

RECEIVED

By Recall Management Division at 12:54 pm, Jun 05, 2012

P: 260-461-1890
W: navistar.com

June 4, 2012

Associate Administrator for Enforcement
National Highway Traffic Safety Administration
1200 New Jersey Avenue, SE
Washington D.C. 20590Subject: Defect Information Report (Initial)
Ref: NHTSA Campaign 12E002 (Braun)

Dear Associate Administrator:

This defect information report is submitted pursuant to Part 573.6(a).

(1) MANUFACTURER'S NAME [Part 573.6(c)(1)]

- Navistar, Inc on behalf of IC Bus, LLC, a wholly owned subsidiary.

(2) IDENTIFICATION OF VEHICLES [Part 573.6(c)(2)]

- Vehicle Type / Make / Model / Model Year Involved:
 - School Bus / IC Bus / CE / 2007, 2009, and 2011
- Vehicle Manufacturing Dates:
 - 01/12/2006 thru 09/08/2009
- Other Identification Necessary to Describe Vehicles:
 - Equipped with feature code 0049DER Braun wheelchair lift.

(3) COMPONENT MANUFACTURER [Part 573.6(c)(2)(iv)]

- This report relates only to a component supplied by Braun Corporation. Contact information is:

Elaine Haschel
Midwest Regional Case Manager
The Braun Corporation
631 W. 11th St.
Winamac, IN. 46996
(800) 488-0359 ext. 3209

(4) *VEHICLE POPULATION INVOLVED [Part 573.6 (c)(3)]*

Type	Make	Model	Number of Suspect Vehicles		
			United States	Canada	Export
School Bus	IC Bus	CE	4	0	0

(5) *PERCENTAGE OF VEHICLES ESTIMATED TO CONTAIN THE DEFECT [Part 573.6 (c)(4)]*

- It is estimated that all (100%) of the vehicles in suspect population could have the defect.

(6) *DESCRIPTION OF DEFECT [Part 573.6 (c)(5)]*

- As reported by Braun Corporation on 01/31/2012, Certain Braun wheelchair lifts, models Century 2 and Vista-2 wheelchair Lifts manufactured from 11/20/2006 thru 09/10/2010, may over time and with frequent use, result in the roll stop latches on the outer barrier becoming bent or misaligned.
- A wheelchair occupant may defeat or ride over the insufficiently latched roll stop. When this occurs when the lift platform is in an elevated position, the wheelchair's occupant could fall and sustain injury.

(7) *CHRONOLOGY OF PRINCIPAL EVENTS WHICH LED TO DETERMINATION OF A SAFETY DEFECT or TEST RESULTS THAT LED TO DETERMINATION OF NONCOMPLIANCE [Part 573.6 (c)(6)/(7)]*

- 04/16/2012 – IC Bus Tulsa, received customer Safety Recall notification letters from Braun Corporation only identifying wheelchair lift model and serial number.
- 05/02/2012 – Navistar Engineering and Compliance met to determine the scope and population of the affected vehicles.
- 05/11/2012 – Navistar determines there are only four units sold to us as confirmed by Braun. We did receive notices from Braun for five units registered as installed in buses branded IC Bus however these buses are manufactured under brand contract and built by Champion Bus. Braun confirms the 5 lifts were sold to Champion Bus.
- 05/24/2012 – Navistar determined that the three delivered buses with affected lifts installed by IC Bus, Tulsa have had the remedy completed. A fourth affected lift was installed into a bus for testing and will not be sold. However Navistar has arranged to have this wheelchair lift remedied as well.
- 05/31/2012 – Navistar determined that the defect as described by Braun could occur in an IC bus application. Navistar also received confirmation from Braun that the three delivered units did have the remedy completed.
- 6/1/2012 – Navistar declares a safety recall.

(8) *PROGRAM TO REMEDY DEFECT [Part 573.6 (c)(8)]*

- Since all delivered buses have been remedied and a remaining bus will not be sold, Navistar does not plan any further notification to these owners.

(9) *PLAN FOR REIMBURSEMENT [Part 573.6 (c)(8)(i)]*

- A plan for reimbursement of pre-notification remedies is not required as all delivered buses have been remedied under the Braun Recall.

(10) SCHEDULE FOR RECALL NOTIFICATION [Part 573.6 (c)(8)(ii)]

- Notification letters will not be required as delivered buses have been remedied under the Braun Recall 12E002.

(11) MANUFACTURER'S CAMPAIGN NUMBER [Part 573.6 (c)(11)]

- A Manufacturer's Campaign number will not be required as all delivered buses have been remedied under the Braun Recall 12E002.

The undersigned should be contacted for any additional information regarding this recall on (260) 461-1890.

Sincerely,



R. L. Van Laar
Compliance Manager
Navistar, Inc.

RV: FI