

SAFETY ADVISORY # 12-186

Springdale Propane Line Relocation

Keystone RV Company is conducting a voluntary RECALL notification campaign in accordance with the National Traffic and Motor Vehicle Safety Act. It has been decided the suspension may contact the copper propane line for the range. If the propane line is damaged and leaks in the presence of an ignition source, an increased risk of fire and/or explosion will result causing property damage and/or personal injury.

- Models Included:** 2012 - 2013 Springdale SG266RLSSRWE
- Serial Number Ranges:** 2012 CG102267 – CG103592
2013 DG100095 – DG102674
- Parts Required:** (1) KRV # 100497 - Fitting - Blk Iron - Elbow - 1/2" - 90 Degree
(1) KRV # 106728 - Fitting - Blk Iron - Nipple - 1/2" x Close
- Tools Required:** - 3/4" Open End Wrench - 13/16 Open End Wrench
- Pipe Wrench - Pipe Joint Compound

REPAIR INSTRUCTIONS

ONE: PREPARING THE TRAILER

Step 1 Locate the trailer on a level, flat and hard surface. Chock the wheels.

TWO: RELOCATE LP GAS LINES

Step 1 Locate the LP gas line distribution manifold mounted on the door side of the unit near the center spring hanger. Inspect the copper gas lines above the shackle links for damage from the shackle links. See figure 1. If the gas line is damaged submit photos with pre-authorization request.

INSPECT FOR
DAMAGED ABOVE
SHACKLE LINKS.



Fig. 1

Step 2

Remove the mounting clamps from the LP manifold to allow the manifold to hang loose so the end fitting can be removed and replaced. Disconnect the copper supply lines from the manifold. Remove the "T" fitting from the manifold. See figure 2 & 3.



Fig. 2

Step 3

Replace the "T" fitting with a 90 degree elbow pointed to the center of the unit. Add a 1/2" close pipe nipple to the elbow. Reinstall the "T" fitting to pipe nipple as shown in Figure 2. Relocate the copper lines to reconnect to manifold. See figure 2 & 3.

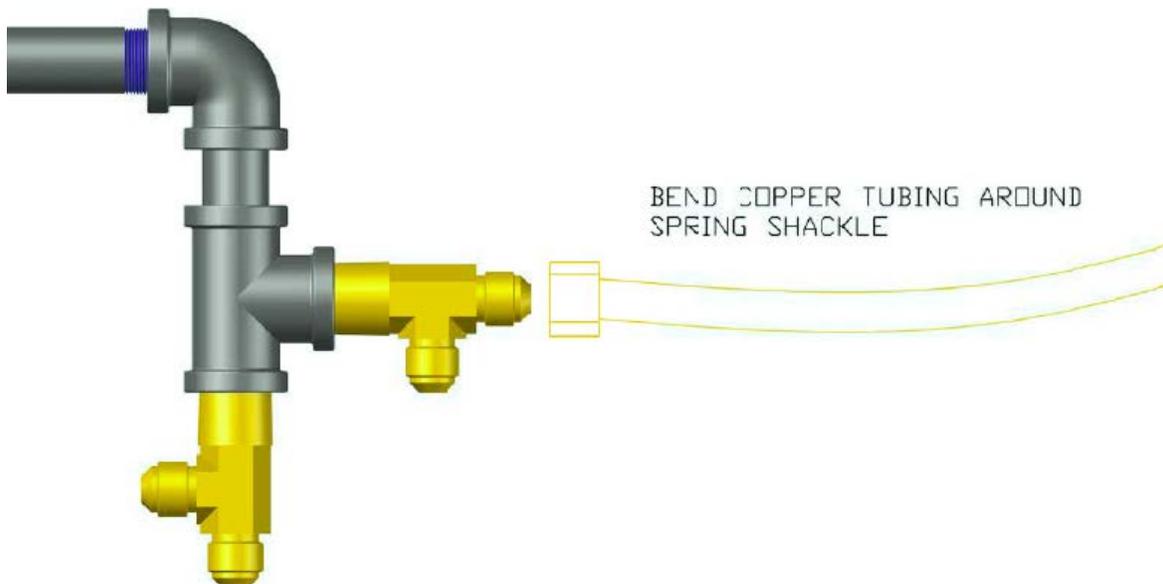


Fig. 3

Step 4

Perform Drop pressure test.

THREE:**WARRANTY REIMBURSEMENT**

Submit the claim on Key Express or on a Keystone Warranty claim form using **Flat Rate Code # 7118642A** with **Service Advisory # 12-186** noted in the customer complaint section of the form. The amount of time authorized for this repair is 1 hour.

Please call Keystone RV Customer Service at **(866) 273-1452** if you have any questions.