

SAFETY RECALL NOTICE

TO: AutoZone, Inc.

NeoSCM Limited (“NeoSCM”) has decided that a safety defect exists in certain replacement brake rotors having a part number of 5399 under the DURALAST brand name (the “5399Rotors”) that were imported by NeoSCM and sold to AutoZone, Inc. (“AutoZone”). The subject 5399 Rotors were manufactured from November 16, 2011 to June 28, 2012 and bear the following Product Date Codes, which are stamped on the rotor hat:

13512	14112	15212	15412	15912	73112	73812	12M12	13B12
13H12	13X12	14A12	14G12	14J12	14M12	15D12	15N12	23F12
23X12	2Z611	43H12	73F12	74G12	7ZN11	BZD11	BZE11	BZG11

Accordingly, a recall to address this issue is being initiated effective as of January 18th, 2013.

The defect involves a design in certain 5399 Rotors which have a narrower bridge between the mounting surface and the braking surface of the rotor than other items having the same part number that came from different manufacturers, or by the same manufacturer using a different design, which provide more thickness in the bridge. The narrow area of the casting can allow for fractures. This design allows the bridge to be approximately 2 mm thinner than the normal thickness when production tolerances are taken into account. In other words, some items may be of normal thickness, but due to normal production tolerances some items may be up to 2 mm thinner than the normal thickness. If the casting fractures, the driver may notice a rattle or clunking noise coming from the front wheel area. In addition, there may be a decrease in braking performance, with more distance required to completely stop the vehicle. The potential decrease in braking performance is indeterminate but might contribute to the possibility of a crash. If the casting fractures while the vehicle is moving it could also result in secondary damage to surrounding vehicle components.

NeoSCM has notified the National Highway Traffic Safety Administration (“NHTSA”) of this recall and information on the recall will be included in the NHTSA’s recall database. We ask that AutoZone post a copy of the attached recall summary on the recall section of AutoZone’s website and at appropriate locations at AutoZone retail stores. There is no cost to owners for this recall.

NeoSCM will supply AutoZone with replacement parts for any customer seeking to return a 5399 Rotor within the scope of this recall an exchange or will reimburse Autozone in the event that the customer returns a 5399 Rotor within this scope of this recall but does not seek a replacement. We ask that AutoZone notify NeoSCM care of the contact indicated below upon the return of a 5399 Rotor within the scope of this recall and NeoSCM will make arrangements to have the

returned 5399 Rotor shipped to NeoSCM and furnish AutoZone with a replacement part or reimbursement for the return.

In the event that the customer already had incurred costs to remedy the defect before becoming aware of the recall, we ask that you provide the customer with the contact information below and NeoSCM will provide reimbursement to the customer for related incurred costs upon furnishing documentation identifying such costs.

Please be reminded that it is a violation of Federal law for you to sell any 5399 Rotor covered by this notification until this recall has been performed on these items of equipment. Substantial civil penalties apply to violations of this law.

Your assistance with this recall is appreciated. Should you have any questions or concerns, please contact Wendell Hays, Sr. Director of Marketing, Neotek Corporation, Inc., 11474 Gulfstream Road, Arlington, TN 38002-9385 [**1-877-978-5490**].