

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING OCTOBER 2016**

*Published November 18, 2016*

**CHILD SEATS:**

None during October 2016.

**EQUIPMENT:**

Christianson Industries, Inc. (Christianson) is recalling certain aluminum black ladders manufactured July 8, 2014 to August 31, 2015, sold for installation on Toy Hauler recreational vehicles. The affected ladders have retractable hinges, each with a welded 'top hat' that can separate from the hinge. If the hinges separate from the ladder while in use, the ladder may fall from the vehicle, increasing the risk of injury. Christianson will notify the purchasers of the ladders and provide a repair kit for the ladders for dealers to install, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Christianson's customer service number at 1-269-663-8502.

**16E-077**

Lippert Components, Inc. (LCI) is recalling certain Sway Command anti-sway tow controllers, part number 0271841, manufactured January 5, 2016, to July 19, 2016 and sold for use with model year 2014-2016 GM trucks. The use of LCI's Sway Command with these trucks that are equipped with the Integrated Trailer Brake Control Module (ITBCM) could cause reduced braking effectiveness or a loss of brake control when towing a trailer. Reduced or complete loss of braking control can increase the risk of a crash. LCI will notify owners and will replace the current controller with an updated controller with correct programming, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact 1-574-537-8900. LCI's number for this recall is LCI-68-092016.

**16E-078**

Atwood Mobile Products (Atwood) is recalling certain left side seat adjusters, model numbers 486059, 486053, 486077, 487952, and 486954, used in All Belts to Seats (ABTS) applications, manufactured June 14, 2016, to August 31, 2016. The affected seat adjusters may allow seats to move in the event of a crash. As such, these adjusters fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 210, "Seat Belt Assembly Anchorages." If the seat moves in the event of a crash, the seat occupant would be at an increased risk of injury. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Atwood customer service at 1-574-264-2131.

**16E-079**

Ivolution Sports Inc. (Ivolution) is recalling certain IV2 JX-SKY 3/4 open face helmets manufactured October 16, 2015, to November 12, 2015. The affected helmets have a detachable Skull Mohawk portion that was affixed with a metal screw instead of a plastic screw, preventing the Mohawk from easily detaching in the event of a crash. As such, these helmets fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 218, "Motorcycle Helmets." If the Mohawk feature of the helmet does not detach in the event of a crash, the rider could be at an increased risk of neck injury. Ivolution will notify owners, and provide a full refund for all returned helmets. The manufacturer has not yet provided a notification schedule. Owners may contact Ivolution customer service at 1-951-852-6327.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING OCTOBER 2016**

*Published November 18, 2016*

**16E-080**

Vega Helmet Corporation (Vega) is recalling certain motorcycle half helmets, models XTA and XTA Touring in sizes L, XL, and XXL, manufactured from February 2013 through December 2014. The affected helmets may not adequately protect the user's head in the event of an impact such as can happen during a crash. As such, these helmets fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 218, "Motorcycle Helmets." In the event of a crash, the helmet may not adequately protect the wearer increasing the risk of injury. Vega will notify owners, and provide a full refund or a free replacement helmet. The recall is expected to begin December 16, 2016. Owners may contact Vega helmet customer service at 1-800-728-4898.

**16E-081**

**TIRES:**

Continental Tire the Americas, LLC (Continental) is recalling certain Crosscontact LX20 tires, size P275/55R20 111S, manufactured May 3, 2015, to May 9, 2015. The tires, sold as replacement tires as well as original equipment on certain General Motors full size trucks and SUVs, may have insufficient adhesion within the belt package, resulting in tread wear, vibration, noise, or bulging areas on the tire. The insufficient adhesion can cause partial or full tread/belt loss, increasing the risk of a crash. Continental will notify owners, and dealers will replace the tires, free of charge. The recall began on November 11, 2016. Owners may contact Continental customer service at 1-888-799-2168.

**16T-016**

GITI Tire (USA) Ltd. (GITI) is recalling certain imported Primewell Valera Touring II tires, sizes 205/50R17 93V XL, 215/50R17 95V XL, 225/50R17 94V, 225/50R18 95T, and 205/65R16 95H, GT Radial Champiro Touring A/S tires, sizes 205/50R17 93V XL, 215/50R17 95V XL, 225/50R17 94V, 205/65R16 95H, and 225/50R18 95T, and Dextero Touring DTR1 tires, sizes 205/50R17 93V XL, 215/50R17 95V XL, 225/50R17 94V, manufactured by PT. Gajah Tunggal TBK in Indonesia. The affected replacement passenger car tires may develop cracks in the lower sidewall, potentially resulting in a loss of air. A loss of air pressure may result in sudden tire failure, increasing the risk of a crash. GITI will notify owners, and dealers will replace the affected tires, free of charge. The recall began on October 24, 2016. Owners may contact GITI customer service at 1-877-342-0882.

**16T-017**

**VEHICLES:**

BMW of North America, LLC (BMW) is recalling one model year 2017 BMW X3 xDrive 28i vehicle manufactured on June 7, 2016. This vehicle has electronic power steering (EPS), and the contact pins on the EPS control unit may not have been welded properly resulting in increased resistance. An increase in pin contact resistance can increase the risk of a fire, even while the vehicle is parked and ignition is off. The vehicle was repaired at the dealership before sale. Therefore, an owner notification notice will not be issued for this

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING OCTOBER 2016**

*Published November 18, 2016*

campaign. Owners may contact BMW customer service at 1-800-525-7417.

**16V-704**

Kia Motors America (Kia) is recalling certain model year 2016 Kia Optima vehicles manufactured November 13, 2015, to April 23, 2016. The right front axle driveshaft may exhibit cracks at the wheel end area. These cracks can cause loud noises or lead to shaft separation. If the driveshaft cracks and separates from the vehicle, it will increase the risk of a crash. Kia will notify owners, and dealers will replace the front axle driveshaft, free of charge. The recall is expected to begin November 29, 2016. Owners may contact Kia customer service at 1-800-333-4542. Kia's number for this recall is SC139.

**16V-705**

Fontaine Modification (Fontaine) is recalling certain model year 2013-2017 Fontaine-modified Peterbilt 220 and Kenworth 370 dual-steer vehicles manufactured September 30, 2013, to August 22, 2016. The right hand side steering may fail due to an improperly press-fitted steering shaft. Loss of steering control can increase the risk of a crash. Fontaine will notify owners, and dealers will replace the steering shaft, free of charge. The recall began on November 2, 2016. Owners may contact Fontaine customer service at 1-704-409-1614.

**16V-706**

Daimler Trucks North America, LLC (DTNA) is recalling certain model year 2017 Freightliner Custom Chassis (FCCC) S2 bus chassis manufactured November 25, 2015, through April 27, 2016. The brake transmission shift interlock feature may be inoperable making it possible to shift into a drive gear without first pressing the brake pedal. This condition can result in the vehicle moving unintentionally or rolling away, increasing the risk of injury or a crash. DTNA will notify owners, and dealers will update the vehicle's software, free of charge. The recall is expected to begin December 1, 2016. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-726.

**16V-707**

REV Ambulance Group Orlando, INC. (REV) is recalling certain model year 2010-2016 Road Rescue Specialty Vehicles, as well as Ultramedic, Promedic, Duramedic, Metromedic, and Transmedic emergency vehicles equipped with Class 1 Ultraview Touchscreens manufactured by Hale Products. These touchscreens may experience false switch activations that can happen without the operator's knowledge causing accessories to turn on or off, affecting vehicle performance. The unintended turning on or off of accessories such as emergency beacons or automatic snow chains can increase the risk of a crash. REV will notify owners, and dealers will upgrade the software or retrofit fuses, free of charge. The recall is expected to begin during November 2016. Owners may contact REV customer service at 1-800-628-8178 or Hale Products Customer Service Center at 1-800-533-3569 or [halecustomerservice@idexcorp.com](mailto:halecustomerservice@idexcorp.com).

**16V-708**

Universal Trailer Cargo Group, Inc. (UTC Group) is recalling certain model year 2015-2016 Haulmark and Wells Cargo Aluminum Snowmobile trailers, models HAS85X16DT2, HAS85X20DT2, HAS85X22DT2, HAS85X24DT2, WAS85X1622, WAS85X2022 and WAS85X2422, manufactured June 18, 2015, to September 23, 2016. Cross winds may result in the trailers tipping or lifting, possibly causing the couplers to

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING OCTOBER 2016**

*Published November 18, 2016*

tear. If the coupler tears, the trailer can separate from the tow vehicle, increasing the risk of a crash. UTC Group will notify owners, and dealers will attach a reinforcement plate assembly and extra coupler tube to each trailer, free of charge. The recall began on October 26, 2016. Owners may contact UTC Group customer service at 1-574-264-9661. UTC Group's number for this recall is ID119915.

**16V-709**

Altec Industries Inc (Altec) is recalling certain model year 2014-2015 A65, A70, A75, A72-T, A77-T, and A82-T aerial devices manufactured April 15, 2014, to October 15, 2015. The affected aerial devices have a fiberglass cover over the boom tip that may have an improperly sized opening. The improperly sized opening may allow the exposed metal tip of the boom to contact an electrically energized conductor, such as an overhead wire, increasing the risk of a injury to the boom operator. Altec will notify owners, and dealers will replace any boom tip cover that has an improperly sized opening, free of charge. The recall is expected to begin during November 2016. Owners may contact Altec customer service at 1-205-991-7733.

**16V-710**

Daimler Trucks North America LLC (DTNA) is recalling certain model year 2014-2017 Western Star 4900 and 5700 trucks manufactured March 22, 2013, to September 23, 2016 and equipped with a Stratosphere sleeper cab. The seat belt mounting plate may have a drill hole that is too large. If the plate has a hole that is too big, the plate may fail when it stressed such as in the event of a crash, preventing the seat belt from adequately restraining the seat occupant, increasing the risk of injury. DTNA will notify owners, and dealers will reinforce the seat belt mounting plate, free of charge. The recall is expected to begin December 1, 2016. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-725.

**16V-711**

Daimler Trucks North America, LLC (DTNA) is recalling certain model year 2017 Thomas Built Buses Saf-T-Liner C2 school bus chassis manufactured November 25, 2015, through April 27, 2016. The brake transmission shift interlock feature may be inoperable making it possible to shift into a drive gear without first pressing the brake pedal. This condition can result in the vehicle moving unintentionally or rolling away, increasing the risk of injury or a crash. DTNA will notify owners, and dealers will update the vehicle's software, free of charge. The recall is expected to begin December 1, 2016. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-726.

**16V-712**

Jayco, Inc. (Jayco) is recalling certain model year 2017 Seismic travel trailers manufactured November 19, 2015, to August 19, 2016. The affected vehicles may be equipped with an underrated resettable fuse for the awning with LED lights. The incorrect fuse may not properly protect the circuit, allowing an electrical short to occur and increasing the risk of a fire. Jayco will notify owners, and dealers will replace the fuse with the correct 1.85 amp hold/3.70 amp trip fuse, free of charge. The recall began on November 3, 2016. Owners may contact Jayco customer service at 1-800-283-8267. Jayco's number for this recall is 9901321.

**16V-713**

Mack Trucks, Inc. (Mack) is recalling certain model year 2017 Pinnacle CHU and CXU trucks manufactured

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING OCTOBER 2016**

*Published November 18, 2016*

March 9, 2016, to May 19, 2016 and equipped with Goodyear G399A LHS 295/75R22.5 LRG tires. The tires on the affected vehicles may have cured improperly causing an incomplete adhesion, possibly resulting in a partial tread separation. Partial tread separation can increase the risk of a crash. Mack will notify owners, and dealers will inspect the tires. If the tires are of the suspected lot, they will be replaced, free of charge. The recall began on November 7, 2016. Owners may contact Mack customer service at 1-800-866-1177. Mack's number for this recall is SC0405.

**16V-714**

Newmar Corporation (Newmar) is recalling certain model year 2017 Newmar King Aire, Essex, London Aire, and Mountain Aire motorhomes manufactured May 12, 2016, to August 23, 2016 and built on a Spartan Motors chassis. The affected vehicles have a power steering pump that may have an occasional loss of output power resulting in reduced or intermittent loss of power steering assist. An intermittent loss of power steering assist could increase the risk of a crash. Newmar will notify owners, and Spartan Motors dealers will replace the power steering pump, free of charge. The recall began on October 26, 2016. Owners may contact Spartan Motors customer service at 1-800-543-4277 or Newmar customer service at 1-800-731-8300. Newmar's number for this recall is 16V 676.

**16V-715**

Subaru of America, Inc. (Subaru) is recalling certain model year 2017 Legacy and Outback vehicles manufactured September 21, 2016, to September 23, 2016. In the affected vehicles, the knee guard bracket may not be properly attached to the steering beam assembly. If the knee guard is not properly attached and the driver is not wearing a seatbelt, the knee guard may not be able to properly restrain the driver's lower body in the event of a crash, increasing the risk of injury. Subaru will notify owners, and dealers will inspect the knee guard welding on each vehicle's steering beam, replacing the beam as necessary, free of charge. The recall began November 14, 2016. Owners may contact Subaru customer service at 1-800-782-2783. Subaru's number for this recall is WTL-72.

**16V-716**

Grand Design RV, LLC (Grand Design) is recalling certain model year 2015-2017 Reflection recreational trailers, model 357BHS and 367BHS, manufactured November 12, 2014, to September 22, 2016. The affected vehicles have an incorrect Gross Axle Weight Rating (GAWR) on the Federal Certification Label, stating a GAWR of 7,000 lbs when the actual GAWR is 6,400 lbs. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." If the operator loads the vehicle to the GAWR on the label, it can cause a loss of vehicle control, increasing the risk of a crash. Grand Design will notify owners, and dealers will install a corrected Federal Certification Label, free of charge. Owners will also have the option to replace the Certification Label free of charge. The recall began on October 28, 2016. Owners may contact Grand Design customer service at 1-574-825-9679. Grand Design's number for this recall is 910007.

**16V-717**

REV Ambulance Group Orlando, INC (REV) is recalling certain model year 2016-2017 Marque Type III, Road Rescue Type I, Road Rescue Type III, Wheeled Coach Type I, Wheeled Coach Type III, Frontline Type I, Frontline Type III, McCoy Miller Type I, and McCoy Miller Type III ambulances manufactured January 1,

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING OCTOBER 2016**

*Published November 18, 2016*

2016, to September 30, 2016. Due to a problem with the seat tracks, the attendant seat(s) on the affected vehicles may unexpectedly move in a rapid deceleration event such as a crash. In the event of a crash, the seat may move forward at a high rate of speed, increasing the risk of injury to the seat occupant. REV will notify owners, and dealers will replace the seat tracks, free of charge. The recall is expected to begin during November 2016. Owners may contact REV customer service at 1-800-628-8178.

**16V-718**

Winnebago Towable (Winnebago) is recalling certain model year 2016-2017 Winnebago Winnie Drop, Micro Minnie, Minnie, Minnie Plus, Spyder, Scorpion, Destination, Instinct, and Voyage travel trailers manufactured November 9, 2015, to September 6, 2016. The weight label on the affected vehicles incorrectly states the fresh water capacity in gallons when it should be stated in pounds. The incorrect information may cause the trailer to be overloaded, possibly resulting in a loss of control and increasing the risk of a crash. Winnebago will notify owners, and dealers will replace the incorrect weight labels with corrected labels, free of charge. The recall is expected to begin during November 2016. Owners may contact Winnebago owner relations at 1-574-825-5250 extension 5220.

**16V-719**

Autocar, LLC (Autocar) is recalling certain model year 2015-2017 Xpeditor vehicles manufactured March 2, 2015, to September 22, 2016. The castle nuts on the steering linkage assembly may not have been tightened properly. If the castle nuts were not properly tightened, the cotter pin could shear and the steering linkage assembly components could separate, resulting in the loss of steering and increasing the risk of a crash. Autocar will notify owners, and dealers will tighten the steering linkage castle nuts, as necessary, free of charge. The recall is expected to begin during November 2016. Owners may contact Autocar customer service at 1-888-218-3611. Autocar's number for this recall is ACX-1604.

**16V-720**

Newmar Corporation (Newmar) is recalling certain model year 2015 Dutch Star motorhomes manufactured July 24, 2014, to September 10, 2014 and built on a Freightliner Custom Chassis Corporation (FCCC) XCM, XCR, or XCL motorhome chassis. In these vehicles with a heavier, adjustable, straight foot pedal, the brake activation signal to certain towed devices may not deactivate when the motorhome service brakes are released. If the brake activation signal to a towed device remains active when the motorhome chassis service brakes are released, the brakes on a towed device may remain engaged depending on brake configuration of the trailer. As a result, the brakes would drag and possibly overheat potentially resulting in a fire. Additionally, following drivers may be confused by the motorhome's actions, increasing the risk of a crash. Newmar will notify owners, and Freightliner dealers will modify the affected pedal assemblies, free of charge. The recall is expected to begin December 5, 2016. Owners may contact Newmar customer service at 1-800-731-8300. Newmar's number for this recall is 16V 654.

**16V-721**

Hyundai Motor America (Hyundai) is recalling certain model year 2010-2016 Genesis Coupe vehicles manufactured December 12, 2008, to June 11, 2016. The electrical harness connector for the front passenger seat Occupant Classification System (OCS) may dislodge when the seat is moved. In the event of a crash

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING OCTOBER 2016**

*Published November 18, 2016*

necessitating deployment of the passenger frontal air bag, the disconnected OCS would, by default, cause the first stage, and only the first stage, of the air bag to deploy, whether there is a child seat in the front seat and the bag should not deploy or if the crash is severe and both stages should deploy. Either scenario increases the risk of injury to the front seat occupant. Hyundai will notify owners, and dealers will secure the OCS connector to prevent it from disconnecting, free of charge. The recall is expected to begin December 2, 2016. Owners may contact Hyundai customer service at 1-855-371-9460. Hyundai's number for this recall is 151.

**16V-722**

Autocar Industries, LLC (Autocar) is recalling certain model year 2015-2017 Xspotter and Xpert vehicles manufactured March 2, 2015, to September 22, 2016. The castle nuts on the steering linkage assembly may not have been tightened properly. If the castle nuts were not properly tightened, the cotter pin could shear and the steering linkage assembly components could separate, resulting in the loss of steering and increasing the risk of a crash. The remedy for this recall campaign is still under development. The recall is expected to begin during November 2016. Owners may contact Autocar customer service at 1-888-218-3611. Autocar's number for this recall is MDTT-1602.

**16V-723**

Nissan North America, Inc. (Nissan) is recalling certain model year 2017 Versa vehicles manufactured August 1, 2016, to August 16, 2016. A seam in the fabric section of the side curtain air bags may tear during side curtain air bag deployment, potentially affecting the performance of the air bag. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 226, "Ejection Mitigation", and number 214, "Side Impact Protection." In the event of a crash necessitating side curtain air bag deployment, if the side curtain air bags do not deploy as intended there would be an increased risk of injury. Nissan will notify owners, and dealers will replace the left and right side curtain air bags, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Nissan customer service at 1-800-647-7261.

**16V-724**

Honda (American Honda Motor Co.) is recalling certain model year 2016 Honda Civic two door and four door 1.5L turbo and 2.0L vehicles. The electric parking brake (EPB) may not engage if it is applied immediately after turning the ignition off. If the EPB is not applied, the vehicle may roll away, increasing the risk of a crash. Honda will notify owners, and dealers will update the vehicle's software to allow the EPB to engage immediately after the ignition is turned off, free of charge. The recall began on November 8, 2016. Owners may contact Honda customer service at 1-888-234-2138. Honda's number for this recall is KC6.

**16V-725**

Hyundai Motor America (Hyundai) is recalling certain model year 2015-2016 Sonata Hybrid vehicles manufactured December 8, 2014, to August 18, 2015, and Hyundai Sonata vehicles manufactured May 28, 2014, to March 18, 2016, equipped with the panoramic sunroof option. Due to a bonding issue with the sunroof wind deflector, the sunroof panel on the affected vehicles may detach while driving. If the sunroof detaches from the vehicle it could become a road hazard, increasing the risk of a crash. Hyundai will notify owners, and dealers will repair the wind deflector anchor plate, free of charge. The recall is expected to begin December 2, 2016. Owners may contact Hyundai customer service at 1-800-633-5151. Hyundai's number for this recall is 152.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING OCTOBER 2016**

*Published November 18, 2016*

**16V-726**

Keystone RV Company (Keystone) is recalling certain model year 2017 Dutchmen Coleman recreational trailers, models 1805RB, 3025RE, 2305QB, 3015BH, 262BH and 2605RL, manufactured September 15, 2016, to September 27, 2016. Wiring in the power center may be loose and some wires may be frayed. Loose or frayed wiring may increase the risk of a fire. Keystone has notified owners, and dealers will inspect the wiring in the power center, correcting it as necessary, free of charge. The recall began on October 17, 2016. Owners may contact Keystone customer service at 1-574-535-2100. Keystone's number for this recall is 16-266.

**16V-727**

Forest River, Inc. (Forest River) is recalling certain model year 2017 Flagstaff and Rockwood trailers equipped with two air conditioners. There is may be excess slack in the wiring harness used in the air conditioner that contains a heating element. If the wires are not tied back and properly secured away from the heating element, the wires may contact the heating element, melt and short, increasing the risk of a fire. Forest River will notify owners, and dealers will install a remedy kit to constrain the wires, free of charge. The recall began on November 1, 2016. Owners may contact Forest River customer service at 1-574-642-5164. Forest River's number for this recall is 10-10062016-0254.

**16V-728**

Ducati North America (Ducati) is recalling certain model year 2016-2017 XDiavel motorcycles manufactured July 7, 2015, to June 22, 2016. The side stand plate lower fastening screw on the affected motorcycles may not be sufficiently tightened, causing the stand to fail and the bike to fall. Additionally, during normal use on the road, the loosening of the lower screw could cause damage to the side stand sensor switch, causing the engine to stall. If the lower stand place screw becomes loose it can cause the bike to fall, or the engine to stall, increasing the risk of injury or a crash. Ducati will notify owners, and dealers will replace the side stand pivot and side stand plate fastening screw, free of charge. The recall began November 7, 2016. Owners may contact Ducati customer service at 1-800-231-6696. Ducati's number for this recall is RCL-16-003(B).

**16V-729**

ShowHauler Trucks, Inc. (ShowHauler) is recalling certain model year 2014-2015 Garagecoaches manufactured September 25, 2014, to July 7, 2015. The affected vehicles are equipped with Thieman Tailgates-brand TVL 12/16 series lift gates supported with roller chains that may fail. Failure of either the street or curb side roller chain would result in that side of the platform falling immediately to the ground without notice, causing an uneven surface and increasing the risk of injury. ShowHauler will notify owners, and Thieman dealers will replace the lift gate chains, free of charge. The recall began on October 20, 2016. Owners may contact Thieman customer service at 1-800-524-5210 extension 104 or ShowHauler customer service at 1-574-825-6764. ShowHauler's number for this recall is 16E076.

**16V-730**

Ford Motor Company (Ford) is recalling certain model year 2017 Lincoln Continental vehicles manufactured June 14, 2016, to September 23, 2016 and equipped with high intensity discharge (HID) headlights. The headlights may have been built with incorrect lenses, adversely affecting the turn signal visibility as well as not

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING OCTOBER 2016**

*Published November 18, 2016*

being properly marked. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Assoc. Equipment." Reduced turn signal visibility to other drivers and pedestrians can increase the risk of a crash. Ford will notify owners, and dealers will inspect the headlights, replacing them as necessary, free of charge. The recall is expected to begin November 7, 2016. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 16C15.

**16V-731**

Forest River, Inc. (Forest River) is recalling certain model year 2016-2017 Coachmen Galleria recreational vehicles, manufactured October 27, 2015, through August 31, 2016. The affected vehicles have an incorrect Cargo Carrying Capacity Federal placard indicating two seat-belted locations when the vehicle has up to five additional designated seating areas, causing the cargo capacity listed to be inaccurate. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." The incorrect cargo capacity information may result in the vehicle being overloaded, increasing the risk of a crash. Forest River will notify owners, and dealers will adhere a corrected Federal Placard, free of charge. The recall is expected to begin on December 5, 2016. Owners may contact Forest River customer service at 1-574-825-8628. Forest River's number for this recall is 225-10062016-0253.

**16V-732**

Ford Motor Company (Ford) is recalling certain model year 2015-2016 Ford Edge vehicles manufactured February 9, 2015, to August 12, 2016. During dealer servicing, the affected vehicles may be have been updated with incorrect Antilock Brake System (ABS) and Electronic Stability Control (ESC) software. This software can cause the ESC system to lose engine torque control, and not provide any warning lamps to warn the driver if there was an ABS or ESC system malfunction. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 126, "Electronic Stability Control Systems" and number 135, "Light Vehicle Brake Systems." If the operator is not warned of an ABS or ESC malfunction and the ESC loses engine torque control, there would be an increased risk of a crash. Ford will notify owners, and dealers will replace the ABS module, and update the service software, free of charge. The recall is expected to begin November 28, 2016. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 16C14.

**16V-733**

Chrysler (FCA US LLC) is recalling certain model year 2016-2017 Jeep Wrangler vehicles manufactured June 16, 2015, to August 14, 2016. In certain crash conditions, the front impact sensor wiring may be pulled until it detaches before a signal can be received by the Occupant Restraint Controller (ORC). If the ORC module does not receive a signal from the front impact sensor, both frontal air bags and the seat belt pretensioners will not deploy in the event of a crash, increasing the risk of injury. Chrysler will notify owners, and dealers will reroute the front impact sensor wiring and relocate the impact sensor branch, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is S76.

**16V-734**

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING OCTOBER 2016**

*Published November 18, 2016*

Volvo Trucks North America (Volvo) is recalling certain model year 2009-2016 VHD trucks manufactured from April 7, 2008, through December 9, 2015, equipped with USK non-greasable drag links. The ball joint seals may be compromised, which can allow water and other contaminants to enter the ball joints. If water and contaminants enter the ball joint, corrosion can occur and lead to accelerated wear, which over time can result in failure of the ball joint, possibly resulting in complete loss of steering, increasing the risk of a crash. Volvo will notify owners, and dealers will replace the drag links, free of charge. The recall is expected to begin on December 9, 2016. Owners may contact Volvo customer service at 1-800-528-6586. Volvo's number for this recall is RVXX1606.

**16V-735**

Chrysler (FCA US LLC) is recalling certain model year 2016 Dodge Viper vehicles manufactured May 24, 2016, to August 28, 2016. The wires for the driver's frontal air bag may be pinched. If the driver's air bag wires are pinched, the air bag may not deploy properly in the event of a crash necessitating air bag deployment, increasing the risk of injury. Dodge will notify owners, and dealers will replace the driver's frontal air bag and clockspring, free of charge. The recall is expected to begin on November 18, 2016. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's recall number for this recall is S75.

**16V-736**

E-One Incorporated (E-One) is recalling certain model year 2012-2016 E-One Pumpers manufactured January 1, 2012, to June 23, 2016 and built on a Ford F-550 chassis modified to be equipped with driveline-driven ("split-shaft") pumps. The bearings and drive shafts of the pumps may loosen due to high vibration levels, such as those created when the vehicle is driven above 65 MPH. If the bearings or drive shafts loosen, parts may fall from the vehicle becoming road hazards, the pump may not function to assist in fire fighting or there may be a loss of vehicle control, increasing the risk of a crash. E-One will notify owners, and Ford dealers will recalibrate the vehicle to be speed limited to 65 MPH, free of charge. The recall is expected to begin November 28, 2016. Owners may contact E-One customer service at 1-352-861-3612.

**16V-737**

Subaru of America, Inc. (Subaru) is recalling certain model year 2007-2009 model year Legacy and Outback vehicles, 2008-2014 Impreza vehicles and 2009-2013 Forester vehicles, all equipped with turbo-charged engines. The relay that controls the secondary air injection pump may fail, causing the pump to continuously operate and overheat. If the air injection pump overheats, it may melt and increase the risk of a fire. Subaru will notify owners, and dealers will replace the secondary air injection pump relay, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Subaru customer service at 1-800-782-2783. Subaru's number for this recall is WTM-73.

**16V-738**

Chrysler (FCA US LLC) is recalling certain model year 2011-2014 Dodge Charger Police vehicles, 2007-2013 RAM 3500 Cab Chassis, 2008-2013 RAM 4500 and 5500 Cab Chassis, and 2013 RAM 2500 and 3500 vehicles. The affected vehicles have a 220 amp alternator that may suddenly fail. If the alternator fails, the vehicle may stall without warning, increasing the risk of a crash. There is also the possibility that the alternator may short circuit, increasing the risk of a fire. Chrysler will notify owners, and dealers will replace the alternator with a

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING OCTOBER 2016**

*Published November 18, 2016*

revised alternator, free of charge. Parts are not currently available, but beginning on November 25, 2016 owners will be notified of the recall and they will be sent a second letter when remedy parts are available. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is S68.

**16V-739**

Morbark, Inc. (Morbark) is recalling certain model year 2008-2016 Beaver wood chippers, models M15R, M15RX, M18R, M18RX and M20R, manufactured January 5, 2008, to October 3, 2016. The side marker lights on the affected vehicles may be mounted too high to be easily seen. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." Side marker lights in an incorrect location may increase the risk of a crash. Morbark will notify owners, and dealers will relocate the rear side marker lights, free of charge. The recall is expected to begin December 12, 2016. Owners may contact Morbark customer service at 1-517-866-2381.

**16V-740**

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain model year 2016-2017 Prius vehicles manufactured August 6, 2015, to October 3, 2016. The affected vehicles are equipped with a foot-operated parking brake system that has a parking brake cable that may disengage. If the parking brake cable disengages from the mechanism and the transmission is left in a gear other than 'Park' while the ignition is on and the driver leaves the vehicle, the vehicle may roll unexpectedly, increasing the risk of a crash. Toyota will notify owners, and dealers will install a clip at the parking brake cable end to prevent the cable from disengaging, free of charge. The recall began November 10, 2016. Owners may contact Toyota customer service at 1-888-270-9371. Toyota's number for this recall is G01.

**16V-741**

Supreme Corporation (Supreme) is recalling certain model year 2014-2015 Spartan Service Body, Signature Van, Iner-City and Kold King vehicles. The affected vehicles are equipped with equipped with Thieman Tailgates-brand TVL 12/16 series lift gates supported with roller chains that may fail. Failure of either the street or curb side roller chain would result in that side of the platform falling immediately to the ground without notice, causing an uneven surface and increasing the risk of injury. Supreme will notify owners, and Thieman dealers will inspect and repair the lift gates, as necessary, free of charge. The recall is expected to begin during November 2016. Owners may contact Supreme customer service at 1-800-842-4889.

**16V-742**

Seagrave Fire Apparatus, LLC (Seagrave) is recalling one model year 2010 Seagrave Heavy Rescue Body Fire Truck manufactured January 5, 2010, to January 19, 2015 and built on a Spartan Motors Metro Star chassis. In the affected vehicle, the power steering fluid may overheat and cause the steering to unexpectedly lock during steering maneuvers. If the steering locks, there could be a loss of control of the vehicle, increasing the risk of a crash. Seagrave has notified the owner, and a Spartan Motors service provider will install a cooler to prevent the steering fluid from overheating, free of charge. The recall began October 21, 2016. Owners may contact Seagrave customer service at 1-715-823-2141 or Spartan Motors USA, Inc. at 1-800-543-5008. Seagrave's number for this recall is 15V-687/RSB16-260-00.

**16V-743**

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING OCTOBER 2016**

*Published November 18, 2016*

Newmar Corporation (Newmar) is recalling certain model year 2012-2017 Canyon Star motor homes manufactured September 7, 2011, to September 6, 2016 and equipped with wheelchair lifts. Incorrect bolts may have been used to install the wheelchair lift base. These bolts may unexpectedly break allowing the lift to move. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 404, "Platform Lift Installations." Unintentional movement of the wheelchair lift can cause injury to the lift occupant and/or the lift operator. Newmar will notify owners, and Newmar service facilities will replace the wheelchair lift base mounting bolts, free of charge. The recall began on October 28, 2016. Owners may contact Newmar customer service at 1-800-731-8300.

**16V-744**

Entegra Coach (Entegra) is recalling certain model year 2017 Cornerstone motorhomes manufactured April 13, 2016, to August 25, 2016. The affected vehicles have a power steering pump that may have an occasional loss of output power resulting in reduced or intermittent loss of power steering assist. An intermittent loss of power steering assist could increase the risk of a crash. Entegra will notify owners, and Qualified Spartan Service Centers will replace the power steering pumps, free of charge. The recall began on November 10, 2016. Owners may contact Entegra customer service at 1-800-945-4787. Entegra's number for this recall is 9903325.

**16V-745**

BMW of North America, LLC (BMW) is recalling certain model year 2007-2011 BMW X5 3.0si, X5 4.8i, X5 M, X5 xDrive30i, X5 xDrive35i, X5 xDrive48i and X5 xDrive50i, 2008-2011 X6 x Drive35i, X6 xDrive50i and X6 M, 2010-2011 X6 ActiveHybrid, 535i xDrive Gran Turismo, 535i Gran Turismo, 550i xDrive Gran Turismo and 550i Gran Turismo, 2011-2012 528i, 535i, 535i xDrive, 550i and 550i xDrive and 2012 535i ActiveHybrid, 640i Convertible, 650i Convertible, 650i xDrive Convertible, 650i Coupe and 650i Coupe xDrive vehicles. The affected vehicles have in-tank fuel pumps that may have insufficiently crimped wire contacts. The loose wires may cause the connector to melt, resulting in a fuel leak. Additionally, the fuel pump may stop working, possibly causing an engine stall and increase the risk of a crash. BMW will notify owners, and dealers will replace the fuel pump module, free of charge. The recall is expected to begin December 5, 2016. Owners may contact BMW customer service at 1-800-525-7417.

**16V-746**

Jayco, Inc. (Jayco) is recalling certain model year 2017 Jay Sport camping trailers manufactured March 31, 2016, to September 30, 2016 and equipped with the Baja Option. The inside walls of the tires on the affected vehicles may rub against the wheel wells, possibly resulting in a tire blowout. A tire blowout may increase the risk of a crash. Jayco will notify owners, and dealers will replace the axle and wheel wells and labels, free of charge. The recall began on November 10, 2016. Owners may contact Jayco customer service at 1-800-283-8267. Jayco's number for this recall is 9901326.

**16V-748**

Forest River, Inc. (Forest River) is recalling certain model year 2016-2017 StarTrans P/S2 transit buses manufactured January 19, 2016, to May 2, 2016, and model year 2016-2017 Glaval Legacy transit buses manufactured November 9, 2015, to August 4, 2016, equipped with ICU3 instrument clusters and hydraulic

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING OCTOBER 2016**

*Published November 18, 2016*

brakes. In the event of a brake malfunction, these clusters may illuminate the Brake System Malfunction telltale/indicator lamp with the word "PARK" instead of the word "BRAKE". As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 101, "Control and Displays," and number 105, "Hydraulic and Electric Brake Systems." If the word "PARK" illuminates instead of the word "BRAKE," the driver may be unaware of a braking issue or malfunction, increasing the risk of a crash. Forest River will notify owners, and Daimler Trucks North America LLC (DTNA) authorized service facilities will replace the ICU3 dash instrument clusters, free of charge. The recall is expected to begin December 5, 2016. Owners may contact StarTrans customer service at 1-574-642-3112, Glaval customer service at 1-574-343-5167, or DTNA customer service at 1-800-547-0712. Forest River's number for this recall is 51-10022016-0252.

**16V-749**

Chrysler (FCA US LLC) is recalling certain 2016 MY Dodge Viper vehicles manufactured January 6, 2016, to January 8, 2016. A defective vibration weld on the passenger airbag chute may cause the passenger air bag door to detach during the air bag deployment. If the air bag door detaches during deployment, there is an increased risk of injury to vehicle occupants. Chrysler will notify owners, and dealers will replace the passenger side upper panel assembly, free of charge. The recall is expected to begin on November 25, 2016. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is S77.

**16V-750**

Forest River, Inc. (Forest River) is recalling certain model year 2016-2017 Surveyor recreational vehicles, model ORSVT247BHDS, manufactured August 10, 2016, to September 13, 2016. The Federal Placard installed on the vehicles indicate an incorrect tire and rim combination. The Federal Placard states that the trailer is equipped with ST225/75R15D tires with 65 PSI and a rim designation of 15X6.0JJ, when actually they have ST205/75R14C tires with 50 PSI and a rim designation of 14X5.5JJ. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims." The operator may over-inflate the tire based on the information printed on the Federal Placard. Overinflating a tire may lead to pre-mature tire degradation, a tire blowout, or reduced handling, increasing the risk of a crash. Forest River will notify owners and dealers and will provide a corrected Federal Placard, free of charge. The recall is expected to begin December 12, 2016. Owners may contact Forest River customer service at 1-574-642-3119 extension 205. Forest River's number for this recall is 37-10132016-0256.

**16V-751**

Polaris Industries, Inc. (Polaris) is recalling certain model year 2016-2017 Slingshot motorcycles manufactured December 28, 2015, to April 27, 2016. The brake pressure switch may have been over tightened in the affected motorcycles. Over tightening of the brake pressure switch may damage the seal, allowing brake fluid to leak, resulting in reduced brake performance, increasing the risk of a crash. Polaris will notify owners, and dealers will install new brake pressure switch seals, free of charge. The recall is expected to begin in November 2016. Owners may contact Polaris customer service at 1-855-863-2284. Polaris' number for this recall is T-16-02.

**16V-752**

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING OCTOBER 2016**

*Published November 18, 2016*

Mazda North American Operations (Mazda) is recalling certain model year 2017 Mazda6 vehicles manufactured August 12, 2016, to September 28, 2016 and equipped with optional accessory fog lights. Due to an incorrect combination switch being installed, the turn signals may not automatically cancel by the rotation of the steering wheel. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." A vehicle continuously driven with the turn signal flashing may result in confusion to other drivers, increasing the risk of a crash. Mazda will notify owners, and dealers will replace the combination switch, free of charge. The recall is expected to begin in November 2016. Owners may contact Mazda customer service at 1-800-222-5500. Mazda's number for this recall is 0316J.

**16V-753**

Polaris Industries, Inc. (Polaris) is recalling certain model year 2015-2017 Slingshot motorcycles manufactured March 4, 2014, to October 7, 2016. The affected vehicles may have insufficient clearance between the fuel line and the hood structure. The insufficient clearance may allow the fuel line to rub against the hood until it leaks fuel. A fuel leak in the presence of an ignition source can increase the risk of a fire. Polaris will notify owners, and dealers will replace the engine fuel line, and inspect the retention clips to reduce the risk of interference, free of charge. The recall is expected to begin in November 2016. Owners may contact Polaris customer service at 1-855-863-2284. Polaris' number for this recall is T-16-03.

**16V-754**

Polaris Industries, Inc. (Polaris) is recalling certain model year 2015-2017 Slingshot motorcycles manufactured March 4, 2014, to September 7, 2016. The affected vehicles may have been manufactured with a swing arm that has insufficient strength. Due to the insufficient swing arm strength, the swing arm may fracture resulting in a loss of momentum or vehicle control, increasing the risk of a crash. Polaris will notify owners, and dealers will inspect, and repair or replace the swing arm, as necessary, free of charge. The recall is expected to begin in November 2016. Owners may contact Polaris customer service at 1-855-863-2284. Polaris' number for this recall is T-16-06.

**16V-755**

Newmar Corporation (Newmar) is recalling certain model year 2017 King Aire motorhomes manufactured January 22, 2016, to October 4, 2016. The affected vehicles are equipped with WABCO OnGuard collision mitigation radar which may have been mounted upside down on the front lower bumper, resulting in decreased performance. If the collision mitigation radar has reduced performance, there may be an increased risk of a crash. Newmar will notify owners, and dealers will check the orientation of the OnGuard radar and, if necessary, correct the orientation, free of charge. The recall is expected to begin December 23, 2016. Owners may contact Newmar customer service at 1-800-731-8300.

**16V-756**

Johnston North America (Johnston) is recalling certain model year 2013-2016 VT651 and VT801 street sweepers manufactured May 1, 2013, to October 13, 2016. The affected street sweepers have tipping hinges that may crack, allowing the hopper to detach from the chassis. If the hopper detaches, it can increase the risk of injury to those nearby. Johnston will notify owners, and dealers will install a reaction beam to increase the

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING OCTOBER 2016**

*Published November 18, 2016*

torsional stiffness of the body and stabilize the tipping pivot brackets, free of charge. The recall began on November 4, 2016. Owners may contact Johnston customer service at 1-704-658-1333.

**16V-757**

Mercedes-Benz USA, LLC (MBUSA) is recalling certain model year 2017 E300 Sedan and E300 Sedan 4Matic vehicles manufactured December 10, 2015, to June 30, 2016. In the affected vehicles, the rear bench seat frame may contact and damage the wiring harness for the fuel pump, fuel tank pressure sensor or fuel level gauge. Damage to the fuel pump wiring may result in an engine stall, increasing the risk of a crash. MBUSA has notified owners, and dealers will modify the routing of the affected wiring harness, repairing it as necessary, free of charge. The recall began October 28, 2016. Owners may contact MBUSA customer service at 1-800-367-6372.

**16V-758**

Mercedes-Benz USA, LLC (MBUSA) is recalling certain model year 2016-2017 GLE 300d 4MATIC, GLE 350, GLE 350 4MATIC, and GLE 400 4MATIC vehicles manufactured October 14, 2015, to November 23, 2015. The low beam headlights on the affected vehicles may not be properly adjusted. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Assoc. Equipment." If the low-beam headlights are out of adjustment, the driver's visibility may be reduced, increasing the risk of a crash. MBUSA will notify owners, and dealers will inspect and correct the headlight adjustment, as necessary, free of charge. The recall is expected to begin in November 2016. Owners may contact MBUSA customer service at 1-800-367-6372.

**16V-759**

Mercedes-Benz USA, LLC (MBUSA) is recalling certain model year 2016-2017 S550 Coupe 4MATIC, S63 AMG Coupe 4MATIC, S65 AMG Coupe and S63 AMG Convertible 4Matic vehicles manufactured September 3, 2015, to February 4, 2016. The low beam headlights on the affected vehicles may not be properly adjusted. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." If the low-beam headlights are out of adjustment, the driver's visibility may be reduced, increasing the risk of a crash. MBUSA will notify owners, and dealers will inspect and correct the headlight adjustment, as necessary, free of charge. The recall is expected to begin in November 2016. Owners may contact MBUSA customer service at 1-800-367-6372.

**16V-760**

Entegra Coach (Entegra) is recalling certain model year 2016-2017 Cornerstone and Anthem motorhomes manufactured April 7, 2015, to August 18, 2016. The affected vehicles are equipped with a Tempurpedic Sealy Mattress that may burn quickly when on fire. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 302, "Flammability of Interior Materials." If the mattress burns quickly, a vehicle occupant may not have enough time to exit the vehicle in the event of a fire, increasing the risk of injury. Entegra will notify owners, and dealers will replace the Tempurpedic Sealy Mattress with a Sleep Number Mattress, free of charge. The recall began on November 3, 2016. Owners may contact Entegra customer service at 1-800-517-9137. Entegra's number for this recall is 9903329.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING OCTOBER 2016**

*Published November 18, 2016*

**16V-761**

Forest River, Inc. (Forest River) is recalling certain model year 2017 Cedar Creek recreational trailers manufactured September 8, 2016, to September 19, 2016. The axles installed on these vehicles were incorrectly identified as having a 7,000 pound capacity when they were only rated and designed to carry up to 6,000 pounds. The owner of a vehicle with the incorrect axles could unknowingly overload the vehicle, possibly resulting in a loss of control or reduced braking distance, potentially increasing the risk of a crash. All affected vehicles have been captured at the dealer level and are being repaired prior to sale. Therefore, an owner notification letter will not be issued for this campaign. Dealers will replace the axles that are rated for a 7,000lb capacity. Owners may contact Forest River customer service at 1-574-593-4000 extension 20209. Forest River's number for this recall is 20-10112016-0255.

**16V-762**

Kaufman Trailers of NE, Inc. (Kaufman) is recalling certain model year 2015-2016 FE-3/7K-44 Mini Car Haulers manufactured January 1, 2015, to August 31, 2016. On the affected trailers, the spring eye may break off the spring and allow the axle to slide back and forth. If the axle slides back and forth, the tires on that axle may contact the fenders or the adjacent tires, possibly damaging the tires and increasing the risk of a crash. Kaufman has notified owners and dealers will replace all of the springs on the affected trailers with a newly designed spring that has a thicker top leaf and rubber bushing with steel sleeve. The recall began on October 24, 2016. For help with this recall, owners may contact Kaufman at 1-336-790-2756.

**16V-764**

Navistar, Inc. (Navistar) is recalling certain model year 2015 IC Bus AE and BE, 2015-2017 CE and 2016-2017 RE school buses, equipped with certain model S2005, S2010, S5005, S5010, S5505, and S5510 wheelchair lifts by Ricon. The affected lifts are equipped with folding link arms that may have pivot holes that are too big, allowing the bearings to move out of position. If the bearings move out of position, the stowed platform may have excessive movement resulting in failure of the platform mounting. This failure could cause the wheelchair lift platform to fall out of the vehicle when the doors are opened, increasing the risk of injury for the lift operator. Navistar will notify owners, and dealers will inspect the link arms for damage or for displaced bearings. The platform will be inspected for cracks. Any damaged parts will be replaced, free of charge. The recall is expected to begin on November 30, 2016. Owners may contact Navistar customer service at 1-331-332-1590, or Ricon Customer Service at 1-800-322-2884.

**16V-765**

Navistar, Inc. (Navistar) is recalling certain model year 2016 IC Bus RE transit buses manufactured November 12, 2015, to November 16, 2015, equipped with certain model S2005, S2010, S5005, S5010, S5505, and S5510 wheelchair lifts by Ricon. The affected lifts are equipped with folding link arms that may have pivot holes that are too big, allowing the bearings to move out of position. If the bearings move out of position, the stowed platform may have excessive movement resulting in failure of the platform mounting. This failure could cause the wheelchair lift platform to fall out of the vehicle when the doors are opened, increasing the risk of injury for the lift operator. Navistar will notify owners, and Ricon dealers will inspect the link arms for damage or for displaced bearings. The platform will be inspected for cracks. Any damaged parts will be replaced, free of

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING OCTOBER 2016**

*Published November 18, 2016*

charge. The recall is expected to begin on November 30, 2016. Owners may contact Navistar customer service at 1-331-332-1590, or Ricon Customer Service at 1-800-322-2884.

**16V-766**

Kovatch Mobile Equipment Corp. (KME) is recalling certain model year 2011-2013 Predator Panther Aerial, 2011-2015 Predator Aerial, 2012-2015 Predator SS Aerial, 2014 Predator TDA, and 2014-2015 Predator SS TDA emergency vehicles equipped with aerial water way trollies. The aerial device water way trolley could separate from the ladder. If the water way trolley separates from the ladder, it may fall, increasing the risk of injury to those nearby. KME will notify owners, and dealers will install re-enforcement inserts to the side clamps of the water way trolley, free of charge. The recall is expected to begin December 1, 2016. Owners may contact KME customer service at 1-800-235-3928.

**16V-767**

Newmar Corporation (Newmar) is recalling certain model year 2017 London Aire, Essex, and King Aire motorhomes manufactured December 9, 2015, to September 26, 2016. The hydraulic entry step controller may not be functioning as designed and may allow the steps to retract unexpectedly. The steps can retract without warning, causing someone using the steps to fall, increasing the risk of injury. Newmar will notify owners, and dealers will inspect the steps and update the controller software, free of charge. The recall is expected to begin December 19, 2016. Owners may contact Newmar customer service at 1-800-731-8300.

**16V-768**

ARBOC Specialty Vehicles, LLC (ARBOC) is recalling certain model year 2016 Spirit of Liberty vehicles manufactured November 7, 2014, to July 29, 2016. In the affected vehicles, the rear engine-run lockout safety switch may have been improperly wired, and as a result, it may be possible to start the engine while the vehicle is being worked on by a mechanic. If the engine can be started while a mechanic is working on the vehicle, they have an increased risk of injury and or death. ARBOC will notify owners, and dealers will inspect the rear engine-run lockout safety switch wiring, correcting it as necessary, free of charge. The recall began on November 4, 2016. Owners may contact ARBOC customer service at 1-866-953-5555.

**16V-769**

Kia Motors America (Kia) is recalling certain model year 2016 Kia Sorento vehicles manufactured March 3, 2016 to March 21, 2016. The driver's seatback frame may have been produced with inadequate weld joints and, as a result, the seatback may not function as designed in the event of a rear-end collision. In the event of a crash, the driver seatback frame could break and fail to restrain a seat occupant, increasing the risk of injury. Kia will notify owners, and dealers will inspect the welds and replace the driver seatback frame, as necessary, free of charge. The recall is expected to begin on December 9, 2016. Owners may contact Kia customer service at 1-800-333-4542. Kia's number for this recall is SC140.

**16V-770**

East Manufacturing Corp. (East) is recalling certain model year 2016 Beast II flatbed trailers manufactured May 22, 2015, to June 19, 2015, equipped with certain Conestoga XP sliding trailer tarping systems with RAD-style rear closures. In the affected trailers, the rear aerodynamic device (RAD) may separate from the rear of the

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING OCTOBER 2016**

*Published November 18, 2016*

tarping system, due to rivet failure. If the RAD detaches from the trailer it may be a road hazard, increasing the risk of a crash. East will notify owners, and dealers will replace the mounting rivets with a bolted connection, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact East customer service at 1-330-325-9921. East's number for this recall is 16E-066.

**16V-771**

Jayco, Inc. (Jayco) is recalling certain model year 2017 Eagle fifth wheel trailers, model 355 MBQS, manufactured October 7, 2016, to October 11, 2016. The affected vehicles may have an axle of insufficient load capacity. If the axle is overloaded, excess tire wear may result, possibly causing tire failure and an increased risk of a crash. All of the affected trailers have been quarantined at dealers and therefore owner notification letters will not be sent. Jayco dealers will replace the 6000lb capacity axle with a 7000lb capacity axle, including new rims and tires and will install updated Federal ID, and Cargo Carrying Capacity labels, free of charge. Owners may contact Jayco customer service at 1-800-283-8267. Jayco's number for this recall is 9901330.

**16V-772**

Newmar Corporation (Newmar) is recalling certain model year 2017 Dutch Star and Ventana motorhomes manufactured May 17, 2016, to September 27, 2016. On certain motorhomes, the wardrobe slide out motor may have been installed without having a brake. If the slide out motor does not have a brake installed, the slide out box could extend unexpectedly, increasing the risk of a crash. Newmar will notify owners, and dealers will inspect the motor and replace it if necessary, free of charge. The recall is expected to begin December 19, 2016. Owners may contact Newmar customer service at 1-800-731-8300.

**16V-773**

Forest River, Inc. (Forest River) is recalling certain model year 2017 Dynamax Isata motorhomes, models ISC24FWM, ISC24RWM, ISC35DBD and ISC36DSD, manufactured May 19, 2016, to October 19, 2016. The affected vehicles may be missing a securing cable tie on the rubber grommet for the copper liquid propane (L.P.) gas line, allowing liquid propane to enter the cabin. If the rubber grommet is not properly sealed and secured, there is an increased risk of propane leak and a fire. Forest River will notify owners, and dealers will inspect the grommet and install a cable tie, as necessary, free of charge. The recall is expected to begin December 19, 2016. Owners may contact Forest River customer service at 1-574-262-3474 extension 203. Forest River's number for this recall is 55-10162016-0257.

**16V-774**

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain model year 2016 Highlander vehicles manufactured May 26, 2016, to September 16, 2016. The brake fluid level sensor may not be connected to the wire harness, preventing the sensor from detecting the brake fluid level. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 135, "Light Vehicle Brake Systems." If the brake fluid level is low and is not detected, the braking performance may be decreased, increasing the risk of a crash. Toyota will notify owners, and dealers will inspect and, as necessary, connect the wire harness to the sensor, free of charge. The recall is expected to begin November 7, 2016. Owners may contact Toyota customer service at 1-800-331-4331. Toyota's number for this G03.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING OCTOBER 2016**

*Published November 18, 2016*

**16V-775**

Spartan Motors USA (Spartan) is recalling certain model year 2017 Spartan Specialty Vehicle K2 and K3 vehicles manufactured March 24, 2016, to August 31, 2016. The throttle circuit wires on the affected vehicles may not have been twisted to cancel out electromagnetic interference, and as a result, interference may cause the throttle signal to be higher or lower than intended. Unintended deceleration or acceleration can increase the risk of a crash. Spartan will notify owners, and dealers will install an overlay harness with twisted wires, free of charge. The recall began on November 3, 2016. Owners may contact Spartan customer service at 1-800-543-5277. Spartan's number for this recall is 16025.

**16V-776**

Ford Motor Company (Ford) is recalling certain model year 2010-2012 Ford Escape vehicles manufactured February 26, 2009, to April 29, 2012, and 2010-2011 Mercury Mariner vehicles manufactured February 25, 2009, to December 12, 2010. On vehicles with a 3.0L engine, the Fuel Delivery Module (FDM) may crack, causing a fuel leak. A fuel leak in the presence of an ignition source increases the risk of a fire. Ford will notify owners, and dealers will replace the FDM flange with one that has a redesigned fuel supply port, free of charge. The recall is expected to begin December 12, 2016. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 16S41.

**16V-777**

Ford Motor Company (Ford) is recalling certain model year 2017 Ford F-250 SD, F-350 SD, F-450 SD, and F-550 SD trucks manufactured March 21, 2016, to August 28, 2016. The protective shield on the fuel conditioning module may have inadequate adhesion, allowing the shield to become dislodged. If the shield becomes dislodged, the drain valve may open resulting in a fuel leak. A fuel leak, in the presence of an ignition source, increases the risk of a fire. Under certain conditions, significant liquid fuel on the road surface may cause a slip hazard, increasing the risk of a crash. Ford will notify owners, and dealers will replace the protective shield, free of charge. The recall is expected to begin November 7, 2016. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 16S39.

**16V-778**

Ford Motor Company (Ford) is recalling certain model year 2015-2017 Mustang vehicles manufactured February 24, 2015, to August 30, 2016. A hose may separate from the engine oil cooler tube assembly causing an oil leak. A sudden loss of engine oil may cause engine failure, increasing the risk of a crash. Additionally, an oil leak, in the presence of an ignition source, increases the risk of a fire. Ford will notify owners, and dealers will replace the engine oil cooler tube assembly, free of charge. The recall is expected to begin December 12, 2016. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 16S40.

**16V-779**

Forest River, Inc. (Forest River) is recalling certain model year 2016 Rockport cargo box trucks and work trucks manufactured December 8, 2015, to May 31, 2016 and built on GM chassis. Cycling the rear ramp in and out may cause the electrical connections on the fuel sending unit to be damaged, resulting in a loss of fuel pressure. A loss of fuel pressure will result in an engine stall, increasing the risk of a crash. Forest River will notify

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING OCTOBER 2016**

*Published November 18, 2016*

owners, and dealers will reinstall the loading ramp structure to give sufficient clearance, free of charge. The recall is expected to begin December 20, 2016. Owners may contact Forest River customer service at 1-574-522-7599. Forest River's number for this recall is 29-10212016-0261.

**16V-780**

General Motors LLC (GM) is recalling certain model year 2016 Chevrolet Malibu vehicles manufactured November 18, 2015, to June 7, 2016. The fabric of the side-impact air bag cushion may tear during deployment. If the air bag tears during deployment, the air bag may not perform as designed, increasing the risk of injury in the event of a crash. GM will notify owners, and dealers will inspect and, as necessary, replace the air bag module, free of charge. The recall began October 27, 2016. Owners may contact Chevrolet customer service at 1-800-222-1020. GM's number for this recall is 16079.

**16V-781**

Forest River, Inc. (Forest River) is recalling certain model year 2017 Vibe trailers manufactured September 20, 2016, to October 20, 2016. The outside of the kitchen stove may have been connected to a 12V D.C. positive circuit, potentially shocking a user that touches it. An energized stove may increase the risk of an electrical shock and injury. Forest River will notify owners, and dealers will disconnect the positive wire, free of charge. The recall is expected to begin December 20, 2016. Owners may contact Forest River customer service at 1-574-296-2084 extension 105. Forest River's number for this recall is 59-102212016-0260.

**16V-782**

Con-Tech Manufacturing (Con-Tech) is recalling certain model year 2015-2017 BridgeKing concrete mixer trucks manufactured September 13, 2015, to April 8, 2016. On the affected vehicles, the fender mounts on the bridge axles may crack and the fenders may separate from the vehicle. A fender that detaches from the bridge axle can become a road hazard and increase the risk of a crash. Con-Tech will notify owners, and dealers will install a service kit that includes fender mount support gussets, free of charge. The recall is expected to begin in November 2016. Owners may contact Con-Tech customer service at 1-507-374-2239.

**16V-783**

REV Recreation Group (REV) is recalling certain model year 2015-2016 Holiday Rambler Vacationer motorhomes. The affected vehicles have a front truss that may not be adequately supported at the attachment points, allowing any wire harnesses or hydraulic lines routed between the truss and its supporting framework to be pinched or crushed. A damaged wire harness can cause an electrical short, resulting in intermittent operation of electrical systems or a vehicle shut down. A damaged hydraulic line may leak fluid. Either condition may increase risk of a fire or a crash. REV will notify owners, and dealers will install additional steel to support the front truss,. Dealers will also inspect the hydraulic hoses and electrical wiring, relocating them as necessary. These repairs will be done free of charge. The recall is expected to begin November 30, 2016. Owners may contact REV customer service at 1-800-509-3417. REV's number for this recall is 161018REV.

**16V-784**

Jayco, Inc. (Jayco) is recalling certain model year 2017 Jay Sport camping trailers, model 12SC, manufactured September 14, 2016, to October 3, 2016. The labels on the affected vehicles incorrectly state that the vehicle is

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING OCTOBER 2016**

*Published November 18, 2016*

equipped with ST175/80R13D tires requiring 65 PSI, when the vehicle is actually equipped with ST175/80R13C tires requiring 50 PSI. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims." Incorrect tire pressure information may result in the tires being over inflated, which can cause possible tire failure, increasing the risk of a crash. Jayco has notified owners and provided them with a corrected label, free of charge. The recall began on November 1, 2016. Owners may contact Jayco customer service at 1-800-283-8267. Jayco's number for this recall is 9901331.

**16V-785**

Starcraft RV (Starcraft) is recalling certain model year 2017 AR-ONE trailers, model 28R, manufactured March 1, 2016, to August 5, 2016. The affected vehicles have incorrect information on Federal Placard and Cargo Carrying Capacity (CCC) labels, possibly resulting in the vehicle being overloaded. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims." An overloaded trailer increases the risk of a crash. Starcraft has notified owners and provided corrected Federal Placards and CCC labels, free of charge. The recall began on November 3, 2016. Owners may contact Starcraft customer service at 1-800-945-4787. Starcraft's number for this recall is 9902328.

**16V-786**

Forest River, Inc. (Forest River) is recalling certain model year 2017 Salem recreational trailers, model SMT186RB, manufactured October 13, 2016 through October 21, 2016 and model year 2017 Wildwood recreational trailers, model WDT186RB, manufactured October 7, 2016, through October 21, 2016. The Federal Placard Label and the VIN incorrectly states that the vehicle has two axles, while the vehicle is only equipped with one axle. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." If the owner follows the information on the Federal Placard Label, the operator may overload the vehicle, increasing the risk of a crash. Forest River will notify owners and will provide a corrected Certificate of Origin, Federal Placard and VIN plate for each trailer, free of charge. The recall is expected to begin on December 21, 2016. Owners may contact Forest River customer service at 1-574-534-1251. Forest River's number for this recall is 6-10252016-0262.

**16V-787**

Mazda North American Operations (Mazda) is recalling certain model year 2010-2011 Tribute vehicles manufactured March 3, 2009, to May 26, 2011. On vehicles with a 3.0L engine, the Fuel Delivery Module (FDM) may crack, causing a fuel leak. A fuel leak in the presence of an ignition source increases the risk of a fire. Mazda will notify owners, and dealers will replace the FDM flange with one that has a redesigned fuel supply port, free of charge. The recall is expected to begin December 15, 2016. Owners may contact Mazda customer service at 1-800-222-5500. Mazda's number for this recall is 0416J.

**16V-788**

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain model year 2017 Jaguar F-Type SVR vehicles built between February 19, 2016 and August 15, 2016. Due to assembly corrections during manufacturing, the bolts connecting the rear lower control arms to the knuckle assembly may fail prematurely. If

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING OCTOBER 2016**

*Published November 18, 2016*

the lower control arm bolt connecting bolt fails, the rear control arm assembly may separate from the vehicle, resulting in a loss of control and increasing the risk of a crash. Jaguar will notify owners, and dealers will replace the bolt that connects the rear lower control arm to the rear knuckle joint, free of charge. The recall is expected to begin on December 19, 2016. Owners may contact Jaguar customer service at 1-800-452-4827. Jaguar's number for this recall is J076.

**16V-789**

Mitsubishi Motors North America, Inc. (MMNA) is recalling certain model year 2007-2013 Outlander vehicles manufactured September 8, 2006, to March 29, 2013. In the affected vehicles, water may enter between the hood and windshield and cause the front wiper link ball joint to corrode, possibly resulting in the wiper link separating and the wipers becoming inoperative. Loss of wiper function can reduce visibility and increase the risk of a crash. MMNA will notify owners, and dealers will replace the rubber boot on the ball joint to prevent water intrusion. Additionally, they will inspect the wiper motor crank arm for excessive play, replacing it as necessary. These repairs will be done free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact MMNA customer service at 1-888-648-7820. MMNA's number for this recall is SR-16-009.

**16V-791**

Mitsubishi Motors North America, Inc. (MMNA) is recalling certain model year 2011-2015 Outlander Sport vehicles manufactured August 26, 2010, to January 5, 2015. In the affected vehicles, water may drop between the hood and the windshield and leak into the wiper motor breathing hole. The water may cause internal corrosion of the windshield wiper motor and the possible failure of the motor. Failure of the wiper motor can cause a loss of visibility, increasing the risk of a crash. MMNA will notify owners, and dealers will replace the wiper motor, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact MMNA customer service at 1-888-648-7820. MMNA's number for this recall is SR-16-010.

**16V-792**

Mazda North America Operations (Mazda) is recalling certain model year 2004-2008 RX-8 vehicles manufactured April 10, 2003, to February 18, 2008. The affected vehicles have fuel pump sealing rings that may deteriorate due to exposure to heat from the engine or exhaust pipe. The deteriorated seals may leak fuel, which, in the presence of an ignition source, can increase the risk of a fire. Mazda will notify owners, and dealers will replace the fuel pump sealing ring set and add a thermal insulation pad to the fuel tank, free of charge. Parts are not currently available. Mazda will notify owners about the issue and will second a second notice when remedy parts are available. The manufacturer did not provide a schedule for these notifications. Owners may contact Mazda customer service at 1-800-222-5500. Mazda's number for this recall is 0516J.

**16V-793**