

NISSAN

NISSAN NORTH AMERICA, INC.

Corporate Office
18501 South Figueroa St.
Gardena, California 90248-4500
Mailing Address: P.O. Box 191
Gardena, California 90248-0191
Telephone: 810.592.3111

RECEIVED

JAN 12 2004

COMMUNICATIONS

January 12, 2004

Mr. George Person
Chief, Recall Analysis Division
Office of Defects Investigation
Safety Assurance
National Highway Traffic Safety Administration
400 Seventh Street, S.W.
Washington, D.C. 20590

Ref: 03V-455

Dear Mr. Person:

The enclosed communication is being provided pursuant to 49 CFR Part 573.6(e)(9).

Technical Compliance Department

Encl.

**INFINITI****RECALL CAMPAIGN BULLETIN**

ITB 03-072 NORTH AMERICA, INC.

Reference:

ITB03-072

Date:

December 19, 2003

**VOLUNTARY RECALL CAMPAIGN
ENGINE SENSORS****CAMPAIGN I.D.# / NHTSA #:** R3021 / 03V-455**APPLIED VEHICLES:** 2002-03 I35 (CA33)
2003 G35 Sedan (V35)
2003 G35 Coupe (CV35)
2003 M45 (Y34)
2002 Q45 (F50)**APPLIED VINS:** I35
JNKDA*1**2T 000033 - 032047
JNKDA*1**3T 100004 - 100005
G35
JNKCV****3M 000030 - 021207
M45
JNKAY*1**3M 000042 - 000066
Q45
JNKBF*1**2M 000090 - 008703**APPLIED ENGINES:** VQ35DE and VK45DE**NOTE: Use Service Comm. to confirm campaign eligibility.****INTRODUCTION**

Infiniti has determined that some 2002-2003 model year Infiniti vehicles may have a defect which relates to motor vehicle safety. The engine might stop running while being driven if the crank position sensor or cam position sensor fails. This may also result in the "Service Engine Soon" light coming on or reduced engine power. If the engine stops running while driving, this could result in a crash without warning.

**INFINITI****RECALL CAMPAIGN BULLETIN**

OPERATING INFINITI NORTH AMERICA, INC.

Reference:

ITB03-072

Date:

December 19, 2003

**VOLUNTARY RECALL CAMPAIGN
ENGINE SENSORS**

145

CAMPAIGN I.D.# / NHTSA #: R3021 / 03V~~345~~

APPLIED VEHICLES: 2002-03 I35 (CA33)
2003 G35 Sedan (V35)
2003 G35 Coupe (CV35)
2003 M45 (Y34)
2002 Q45 (F50)

APPLIED VINS:

I35
JNKDA*1**2T 000033 - 032047
JNKDA*1**3T 100004 - 100005

G35
JNKCV****3M 000030 - 021207

M45
JNKAY*1**3M 000042 - 000066

Q45
JNKBF*1**2M 000090 - 008703

APPLIED ENGINES: VQ35DE and VK45DE

NOTE: Use Service Comm. to confirm campaign eligibility.**INTRODUCTION**

Infiniti has determined that some 2002-2003 model year Infiniti vehicles may have a defect which relates to motor vehicle safety. The engine might stop running while being driven if the crank position sensor or cam position sensor fails. This may also result in the "Service Engine Soon" light coming on or reduced engine power. If the engine stops running while driving, this could result in a crash without warning.

IDENTIFICATION NUMBER

Nissan has assigned identification number R3021 to this campaign. This number must appear on all communications and documentation of any nature dealing with this campaign.

NUMBER OF VEHICLES POTENTIALLY AFFECTED

The number of vehicles potentially affected is approximately 58,000.

DEALER RESPONSIBILITY

It is the retailer's responsibility to check Infiniti Net for the campaign status on each vehicle falling within the range of this voluntary safety recall which for any reason enters the service department. This includes vehicles purchased from private parties or presented by transient (tourist) owners and vehicles in a dealer's inventory. Federal law requires that new vehicles in dealer inventory which are the subject of a safety recall must be corrected prior to sale. Failure to do so can result in civil penalties by the National Highway Traffic Safety Administration. While federal law applies only to new vehicles, Infiniti strongly encourages dealers to correct any used vehicles in their inventory before they are retailed.

SERVICE PROCEDURE

You will replace the following sensors: Crankshaft Position Sensor, Camshaft Position Sensors, and in some cases the Variable Timing Control Sensors. The service procedures are divided by engine 'family' and vehicle model (see Figure C, next page).

NOTE: Use Service Comm to confirm the vehicle is included in this campaign before performing the following procedure.

IMPORTANT

- There are two sensor kits associated with this campaign -- one kit for each engine family (see Figure A, below).
- **THE SENSORS IN EACH KIT ARE DIFFERENT. IT IS CRITICAL THAT EACH SENSOR BE INSTALLED IN THE CORRECT LOCATION. REFER TO FIGURE A (BELOW) AND THE ILLUSTRATIONS IN EACH REPAIR SECTION FOR SENSOR LOCATIONS.**
- Each new sensor (within each kit) is contained in a bag. The bag is labeled with the Nissan part number. Keep the sensor in the bag until just before it is installed. The supplier part number is molded onto the face of the sensor. This number starts with "A29-".
- The Crankshaft and Camshaft Position Sensors in Sensor Kit P/N 23731-4M527 look the same. To help you tell the difference between these sensors, a white paint mark was added to the Crankshaft sensor (see Figure A, below).
- The old and new sensors may appear identical, therefore **KEEP THEM SEPARATE**.
- When disconnecting the vehicle harness connector* from the sensor(s); first **PUSH** the Release Button inward, then **PULL** the connector back (see Figure B, next page). **NOTE:** Do **NOT** pull on the wires when disconnecting the connector.

* The button for this connector is green and the connector body color is green or black.

Sensor Kits (Based on Engine Family)

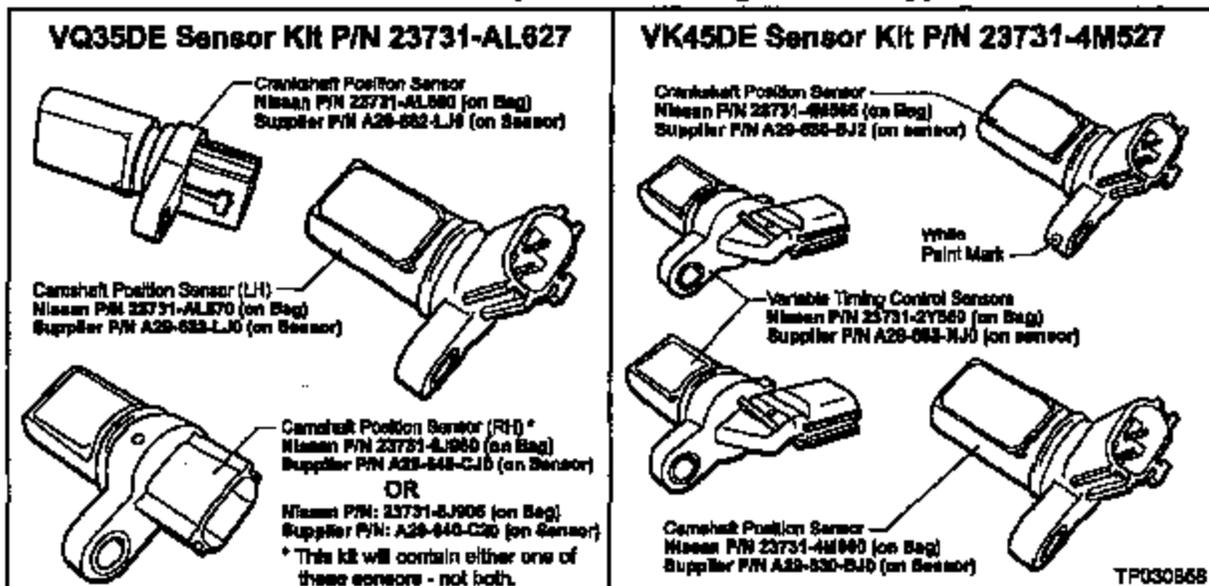


Figure A

Sensor Connector Release

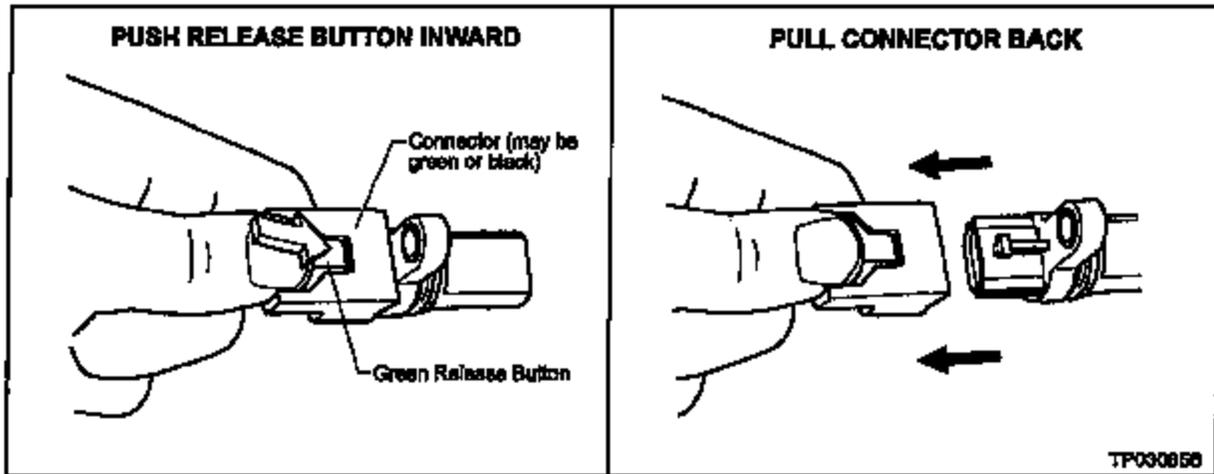


Figure B


NOTE: Do NOT pull on the wires when disconnecting the connector.

Sensor Replacement Procedures

Model	VQ35DE	VK45DE
I35 – CA33	Page 5	
G35 Sedan & Coupe – V35 & CV35	Page 8	
M45 – Y34		Page 13
Q45 – F50		Page 16

Figure C

VQ35DE Engine (Use Kit P/N 23731-AL627)

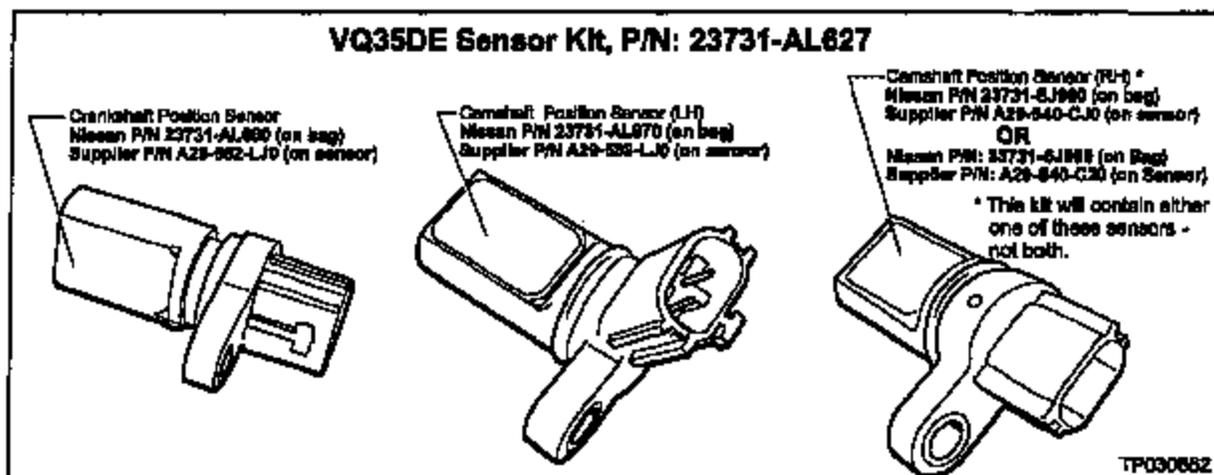

I35 (CA33)

IMPORTANT

- **THE SENSORS IN THIS KIT ARE DIFFERENT. IT IS CRITICAL THAT EACH SENSOR BE INSTALLED IN THE CORRECT LOCATION. REFER TO "FIGURE A" AND THE ILLUSTRATIONS IN THIS REPAIR SECTION FOR SENSOR LOCATIONS.**
- Each new sensor (within each kit) is contained in a bag. The bag is labeled with the Nissan part number. Keep the sensor in the bag until just before it is installed. The supplier part number is on the face of the sensor. This number starts with "A29-".
- The old and new sensors may appear identical, therefore **KEEP THEM SEPARATE**.

Camshaft Position Sensor Replacement (P/N 23731-AL670 / A29-632-LJ0 & 23731-6J960* / A29-640-CJ0)

* This sensor can be substituted with P/N 23731-6J908 / A29-640-C20.

1. Record all radio station presets.
2. Disconnect the negative battery cable.
3. Locate the Camshaft Position Sensors (see Figure 1).

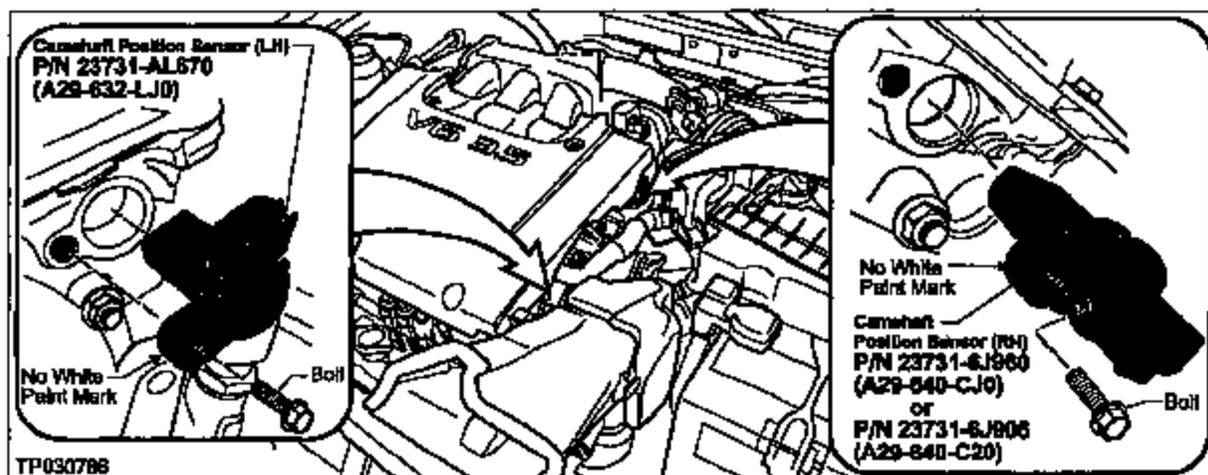


Figure 1

4. Disconnect the vehicle wire harness connectors from the sensors.

NOTE: If the connector will not release for you, see Figure B (if applicable).

5. Remove and save the bolts that hold the sensors in place.

IMPORTANT: Perform the following steps on only **ONE** sensor at a time.

6. Remove the **Camshaft Position Sensor** with a pulling and twisting motion. Then, using a pair of pliers, break the connector on the **OLD** sensor so it cannot be reused.
7. Clean the hole that the old sensor was removed from.
8. Open the kit bag, remove the **NEW** sensor and apply a thin coat of clean engine oil to the o-ring on the new sensor.
9. Insert (until fully seated) the **NEW** sensor into the hole with a pushing and twisting motion, being careful not to damage the o-ring.
10. Re-install and tighten the sensor mounting bolt to 74 - 96 in-lb (8.4 - 10.8 N-m, 0.86 - 1.1 kg-m).
11. Re-connect the vehicle wire harness connectors to the sensors.

Crankshaft Position Sensor Replacement (P/N 23731-AL660 / A29-662-LJ0)

1. Raise the vehicle on a hoist.
2. Remove the Lower Engine Cover (see Figure 2).

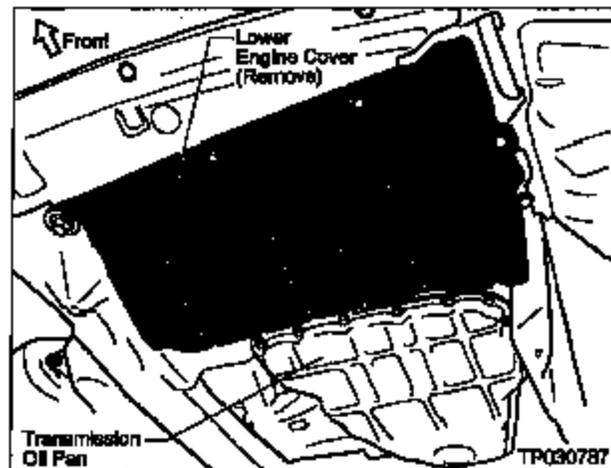


Figure 2

3. Locate the **Crankshaft Position Sensor** (see Figure 3).

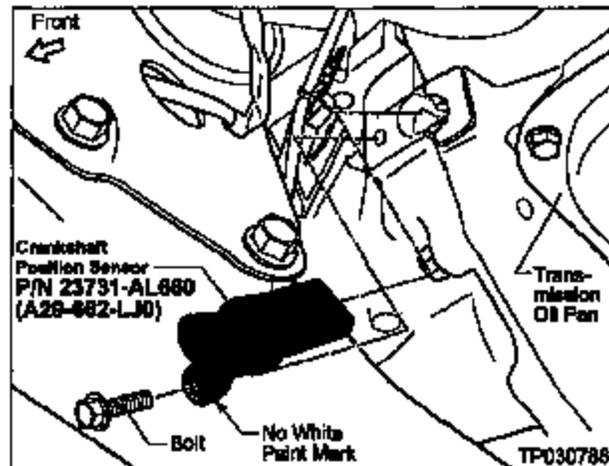


Figure 3

4. Disconnect the vehicle wire harness connector from the sensor.
NOTE: If the connector will not release for you, see Figure B (if applicable).
5. Remove and save the bolt that holds the sensor in place.
6. Remove the Crankshaft Position Sensor with a pulling and twisting motion. Then, using a pair of pliers, break the connector on the OLD sensor so it cannot be reused.
7. Clean the hole that the old sensor was removed from.
8. Open the kit bag, remove the NEW sensor and apply a thin coat of clean engine oil to the o-ring (if applicable) on the new sensor.
9. Insert (until fully seated) the NEW sensor into the hole with a pushing and twisting motion, being careful not to damage the o-ring.
10. Re-install and tighten the sensor mounting bolt to 74 - 96 In-lb (8.4 - 10.8 N-m, 0.88 - 1.1 kg-m).
11. Re-connect the vehicle wire harness connector to the sensor.
12. Lower the vehicle to the ground.
13. Reconnect the battery cable and reset the radio station presets and clock.

G35 Sedan and Coupe (V35 and CV35)

IMPORTANT

- **THE SENSORS IN THIS KIT ARE DIFFERENT. IT IS CRITICAL THAT EACH SENSOR BE INSTALLED IN THE CORRECT LOCATION. REFER TO "FIGURE A" AND THE ILLUSTRATIONS IN THIS REPAIR SECTION FOR SENSOR LOCATIONS.**
- Each new sensor (within each kit) is contained in a bag. The bag is labeled with the Nissan part number. Keep the sensor in the bag until just before it is installed. The supplier part number is on the face of the sensor. This number starts with "A29-".
- The old and new sensors may appear identical, therefore **KEEP THEM SEPARATE**.

Camshaft Position Sensor Replacement (Driver's Side), P/N 23731-AL670 / A29-832-LJ0

1. Record all radio station presets.
2. Disconnect the negative battery cable.
3. Remove the Upper Engine Cover (see Figure 4).

NOTE: If equipped, the Strut Tower Cross Bar will have to be re-positioned to remove the Upper Engine Cover.

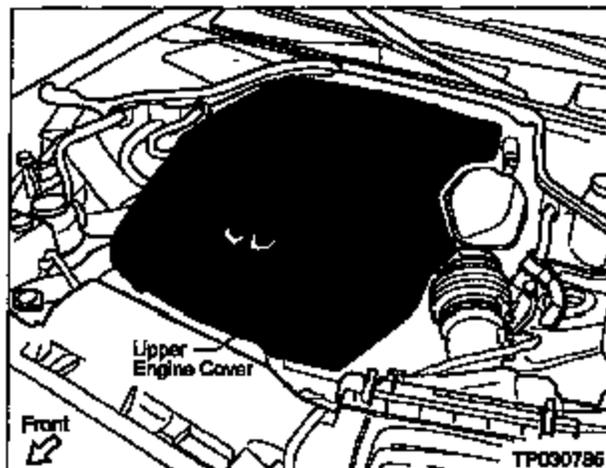


Figure 4

4. Remove the Air Inlet Duct and Throttle Body (see Figure 5).

CAUTION: Avoid engine damage; place a shop rag in the opening of the Intake collector (see Figure 6, next page).

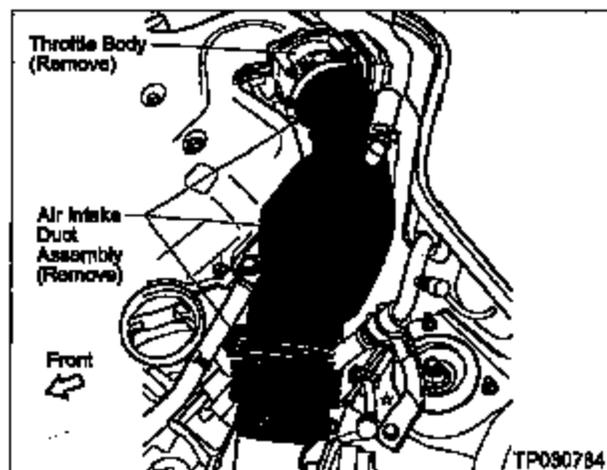


Figure 5

5. Locate the driver's side (LH) Camshaft Position Sensor (see Figure 6).

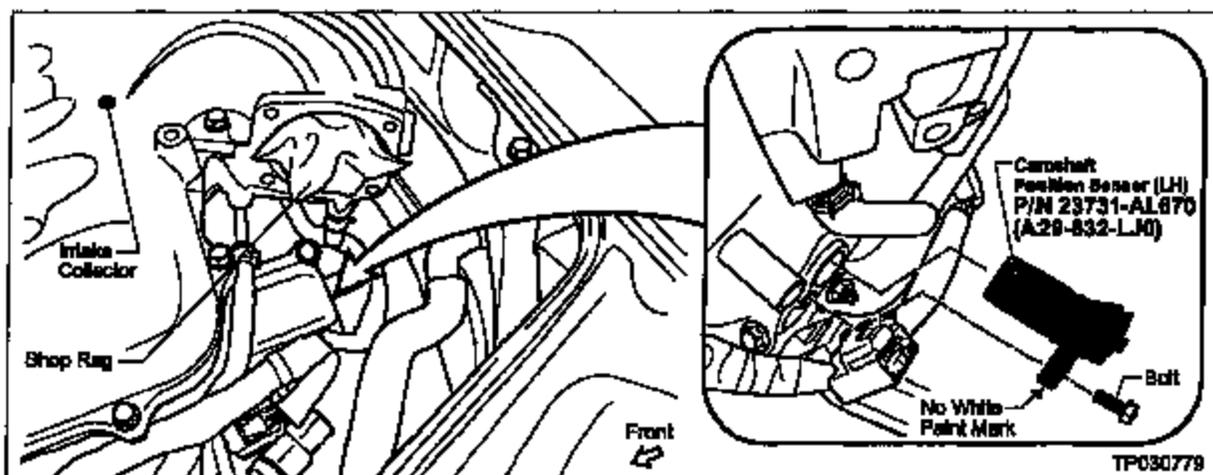


Figure 6

6. Disconnect the vehicle wire harness connector from the sensor.
- NOTE:** If the connector will not release for you, see Figure B (if applicable).
7. Remove and save the bolt that holds the sensor in place.
8. Remove the **Camshaft Position Sensor** with a pulling and twisting motion. Then, using a pair of pliers, break the connector on the **OLD** sensor so it cannot be reused.
9. Clean the hole that the old sensor was removed from.
10. Open the kit bag, remove the **NEW** sensor and apply a thin coat of clean engine oil to the o-ring on the new sensor.
11. Insert (until fully seated) the **NEW** sensor into the hole with a pushing and twisting motion, being careful not to damage the o-ring.
12. Re-install and tighten the sensor mounting bolt to 74 - 96 in-lb (8.4 - 10.8 N-m, 0.86 - 1.1 kg-m).
13. Re-connect the vehicle wire harness connector to the sensor.

Camshaft Position Sensor Replacement (Passenger Side), P/N 23731-6J980* / A29-640-CJ0

* This sensor can be substituted with P/N 23731-6J906 / A29-640-C20.

1. Locate the passenger side (RH) Camshaft Position Sensor (see Figure 7).

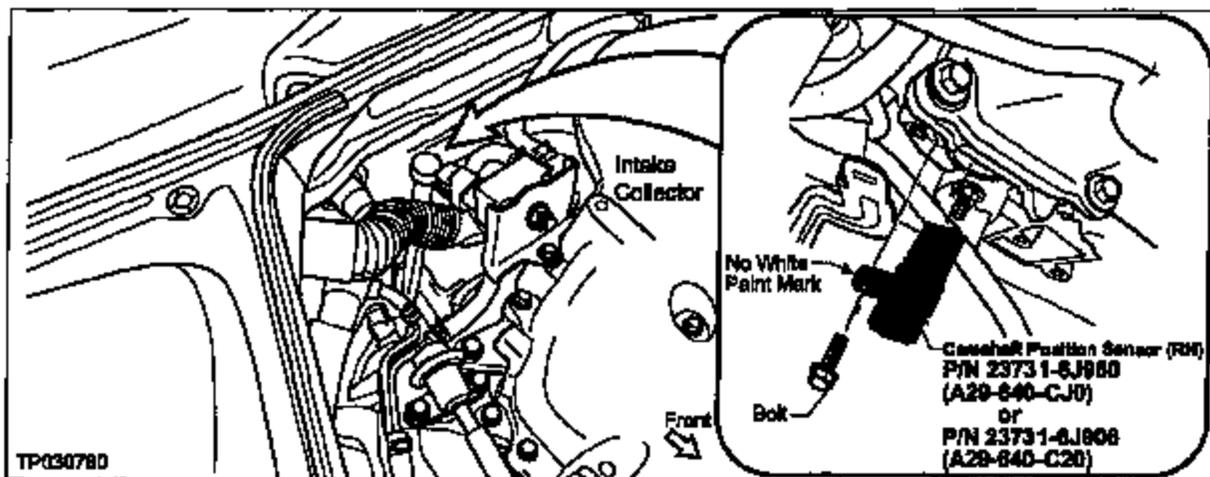


Figure 7

2. Disconnect the vehicle wire harness connector from the sensor.
NOTE: If the connector will not release for you, see Figure B (if applicable).
3. Remove and save the bolt that holds the sensor in place.
4. Remove the **Camshaft Position Sensor** with a pulling and twisting motion. Then, using a pair of pliers, break the connector on the **OLD** sensor so it cannot be reused.
5. Clean the hole that the old sensor was removed from.
6. Open the kit bag, remove the **NEW** sensor and apply a thin coat of clean engine oil to the o-ring on the new sensor.
7. Insert (until fully seated) the **NEW** sensor into the hole with a pushing and twisting motion, being careful not to damage the o-ring.
8. Re-install and tighten the sensor mounting bolt to **74 - 98 in-lb (8.4 - 10.8 N-m, 0.96 - 1.1 kg-m)**.
9. Re-connect the vehicle wire harness connector to the sensor.
10. Remove the shop rag from the Intake collector opening. Then re-install the Throttle Body using the new gasket (see Parts Information). Tighten the Throttle Body screws to **64 - 88 in-lb (7.2 - 9.7 N-m, 0.73 - 0.99 kg-m)**.
11. Re-install the Air Inlet Duct, Upper Engine Cover, and if applicable the Strut Tower Cross Bar.

Crankshaft Position Sensor Replacement (P/N 23731-AL660 / A29-662-LJ0)

1. Raise the vehicle on a hoist.
2. Remove the Lower Engine Cover (see Figure 8).

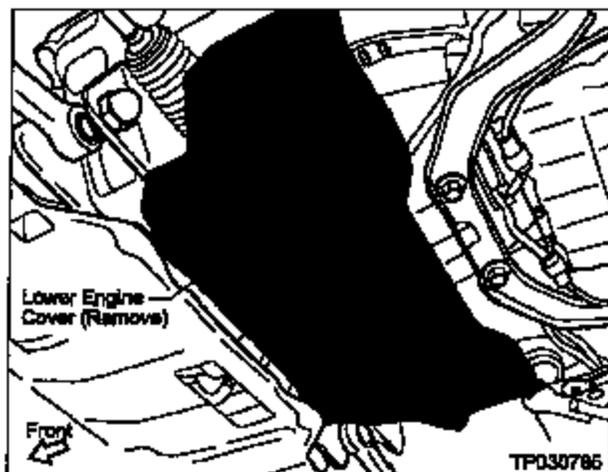


Figure 8

3. Locate the Crankshaft Position Sensor:

- Figure 9 (below) shows the G35 Sedan Crankshaft Position Sensor location
- Figure 9a (next page) shows the G35 Coupe Crankshaft Position Sensor location

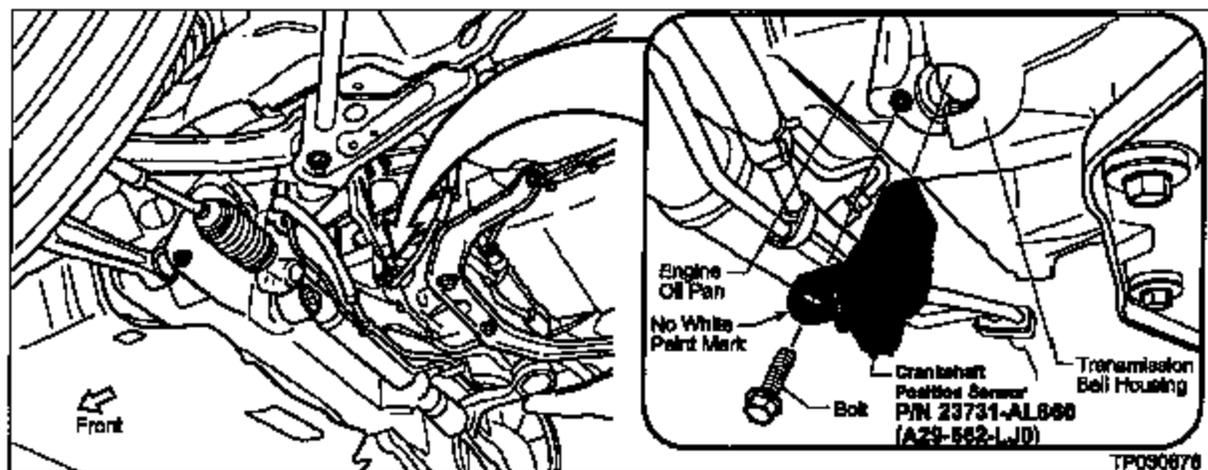


Figure 9 (G35 Sedan Crankshaft Position Sensor Location)


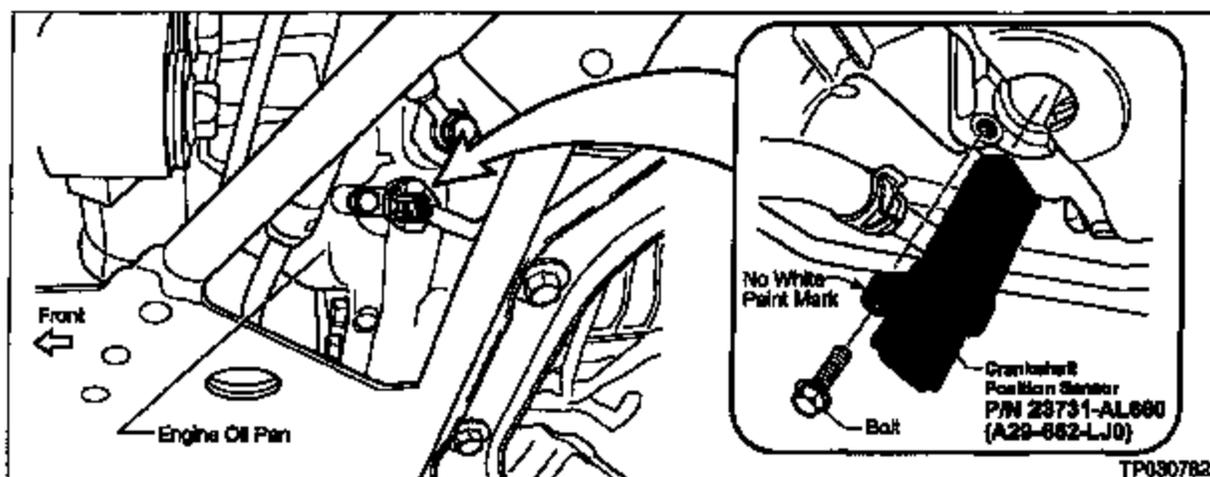


Figure 9a (G35 Coupe Crankshaft Position Sensor Location)

4. Disconnect the vehicle wire harness connector from the sensor.
NOTE: If the connector will not release for you, see Figure B (if applicable).
5. Remove and save the bolt that holds the sensor in place.
6. Remove the Crankshaft Position Sensor with a pulling and twisting motion. Then, using a pair of pliers, break the connector on the OLD sensor so it cannot be reused.
7. Clean the hole that the old sensor was removed from.
8. Open the kit bag, remove the NEW sensor and apply a thin coat of clean engine oil to the o-ring (if applicable) on the new sensor.
9. Insert (until fully seated) the NEW sensor into the hole with a pushing and twisting motion, being careful not to damage the o-ring.
10. Re-install and tighten the sensor mounting bolt to 74 - 96 in-lb (8.4 - 10.8 N-m, 0.96 - 1.1 kg-m).
11. Re-connect the vehicle wire harness connector to the sensor.
12. Re-Install the Lower Engine Cover.
13. Lower the vehicle to the ground.
14. Reconnect the battery cable and reset the radio station presets and clock.

VK45DE Engine (Use Kit P/N 23731-4M527)

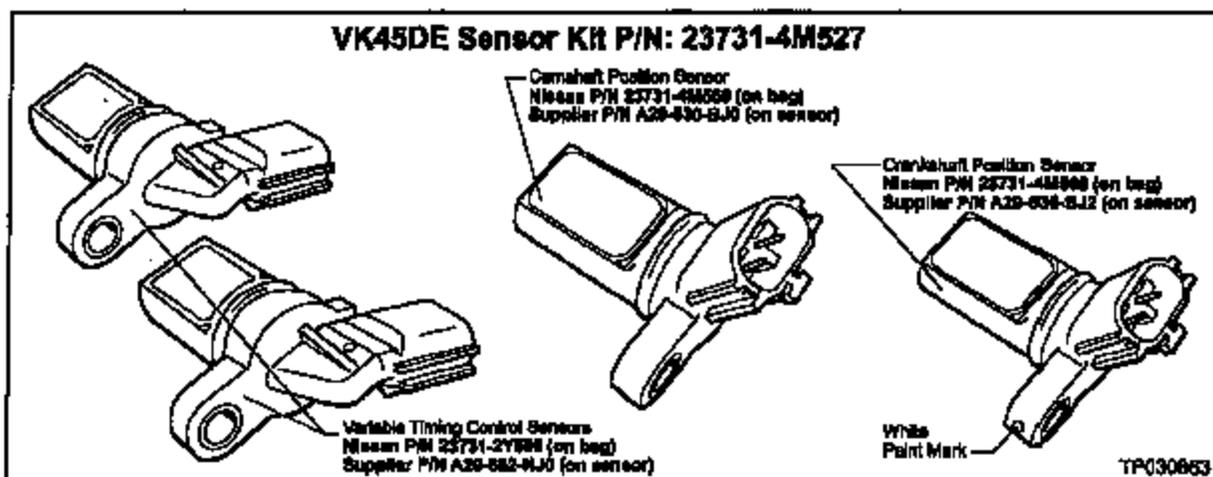

M45 (Y34)

IMPORTANT

- **THE SENSORS IN THIS KIT ARE DIFFERENT. IT IS CRITICAL THAT EACH SENSOR BE INSTALLED IN THE CORRECT LOCATION. REFER TO "FIGURE A" AND THE ILLUSTRATIONS IN THIS REPAIR SECTION FOR SENSOR LOCATIONS.**
- Each new sensor (within each kit) is contained in a bag. The bag is labeled with the Nissan part number. Keep the sensor in the bag until just before it is installed. The supplier part number is on the face of the sensor. This number starts with "A29-".
- The Crankshaft and Camshaft Position Sensors in Sensor Kit P/N 23731-4M527 look the same. To help you tell the difference between these sensors, a white paint mark was added to the Crankshaft sensor (see the illustration above).
- The old and new sensors may appear identical, therefore **KEEP THEM SEPARATE**.

1. Record all radio station presets.
2. Disconnect the negative battery cable.
3. Remove the Upper Engine Cover and Air Inlet Duct (see Figure 10).

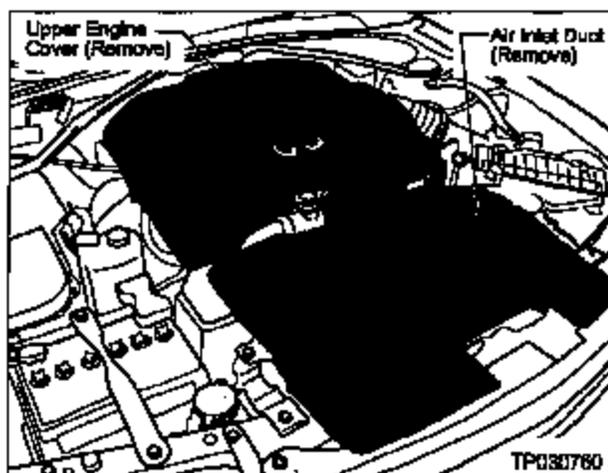


Figure 10

Camshaft Position Sensor and Variable Timing Control Sensors Replacement

4. Locate the Camshaft Position Sensor and the Variable Timing Control Sensors (see Figure 11).

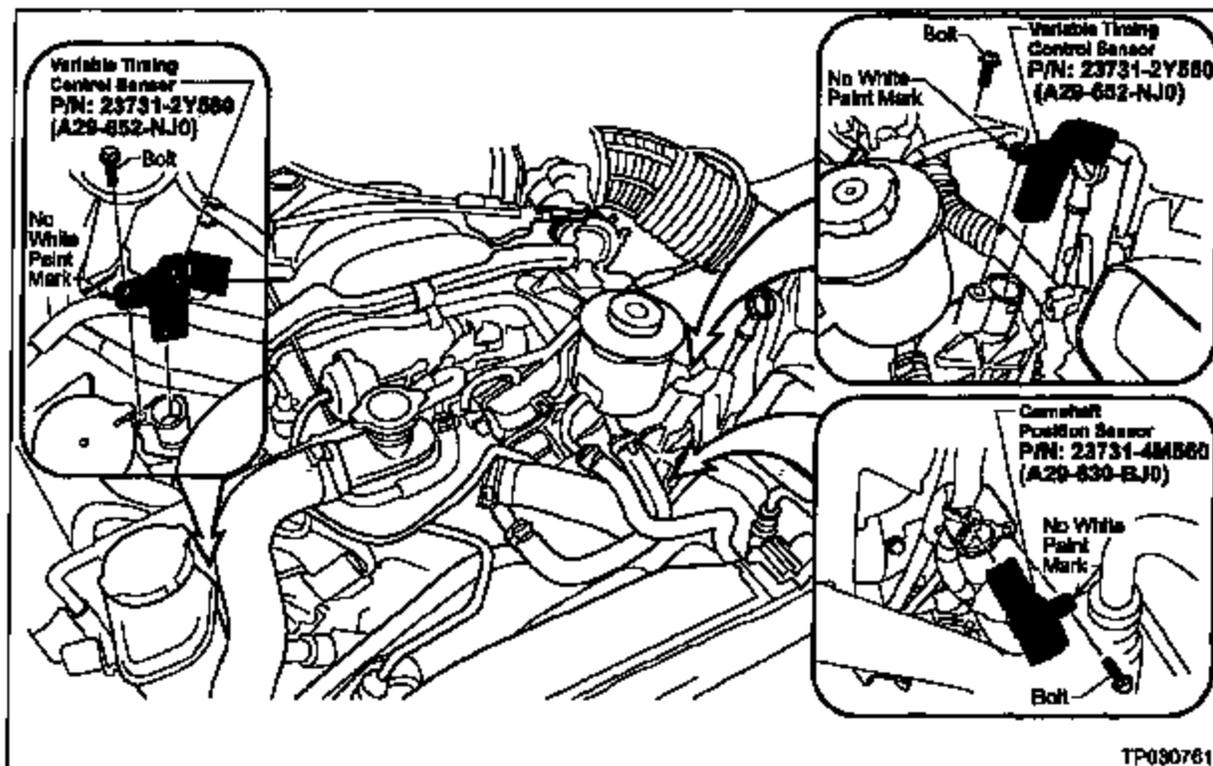


Figure 11

5. Disconnect the vehicle wire harness connectors from the sensors.

NOTE: If the connector will not release for you, see Figure B (if applicable).

6. Remove and save the bolts that hold the sensors in place.

Camshaft Position Sensor (P/N 23731-4M560 / A29-630-BJ0)

7. Remove the Camshaft Position Sensor with a pulling and twisting motion. Then, using a pair of pliers, break the connector on the OLD sensor so it cannot be reused.
8. Clean the hole that the old sensor was removed from.
9. Open the kit bag, remove the NEW sensor and apply a thin coat of clean engine oil to the o-ring on the new sensor.
10. Insert (until fully seated) the NEW sensor into the hole with a pushing and twisting motion, being careful not to damage the o-ring.
11. Re-install and tighten the sensor mounting bolt to 63 – 96 in-lb (7.1 – 10.8 N-m, 0.72 – 1.1 kg-m).
12. Re-connect the vehicle wire harness connector to the sensors.

Variable Timing Control Sensors (P/N 23731-2Y560 / A29-652-NJ0)

IMPORTANT: Perform the following steps on only ONE sensor at a time.

13. Remove the Variable Timing Control Sensor with a pulling and twisting motion. Then, using a pair of pliers, break the connector on the OLD sensor so it cannot be reused.

14. Clean the hole that the old sensor was removed from.
15. Open the kit bag, remove the **NEW** sensor and apply a thin coat of clean engine oil to the o-ring on the new sensor.
16. Insert (until fully seated) the **NEW** sensor into the hole with a pushing and twisting motion, **being careful not to damage the o-ring.**
17. Re-install and tighten the sensor mounting bolt to **63 – 96 In-lb (7.1 – 10.8 N-m, 0.72 – 1.1 kg-m).**
18. Re-connect the vehicle wire harness connectors to the sensors.
19. Re-install the Upper Engine Cover and Air Inlet Duct.

Crankshaft Position Sensor* Replacement (P/N 23731-4M568 / A29-630-BJ2)

* This sensor has a white paint mark on it (see Figure 13, below).

1. Raise the vehicle on a hoist.
2. Remove the Lower Engine Cover (see Figure 12).

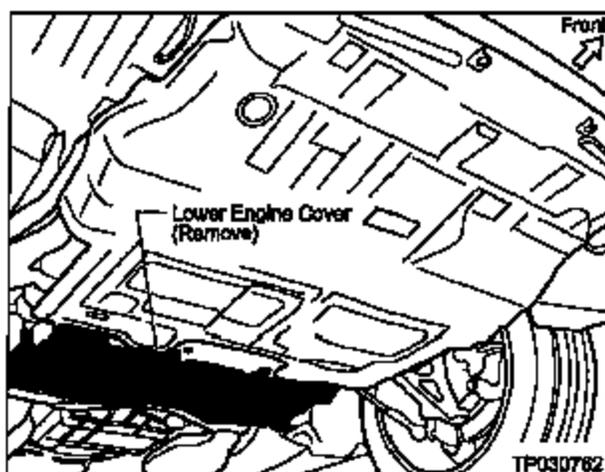


Figure 12

3. Locate the Crankshaft Position Sensor (see Figure 13).

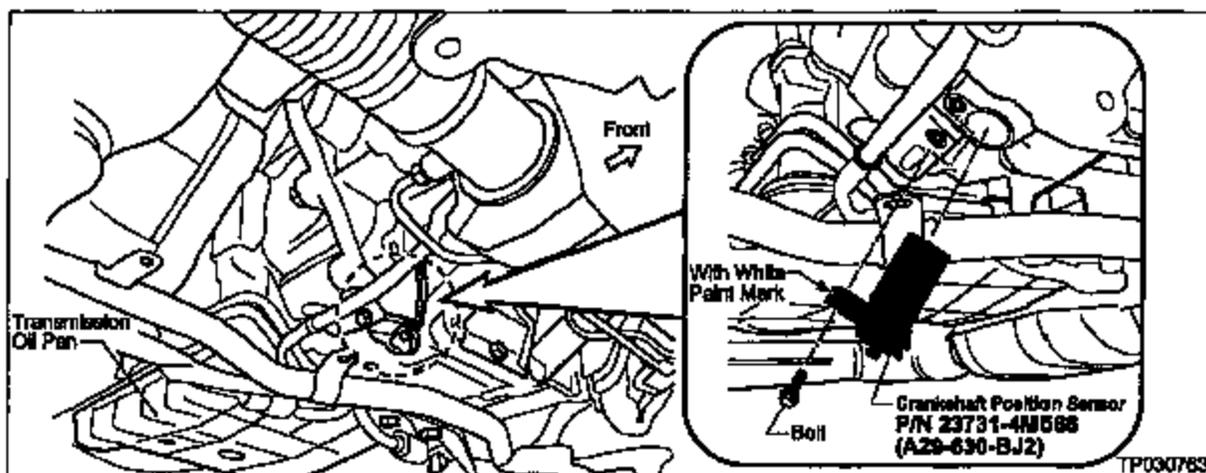


Figure 13

4. Disconnect the vehicle wire harness connector from the sensor.
NOTE: If the connector will not release for you, see Figure B (if applicable).
5. Remove and save the bolt that holds the sensor in place.

6. Remove the Crankshaft Position Sensor with a pulling and twisting motion. Then, using a pair of pliers, break the connector on the OLD sensor so it cannot be reused.
7. Clean the hole that the old sensor was removed from.
8. Open the kit bag, remove the NEW sensor and apply a thin coat of clean engine oil to the o-ring (if applicable) on the new sensor.
9. Insert (until fully seated) the NEW sensor into the hole with a pushing and twisting motion, being careful not to damage the o-ring.
10. Re-install and tighten the sensor mounting bolt to 74 - 96 in-lb (8.4 - 10.8 N-m, 0.88 - 1.1 kg-m).
11. Re-connect the vehicle wire harness connector to the sensor.
12. Re-install the Lower Engine Cover.
13. Lower the vehicle to the ground.
14. Reconnect the battery cable and reset the radio station presets and clock.

Q45 (F50)

IMPORTANT

- THE SENSORS IN THIS KIT ARE DIFFERENT. IT IS CRITICAL THAT EACH SENSOR BE INSTALLED IN THE CORRECT LOCATION. REFER TO "FIGURE A" AND THE ILLUSTRATIONS IN THIS REPAIR SECTION FOR SENSOR LOCATIONS.
- Each new sensor (within each kit) is contained in a bag. The bag is labeled with the Nissan part number. Keep the sensor in the bag until just before it is installed. The supplier part number is on the face of the sensor. This number starts with "A29-".
- The Crankshaft and Camshaft Position Sensors in Sensor Kit P/N 23731-4M527 look the same. To help you tell the difference between these sensors, a white paint mark was added to the Crankshaft sensor (see the illustration at the top of page 13).
- The old and new sensors may appear identical, therefore KEEP THEM SEPARATE.

1. Record all radio station presets.
2. Disconnect the negative battery cable.
3. Remove the Upper Engine Cover and Air Inlet Duct (see Figure 14).

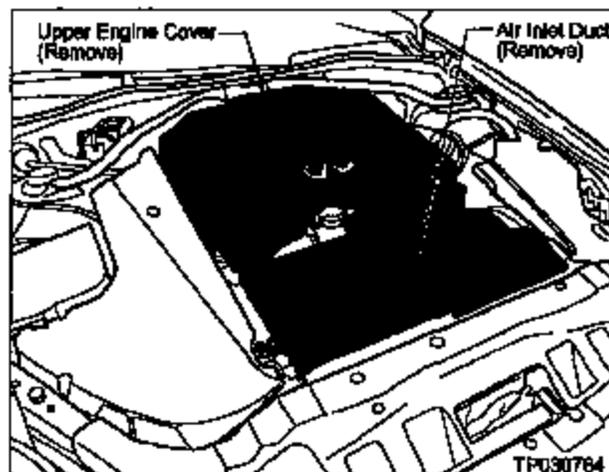


Figure 14

Camshaft Position Sensor and Variable Timing Control Sensors Replacement

4. Locate the Camshaft Position Sensor and the Variable Timing Control Sensors (see Figure 15).

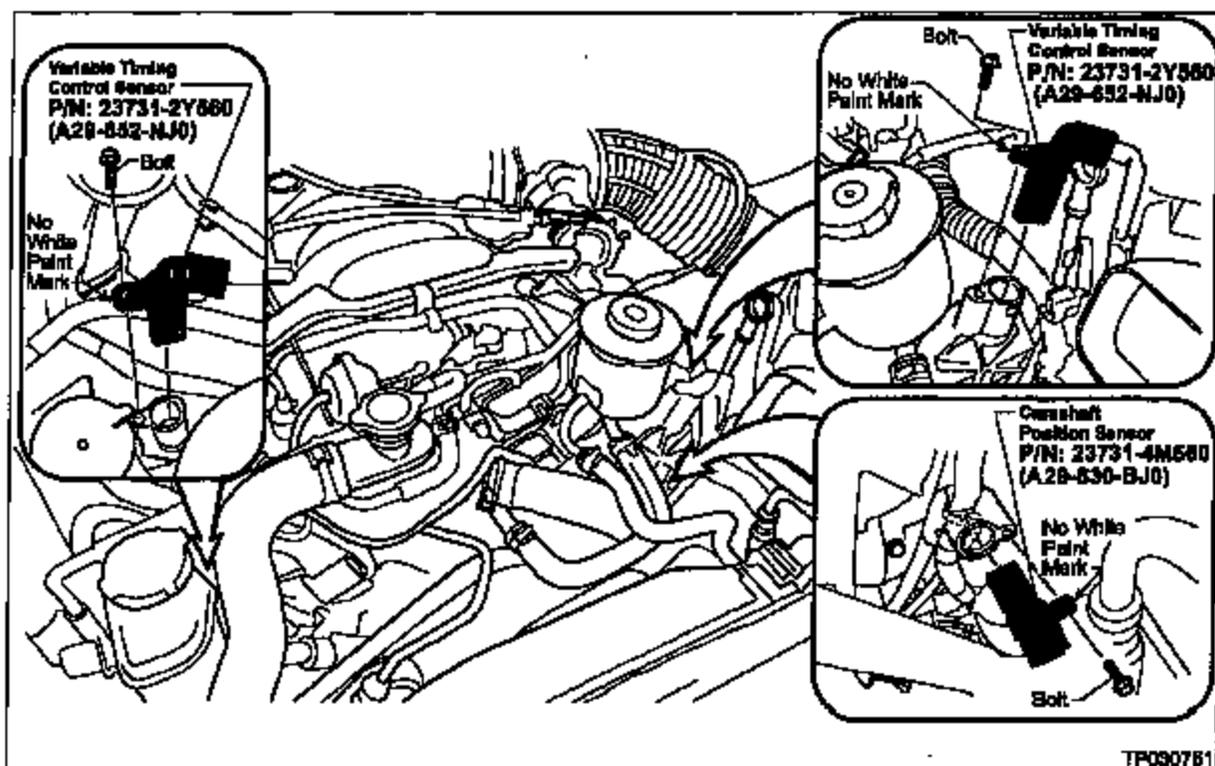


Figure 15

5. Disconnect the vehicle wire harness connectors from the sensors.
NOTE: If the connector will not release for you, see Figure B (if applicable).
6. Remove and save the bolts that hold the sensors in place.

Camshaft Position Sensor (P/N 23731-4M560 / A29-630-BJ0)

7. Remove the Camshaft Position Sensor with a pulling and twisting motion. Then, using a pair of pliers, break the connector on the OLD sensor so it cannot be reused.
8. Clean the hole that the old sensor was removed from.
9. Open the kit bag, remove the NEW sensor and apply a thin coat of clean engine oil to the o-ring on the new sensor.
10. Insert (until fully seated) the NEW sensor into the hole with a pushing and twisting motion, being careful not to damage the o-ring.
11. Re-install and tighten the sensor mounting bolt to 63 – 96 in-lb (7.1 – 10.8 N-m, 0.72 – 1.1 kg-m).
12. Re-connect the vehicle wire harness connector to the sensor.

Variable Timing Control Sensors (P/N 23731-2Y580 / A29-852-NJ0)

IMPORTANT: Perform the following steps on only **ONE** sensor at a time.

13. Remove the Variable Timing Control Sensors with a pulling and twisting motion. Then, using a pair of pliers, break the connector on the OLD sensor so it cannot be reused.
14. Clean the hole that the old sensor was removed from.
15. Open the kit bag, remove the NEW sensor and apply a thin coat of clean engine oil to the o-ring on the new sensor.
16. Insert (until fully seated) the NEW sensors into the hole with a pushing and twisting motion, being careful not to damage the o-ring.
17. Re-install and tighten the sensor mounting bolts to 63 – 96 in-lb (7.1 – 10.8 N-m, 0.72 – 1.1 kg-m).
18. Re-connect the vehicle wire harness connectors to the sensors.
19. Re-install the Upper Engine Cover and Air Inlet Duct.

Crankshaft Position Sensor* Replacement (P/N 23731-4M566 / A29-630-BJ2)

* This sensor has a white paint mark on it (see Figure 17, next page).

1. Raise the vehicle on a hoist.
2. Remove the Lower Engine Cover (see Figure 16).

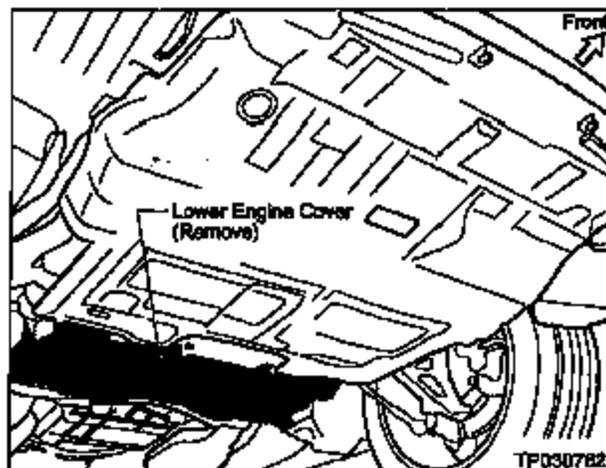


Figure 16

3. Locate the Crankshaft Position Sensor (see Figure 17).

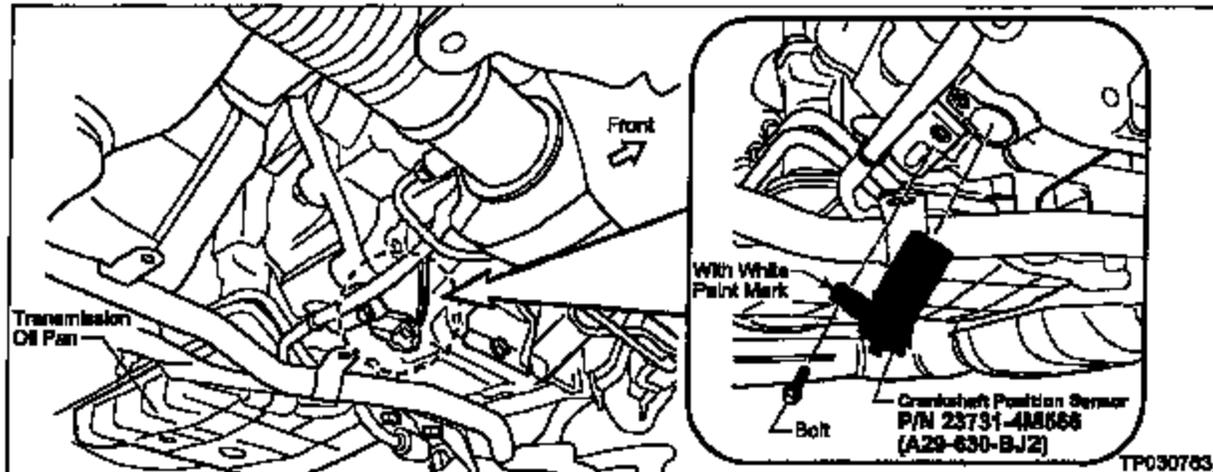


Figure 17

4. Disconnect the vehicle wire harness connector from the sensor.
NOTE: If the connector will not release for you, see Figure B (if applicable).
5. Remove and save the bolt that holds the sensor in place.
6. Remove the Crankshaft Position Sensor with a pulling and twisting motion. Then, using a pair of pliers, break the connector on the OLD sensor so it cannot be reused.
7. Clean the hole that the old sensor was removed from.
8. Open the kit bag, remove the NEW sensor and apply a thin coat of clean engine oil to the o-ring (if applicable) on the new sensor.
9. Insert (until fully seated) the NEW sensor into the hole with a pushing and twisting motion, being careful not to damage the o-ring.
10. Re-install and tighten the sensor mounting bolt to **74 - 98 in-lb (8.4 - 10.8 N-m, 0.86 - 1.1 kg-m).**
11. Re-connect the vehicle wire harness connector to the sensor.
12. Re-Install the Lower Engine Cover.
13. Lower the vehicle to the ground.
14. Reconnect the battery cable and reset the radio station presets and clock.

PARTS INFORMATION

DESCRIPTION	PART NUMBER	QTY
Sensor Kit (VQ35DE)	23731-AL627	1
Sensor Kit (VK45DE)	23731-4M527	1

The following part (Gasket – Throttle Body) is ONLY for G35 Sedan and Coupe.

Gasket – Throttle Body	A6175-AR000	1
------------------------	-------------	---

CLAIMS INFORMATION

Submit a "Campaign" (CM) line claim using the following claims coding information:

If identified on Service Comm with Campaign LD.: R3021

DESCRIPTION	OP CODE	FRT
Install new engine sensor kit	R30210	0.5 hrs. (I35, M45, Q45)
Install new engine sensor kit	R30211	0.7hrs. (G35)

OWNER'S LETTER

Dear Infiniti owner:

This notice is sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act. Infiniti has decided that a defect which relates to motor vehicle safety exists in some 2002-2003 model year Infiniti vehicles. Our records indicate that you own the Infiniti vehicle identified by the Vehicle Identification Number on the cover of this notice.

Reason for Recall

On some 2002-2003 model year Infiniti vehicles, there is a possibility that the engine might stop running while being driven if the crank position sensor fails. This may also result in the "Service Engine Soon" light coming on or reduced engine power. If the engine stops running while driving, this could result in a crash without warning.

What Infiniti Will Do

In order to prevent this incident from occurring, your Infiniti dealer will replace the crank position sensors. This free service should take about one hour to complete, but your Infiniti dealer may require your vehicle for a longer period of time based upon their work schedule, or parts availability.

What You Should Do

Contact your Infiniti dealer at your earliest convenience in order to arrange an appointment to have your vehicle repaired. **If the "Service Engine Soon" light comes on, contact your dealer as soon as possible to have your vehicle inspected.** Please bring this notice with you when you keep your service appointment. Instructions have been sent to your Infiniti dealer. If the dealer fails, or is unable to make the necessary repairs free of charge, you may contact an Infiniti representative toll free at (800) 662-6200. If you reside in Hawaii, please call 1-808-636-0888. You may also contact the Administrator of the National Highway Traffic Safety Administration, 400 Seventh Street SW, Washington, D.C. 20590 or call the toll free Safety Hotline at (888) 327-4236.

If you have paid to have a crank position sensor replaced prior to this campaign, you may be eligible for reimbursement of the related expense. Contact an Infiniti representative at the numbers listed above for additional information on how to obtain a reimbursement.

Federal law requires that any vehicle lessor receiving this recall notice must forward a copy of this notice to the lessee within ten days.

Thank you for your cooperation. We are indeed sorry for any inconvenience this may cause you.



RECALL CAMPAIGN BULLETIN

Reference:

NTB03-124

Date:

December 19, 2003

VOLUNTARY RECALL CAMPAIGN ENGINE SENSORS

CAMPAIGN I.D.# / NHTSA #: R3022 / 03V-455

APPLIED VEHICLES: 2000-03 Sentra (B15)
2002 Altima (L31)
2002-03 Maxima (A33)
2003 Murano (Z50)
2003 350Z (Z33)

APPLIED VINS:

Sentra

3N1*B*1**YL 000201 - 385976
3N1*B*1**1L 004135 - 525647
3N1*B*1**2L 550003 - 730181
3N1*B*1**3L 556548 - 730379

Altima

1N4AL11**2C100030 - 718759
1N4BL11**2C100029 - 718752

Maxima

JN1DA*1**2T 000002 - 454881
JN1DA*1**3T 400002 - 515067

Murano

JN8AZ08T*3W 100007 - 100032
JN8AZ08W*3W 200005 - 200071

350Z

JN1AZ*4**3T 000001 - 100167

APPLIED ENGINES: QG18DE, QR25DE, VQ35DE

NOTE: Use Service Comm. to confirm campaign eligibility.

INTRODUCTION

Nissan has determined that some 2000-2003 model year Nissan vehicles may have a defect which relates to motor vehicle safety. The engine might stop running while being driven if the crank position sensor or cam position sensor fails. This may also result in the "Service Engine Soon" light coming on or reduced engine power. If the engine stops running while driving, this could result in a crash without warning.

IDENTIFICATION NUMBER

Nissan has assigned identification number R3022 to this campaign. This number must appear on all communications and documentation of any nature dealing with this campaign.

NUMBER OF VEHICLES POTENTIALLY AFFECTED

The number of vehicles potentially affected is approximately 572,000.

DEALER RESPONSIBILITY

It is the retailer's responsibility to check Service Comm for the campaign status on each vehicle falling within the range of this voluntary safety recall which for any reason enters the service department. This includes vehicles purchased from private parties or presented by transient (tourist) owners and vehicles in a dealer's inventory. **Federal law requires that new vehicles in dealer inventory which are the subject of a safety recall must be corrected prior to sale. Failure to do so can result in civil penalties by the National Highway Traffic Safety Administration.** While federal law applies only to new vehicles, Nissan strongly encourages dealers to correct any used vehicles in their inventory before they are retailed.

SERVICE PROCEDURE

You will replace the following sensors: Crankshaft Position Sensor, Camshaft Position Sensor(s), and in some cases the Variable Timing Control Sensor(s). The service procedures are divided by engine 'family' and vehicle model (see Figure C, next page).

NOTE: Use Service Comm to confirm the vehicle is included in this campaign before performing the following procedure.

IMPORTANT

- There are three sensor kits associated with this campaign – one kit for each engine family (see Figure A, below).
- **THE SENSORS IN EACH KIT ARE DIFFERENT. IT IS CRITICAL THAT EACH SENSOR BE INSTALLED IN THE CORRECT LOCATION. REFER TO FIGURE A (BELOW) AND THE ILLUSTRATIONS IN EACH REPAIR SECTION FOR SENSOR LOCATIONS.**
- Each new sensor (within each kit) is contained in a bag. The bag is labeled with the Nissan part number. Keep the sensor in the bag until just before it is installed. The supplier part number is molded onto the face of the sensor. This number starts with "A29-".
- The Crankshaft and Camshaft Position Sensors in Sensor Kits P/N 23731-4M528 and 23731-6N225 look the same. To help you tell the difference between these sensors, a white paint mark was added to the Crankshaft sensor (see Figure A).
- The old and new sensors may appear identical, therefore **KEEP THEM SEPARATE**.
- When disconnecting the vehicle harness connector* from the sensor(s); first **PUSH** the Release Button Inward, then **PULL** the connector back (see Figure B, next page). **NOTE:** Do NOT pull on the wires when disconnecting the connector.
* The button for this connector is green and the connector body color is green or black.

Sensor Kits (Based on Engine Family)

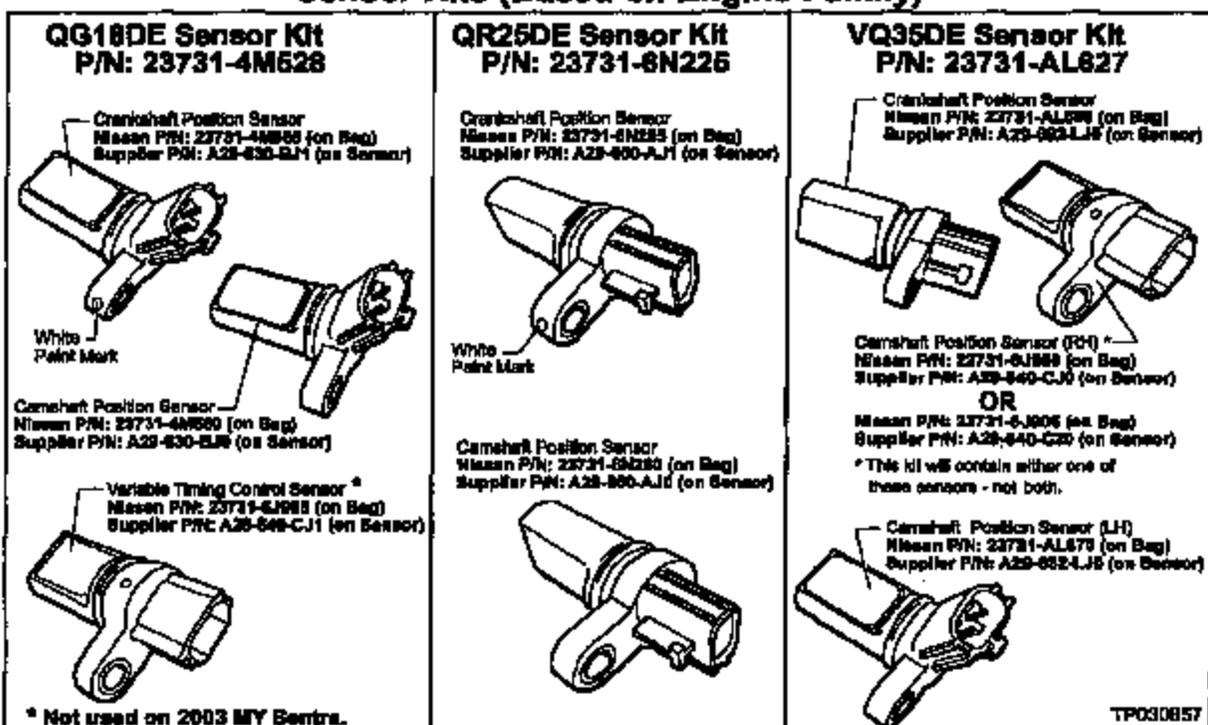


Figure A

Sensor Connector Release

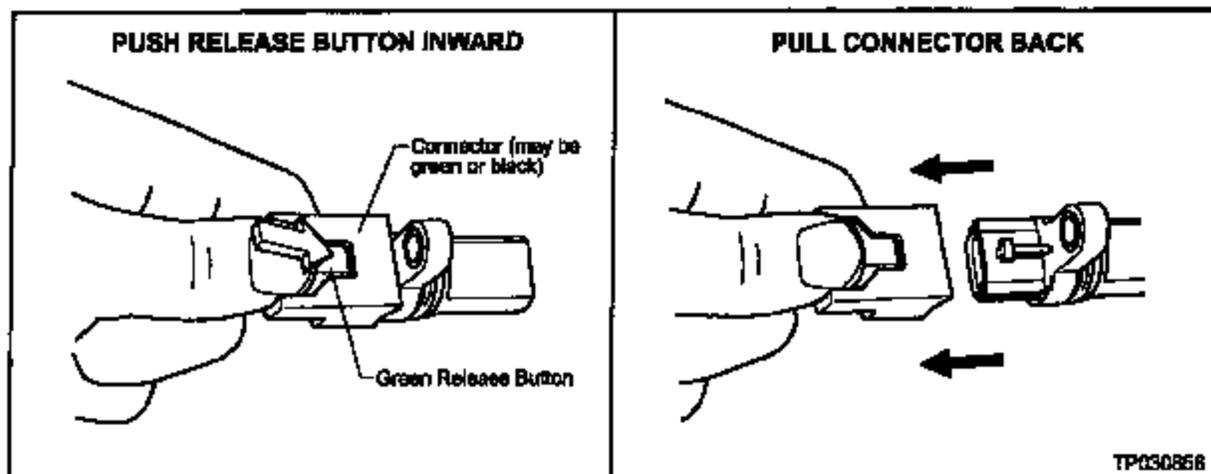


Figure B


NOTE: Do NOT pull on the wires when disconnecting the connector.

Sensor Replacement Procedures

Model	QG18DE	QR25DE	VQ35DE
2000-02 MY Sentra – B15	Page 5	Page 10	
2003 MY Sentra – B15	Page 8		
Altima – L31		Page 12	Page 13
Maxima – A33			Page 16
Murano – Z50			Page 18
350Z – Z33			Page 20

Figure C

QG18DE Engine (Use Kit P/N 23731-4M528)

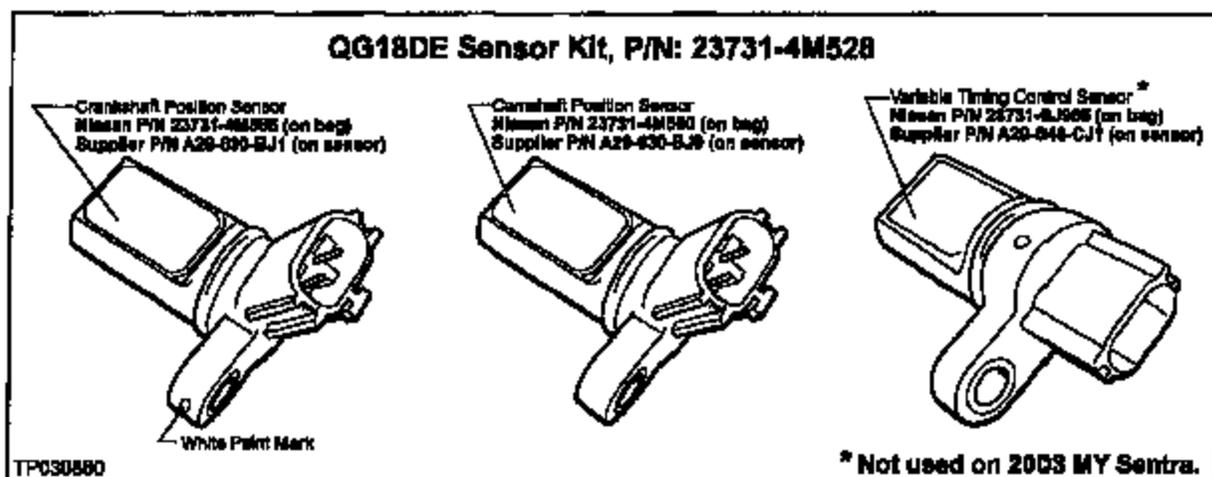

2000-02 MY Sentra (B15)

IMPORTANT

- **THE SENSORS IN THIS KIT ARE DIFFERENT. IT IS CRITICAL THAT EACH SENSOR BE INSTALLED IN THE CORRECT LOCATION. REFER TO "FIGURE A" AND THE ILLUSTRATIONS IN THIS REPAIR SECTION FOR SENSOR LOCATIONS.**
- Each new sensor (within each kit) is contained in a bag. The bag is labeled with the Nissan part number. Keep the sensor in the bag until just before it is installed. The supplier part number is on the face of the sensor. This number starts with "A29-".
- The Crankshaft and Camshaft Position Sensors in Sensor Kit P/N 23731-4M528 look the same. To help you tell the difference between these sensors, a white paint mark was added to the Crankshaft sensor (see illustration above).
- The old and new sensors may appear identical, therefore **KEEP THEM SEPARATE**.

Camshaft Position Sensor and Variable Timing Control Sensor Replacement

1. Record all radio station presets.
2. Disconnect the negative battery cable.
3. Locate the **Camshaft Position Sensor** and the **Variable Timing Control Sensor** (see Figure 1).

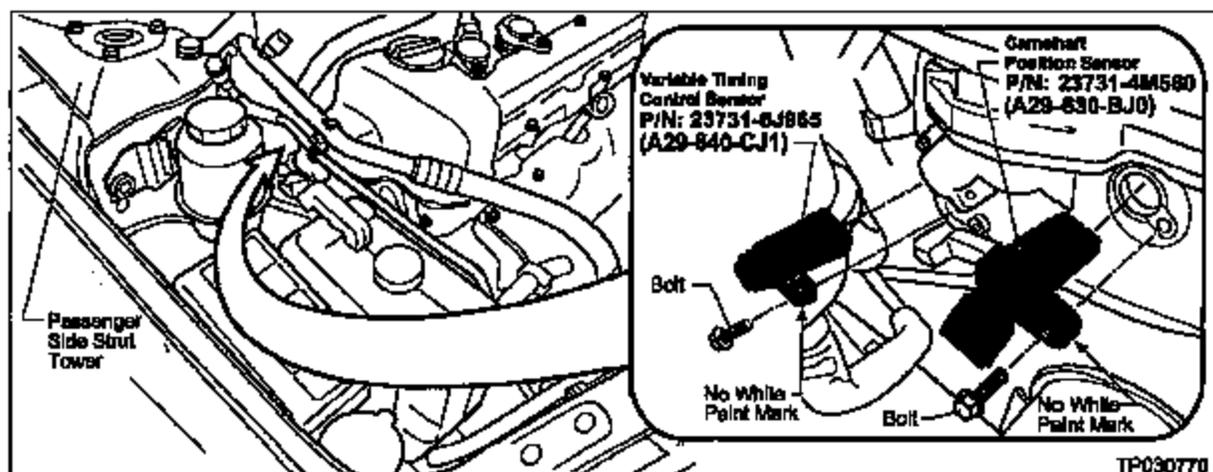


Figure 1

4. Disconnect the vehicle wire harness connectors from the sensors.
NOTE: If the connector will not release for you, see Figure B (if applicable).
5. Remove and save the bolts that hold the sensors in place.

Camshaft Position Sensor (P/N 27731-4M560 / A29-630-BJ0)

6. Remove the **Camshaft Position Sensor** with a pulling and twisting motion. Then, using a pair of pliers, break the connector on the **OLD** sensor so it cannot be reused.
7. Clean the hole that the old sensor was removed from.
8. Open the kit bag, remove the **NEW** sensor and apply a thin coat of clean engine oil to the o-ring on the new sensor.
9. Insert (until fully seated) the **NEW** sensor into the hole with a pushing and twisting motion, being careful not to damage the o-ring.
10. Re-install and tighten the sensor mounting bolt to **64 - 97 In-lb (7.2 – 11.0 N-m, 0.73 – 1.1 kg-m).**
11. Re-connect the vehicle wire harness connector to the sensor.

Variable Timing Control Sensor (P/N 23731-6J965 / A29-640-CJ1)

12. Remove the **Variable Timing Control Sensor** with a pulling and twisting motion. Then, using a pair of pliers, break the connector on the **OLD** sensor so it cannot be reused.
13. Clean the hole that the old sensor was removed from.
14. Open the kit bag, remove the **NEW** sensor and apply a thin coat of clean engine oil to the o-ring on the new sensor.
15. Insert (until fully seated) the **NEW** sensor into the hole with a pushing and twisting motion, being careful not to damage the o-ring.
16. Re-install and tighten the sensor mounting bolt to **64 - 97 In-lb (7.2 – 11.0 N-m, 0.73 – 1.1 kg-m).**
17. Re-connect the vehicle wire harness connector to the sensor.

Crankshaft Position Sensor* Replacement (P/N 23731-4M565 / A29-630-BJ1)

* This sensor has a white paint mark on it (see Figure 2).

1. Raise the vehicle on a hoist.
2. Locate the **Crankshaft Position Sensor** (see Figure 2).

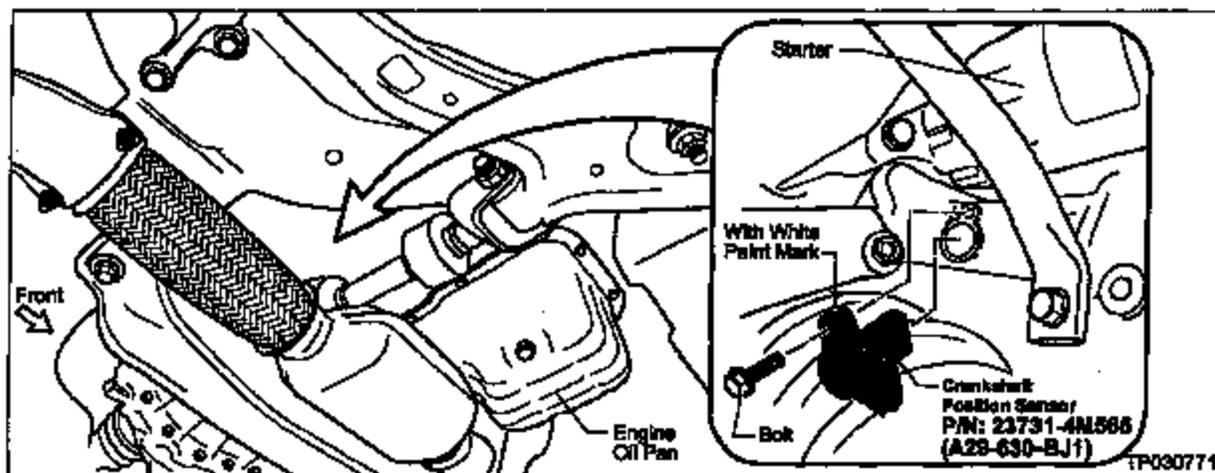


Figure 2

3. Disconnect the vehicle wire harness connector from the sensor.
NOTE: If the connector will not release for you, see Figure B (if applicable).
4. Remove and save the bolt that holds the sensor in place.
5. Remove the **Crankshaft Position Sensor** with a pulling and twisting motion. Then, using a pair of pliers, break the connector on the **OLD** sensor so it cannot be reused.
6. Clean the hole that the old sensor was removed from.
7. Open the kit bag, remove the **NEW** sensor and apply a thin coat of clean engine oil to the o-ring on the new sensor.
8. Insert (until fully seated) the **NEW** sensor into the hole with a pushing and twisting motion, being careful not to damage the o-ring.
9. Re-install and tighten the sensor mounting bolt to **64 - 97 in-lb (7.2 - 11.0 N-m, 0.73 - 1.1 kg-m).**
10. Re-connect the vehicle wire harness connector to the sensor.
11. Lower the vehicle to the ground.
12. Reconnect the battery cable and reset the radio station presets and clock.

2003 MY Sentra (B15)

IMPORTANT

- **THE SENSORS IN THIS KIT ARE DIFFERENT. IT IS CRITICAL THAT EACH SENSOR BE INSTALLED IN THE CORRECT LOCATION. REFER TO "FIGURE A" AND THE ILLUSTRATIONS IN THIS REPAIR SECTION FOR SENSOR LOCATIONS.**
- Each new sensor (within each kit) is contained in a bag. The bag is labeled with the Nissan part number. Keep the sensor in the bag until just before it is installed. The supplier part number is on the face of the sensor. This number starts with "A29-".
- The Crankshaft and Camshaft Position Sensors in Sensor Kit P/N 23731-4M528 look the same. To help you tell the difference between these sensors, a white paint mark was added to the Crankshaft sensor (see the illustration at the top of page 5).
- The old and new sensors may appear identical, therefore **KEEP THEM SEPARATE**.
- The Variable Timing Control Sensor (P/N 23731-6J965 / A29-640-CJ1) is **NOT** used on the 2003 MY Sentra.

Camshaft Position Sensor Replacement (P/N 23731-4M560 / A29-630-BJ0)

1. Record all radio station presets.
2. Disconnect the negative battery cable.
3. Locate the Camshaft Position Sensor (see Figure 3).

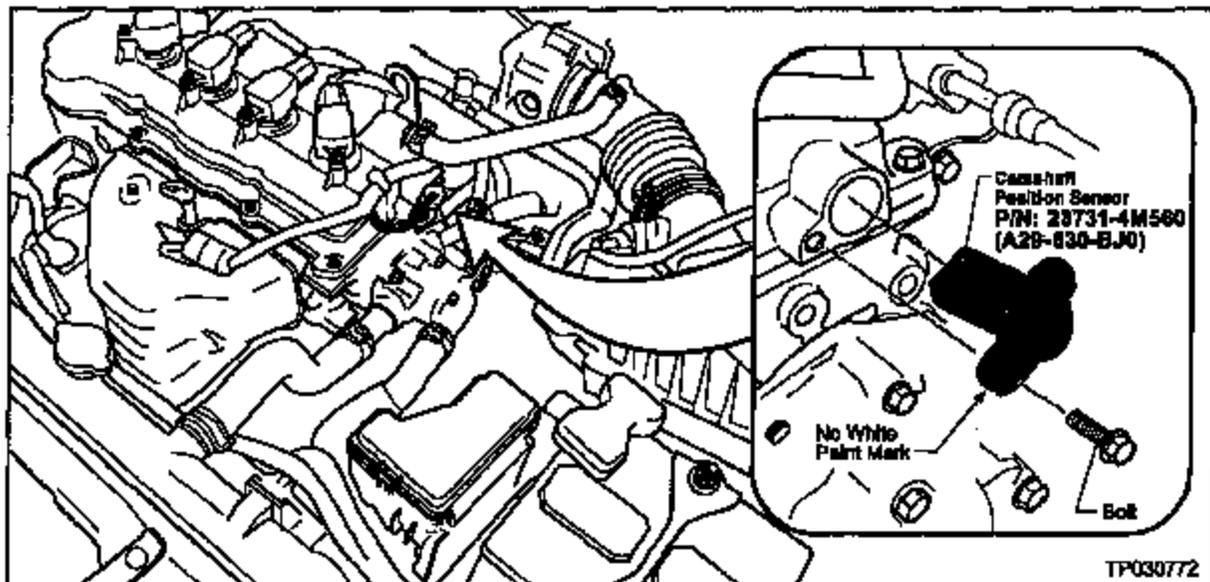


Figure 3

4. Disconnect the vehicle wire harness connector from the sensor.
NOTE: If the connector will not release for you, see Figure B (if applicable).
5. Remove and save the bolt that holds the sensor in place.
6. Remove the Camshaft Position Sensor with a pulling and twisting motion. Then, using a pair of pliers, break the connector on the OLD sensor so it cannot be reused.
7. Clean the hole that the old sensor was removed from.
8. Open the kit bag, remove the **NEW** sensor and apply a thin coat of clean engine oil to the o-ring on the new sensor.

9. Insert (until fully seated) the **NEW** sensor into the hole with a pushing and twisting motion, being careful not to damage the o-ring.
10. Re-install and tighten the sensor mounting bolt to **64 - 97 in-lb (7.2 – 11.0 N-m, 0.73 – 1.1 kg-m).**
11. Re-connect the vehicle wire harness connector to the sensor.

Crankshaft Position Sensor* Replacement (P/N 23731-4M565 / A29-630-BJ1)

* This sensor has a white paint mark on it (see Figure 4).

1. Raise the vehicle on a hoist.
2. Locate the **Crankshaft Position Sensor** (see Figure 4).


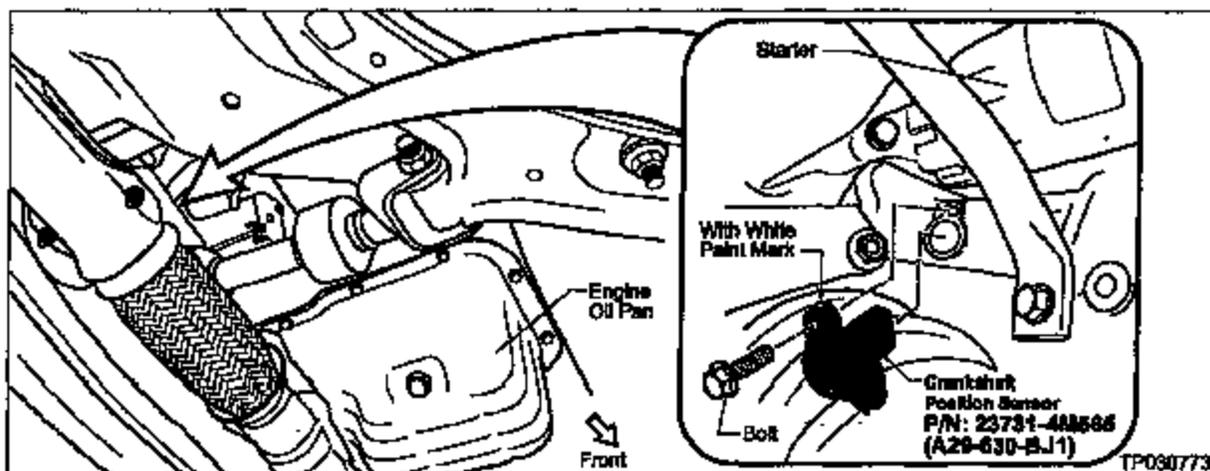


Figure 4

3. Disconnect the vehicle wire harness connector from the sensor.
NOTE: If the connector will not release for you, see Figure B (if applicable).
4. Remove and save the bolt that holds the sensor in place.
5. Remove the **Crankshaft Position Sensor** with a pulling and twisting motion. Then, using a pair of pliers, break the connector on the **OLD** sensor so it cannot be reused.
6. Clean the hole that the old sensor was removed from.
7. Open the kit bag, remove the **NEW** sensor and apply a thin coat of clean engine oil to the o-ring on the new sensor.
8. Insert (until fully seated) the **NEW** sensor into the hole with a pushing and twisting motion, being careful not to damage the o-ring.
9. Re-install and tighten the sensor mounting bolt to **64 - 97 in-lb (7.2 – 11.0 N-m, 0.73 – 1.1 kg-m).**
10. Re-connect the vehicle wire harness connector to the sensor.
11. Lower the vehicle to the ground.
12. Reconnect the battery cable and reset the radio station presets and clock.

QR25DE Engine (Use Kit P/N 23731-6N225)

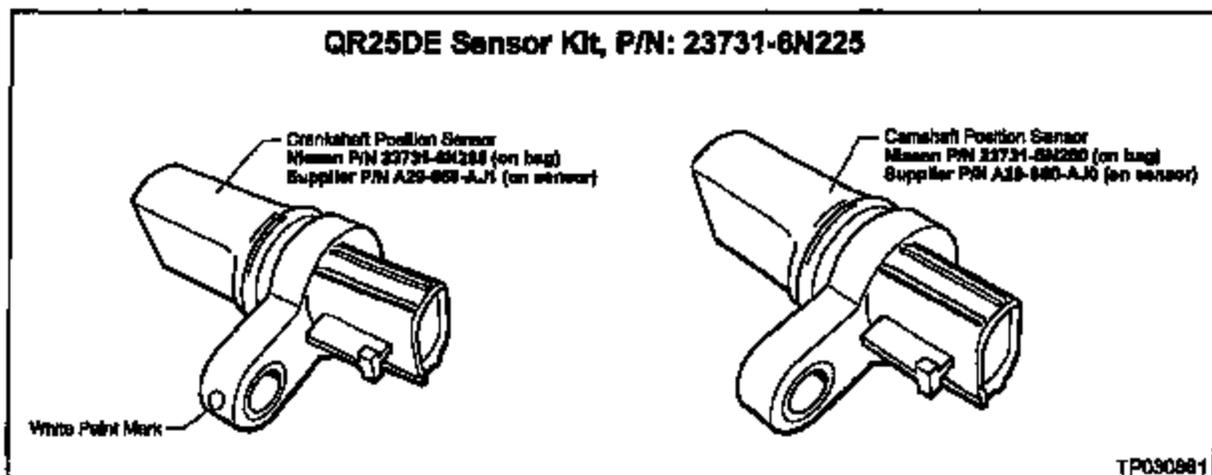

Sentra (B15)

IMPORTANT

- **THE SENSORS IN THIS KIT ARE DIFFERENT. IT IS CRITICAL THAT EACH SENSOR BE INSTALLED IN THE CORRECT LOCATION. REFER TO "FIGURE A" AND THE ILLUSTRATIONS IN THIS REPAIR SECTION FOR SENSOR LOCATIONS.**
- Each new sensor (within each kit) is contained in a bag. The bag is labeled with the Nissan part number. Keep the sensor in the bag until just before it is installed. The supplier part number is on the face of the sensor. This number starts with "A29-".
- The Crankshaft and Camshaft Position Sensors in Sensor Kit P/N 23731-6N225 look the same. To help you tell the difference between these sensors, a white paint mark was added to the Crankshaft sensor (see illustration above).
- The old and new sensors may appear identical, therefore **KEEP THEM SEPARATE**.

Camshaft Position Sensor Replacement (P/N 23731-6N260 / A29-860-AJ0)

1. Record all radio station presets.
2. Disconnect the negative battery cable.
3. Locate the **Camshaft Position Sensor** (see Figure 5).

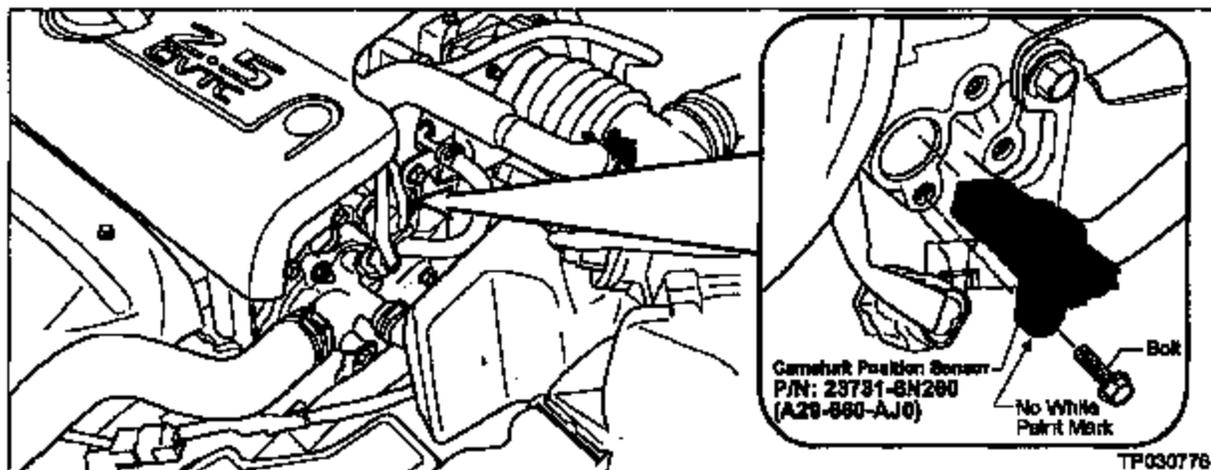


Figure 5

4. Disconnect the vehicle wire harness connector from the sensor.
NOTE: If the connector will not release for you, see Figure B (if applicable).
5. Remove and save the bolt that holds the sensor in place.
6. Remove the **Camshaft Position Sensor** with a pulling and twisting motion. Then, using a pair of pliers, break the connector on the **OLD** sensor so it cannot be reused.
7. Clean the hole that the old sensor was removed from.
8. Open the kit bag, remove the **NEW** sensor and apply a thin coat of clean engine oil to the o-ring on the new sensor.
9. Insert (until fully seated) the **NEW** sensor into the hole with a pushing and twisting motion, being careful not to damage the o-ring.
10. Re-install and tighten the sensor mounting bolt to **48 - 65 In-lb (5.4 - 7.3 N-m, 0.55 - 0.75 kg-m).**
11. Re-connect the vehicle wire harness connector to the sensor.

Crankshaft Position Sensor* Replacement (P/N 23731-6N265 / A29-660-AJ1)

* This sensor has a white paint mark on it (see Figure 6).

1. Raise the vehicle on a hoist.
2. Locate the **Crankshaft Position Sensor** (see Figure 6).

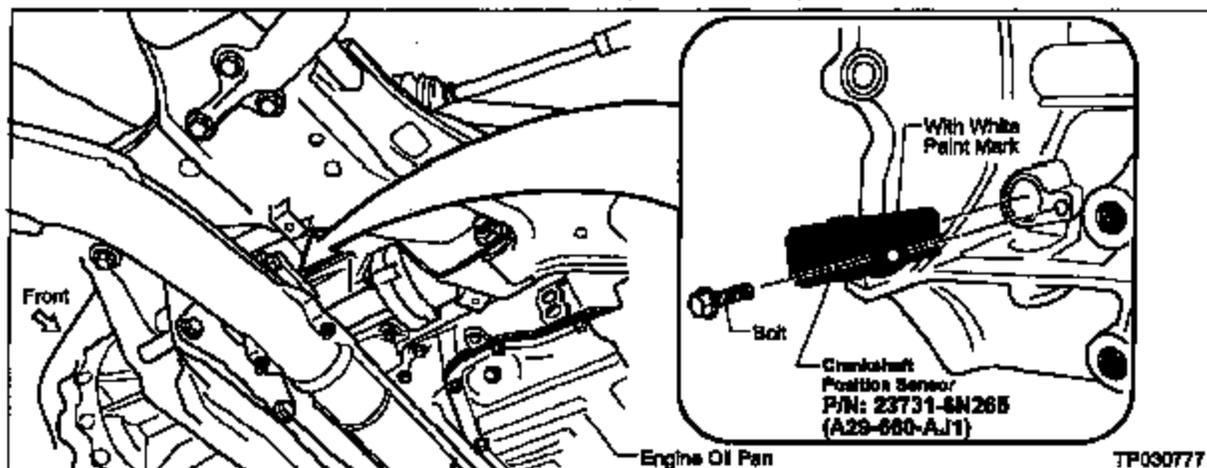


Figure 6

3. Disconnect the vehicle wire harness connector from the sensor.
NOTE: If the connector will not release for you, see Figure B (if applicable).
4. Remove and save the bolt that holds the sensor in place.
5. Remove the **Crankshaft Position Sensor** with a pulling and twisting motion. Then, using a pair of pliers, break the connector on the **OLD** sensor so it cannot be reused.
6. Clean the hole that the old sensor was removed from.
7. Open the kit bag, remove the **NEW** sensor and apply a thin coat of clean engine oil to the o-ring on the new sensor.
8. Insert (until fully seated) the **NEW** sensor into the hole with a pushing and twisting motion, being careful not to damage the o-ring.
9. Re-install and tighten the sensor mounting bolt to **48 - 65 In-lb (5.4 - 7.3 N-m, 0.55 - 0.75 kg-m).**
10. Re-connect the vehicle wire harness connector to the sensor.
11. Lower the vehicle to the ground.
12. Reconnect the battery cable and reset the radio station presets and clock.

Altima (L31)

IMPORTANT

- **THE SENSORS IN THIS KIT ARE DIFFERENT. IT IS CRITICAL THAT EACH SENSOR BE INSTALLED IN THE CORRECT LOCATION. REFER TO "FIGURE A" AND THE ILLUSTRATIONS IN THIS REPAIR SECTION FOR SENSOR LOCATIONS.**
- Each new sensor (within each kit) is contained in a bag. The bag is labeled with the Nissan part number. Keep the sensor in the bag until just before it is installed. The supplier part number is on the face of the sensor. This number starts with "A29-".
- The Crankshaft and Camshaft Position Sensors in Sensor Kit P/N 23731-6N225 look the same. To help you tell the difference between these sensors, a white paint mark was added to the Crankshaft sensor (see the illustration at the top of page 10).
- The old and new sensors may appear identical, therefore **KEEP THEM SEPARATE.**

Camshaft & Crankshaft* Position Sensor Replacement

* This sensor has a white paint mark on it (see Figure 7).

1. Record all radio station presets.
2. Disconnect the negative battery cable.
3. Locate the **Camshaft Position Sensor** and **Crankshaft Position Sensor** (see Figure 7).

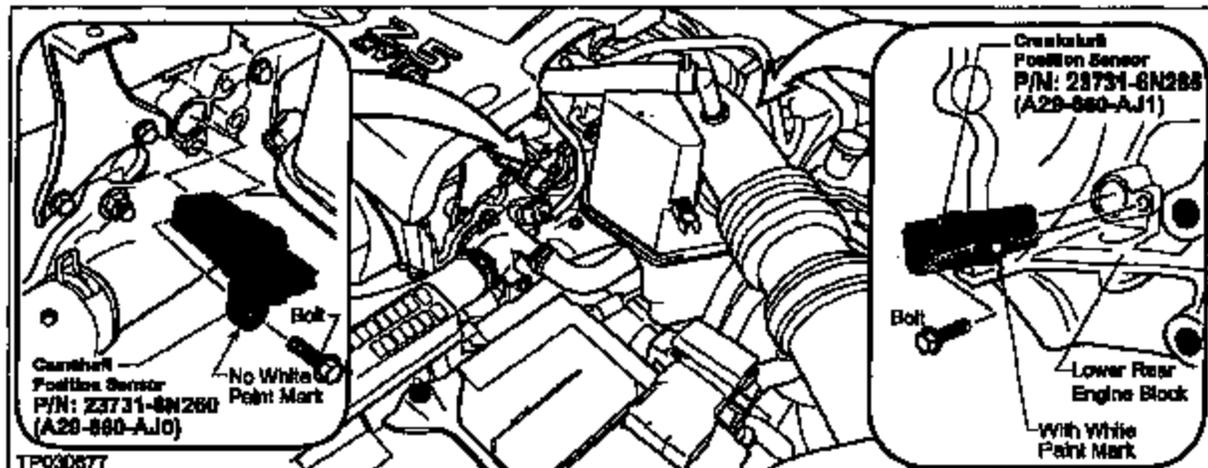


Figure 7

4. Disconnect the vehicle wire harness connector from the sensors.
NOTE: If the connector will not release for you, see Figure B (if applicable).
5. Remove and save the bolt that holds the sensors in place.

Camshaft Position Sensor (P/N 23731-6N260 / A29-660-AJ0)


6. Remove the **Camshaft Position Sensor** with a pulling and twisting motion. Then, using a pair of pliers, break the connector on the **OLD** sensor so it cannot be reused.
7. Clean the hole that the old sensor was removed from.
8. Open the kit bag, remove the **NEW** sensor and apply a thin coat of clean engine oil to the o-ring on the new sensor.
9. Insert (until fully seated) the **NEW** sensors into the hole with a pushing and twisting motion, being careful not to damage the o-ring.

Crankshaft Position Sensor* (P/N 23731-6N265 / A29-660-AJ1)

* This sensor has a white paint mark on it (see Figure 7).

10. Remove the **Crankshaft Position Sensor** with a pulling and twisting motion. Then, using a pair of pliers, break the connector on the **OLD** sensor so it cannot be reused.
11. Clean the hole that the old sensor was removed from.
12. Open the kit bag, remove the **NEW** sensor and apply a thin coat of clean engine oil to the o-ring on the new sensor.
13. Insert (until fully seated) the **NEW** sensors into the hole with a pushing and twisting motion, being careful not to damage the o-ring.
14. Re-install and tighten the sensor mounting bolts to **48 - 65 in-lb (5.4 – 7.3 N-m, 0.55 – 0.75 kg-m).**
15. Re-connect the vehicle wire harness connectors to the sensors.
16. Reconnect the battery cable and reset the radio station presets and clock.

VQ35DE Engine (Use Kit P/N 23731-AL627)

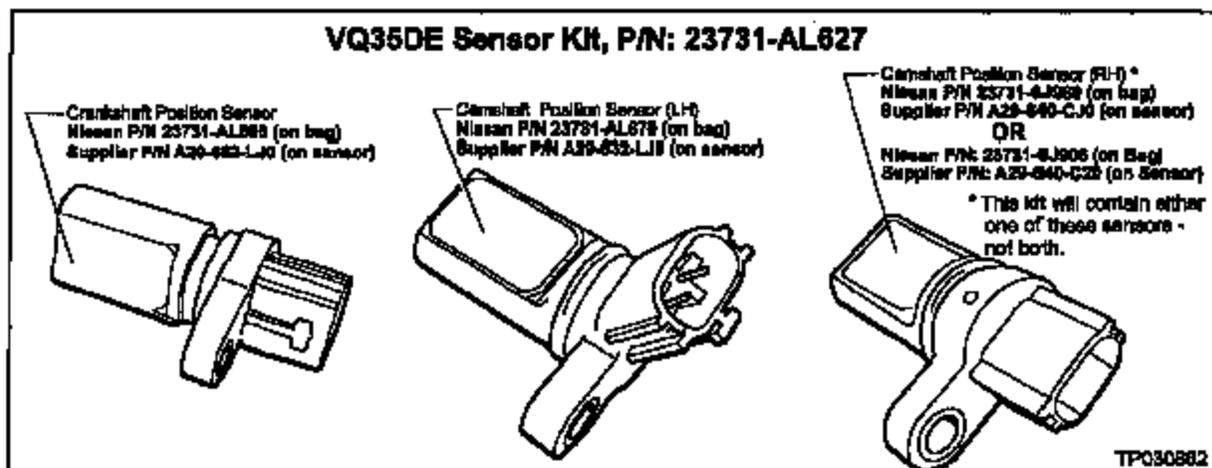

Altima (L31)

IMPORTANT

- **THE SENSORS IN THIS KIT ARE DIFFERENT. IT IS CRITICAL THAT EACH SENSOR BE INSTALLED IN THE CORRECT LOCATION. REFER TO "FIGURE A" AND THE ILLUSTRATIONS IN THIS REPAIR SECTION FOR SENSOR LOCATIONS.**
- Each new sensor (within each kit) is contained in a bag. The bag is labeled with the Nissan part number. Keep the sensor in the bag until just before it is installed. The supplier part number is on the face of the sensor. This number starts with "A29-".
- The old and new sensors may appear identical, therefore **KEEP THEM SEPARATE.**

Camshaft Position Sensor Replacement (P/N 23731-AL670 / A29-632-LJ0 & 23731-6J960* / A29-640-CJ0)

* This sensor can be substituted with P/N 23731-6J906 / A29-640-C20.

1. Record all radio station presets.
2. Disconnect the negative battery cable.
3. Locate the **Camshaft Position Sensors** (see Figure 8).

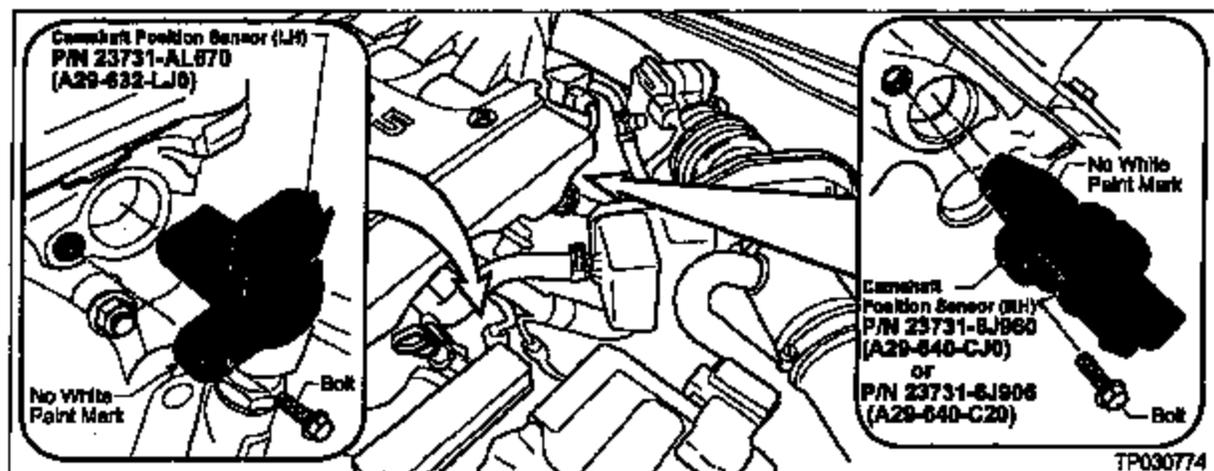


Figure 8

4. Disconnect the vehicle wire harness connectors from the sensors.
NOTE: If the connector will not release for you, see Figure B (if applicable).
5. Remove and save the bolts that hold the sensors in place.
IMPORTANT: Perform the following steps on only **ONE** sensor at a time.
6. Remove the **Camshaft Position Sensor** with a pulling and twisting motion. Then, using a pair of pliers, break the connector on the **OLD** sensor so it cannot be reused.
7. Clean the hole that the old sensor was removed from.
8. Open the kit bag, remove the **NEW** sensor and apply a thin coat of clean engine oil to the o-ring on the new sensor.
9. Insert (until fully seated) the **NEW** sensor into the hole with a pushing and twisting motion, being careful not to damage the o-ring.
10. Re-install and tighten the sensor mounting bolt to 74 - 96 in-lb (8.4 - 10.8 N-m, 0.86 - 1.1 kg-m).
11. Re-connect the vehicle wire harness connectors to the sensors.

Crankshaft Position Sensor Replacement (P/N 23731-AL660 / A29-662-LJ0)

1. Raise the vehicle on a hoist.
2. Locate the **Crankshaft Position Sensor** (see Figure 9).

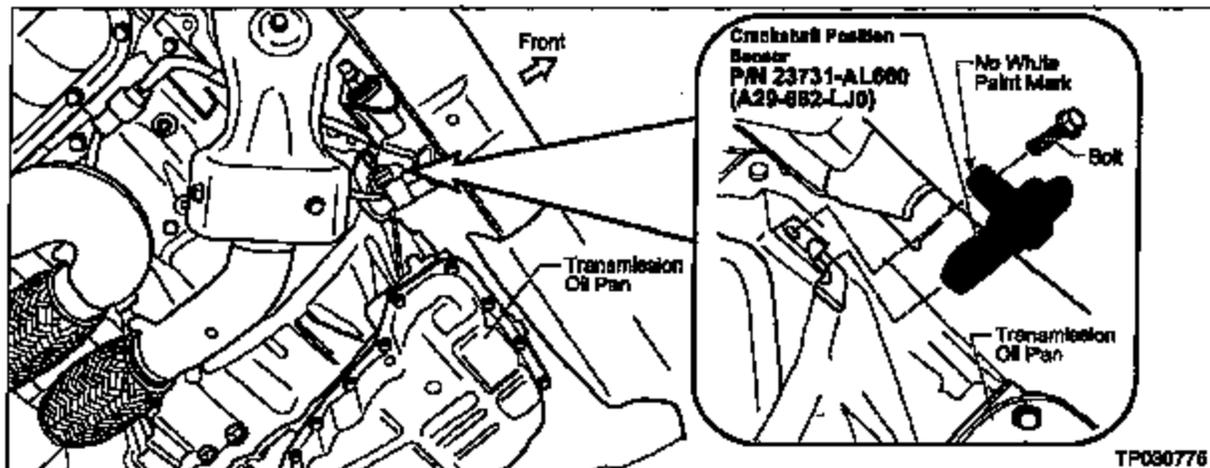


Figure 9

3. Disconnect the vehicle wire harness connector from the sensor.
NOTE: If the connector will not release for you, see Figure B (if applicable).
4. Remove and save the bolt that holds the sensor in place.
5. Remove the **Crankshaft Position Sensor** with a pulling and twisting motion. Then, using a pair of pliers, break the connector on the **OLD** sensor so it cannot be reused.
6. Clean the hole that the old sensor was removed from.
7. Open the kit bag, remove the **NEW** sensor and apply a thin coat of clean engine oil to the o-ring (if applicable) on the new sensor.
8. Insert (until fully seated) the **NEW** sensor into the hole with a pushing and twisting motion, being careful not to damage the o-ring.
9. Re-install and tighten the sensor mounting bolt to **74 - 96 in-lb (8.4 - 10.8 N-m, 0.86 - 1.1 kg-m).**
10. Re-connect the vehicle wire harness connector to the sensor.
11. Lower the vehicle to the ground.
12. Reconnect the battery cable and reset the radio station presets and clock.

Maxima (A33)

IMPORTANT

- **THE SENSORS IN THIS KIT ARE DIFFERENT. IT IS CRITICAL THAT EACH SENSOR BE INSTALLED IN THE CORRECT LOCATION. REFER TO "FIGURE A" AND THE ILLUSTRATIONS IN THIS REPAIR SECTION FOR SENSOR LOCATIONS.**
- Each new sensor (within each kit) is contained in a bag. The bag is labeled with the Nissan part number. Keep the sensor in the bag until just before it is installed. The supplier part number is on the face of the sensor. This number starts with "A29".
- The old and new sensors may appear identical, therefore **KEEP THEM SEPARATE**.

Camshaft Position Sensor Replacement (P/N 23731-AL670 / A29-632-LJ0 & 23731-6J960* / A29-640-CJ0)

* This sensor can be substituted with P/N 23731-6J906 / A29-640-C20.

1. Record all radio station presets.
2. Disconnect the negative battery cable.
3. Locate the **Camshaft Position Sensors** (see Figure 10).

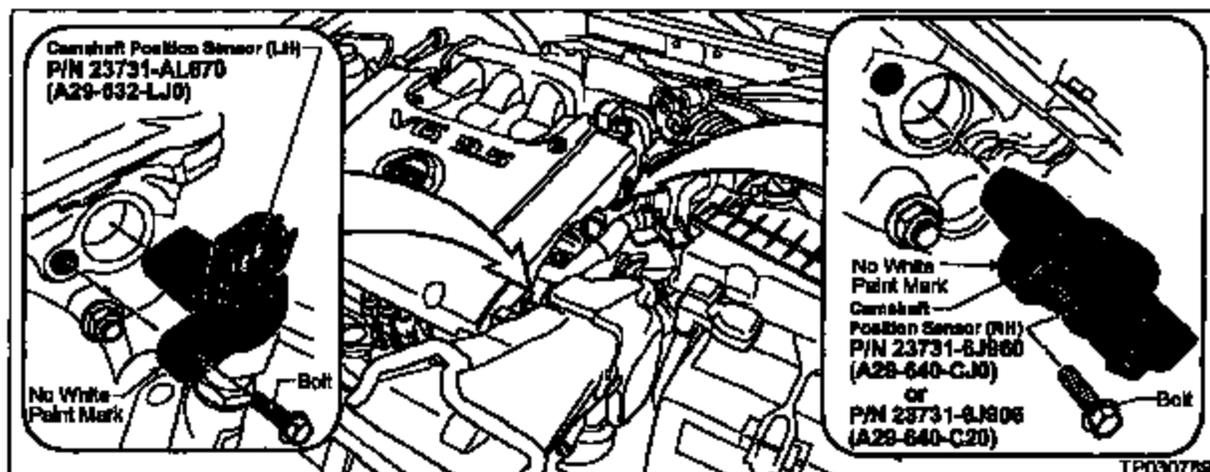


Figure 10

4. Disconnect the vehicle wire harness connectors from the sensors.
NOTE: If the connector will not release for you, see Figure B (if applicable).
5. Remove and save the bolts that hold the sensors in place.
IMPORTANT: Perform the following steps on only **ONE** sensor at a time.
6. Remove the **Camshaft Position Sensor** with a pulling and twisting motion. Then, using a pair of pliers, break the connector on the **OLD** sensor so it cannot be reused.
7. Clean the hole that the old sensor was removed from.
8. Open the kit bag, remove the **NEW** sensor and apply a thin coat of clean engine oil to the o-ring on the new sensor.
9. Insert (until fully seated) the **NEW** sensor into the hole with a pushing and twisting motion, being careful not to damage the o-ring.
10. Re-install and tighten the sensor mounting bolt to 74 - 96 in-lb (8.4 - 10.8 N-m, 0.86 - 1.1 kg-m).
11. Re-connect the vehicle wire harness connectors to the sensors.

Crankshaft Position Sensor Replacement (P/N 23731-AL660 / A29-662-LJ0)

1. Raise the vehicle on a hoist.
2. Remove the Lower Engine Cover (see Figure 11).

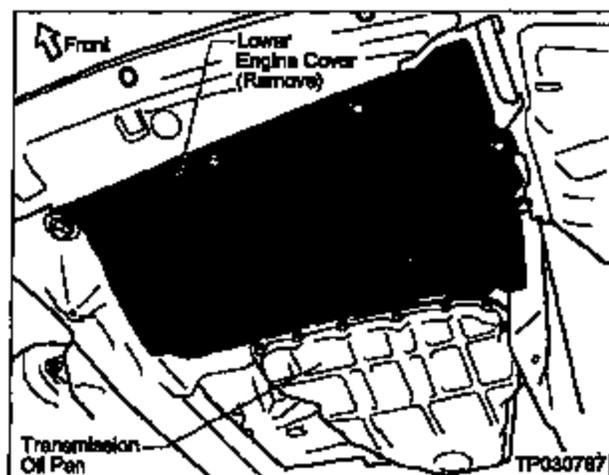


Figure 11

3. Locate the Crankshaft Position Sensor (see Figure 12).

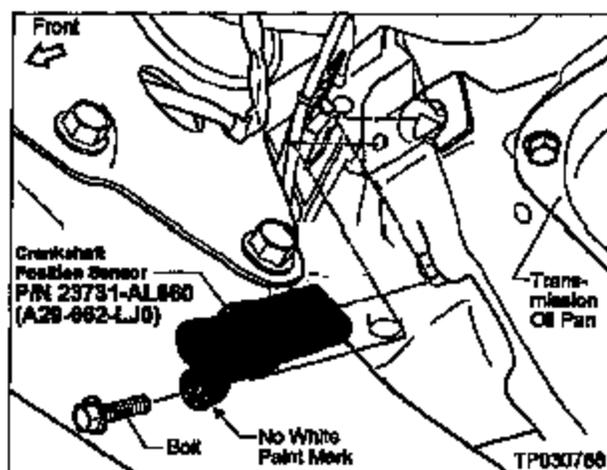


Figure 12

4. Disconnect the vehicle wire harness connector from the sensor.
NOTE: If the connector will not release for you, see Figure B (if applicable).
5. Remove and save the bolt that holds the sensor in place.
6. Remove the Crankshaft Position Sensor with a pulling and twisting motion. Then, using a pair of pliers, break the connector on the OLD sensor so it cannot be reused.
7. Clean the hole that the old sensor was removed from.
8. Open the kit bag, remove the NEW sensor and apply a thin coat of clean engine oil to the o-ring (if applicable) on the new sensor.
9. Insert (until fully seated) the NEW sensor into the hole with a pushing and twisting motion, being careful not to damage the o-ring.
10. Re-install and tighten the sensor mounting bolt to 74 - 96 in-lb (8.4 - 10.8 N-m, 0.86 - 1.1 kg-m).
11. Re-connect the vehicle wire harness connector to the sensor.
12. Re-install the Lower Engine Cover.
13. Lower the vehicle to the ground.
14. Reconnect the battery cable and reset the radio station presets and clock.

Murano (Z50)

IMPORTANT

- **THE SENSORS IN THIS KIT ARE DIFFERENT. IT IS CRITICAL THAT EACH SENSOR BE INSTALLED IN THE CORRECT LOCATION. REFER TO "FIGURE A" AND THE ILLUSTRATIONS IN THIS REPAIR SECTION FOR SENSOR LOCATIONS.**
- Each new sensor (within each kit) is contained in a bag. The bag is labeled with the Nissan part number. Keep the sensor in the bag until just before it is installed. The supplier part number is on the face of the sensor. This number starts with "A29-".
- The old and new sensors may appear identical, therefore **KEEP THEM SEPARATE.**

Camshaft Position Sensor Replacement (P/N 23731-AL670 / A29-632-LJ0 & 23731-6J960* / A29-640-CJ0)

* This sensor can be substituted with P/N 23731-6J906 / A29-640-C20.

1. Record all radio station presets.
2. Disconnect the negative battery cable.
3. Locate the **Camshaft Position Sensors** (see Figure 13).

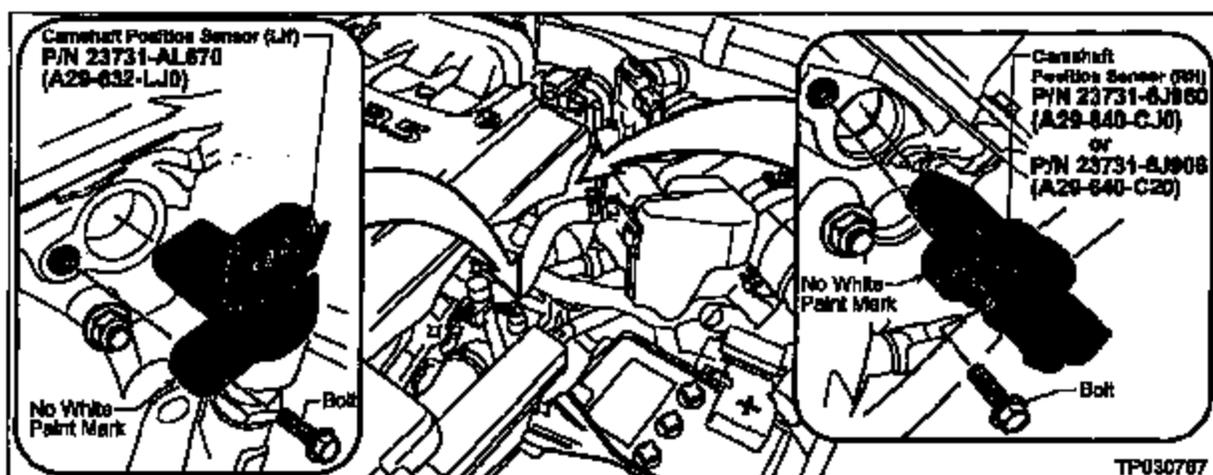


Figure 13

4. Disconnect the vehicle wire harness connectors from the sensors.
NOTE: If the connector will not release for you, see Figure B (if applicable).
5. Remove and save the bolts that hold the sensors in place.
IMPORTANT: Perform the following steps on only **ONE** sensor at a time.
6. Remove the **Camshaft Position Sensor** with a pulling and twisting motion. Then, using a pair of pliers, break the connector on the **OLD** sensor so it cannot be reused.
7. Clean the hole that the old sensor was removed from.
8. Open the kit bag, remove the **NEW** sensor and apply a thin coat of clean engine oil to the o-ring on the new sensor.

9. Insert (until fully seated) the **NEW** sensor into the hole with a pushing and twisting motion, being careful not to damage the o-ring.
10. Re-install and tighten the sensor mounting bolt to **74 - 96 In-lb (8.4 - 10.8 N-m, 0.86 - 1.1 kg-m).**
11. Re-connect the vehicle wire harness connectors to the sensors.

Crankshaft Position Sensor Replacement (P/N 23731-AL660 / A29-662-LJ0)

1. Raise the vehicle on a hoist.
2. Locate the **Crankshaft Position Sensor** (see Figure 14).

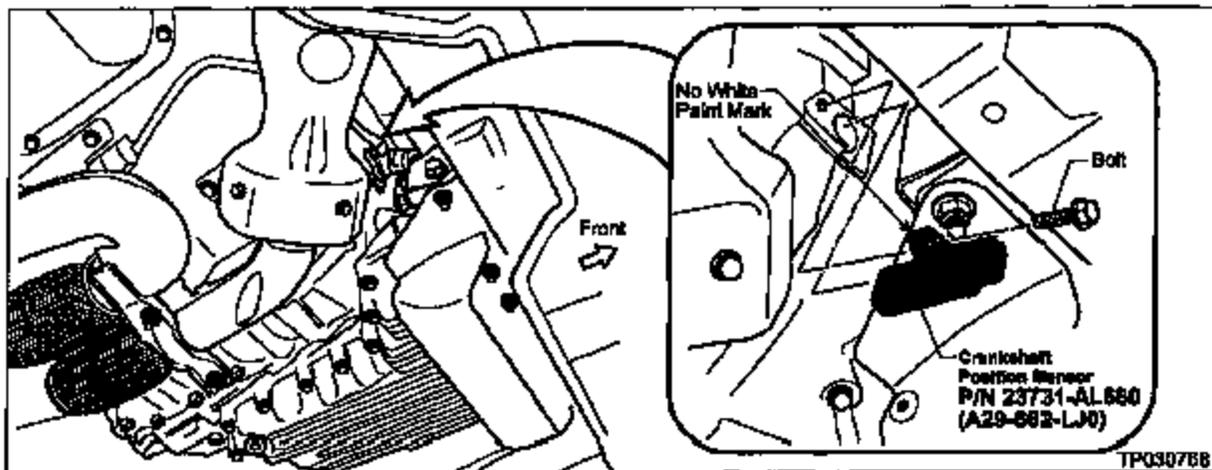


Figure 14

3. Disconnect the vehicle wire harness connector from the sensor.
NOTE: If the connector will not release for you, see Figure B (if applicable).
4. Remove and save the bolt that holds the sensor in place.
5. Remove the **Crankshaft Position Sensor** with a pulling and twisting motion. Then, using a pair of pliers, break the connector on the **OLD** sensor so it cannot be reused.
6. Clean the hole that the old sensor was removed from.
7. Open the kit bag, remove the **NEW** sensor and apply a thin coat of clean engine oil to the o-ring (if applicable) on the new sensor.
8. Insert (until fully seated) the **NEW** sensor into the hole with a pushing and twisting motion, being careful not to damage the o-ring.
9. Re-install and tighten the sensor mounting bolt to **74 - 98 In-lb (8.4 - 10.8 N-m, 0.86 - 1.1 kg-m).**
10. Re-connect the vehicle wire harness connector to the sensor.
11. Lower the vehicle to the ground.
12. Reconnect the battery cable and reset the radio station presets and clock.

350Z (Z33)

IMPORTANT

- **THE SENSORS IN THIS KIT ARE DIFFERENT. IT IS CRITICAL THAT EACH SENSOR BE INSTALLED IN THE CORRECT LOCATION. REFER TO "FIGURE A" AND THE ILLUSTRATIONS IN THIS REPAIR SECTION FOR SENSOR LOCATIONS.**
- Each new sensor (within each kit) is contained in a bag. The bag is labeled with the Nissan part number. Keep the sensor in the bag until just before it is installed. The supplier part number is on the face of the sensor. This number starts with "A29-".
- The old and new sensors may appear identical, therefore **KEEP THEM SEPARATE.**

Camshaft Position Sensor Replacement (Driver's Side), P/N 23731-AL670 / A29-632-LJ0

1. Record all radio station presets.
2. Disconnect the negative battery cable.
3. Remove the Air Inlet Duct and Throttle Body (see Figure 15).

CAUTION: Avoid engine damage; place a shop rag in the opening of the intake collector (see Figure 16, next page).

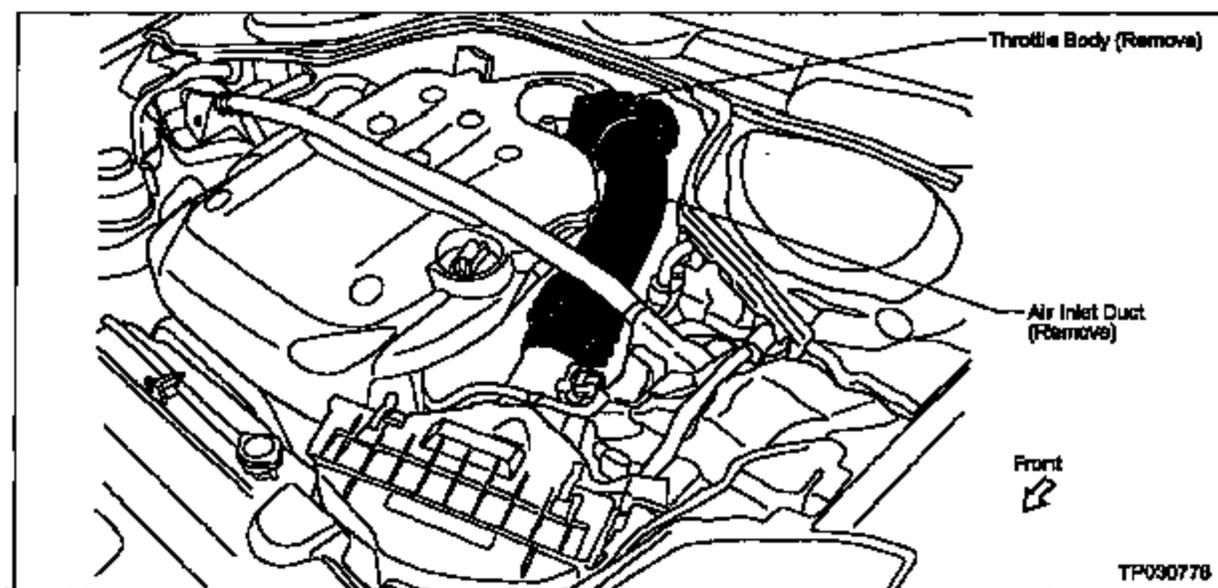


Figure 15

4. Locate the driver's side (LH) Camshaft Position Sensor (see Figure 16).

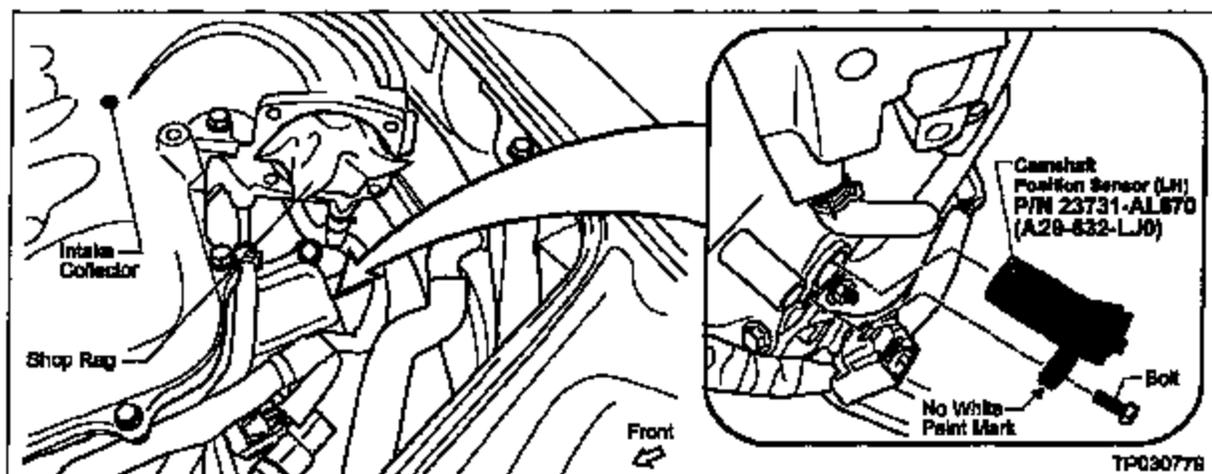


Figure 16

5. Disconnect the vehicle wire harness connector from the sensor.

NOTE: If the connector will not release for you, see Figure B (if applicable).

6. Remove and save the bolt that holds the sensor in place.

7. Remove the **Camshaft Position Sensor** with a pulling and twisting motion. Then, using a pair of pliers, break the connector on the **OLD** sensor so it cannot be reused.

8. Clean the hole that the old sensor was removed from.

9. Open the kit bag, remove the **NEW** sensor and apply a thin coat of clean engine oil to the o-ring on the new sensor.

10. Insert (until fully seated) the **NEW** sensor into the hole with a pushing and twisting motion, being careful not to damage the o-ring.

11. Re-install and tighten the sensor mounting bolt to 74 - 96 in-lb (8.4 - 10.8 N-m, 0.86 - 1.1 kg-m).

12. Re-connect the vehicle wire harness connector to the sensor.

Camshaft Position Sensor Replacement (Pass. Side), P/N 23731-6J960* / A29-640-CJ0

* This sensor can be substituted with P/N 23731-6J906 / A29-640-C20.

1. Locate the passenger side (RH) Camshaft Position Sensor (see Figure 17).

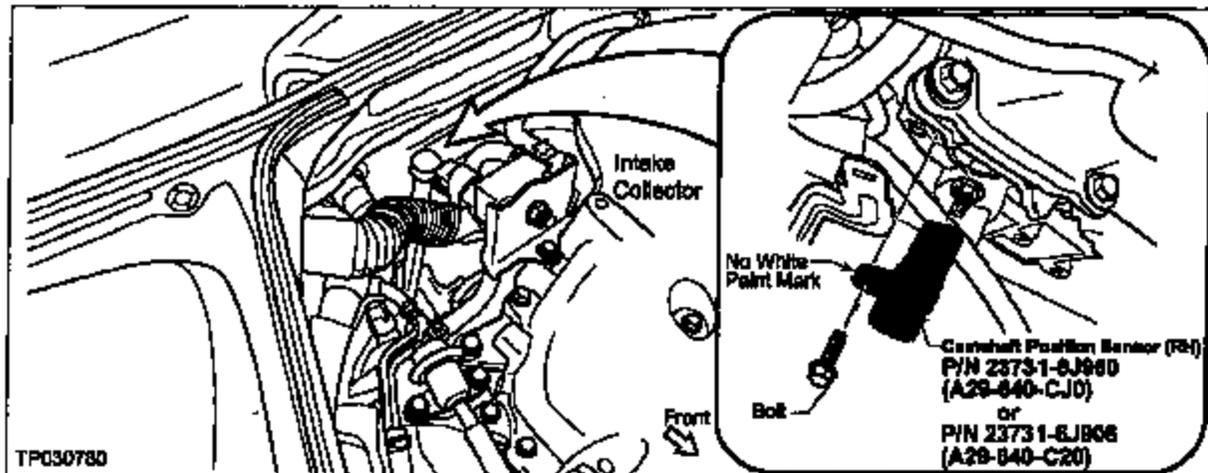


Figure 17

2. Disconnect the vehicle wire harness connector from the sensor.
NOTE: If the connector will not release for you, see Figure B (if applicable).
3. Remove and save the bolt that holds the sensor in place.
4. Remove the **Camshaft Position Sensor** with a pulling and twisting motion. Then, using a pair of pliers, break the connector on the **OLD** sensor so it cannot be reused.
5. Clean the hole that the old sensor was removed from.
6. Open the kit bag, remove the **NEW** sensor and apply a thin coat of clean engine oil to the o-ring on the new sensor.
7. Insert (until fully seated) the **NEW** sensor into the hole with a pushing and twisting motion, being careful not to damage the o-ring.
8. Re-install and tighten the sensor mounting bolt to **74 - 96 In-lb (8.4 - 10.8 N-m, 0.86 - 1.1 kg-m).**
9. Re-connect the vehicle wire harness connector to the sensor.
10. Remove the shop rag from the Intake collector opening. Then re-install the Throttle Body using the new gasket (see Parts Information). Tighten the Throttle Body screws to **64 - 86 In-lb (7.2 - 9.7 N-m, 0.73 - 0.99 kg-m).**
11. Re-install the Air Inlet Duct.

Crankshaft Position Sensor Replacement (P/N 23731-AL660 / A29-862-LJ0)

1. Raise the vehicle on a hoist.
2. Remove the Lower Engine Cover (see Figure 18).

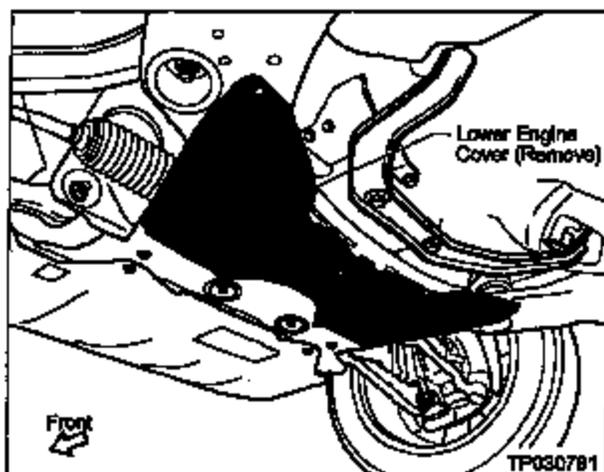


Figure 18

3. Locate the Crankshaft Position Sensor (see Figure 19).

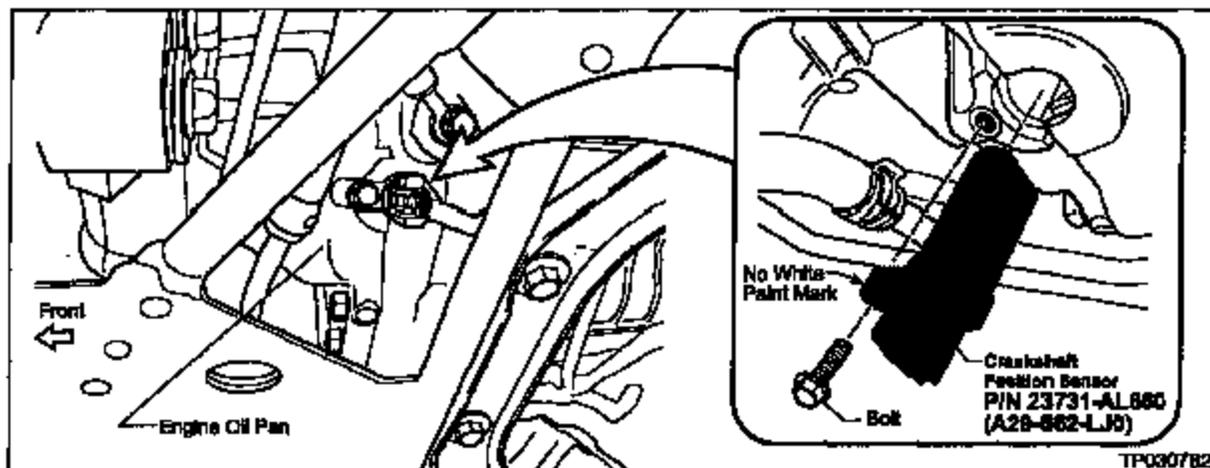


Figure 19

4. Disconnect the vehicle wire harness connector from the sensor.
NOTE: If the connector will not release for you, see Figure B (if applicable).
5. Remove and save the bolt that holds the sensor in place.
6. Remove the Crankshaft Position Sensor with a pulling and twisting motion. Then, using a pair of pliers, break the connector on the OLD sensor so it cannot be reused.
7. Clean the hole that the old sensor was removed from.
8. Open the kit bag, remove the NEW sensor and apply a thin coat of clean engine oil to the o-ring (if applicable) on the new sensor.
9. Insert (until fully seated) the NEW sensor into the hole with a pushing and twisting motion, being careful not to damage the o-ring.
10. Re-install and tighten the sensor mounting bolt to 74 - 86 in-lb (8.4 - 10.8 N-m, 0.86 - 1.1 kg-m).
11. Re-connect the vehicle wire harness connector to the sensor.
12. Re-install the Lower Engine Cover.
13. Lower the vehicle to the ground.
14. Reconnect the battery cable and reset the radio station presets and clock.

PARTS INFORMATION

DESCRIPTION	PART NUMBER	QTY
Sensor Kit (QG18DE)	23731-4M528	1
Sensor Kit (QR25DE)	23731-8N225	1
Sensor Kit (VQ35DE)	23731-AL627	1

The following part (Gasket – Throttle Body) is ONLY for 350Z.

Gasket – Throttle Body	A6175-AR000	1
------------------------	-------------	---

CLAIMS INFORMATION

Submit a "Campaign" (CM) line claim using the following claims coding information:

If identified on Service Comm with Campaign I.D.: R3022

DESCRIPTION	OP CODE	FRT
Install new engine sensor kit	R30220	0.5 hrs. (A33, Z50, B15, & L31)
Install new engine sensor kit	R30221	0.8 hrs. (Z33)

OWNER'S LETTER

Dear Nissan owner:

This notice is sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act. Nissan has decided that a defect which relates to motor vehicle safety exists in some 2000-2003 model year Nissan vehicles. Our records indicate that you own the Nissan vehicle identified by the Vehicle Identification Number on the cover of this notice.

Reason for Recall

On some 2000-2003 model year Nissan vehicles, there is a possibility that the engine might stop running while being driven if the crank position sensor fails. This may also result in the "Service Engine Soon" light coming on or reduced engine power. If the engine stops running while driving, this could result in a crash without warning.

What Nissan Will Do

In order to prevent this incident from occurring, your Nissan dealer will replace the crank position sensors. This free service should take about one hour to complete, but your Nissan dealer may require your vehicle for a longer period of time based upon their work schedule, or parts availability.

What You Should Do

Contact your Nissan dealer at your earliest convenience in order to arrange an appointment to have your vehicle repaired. If the "Service Engine Soon" light comes on, contact your dealer as soon as possible to have your vehicle inspected. Please bring this notice with you when you keep your service appointment. Instructions have been sent to your Nissan dealer. If the dealer fails, or is unable to make the necessary repairs free of charge, you may contact the National Consumer Affairs Office, Nissan North America, Inc. at P.O. Box 191, Gardena, California 90248-0191. The toll free number is 1-800-NISSAN1 (1-800-847-7261). If you reside in Hawaii, please call 1-808-836-0888. You may also contact the Administrator of the National Highway Traffic Safety Administration, 400 Seventh Street SW, Washington, D.C. 20590 or call the toll free Safety Hotline at (888) 327-4236.

If you have paid to have a crank position sensor replaced prior to this campaign, you may be eligible for reimbursement of the related expense. Contact Nissan Consumer Affairs at the numbers listed above for additional information on how to obtain a reimbursement.

Federal law requires that any vehicle lessor receiving this recall notice must forward a copy of this notice to the lessee within ten days.

Thank you for your cooperation. We are indeed sorry for any inconvenience this may cause you.