

Ford Motor Company

L. W. Camp, Director
Automotive Safety Office
Environmental and Safety Engineering

November 10, 2000

Kenneth N. Weinstein
Associate Administrator for Safety Assurance
National Highway Traffic Safety Administration
400 Seventh Street, SW
Washington, DC 20590

Dear Mr. Weinstein:

Subject: Safety Recall 00V-228 NSA-11paw
(Ford Number 00S21)

Enclosed are dealer and owner letters issued by Ford Customer Service Division regarding a recall of certain 2000 Model Year Cars and Light Trucks. Specific details were forwarded to you in our letter dated August 11, 2000.

Sincerely,



00S21dir.docxty
Enclosures



Ford Motor Company

October 2000

TO: All Ford and Lincoln Mercury Dealers

SUBJECT: DEMONSTRATION / DELIVERY HOLD Safety Recall 00S21: Certain 2000 Model Year Cars and Light Trucks - Seat Belt Buckle Assembly Inspection

REF: Dealer Announcement dated 12/17/98, Lincoln Commitment Special Handling Procedure (Attachment IV)

AFFECTED VEHICLES

Certain 2000 model year:

- Escort and Escort ZX2 vehicles built from May 3, 2000 through June 30, 2000 at the Hermosillo assembly plant
- Town Car vehicles built from April 11, 2000 through June 30, 2000 at the Wixom assembly plant
- Explorer vehicles built from April 12, 2000 through June 30, 2000 at the St. Louis assembly plant
- Explorer and Mountaineer vehicles built from May 3, 2000 through June 30, 2000 at the Louisville assembly plant
- Villager vehicles built from May 02, 2000 through June 30, 2000 at the Ohio Truck assembly plant
- Contour and Mystique vehicles built from May 3, 2000 through August 10, 2000 at the Cuautitlan assembly plant
- F-Series vehicles built from:
 - April 6, 2000 through April 25, 2000 at Ontario Assembly Plant
 - April 21, 2000 through May 5, 2000 at Norfolk Assembly Plant
 - April 17, 2000 through July 17, 2000 at Kansas City assembly plant
- Ranger vehicles built from:
 - April 26, 2000 through June 6, 2000 at Twin Cities Assembly Plant
 - May 3, 2000 through June 21, 2000 at Edison Assembly Plant
- Windstar vehicles built from April 27, 2000 through May 17, 2000 at Oakville Assembly Plant – for Europe only

NON-COMPLIANCE

Certain affected vehicles may have seat belt buckle assemblies that may not conform to Standard 209, paragraph S4.4 (b)(3) of the Federal Motor Vehicle Safety Standards which requires that the seat belt buckle assemblies withstand a force of not less than 13,345 N (3,000 lbs). Buckle assemblies in certain seating positions of the affected vehicles may not conform to this standard. In the event of an accident, this may increase the risk of personal injury for the occupant in the affected seats.

SERVICE ACTION

Before demonstrating or delivering any of the vehicles involved in this recall, the dealer must inspect the date code on the seat belt buckles in certain seating positions on all affected vehicles and replace all seat belt buckle assemblies that fall within the suspect date code range.

PLEASE NOTE

Correct all vehicles in stock before delivery. Federal law requires dealers to complete any outstanding safety recall service before a new vehicle is delivered to the buyer or lessee. Violation of this requirement by a dealer could result in a civil penalty of up to \$1,100 per vehicle.

LINCOLN COMMITMENT SPECIAL HANDLING PROCEDURE

The Lincoln Commitment Special Handling Procedure has been activated for all Town Car owners affected by this recall. Please see dealer announcement dated 12/17/98, Lincoln Commitment Special Handling Procedure (Attachment IV). The special handling procedure provides additional allowance to enable dealers to offer Town Car owners convenient vehicle handling.

Lincoln Mercury is asking for your support and the cooperation of your sales and service teams to make this a positive experience for our Town Car customers, many of whom are new to the Lincoln family.

ATTACHMENTS

- Attachment I: Administrative Information
- Attachment II: Labor Allowances and Parts Ordering Information
- Attachment III: Technical Information
- Attachment IV: Lincoln Commitment Special Handling Procedure Announcement Letter
- Customer Letter

QUESTIONS?

- Claims Information:.....1-800-423-8851
- Other (Dealer Only) Recall Questions:.....1-800-325-5821

Sincerely,

 Ann O'Neill
 Director
 Vehicle Service and Programs

DEMONSTRATION / DELIVERY HOLD: Safety Recall 00S21
Certain 2000 Model Year Cars and Light Trucks –
Seat Belt Buckle Assembly Inspection

OASIS

You must use OASIS to determine if a vehicle is eligible for this recall.

PLEASE NOTE

Correct all vehicles in stock before delivery. Federal law requires dealers to complete any outstanding safety recall service before a new vehicle is delivered to the buyer or lessee. Violation of this requirement by a dealer could result in a civil penalty of up to \$1,100 per vehicle.

PROMPTLY CORRECT

Promptly correct all affected vehicles on your dealer VIN list which you will receive in the Ford Dealer Consolidated Communicator (FDCC). Also, correct other eligible vehicles which are brought to your dealership.

DEALER-OWNER CONTACT

Immediately contact any affected owner whose name is not on the list. Give the owner a copy of the Owner Letter and schedule a service date.

Note: Town Car owners should receive the "Lincoln Commitment Special Handling Procedure". Before calling Town Car owners, review Attachment IV to familiarize yourself with this special handling procedure.

REGIONAL CONTACT

Advise regional office if an owner:

- cannot be contacted.
- does not make a service date.

CLAIMS PREPARATION AND SUBMISSION

- Enter claims using DWE.
- Refer to ACESII manual for claims preparation and submission information.
- To claim for the "Lincoln Commitment Special Handling", follow the instructions on page two of Attachment IV.

DEMONSTRATION / DELIVERY HOLD: Safety Recall 00S21
Certain 2000 Model Year Cars and Light Trucks –
Seat Belt Buckle Assembly Inspection

OWNER REFUNDS

Ford Motor Company will only refund owner-paid repairs made before the date of the Owner Letter (or after the date of the Owner Letter if an emergency repair was made away from the servicing dealer). Refer to ACESII manual for refund information.

RENTAL CARS

If a part needs to be ordered, Ford Motor Company will pay for a rental vehicle, except for fuel which will be at owner's expense. Enter the word "LOANER" plus the number of days the vehicle was used in the Miscellaneous Expense area.

DEMONSTRATION / DELIVERY HOLD: Safety Recall 00S21
Certain 2000 Model Year Cars and Light Trucks –
Seat Belt Buckle Assembly Inspection

LABOR ALLOWANCES

Description	Labor Operation	Labor Time
Inspect date code on seat belt buckle assemblies and return vehicle to owner. - Escort, ZX2 , Town Car, Villager, Ranger - Explorer/Mountaineer and - F-Series with 60/40 Seats - Contour/Mystique, F-Series with Full Bench Seats, and Windstar (Europe Only)	00S21A	0.2 Hrs
	00S21K	0.4 Hrs
Inspect date code, replace ONE seat belt buckle assembly: - Escort, ZX2, F-Series and Ranger with 60/40 seats, Town Car and Villager..... - Windstar (Europe Only), Ranger with Bucket Seats, and Villager..... - F-Series with Full Bench Seats, Contour and Mystique - Explorer and Mountaineer	00S21B	0.3 Hrs
	00S21C	0.4 Hrs
	00S21D	0.5 Hrs
	00S21E	0.9 Hrs
Inspect date code, replace TWO seat belt buckle assemblies: - Windstar (Europe Only), Villager, and F-Series with Full Bench Seats - Explorer and Mountaineer	00S21F	0.5 Hrs
	00S21G	1.4 Hrs
Inspect date code, replace THREE seat belt buckle assemblies: - Villager	00S21H	0.6 Hrs
Administrative Allowance	Misc. Expense Code "ADMIN"	0.1 Hour
Lincoln Commitment Special Handling:*	Misc. Expense Code "LCHP"	See Attachment IV

* Lincoln Commitment Special Handling does not apply to vehicles in dealer stock.

DEMONSTRATION / DELIVERY HOLD: Safety Recall 00S21
Certain 2000 Model Year Cars and Light Trucks -
Seat Belt Buckle Assembly Inspection

PARTS REQUIREMENTS**Parts Ordering Information**

Order your parts requirement through normal order processing channels. Not all vehicles will require new parts. Please perform the inspection before ordering parts.

Parts Application Chart: Seat Belt Buckle Assembly

Vehicle	Color	Seat Location	Service No
Contour and Mystique	Medium Prairie Tan	Seat Belt Buckle End (front seat) - R.H.	98BZ- 5461202-AAA
	Truffle (Greystone)	Seat Belt Buckle End (front seat) - R.H.	98BZ- 5461202-AAB
	Alchemy (Midnight Blue)	Seat Belt Buckle End (front seat) - R.H.	98BZ- 5461202-AAC
Escort	Medium Graphite	Belt Asy. (rear seat) - L.H.	XS4Z-54613B85-AAC
Escort ZX2	Midnight Black	Rear Seat L.H.	XS4Z-63613B85-AAB
Explorer And Mountaineer	Medium Prairie Tan	Seat Belt Buckle End (front seat) - R.H.	XL2Z- 7861202-AAB
	Medium Graphite	Seat Belt Buckle End (front seat) - R.H.	XL2Z- 7861202-AAC
	Dark Graphite	Seat Belt Buckle End (front seat) - L.H.	XL2Z- 7861203-AAA
	Medium Prairie Tan	Seat Belt Buckle End (front seat) - L.H.	XL2Z- 7861203-AAB
	Medium Graphite	Seat Belt Buckle End (front seat) - L.H.	XL2Z- 7861203-AAC
F-Series	Medium Parchment	Front Seat Center R.H.	YL3Z-15612B18-AAA
	Medium Graphite	Front Seat Center R.H.	YL3Z-15612B18-AAC
	Dark Graphite	Front Seat Center R.H.	YL3Z-15612B18-AAD
	Medium Graphite	Front Seat Center L.H.	YL3Z-78612B19-AAC
Ranger	Medium Prairie Tan	Front Seat R.H.	F87Z- 1061202-AAA
	Medium Graphite	Front Seat R.H.	F87Z- 1061202-AAD
	Dark Graphite	Front Seat R.H.	XL5Z- 1061202-AAA

DEMONSTRATION / DELIVERY HOLD: Safety Recall 00S21
Certain 2000 Model Year Cars and Light Trucks -
Seat Belt Buckle Assembly Inspection

Parts Application Chart: Seat Belt Buckle Assembly

Town Car	Midnight Black	Rear Seat R.H.	F8VZ- 5460044-AAE
	Medium Parchment / Light Parchment	Rear Seat R.H.	YW1Z- 5460044-AAA
	Medium & Light Graphite	Rear Seat R.H.	YW1Z- 5460044-AAB
	Medium Parchment	Rear Seat Center	YW1Z-54600A38-AAF
	Midnight Black	Rear Seat Center	YW1Z-54600A38-AAH
	Medium and Light Parchment	Rear Seat Center	YW1Z-54600A38-AAJ
	Medium & Light Graphite	Rear Seat Center	YW1Z-54600A38-AAK
Villager	Medium Portland	2nd Or 3rd Row R.H.)	XF5Z- 1260044-CCC
	Light Mink	2nd Row (Bench)	XF5Z- 1260044-DDD
	Light Mink	2nd Or 3rd Row L.H.	XF5Z- 1260045-AAA
	Medium Portland	2nd Or 3rd Row L.H.	XF5Z- 1260045-CCC
	Light Mink	Front Seat R.H.	XF5Z-1261202-AAA
	Medium Portland	Front Seat R.H.	XF5Z-1261202-CCC
Windstar (Europe Only)	Black	R.H. Front Buckle	XF2Z- 1661202-BBC
	Black	L.H. Front Buckle	XF2Z- 1661203-BBC

DEMONSTRATION / DELIVERY HOLD: Safety Recall 00S21
Certain 2000 Model Year Cars and Light Trucks –
Seat Belt Buckle Assembly Inspection

DEALER PRICE

For latest prices, refer to:

- DOES II
- Updated Price Book

EXCESS STOCK RETURN

Excess stock returned for credit must have been purchased from Ford Customer Service Division in accordance with Policy Procedure Bulletin 4000.

SEAT BELT BUCKLE INSPECTION AND REPLACEMENT

AFFECTED VEHICLES: CERTAIN 2000 MODEL YEAR CONTOUR, ESCORT/ZX2, TOWN CAR, EXPLORER/MOUNTAINEER, F-SERIES (LIGHT DUTY), RANGER, VILLAGER AND WINDSTAR (EUROPE ONLY)

OVERVIEW

The affected vehicles in this program will require inspection of seat belt buckles in certain seating positions to determine if replacement is necessary.

- **Not all seat belt buckles will require inspection.** Only the seat belts identified in the Build Date Code Inspection chart will need to be inspected.
- The build date code is located on the seat belt buckle end. A plastic anchor boot covers the build date code on some affected seat belt buckles. These vehicles will require removal and disassembly of the seat belt buckle, and are identified in the Build Date Code Inspection chart.

SERVICE PROCEDURE

1. Refer to the Build Date Code Inspection chart on page 3 to identify the seat belt buckle(s) that require inspection.
2. Inspect the build date code located on the seat belt buckle end(s). Refer to Figure 1. If the build date code is covered by the plastic anchor boot, proceed as follows:
 - Remove the seat belt buckle from the vehicle. Refer to the service procedures in section 501-20A of the appropriate Workshop Manual.
 - Separate the seat belt buckle from the plastic anchor boot to access the build date code. If the plastic anchor boot is damaged during separation, replace the seat belt buckle assembly regardless of the build date code.


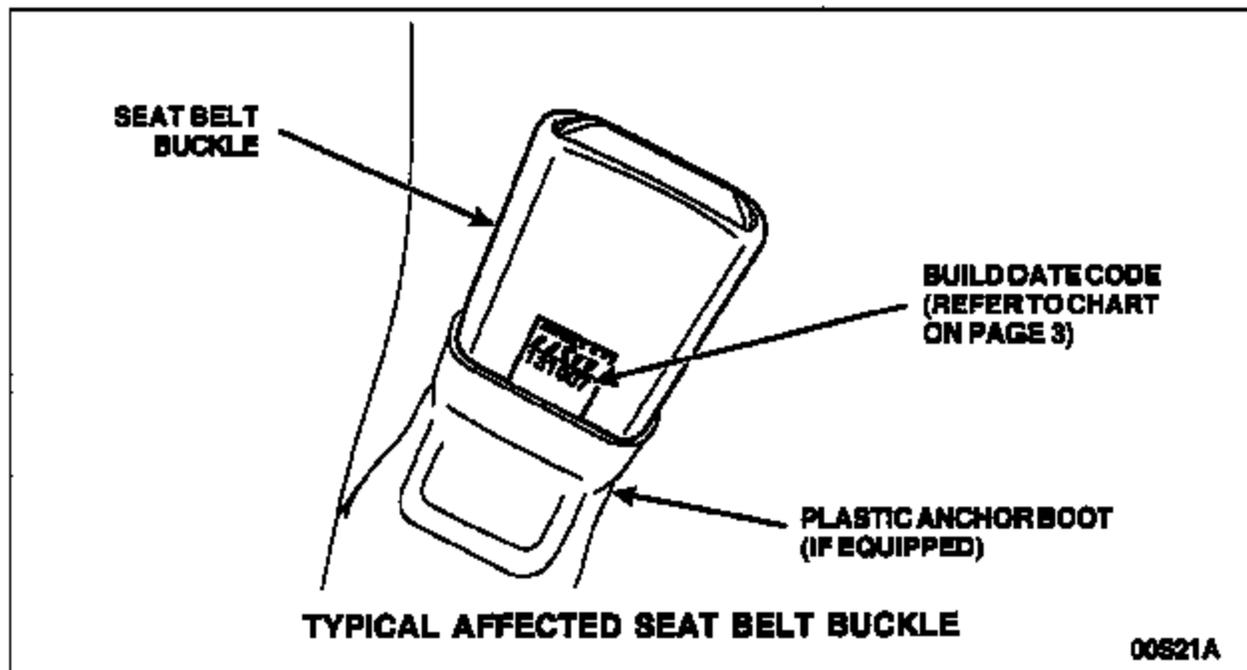


FIGURE 1

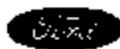

3. Compare the seat belt buckle date code to the code listed in the Build Date Code Inspection chart on Page 3.

NOTE: On certain vehicles, you will receive a retractor and buckle as an assembly. Only the buckle is to be replaced under this program. The retractor portion of the *new* assembly should be discarded.

NOTE: Apply Ford Threadlock 262 (E2FZ-19554B) or equivalent to fasteners when installing seat belt buckle assemblies.

- If the build date code matches that listed in the chart, replace the seat belt buckle assembly. Refer to the service procedures in section 501-20A of the appropriate Workshop Manual.
- If the build date code does not match those listed in the chart, the seat belt buckle does not require replacement. Assemble and install the seat belt buckle, if removed. Refer to the service procedures in section 501-20A of the appropriate Workshop Manual.



©2000 FORD MOTOR COMPANY
DEARBORN, MICHIGAN 48121
10/00


BUILD DATE CODE INSPECTION CHART

Vehicle	Seat Location	Replace if this Build Date Code is on Buckle
CONTOUR/ MYSTIQUE	1st Row RH	157001 162002
ESCORT	2nd Row LH	163001
ZX2	2nd Row LH	163001
EXPLORER/ MOUNTAINEER	1st Row RH 1st Row LH	156001 161001 161002 163001
F-SERIES/ (LIGHT DUTY)	1st Row RH (60/40) 1st Row RH & LH (Full Bench)	131001 131007 151001
RANGER	1st Row RH	157002 161001 161002 163001 163002 164002 164003
TOWN CAR	2nd Row LH 2nd Row RH	131001 146001 146002 151001 156001 161000 161001
VILLAGER	1st Row RH 2nd Row RH (Bucket) 2nd Row (Bench) 3rd Row LH (Bench)	156001 157001
WINDSTAR (European Only)	1st Row RH 1st Row LH	137001 136002

Vehicles that require seat belt buckle removal prior to inspection

**Program Announcement Letter
Lincoln Commitment Special Handling**

Ford Customer Service Division

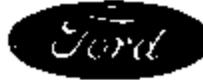

Ford Motor Company
P.O. Box 1904
Dearborn, Michigan 48121

December 17, 1998

To: All Lincoln Mercury and Ford Dealers

**cc: Parts Managers
Service Managers**

**Subject: Announcing Lincoln Commitment Special Customer Handling Procedure for
Certain Recalls and Owner Notification Programs**

As part of our ongoing commitment to Lincoln customers, we are pleased to announce the Lincoln Commitment Special Customer Handling Procedure to provide additional dealer compensation for certain Recalls and Owner Notification Programs (ONP's) that affect Lincoln brand vehicles.

This additional compensation is being provided to allow dealers to provide personalized service designed to make the recall repair a positive experience for the Lincoln customer, many of whom are new to the Lincoln family.

Each Recall/ONP Bulletin affecting Lincoln vehicles will indicate whether the Lincoln Commitment Special Customer Handling Procedure is authorized; please note that not every Recall/ONP will qualify for this procedure and that the procedure will not be communicated to customers as a normal benefit of the Lincoln Commitment Program. Special handling and claiming instructions are included on the attached page. This program will apply only to Lincoln vehicles which have been delivered to customers.

We ask you to make maximum usage of these special enhancements to the Lincoln Commitment Program when applicable. Thank you in advance for your support of this program and our commitment to surprise and delight our Lincoln customers.

/O.S.B./
Mark Hutchins
President
Lincoln Mercury

/O.S.B./
M. D. Jordan
Executive Director
Ford Customer Service Division
North America

If Dealer Picks up and Returns Vehicle for Customer:

<ul style="list-style-type: none"> • Pick up the customer's vehicle (at a location of their preference such as home or place of business) and return after repair* • Drop off comparable loaner vehicle • Refill fuel tank • Wash and vacuum vehicle • Return vehicle to customer after repair is completed 	<p>Up to 2 hours additional labor (converted to a dollar amount) plus actual cost of fuel and wash/vacuum</p> <p>Note: Labor time to fill tank and wash/vacuum has been included in 2 hour allowance</p> <p>Labor subject to time recording procedures as outlined in Warranty & Policy Manual</p>	<p>Submit total dollar value (labor+fuel+wash/vacuum) using Misc. Expense Code "LCHP"</p> <p>EXAMPLE (using example labor rate of \$58/hour and fuel cost of \$1.05/gallon):</p> <p>1.2 hrs. labor* = \$69.60 9.0 gals fuel = 9.45 Wash/vacuum = 3.50 Total Submitted = \$82.55</p> <p>*travel time+fueling/washing labor</p>
<p>Provide comparable loaner vehicle to customer when vehicle is picked up</p>	<p>Actual cost up to a maximum of \$35 per day for a Lincoln loaner or up to \$28 per day for a Mercury or Ford loaner</p> <p>(This does not count against TAP allocation)</p>	<p>Submit up to 3 days maximum using "LOANER" (if additional days are required, call 1-800-325-5821 for authorization)</p>
<p>Perform Recall/ONP repair at dealership</p>	<p>Inspection/repair labor allowance as specified in Recall/ONP Bulletin</p>	<p>See applicable Recall/ONP Bulletin</p>

*Or repair on-site if appropriate; if on-site repair is performed, rental charges do not apply.

If Customer Brings Vehicle to Dealer:

<p>Perform Recall/ONP repair at dealership</p>	<p>Inspection/repair labor allowance as specified in Recall/ONP Bulletin</p>	<p>See applicable Recall/ONP Bulletin</p>
<p>Provide comparable loaner vehicle to customer</p>	<p>Actual cost up to a maximum of \$38 per day for a Lincoln loaner or up to \$28 per day for a Mercury or Ford loaner</p> <p>(This does not count against TAP allocation)</p>	<p>Submit up to 3 days maximum using "LOANER" (if additional days are required, call 1-800-325-5821 for authorization)</p>
<p>Refill fuel tank and wash/ vacuum vehicle</p>	<p>Up to 0.5 hour additional labor (converted to a dollar amount) plus actual cost of fuel and wash/vacuum</p>	<p>Submit total dollar value (labor+fuel+wash/vacuum) using Misc. Expense Code "LCHP"</p>

Ford Motor Company

Ford Motor Company
P. O. Box 1904
Dearborn, Michigan 48121
1-800-392-3673

00S21

October 2000

Mr. John Sample
123 Main Street
Anywhere, USA 12345

Your Vehicle Identification Number: 12345678901234567

This notice is sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act.

Ford Motor Company has decided that certain 2000 model year cars and light trucks fail to conform to the requirements specified in the Federal Motor Vehicle Safety Standard (FMVSS) Standard No. 209: Seat Belt Assemblies, paragraph S4.4 (b)(3), which requires the structural components in a seat belt assembly that are common to pelvic and upper torso restraints to withstand a force of not less than 13,345 N (3,000 lbs).

What the non-compliance issue is...

In the affected vehicles, some seat belt buckles have been installed that may not withstand the force required by FMVSS.

What Ford Motor Company and your dealer will do...

Your dealer will inspect the date code on certain seat belt buckles of your vehicle and replace all seat belt buckles that fall within the suspect date code range.

Your dealer will perform this service free of charge (parts and labor). Owners who are affected by this recall are requested to return their vehicle to their dealer to have the seat belt buckles inspected.

How long will it take?

The time needed for this repair is less than one-half day. However, due to service scheduling issues, your dealer may need your vehicle for a longer period of time.

What we are asking you to do...

Call your dealer without delay. Ask for a service date for Safety Recall 00S21.

If inspection reveals that a seat belt buckle assembly needs to be replaced, your dealer will need to order the part. Parts would be expected to arrive within a week after ordering.

If a part needs to be ordered, Ford Motor Company has authorized your dealer to provide you with a rental vehicle until the parts arrive and are installed on your vehicle.

When you bring your vehicle in, show the dealer this letter. If you misplace this letter, your dealer will still do the work, free of charge.

**If you've changed
address or sold the
vehicle...**

Please fill out the enclosed prepaid postcard and mail it to us if you have changed address or sold the vehicle.

**If you have
concerns...**

If you have trouble getting your vehicle repaired promptly and without charge, please contact the Ford Motor Company Customer Relationship Center and one of our representatives will be happy to assist you:

CALL: (800) 392-3673
(800) 232-5952 (TDD for the Hearing Impaired)

Office Hours: (Eastern Standard Time)

Monday-Friday: 8am - 11pm

Saturday: 9am - 6pm

or you may contact us through the Internet at:

www.ownerconnection.com

Our current response time to Internet inquiries is three business days.

You also may send a complaint to the Administrator, National Highway Traffic Safety Administration, 400 Seventh Street, S. W., Washington, D. C. 20590 or call the toll free Auto Safety Hotline 1-800-424-9393 (Washington, D. C. area residents may call 1-202-388-0123).


**Quality Care service is
there for you all year
round.**

QualityCare
at your service

Quality Care is the commitment of Ford Motor Company and its dealerships to provide you with a superior service and ownership experience. While we regret the inconvenience caused by this program, we stand committed with our dealers to assist you with all of your automotive service needs. With our nationwide dealer network, we're here to ensure you receive Quality Care service so that your vehicle maintains peak performance throughout your ownership experience.

We pride ourselves on becoming the world's leading consumer company for automotive products and services. Again, we are sorry for the inconvenience. Thank you for your attention to this important matter.

Sincerely,

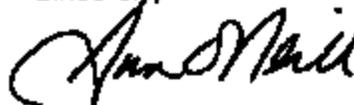

Ann O'Neill
Director


Vehicle Service and Programs

2000 B-SERIES SEAT BELT BUCKLE INSPECTION AND REPLACEMENT (RECALL #95010)**A. VEHICLE INSPECTION PROCEDURE**

1. Verify VIN and build date are within the following range:
 - 4F4*****YT M33268 - M35416
 - Build Date: May 3, 2000 - May 18, 2000
 - If vehicle is within the above range, proceed to STEP 2.
 - If vehicle is not within the above range, return it to the customer or inventory.
2. Perform a Vehicle Status Inquiry using your MDCS System and inspect vehicle for an Authorized Modification Label **RECALL #95010** attached to the driver's side door. Refer to illustration below.

Note

- Be sure to verify the recall number as the vehicle may have multiple labels.

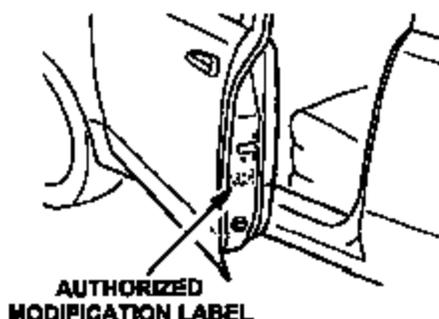

- If MDCS displays **RECALL: 95010 N** and an Authorized Modification Label is **not present**, the recall has not been performed. Proceed to "B. REPAIR PROCEDURE."
- If MDCS displays **RECALL: 95010 N** and an Authorized Modification Label is **present**, contact the Warranty Department at (800) 682-8779. They will update the vehicle history.
- If MDCS displays **RECALL: 95010 D** and an Authorized Modification Label is **not present**, proceed to "C. AUTHORIZED MODIFICATION LABEL INSTALLATION."
- If MDCS displays **RECALL: 95010 D** and an Authorized Modification Label is **present**, the recall has already been completed. Return the vehicle to the customer or inventory.
- If MDCS does not display **RECALL: 95010 N** or **RECALL: 95010 D**, this recall does not apply to the vehicle. Return vehicle to the customer or inventory.

B. REPAIR PROCEDURE


1. Compare the passenger side seat belt buckle data code to the code list on the following Build Date Code Inspection Chart.

Note

- Recall does not apply to driver's side seat belt assembly.
- If the build date code matches the chart below, replace the seat belt buckle assembly. Refer to Workshop Manual (section 08-11).

Note

- Apply threadlock (P/N ZZL1-89-232) or equivalent to fasteners when installing seat belt buckle assemblies.
- If the build code does **NOT** match those listed in the chart below, the seat belt buckle does not require replacement; return vehicle to customer or inventory.

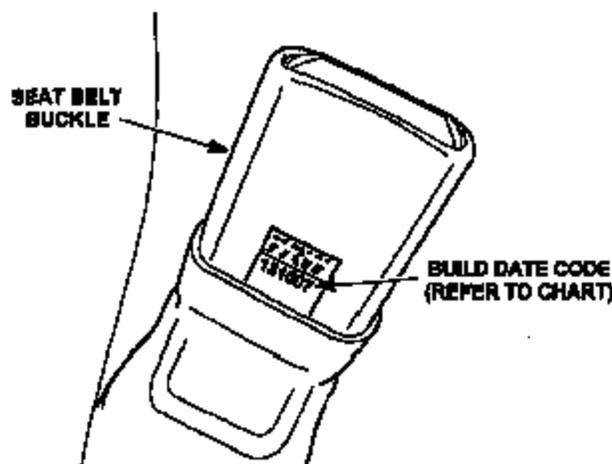

BUILD DATE CODE INSPECTION CHART
157002
161001
161002
163001
163002
164002
164003

C. AUTHORIZED MODIFICATION LABEL INSTALLATION

Complete an "Authorized Modification Label" with the recall number written on the sticker and affix it to driver's side door under the door latch. Refer back to the illustration under "A. VEHICLE INSPECTION PROCEDURE"



Campaign Bulletin

File In Section: Product Campaigns
Bulletin No.: 00087
Date: December, 2000

00V-228.003



F/CMVSS NONCOMPLIANCE CAMPAIGN

SUBJECT: 00087 - SEAT BELT BUCKLE

**MODELS: CERTAIN 2000-01 'U'-VAN AND 'W'-CAR MODEL VEHICLES
CERTAIN 2000-01 'S/T' TRUCK MODEL VEHICLES**

CONDITION

General Motors has decided that certain 2000-01 'U'-Van, 2000-01 'W'-Car, and 2000-01 'S/T' Truck model vehicles fall to conform to Federal/Canada Motor Vehicle Safety Standard 209, "Seat Belt Assemblies". The seat belt buckles in certain, specific seating locations in these vehicles do not meet the pull test requirement. In a crash, the seat belt buckle may release and the occupant may receive more severe injuries.

CORRECTION

Dealers are to replace suspect seat belt buckle assemblies. In certain seating locations, dealers will inspect for a suspect date code and replace seat belt buckle assemblies having suspect date codes.

VEHICLES INVOLVED

Involved are certain 2000-01 'U'-Van, 2000-01 'W'-Car, and 2000-01 'S/T' Truck model vehicles built within these VIN breakpoints:

YEAR	DIVISION	MODEL	PLANT	FROM	THROUGH
2000	Buick	Century/Regal	Oshawa 2	Y1311389	Y1340411
2000	Chevrolet	Lumina	Oshawa 2	Y1311211	Y1340410
2000	Chevrolet	Impala/Monte Carlo	Oshawa 1	Y9334602	Y9365791
2000	Chevrolet	Venture	Doraville	YD311479	YD337388
2000	Chevrolet	S/T	Moraine	Y2258880	Y2381029
2000	Chevrolet	S/T	Shreveport	Y8269084	Y8297381
2000	Chevrolet	S/T	Linden	YK262348	YK276988
2000	Oldsmobile	Intrigue	Fairfax	YF295906	YF318652
2000	Oldsmobile	Silhouette	Doraville	YD315175	YD337287
2000	Oldsmobile	S/T	Moraine	Y2357182	Y2381008
2000	Pontiac	Grand Prix	Fairfax	YF301133	YF318654
2000	Pontiac	Montana	Doraville	YD309642	YD339645
2000	GMC	S/T	Moraine	Y2358187	Y2381000
2000	GMC	S/T	Linden	YK262351	YK276985
2000	GMC	S/T	Shreveport	Y8252997	Y8297377
2001	Buick	Century/Regal	Oshawa 2	11100001	11100024
2001	Chevrolet	Impala/Monte Carlo	Oshawa 1	19100001	19100970
2001	Chevrolet	Lumina	Oshawa 2	11100011	11100011
2001	Chevrolet	Venture	Doraville	1D100001	1D100040
2001	Chevrolet	S/T	Moraine	12100021	12100021
2001	Chevrolet	S/T	Shreveport	18100015	18100018
2001	Chevrolet	S/T	Linden	1K100018	1K100036
2001	Oldsmobile	Intrigue	Fairfax	1F100031	1F100039
2001	Oldsmobile	Silhouette	Doraville	1D100003	1D100064
2001	Oldsmobile	S/T	Moraine	12100020	12100024
2001	Pontiac	Grand Prix	Fairfax	1F100033	1F100046
2001	Pontiac	Montana	Doraville	1D100004	1D100081
2001	GMC	S/T	Moraine	12100019	12100026
2001	GMC	S/T	Linden	1K100019	1K100034
2001	GMC	S/T	Shreveport	18100014	18100017

IMPORTANT: Dealers should confirm vehicle through **GMVIS** (GM Vehicle Inquiry System) or **GM Access Screen** (Canada only) or **DCS Screen 445** (IPC only) before beginning campaign repairs. [Not all vehicles within the above breakpoints may be involved.]

Involved vehicles have been identified by Vehicle Identification Number. Computer listings containing the complete Vehicle Identification Number, customer name and address data have been prepared, and are being furnished to involved dealers with the campaign bulletin. The customer name and address data furnished will enable dealers to follow up with customers involved in this campaign. Any dealer not receiving a computer listing with the campaign bulletin has no involved vehicles currently assigned.

These dealer listings may contain customer names and addresses obtained from Motor Vehicle Registration Records. The use of such motor vehicle registration data for any other

purpose is a violation of law in several states/provinces/countries. Accordingly, you are urged to limit the use of this listing to the follow-up necessary to complete this campaign.

PARTS INFORMATION

Parts required to complete this campaign are to be obtained from General Motors Service Parts Operations (GMSPO). Please refer to your "involved vehicles listing" before ordering parts. Normal orders should be placed on a DRO = Daily Replenishment Order. In an emergency situation, parts should be ordered on a CSO = Customer Special Order.


Part Number	Position and Description	Quantity/ Vehicle
12457479	U-Van Front RH - BELT KIT,D/SEAT(BKL SI)(W/PRETENSIONER)(GRAY)	As reqd.
12457483	U-Van Front RH - BELT KIT,P/SEAT(BKL SI)(W/PRETENSIONER)(GRAY)	As reqd.
12457486	U-Van Front RH - BELT KIT,P/SEAT(BKL SI)(W/PRETENSIONER)(SABLE)	As reqd.
12459820	U-Van Rear Center - BELT KIT,R/SEAT CTR(BKL SI)(#2)(INCLS CTR BELT COMPL & LH/RH BKL)(SABLE)	As reqd.
12531150	U-Van Rear Center - BELT KIT,R/SEAT(BKL SI)(GRAY)	As reqd.
88894663	U-Van Rear Center - BELT KIT,R/SEAT CTR(BKL SI)(INCLS CTR BELT COMPL & LH/RH BKL)(GRAY)	As reqd.
88894664	U-Van Rear Center - BELT KIT,R/SEAT CTR(BKL SI)(INCLS CTR BELT COMPL & LH/RH BKL)(NEUTRAL)	As reqd.
88894671	U-Van Rear Center - BELT KIT,R/SEAT(BKL SI)(BEIGE)	As reqd.
88895093	U-Van Rear Center - BELT KIT,R/SEAT(BKL SI)(60%)(GRAY)	As reqd.
88895094	U-Van Rear Seat Bench - BELT KIT,R/SEAT(BKL SI)(60%)(NEUTRAL)	As reqd.
88895095	U-Van Rear Seat Bench - BELT KIT,R/SEAT(BKL SI)(60%)(SABLE)	As reqd.
12369754	W-Car Rear Center - BELT KIT,R/SEAT CTR & OTR ST BKL(7 PANEL WEBBING)(NEUTRAL)	As reqd.
12453442	W-Car Front Center - BELT KIT,F/SEAT CTR(BLUE)	As reqd.
12458469	W-Car Front LH - BELT KIT,D/SEAT(BKL SI)(12 PANEL WEBBING)(GRAY)	As reqd.
12458899	W-Car Front Center - BELT KIT,F/SEAT CTR(PEWTER)	As reqd.
12459815	W-Car Rear RH - BELT KIT,R/SEAT CTR(LAT SI)(PEWTER)	As reqd.
12459816	W-Car Rear RH - BELT KIT,R/SEAT CTR(LAT SI)(OAK)	As reqd.
12459833	W-Car Front LH - BELT KIT,D/SEAT(BKL SI)(OAK)	As reqd.
88893317	W-Car Front LH - BELT KIT,D/SEAT(BKL SI)(EBONY)	As reqd.
88893318	W-Car Front RH - BELT KIT,P/SEAT(BKL SI)(PEWTER)	As reqd.
88893319	W-Car Front RH - BELT KIT,P/SEAT(BKL SI)(OAK)	As reqd.
88893320	W-Car Front RH - BELT KIT,P/SEAT(BKL SI)(BLUE)	As reqd.
88893321	W-Car Front RH - BELT KIT,P/SEAT(BKL SI)(EBONY)	As reqd.
88893325	W-Car Rear RH - BELT KIT,R/SEAT CTR & OTR ST BKL(PEWTER)	As reqd.
88893353	W-Car Rear Center - BELT KIT,R/SEAT CTR & OTR ST BKL(OAK)	As reqd.
88893354	W-Car Rear Center - BELT KIT,R/SEAT CTR & OTR ST BKL(EBONY)	As reqd.
88893355	W-Car Rear LH - BELT KIT,R/SEAT CTR & OTR ST BKL(PEWTER)	As reqd.
88893356	W-Car Rear RH - BELT KIT,R/SEAT CTR & OTR ST BKL(OAK)	As reqd.
88894557	W-Car Front Center - BELT KIT,F/SEAT CTR(NEUTRAL)	As reqd.
88894558	W-Car Front Center - BELT KIT,F/SEAT CTR(PEWTER)	As reqd.
88894560	W-Car Rear Center - BELT KIT,R/SEAT CTR & OTR ST BKL(PEWTER)	As reqd.
88894561	W-Car Rear Center - BELT KIT,R/SEAT CTR & OTR ST BKL(GRAY)	As reqd.
88894562	W-Car Rear Center - BELT KIT,R/SEAT CTR & OTR ST BKL(BLUE)	As reqd.
88894563	W-Car Rear Center - BELT KIT,R/SEAT CTR & OTR ST BKL(GRAPHITE)	As reqd.

Part Number	Position and Description	Quantity/ Vehicle
88894565	W-Car Rear Center - BELT KIT,R/SEAT CTR & OTR ST BKL(GRAY)	As reqd.
88884566	W-Car Rear Center - BELT KIT,R/SEAT CTR & OTR ST BKL(7-PANEL WEBBING)(NEUTRAL)	As reqd.
88895099	W-Car Front LH - BELT,D/SEAT(BKL SI)(NEUTRAL)	As reqd.
88895102	W-Car Front RH - BELT KIT,P/SEAT(BKL SI)(NEUTRAL)	As reqd.
88895103	W-Car Front RH - BELT KIT,P/SEAT(BKL SI)(GRAY)	As reqd.
88895104	W-Car Front RH - BELT KIT,P/SEAT(BKL SI)(BLUE)	As reqd.
88895105	W-Car Front Center - BELT KIT,F/SEAT CTR(NEUTRAL)	As reqd.
88895106	W-Car Front Center - BELT KIT,F/SEAT CTR(GRAY)	As reqd.
88896426	W-Car Rear Center - BELT KIT,R/SEAT CTR & OTR ST BKL(NEUTRAL)	As reqd.
88896427	W-Car Rear Center - BELT KIT,R/SEAT CTR & OTR ST BKL(NEUTRAL)	As reqd.
88896429	W-Car Front LH - BELT KIT,D/SEAT(BKL SI)(GRAPHITE)	As reqd.
88896430	W-Car Front RH - BELT KIT,P/SEAT(BKL SI)(7 PANEL WEBBING)(GRAPHITE)	As reqd.
88896432	W-Car Front RH - BELT,P/SEAT(BKL SI)(GRAY)	As reqd.
88896434	W-Car Front RH - BELT KIT,P/SEAT(BKL SI)(NEUTRAL)	As reqd.
12474840	S/T Front RH - BELT KIT,P/SEAT(BKL SI)(GRAPHITE)	As reqd.
12474841	S/T Front LH - BELT KIT,D/SEAT(BKL SI)(BEIGE)	As reqd.
12474843	S/T Front LH - BELT KIT,D/SEAT(BKL SI)(PEWTER)	As reqd.
12474844	S/T Front RH - BELT KIT,P/SEAT(BKL SI)(PEWTER)	As reqd.
12477768	S/T Front RH - BELT KIT,F/SEAT CTR(LAT SI)(INCLS OTR BKL)(GRAPHITE)	As reqd.
12477769	S/T Front RH - BELT KIT,F/SEAT CTR(LAT SI)(INCLS OTR BKL)(BEIGE)	As reqd.
12477774	S/T Split Bench Center - BELT KIT,F/SEAT CTR(BKL SI)(GRAPHITE)	As reqd.
12477776	S/T Split Bench Center - BELT KIT,F/SEAT CTR(BKL SI)(PEWTER)	As reqd.

SERVICE PROCEDURE

Refer to the following table to determine whether

- The suspect seat belt buckle(s) in an involved vehicle can be inspected for suspect date codes(s) (1). See illustration.
- The suspect seat belt buckle(s) in an involved vehicle cannot be inspected and must be replaced.

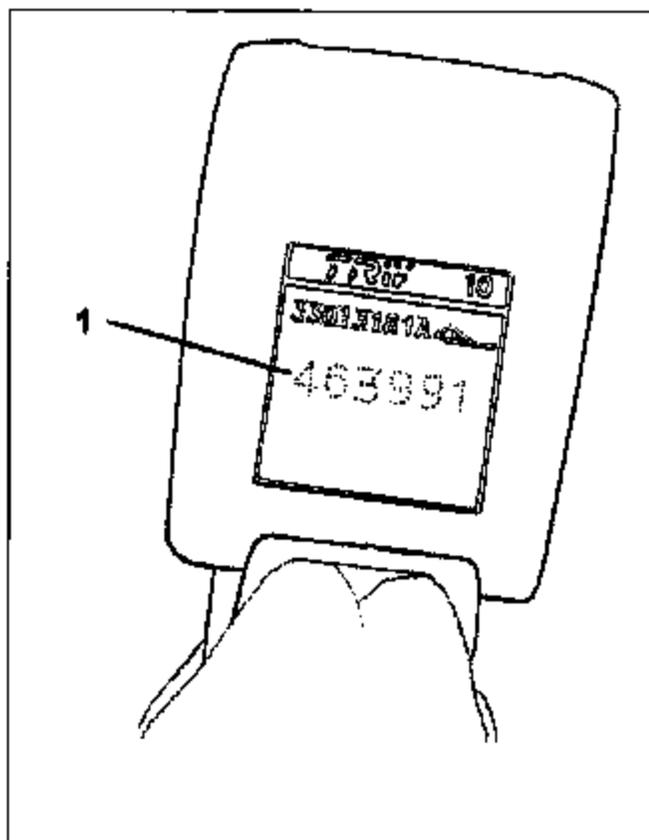

Make	Model	Interior Color	RPO	Begin VIN	Ending VIN	Position	Service Part Numbers	Suspect Date Codes
Chevrolet	U-van	Grey	141	YD311479 1D1000D1	YD377388 1D100040	Driver	12457479	135002
								168001
								156002
								157001
								157002
							161002	
						Frt Passenger	12457483	136001
								136002
								141002
								142001
	162001							
2 nd Row Bench RH	88895093	154001						
		161002						
2 nd or 3 rd Row Capt. Chair	12531150	Repl. - Can't Inspect						
3 rd Row Bench	88894663	145009						
		154001						
		154002						
		154003						
		161002						
		162001						
	162003							
Chevrolet	U-van	Neutral	621	YD311479 1D1000D1	YD377388 1D100040	2 nd Row Bench RH	88895094	161002
						3 rd Row Bench		151001
							151007	
Chevrolet	Lumina	Pewter	921	Y1311211 11100011	Y1340410 11100011	Frt Passenger (incl Ctr Pass)	88894558	Repl. - Can't Inspect
						Rear		151002
							151003	
	151004							

Make	Model	Interior Color	RPO	Begin VIN	Ending VIN	Position	Service Part Numbers	Suspect Date Codes
Chevrolet	Lumina	Neutral	521	Y1311211 11100011	Y1340410 11100011	Frt Passenger (Incl Ctr Pass)	88894557	Repl. - Can't Inspect
Chevrolet	Monte Carlo	Camel	671	Y9334602	Y9341075	Rear	88893353	151001
Chevrolet	Monte Carlo	Camel	671	Y9341076 19100001	Y9365791 19100970	Driver	12459833	Repl. - Can't Inspect
						Frt Passenger	88893319	Repl. - Can't Inspect
						Rear	88893353	151001
Chevrolet	Monte Carlo	Pewter	921	Y9334602	Y9341075	Rear	88893325	161002
Chevrolet	Monte Carlo	Pewter	921	Y9341076 19100001	Y9365791 19100970	Frt Passenger	88893318	Repl. - Can't Inspect
						Rear	88893325	161002
Chevy	Monte Carlo	Black	191	Y9334602	Y9341075	Rear	88893354	148001
								148002
								148003
								148004
								148005
								148006
								148007
								151002
								151004
								151005
								151003
165003								
Chevy	Monte Carlo	Black	191	Y9341076 19100001	Y9365791 19100970	Driver	88893317	Repl. - Can't Inspect
						Frt Passenger	88893321	Repl. - Can't Inspect
						Rear	88893354	148001
148002								
148003								
148004								
148005								
148006								
148007								
151002								
151004								
151005								
151003								
165003								
Chevrolet	Monte Carlo	Neutral	621	19100001	19100970	Rear (2001 only)	88896428	154003

Make	Model	Interior Color	RPO	Begin VIN	Ending VIN	Position	Service Part Numbers	Suspect Date Codes
Chevrolet	Impala	Camel	87I	Y9334802	Y9341075	Rear	88893356	151002
							12459816	151002 151003 154002
Chevrolet	Impala	Camel	87I	Y9341076 19100001	Y9365791 19100970	Driver	12459833	Repl. - Can't Inspect
						Frt Passenger	88893319	Repl. - Can't Inspect
						Rear	88893356 12459816	151002 151002 161003 164002
Chevrolet	Impala	Pewter	92I	Y9334602	Y9341075	Rear	88893355	148002 148003 146004 153002 161002
							12459815	153002 154001 154003 161002
Chevrolet	Impala	Pewter	92I	Y9341076 19100001	Y9365791 19100970	Frt Passenger	88893318	Repl. - Can't Inspect
						Frt Center	12458899	161002
						Rear	88893355 12459816	148002 148003 146004 153002 161002 153002 154001 154003 161002
Chevy	Impala	Dark Blue	27I	Y9341076 19100001	Y9365791 19100970	Frt Passenger	88893320	Can't Inspect
Chevrolet	Impala	Neutral	52I	19100001	19100970	Rear (2001 Only)	88898427	154003

Make	Model	Interior Color	RPO	Begin VIN	Ending VIN	Position	Service Part Numbers	Suspect Date Codes
Pontiac	U-van	Grey	14I	YD309642 1D100004	YD339645 1D100081	Driver	12457479	135002 156001 158002 157001 157002 161002
						Frt Passenger	12457483	136001 136002 141002 142001 162001
						2 nd Row Bench RH	88895083	154001 161002
						2 nd or 3 rd Row Capt. Chair	12631150	Repl. - Can't Inspect
						3 rd Row Bench	88894863	145009 154001 154002 154003 161002 162001 162003
Pontiac	U-van	Neutral	52I	YD309642 1D100004	YD339645 1D100081	2 nd Row Bench RH	88895094	161002
						3 rd Row Bench	88894864	151001 151007
Pontiac	U-Van	Beige	64I	YD309642 1D100004	YD339645 1D100081	Frt Passenger	12457486	157002 161001 161002
						2 nd Row Bench RH	88895095	161002
						2 nd & 3 rd Row Capt. Chair	88894871	Repl. - Can't Inspect
Pontiac	Gr. Prix	Neutral	52I	YF302181	YF318654	Rear	12369754	154001 154002 154003 162003
Pontiac	Gr. Prix	Neutral	52I	YF302183 1F100033	YF318654 1F100046	Driver	88895099	Repl. - Can't Inspect
						Frt Passenger	88895102	Repl. - Can't Inspect
						Rear	12369754	154001 154002 154003 162003
Pontiac	Gr. Prix	Graphite/ Charcoal	12I/ 17I	YF302181	YF318654	Rear	88894563	154001 154002
Pontiac	Gr. Prix	Graphite/ Charcoal	12I/ 17I	YF302183 1F100033	YF318654 1F100046	Driver	88886429	Repl. - Can't Inspect
						Frt Passenger	88896430	Repl. - Can't Inspect
						Rear	88894563	154001 154002

Make	Model	Interior Color	RPO	Begin VIN	Ending VIN	Position	Service Part Numbers	Suspect Date Codes
Oldsmobile	U-van	Grey	14I	YD315175 1D100003	YD337287 1D100064	Driver	12457479	136002 168001 156002 167001 157002 161002
						Frt Passenger	12457483	136001 136002 141002 142001 162001
						2 nd Row Bench RH	88895093	154001 161002
						2 nd or 3 rd Row Capt. Chair	12631150	Repl. - Can't Inspect
						3 rd Row Bench	88894663	145009 154001 154002 154003 161002 162001 162003
Oldsmobile	U-van	Neutral	52I	YD315175 1D100003	YD337287 1D100064	2 nd Row Bench RH	88895094	161002
						3 rd Row Bench	88894664	151001 161007
Oldsmobile	U-Van	Beige	84I	YD315175 1D100003	YD337287 1D100064	Frt Passenger	12457486	157002 161001 161002
						2 nd Row Bench RH	88895096	161002
						2 nd or 3 rd Row Capt. Chair	88894671	Repl. - Can't Inspect
						3 rd Row Bench	12459820	161002
Oldsmobile	Intrigue	Beige	84I	YF295906	YF302197	Rear	12389754	154001 154002 154003 162003
Oldsmobile	Intrigue	Beige	84I	YF302209 1F100031	YF318662 1F100046	Driver	88895099	Repl. - Can't Inspect
						Frt Passenger	88895102	Repl. - Can't Inspect
						Rear	12389754	154001 154002 154003 162003
Oldsmobile	Intrigue	Grey	14I	YF295906	YF302197	Rear	88894665	161002
Oldsmobile	Intrigue	Grey	14I	YF302209 1F100031	YF318662 1F100046	Frt Passenger	88896432	Repl. - Can't Inspect
						Rear	88894665	161002

Make	Model	Interior Color	RPO	Begin VIN	Ending VIN	Position	Service Part Numbers	Suspect Date Codes
Oldsmobile	Intrigue	Neutral	52I	YF295806	YF302187	Rear	88894588	145002 145003 145004 145005 145006 145007 145008 145009 145010 145011 145012 145013
Oldsmobile	Intrigue	Neutral	52I	YF302209 1F100031	YF318652 1F100046	Frt Passenger	88896434	Repl. - Can't Inspect
						Rear	88894588	145002 145003 145004 145005 145006 145007 145008 145009 145010 145011 145012 145013

Make	Model	Interior Color	RPO	Begin VIN	Ending VIN	Position	Service Part Numbers	Suspect Date Codes
Buick	Century	Grey	14I	Y1311389	Y1315424	Rear	88894561	152002 152003 152004 152005 152006 152007 155001
Buick	Century	Grey	14I	Y1315425 11100001	Y1340411 11100024	Driver	12458469	Repl. - Can't Inspect
						Frt Passenger RH	88895103	Repl. - Can't Inspect
						Frt Center	88895106	145002 145003 145004 145005 145006 145007 145008 154001 154002 155001
						Rear	88894561	152002 152003 152004 152005 152006 152007 155001
Buick	Century	Neutral	52I	Y1311389	Y1315424	Rear	12369754	154001 154002 154003 162003
Buick	Century	Neutral	52I	Y1315425 11100001	Y1340411 11100024	Frt Center	88895105	151001
						Rear	12369754	154001 154002 154003 162003
Buick	Century	Medium Blue	30I	Y1311389	Y1315424	Rear	88894562	154001
Buick	Century	Medium Blue	30I	Y1315425 11100001	Y1340411 11100024	Frt Passenger	88895104	Repl. - Can't Inspect
						Frt Center	12453442	154002
						Rear	88894562	154001

Make	Model	Interior Color	RPO	Begin VIN	Ending VIN	Position	Service Part Numbers	Suspect Date Codes
Buick	Regal	Gray	14I	Y1311389	Y1315424	Rear	88894561	152002 152003 152004 152005 152006 152007 155001
Buick	Regal	Grey	14I	Y1315425 11100001	Y1340411 11100024	Driver	12458469	Repl. - Can't Inspect
						Frnt Passenger	88895103	Repl. - Can't Inspect
						Rear	88894561	155001
Buick	Regal	Neutral	52I	Y1311389	Y1315424	Rear	12369754	154001 154002 154003 162003
Buick	Regal	Neutral	52I	Y1315425 11100001	Y1340411 11100024	Frnt Passenger	88895102	Repl. - Can't Inspect
						Rear	12369754	164001 164002 154003 162003
Buick	Regal	Medlum Blue	30I	Y1315425 11100001	Y1340411 11100024	Frnt Passenger	88895104	Repl. - Can't Inspect

Make	Model	Interior Color	RPO	Begin VIN	Ending VIN	Position	Service Part Numbers	Suspect Date Codes
Chevrolet/ GMC/ Oldsmobile	S/T	Beige	841	See S/T VIN Breakpoints in Table		Driver (Bucket or Bench seat)	12474641	Repl. - Can't Inspect
						Frt Passenger (Bench seat only)	12477769	Repl. - Can't Inspect
Chevrolet/ GMC/ Oldsmobile	S/T	Pewter	821	See S/T VIN Breakpoints in Table		Driver (Bucket or Bench Seat)	12474643	Repl. - Can't Inspect
						Frt Passenger (Bucket or Bench)	12474644	Repl. - Can't Inspect
						Frt Center (Bench Seat Only)	12477776	163002
Chevrolet/ GMC/ Oldsmobile	S/T	Graphite	121	See S/T VIN Breakpoints in Table		Frt Passenger (Bucket or Bench Seat)	12474640	Repl. - Can't Inspect
						Frt Passenger (Bench seat only)	12477768	Repl. - Can't Inspect
						Frt. Center (Bench Seat Only)	12477774	157001 163002

Models: Intrigue / Grand Prix / Regal / Century / Monte Carlo / Impala

Location and Seat Type: Front Bucket

Buckle Location: Driver and Passenger

Service Procedure:

- Replace only (no inspection required)
1. Move the seat to the full forward position.
 2. Remove the seat belt buckle nut.
 3. Remove the seat belt buckle.
 4. Disconnect the electrical connector (driver's seat only).
 5. Connect the new seat belt buckle electrical connector (driver's seat only).
 6. Install the seat belt buckle to the seat.
 7. Install the seat belt buckle nut and tighten to 42 N.m (31 lb. ft.).

Models: Century / Impala
Location and Seat Type: Front 60/40 Split Bench
Buckle Location: Driver Center and Passenger

Service Procedure:

- Replace driver and passenger (no inspection required)
- Inspect center and replace if required

The following procedure applies to the driver, center and passenger seat belt buckles except where indicated.

1. Inspect the date codes on the center front seat belt buckle to determine if replacement is required. See Date Code Information.
2. Remove the left hand fuse panel cover and remove SIR fuse.
3. Move the seat to the full rearward position and disconnect the air bag connector under the seat.
4. Remove the seat track front covers.
5. Move the seat forward and remove the bolts attaching the seat to the floor.
6. Remove the seat belt cover from the seat and remove seat belt retaining nut.
7. Disconnect the seat electrical connector.
8. Remove the head rest.
9. Remove the seat from the vehicle.
10. Disconnect the seat belt buckle electrical connector.
11. Remove the seat belt buckle retaining nut.
12. Remove the seat belt buckle from the seat.
IMPORTANT: The center seat belt replacement kits include both the buckle and latch plate. It is NOT necessary to replace the latch plate if center buckle replacement is required.
13. If center buckle replacement is required, using a drill, remove the rivet that attaches the center buckle to the seat track.
14. If center buckle replacement is required, attach the center buckle to the seat track with a new rivet.
15. Install the seat belt buckle to the seat and install the retaining nut. Tighten to 42 N.m (31 lb. ft.).
16. Connect the seat belt buckle electrical connector.
17. Install the seat in the vehicle.
18. Install the head rest.
19. Connect the seat electrical connector.
20. Install the seat belt, retaining nut and cover to the seat. Tighten to 42 N.m (31 lb. ft.).
21. Install the bolts attaching the seat to the floor. Tighten to 24 N.m (18 lb. ft.).
22. Install the seat track front covers.

23. Move seat to the full rearward position and connect the air bag connector under the seat (driver's seat only).
24. Install the SIR fuse and left hand fuse panel cover.
25. Install the GM Campaign Identification Label.

Models: Lumina
Location and Seat Type: Front 60/40 Split Bench
Buckle Location: Driver, Center and Passenger

IMPORTANT: When replacing the driver and passenger buckles, the center buckle will also get replaced because it is attached to the passenger buckle. Therefore, no inspection of the center buckle is required.

Service Procedure:

- Replace only (no inspection required).
1. Move the seat to the full forward position.
 2. Remove the plastic covers from the base of the seat belt buckles.
 3. Remove the bolts attaching the seat belt buckles to the floor.
 4. Disconnect the electrical connector (driver's seat belt buckle only).
 5. Remove the seat belt buckles.
 6. Install the new seat belt buckles.
 7. Connect the electrical connector (driver's seat belt buckle only).
 8. Install the bolts attaching the seat belt buckles to the floor and tighten to 42 N.m (31 lb. ft.).
 9. Install the plastic covers on the base of the seat belt covers.
 10. Install the GM Campaign Identification Label.

Models: Intrigue / Grand Prix / Regal/Century / Monte Carlo/Impala/ Lumina
Location and Seat Type: Rear Bench
Buckle Location: Left, Center, Right

Service Procedure

- Inspect and replace if required
1. Inspect the date codes on the left, center and right rear seat belt buckles to determine if replacement is required. See Date Code Information. If one or more buckles require replacement, proceed to step 2. If no replacement is required, proceed to Step 8.
 2. Remove the rear seat cushion.
 3. Remove the seat belt buckles(s) attaching nut(s).
IMPORTANT: Some rear seat belt buckle kits include all three buckles (right, center, left) as well as the center latch plate. In some kits two buckles or one buckle and the center latch plate may be pre-assembled. Install these pre-assembled parts as is and do NOT attempt to separate. Also, do NOT install the other buckle assembly included in the kit unless the inspection done in step 1 indicates that replacement is required.
 4. Remove the necessary seat belt buckle(s).

5. Install the new seat belt buckle assembly(s).
6. Install the seat belt buckle attaching nut(s) and tighten to 42 N.m (31 lb. ft.).
7. Install the rear seat cushion.
8. Install the GM Campaign Identification Label.

Models: Montana / Venture / Silhouette
Location and Seat Type: Front Captain's Chairs
Buckle Location: Driver or Passenger

Service Procedure:

- Inspect and replace if required
1. Inspect the date codes on both the driver and passenger seat belt buckles to determine if replacement is required. See Date Code Information. If one or both buckles require replacement, proceed to step 2. If no front buckles require replacement proceed to the appropriate 2nd and 3rd row seat belt buckle inspection/replacement section.
 2. Remove the SIR fuse.
 3. Remove the nuts attaching the seat assembly to the floor.
 4. Remove the Connector Position Assurance (CPA) from the connectors and disconnect the electrical connectors from the seat.
 5. Remove the seat from the vehicle.
 6. Remove the screws attaching the side cover to the seat and remove the cover.
 7. Remove the nut attaching the seat belt buckle and pre-tensioner assembly to the seat.
 8. Remove the inboard REAR seat track to seat attaching bolt.
 9. Loosen the inboard FRONT seat track to seat attaching bolt.
 10. Disconnect the CPA and disconnect the pre-tensioner electrical connector.
 11. Route the electrical connector between the seat track and seat assembly and remove the seat belt buckle and pre-tensioner assembly.
 12. Route the new electrical connector between the seat track and seat assembly and install the buckle and pre-tensioner assembly on the seat stud.
 13. Connect the pre-tensioner electrical connector and install the CPA.
 14. Install the nut attaching the buckle and pre-tensioner assembly to the seat and tighten to 35 N.m (26 lb. ft.).
 15. Install the inboard REAR seat track to seat attaching bolt and tighten to 32 N.m (24 lb. ft.).
 16. Tighten the inboard FRONT seat track to seat attaching bolt to 32 N.m (24 lb. ft.).
 17. Install the side cover on the seat and install the attaching screws. Tighten to 2 N.m (18 lb. in.).
 18. Install the seat in the vehicle.
 19. Connect the electrical connectors and install the CPA.
 20. Install the nuts attaching the seat assembly to the floor and tighten to 40 N.m (30 lb. ft.).

21. Install the SIR fuse.
22. Turn the ignition switch to the "ON" position and verify that the AIR BAG light flashes 7 times and goes out.
23. Proceed to the appropriate 2nd and 3rd row seat belt buckle inspection/replacement section.

Models: Montana / Venture / Silhouette
Location and Seat Type: 2nd or 3rd Row with Captains Chairs
Buckle Location: All

Service Procedure:

- Replace only (no inspection required).
 1. Remove the screws attaching the side cover and remove the cover.
 2. Remove the seat belt buckle nut and remove the buckle.
 3. Install the new seat belt buckle.
 4. Install the nut and tighten to 53 N.m (39 lb. ft.).
 5. Install the side cover and tighten screws to 2 N.m (18 lb. In.).
 6. Install the GM Campaign Identification Label.

Models: Montana / Venture / Silhouette
Location and Seat Type: 2nd Row with Split Bench Seat
Buckle Location: Left and Right

Service Procedure:

- Inspect and replace if required
 1. Inspect the date code on each seat belt buckle on to determine if replacement is required. See Date Code Information. If one or more buckles require replacement, proceed to the appropriate seat description below. If no buckles require replacement proceed to step 2 after the seat descriptions.
 - **Right Seat:**
 - Remove the seat from the vehicle.
 - Unhook the J-strip on the bottom rear of the seat cushion to access the seat belt buckle retaining bolt.
 - Remove the retaining bolt and the seat belt buckle.
 - Install the new seat belt buckle in the seat.
 - Install the retaining bolt and tighten to 53 N.m (39 lb. ft.).
 - Re-hook the J-strip on the bottom rear of the seat cushion.
 - Install the seat in the vehicle.
 - **Left Seat:**
 - Remove the seat from the vehicle.
 - Reposition the seat cushion material to access the seat belt buckle retaining bolt.

- Remove the retaining bolt and the seat belt buckle.
- Install the new seat belt buckle in the seat.
- Install the retaining bolt and tighten to 53 N.m (39 lb. ft.).
- Install the seat in the vehicle.

2. Install the GM Campaign Identification Label.

Models: Montana / Venture / Silhouette
Location and Seat Type: 3rd Row with 50/50 Bench Seat
Buckle Location: Left, Center, Right

Service Procedure:

- Inspect and replace if required
1. Inspect the date code on each seat belt buckle on to determine if replacement is required. See date code information. If one or more buckles require replacement, proceed to step 2. If no buckles require replacement proceed to step 9.
 2. Remove the seat from the vehicle.
 3. Unhook the J-strip on the bottom rear of the seat cushion to access the seat belt buckle retaining bolt.
 4. Remove the retaining bolt and the seat belt buckle.
 5. Install the new seat belt buckle in the seat.
 6. Install the retaining bolt and tighten to 53 N.m (39 lb. ft.).
 7. Re-hook the J-strip on the bottom rear of the seat cushion.
 8. Install the seat in the vehicle.
 9. Install the GM Campaign Identification Label.

Models: S/T Truck
Location and Seat Type: Front Buckets
Buckle Location: Driver or Passenger

Service Procedure:

- Replace only (no inspection required)
1. Remove the seat track front and rear covers.
 2. Remove the nuts and bolt that attach the seat track to the floor.
 3. Disconnect the electrical connector from under the seat (driver's side only).
 4. Remove the seat from the vehicle.
 5. Remove the seat belt buckle retaining bolt and remove the buckle.
 6. Install the new buckle and retaining bolt. Tighten to 70 N.m (52 lb. ft.).
 7. Install the seat in the vehicle.
 8. Connect the electrical connector under the seat (driver's side only).
 9. Install the nuts that attach the seat track to the floor. Tighten to 45 N.m (33 lb. ft.).
 10. Install the bolt that attaches the seat track to the floor. Tighten to 70 N.m (52 lb. ft.).

11. Install the seat track front and rear covers.
12. Install the GM Campaign Identification Label.

Models: S/T Pickup
Location and Seat Type: Front Split Bench
Buckle Location: Driver, Center and Passenger

Service Procedure:

- Replace driver and RH passenger (no inspection required)
- Inspect center passenger buckle and replace if required
- 1. Inspect the date code on center passenger buckle to determine if replacement is required. See date code information.
 - **Driver, or Both Driver and Center Seat Belt Buckles:**
 - Move the seat to the full forward position and remove the seat track covers.
 - Remove the bolt and nut attaching the rear of the seat to the floor.
 - Move the seat to the full rearward position and remove the covers from the nuts that attach the front of the seat to the floor.
 - Remove the nuts that attach the front of the seat to the floor.
 - Disconnect the electrical connector from under the seat.
 - Remove the seat from the vehicle.
 - Disconnect the seat belt buckle electrical connector.
 - Remove the seat belt buckle retaining nut and remove the buckle from the seat.

IMPORTANT: If the center seat belt buckle also requires replacement, do so at this time using the described steps. If the center buckle does not require replacement, proceed with the installation of the new driver seat belt buckle.

IMPORTANT: The brass bushing or grommet described in the next step is used as an assembly aid during the assembly of the vehicle. It is not necessary to replace the bushing if center buckle replacement is required.

- Using an appropriate tool, separate the center seat belt buckle mounting bracket from the driver's seat track by removing the brass bushing. Completely remove the bushing and discard it. No replacement bushing is required when reassembling.
- Install the new seat belt buckle in the seat and install the retaining nut. Tighten to 70 N.m (52 lb. ft.).
- Connect the seat belt buckle electrical connector.
- Install the seat in the vehicle.
- Connect the electrical connector under the seat.
- Install the nuts that attach the front of the seat to the floor. Tighten to 45 N.m (33 lb. ft.).
- Install the covers on the nuts that attach the front of the seat to the floor.
- Move the seat to the full forward position.

- If the center seat belt buckle is also being replaced, install the new center buckle on the seat track at this time.
- Install the nut that attaches the rear of the seat to the floor. Tighten to 45 N.m (33 lb. ft.).
- Install the bolt that attaches the rear of the seat to the floor. Tighten to 70 N.m (52 lb. ft.).
- Install the seat track covers.
- **Passenger Seat Belt Buckle:**
 - Move driver's seat to the full forward position.
 - Remove the passenger seat belt buckle retaining bolt.
 - Remove the passenger seat belt buckle from the seat.
 - Install the new passenger seat belt buckle in the seat.
 - Install the passenger seat belt buckle retaining bolt. Tighten to 70 N.m (52 lb. ft.).
 - Move the driver's seat to the appropriate position.

2. Install the GM Campaign Identification Label.

CAMPAIGN IDENTIFICATION LABEL – For US and IPC

Place a Campaign Identification Label on each vehicle corrected in accordance with the instructions outlined in this Product Campaign Bulletin. Each label provides a space to include the campaign number and the five (5) digit dealer code of the dealer performing the campaign service. This information may be inserted with a typewriter or a ball point pen.

Put the Campaign Identification Label on a clean and dry surface of the radiator core support in an area that will be visible to people servicing the vehicle. **When installing the Campaign Identification Label, be sure to pull the tab to allow adhesion of the clear protective covering. Additional Campaign Identification Labels for US dealers can be obtained from Dealer Support Materials by calling 1-888-549-8152 (Monday-Friday, 8:00 a.m. to 5:00 p.m. EST). Ask for Item Number S-1015 when ordering.**


Additional Campaign Identification Labels for IPC dealers can be obtained from your Regional Marketing Office

CAMPAIGN IDENTIFICATION LABEL – For CANADA

Place a Campaign Identification Label on each vehicle corrected in accordance with the instructions outlined in this Product Campaign Bulletin. Each label provides a space to include the campaign number and the five (5) digit dealer code of the dealer performing the campaign service. This information may be inserted with a typewriter or a ball point pen.



Put the Campaign Identification Label on a clean and dry surface of the radiator core support in an area that will be visible to people servicing the vehicle. **Additional Campaign Identification Labels for Canadian dealers can be obtained from DGN by calling 1-800-668-5539 (Monday-Friday, 8:00 a.m. to 5:00 p.m. EST). Ask for Item Number GMP 91 when ordering.**

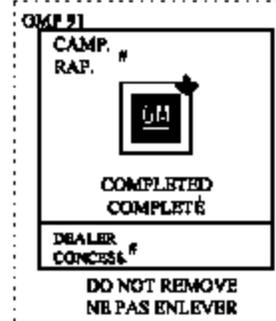

CLAIM INFORMATION

Submit a Product Campaign Claim with the information indicated below:

REPAIR PERFORMED	PART COUNT	PART NO.	PARTS ALLOW	CC-FC	LABOR OP	LABOR HOURS
<u>U-Van with frt Capt. Chairs, 2nd and 3rd row split bench</u> Inspect only:	--	--	--	MA-96	VO636	* 0.2
Add: Driver seat belt buckle repl. (with pretensioner)	1	12457479	**			0.5
Add: Frt passenger seat belt buckle repl.	1	12467479	**			0.5
Add: Both frt seat belt buckle replace (bucket seat with pretensioner)	2	12457479	**			0.8
Add: 2 nd row RH seat belt buckle repl. (split bench)	1	12457479	**			0.2
Add: 2 nd row LH seat belt buckle repl. (split bench)	1	12457479	**			0.1
Add: 3 rd row repl. one seat belt buckle (split bench)	1	12457479	**			0.2
Add: 3 rd row repl. second and/or third seat belt buckle(s)	1 or 2	12457479	**			0.2
<u>U-Van with frt capt. chairs, 2nd and 3rd row capt. chairs</u> Inspect only:	--	--	--	MA-96	VO837	* 0.2
Add: Driver seat belt buckle repl. (with pretensioner)	1	12467479	**			0.5
Add: Frt passenger seat belt buckle repl. (with pretensioner)	1	12457479	**			0.5
Add: Both frt seat belt buckle replace (bucket seat with pretensioner)	2	12457479	**			0.8
Add: 2 nd row seat belt buckles repl. (capt. Chair both LH and RH)	2	88894671	**			0.3
Add: 2 nd & 3 rd row seat belt buckles repl. (capt. Chair - All 4)	4	88894671	**			0.5

REPAIR PERFORMED	PART COUNT	PART NO.	PARTS ALLOW	CC-FC	LABOR OP	LABOR HOURS
<u>S/T with bucket seats</u> Repl either driver or passenger bucket seat belt buckle (not both)	1	12474641		MA 96	V0638	* 0.4
Repl <u>both</u> driver & passenger bucket seat belt buckle	1	12474640		MA 96	V0639	* 0.7
<u>S/T with bench seat</u> Inspect only	-	-		MA-96	V0640	* 0.2
Add: Repl driver seat belt buckle	1	12477769	**			0.3
Add: Repl center passenger seat belt buckle (attached to driver's seat)	1	12477769	**			0.3
Add: Repl RH passenger seat belt buckle	1	12477769	**			0.1
<u>Chevrolet Lumina (bench)</u> Inspect only	-	-	-	MA-96	V0641	* 0.2
Add: Repl. driver seat belt buckle	1	88894557	**			0.1
Add: Repl frt passenger seat belt buckle	1	88894557	**			0.1
Add: Repl. both driver and frt passenger seat belt buckle	2	88894557	**			0.2
Add: Repl rear seat belt buckle - one or all	1	88894557	**			0.1
<u>Chevrolet, Buick Bucket Seats</u> Inspect only	-	-	-	MA-96	V0642	* 0.2
Add: Repl driver seat belt buckle	1	88893353	**			0.2
Add: Repl frt passenger seat belt buckle	1	88893353	**			0.1
Add: Repl both driver and frt passenger seat belt buckle	2	88893353	**			0.2
Add: Repl rear seat belt buckle - one or all	1	88893353	**			0.1

REPAIR PERFORMED	PART COUNT	PART NO.	PARTS ALLOW	CC-FC	LABOR OP	LABOR HOURS
<u>Intrigue, Gr. Prix Bucket Seats</u> Inspect only	—	—	—	MA-96	V0843	• 0.2
Add: Repl driver seat belt buckle	1	88895099	**			0.2
Add: Repl frt passenger seat belt buckle	1	88895099	**			0.1
Add: Repl both driver and frt passenger seat belt buckle	2	88895099	**			0.3
Add: Repl rear seat belt buckle — one or all	1	88895099	**			0.1
<u>Impala, Century with 60/40 split bench</u> Inspect only	--	--		MA-96	V0844	• 0.2
Add: Repl. driver seat belt buckle	1	12458469	**			0.4
Add: Repl. frt passenger seat belt buckle	1	12458469	**			0.3
Add: Repl both driver and RH front passenger seat belt buckles	2	12458469	**			0.6
Add: Repl both driver and ctr frt passenger seat belt buckle	2	12458469	**			0.7
Add: Repl both RH and ctr frt passenger seat belt buckles	2	12458469	**			0.4
Add: Repl only ctr frt passenger seat belt buckle	1	12458469	**			0.4
Add: Repl rear seat belt buckle — one or all	1	12458469	**			0.1

* For Campaign Administrative Allowance, add 0.1 hours to the "Labor Hours".

** The "Parts Allowance" should be the sum total of the current GMSPO Dealer Net price plus applicable Mark-Up or Landed Cost Mark-Up (for IPC) for parts needed to complete the repair.

CUSTOMER NOTIFICATION – For US and CANADA

Customers will be notified of this campaign on their vehicles by General Motors (see copy of customer letter included with this bulletin).

CUSTOMER NOTIFICATION – For IPC

Letters will be sent to known owners of record located within areas covered by the US National Traffic and Motor Vehicle Safety Act. For owners outside these areas, dealers should notify customers using the attached suggested dealer letter.

DEALER CAMPAIGN RESPONSIBILITY – For US and IPC (US States, Territories, and Possessions)

The US National Traffic and Motor Vehicle Safety Act provides that each vehicle that is subject to a recall campaign of this type must be adequately repaired within a reasonable time after the customer has tendered it for repair. A failure to repair within sixty days after tender of a vehicle is prima facie evidence of failure to repair within a reasonable time. If the condition is not adequately repaired within a reasonable time, the customer may be entitled to an identical or reasonably equivalent vehicle at no charge or to a refund of the purchase price less a reasonable allowance for depreciation. To avoid having to provide these burdensome remedies, every effort must be made to promptly schedule an appointment with each customer and to repair their vehicle as soon as possible. In the recall campaign notification letters, customers are told how to contact the US National Highway Traffic Safety Administration if the campaign is not completed within a reasonable time.

This bulletin is notice to you that the new motor vehicles included in this campaign may not comply with the standard identified above. Under Title 49, Section 30112 of the United States Code, it is illegal for a dealer to sell a new motor vehicle which the dealer knows does not comply with an applicable Federal Motor Vehicle Safety Standard. As a consequence, if you sell any of these motor vehicles without first performing the campaign correction, your dealership may be subject to a civil penalty for each such sale.

DEALER CAMPAIGN RESPONSIBILITY - ALL

All unsold new vehicles in dealers' possession and subject to this campaign must be held and inspected/repaired per the service procedure of this campaign bulletin before customers take possession of these vehicles.

Dealers are to service all vehicles subject to this campaign at no charge to customers, regardless of mileage, age of vehicle, or ownership, from this time forward.

Customers who have recently purchased vehicles sold from your vehicle inventory, and for which there is no customer information indicated on the dealer listing, are to be contacted by the dealer. Arrangements are to be made to make the required correction according to the instructions contained in this bulletin. This could be done by mailing to such customers, a copy of the customer letter accompanying this bulletin. Campaign follow-up cards should not be used for this purpose, since the customer may not as yet have received the notification letter.

In summary, whenever a vehicle subject to this campaign enters your vehicle inventory, or is in your dealership for service in the future, you must take the steps necessary to be sure the campaign correction has been made before selling or releasing the vehicle.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the tools, equipment, safety instructions, and know-how to do a job properly and safely. If a condition is described, **DO NOT** assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your dealer/retailer for information on whether your vehicle may benefit from the information.



**We Support
Voluntary
Technician
Certification**

December, 2000

Dear General Motors Customer:

This notice is sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act.

Reason For This Recall: General Motors has decided that certain 2000-01 'U'-Van, 2000-01 'W'-Car, and 2000-01 'S/T' Truck model vehicles fail to conform to Federal/Canada Motor Vehicle Safety Standard 209, "Seat Belt Assemblies". The seat belt buckles in certain, specific seating locations in these vehicles do not meet the pull test requirement. In a crash, the seat belt buckle may release and the occupant may receive more severe injuries.

What Will Be Done: Your dealer will replace suspect seat belt buckle assemblies. In certain seating locations, dealers will inspect for a suspect date code and replace seat belt buckle assemblies with suspect date codes. This service will be performed for you at no charge.

How Long Will The Repair Take? The length of time required to perform this inspection and service correction is approximately one hour, forty five minutes. Additional time may be required to schedule and process your vehicle. If your dealer has a large number of vehicles awaiting service, this additional time may be significant. Please ask your dealer if you wish to know how much additional time will be needed to schedule, process and repair your vehicle.

Contacting Your Dealer: Please contact your dealer as soon as possible to arrange a service date. Parts are available and instructions for making this correction have been sent to your dealer. Your dealer is best equipped to obtain parts and provide services to correct your vehicle as promptly as possible. Should your dealer be unable to schedule a service date within a reasonable time, you should contact the appropriate Customer Assistance Center at the listed number below:

Division	Number	Deaf, Hearing Impaired or Speech Impaired *
Buick	1-800-521-7300	1-800-832-8425
Chevrolet	1-800-222-1020	1-800-833-2438
GMC	1-800-462-8782	1-800-462-8583
Pontiac	1-800-762-2737	1-800-833-7668
Oldsmobile	1-800-442-6537	1-800-833-6537
GMODC	(905) 644-4112	
Puerto Rico - English	1-800-496-9992	
Puerto Rico - Español	1-800-496-9993	
Virgin Islands	1-800-496-9994	

* Utilizes Telecommunication Devices for the Deaf/Text Telephones (TDD/TTY)

If, after contacting the appropriate customer assistance center, you are still not satisfied that we have done our best to remedy this condition without charge and within a reasonable time, you may wish to write the Administrator, National Highway Traffic Safety Administration, 400 Seventh Street, SW, Washington, DC 20590 or call 1-888-327-4236.

Customer Reply Card: The attached customer reply card identifies your vehicle. Presentation of this card to your dealer will assist in making the necessary correction in the shortest possible time. If you no longer own this vehicle, please let us know by completing the attached and mailing it in the postage paid envelope.

We are sorry to cause you this inconvenience; however, we have taken this action in the interest of your safety and continued satisfaction with our products.

General Motors Corporation

Enclosure

(SUGGESTED DEALER LETTER)

General Motors has decided that certain 2000-2001 Montana, Venture, Silhouette, Grand Prix, Impala, Lumina, Monte Carlo, Intrigue, Century, Regal, Blazer, S-10, Jimmy, Sonoma and Bravada model vehicles fail to conform to Federal/Canada Motor Vehicle Safety Standard 209, "Seat Belt Assemblies". The seat belt buckles, in certain specific seating locations in these vehicles, do not meet the pull test requirement. In a crash, the seat belt buckle may release and the occupant may receive more severe injuries.

We will replace suspect seat belt buckle assemblies. In certain seating locations, we will inspect for a suspect date code and replace seat belt buckle assemblies with suspect date codes. This service will be performed for you at **no charge**.

Please contact us as soon as possible to arrange a service date.

We sincerely regret any inconvenience this causes you; however, we have taken this action in the interest of your continued satisfaction with our products.

GMODC
General Motors Corporation

00067

/il



Campaign Bulletin

File In Section: Product Campaigns
Bulletin No.: 00067A
Date: February, 2001

DOV-228.003



F/CMVSS NONCOMPLIANCE CAMPAIGN

SUBJECT: 00067A - SEAT BELT BUCKLE

**MODELS: CERTAIN 2000-01 'U'-VAN AND 'W'-CAR MODEL VEHICLES
CERTAIN 2000-01 'S/T' TRUCK MODEL VEHICLES**

**THIS CAMPAIGN BULLETIN SUPERCEDES AND REPLACES CAMPAIGN BULLETIN 00067
ISSUED DECEMBER 20, 2000. THIS BULLETIN IS BEING REVISED AND REISSUED TO
CORRECT ERRORS AND TO CLARIFY THE PROCESS TO BE FOLLOWED TO DETERMINE
WHEN A SEAT BELT BUCKLE ASSEMBLY SHOULD BE INSPECTED AND/OR REPLACED.**

CONDITION

General Motors has decided that certain 2000-01 'U'-Van, 2000-01 'W'-Car, and 2000-01 'S/T' Truck model vehicles fail to conform to Federal/Canada Motor Vehicle Safety Standard 209, "Seat Belt Assemblies". The seat belt buckles in certain, specific seating locations in these vehicles do not meet the pull test requirement. In a crash, the seat belt buckle may release and the occupant may receive more severe injuries.

CORRECTION

Dealers are to inspect for a suspect date code and replace seat belt buckle assemblies having suspect date codes. In certain seating locations, inspection of date codes is not possible, requiring replacement of the seat belt buckle assembly without inspection.

VEHICLES INVOLVED

Involved are certain 2000-01 'U'-Van, 2000-01 'W'-Car, and 2000-01 'S/T' Truck model vehicles built within these VIN breakpoints:

YEAR	DIVISION	MODEL	PLANT	FROM	THROUGH
2000	Buick	Century/Regal	Oshawa 2	Y1311389	Y1340411
2000	Chevrolet	Lumina	Oshawa 2	Y1311211	Y1340410
2000	Chevrolet	Impala/Monte Carlo	Oshawa 1	Y9334802	Y9365791
2000	Chevrolet	Venture	Doraville	YD311479	YD337388
2000	Chevrolet	S/T	Moraine	Y2258880	Y2381029
2000	Chevrolet	S/T	Shreveport	Y8269084	Y8297381
2000	Chevrolet	S/T	Linden	YK262348	YK276988
2000	Oldsmobile	Intrigue	Fairfax	YF295908	YF318652
2000	Oldsmobile	Silhouette	Doraville	YD315175	YD337287
2000	Oldsmobile	S/T	Moraine	Y2357182	Y2381008
2000	Pontiac	Grand Prix	Fairfax	YF301133	YF318654
2000	Pontiac	Montana	Doraville	YD309642	YD339645
2000	GMC	S/T	Moraine	Y2358187	Y2381000
2000	GMC	S/T	Linden	YK262351	YK276985
2000	GMC	S/T	Shreveport	Y8252997	Y8297377
2001	Buick	Century/Regal	Oshawa 2	11100001	11100024
2001	Chevrolet	Impala/Monte Carlo	Oshawa 1	19100001	19100970
2001	Chevrolet	Lumina	Oshawa 2	11100011	11100011
2001	Chevrolet	Venture	Doraville	1D100001	1D100040
2001	Chevrolet	S/T	Moraine	12100021	12100021
2001	Chevrolet	S/T	Shreveport	18100015	18100018
2001	Chevrolet	S/T	Linden	1K100018	1K100036
2001	Oldsmobile	Intrigue	Fairfax	1F100031	1F100039
2001	Oldsmobile	Silhouette	Doraville	1D100003	1D100064
2001	Oldsmobile	S/T	Moraine	12100020	12100024
2001	Pontiac	Grand Prix	Fairfax	1F100033	1F100046
2001	Pontiac	Montana	Doraville	1D100004	1D100081
2001	GMC	S/T	Moraine	12100019	12100026
2001	GMC	S/T	Linden	1K100019	1K100034
2001	GMC	S/T	Shreveport	18100014	18100017

IMPORTANT: Dealers should confirm vehicle through **GMVIS** (GM Vehicle Inquiry System) or **GM Access Screen** (Canada only) or **DCS Screen 445** (IPC only) before beginning campaign repairs. [Not all vehicles within the above breakpoints may be involved.]

Involved vehicles have been identified by Vehicle Identification Number. Computer listings containing the complete Vehicle Identification Number, customer name and address data have been prepared, and are being furnished to involved dealers with the campaign bulletin. The customer name and address data furnished will enable dealers to follow up with customers involved in this campaign. Any dealer not receiving a computer listing with the campaign bulletin has no involved vehicles currently assigned.

These dealer listings may contain customer names and addresses obtained from Motor Vehicle Registration Records. The use of such motor vehicle registration data for any other purpose is a violation of law in several states/provinces/countries. Accordingly, you are urged to limit the use of this listing to the follow-up necessary to complete this campaign.

PARTS INFORMATION

Parts required to complete this campaign are to be obtained from General Motors Service Parts Operations (GMSPO). Please refer to your "Involved vehicles listing" and the Vehicle Seating Position Decision Table (begins on page 7) before ordering parts. Normal orders should be placed on a DRO = Daily Replenishment Order. In an emergency situation, parts should be ordered on a CSO = Customer Special Order.


Part Number	Position and Description	Quantity/ Vehicle
12457479	U-Van Front RH - BELT KIT,D/SEAT(BKL SI)(W/PRETENSIONER)(GRAY)	As reqd.
12457483	U-Van Front RH - BELT KIT,P/SEAT(BKL SI)(W/PRETENSIONER)(GRAY)	As reqd.
12457488	U-Van Front RH - BELT KIT,P/SEAT(BKL SI)(W/PRETENSIONER)(SABLE)	As reqd.
12459820	U-Van Rear Center - BELT KIT,R/SEAT CTR(BKL SI)(#2)(INCLS CTR BELT COMPL & LH/RH BKL)(SABLE)	As reqd.
12531150	U-Van Rear Center - BELT KIT,R/SEAT(BKL SI)(GRAY)	As reqd.
88894663	U-Van Rear Center - BELT KIT,R/SEAT CTR(BKL SI)(INCLS CTR BELT COMPL & LH/RH BKL)(GRAY)	As reqd.
88894664	U-Van Rear Center - BELT KIT,R/SEAT CTR(BKL SI)(INCLS CTR BELT COMPL & LH/RH BKL)(NEUTRAL)	As reqd.
88894671	U-Van Rear Center - BELT KIT,R/SEAT(BKL SI)(BEIGE)	As reqd.
88895083	U-Van Rear Center - BELT KIT,R/SEAT(BKL SI)(60%)(GRAY)	As reqd.
88895094	U-Van Rear Seat Bench - BELT KIT,R/SEAT(BKL SI)(60%)(NEUTRAL)	As reqd.
88895095	U-Van Rear Seat Bench - BELT KIT,R/SEAT(BKL SI)(60%)(SABLE)	As reqd.
12389754	W-Car Rear Center - BELT KIT,R/SEAT CTR & OTR ST BKL(7 PANEL WEBBING)(NEUTRAL)	As reqd.
12453442	W-Car Front Center - BELT KIT,F/SEAT CTR(BLUE)	As reqd.
12458489	W-Car Front LH - BELT KIT,D/SEAT(BKL SI)(12 PANEL WEBBING)(GRAY)	As reqd.
12458899	W-Car Front Center - BELT KIT,F/SEAT CTR(PEWTER)	As reqd.
12459815	W-Car Rear RH - BELT KIT,R/SEAT CTR(LAT SI)(PEWTER)	As reqd.
12459818	W-Car Rear RH - BELT KIT,R/SEAT CTR(LAT SI)(OAK)	As reqd.
12459839	W-Car Front LH - BELT KIT,D/SEAT(BKL SI)(OAK)	As reqd.
88893317	W-Car Front LH - BELT KIT,D/SEAT(BKL SI)(EBONY)	As reqd.
88893318	W-Car Front RH - BELT KIT,P/SEAT(BKL SI)(PEWTER)	As reqd.
88893319	W-Car Front RH - BELT KIT,P/SEAT(BKL SI)(OAK)	As reqd.
88893320	W-Car Front RH - BELT KIT,P/SEAT(BKL SI)(BLUE)	As reqd.
88893321	W-Car Front RH - BELT KIT,P/SEAT(BKL SI)(EBONY)	As reqd.
88893325	W-Car Rear RH - BELT KIT,R/SEAT CTR & OTR ST BKL(PEWTER)	As reqd.
88893353	W-Car Rear Center - BELT KIT,R/SEAT CTR & OTR ST BKL(OAK)	As reqd.
88893354	W-Car Rear Center - BELT KIT,R/SEAT CTR & OTR ST BKL(EBONY)	As reqd.
88893355	W-Car Rear LH - BELT KIT,R/SEAT CTR & OTR ST BKL(PEWTER)	As reqd.
88893356	W-Car Rear RH - BELT KIT,R/SEAT CTR & OTR ST BKL(OAK)	As reqd.
88894557	W-Car Front Center - BELT KIT,F/SEAT CTR(NEUTRAL)	As reqd.
88894558	W-Car Front Center - BELT KIT,F/SEAT CTR(PEWTER)	As reqd.
88894560	W-Car Rear Center - BELT KIT,R/SEAT CTR & OTR ST BKL(PEWTER)	As reqd.
88894561	W-Car Rear Center - BELT KIT,R/SEAT CTR & OTR ST BKL(GRAY)	As reqd.
88894562	W-Car Rear Center - BELT KIT,R/SEAT CTR & OTR ST BKL(BLUE)	As reqd.
88894563	W-Car Rear Center - BELT KIT,R/SEAT CTR & OTR ST BKL(GRAPHITE)	As reqd.

Part Number	Position and Description	Quantity/ Vehicle
88894565	W-Car Rear Center - BELT KIT,R/SEAT CTR & OTR ST BKL(GRAY)	As reqd.
88894566	W-Car Rear Center - BELT KIT,R/SEAT CTR & OTR ST BKL(7-PANEL WEBBING)(NEUTRAL)	As reqd.
88895099	W-Car Front LH - BELT,D/SEAT(BKL SI)(NEUTRAL)	As reqd.
88895102	W-Car Front RH - BELT KIT,P/SEAT(BKL SI)(NEUTRAL)	As reqd.
88895103	W-Car Front RH - BELT KIT,P/SEAT(BKL SI)(GRAY)	As reqd.
88895104	W-Car Front RH - BELT KIT,P/SEAT(BKL SI)(BLUE)	As reqd.
88895105	W-Car Front Center - BELT KIT,F/SEAT CTR(NEUTRAL)	As reqd.
88895106	W-Car Front Center - BELT KIT,F/SEAT CTR(GRAY)	As reqd.
88896426	W-Car Rear Center - BELT KIT,R/SEAT CTR & OTR ST BKL(NEUTRAL)	As reqd.
88896427	W-Car Rear Center - BELT KIT,R/SEAT CTR & OTR ST BKL(NEUTRAL)	As reqd.
88896429	W-Car Front LH - BELT KIT,D/SEAT(BKL SI)(GRAPHITE)	As reqd.
88896430	W-Car Front RH - BELT KIT,P/SEAT(BKL SI)(7 PANEL WEBBING)(GRAPHITE)	As reqd.
88896432	W-Car Front RH - BELT,P/SEAT(BKL SI)(GRAY)	As reqd.
88896434	W-Car Front RH - BELT KIT,P/SEAT(BKL SI)(NEUTRAL)	As reqd.
12474640	S/T Front RH - BELT KIT,P/SEAT(BKL SI)(GRAPHITE)	As reqd.
12474641	S/T Front LH - BELT KIT,D/SEAT(BKL SI)(BEIGE)	As reqd.
12474643	S/T Front LH - BELT KIT,D/SEAT(BKL SI)(PEWTER)	As reqd.
12474644	S/T Front RH - BELT KIT,P/SEAT(BKL SI)(PEWTER)	As reqd.
12477768	S/T Front RH - BELT KIT,F/SEAT CTR(LAT SI)(INCLS OTR BKL)(GRAPHITE)	As reqd.
12477769	S/T Front RH - BELT KIT,F/SEAT CTR(LAT SI)(INCLS OTR BKL)(BEIGE)	As reqd.
12477774	S/T Split Bench Center - BELT KIT,F/SEAT CTR(BKL SI)(GRAPHITE)	As reqd.
12477776	S/T Split Bench Center - BELT KIT,F/SEAT CTR(BKL SI)(PEWTER)	As reqd.

SERVICE PROCEDURE

There are three (3) steps that must be followed to complete this campaign:

- Refer to the Vehicle Seating Position Decision Table to determine which seating positions need to be inspected and/or replaced for the particular vehicle in question.
- See illustration with example date code. Inspect the seat belt buckle assemblies in the seating positions identified in the table for suspect date codes (see date code table on page 7).
- Replace seat belt buckle assemblies with suspect date codes using the appropriate service procedure(s) following the table. Also, replace any seat belt buckle assemblies which have been identified as "Replace Only - No Inspection Required" in the Vehicle Seating Position Decision Table using the appropriate service procedure.

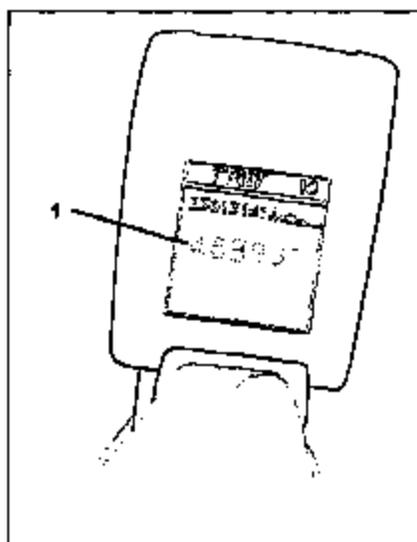

Important: For any involved vehicle, the Vehicle Seating Position Decision Table should be checked to determine which seating positions require inspection and/or replacement of the seat belt buckle assembly. The service procedures provide "how-to" information for inspecting and/or replacing the seat belt buckle assemblies in all seating positions in involved vehicles.

Example:

Year/Model: 2000 Chevrolet Impala
Interior Color: Pewter (92I)
VIN Last 8: Y9366791
Front Seating: AR9 Reclining Front Bucket Seats

Refer to the Vehicle Seating Position Decision Table, page 9.

1. There are two groupings that match the model and interior color, but only the lower grouping includes the VIN of the example vehicle.
2. This grouping indicates that the front passenger, front center, and rear seating positions require inspection and/or replacement.
3. The driver seating position is not included, and does not require any inspection/replacement.
4. Since this vehicle has front bucket seats, there is no front center passenger seating position or seat belt buckle to inspect or replace.
5. The rear seat belt buckles are to be inspected for suspect date codes and replaced if necessary.
6. The front passenger seat belt buckle assembly cannot be inspected and should be replaced with P/N 88893318.
7. To replace the front RH passenger seat belt buckle, follow the service procedure that begins at the top of page 25. This service procedure includes steps for replacing the seat belt buckles for both front seating positions, but on this specific vehicle, only the front passenger seat belt buckle requires replacement.
8. The LH rear seat belt buckle assembly (LH rear and center rear are a single assembly) requires inspection for suspect date codes. If either of the date codes matches any of the suspect date codes (see date code table at the top of page 7), the buckle should be replaced with P/N 88893355. If there is no date code match with any of the suspect date codes, do not replace this seat belt buckle assembly.
9. The RH rear seat buckle assembly requires inspection of the date code. If the date code matches any of the suspect date codes (see date code table at the top of page 7), the buckle should be replaced with P/N 12459815. If the date code does not match any of the suspect date codes, do not replace this seat belt buckle assembly.
10. To replace either of the rear seat belt buckle assemblies, follow the service procedure that begins near the top of page 27. This service procedure includes steps for replacing the seat belt buckles at all three seating positions, if necessary.

Suspect Data Codes

135002	145004	145011	146006	151006	152007	156002	163002
136001	145005	145012	146008	151007	153002	157001	165003
136002	145006	145013	146007	152002	154001	157002	
141002	145007	146001	151001	152003	154002	161001	
142001	145008	146002	151002	152004	154003	161002	
145002	145009	146003	151003	152005	155001	162001	
145003	145010	146004	151004	152006	156001	162003	

IMPORTANT: FOR U-VANS (MONTANA, SILHOUETTE, VENTURE) NO SEAT BELT BUCKLES ON MODULAR BUCKET SEAT (RPO AL4) ARE INVOLVED IN THIS CAMPAIGN. MODULAR BUCKET SEATS DO NOT HAVE ARMRESTS AND CAN BE MOVED TO DIFFERENT LOCATIONS, UNLIKE CAPTAIN'S CHAIRS OR SPLIT BENCH SEATS.

**Vehicle Seating Position
Decision Table**

Division	Model Year	Model	Interior Color	Interior Color RPO	Beginning VIN(s)	Ending VIN(s)	Seating Position to Inspect/Replace	Repair Action Req'd.	Service Part No.
Buick	2000	Century	Grey	14I	Y1311388	Y1315424	Rear (all)	Inspect and Replace if Necessary	88894561
Buick	2000	Century	Grey	14I	Y1315425	Y1340411	Driver	Replace Only - No Inspection Required	12458469
Buick	2000	Century	Grey	14I	Y1315425	Y1340411	Frt Ctr	Inspect and Replace if Necessary	88895106
Buick	2000	Century	Grey	14I	Y1315425	Y1340411	Frt RH Passenger	Replace Only - No Inspection Required	88895103
Buick	2000	Century	Grey	14I	Y1315425	Y1340411	Rear (all)	Inspect and Replace if Necessary	88894561
Buick	2000	Century	Med Blue	30I	Y1311389	Y1315424	Rear (all)	Inspect and Replace if Necessary	88894562
Buick	2000	Century	Med Blue	30I	Y1315425	Y1340411	Frt Ctr	Inspect and Replace if Necessary	12453442
Buick	2000	Century	Med Blue	30I	Y1315425	Y1340411	Frt RH Passenger	Replace Only - No Inspection Required	88895104
Buick	2000	Century	Med Blue	30I	Y1315425	Y1340411	Rear (all)	Inspect and Replace if Necessary	88894562
Buick	2000	Century	Neutral	52I	Y1311388	Y1315424	Rear (all)	Inspect and Replace if Necessary	12369754
Buick	2000	Century	Neutral	52I	Y1315425	Y1340411	Frt Ctr	Inspect and Replace if Necessary	88895105
Buick	2000	Century	Neutral	52I	Y1315425	Y1340411	Rear (all)	Inspect and Replace if Necessary	12369754

Division	Model Year	Model	Interior Color	Interior Color RPO	Beginning VIN(s)	Ending VIN(s)	Seating Position to Inspect/Replace	Repair Action Req'd.	Service Part No.
Buick	2000	Regal	Grey	14i	Y1311389	Y1315424	Rear (all)	Inspect and Replace if Necessary	88894561
Buick	2000	Regal	Grey	14i	Y1315425	Y1340411	Driver	Replace Only - No Inspection Required	12458489
Buick	2000	Regal	Grey	14i	Y1315425	Y1340411	Frt RH Passenger	Replace Only - No Inspection Required	88895103
Buick	2000	Regal	Grey	14i	Y1315425	Y1340411	Rear (all)	Inspect and Replace if Necessary	88894561
Buick	2000	Regal	Med Blue	30i	Y1315425	Y1340411	Frt RH Passenger	Replace Only - No Inspection Required	88895104
Buick	2000	Regal	Neutral	52i	Y1311389	Y1315424	Rear (all)	Inspect and Replace if Necessary	12369754
Buick	2000	Regal	Neutral	52i	Y1315425	Y1340411	Frt RH Passenger	Replace Only - No Inspection Required	88895102
Buick	2000	Regal	Neutral	52i	Y1315425	Y1340411	Rear (all)	Inspect and Replace if Necessary	12369754
Buick	2001	Century	Grey	14i	11100001	11100024	Driver	Replace Only - No Inspection Required	12458489
Buick	2001	Century	Grey	14i	11100001	11100024	Frt RH Passenger	Inspect and Replace if Necessary	88896106
Buick	2001	Century	Grey	14i	11100001	11100024	Frt Ctr	Replace Only - No Inspection Required	88895103
Buick	2001	Century	Grey	14i	11100001	11100024	Rear (all)	Inspect and Replace if Necessary	88894561
Buick	2001	Century	Med Blue	30i	11100001	11100024	Frt Ctr	Inspect and Replace if Necessary	12463442
Buick	2001	Century	Med Blue	30i	11100001	11100024	Frt RH Passenger	Replace Only - No Inspection Required	88895104
Buick	2001	Century	Med Blue	30i	11100001	11100024	Rear (all)	Inspect and Replace if Necessary	88894562
Buick	2001	Century	Neutral	52i	11100001	11100024	Frt Ctr	Inspect and Replace if Necessary	88895105
Buick	2001	Century	Neutral	52i	11100001	11100024	Rear (all)	Inspect and Replace if Necessary	12369754
Buick	2001	Regal	Grey	14i	11100001	11100024	Driver	Replace Only - No Inspection Required	12458489
Buick	2001	Regal	Grey	14i	11100001	11100024	Frt RH Passenger	Replace Only - No Inspection Required	88895103
Buick	2001	Regal	Grey	14i	11100001	11100024	Rear (all)	Inspect and Replace if Necessary	88894561
Buick	2001	Regal	Med Blue	30i	11100001	11100024	Frt RH Passenger	Replace Only - No Inspection Required	88895104
Buick	2001	Regal	Neutral	52i	11100001	11100024	Frt RH Passenger	Replace Only - No Inspection Required	88896102
Buick	2001	Regal	Neutral	52i	11100001	11100024	Rear (all)	Inspect and Replace if Necessary	12369754

Division	Model Year	Model	Interior Color	Interior Color RPO	Beginning VIN(s)	Ending VIN(s)	Seating Position to Inspect/Replace	Repair Action Req'd.	Service Part No.
Chevrolet	2000	Impala	Camel	871	Y9334602	Y9341075	Rear LH and Ctr	Inspect and Replace if Necessary	12459816
Chevrolet	2000	Impala	Camel	871	Y9334602	Y9341075	Rear RH	Inspect and Replace if Necessary	88893356
Chevrolet	2000	Impala	Camel	871	Y9341076	Y9385791	Driver	Replace Only - No Inspection Required	12459833
Chevrolet	2000	Impala	Camel	871	Y9341076	Y9385791	Frt RH Passenger	Replace Only - No Inspection Required	88893319
Chevrolet	2000	Impala	Camel	871	Y9341076	Y9385791	Rear LH and Ctr	Inspect and Replace if Necessary	12459816
Chevrolet	2000	Impala	Camel	871	Y9341076	Y9385791	Rear RH	Inspect and Replace if Necessary	88893356
Chevrolet	2000	Impala	Dark Blue	271	Y9341076	Y9385791	Frt RH Passenger	Replace Only - No Inspection Required	88893320
Chevrolet	2000	Impala	Pewter	921	Y9334602	Y9341075	Rear LH and Ctr	Inspect and Replace if Necessary	88893355
Chevrolet	2000	Impala	Pewter	921	Y9334602	Y9341075	Rear RH	Inspect and Replace if Necessary	12459815
Chevrolet	2000	Impala	Pewter	921	Y9341076	Y9385791	Frt RH Passenger	Replace Only - No Inspection Required	88893318
Chevrolet	2000	Impala	Pewter	921	Y9341076	Y9385791	Frt Ctr	Inspect and Replace if Necessary	12458999
Chevrolet	2000	Impala	Pewter	921	Y9341076	Y9385791	Rear LH and Ctr	Inspect and Replace if Necessary	88893355
Chevrolet	2000	Impala	Pewter	921	Y9341076	Y9385791	Rear RH	Inspect and Replace if Necessary	12459815
Chevrolet	2000	Lumina	Neutral	521	Y1311211	Y1340410	Frt Ctr and RH Passenger	Replace Only - No Inspection Required	88894557
Chevrolet	2000	Lumina	Pewter	921	Y1311211	Y1340410	Frt Ctr and RH Passenger	Replace Only - No Inspection Required	88894558
Chevrolet	2000	Lumina	Pewter	921	Y1311211	Y1340410	Rear (all)	Inspect and Replace if Necessary	88894560
Chevrolet	2000	Monte Carlo	Black	191	Y9334602	Y9341075	Rear (all)	Inspect and Replace if Necessary	88893354
Chevrolet	2000	Monte Carlo	Black	191	Y9341076	Y9385791	Driver	Replace Only - No Inspection Required	88893317
Chevrolet	2000	Monte Carlo	Black	191	Y9341076	Y9385791	Frt RH Passenger	Replace Only - No Inspection Required	88893321
Chevrolet	2000	Monte Carlo	Black	191	Y9341076	Y9385791	Rear (all)	Inspect and Replace if Necessary	88893354
Chevrolet	2000	Monte Carlo	Camel	871	Y9334602	Y9341075	Rear (all)	Inspect and Replace if Necessary	88893353
Chevrolet	2000	Monte Carlo	Camel	871	Y9341076	Y9385791	Driver	Replace Only - No Inspection Required	12459833
Chevrolet	2000	Monte Carlo	Camel	871	Y9341076	Y9385791	Frt Passenger	Replace Only - No Inspection Required	88893319
Chevrolet	2000	Monte Carlo	Camel	871	Y9341076	Y9385791	Rear (all)	Inspect and Replace if Necessary	88893353
Chevrolet	2000	Monte Carlo	Pewter	921	Y9334602	Y9341075	Rear (all)	Inspect and Replace if Necessary	88893325
Chevrolet	2000	Monte Carlo	Pewter	921	Y9341076	Y9385791	Frt RH Passenger	Replace Only - No Inspection Required	88893318
Chevrolet	2000	Monte Carlo	Pewter	921	Y9341076	Y9385791	Rear (all)	Inspect and Replace if Necessary	88893325

Division	Model Year	Model	Interior Color	Interior Color RPO	Beginning VIN(s)	Ending VIN(s)	Seating Position to Inspect/Replace	Repair Action Req'd.	Service Part No.
Chevrolet	2000	S-10 Pickup	Beige	84I	Y8269084	Y8297381	Driver (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474641
Chevrolet	2000	S-10 Pickup	Beige	84I	Y8269084	Y8297381	Frt RH Passenger (A52 Full Bench only)	Replace Only - No Inspection Required	12477769
Chevrolet	2000	S-10 Pickup	Beige	84I	YK262348	YK278988	Driver (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474641
Chevrolet	2000	S-10 Pickup	Beige	84I	YK262348	YK278988	Frt RH Passenger (A52 Full Bench only)	Replace Only - No Inspection Required	12477769
Chevrolet	2000	S-10 Pickup	Graphite	12I	Y8269084	Y8297381	Frt RH Passenger (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474640
Chevrolet	2000	S-10 Pickup	Graphite	12I	Y8269084	Y8297381	Frt RH Passenger (A52 Full Bench Only-Incl. Latch Plate for Center Position)	Replace Only - No Inspection Required	12477768
Chevrolet	2000	S-10 Pickup	Graphite	12I	Y8269084	Y8297381	Frt Ctr (AM6 Split Bench only)	Inspect and Replace if Necessary	12477774
Chevrolet	2000	S-10 Pickup	Graphite	12I	YK262348	YK278988	Frt RH Passenger (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474640
Chevrolet	2000	S-10 Pickup	Graphite	12I	YK262348	YK278988	Frt RH Passenger (A52 Full Bench Only-Incl. Latch Plate for Center Position)	Replace Only - No Inspection Required	12477768
Chevrolet	2000	S-10 Pickup	Graphite	12I	YK262348	YK278988	Frt Ctr (AM6 Split Bench only)	Inspect and Replace if Necessary	12477774
Chevrolet	2000	S-10 Pickup	Pewter	92I	Y8269084	Y8297381	Driver (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474643
Chevrolet	2000	S-10 Pickup	Pewter	92I	Y8269084	Y8297381	Frt RH Passenger (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474644
Chevrolet	2000	S-10 Pickup	Pewter	92I	Y8269084	Y8297381	Frt Ctr (AM6 Split Bench only)	Inspect and Replace if Necessary	12477776
Chevrolet	2000	S-10 Pickup	Pewter	92I	YK262348	YK278988	Driver (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474643
Chevrolet	2000	S-10 Pickup	Pewter	92I	YK262348	YK278988	Frt RH Passenger (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474644
Chevrolet	2000	S-10 Pickup	Pewter	92I	YK262348	YK278988	Frt Ctr (AM6 Split Bench only)	Inspect and Replace if Necessary	12477776

Division	Model Year	Model	Interior Color	Interior Color RPO	Beginning VIN(s)	Ending VIN(s)	Seating Position to Inspect/Replace	Repair Action Req'd.	Service Part No.
Chevrolet	2000	Utility	Beige	64I	Y2258880	Y2381029	Driver (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474841
Chevrolet	2000	Utility	Beige	64I	YK282348	YK278988	Driver (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474841
Chevrolet	2000	Utility	Graphite	12I	Y2258880	Y2381029	Frt RH Passenger Except KA1 Heated Seat (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474840
Chevrolet	2000	Utility	Graphite	12I	Y2258880	Y2381029	Frt Ctr (AM6 Split Bench only)	Inspect and Replace if Necessary	12477774
Chevrolet	2000	Utility	Graphite	12I	YK282348	YK278988	Frt RH Passenger Except KA1 Heated Seat (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474840
Chevrolet	2000	Utility	Graphite	12I	YK282348	YK278988	Frt Ctr (AM6 Split Bench only)	Inspect and Replace if Necessary	12477774
Chevrolet	2000	Utility	Pewter	92I	Y2258880	Y2381029	Driver (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474843
Chevrolet	2000	Utility	Pewter	92I	Y2258880	Y2381029	Frt RH Passenger Except KA1 Heated Seat (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474844
Chevrolet	2000	Utility	Pewter	92I	Y2258880	Y2381029	Frt RH Passenger With KA1 Heated Seat (Bucket Only)	Replace Only - No Inspection Required	12474843
Chevrolet	2000	Utility	Pewter	92I	Y2258880	Y2381029	Frt Ctr (AM6 Split Bench only)	Inspect and Replace if Necessary	12477776
Chevrolet	2000	Utility	Pewter	92I	YK282348	YK278988	Driver (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474843
Chevrolet	2000	Utility	Pewter	92I	YK282348	YK278988	Frt RH Passenger Except KA1 Heated Seat (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474844
Chevrolet	2000	Utility	Pewter	92I	YK282348	YK278988	Frt RH Passenger With KA1 Heated Seat (Bucket Only)	Replace Only - No Inspection Required	12474843
Chevrolet	2000	Utility	Pewter	92I	YK282348	YK278988	Frt Ctr (AM6 Split Bench only)	Inspect and Replace if Necessary	12477776
Chevrolet	2000	Venture	Grey	14I	YD311479	YD377368	Driver	Inspect and Replace if Necessary	12457479
Chevrolet	2000	Venture	Grey	14I	YD311479	YD377368	Frt RH Passenger	Inspect and Replace if Necessary	12457483
Chevrolet	2000	Venture	Grey	14I	YD311479	YD377368	2nd Row 60/40 Bench RH (AT5)	Inspect and Replace if Necessary	88895093
Chevrolet	2000	Venture	Grey	14I	YD311479	YD377368	2nd Row Capt. Chair LH and RH	Replace Only - No Inspection Required	12531150
Chevrolet	2000	Venture	Grey	14I	YD311479	YD377368	3rd Row AM9 Split Bench (all)	Inspect and Replace if Necessary	88894863
Chevrolet	2000	Venture	Grey	14I	YD311479	YD377368	3rd Row Capt. Chair LH and RH	Replace Only - No Inspection Required	12531150
Chevrolet	2000	Venture	Neutral	52I	YD311479	YD377368	2nd Row 60/40 Bench RH (AT5)	Inspect and Replace if Necessary	88895094
Chevrolet	2000	Venture	Neutral	52I	YD311479	YD377368	3rd Row AM9 Split Bench (all)	Inspect and Replace if Necessary	88894864

- Move the seat to the full forward position and remove the seat track covers.
- Remove the bolt and nut attaching the rear of the seat to the floor.
- Move the seat to the full rearward position and remove the covers from the nuts that attach the front of the seat to the floor.
- Remove the nuts that attach the front of the seat to the floor.
- Disconnect the electrical connector from under the seat.
- Remove the seat from the vehicle.
- Disconnect the seat belt buckle electrical connector.
 - Remove the seat belt buckle retaining nut and remove the buckle from the seat.

IMPORTANT: If the center seat belt buckle also requires replacement, do so at this time using the described steps. If the center buckle does not require replacement, proceed with the installation of the new driver seat belt buckle.

IMPORTANT: The brass bushing or grommet described in the next step is used as an assembly aid during the assembly of the vehicle. It is not necessary to replace the bushing if center buckle replacement is required.

- Using an appropriate tool, separate the center seat belt buckle mounting bracket from the driver's seat track by removing the brass bushing. Completely remove the bushing and discard it. No replacement bushing is required when reassembling.
- Install the new seat belt buckle in the seat and install the retaining nut. Tighten to 70 N.m (52 lb. ft.).
- Connect the seat belt buckle electrical connector.
- Install the seat in the vehicle.
- Connect the electrical connector under the seat.
- Install the nuts that attach the front of the seat to the floor. Tighten to 45 N.m (33 lb. ft.).
- Install the covers on the nuts that attach the front of the seat to the floor.
- Move the seat to the full forward position.
- If the center seat belt buckle is also being replaced, install the new center buckle on the seat track at this time.
- Install the nut that attaches the rear of the seat to the floor. Tighten to 45 N.m (33 lb. ft.).
- Install the bolt that attaches the rear of the seat to the floor. Tighten to 70 N.m (52 lb. ft.).
- Install the seat track covers.
- **Passenger Seat Belt Buckle:**
 - Move driver's seat to the full forward position.
 - Remove the passenger seat belt buckle retaining bolt.
 - Remove the passenger seat belt buckle from the seat.

- Install the new passenger seat belt buckle in the seat.
- Install the passenger seat belt buckle retaining bolt. Tighten to 70 N.m (52 lb. ft.).
- Move the driver's seat to the appropriate position.

2. Install the GM Campaign Identification Label.

CAMPAIGN IDENTIFICATION LABEL – For US and IPC

Place a Campaign Identification Label on each vehicle corrected in accordance with the instructions outlined in this Product Campaign Bulletin. Each label provides a space to include the campaign number and the five (5) digit dealer code of the dealer performing the campaign service. This information may be inserted with a typewriter or a ball point pen.

Put the Campaign Identification Label on a clean and dry surface of the radiator core support in an area that will be visible to people servicing the vehicle. When installing the Campaign Identification Label, be sure to pull the tab to allow adhesion of the clear protective covering. Additional Campaign Identification Labels for US dealers can be obtained from Dealer Support Materials by calling 1-888-549-6152 (Monday-Friday, 8:00 a.m. to 5:00 p.m. EST). Ask for Item Number 8-1015 when ordering.




Additional Campaign Identification Labels for IPC dealers can be obtained from your Regional Marketing Office

CAMPAIGN IDENTIFICATION LABEL – For CANADA

Place a Campaign Identification Label on each vehicle corrected in accordance with the instructions outlined in this Product Campaign Bulletin. Each label provides a space to include the campaign number and the five (5) digit dealer code of the dealer performing the campaign service. This information may be inserted with a typewriter or a ball point pen.

Put the Campaign Identification Label on a clean and dry surface of the radiator core support in an area that will be visible to people servicing the vehicle. Additional Campaign Identification Labels for Canadian dealers can be obtained from DGN by calling 1-800-888-5539 (Monday-Friday, 8:00 a.m. to 5:00 p.m. EST). Ask for Item Number GMP 91 when ordering.

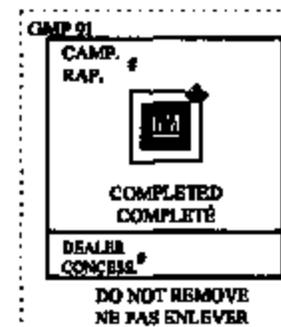

Division	Model Year	Model	Interior Color	Interior Color RPO	Beginning VIN(s)	Ending VIN(s)	Seating Position to Inspect/Replace	Repair Action Req'd.	Service Part No.
Chevrolet	2001	Impala	Camel	871	19100001	19100970	Driver	Replace Only - No Inspection Required	12459833
Chevrolet	2001	Impala	Camel	871	19100001	19100970	Frt RH Passenger	Replace Only - No Inspection Required	88893319
Chevrolet	2001	Impala	Camel	871	19100001	19100970	Rear LH and Ctr	Inspect and Replace if Necessary	12458818
Chevrolet	2001	Impala	Camel	871	19100001	19100970	Rear RH	Inspect and Replace if Necessary	88893356
Chevrolet	2001	Impala	Dark Blue	271	19100001	19100970	Frt RH Passenger	Replace Only - No Inspection Required	88893320
Chevrolet	2001	Impala	Neutral	521	19100001	19100970	Rear LH and Ctr	Inspect and Replace if Necessary	88896427
Chevrolet	2001	Impala	Pewter	921	19100001	19100970	Frt RH Passenger	Replace Only - No Inspection Required	88893318
Chevrolet	2001	Impala	Pewter	921	19100001	19100970	Frt Ctr	Inspect and Replace if Necessary	12458899
Chevrolet	2001	Impala	Pewter	921	19100001	19100970	Rear LH and Ctr	Inspect and Replace if Necessary	88893356
Chevrolet	2001	Impala	Pewter	921	19100001	19100970	Rear RH	Inspect and Replace if Necessary	12458815
Chevrolet	2001	Monte Carlo	Black	191	19100001	19100970	Driver	Replace Only - No Inspection Required	88893317
Chevrolet	2001	Monte Carlo	Black	191	19100001	19100970	Frt RH Passenger	Replace Only - No Inspection Required	88893321
Chevrolet	2001	Monte Carlo	Black	191	19100001	19100970	Rear (all)	Inspect and Replace if Necessary	88893354
Chevrolet	2001	Monte Carlo	Camel	871	19100001	19100970	Driver	Replace Only - No Inspection Required	12459833
Chevrolet	2001	Monte Carlo	Camel	871	19100001	19100970	Frt RH Passenger	Replace Only - No Inspection Required	88893319
Chevrolet	2001	Monte Carlo	Camel	871	19100001	19100970	Rear (all)	Inspect and Replace if Necessary	12459816
Chevrolet	2001	Monte Carlo	Neutral	521	19100001	19100970	Rear (all)	Inspect and Replace if Necessary	88896426
Chevrolet	2001	Monte Carlo	Pewter	921	19100001	19100970	Frt RH Passenger	Replace Only - No Inspection Required	88893318
Chevrolet	2001	Monte Carlo	Pewter	921	19100001	19100970	Rear (all)	Inspect and Replace if Necessary	88893325

Division	Model Year	Model	Interior Color	Interior Color RPO	Beginning VIN(s)	Ending VIN(s)	Seating Position to Inspect/Replace	Repair Action Req'd.	Service Part No.
Chevrolet	2001	S-10 Pickup	Beige	64I	18100015	18100018	Driver (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474841
Chevrolet	2001	S-10 Pickup	Beige	64I	18100015	18100018	Frt RH Passenger (A52 Full Bench only)	Replace Only - No Inspection Required	12477768
Chevrolet	2001	S-10 Pickup	Beige	64I	1K100018	1K100036	Driver (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474841
Chevrolet	2001	S-10 Pickup	Beige	64I	1K100018	1K100036	Frt RH Passenger (A52 Full Bench only)	Replace Only - No Inspection Required	12477768
Chevrolet	2001	S-10 Pickup	Graphite	12I	18100015	18100018	Frt RH Passenger (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474840
Chevrolet	2001	S-10 Pickup	Graphite	12I	18100015	18100018	Frt RH Passenger (A52 Full Bench Only-Incl. Latch Plate for Center Position)	Replace Only - No Inspection Required	12477768
Chevrolet	2001	S-10 Pickup	Graphite	12I	18100015	18100018	Frt Ctr (AM6 Split Bench only)	Inspect and Replace if Necessary	12477774
Chevrolet	2001	S-10 Pickup	Graphite	12I	1K100018	1K100036	Frt RH Passenger (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474840
Chevrolet	2001	S-10 Pickup	Graphite	12I	1K100018	1K100036	Frt RH Passenger (A52 Full Bench Only-Incl. Latch Plate for Center Position)	Replace Only - No Inspection Required	12477768
Chevrolet	2001	S-10 Pickup	Graphite	12I	1K100018	1K100036	Frt Ctr (AM6 Split Bench only)	Inspect and Replace if Necessary	12477774
Chevrolet	2001	S-10 Pickup	Pewter	92I	18100015	18100018	Driver (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474843
Chevrolet	2001	S-10 Pickup	Pewter	92I	18100015	18100018	Frt RH Passenger (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474844
Chevrolet	2001	S-10 Pickup	Pewter	92I	18100015	18100018	Frt Ctr (AM6 Split Bench only)	Inspect and Replace if Necessary	12477776
Chevrolet	2001	S-10 Pickup	Pewter	92I	1K100018	1K100036	Driver (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474843
Chevrolet	2001	S-10 Pickup	Pewter	92I	1K100018	1K100036	Frt RH Passenger (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474844
Chevrolet	2001	S-10 Pickup	Pewter	92I	1K100018	1K100036	Frt Ctr (AM6 Split Bench only)	Inspect and Replace if Necessary	12477776

Division	Model Year	Model	Interior Color	Interior Color RPO	Beginning VIN(s)	Ending VIN(s)	Seating Position to Inspect/Replace	Repair Action Req'd.	Service Part No.
Chevrolet	2001	Utility	Beige	64I	12100021	12100021	Driver (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474641
Chevrolet	2001	Utility	Beige	64I	1K100018	1K100036	Driver (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474641
Chevrolet	2001	Utility	Graphite	12I	12100021	12100021	Frt RH Passenger Except KA1 Heated Seat (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474640
Chevrolet	2001	Utility	Graphite	12I	12100021	12100021	Frt Ctr (AM6 Split Bench only)	Inspect and Replace if Necessary	12477774
Chevrolet	2001	Utility	Graphite	12I	1K100018	1K100036	Frt RH Passenger Except KA1 Heated Seat (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474640
Chevrolet	2001	Utility	Graphite	12I	1K100018	1K100036	Frt Ctr (AM6 Split Bench only)	Inspect and Replace if Necessary	12477774
Chevrolet	2001	Utility	Pewter	92I	12100021	12100021	Driver (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474643
Chevrolet	2001	Utility	Pewter	92I	12100021	12100021	Frt RH Passenger Except KA1 Heated Seat (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474644
Chevrolet	2001	Utility	Pewter	92I	12100021	12100021	Frt RH Passenger With KA1 Heated Seat (Bucket Only)	Replace Only - No Inspection Required	12474643
Chevrolet	2001	Utility	Pewter	92I	12100021	12100021	Frt Ctr (AM6 Split Bench only)	Inspect and Replace if Necessary	12477776
Chevrolet	2001	Utility	Pewter	92I	1K100018	1K100036	Driver (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474643
Chevrolet	2001	Utility	Pewter	92I	1K100018	1K100036	Frt RH Passenger Except KA1 Heated Seat (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474644
Chevrolet	2001	Utility	Pewter	92I	1K100018	1K100036	Frt RH Passenger With KA1 Heated Seat (Bucket Only)	Replace Only - No Inspection Required	12474643
Chevrolet	2001	Utility	Pewter	92I	1K100018	1K100036	Frt Ctr (AM6 Split Bench only)	Inspect and Replace if Necessary	12477776
Chevrolet	2001	Venture	Grey	14I	1D100001	1D100040	Driver	Inspect and Replace if Necessary	12467479
Chevrolet	2001	Venture	Grey	14I	1D100001	1D100040	Frt RH Passenger	Inspect and Replace if Necessary	12467483
Chevrolet	2001	Venture	Grey	14I	1D100001	1D100040	2nd Row 60/40 Bench RH (AT5)	Inspect and Replace if Necessary	88895093
Chevrolet	2001	Venture	Grey	14I	1D100001	1D100040	2nd Row Capt. Chair LH and RH	Replace Only - No Inspection Required	12531150
Chevrolet	2001	Venture	Grey	14I	1D100001	1D100040	3rd Row AM9 Split Bench (all)	Inspect and Replace if Necessary	88894663
Chevrolet	2001	Venture	Grey	14I	1D100001	1D100040	3rd Row Capt. Chair LH or RH	Replace Only - No Inspection Required	12531150
Chevrolet	2001	Venture	Neutral	62I	1D100001	1D100040	2nd Row 60/40 Bench RH (AT5)	Inspect and Replace if Necessary	88895094
Chevrolet	2001	Venture	Neutral	52I	1D100001	1D100040	3rd Row AM9 Split Bench (all)	Inspect and Replace if Necessary	88894664

Division	Model Year	Model	Interior Color	Interior Color RPO	Beginning VIN(s)	Ending VIN(s)	Seating Position to Inspect/Replace	Repair Action Req'd.	Service Part No.
GMC	2000	Sonoma	Beige	64I	Y8252997	Y8297377	Driver (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474641
GMC	2000	Sonoma	Beige	64I	Y8252997	Y8297377	Frt RH Passenger (Bench only)	Replace Only - No Inspection Required	12477769
GMC	2000	Sonoma	Beige	64I	YK262351	YK276985	Driver (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474641
GMC	2000	Sonoma	Beige	64I	YK262351	YK276985	Frt RH Passenger (Bench only)	Replace Only - No Inspection Required	12477769
GMC	2000	Sonoma	Graphite	12I	Y8252997	Y8297377	Frt RH Passenger (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474640
GMC	2000	Sonoma	Graphite	12I	Y8252997	Y8297377	Frt RH Passenger (A52 Full Bench Only-Incl. Latch Plate for Center Position)	Replace Only - No Inspection Required	12477768
GMC	2000	Sonoma	Graphite	12I	Y8252997	Y8297377	Frt Ctr (AM6 Split Bench only)	Inspect and Replace if Necessary	12477774
GMC	2000	Sonoma	Graphite	12I	YK262351	YK276985	Frt RH Passenger (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474640
GMC	2000	Sonoma	Graphite	12I	YK262351	YK276985	Frt RH Passenger (A52 Full Bench Only-Incl. Latch Plate for Center Position)	Replace Only - No Inspection Required	12477768
GMC	2000	Sonoma	Graphite	12I	YK262351	YK276985	Frt Ctr (AM6 Split Bench only)	Inspect and Replace if Necessary	12477774
GMC	2000	Sonoma	Pewter	82I	Y8252997	Y8297377	Driver (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474643
GMC	2000	Sonoma	Pewter	82I	Y8252997	Y8297377	Frt RH Passenger (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474644
GMC	2000	Sonoma	Pewter	82I	Y8252997	Y8297377	Frt Ctr (AM6 Split Bench only)	Inspect and Replace if Necessary	12477776
GMC	2000	Sonoma	Pewter	82I	YK262351	YK276985	Driver (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474643
GMC	2000	Sonoma	Pewter	82I	YK262351	YK276985	Frt RH Passenger (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474644
GMC	2000	Sonoma	Pewter	82I	YK262351	YK276985	Frt Ctr (AM6 Split Bench only)	Inspect and Replace if Necessary	12477776
GMC	2000	Utility	Beige	64I	Y2358187	Y2361000	Driver (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474641
GMC	2000	Utility	Beige	64I	YK262351	YK276985	Driver (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474641
GMC	2000	Utility	Graphite	12I	Y2358187	Y2361000	Frt RH Passenger Except KA1 Heated Seat (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474640
GMC	2000	Utility	Graphite	12I	Y2358187	Y2361000	Frt Ctr (AM6 Split Bench only)	Inspect and Replace if Necessary	12477774
GMC	2000	Utility	Graphite	12I	YK262351	YK276985	Frt RH Passenger Except KA1 Heated Seat (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474640
GMC	2000	Utility	Graphite	12I	YK262351	YK276985	Frt Ctr (AM6 Split Bench only)	Inspect and Replace if Necessary	12477774

Division	Model Year	Model	Interior Color	Interior Color RPO	Beginning VIN(s)	Ending VIN(s)	Seating Position to Inspect/Replace	Repair Action Req'd.	Service Part No.
GMC	2000	Utility	Pewter	92I	Y2358187	Y2381000	Driver (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474843
GMC	2000	Utility	Pewter	92I	Y2358187	Y2381000	Frt RH Passenger Except KA1 Heated Seat (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474844
GMC	2000	Utility	Pewter	92I	Y2358187	Y2381000	Frt RH Passenger With KA1 Heated Seat (Bucket Only)	Replace Only - No Inspection Required	12474643
GMC	2000	Utility	Pewter	92I	Y2358187	Y2381000	Frt Ctr (AM6 Split Bench only)	Inspect and Replace if Necessary	12477776
GMC	2000	Utility	Pewter	92I	YK262351	YK276885	Driver (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474843
GMC	2000	Utility	Pewter	92I	YK262351	YK276885	Frt RH Passenger Except KA1 Heated Seat (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474844
GMC	2000	Utility	Pewter	92I	Y2358187	Y2381000	Frt RH Passenger With KA1 Heated Seat (Bucket Only)	Replace Only - No Inspection Required	12474843
GMC	2000	Utility	Pewter	92I	YK262351	YK276885	Frt Ctr (AM6 Split Bench only)	Inspect and Replace if Necessary	12477776
GMC	2001	Sonoma	Beige	84I	18100015	18100018	Driver (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474841
GMC	2001	Sonoma	Beige	84I	18100015	18100018	Frt RH Passenger (A52 Full Bench only)	Replace Only - No Inspection Required	12477769
GMC	2001	Sonoma	Beige	84I	1K100018	1K100036	Driver (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474841
GMC	2001	Sonoma	Beige	84I	1K100018	1K100036	Frt RH Passenger (A52 Full Bench only)	Replace Only - No Inspection Required	12477769
GMC	2001	Sonoma	Pewter	92I	18100015	18100018	Driver (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474643
GMC	2001	Sonoma	Pewter	92I	18100015	18100018	Frt RH Passenger (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474844
GMC	2001	Sonoma	Pewter	92I	18100015	18100018	Frt Ctr (AM6 Split Bench only)	Inspect and Replace if Necessary	12477776
GMC	2001	Sonoma	Pewter	92I	1K100018	1K100036	Driver (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474843
GMC	2001	Sonoma	Pewter	92I	1K100018	1K100036	Frt RH Passenger (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474844
GMC	2001	Sonoma	Pewter	92I	1K100018	1K100036	Frt Ctr (AM6 Split Bench only)	Inspect and Replace if Necessary	12477776

Division	Model Year	Model	Interior Color	Interior Color RPO	Beginning VIN(s)	Ending VIN(s)	Seating Position to Inspect/Replace	Repair Action Req'd.	Service Part No.
GMC	2001	Utility	Beige	641	12100021	12100021	Driver (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474841
GMC	2001	Utility	Beige	641	1K100018	1K100036	Driver (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474841
GMC	2001	Utility	Graphite	121	12100021	12100021	Frt RH Passenger Except KA1 Heated Seat (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474840
GMC	2001	Utility	Graphite	121	12100021	12100021	Frt Ctr (AM6 Split Bench only)	Inspect and Replace if Necessary	12477774
GMC	2001	Utility	Graphite	121	1K100018	1K100036	Frt RH Passenger Except KA1 Heated Seat (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474840
GMC	2001	Utility	Graphite	121	1K100018	1K100036	Frt Ctr (AM6 Split Bench only)	Inspect and Replace if Necessary	12477774
GMC	2001	Utility	Pewter	921	12100021	12100021	Driver (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474843
GMC	2001	Utility	Pewter	921	12100021	12100021	Frt RH Passenger Except KA1 Heated Seat (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474844
GMC	2001	Utility	Pewter	921	12100021	12100021	Frt RH Passenger With KA1 Heated Seat (Bucket Only)	Replace Only - No Inspection Required	12474843
GMC	2001	Utility	Pewter	921	12100021	12100021	Frt Ctr (AM6 Split Bench only)	Inspect and Replace if Necessary	12477776
GMC	2001	Utility	Pewter	921	1K100018	1K100036	Driver (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474843
GMC	2001	Utility	Pewter	921	1K100018	1K100036	Frt RH Passenger Except KA1 Heated Seat (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474844
GMC	2001	Utility	Pewter	921	12100021	12100021	Frt RH Passenger With KA1 Heated Seat (Bucket Only)	Replace Only - No Inspection Required	12474843
GMC	2001	Utility	Pewter	921	1K100018	1K100036	Frt Ctr (AM6 Split Bench only)	Inspect and Replace if Necessary	12477776

Division	Model Year	Model	Interior Color	Interior Color RPO	Beginning VIN(s)	Ending VIN(s)	Seating Position to Inspect/Replace	Repair Action Req'd.	Service Part No.
Oldsmobile	2000	Intrigue	Beige	64I	YF295806	YF302197	Rear (all)	Inspect and Replace if Necessary	12369754
Oldsmobile	2000	Intrigue	Beige	64I	YF302209	YF318652	Driver	Replace Only - No Inspection Required	88895089
Oldsmobile	2000	Intrigue	Beige	64I	YF302209	YF318652	Frt RH Passenger	Replace Only - No Inspection Required	88895102
Oldsmobile	2000	Intrigue	Beige	64I	YF302209	YF318652	Rear (all)	Inspect and Replace if Necessary	12369754
Oldsmobile	2000	Intrigue	Grey	14I	YF295806	YF302197	Rear (all)	Inspect and Replace if Necessary	88894585
Oldsmobile	2000	Intrigue	Grey	14I	YF302209	YF318652	Frt RH Passenger	Replace Only - No Inspection Required	88894432
Oldsmobile	2000	Intrigue	Grey	14I	YF302209	YF318652	Rear (all)	Inspect and Replace if Necessary	88894585
Oldsmobile	2000	Intrigue	Neutral	52I	YF295806	YF302197	Rear (all)	Inspect and Replace if Necessary	88894586
Oldsmobile	2000	Intrigue	Neutral	52I	YF302209	YF318652	Frt RH Passenger	Replace Only - No Inspection Required	88894434
Oldsmobile	2000	Intrigue	Neutral	52I	YF302209	YF318652	Rear (all)	Inspect and Replace if Necessary	88894586
Oldsmobile	2000	Silhouette	Beige	64I	YD315175	YD337287	Frt RH Passenger	Inspect and Replace if Necessary	12457486
Oldsmobile	2000	Silhouette	Beige	64I	YD315175	YD337287	2nd Row 60/40 Bench RH (AT5)	Inspect and Replace if Necessary	88895085
Oldsmobile	2000	Silhouette	Beige	64I	YD315175	YD337287	2nd Row Capt. Chair LH and RH	Replace Only - No Inspection Required	88894671
Oldsmobile	2000	Silhouette	Beige	64I	YD315175	YD337287	3rd Row AM9 Split Bench (all)	Inspect and Replace if Necessary	12458620
Oldsmobile	2000	Silhouette	Beige	64I	YD315175	YD337287	3rd Row Capt. Chair LH and RH	Replace Only - No Inspection Required	88894671
Oldsmobile	2000	Silhouette	Grey	14I	YD315175	YD337287	Driver	Inspect and Replace if Necessary	12457479
Oldsmobile	2000	Silhouette	Grey	14I	YD315175	YD337287	Frt RH Passenger	Inspect and Replace if Necessary	12457483
Oldsmobile	2000	Silhouette	Grey	14I	YD315175	YD337287	2nd Row 60/40 Bench RH (AT5)	Inspect and Replace if Necessary	88895083
Oldsmobile	2000	Silhouette	Grey	14I	YD315175	YD337287	2nd Row Capt. Chair LH and RH	Replace Only - No Inspection Required	12531150
Oldsmobile	2000	Silhouette	Grey	14I	YD315175	YD337287	3rd Row AM9 Split Bench (all)	Inspect and Replace if Necessary	88894663
Oldsmobile	2000	Silhouette	Grey	14I	YD315175	YD337287	3rd Row Capt. Chair LH and RH	Replace Only - No Inspection Required	12531150
Oldsmobile	2000	Silhouette	Neutral	52I	YD315175	YD337287	2nd Row 60/40 Bench RH (AT5)	Inspect and Replace if Necessary	88895084
Oldsmobile	2000	Silhouette	Neutral	52I	YD315175	YD337287	3rd Row AM9 Split Bench (all)	Inspect and Replace if Necessary	88894664
Oldsmobile	2000	Utility	Beige	64I	Y2357182	Y2381008	Driver (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474641
Oldsmobile	2000	Utility	Graphite	12I	Y2357182	Y2381008	Frt RH Passenger Except KA1 Heated Seat (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474640
Oldsmobile	2000	Utility	Graphite	12I	Y2357182	Y2381008	Frt Ctr (AM6 Split Bench only)	Inspect and Replace if Necessary	12477774

Division	Model Year	Model	Interior Color	Interior Color RPO	Beginning VIN(s)	Ending VIN(s)	Seating Position to Inspect/Replace	Repair Action Req'd.	Service Part No.
Oldsmobile	2000	Utility	Pewter	92i	Y2357182	Y2381008	Driver (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474643
Oldsmobile	2000	Utility	Pewter	92i	Y2357182	Y2381008	Frt RH Passenger Except KA1 Heated Seat (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474644
Oldsmobile	2000	Utility	Pewter	92i	Y2357182	Y2381008	Frt RH Passenger With KA1 Heated Seat (Bucket Only)	Replace Only - No Inspection Required	12474643
Oldsmobile	2000	Utility	Pewter	92i	Y2357182	Y2381008	Frt Ctr (AM6 Split Bench only)	Inspect and Replace if Necessary	12477776
Oldsmobile	2001	Intrigue	Beige	64i	1F100031	1F100046	Driver	Replace Only - No Inspection Required	88895099
Oldsmobile	2001	Intrigue	Beige	64i	1F100031	1F100046	Frt RH Passenger	Replace Only - No Inspection Required	88895102
Oldsmobile	2001	Intrigue	Beige	64i	1F100031	1F100046	Rear (all)	Inspect and Replace if Necessary	12369754
Oldsmobile	2001	Intrigue	Grey	14i	1F100031	1F100046	Frt RH Passenger	Replace Only - No Inspection Required	88896432
Oldsmobile	2001	Intrigue	Grey	14i	1F100031	1F100046	Rear (all)	Inspect and Replace if Necessary	88894585
Oldsmobile	2001	Intrigue	Neutral	52i	1F100031	1F100046	Frt RH Passenger	Replace Only - No Inspection Required	88896434
Oldsmobile	2001	Intrigue	Neutral	52i	1F100031	1F100046	Rear (all)	Inspect and Replace if Necessary	88894588
Oldsmobile	2001	Silhouette	Beige	64i	1D100003	1D100064	Frt RH Passenger	Inspect and Replace if Necessary	12457488
Oldsmobile	2001	Silhouette	Beige	64i	1D100003	1D100064	2nd Row 60/40 Bench RH (AT5)	Inspect and Replace if Necessary	88895096
Oldsmobile	2001	Silhouette	Beige	64i	1D100003	1D100064	2nd Row Capt. Chair LH and RH	Replace Only - No Inspection Required	88894671
Oldsmobile	2001	Silhouette	Beige	64i	1D100003	1D100064	3rd Row AM6 Split Bench (all)	Inspect and Replace if Necessary	12459820
Oldsmobile	2001	Silhouette	Beige	64i	1D100003	1D100064	3rd Row Capt. Chair LH and RH	Replace Only - No Inspection Required	88894671
Oldsmobile	2001	Silhouette	Grey	14i	1D100003	1D100064	Driver	Inspect and Replace if Necessary	12457479
Oldsmobile	2001	Silhouette	Grey	14i	1D100003	1D100064	Frt RH Passenger	Inspect and Replace if Necessary	12457483
Oldsmobile	2001	Silhouette	Grey	14i	1D100003	1D100064	2nd Row 60/40 Bench RH (AT5)	Inspect and Replace if Necessary	88895093
Oldsmobile	2001	Silhouette	Grey	14i	1D100003	1D100064	2nd Row Capt. Chair LH and RH	Replace Only - No Inspection Required	12531150
Oldsmobile	2001	Silhouette	Grey	14i	1D100003	1D100064	3rd Row AM9 Split Bench (all)	Inspect and Replace if Necessary	88894663
Oldsmobile	2001	Silhouette	Grey	14i	1D100003	1D100064	3rd Row Capt. Chair LH and RH	Replace Only - No Inspection Required	12531150
Oldsmobile	2001	Silhouette	Neutral	52i	1D100003	1D100064	2nd Row 60/40 Bench RH (AT5)	Replace Only - No Inspection Required	88896434
Oldsmobile	2001	Silhouette	Neutral	52i	1D100003	1D100064	3rd Row AM9 Split Bench (all)	Inspect and Replace if Necessary	88894586

Division	Model Year	Model	Interior Color	Interior Color RPO	Beginning VIN(s)	Ending VIN(s)	Seating Position to Inspect/Replace	Repair Action Req'd.	Service Part No.
Oldsmobile	2001	Utility	Beige	64I	12100020	12100024	Driver (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474641
Oldsmobile	2001	Utility	Graphite	12I	12100020	12100024	Frt RH Passenger Except KA1 Heated Seat (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474640
Oldsmobile	2001	Utility	Graphite	12I	12100020	12100024	Frt Ctr (AM6 Split Bench only)	Inspect and Replace if Necessary	12477774
Oldsmobile	2001	Utility	Pewter	82I	12100020	12100024	Driver (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474643
Oldsmobile	2001	Utility	Pewter	92I	12100020	12100024	Frt RH Passenger Except KA1 Heated Seat (Bkt or AM6 Split Bench)	Replace Only - No Inspection Required	12474644
Oldsmobile	2001	Utility	Pewter	92I	12100020	12100024	Frt RH Passenger With KA1 Heated Seat (Bucket Only)	Replace Only - No Inspection Required	12474643
Oldsmobile	2001	Utility	Pewter	92I	12100020	12100024	Frt Ctr (AM6 Split Bench only)	Inspect and Replace if Necessary	12477776
Pontiac	2000	Gr. Prix	Grph/Char	12I/17I	YF301133	YF302181	Rear (all)	Inspect and Replace if Necessary	88894563
Pontiac	2000	Gr. Prix	Grph/Char	12I/17I	YF302183	YF318854	Driver	Replace Only - No Inspection Required	88896429
Pontiac	2000	Gr. Prix	Grph/Char	12I/17I	YF302183	YF318854	Frt RH Passenger	Replace Only - No Inspection Required	88896430
Pontiac	2000	Gr. Prix	Grph/Char	12I/17I	YF302183	YF318854	Rear (all)	Inspect and Replace if Necessary	88894563
Pontiac	2000	Gr. Prix	Neutral	52I	YF301133	YF302181	Rear (all)	Inspect and Replace if Necessary	12369754
Pontiac	2000	Gr. Prix	Neutral	62I	YF302183	YF318854	Driver	Replace Only - No Inspection Required	88895089
Pontiac	2000	Gr. Prix	Neutral	62I	YF302183	YF318854	Frt RH Passenger	Replace Only - No Inspection Required	88895102
Pontiac	2000	Gr. Prix	Neutral	52I	YF302183	YF318854	Rear (all)	Inspect and Replace if Necessary	12369754
Pontiac	2000	Montana	Beige	64I	YD309642	YD339645	Frt RH Passenger	Inspect and Replace if Necessary	12457486
Pontiac	2000	Montana	Beige	64I	YD309642	YD339645	2nd Row 60/40 Bench RH (AT5)	Inspect and Replace if Necessary	88895095
Pontiac	2000	Montana	Beige	64I	YD309642	YD339645	2nd Row Capt. Chair LH and RH	Replace Only - No Inspection Required	88894671
Pontiac	2000	Montana	Beige	64I	YD309642	YD339645	3rd Row Capt. Chair LH and RH	Replace Only - No Inspection Required	88894671

Division	Model Year	Model	Interior Color	Interior Color RPO	Beginning VIN(s)	Ending VIN(s)	Seating Position to Inspect/Replace	Repair Action Req'd.	Service Part No.
Pontiac	2000	Montana	Grey	14I	YD309842	YD339845	Driver	Inspect and Replace if Necessary	12457479
Pontiac	2000	Montana	Grey	14I	YD309842	YD339845	Frt RH Passenger	Inspect and Replace if Necessary	12457483
Pontiac	2000	Montana	Grey	14I	YD309842	YD339845	2nd Row 60/40 Bench RH (AT5)	Inspect and Replace if Necessary	88895093
Pontiac	2000	Montana	Grey	14I	YD309842	YD339845	2nd Row Capt. Chair LH and RH	Replace Only - No Inspection Required	12531150
Pontiac	2000	Montana	Grey	14I	YD309842	YD339848	3rd Row AM9 Split Bench (all)	Inspect and Replace if Necessary	88894863
Pontiac	2000	Montana	Grey	14I	YD309842	YD339845	3rd Row Capt. Chair LH and RH	Replace Only - No Inspection Required	12531150
Pontiac	2000	Montana	Neutral	52I	YD309842	YD339845	2nd Row 60/40 Bench RH (AT5)	Inspect and Replace if Necessary	88895094
Pontiac	2000	Montana	Neutral	52I	YD309842	YD339845	3rd Row AM9 Split Bench (all)	Inspect and Replace if Necessary	88894864
Pontiac	2001	Gr. Prix	Grph/Char	12W17I	1F100033	1F100046	Driver	Replace Only - No Inspection Required	88896429
Pontiac	2001	Gr. Prix	Grph/Char	12W17I	1F100033	1F100046	Frt RH Passenger	Replace Only - No Inspection Required	88896430
Pontiac	2001	Gr. Prix	Grph/Char	12W17I	1F100033	1F100046	Rear (all)	Inspect and Replace if Necessary	88894863
Pontiac	2001	Gr. Prix	Neutral	52I	1F100033	1F100046	Driver	Replace Only - No Inspection Required	88895099
Pontiac	2001	Gr. Prix	Neutral	52I	1F100033	1F100046	Frt RH Passenger	Replace Only - No Inspection Required	88895102
Pontiac	2001	Gr. Prix	Neutral	52I	1F100033	1F100046	Rear (all)	Inspect and Replace if Necessary	12389754
Pontiac	2001	Montana	Beige	84I	1D100004	1D100081	Frt RH Passenger	Inspect and Replace if Necessary	12457486
Pontiac	2001	Montana	Beige	84I	1D100004	1D100081	2nd Row 60/40 Bench RH (AT5)	Inspect and Replace if Necessary	88895095
Pontiac	2001	Montana	Beige	84I	1D100004	1D100081	2nd Row Capt. Chair LH and RH	Replace Only - No Inspection Required	88894871
Pontiac	2001	Montana	Beige	84I	1D100004	1D100081	3rd Row Capt. Chair LH and RH	Replace Only - No Inspection Required	88894871
Pontiac	2001	Montana	Grey	14I	1D100004	1D100081	Driver	Inspect and Replace if Necessary	12457479
Pontiac	2001	Montana	Grey	14I	1D100004	1D100081	Frt RH Passenger	Inspect and Replace if Necessary	12457483
Pontiac	2001	Montana	Grey	14I	1D100004	1D100081	2nd Row 60/40 Bench RH (AT5)	Inspect and Replace if Necessary	88895093
Pontiac	2001	Montana	Grey	14I	1D100004	1D100081	2nd Row Capt. Chair LH and RH	Replace Only - No Inspection Required	12531150
Pontiac	2001	Montana	Grey	14I	1D100004	1D100081	3rd Row AM9 Split Bench (all)	Inspect and Replace if Necessary	88894863
Pontiac	2001	Montana	Grey	14I	1D100004	1D100081	3rd Row Capt. Chair LH and RH	Replace Only - No Inspection Required	12531150
Pontiac	2001	Montana	Neutral	52I	1D100004	1D100081	2nd Row 60/40 Bench RH (AT5)	Inspect and Replace if Necessary	88895094
Pontiac	2001	Montana	Neutral	52I	1D100004	1D100081	3rd Row AM9 Split Bench (all)	Inspect and Replace if Necessary	88894864

Service Procedures For Inspection/Replacement of Seat Belt Buckle Assemblies All Seating Positions

Models: Intrigue / Grand Prix / Regal / Century / Monte Carlo / Impala

Location and Seat Type: Front Bucket

Buckle Location: Driver and Passenger

Service Procedure:

- Replace only (no inspection required)
1. Move the seat to the full forward position.
 2. Remove the seat belt buckle nut.
 3. Remove the seat belt buckle.
 4. Disconnect the electrical connector (driver's seat only).
 5. Connect the new seat belt buckle electrical connector (driver's seat only).
 6. Install the seat belt buckle to the seat.
 7. Install the seat belt buckle nut and tighten to 42 N.m (31 lb. ft.).

Models: Century / Impala

Location and Seat Type: Front 60/40 Split Bench

Buckle Location: Driver Center and Passenger

Service Procedure:

- Replace driver and passenger (no inspection required)
- Inspect center and replace if required

The following procedure applies to the driver, center and passenger seat belt buckles except where indicated.

1. Inspect the date codes on the center front seat belt buckle to determine if replacement is required. See Date Code Information.
2. Remove the left hand fuse panel cover and remove SIR fuse.
3. Move the seat to the full rearward position and disconnect the air bag connector under the seat.
4. Remove the seat track front covers.
5. Move the seat forward and remove the bolts attaching the seat to the floor.
6. Remove the seat belt cover from the seat and remove seat belt retaining nut.
7. Disconnect the seat electrical connector.
8. Remove the head rest.
9. Remove the seat from the vehicle.
10. Disconnect the seat belt buckle electrical connector.
11. Remove the seat belt buckle retaining nut.

12. Remove the seat belt buckle from the seat.
IMPORTANT: The center seat belt replacement kits include both the buckle and latch plate. It is NOT necessary to replace the latch plate if center buckle replacement is required.
13. If center buckle replacement is required, using a drill, remove the rivet that attaches the center buckle to the seat track.
14. If center buckle replacement is required, attach the center buckle to the seat track with a new rivet.
15. Install the seat belt buckle to the seat and install the retaining nut. Tighten to 42 N.m (31 lb. ft.).
16. Connect the seat belt buckle electrical connector.
17. Install the seat in the vehicle.
18. Install the head rest.
19. Connect the seat electrical connector.
20. Install the seat belt, retaining nut and cover to the seat. Tighten to 42 N.m (31 lb. ft.).
21. Install the bolts attaching the seat to the floor. Tighten to 24 N.m (18 lb. ft.).
22. Install the seat track front covers.
23. Move seat to the full rearward position and connect the air bag connector under the seat (driver's seat only).
24. Install the SIR fuse and left hand fuse panel cover.
25. Install the GM Campaign Identification Label.

Models: Lumina
Location and Seat Type: Front 60/40 Split Bench
Buckle Location: Driver, Center and Passenger

IMPORTANT: When replacing the driver and passenger buckles, the center buckle will also get replaced because it is attached to the passenger buckle. Therefore, no inspection of the center buckle is required.

Service Procedure:

- Replace only (no inspection required).
1. Move the seat to the full forward position.
 2. Remove the plastic covers from the base of the seat belt buckles.
 3. Remove the bolts attaching the seat belt buckles to the floor.
 4. Disconnect the electrical connector (driver's seat belt buckle only).
 5. Remove the seat belt buckles.
 6. Install the new seat belt buckles.
 7. Connect the electrical connector (driver's seat belt buckle only).

8. Install the bolts attaching the seat belt buckles to the floor and tighten to 42 N.m (31 lb. ft.).
9. Install the plastic covers on the base of the seat belt covers.
10. Install the GM Campaign Identification Label.

Models: Intrigue / Grand Prix / Regal/Century / Monte Carlo/Impala/ Lumina
Location and Seat Type: Rear Bench
Buckle Location: Left, Center, Right

Service Procedure

- Inspect and replace if required
1. Inspect the date codes on the left, center and right rear seat belt buckles to determine if replacement is required. See Date Code Information. If one or more buckles require replacement, proceed to step 2. If no replacement is required, proceed to Step 8.
 2. Remove the rear seat cushion.
 3. Remove the seat belt buckles(s) attaching nut(s).
IMPORTANT: Some rear seat belt buckle kits include all three buckles (right, center, left) as well as the center latch plate. In some kits two buckles or one buckle and the center latch plate may be pre-assembled. Install these pre-assembled parts as is and do NOT attempt to separate. Also, do NOT install the other buckle assembly included in the kit unless the inspection done in step 1 indicates that replacement is required.
 4. Remove the necessary seat belt buckle(s).
 5. Install the new seat belt buckle assembly(s).
 6. Install the seat belt buckle attaching nut(s) and tighten to 42 N.m (31 lb. ft.).
 7. Install the rear seat cushion.
 8. Install the GM Campaign Identification Label.

Models: Montana / Venture / Silhouette
Location and Seat Type: Front Captain's Chairs
Buckle Location: Driver or Passenger

Service Procedure:

- Inspect and replace if required
1. Inspect the date codes on both the driver and passenger seat belt buckles to determine if replacement is required. See Date Code Information. If one or both buckles require replacement, proceed to step 2. If no front buckles require replacement proceed to the appropriate 2nd and 3rd row seat belt buckle inspection/replacement section.
 2. Remove the SIR fuse.
 3. Remove the nuts attaching the seat assembly to the floor.
 4. Remove the Connector Position Assurance (CPA) from the connectors and disconnect the electrical connectors from the seat.
 5. Remove the seat from the vehicle.

6. Remove the screws attaching the side cover to the seat and remove the cover.
7. Remove the nut attaching the seat belt buckle and pre-tensioner assembly to the seat.
8. Remove the inboard REAR seat track to seat attaching bolt.
9. Loosen the inboard FRONT seat track to seat attaching bolt.
10. Disconnect the CPA and disconnect the pre-tensioner electrical connector.
11. Route the electrical connector between the seat track and seat assembly and remove the seat belt buckle and pre-tensioner assembly.
12. Route the new electrical connector between the seat track and seat assembly and install the buckle and pre-tensioner assembly on the seat stud.
13. Connect the pre-tensioner electrical connector and install the CPA.
14. Install the nut attaching the buckle and pre-tensioner assembly to the seat and tighten to 35 N.m (26 lb. ft.).
15. Install the inboard REAR seat track to seat attaching bolt and tighten to 32 N.m (24 lb. ft.).
16. Tighten the inboard FRONT seat track to seat attaching bolt to 32 N.m (24 lb. ft.).
17. Install the side cover on the seat and install the attaching screws. Tighten to 2 N.m (18 lb. in.).
18. Install the seat in the vehicle.
19. Connect the electrical connectors and install the CPA.
20. Install the nuts attaching the seat assembly to the floor and tighten to 40 N.m (30 lb. ft.).
21. Install the SIR fuse.
22. Turn the ignition switch to the "ON" position and verify that the AIR BAG light flashes 7 times and goes out.
23. Proceed to the appropriate 2nd and 3rd row seat belt buckle inspection/replacement section.

Models: Montana / Venture / Silhouette
Location and Seat Type: 2nd or 3rd Row with Captains Chairs
Buckle Location: All

Service Procedure:

- Replace only (no inspection required).
1. Remove the screws attaching the side cover and remove the cover.
 2. Remove the seat belt buckle nut and remove the buckle.
 3. Install the new seat belt buckle.
 4. Install the nut and tighten to 53 N.m (39 lb. ft.).
 5. Install the side cover and tighten screws to 2 N.m (18 lb. in.).
 6. Install the GM Campaign Identification Label.
-

Models: Montana / Venture / Silhouette
Location and Seat Type: 2nd Row with Split Bench Seat
Buckle Location: Left and Right

Service Procedure:

- Inspect and replace if required
1. Inspect the date code on each seat belt buckle on to determine if replacement is required. See Date Code Information. If one or more buckles require replacement, proceed to the appropriate seat description below. If no buckles require replacement proceed to step 2 after the seat descriptions.
 - **Right Seat:**
 - Remove the seat from the vehicle.
 - Unhook the J-strip on the bottom rear of the seat cushion to access the seat belt buckle retaining bolt.
 - Remove the retaining bolt and the seat belt buckle.
 - Install the new seat belt buckle in the seat.
 - Install the retaining bolt and tighten to 53 N.m (39 lb. ft.).
 - Re-hook the J-strip on the bottom rear of the seat cushion.
 - Install the seat in the vehicle.
 - **Left Seat:**
 - Remove the seat from the vehicle.
 - Reposition the seat cushion material to access the seat belt buckle retaining bolt.
 - Remove the retaining bolt and the seat belt buckle.
 - Install the new seat belt buckle in the seat.
 - Install the retaining bolt and tighten to 53 N.m (39 lb. ft.).
 - Install the seat in the vehicle.
 2. Install the GM Campaign Identification Label.

Models: Montana / Venture / Silhouette
Location and Seat Type: 3rd Row with 50/50 Bench Seat
Buckle Location: Left, Center, Right

Service Procedure:

- Inspect and replace if required
1. Inspect the date code on each seat belt buckle on to determine if replacement is required. See date code Information. If one or more buckles require replacement, proceed to step 2. If no buckles require replacement proceed to step 9.
 2. Remove the seat from the vehicle.

3. Unhook the J-strip on the bottom rear of the seat cushion to access the seat belt buckle retaining bolt.
4. Remove the retaining bolt and the seat belt buckle.
5. Install the new seat belt buckle in the seat.
6. Install the retaining bolt and tighten to 53 N.m (39 lb. ft.).
7. Re-hook the J-strip on the bottom rear of the seat cushion.
8. Install the seat in the vehicle.
9. Install the GM Campaign Identification Label.

Models: S/T Truck
Location and Seat Type: Front Buckets
Buckle Location: Driver or Passenger

Service Procedure:

- Replace only (no inspection required)
1. Remove the seat track front and rear covers.
 2. Remove the nuts and bolt that attach the seat track to the floor.
 3. Disconnect the electrical connector from under the driver's seat. If the vehicle has heated seats (RPO KA1), disconnect the electrical connector from under the passenger's seat.
 4. Remove the seat from the vehicle.
 5. Remove the seat belt buckle retaining bolt and remove the buckle.
 6. Install the new buckle and retaining bolt. Tighten to 70 N.m (52 lb. ft.).
 7. Install the seat in the vehicle.
 8. Connect the electrical connector under the seat (driver's side only).
 9. Install the nuts that attach the seat track to the floor. Tighten to 45 N.m (33 lb. ft.).
 10. Install the bolt that attaches the seat track to the floor. Tighten to 70 N.m (52 lb. ft.).
 11. Install the seat track front and rear covers.
 12. Install the GM Campaign Identification Label.

Models: S/T Pickup
Location and Seat Type: Front Split Bench
Buckle Location: Driver, Center and Passenger

Service Procedure:

- Replace driver and RH passenger (no inspection required)
 - Inspect center passenger buckle and replace if required
1. Inspect the date code on center passenger buckle to determine if replacement is required. See date code information.
 - **Driver, or Both Driver and Center Seat Belt Buckles:**

CLAIM INFORMATION

Submit a Product Campaign Claim with the information indicated below:

REPAIR PERFORMED	PART COUNT	PART NO.	PARTS ALLOW	CC-FC	LABOR OP	LABOR HOURS
<u>U-Van with frt Capt. Chairs, 2nd (AT5) and 3rd (AM9) row split bench</u> Inspect only:	—	—	—	MA-98	V0836	* 0.2
Add: Driver seat belt buckle repl. (with pretensioner)	1	12457479	**			0.5
Add: Frt passenger seat belt buckle repl.	1	12457479	**			0.5
Add: Both frt seat belt buckle replace (bucket seat with pretensioner)	2	12457479	**			0.8
Add: 2 nd row RH seat belt buckle repl. (AT5 split bench)	1	12457479	**			0.2
Add: 2 nd row LH seat belt buckle repl. (AT5 split bench)	1	12457479	**			0.1
Add: 3 rd row repl. one seat belt buckle (AM9 split bench)	1	12457479	**			0.2
Add: 3 rd row repl. second and/or third seat belt buckles (AM9 split bench)	1 or 2	12457479	**			0.2
<u>U-Van with frt capt. chairs, 2nd row capt. chairs, 3rd row capt. chairs or AM9 split bench</u> Inspect only:	—	—	—	MA-98	V0837	* 0.2
Add: Driver seat belt buckle repl. (with pretensioner)	1	12457479	**			0.5
Add: Frt passenger seat belt buckle repl. (with pretensioner)	1	12457479	**			0.5
Add: Both frt seat belt buckle replace (bucket seat with pretensioner)	2	12457479	**			0.8
Add: 2 nd row seat belt buckles repl. (capt. chair both LH and RH)	2	88894671	**			0.3
Add: 2 nd & 3 rd row seat belt buckles repl. (capt. chair — All 4)	4	88894671	**			0.5
Add: 3 rd row repl. one seat belt buckle (AM9 split bench)	1	12457479	**			0.2
Add: 3 rd row repl. second and/or third seat belt buckles (AM9 split bench)	1 or 2	12457479	**			0.2
<u>S/T with bucket seats</u> Repl either driver or passenger bucket seat belt buckle (not both)	1	12474841		MA 98	V0838	* 0.4
Repl both driver & passenger bucket seat belt buckle	1	12474840		MA 98	V0838	* 0.7

REPAIR PERFORMED	PART COUNT	PART NO.	PARTS ALLOW	CC-FC	LABOR OP	LABOR HOURS
<u>S/T with bench seat</u> Inspect only	—	—		MA-98	V0840	* 0.2
Add: Repl driver seat belt buckle	1	12477769	**			0.3
Add: Repl center passenger seat belt buckle (attached to driver's seat)	1	12477769	**			0.3
Add: Repl RH passenger seat belt buckle	1	12477769	**			0.1
<u>Chevrolet Lumina (bench)</u> Inspect only	—	—	—	MA-98	V0841	* 0.2
Add: Repl driver seat belt buckle	1	88894557	**			0.1
Add: Repl frt passenger seat belt buckle	1	88894557	**			0.1
Add: Repl both driver and frt passenger seat belt buckle	2	88894557	**			0.2
Add: Repl rear seat belt buckle — one or all	1	88894557	**			0.1
<u>Chevrolet, Buick Bucket Seats</u> Inspect only	—	—	—	MA-98	V0842	* 0.2
Add: Repl driver seat belt buckle	1	88893363	**			0.2
Add: Repl frt passenger seat belt buckle	1	88893363	**			0.1
Add: Repl both driver and frt passenger seat belt buckle	2	88893363	**			0.2
Add: Repl rear seat belt buckle — one or all	1	88893363	**			0.1
<u>Intrigue, Gr. Prix Bucket Seats</u> Inspect only	—	—	—	MA-98	V0843	* 0.2
Add: Repl driver seat belt buckle	1	88895099	**			0.2
Add: Repl frt passenger seat belt buckle	1	88895099	**			0.1
Add: Repl both driver and frt passenger seat belt buckle	2	88895099	**			0.3
Add: Repl rear seat belt buckle — one or all	1	88895099	**			0.1

REPAIR PERFORMED	PART COUNT	PART NO.	PARTS ALLOW	CC-FC	LABOR OP	LABOR HOURS
<u>Impala, Century with 60/40 split bench</u> Inspect only	—	—		MA-98	V0844	* 0.2
Add: Repl. driver seat belt buckle	1	12458489	**			0.4
Add: Repl. frt passenger seat belt buckle	1	12458489	**			0.3
Add: Repl both driver and RH front passenger seat belt buckles	2	12458489	**			0.6
Add: Repl both driver and ctr frt passenger seat belt buckle	2	12458489	**			0.7
Add: Repl both RH and ctr frt passenger seat belt buckles	2	12458489	**			0.4
Add: Repl only ctr frt passenger seat belt buckle	1	12458489	**			0.4
Add: Repl rear seat belt buckle – one or all	1	12458489	**			0.1

* For Campaign Administrative Allowance, add 0.1 hours to the "Labor Hours".

** The "Parts Allowance" should be the sum total of the current GMSP0 Dealer Net price plus applicable Mark-Up or Landed Cost Mark-Up (for IPC) for parts needed to complete the repair.

Refer to the General Motors WINS Claims Processing Manual for details on Product Campaign Claim Submission.

CUSTOMER NOTIFICATION – For US and CANADA

Customers will be notified of this campaign on their vehicles by General Motors (see copy of customer letter included with this bulletin).

CUSTOMER NOTIFICATION – For IPC

Letters will be sent to known owners of record located within areas covered by the US National Traffic and Motor Vehicle Safety Act. For owners outside these areas, dealers should notify customers using the attached suggested dealer letter.

DEALER CAMPAIGN RESPONSIBILITY – For US and IPC (US States, Territories, and Possessions)

The US National Traffic and Motor Vehicle Safety Act provides that each vehicle that is subject to a recall campaign of this type must be adequately repaired within a reasonable time after the customer has tendered it for repair. A failure to repair within sixty days after tender of a vehicle is prima facie evidence of failure to repair within a reasonable time. If the condition is not adequately repaired within a reasonable time, the customer may be entitled to an identical or reasonably equivalent vehicle at no charge or to a refund of the purchase price less a reasonable allowance for depreciation. To avoid having to provide these burdensome remedies, every effort must be made to promptly schedule an appointment with each customer and to repair their vehicle as soon as possible. In the recall campaign notification

letters, customers are told how to contact the US National Highway Traffic Safety Administration if the campaign is not completed within a reasonable time.

This bulletin is notice to you that the new motor vehicles included in this campaign may not comply with the standard identified above. Under Title 49, Section 30112 of the United States Code, it is illegal for a dealer to sell a new motor vehicle which the dealer knows does not comply with an applicable Federal Motor Vehicle Safety Standard. As a consequence, if you sell any of these motor vehicles without first performing the campaign correction, your dealership may be subject to a civil penalty for each such sale.

DEALER CAMPAIGN RESPONSIBILITY - ALL

All unsold new vehicles in dealers' possession and subject to this campaign must be held and inspected/repaired per the service procedure of this campaign bulletin before customers take possession of these vehicles.

Dealers are to service all vehicles subject to this campaign at no charge to customers, regardless of mileage, age of vehicle, or ownership, from this time forward.

Customers who have recently purchased vehicles sold from your vehicle inventory, and for which there is no customer information indicated on the dealer listing, are to be contacted by the dealer. Arrangements are to be made to make the required correction according to the instructions contained in this bulletin. This could be done by mailing to such customers, a copy of the customer letter accompanying this bulletin. Campaign follow-up cards should not be used for this purpose, since the customer may not as yet have received the notification letter.

In summary, whenever a vehicle subject to this campaign enters your vehicle inventory, or is in your dealership for service in the future, you must take the steps necessary to be sure the campaign correction has been made before selling or releasing the vehicle.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the tools, equipment, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your dealer/retailer for information on whether your vehicle may benefit from the information.



**We Support
Voluntary
Technician
Certification**

December, 2000

Dear General Motors Customer:

This notice is sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act.

Reason For This Recall: General Motors has decided that certain 2000-01 'U'-Van, 2000-01 'W'-Car, and 2000-01 'S/T' Truck model vehicles fail to conform to Federal/Canada Motor Vehicle Safety Standard 209, "Seat Belt Assemblies". The seat belt buckles in certain, specific seating locations in these vehicles do not meet the pull test requirement. In a crash, the seat belt buckle may release and the occupant may receive more severe injuries.

What Will Be Done: Your dealer will replace suspect seat belt buckle assemblies. In certain seating locations, dealers will inspect for a suspect date code and replace seat belt buckle assemblies with suspect date codes. This service will be performed for you at no charge.

How Long Will The Repair Take? The length of time required to perform this inspection and service correction is approximately one hour, forty five minutes. Additional time may be required to schedule and process your vehicle. If your dealer has a large number of vehicles awaiting service, this additional time may be significant. Please ask your dealer if you wish to know how much additional time will be needed to schedule, process and repair your vehicle.

Contacting Your Dealer: Please contact your dealer as soon as possible to arrange a service date. Parts are available and instructions for making this correction have been sent to your dealer. Your dealer is best equipped to obtain parts and provide services to correct your vehicle as promptly as possible. Should your dealer be unable to schedule a service date within a reasonable time, you should contact the appropriate Customer Assistance Center at the listed number below:

Division	Number	Deaf, Hearing Impaired or Speech Impaired *
Buick	1-800-521-7300	1-800-832-8425
Chevrolet	1-800-222-1020	1-800-833-2438
GMC	1-800-462-8782	1-800-462-8583
Pontiac	1-800-762-2737	1-800-833-7668
Oldsmobile	1-800-442-6537	1-800-833-6537
GMODC	(905) 644-4112	
Puerto Rico - English	1-800-496-9992	
Puerto Rico - Español	1-800-496-9993	
Virgin Islands	1-800-496-9994	

* Utilize Telecommunication Devices for the Deaf/Text Telephones (TDD/TTY)

If, after contacting the appropriate customer assistance center, you are still not satisfied that we have done our best to remedy this condition without charge and within a reasonable time, you may wish to write the Administrator, National Highway Traffic Safety Administration, 400 Seventh Street, SW, Washington, DC 20590 or call 1-888-327-4236.

Customer Reply Card: The attached customer reply card identifies your vehicle. Presentation of this card to your dealer will assist in making the necessary correction in the shortest possible time. If you no longer own this vehicle, please let us know by completing the attached and mailing it in the postage paid envelope.

We are sorry to cause you this inconvenience; however, we have taken this action in the interest of your safety and continued satisfaction with our products.

General Motors Corporation

Enclosure



Campaign Bulletin

File In Section: Product Campaigns
Bulletin No.: 00067B
Date: May, 2001

00V-228,003



F/CMVSS NONCOMPLIANCE CAMPAIGN

SUBJECT: 00067B SEAT BELT BUCKLE

**MODELS: CERTAIN 2000-01 'U'-VAN AND 'W'-CAR MODEL VEHICLES
CERTAIN 2000-01 'S/T' TRUCK MODEL VEHICLES**

THIS SUPPLEMENT IS BEING ISSUED IN ORDER TO:

- **PROVIDE INFORMATION REGARDING SOME VEHICLES THAT WERE ERRONEOUSLY INCLUDED IN THE CAMPAIGN POPULATION**
- **PROVIDE AN IMPROVED VEHICLE SEATING POSITION DECISION TABLE**

THIS SUPPLEMENT SHOULD BE FILED WITH CAMPAIGN BULLETIN 00067A, ISSUED FEBRUARY 19, 2001.

VEHICLES INVOLVED

IMPORTANT: A small number of 2000 Chevrolet S-10 and GMC Sonoma model vehicles were erroneously included in this campaign. These vehicles were built at the Linden Plant and are equipped with pewter interior (RPO 92I) and full bench seats (RPO A52).

These vehicles will be removed from **GMVIS** (GM Vehicle Inquiry System) or **GM Access Screen** (Canada only) or **DCS Screen 445** (IPC only) and involved owners will be notified of this error (sample letter attached).

There is no change to the vehicles involved table from bulletin 00067A.

VEHICLE SEATING POSITION DECISION TABLE

The following table is revised to include specific date code information for each vehicle, seat type, seating position, and color.

Decision Table

IMPORTANT: FOR U-VANS (MONTANA, SILHOUETTE, VENTURE) NO SEAT BELT BUCKLES ON MODULAR BUCKET SEAT (RPO AL4) ARE INVOLVED IN THIS CAMPAIGN. MODULAR BUCKET SEATS DO NOT HAVE ARMRESTS AND CAN BE MOVED TO DIFFERENT LOCATIONS, UNLIKE CAPTAIN'S CHAIRS OR SPLIT BENCH SEATS.

Vehicle Seating Position
Decision Table

Division	Model Year	Model	Interior Color	Interior Color RPO	Beginning VIN(s)	Ending VIN(s)	Seating Position to Insp./Repl.	Repair Action Req'd.	Service Part No.	Suspect Date Codes
Buick	2000	Century	Grey	14I	Y1311389	Y1315424	Rear (all)	Insp. and Repl. if Necessary	88894561	152002 152003 152004 152005 152006 152007 155001
Buick	2000	Century	Grey	14I	Y1315425	Y1340411	Driver	Repl. Only - No Insp. Req'd.	12458469	-
Buick	2000	Century	Grey	14I	Y1315425	Y1340411	Frt Ctr	Insp. and Repl. if Necessary	88895106	145002 145003 145004 145005 145006 145007 145008 154001 154002 155001
Buick	2000	Century	Grey	14I	Y1315425	Y1340411	Frt RH Pass.	Repl. Only - No Insp. Req'd.	88895103	-
Buick	2000	Century	Grey	14I	Y1315425	Y1340411	Rear (all)	Insp. and Repl. if Necessary	88894561	152002 152003 152004 152005 152006 152007 155001

Division	Model Year	Model	Interior Color	Interior Color RPC	Beginning VIN(s)	Ending VIN(s)	Seating Position to Insp./Repl.	Repair Action Req'd.	Service Part No.	Suspect Date Codes
Buick	2000	Century	Med Blue	30I	Y1311389	Y1315424	Rear (all)	Insp. and Repl. if Necessary	88894562	154001
Buick	2000	Century	Med Blue	30I	Y1315425	Y1340411	Frnt Ctr	Insp. and Repl. if Necessary	12453442	154002
Buick	2000	Century	Med Blue	30I	Y1315425	Y1340411	Frnt RH Pass.	Repl. Only - No Insp. Req'd.	88895104	-
Buick	2000	Century	Med Blue	30I	Y1315425	Y1340411	Rear (all)	Insp. and Repl. if Necessary	88894562	154001
Buick	2000	Century	Neutral	52I	Y1311389	Y1315424	Rear (all)	Insp. and Repl. if Necessary	12369754	154001 154002 154003 162003
Buick	2000	Century	Neutral	52I	Y1315425	Y1340411	Frnt Ctr	Insp. and Repl. if Necessary	88895105	151001
Buick	2000	Century	Neutral	52I	Y1315425	Y1340411	Rear (all)	Insp. and Repl. if Necessary	12369754	154001 154002 154003 162003
Buick	2000	Regal	Grey	14I	Y1311389	Y1315424	Rear (all)	Insp. and Repl. if Necessary	88894561	152002 152003 152004 152005 152006 152007 155001
Buick	2000	Regal	Grey	14I	Y1315425	Y1340411	Driver	Repl. Only - No Insp. Req'd.	12458469	-
Buick	2000	Regal	Grey	14I	Y1315425	Y1340411	Frnt RH Pass.	Repl. Only - No Insp. Req'd.	88895103	-
Buick	2000	Regal	Grey	14I	Y1315425	Y1340411	Rear (all)	Insp. and Repl. if Necessary	88894561	152002 152003 152004 162006 152006 152007 155001
Buick	2000	Regal	Med Blue	30I	Y1315425	Y1340411	Frnt RH Pass.	Repl. Only - No Insp. Req'd.	88895104	-
Buick	2000	Regal	Neutral	52I	Y1311389	Y1315424	Rear (all)	Insp. and Repl. if Necessary	12369754	154001 154002 154003 162003

Division	Model Year	Model	Interior Color	Interior Color RPO	Beginning VIN(s)	Ending VIN(s)	Seating Position to Insp./Repl.	Repair Action Req'd.	Service Part No.	Suspect Date Codes
Buick	2000	Regal	Neutral	52I	Y1315425	Y1340411	Frnt RH Pass.	Repl. Only - No Insp. Req'd.	88895102	-
Buick	2000	Regal	Neutral	52I	Y1315425	Y1340411	Rear (all)	Insp. and Repl. if Necessary	12369754	154001 154002 154003 162003
Buick	2001	Century	Grey	14I	11100001	11100024	Driver	Repl. Only - No Insp. Req'd.	12458489	-
Buick	2001	Century	Grey	14I	11100001	11100024	Frnt Ctr	Insp. and Repl. if Necessary	88895108	145002 145003 145004 145005 145006 145007 145008 154001 164002 155001
Buick	2001	Century	Grey	14I	11100001	11100024	Frnt RH Pass.	Repl. Only - No Insp. Req'd.	88895103	-
Buick	2001	Century	Grey	14I	11100001	11100024	Rear (all)	Insp. and Repl. if Necessary	88894561	152002 152003 162004 152005 152006 152007 155001
Buick	2001	Century	Med Blue	30I	11100001	11100024	Frnt Ctr	Insp. and Repl. if Necessary	12453442	154002
Buick	2001	Century	Med Blue	30I	11100001	11100024	Frnt RH Pass.	Repl. Only - No Insp. Req'd.	88895104	-
Buick	2001	Century	Med Blue	30I	11100001	11100024	Rear (all)	Insp. and Repl. if Necessary	88894562	154001
Buick	2001	Century	Neutral	52I	11100001	11100024	Frnt Ctr	Insp. and Repl. if Necessary	88895105	151001
Buick	2001	Century	Neutral	52I	11100001	11100024	Rear (all)	Insp. and Repl. if Necessary	12369754	154001 154002 154003 162003
Buick	2001	Regal	Grey	14I	11100001	11100024	Driver	Repl. Only - No Insp. Req'd.	12458469	-
Buick	2001	Regal	Grey	14I	11100001	11100024	Frnt RH Pass.	Repl. Only - No Insp. Req'd.	88895103	-
Buick	2001	Regal	Grey	14I	11100001	11100024	Rear (all)	Insp. and Repl. if Necessary	88894561	155001

Division	Model Year	Model	Interior Color	Interior Color RPO	Beginning VIN(s)	Ending VIN(s)	Seating Position to Insp./Repl.	Repair Action Req'd.	Service Part No.	Suspect Date Codes
Buick	2001	Regal	Med Blue	30I	11100001	11100024	Frt RH Pass.	Repl. Only - No Insp. Req'd.	88895104	-
Buick	2001	Regal	Neutral	52I	11100001	11100024	Frt RH Pass.	Repl. Only - No Insp. Req'd.	88895102	-
Buick	2001	Regal	Neutral	52I	11100001	11100024	Rear (all)	Insp. and Repl. if Necessary	12369754	154001 154002 154003 162003
Chevrolet	2000	Impala	Dark Blue	27I	Y9341076	Y9365791	Frt RH Pass.	Repl. Only - No Insp. Req'd.	88893320	-
Chevrolet	2000	Impala	Camel	67I	Y9334602	Y9341075	Rear LH and Ctr	Insp. and Repl. if Necessary	12459816	151002 151003 154002
Chevrolet	2000	Impala	Camel	67I	Y9334602	Y9341075	Rear RH	Insp. and Repl. if Necessary	88893356	151002
Chevrolet	2000	Impala	Camel	67I	Y9341076	Y9365791	Driver	Repl. Only - No Insp. Req'd.	12459833	-
Chevrolet	2000	Impala	Camel	67I	Y9341076	Y9365791	Frt RH Pass.	Repl. Only - No Insp. Req'd.	88893319	-
Chevrolet	2000	Impala	Camel	67I	Y9341076	Y9365791	Rear LH and Ctr	Insp. and Repl. if Necessary	12459816	151002 151003 154002
Chevrolet	2000	Impala	Camel	67I	Y9341076	Y9365791	Rear RH	Insp. and Repl. if Necessary	88893358	151002
Chevrolet	2000	Impala	Pewter	92I	Y9334602	Y9341075	Rear LH and Ctr	Insp. and Repl. if Necessary	88893355	146002 146003 146004 153002 161002
Chevrolet	2000	Impala	Pewter	92I	Y9334602	Y9341075	Rear RH	Insp. and Repl. if Necessary	12459815	153002 154001 154003 161002

Division	Model Year	Model	Interior Color	Interior Color RPO	Beginning VIN(s)	Ending VIN(s)	Seating Position to Insp./Repl.	Repair Action Req'd.	Service Part No.	Suspect Date Codes
Chevrolet	2000	Impala	Pewter	92I	Y9341076	Y9365791	Frt Ctr	Insp. and Repl. if Necessary	12458899	161002
Chevrolet	2000	Impala	Pewter	92I	Y9341076	Y9365791	Frt RH Pass.	Repl. Only - No Insp. Req'd.	88893318	-
Chevrolet	2000	Impala	Pewter	82I	Y8341076	Y8365791	Rear LH and Ctr	Insp. and Repl. if Necessary	88893355	146002 146003 146004 153002 161002
Chevrolet	2000	Impala	Pewter	92I	Y9341076	Y9365791	Rear RH	Insp. and Repl. if Necessary	12459815	153002 154001 154003 161002
Chevrolet	2000	Lumina	Neutral	52I	Y1311211	Y1340410	Frt Ctr and RH Pass.	Repl. Only - No Insp. Req'd.	88894557	-
Chevrolet	2000	Lumina	Pewter	92I	Y1311211	Y1340410	Frt Ctr and RH Pass.	Repl. Only - No Insp. Req'd.	88894558	-
Chevrolet	2000	Lumina	Pewter	92I	Y1311211	Y1340410	Rear (all)	Insp. and Repl. if Necessary	88894560	151002 151003 151004
Chevrolet	2000	Monte Carlo	Black	19I	Y9334602	Y9341075	Rear (all)	Insp. and Repl. if Necessary	88893354	146001 146002 146003 146004 146005 146006 146007 151002 151003 151004 151005 165003

Division	Model Year	Model	Interior Color	Interior Color RPO	Beginning VIN(s)	Ending VIN(s)	Seating Position to Insp./Repl.	Repair Action Req'd.	Service Part No.	Suspect Date Codes
Chevrolet	2000	Monte Carlo	Black	19I	Y9341076	Y9365791	Driver	Repl. Only - No Insp. Req'd.	88893317	-
Chevrolet	2000	Monte Carlo	Black	19I	Y9341076	Y9365791	Frnt RH Pass.	Repl. Only - No Insp. Req'd.	88893321	-
Chevrolet	2000	Monte Carlo	Black	19I	Y9341076	Y9365791	Rear (all)	Insp. and Repl. if Necessary	88893354	146001 146002 146003 146004 146005 146006 146007 151002 151003 151004 151005 165003
Chevrolet	2000	Monte Carlo	Camel	67I	Y9334602	Y9341075	Rear (all)	Insp. and Repl. if Necessary	88893353	151001
Chevrolet	2000	Monte Carlo	Camel	67I	Y9341076	Y9365791	Driver	Repl. Only - No Insp. Req'd.	12459833	-
Chevrolet	2000	Monte Carlo	Camel	67I	Y9341076	Y9365791	Frnt Pass.	Repl. Only - No Insp. Req'd.	88893319	-
Chevrolet	2000	Monte Carlo	Camel	67I	Y9341076	Y9365791	Rear (all)	Insp. and Repl. if Necessary	88893353	151001
Chevrolet	2000	Monte Carlo	Pewter	92I	Y9334602	Y9341075	Rear (all)	Insp. and Repl. if Necessary	88893325	161002
Chevrolet	2000	Monte Carlo	Pewter	92I	Y9341076	Y9365791	Frnt RH Pass.	Repl. Only - No Insp. Req'd.	88893316	-
Chevrolet	2000	Monte Carlo	Pewter	92I	Y9341076	Y9365791	Rear (all)	Insp. and Repl. if Necessary	88893325	161002
Chevrolet	2000	S-10 Pickup	Graphite	12I	Y8269084	Y8297381	Frnt Ctr (AM6 Split Bench only)	Insp. and Repl. if Necessary	12477774	157001 163002
Chevrolet	2000	S-10 Pickup	Graphite	12I	Y8269084	Y8297381	Frnt RH Pass. (A52 Full Bench Only-Incl. Latch Plate for Center Position)	Repl. Only - No Insp. Req'd.	12477768	-
Chevrolet	2000	S-10 Pickup	Graphite	12I	Y8269084	Y8297381	Frnt RH Pass. (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474640	-
Chevrolet	2000	S-10 Pickup	Graphite	12I	YK262348	YK276988	Frnt Ctr (AM6 Split Bench only)	Insp. and Repl. if Necessary	12477774	157001 163002
Chevrolet	2000	S-10 Pickup	Graphite	12I	YK262348	YK276988	Frnt RH Pass. (A52 Full Bench Only-Incl. Latch Plate for Center Position)	Repl. Only - No Insp. Req'd.	12477768	-
Chevrolet	2000	S-10 Pickup	Graphite	12I	YK262348	YK276988	Frnt RH Pass. (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474640	-

Division	Model Year	Model	Interior Color	Interior Color RPO	Beginning VIN(s)	Ending VIN(s)	Seating Position to Insp./Repl.	Repair Action Req'd.	Service Part No.	Suspect Date Codes
Chevrolet	2000	S-10 Pickup	Beige	64I	Y8269084	Y8297381	Driver (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474641	-
Chevrolet	2000	S-10 Pickup	Beige	64I	Y8269084	Y8297381	Frt RH Pass. (A52 Full Bench only)	Repl. Only - No Insp. Req'd.	12477769	-
Chevrolet	2000	S-10 Pickup	Beige	64I	YK262348	YK276988	Driver (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474641	-
Chevrolet	2000	S-10 Pickup	Beige	64I	YK262348	YK276988	Frt RH Pass. (A52 Full Bench only)	Repl. Only - No Insp. Req'd.	12477769	-
Chevrolet	2000	S-10 Pickup	Pewter	92I	Y8269084	Y8297381	Driver (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474643	-
Chevrolet	2000	S-10 Pickup	Pewter	92I	Y8269084	Y8297381	Frt Ctr (AM6 Split Bench only)	Insp. and Repl. if Necessary	12477776	163002
Chevrolet	2000	S-10 Pickup	Pewter	92I	Y8269084	Y8297381	Frt RH Pass. (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474644	-
Chevrolet	2000	S-10 Pickup	Pewter	92I	YK262348	YK276988	Driver (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474643	-
Chevrolet	2000	S-10 Pickup	Pewter	92I	YK262348	YK276988	Frt Ctr (AM6 Split Bench only)	Insp. and Repl. if Necessary	12477776	163002
Chevrolet	2000	S-10 Pickup	Pewter	92I	YK262348	YK276988	Frt RH Pass. (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474644	-
Chevrolet	2000	Utility	Graphite	12I	Y2258880	Y2381029	Frt Ctr (AM6 Split Bench only)	Insp. and Repl. if Necessary	12477774	157001 163002
Chevrolet	2000	Utility	Graphite	12I	Y2258880	Y2381029	Frt RH Pass. Except KA1 Htd. Seat (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474640	-
Chevrolet	2000	Utility	Graphite	12I	YK262348	YK276988	Frt Ctr (AM6 Split Bench only)	Insp. and Repl. if Necessary	12477774	157001 163002
Chevrolet	2000	Utility	Graphite	12I	YK262348	YK276988	Frt RH Pass. Except KA1 Htd. Seat (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474640	-
Chevrolet	2000	Utility	Beige	64I	Y2258880	Y2381029	Driver (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474641	-
Chevrolet	2000	Utility	Beige	64I	YK262348	YK276988	Driver (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474641	-
Chevrolet	2000	Utility	Pewter	92I	Y2258880	Y2381029	Driver (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474643	-
Chevrolet	2000	Utility	Pewter	92I	Y2258880	Y2381029	Frt Ctr (AM6 Split Bench only)	Insp. and Repl. if Necessary	12477776	163002
Chevrolet	2000	Utility	Pewter	92I	Y2258880	Y2381029	Frt RH Pass. Except KA1 Htd. Seat (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474644	-
Chevrolet	2000	Utility	Pewter	92I	Y2258880	Y2381029	Frt RH Pass. With KA1 Htd. Seat (Bucket Only)	Repl. Only - No Insp. Req'd.	12474643	-

Division	Model Year	Model	Interior Color	Interior Color RPO	Beginning VIN(s)	Ending VIN(s)	Seating Position to Insp./Repl.	Repair Action Req'd.	Service Part No.	Suspect Date Codes
Chevrolet	2000	Utility	Pewter	92I	YK262348	YK278988	Driver (Bkt or AM8 Split Bench)	Repl. Only - No Insp. Req'd.	12474843	--
Chevrolet	2000	Utility	Pewter	92I	YK262348	YK278988	Frt Cir (AM6 Split Bench only)	Insp. and Repl. if Necessary	12477776	163002
Chevrolet	2000	Utility	Pewter	92I	YK262348	YK278988	Frt RH Pass. Except KA1 Htd. Seat (Bkt or AM8 Split Bench)	Repl. Only - No Insp. Req'd.	12474844	--
Chevrolet	2000	Utility	Pewter	92I	YK262348	YK278988	Frt RH Pass. With KA1 Htd. Seat (Bucket Only)	Repl. Only - No Insp. Req'd.	12474843	--
Chevrolet	2000	Venture	Grey	14I	YD311479	YD377388	Driver	Insp. and Repl. if Necessary	12457479	135002 158001 158002 157001 157002 161002
Chevrolet	2000	Venture	Grey	14I	YD311479	YD377388	Frt RH Pass.	Insp. and Repl. if Necessary	12457483	136001 136002 141002 142001 162001
Chevrolet	2000	Venture	Grey	14I	YD311479	YD377388	2nd Row 60/40 Bench RH (AT5)	Insp. and Repl. if Necessary	88895093	154001 161002
Chevrolet	2000	Venture	Gray	14I	YD311479	YD377388	2nd Row Capt. Chair LH and RH	Repl. Only - No Insp. Req'd.	12531150	--
Chevrolet	2000	Venture	Grey	14I	YD311479	YD377388	3rd Row AM9 Split Bench (all)	Insp. and Repl. if Necessary	88894863	145009 154001 154002 154003 161002 162001 162003
Chevrolet	2000	Venture	Grey	14I	YD311479	YD377388	3rd Row Capt. Chair LH and RH	Repl. Only - No Insp. Req'd.	12531150	--
Chevrolet	2000	Venture	Neutral	52I	YD311479	YD377388	2nd Row 60/40 Bench RH (AT5)	Insp. and Repl. if Necessary	88895094	161002
Chevrolet	2000	Venture	Neutral	52I	YD311479	YD377388	3rd Row AM9 Split Bench (all)	Insp. and Repl. if Necessary	88894864	151001 151007
Chevrolet	2001	Impala	Dark Blue	27I	19100001	19100970	Frt RH Pass.	Repl. Only - No Insp. Req'd.	88893320	--
Chevrolet	2001	Impala	Neutral	52I	19100001	19100970	Rear LH and Ctr	Insp. and Repl. if Necessary	88896427	154003

Division	Model Year	Model	Interior Color	Interior Color RPO	Beginning VIN(s)	Ending VIN(s)	Seating Position to Insp./Repl.	Repair Action Req'd.	Service Part No.	Suspect Date Codes
Chevrolet	2001	Impala	Camel	671	19100001	19100970	Driver	Repl. Only - No Insp. Req'd.	12458833	-
Chevrolet	2001	Impala	Camel	671	19100001	19100970	Frt RH Pass.	Repl. Only - No Insp. Req'd.	88893319	-
Chevrolet	2001	Impala	Camel	671	19100001	19100970	Rear LH and Ctr	Insp. and Repl. if Necessary	12458816	151002 151003 154002
Chevrolet	2001	Impala	Camel	671	19100001	19100970	Rear RH	Insp. and Repl. if Necessary	88893356	151002
Chevrolet	2001	Impala	Pewter	921	19100001	19100970	Frt Ctr	Insp. and Repl. if Necessary	12458899	181002
Chevrolet	2001	Impala	Pewter	921	19100001	19100970	Frt RH Pass.	Repl. Only - No Insp. Req'd.	88893318	-
Chevrolet	2001	Impala	Pewter	921	19100001	19100970	Rear LH and Ctr	Insp. and Repl. if Necessary	88893355	46002 146003 146004 153002 161002
Chevrolet	2001	Impala	Pewter	921	19100001	19100970	Rear RH	Insp. and Repl. if Necessary	12458815	153002 154001 154003 161002
Chevrolet	2001	Monte Carlo	Black	191	19100001	19100970	Driver	Repl. Only - No Insp. Req'd.	88893317	-
Chevrolet	2001	Monte Carlo	Black	191	19100001	19100970	Frt RH Pass.	Repl. Only - No Insp. Req'd.	88893321	-
Chevrolet	2001	Monte Carlo	Black	191	19100001	19100970	Rear (all)	Insp. and Repl. if Necessary	88893354	146001 146002 146003 146004 146005 146006 146007 151002 151003 151004 151005 165003
Chevrolet	2001	Monte Carlo	Neutral	521	19100001	19100970	Rear (all)	Insp. and Repl. if Necessary	88893426	154003

Division	Model Year	Model	Interior Color	Interior Color RPO	Beginning VIN(s)	Ending VIN(s)	Seating Position to Insp./Repl.	Repair Action Req'd.	Service Part No.	Suspect Date Codes
Chevrolet	2001	Monte Carlo	Camel	671	19100001	19100970	Driver	Repl. Only - No Insp. Req'd.	12458833	-
Chevrolet	2001	Monte Carlo	Camel	671	19100001	19100970	Frt RH Pass.	Repl. Only - No Insp. Req'd.	88893319	-
Chevrolet	2001	Monte Carlo	Camel	671	19100001	19100970	Rear (all)	Insp. and Repl. if Necessary	88893353	151001
Chevrolet	2001	Monte Carlo	Pewter	921	19100001	19100970	Frt RH Pass.	Repl. Only - No Insp. Req'd.	88893318	-
Chevrolet	2001	Monte Carlo	Pewter	921	19100001	19100970	Rear (all)	Insp. and Repl. if Necessary	88893325	161002
Chevrolet	2001	S-10 Pickup	Graphite	121	18100015	18100018	Frt Ctr (AM6 Split Bench only)	Insp. and Repl. if Necessary	12477774	157001 163002
Chevrolet	2001	S-10 Pickup	Graphite	121	18100015	18100018	Frt RH Pass. (A52 Full Bench Only-Incl. Latch Plate for Center Position)	Repl. Only - No Insp. Req'd.	12477768	-
Chevrolet	2001	S-10 Pickup	Graphite	121	18100015	18100018	Frt RH Pass. (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474640	-
Chevrolet	2001	S-10 Pickup	Graphite	121	1K100018	1K100036	Frt Ctr (AM6 Split Bench only)	Insp. and Repl. if Necessary	12477774	157001 163002
Chevrolet	2001	S-10 Pickup	Graphite	121	1K100018	1K100036	Frt RH Pass. (A52 Full Bench Only-Incl. Latch Plate for Center Position)	Repl. Only - No Insp. Req'd.	12477768	-
Chevrolet	2001	S-10 Pickup	Graphite	121	1K100018	1K100036	Frt RH Pass. (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474640	-
Chevrolet	2001	S-10 Pickup	Beige	641	18100015	18100018	Driver (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474641	-
Chevrolet	2001	S-10 Pickup	Beige	641	18100015	18100018	Frt RH Pass. (A52 Full Bench only)	Repl. Only - No Insp. Req'd.	12477769	-
Chevrolet	2001	S-10 Pickup	Beige	641	1K100018	1K100036	Driver (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474641	-
Chevrolet	2001	S-10 Pickup	Beige	641	1K100018	1K100036	Frt RH Pass. (A52 Full Bench only)	Repl. Only - No Insp. Req'd.	12477769	-
Chevrolet	2001	S-10 Pickup	Pewter	921	18100015	18100018	Driver (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474643	-
Chevrolet	2001	S-10 Pickup	Pewter	921	18100015	18100018	Frt Ctr (AM6 Split Bench only)	Insp. and Repl. if Necessary	12477776	163002
Chevrolet	2001	S-10 Pickup	Pewter	921	18100015	18100018	Frt RH Pass. (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474644	-
Chevrolet	2001	S-10 Pickup	Pewter	921	1K100018	1K100036	Driver (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474643	-
Chevrolet	2001	S-10 Pickup	Pewter	921	1K100018	1K100036	Frt Ctr (AM6 Split Bench only)	Insp. and Repl. if Necessary	12477776	163002
Chevrolet	2001	S-10 Pickup	Pewter	921	1K100018	1K100036	Frt RH Pass. (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474644	-

Division	Model Year	Model	Interior Color	Interior Color RPO	Beginning VIN(s)	Ending VIN(s)	Seating Position to Insp./Repl.	Repair Action Req'd.	Service Part No.	Suspect Date Codes
Chevrolet	2001	Utility	Graphite	12I	12100021	12100021	Frt Ctr (AM6 Split Bench only)	Insp. and Repl. if Necessary	12477774	157001 163002
Chevrolet	2001	Utility	Graphite	12I	12100021	12100021	Frt RH Pass. Except KA1 Htd. Seat (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474640	-
Chevrolet	2001	Utility	Graphite	12I	1K100018	1K100036	Frt Ctr (AM6 Split Bench only)	Insp. and Repl. if Necessary	12477774	157001 163002
Chevrolet	2001	Utility	Graphite	12I	1K100018	1K100036	Frt RH Pass. Except KA1 Htd. Seat (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474640	-
Chevrolet	2001	Utility	Beige	64I	12100021	12100021	Driver (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474641	-
Chevrolet	2001	Utility	Beige	64I	1K100018	1K100036	Driver (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474641	-
Chevrolet	2001	Utility	Pewter	92I	12100021	12100021	Driver (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474643	-
Chevrolet	2001	Utility	Pewter	92I	12100021	12100021	Frt Ctr (AM6 Split Bench only)	Insp. and Repl. if Necessary	12477776	163002
Chevrolet	2001	Utility	Pewter	92I	12100021	12100021	Frt RH Pass. Except KA1 Htd. Seat (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474644	-
Chevrolet	2001	Utility	Pewter	92I	12100021	12100021	Frt RH Pass. With KA1 Htd. Seat (Bucket Only)	Repl. Only - No Insp. Req'd.	12474643	-
Chevrolet	2001	Utility	Pewter	92I	1K100018	1K100036	Driver (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474643	-
Chevrolet	2001	Utility	Pewter	92I	1K100018	1K100036	Frt Ctr (AM6 Split Bench only)	Insp. and Repl. if Necessary	12477776	163002
Chevrolet	2001	Utility	Pewter	92I	1K100018	1K100036	Frt RH Pass. Except KA1 Htd. Seat (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474644	-
Chevrolet	2001	Utility	Pewter	92I	1K100018	1K100036	Frt RH Pass. With KA1 Htd. Seat (Bucket Only)	Repl. Only - No Insp. Req'd.	12474643	-

Division	Model Year	Model	Interior Color	Interior Color RPO	Beginning VIN(s)	Ending VIN(s)	Seating Position to Insp./Repl.	Repair Action Req'd.	Service Part No.	Suspect Data Codes
Chevrolet	2001	Venture	Grey	14I	1D100001	1D100040	Driver	Insp. and Repl. if Necessary	12457479	135002 158001 158002 157001 157002 161002
Chevrolet	2001	Venture	Grey	14I	1D100001	1D100040	Frt RH Pass.	Insp. and Repl. if Necessary	12457483	136001 136002 141002 142001 162001
Chevrolet	2001	Venture	Grey	14I	1D100001	1D100040	2nd Row 60/40 Bench RH (AT5)	Insp. and Repl. if Necessary	88895093	154001 161002
Chevrolet	2001	Venture	Grey	14I	1D100001	1D100040	2nd Row Capt. Chair LH and RH	Repl. Only - No Insp. Req'd.	12531150	-
Chevrolet	2001	Venture	Grey	14I	1D100001	1D100040	3rd Row AM9 Split Bench (all)	Insp. and Repl. if Necessary	88894883	145009 154001 154002 154003 161002 162001 162003
Chevrolet	2001	Venture	Grey	14I	1D100001	1D100040	3rd Row Capt. Chair LH or RH	Repl. Only - No Insp. Req'd.	12531150	-
Chevrolet	2001	Venture	Neutral	52I	1D100001	1D100040	2nd Row 60/40 Bench RH (AT5)	Insp. and Repl. if Necessary	88895094	161002
Chevrolet	2001	Venture	Neutral	52I	1D100001	1D100040	3rd Row AM9 Split Bench (all)	Insp. and Repl. if Necessary	88894884	151001 151007
GMC	2000	Sonoma	Graphite	12I	Y8252997	Y8297377	Frt Ctr (AM6 Split Bench only)	Insp. and Repl. if Necessary	12477774	157001 163002
GMC	2000	Sonoma	Graphite	12I	Y8252997	Y8297377	Frt RH Pass. (A52 Full Bench Only-Incl. Latch Plate for Center Position)	Repl. Only - No Insp. Req'd.	12477768	-
GMC	2000	Sonoma	Graphite	12I	Y8252997	Y8297377	Frt RH Pass. (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474840	-

Division	Model Year	Model	Interior Color	Interior Color RPO	Beginning VIN(s)	Ending VIN(s)	Seating Position to Insp./Repl.	Repair Action Req'd.	Service Part No.	Suspect Date Codes
GMC	2000	Sonoma	Graphite	121	YK262351	YK276985	Frt Ctr (AM6 Split Bench only)	Insp. and Repl. if Necessary	12477774	157001 163002
GMC	2000	Sonoma	Graphite	121	YK262351	YK276985	Frt RH Pass. (A52 Full Bench Only-Incl. Latch Plate for Center Position)	Repl. Only - No Insp. Req'd.	12477768	-
GMC	2000	Sonoma	Graphite	121	YK262351	YK276985	Frt RH Pass. (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474640	-
GMC	2000	Sonoma	Beige	641	Y8252997	Y8297377	Driver (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474641	-
GMC	2000	Sonoma	Beige	641	Y8252997	Y8297377	Frt RH Pass. (Bench only)	Repl. Only - No Insp. Req'd.	12477769	-
GMC	2000	Sonoma	Beige	641	YK262351	YK276985	Driver (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474641	-
GMC	2000	Sonoma	Beige	641	YK262351	YK276985	Frt RH Pass. (Bench only)	Repl. Only - No Insp. Req'd.	12477769	-
GMC	2000	Sonoma	Pewter	921	Y8252997	Y8297377	Driver (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474643	-
GMC	2000	Sonoma	Pewter	921	Y8252997	Y8297377	Frt Ctr (AM6 Split Bench only)	Insp. and Repl. if Necessary	12477776	163002
GMC	2000	Sonoma	Pewter	821	Y8252997	Y8297377	Frt RH Pass. (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474644	-
GMC	2000	Sonoma	Pewter	921	YK262351	YK276985	Driver (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474643	-
GMC	2000	Sonoma	Pewter	821	YK262351	YK276985	Frt Ctr (AM6 Split Bench only)	Insp. and Repl. if Necessary	12477776	163002
GMC	2000	Sonoma	Pewter	921	YK262351	YK276985	Frt RH Pass. (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474644	-
GMC	2000	Utility	Graphite	121	Y2358187	Y2381000	Frt Ctr (AM6 Split Bench only)	Insp. and Repl. if Necessary	12477774	157001 163002
GMC	2000	Utility	Graphite	121	Y2358187	Y2381000	Frt RH Pass. Except KA1 Htd. Seat (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474640	-
GMC	2000	Utility	Graphite	121	YK262351	YK276985	Frt Ctr (AM6 Split Bench only)	Insp. and Repl. if Necessary	12477774	157001 163002
GMC	2000	Utility	Graphite	121	YK262351	YK276985	Frt RH Pass. Except KA1 Htd. Seat (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474640	-
GMC	2000	Utility	Beige	641	Y2358187	Y2381000	Driver (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474641	-
GMC	2000	Utility	Beige	641	YK262351	YK276985	Driver (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474641	-

Division	Model Year	Model	Interior Color	Interior Color RPO	Beginning VIN(s)	Ending VIN(s)	Seating Position to Insp./Repl.	Repair Action Req'd.	Service Part No.	Suspect Date Codes
GMC	2000	Utility	Pewter	92I	Y2358187	Y2381000	Driver (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474843	--
GMC	2000	Utility	Pewter	92I	Y2358187	Y2381000	Frt Ctr (AM6 Split Bench only)	Insp. and Repl. if Necessary	12477776	163002
GMC	2000	Utility	Pewter	92I	Y2358187	Y2381000	Frt RH Pass. Except KA1 Htd. Seat (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474844	--
GMC	2000	Utility	Pewter	92I	Y2358187	Y2381000	Frt RH Pass. With KA1 Htd. Seat (Bucket Only)	Repl. Only - No Insp. Req'd.	12474843	--
GMC	2000	Utility	Pewter	92I	YK262351	YK278985	Driver (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474843	--
GMC	2000	Utility	Pewter	92I	YK262351	YK278985	Frt Ctr (AM6 Split Bench only)	Insp. and Repl. if Necessary	12477776	163002
GMC	2000	Utility	Pewter	92I	YK262351	YK278985	Frt RH Pass. Except KA1 Htd. Seat (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474844	--
GMC	2001	Sonoma	Beige	64I	18100015	18100018	Driver (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474841	--
GMC	2001	Sonoma	Beige	64I	18100015	18100018	Frt RH Pass. (A52 Full Bench only)	Repl. Only - No Insp. Req'd.	12477769	--
GMC	2001	Sonoma	Beige	64I	1K100018	1K100036	Driver (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474841	--
GMC	2001	Sonoma	Beige	64I	1K100018	1K100036	Frt RH Pass. (A52 Full Bench only)	Repl. Only - No Insp. Req'd.	12477769	--
GMC	2001	Sonoma	Pewter	92I	18100015	18100018	Driver (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474843	--
GMC	2001	Sonoma	Pewter	92I	18100015	18100018	Frt Ctr (AM6 Split Bench only)	Insp. and Repl. if Necessary	12477776	163002
GMC	2001	Sonoma	Pewter	92I	18100015	18100018	Frt RH Pass. (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474844	--
GMC	2001	Sonoma	Pewter	92I	1K100018	1K100036	Driver (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474843	--
GMC	2001	Sonoma	Pewter	92I	1K100018	1K100036	Frt Ctr (AM6 Split Bench only)	Insp. and Repl. if Necessary	12477776	163002
GMC	2001	Sonoma	Pewter	92I	1K100018	1K100036	Frt RH Pass. (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474844	--
GMC	2001	Utility	Graphite	12I	12100021	12100021	Frt Ctr (AM6 Split Bench only)	Insp. and Repl. if Necessary	12477774	157001 163002
GMC	2001	Utility	Graphite	12I	12100021	12100021	Frt RH Pass. Except KA1 Htd. Seat (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474840	--

Division	Model Year	Model	Interior Color	Interior Color RPO	Beginning VIN(s)	Ending VIN(s)	Seating Position to Insp./Repl.	Repair Action Req'd.	Service Part No.	Suspect Date Codes
GMC	2001	Utility	Graphite	121	1K100018	1K100036	Frt Ctr (AM6 Split Bench only)	Insp. and Repl. if Necessary	12477774	157001 183002
GMC	2001	Utility	Graphite	121	1K100018	1K100036	Frt RH Pass. Except KA1 Htd. Seat (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474640	-
GMC	2001	Utility	Belge	641	12100021	12100021	Driver (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474641	-
GMC	2001	Utility	Belge	641	1K100018	1K100036	Driver (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474641	-
GMC	2001	Utility	Pewter	921	12100021	12100021	Driver (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474643	-
GMC	2001	Utility	Pewter	921	12100021	12100021	Frt Ctr (AM6 Split Bench only)	Insp. and Repl. if Necessary	12477776	183002
GMC	2001	Utility	Pewter	921	12100021	12100021	Frt RH Pass. Except KA1 Htd. Seat (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474644	-
GMC	2001	Utility	Pewter	921	12100021	12100021	Frt RH Pass. With KA1 Htd. Seat (Bucket Only)	Repl. Only - No Insp. Req'd.	12474643	-
GMC	2001	Utility	Pewter	921	1K100018	1K100036	Driver (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474643	-
GMC	2001	Utility	Pewter	921	1K100018	1K100036	Frt Ctr (AM6 Split Bench only)	Insp. and Repl. if Necessary	12477776	183002
GMC	2001	Utility	Pewter	921	1K100018	1K100036	Frt RH Pass. Except KA1 Htd. Seat (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474644	-
Oldsmobile	2000	Intrigue	Grey	141	YF295906	YF302197	Rear (all)	Insp. and Repl. if Necessary	88894565	161002
Oldsmobile	2000	Intrigue	Grey	141	YF302209	YF318652	Frt RH Pass.	Repl. Only - No Insp. Req'd.	88896432	-
Oldsmobile	2000	Intrigue	Grey	141	YF302209	YF318652	Rear (all)	Insp. and Repl. if Necessary	88894565	161002
Oldsmobile	2000	Intrigue	Neutral	521	YF295906	YF302197	Rear (all)	Insp. and Repl. if Necessary	88894565	145002 145003 145004 145005 145006 145007 145008 145009 145010 145011 145012 145013

Division	Model Year	Model	Interior Color	Interior Color RPO	Beginning VIN(s)	Ending VIN(s)	Seating Position to Insp./Repl.	Repair Action Req'd.	Service Part No.	Suspect Date Codes
Oldsmobile	2000	Intrigue	Neutral	52I	YF302209	YF318652	Frt RH Pass.	Repl. Only - No Insp. Req'd.	88896434	-
Oldsmobile	2000	Intrigue	Neutral	52I	YF302209	YF318652	Rear (all)	Insp. and Repl. if Necessary	88894586	145002 145003 145004 145005 145006 145007 145008 145009 145010 145011 145012 145013
Oldsmobile	2000	Intrigue	Beige	64I	YF295908	YF302197	Rear (all)	Insp. and Repl. if Necessary	12369754	154001 154002 154003 162003
Oldsmobile	2000	Intrigue	Beige	64I	YF302209	YF318652	Driver	Repl. Only - No Insp. Req'd.	88895089	-
Oldsmobile	2000	Intrigue	Beige	64I	YF302209	YF318652	Frt RH Pass.	Repl. Only - No Insp. Req'd.	88895102	-
Oldsmobile	2000	Intrigue	Beige	64I	YF302209	YF318652	Rear (all)	Insp. and Repl. if Necessary	12369754	154001 154002 154003 162003

Division	Model Year	Model	Interior Color	Interior Color RPO	Beginning VIN(s)	Ending VIN(s)	Seating Position to Insp./Repl.	Repair Action Req'd.	Service Part No.	Suspect Date Codes
Oldsmobile	2000	Silhouette	Grey	14I	YD315175	YD337287	Driver	Insp. and Repl. if Necessary	12457479	135002 158001 158002 157001 157002 181002
Oldsmobile	2000	Silhouette	Grey	14I	YD315175	YD337287	Frt RH Pass.	Insp. and Repl. if Necessary	12457483	136001 136002 141002 142001 182001
Oldsmobile	2000	Silhouette	Grey	14I	YD315175	YD337287	2nd Row 60/40 Bench RH (AT5)	Insp. and Repl. if Necessary	88896093	154001 181002
Oldsmobile	2000	Silhouette	Grey	14I	YD315175	YD337287	2nd Row Capt. Chair LH and RH	Repl. Only - No Insp. Req'd.	12531150	-
Oldsmobile	2000	Silhouette	Grey	14I	YD315175	YD337287	3rd Row AM9 Split Bench (all)	Insp. and Repl. if Necessary	88894863	145008 154001 154002 154003 181002 182001 182003
Oldsmobile	2000	Silhouette	Grey	14I	YD315175	YD337287	3rd Row Capt. Chair LH and RH	Repl. Only - No Insp. Req'd.	12531150	-
Oldsmobile	2000	Silhouette	Neutral	52I	YD315175	YD337287	2nd Row 60/40 Bench RH (AT5)	Insp. and Repl. if Necessary	88895094	181002
Oldsmobile	2000	Silhouette	Neutral	52I	YD315175	YD337287	3rd Row AM9 Split Bench (all)	Insp. and Repl. if Necessary	88894864	151001 181007
Oldsmobile	2000	Silhouette	Beige	84I	YD315175	YD337287	Frt RH Pass.	Insp. and Repl. if Necessary	12457486	157002 181001 181002
Oldsmobile	2000	Silhouette	Beige	84I	YD315175	YD337287	2nd Row 60/40 Bench RH (AT5)	Insp. and Repl. if Necessary	88895095	181002
Oldsmobile	2000	Silhouette	Beige	84I	YD315175	YD337287	2nd Row Capt. Chair LH and RH	Repl. Only - No Insp. Req'd.	88894671	-
Oldsmobile	2000	Silhouette	Beige	84I	YD315175	YD337287	3rd Row AM9 Split Bench (all)	Insp. and Repl. if Necessary	12459820	181002
Oldsmobile	2000	Silhouette	Beige	84I	YD315175	YD337287	3rd Row Capt. Chair LH and RH	Repl. Only - No Insp. Req'd.	88894671	-
Oldsmobile	2000	Utility	Graphite	12I	Y2357182	Y2381008	Frt Ctr (AM6 Split Bench only)	Insp. and Repl. if Necessary	12477774	157001 183002
Oldsmobile	2000	Utility	Graphite	12I	Y2357182	Y2381008	Frt RH Pass. Except KA1 Htd. Seat (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474640	-

Division	Model Year	Model	Interior Color	Interior Color RPO	Beginning VIN(s)	Ending VIN(s)	Seating Position to Insp./Repl.	Repair Action Req'd.	Service Part No.	Suspect Date Codes
Oldsmobile	2000	Utility	Beige	64I	Y2357182	Y2381008	Driver (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474641	-
Oldsmobile	2000	Utility	Pewter	92I	Y2357182	Y2381008	Driver (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474643	-
Oldsmobile	2000	Utility	Pewter	92I	Y2357182	Y2381008	Frt Ctr (AM6 Split Bench only)	Insp. and Repl. If Necessary	12477776	163002
Oldsmobile	2000	Utility	Pewter	92I	Y2357182	Y2381008	Frt RH Pass. Except KA1 Htd. Seat (Bkt or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474644	-
Oldsmobile	2000	Utility	Pewter	92I	Y2357182	Y2381008	Frt RH Pass. With KA1 Htd. Seat (Bucket Only)	Repl. Only - No Insp. Req'd.	12474643	-
Oldsmobile	2001	Intrigue	Grey	14I	1F100031	1F100046	Frt RH Pass.	Repl. Only - No Insp. Req'd.	8889432	-
Oldsmobile	2001	Intrigue	Grey	14I	1F100031	1F100046	Rear (all)	Insp. and Repl. If Necessary	88894565	161002
Oldsmobile	2001	Intrigue	Neutral	52I	1F100031	1F100046	Frt RH Pass.	Repl. Only - No Insp. Req'd.	8889434	-
Oldsmobile	2001	Intrigue	Neutral	52I	1F100031	1F100046	Rear (all)	Insp. and Repl. If Necessary	88894566	145002 145003 145004 145005 145006 145007 145008 145009 145010 145011 145012 145013
Oldsmobile	2001	Intrigue	Beige	64I	1F100031	1F100046	Driver	Repl. Only - No Insp. Req'd.	88895099	-
Oldsmobile	2001	Intrigue	Beige	64I	1F100031	1F100046	Frt RH Pass.	Repl. Only - No Insp. Req'd.	88895102	-
Oldsmobile	2001	Intrigue	Beige	64I	1F100031	1F100046	Rear (all)	Insp. and Repl. If Necessary	12369754	154001 154002 154003 162003

Division	Model Year	Model	Interior Color	Interior Color RPO	Beginning VIN(s)	Ending VIN(s)	Seating Position to Insp./Repl.	Repair Action Req'd.	Service Part No.	Suspect Data Codes
Oldsmobile	2001	Silhouette	Grey	14I	1D100003	1D100064	Driver	Insp. and Repl. if Necessary	12457479	135002 156001 156002 157001 157002 161002
Oldsmobile	2001	Silhouette	Grey	14I	1D100003	1D100064	Frnt RH Pass.	Insp. and Repl. if Necessary	12457483	136001 136002 141002 142001 162001
Oldsmobile	2001	Silhouette	Grey	14I	1D100003	1D100064	2nd Row 60/40 Bench RH (AT5)	Insp. and Repl. if Necessary	88895093	154001 161002
Oldsmobile	2001	Silhouette	Grey	14I	1D100003	1D100064	2nd Row Capt. Chair LH and RH	Repl. Only - No Insp. Req'd.	12531150	-
Oldsmobile	2001	Silhouette	Grey	14I	1D100003	1D100064	3rd Row AM9 Split Bench (all)	Insp. and Repl. if Necessary	88894663	145009 154001 154002 154003 161002 162001 162003
Oldsmobile	2001	Silhouette	Grey	14I	1D100003	1D100064	3rd Row Capt. Chair LH and RH	Repl. Only - No Insp. Req'd.	12531150	-
Oldsmobile	2001	Silhouette	Neutral	52I	1D100003	1D100064	2nd Row 60/40 Bench RH (AT5)	Repl. Only - No Insp. Req'd.	88896434	-
Oldsmobile	2001	Silhouette	Neutral	52I	1D100003	1D100064	3rd Row AM9 Split Bench (all)	Insp. and Repl. if Necessary	88894664	151001 151007
Oldsmobile	2001	Silhouette	Beige	64I	1D100003	1D100064	Frnt RH Pass.	Insp. and Repl. if Necessary	12457486	157002 161001 161002
Oldsmobile	2001	Silhouette	Beige	64I	1D100003	1D100064	2nd Row 60/40 Bench RH (AT5)	Insp. and Repl. if Necessary	88895095	161002
Oldsmobile	2001	Silhouette	Beige	64I	1D100003	1D100064	2nd Row Capt. Chair LH and RH	Repl. Only - No Insp. Req'd.	88894671	-
Oldsmobile	2001	Silhouette	Beige	64I	1D100003	1D100064	3rd Row AM9 Split Bench (all)	Insp. and Repl. if Necessary	12459820	161002
Oldsmobile	2001	Silhouette	Beige	64I	1D100003	1D100064	3rd Row Capt. Chair LH and RH	Repl. Only - No Insp. Req'd.	88894671	-
Oldsmobile	2001	Utility	Graphite	12I	12100020	12100024	Frnt Ctr (AM6 Split Bench only)	Insp. and Repl. if Necessary	12477774	157001 163002
Oldsmobile	2001	Utility	Graphite	12I	12100020	12100024	Frnt RH Pass. Except KA1 Htd. Seat (Bkl or AM6 Split Bench)	Repl. Only - No Insp. Req'd.	12474640	-

Division	Model Year	Model	Interior Color	Interior Color RPO	Beginning VIN(s)	Ending VIN(s)	Seating Position to Insp./Repl.	Repair Action Req'd.	Service Part No.	Suspect Date Codes
Oldsmobile	2001	Utility	Beige	64I	12100020	12100024	Driver (Bkt or AM8 Split Bench)	Repl. Only - No Insp. Req'd.	12474641	-
Oldsmobile	2001	Utility	Pewter	92I	12100020	12100024	Driver (Bkt or AM8 Split Bench)	Repl. Only - No Insp. Req'd.	12474643	-
Oldsmobile	2001	Utility	Pewter	92I	12100020	12100024	Frt Ctr (AM8 Split Bench only)	Insp. and Repl. if Necessary	12477776	163002
Oldsmobile	2001	Utility	Pewter	92I	12100020	12100024	Frt RH Pass. Except KA1 Htd. Seat (Bkt or AM8 Split Bench)	Repl. Only - No Insp. Req'd.	12474644	-
Oldsmobile	2001	Utility	Pewter	92I	12100020	12100024	Frt RH Pass. With KA1 Htd. Seat (Bucket Only)	Repl. Only - No Insp. Req'd.	12474643	-
Pontiac	2000	Gr. Prtx	Grph/Char	12V17I	YF301133	YF302181	Rear (all)	Insp. and Repl. if Necessary	88894563	154001 154002
Pontiac	2000	Gr. Prtx	Grph/Char	12V17I	YF302183	YF318654	Driver	Repl. Only - No Insp. Req'd.	8889429	-
Pontiac	2000	Gr. Prtx	Grph/Char	12V17I	YF302183	YF318654	Frt RH Pass.	Repl. Only - No Insp. Req'd.	8889430	-
Pontiac	2000	Gr. Prtx	Grph/Char	12V17I	YF302183	YF318654	Rear (all)	Insp. and Repl. if Necessary	88894563	154001 154002
Pontiac	2000	Gr. Prtx	Neutral	52I	YF301133	YF302181	Rear (all)	Insp. and Repl. if Necessary	12369754	154001 154002 154003 162003
Pontiac	2000	Gr. Prtx	Neutral	52I	YF302183	YF318654	Driver	Repl. Only - No Insp. Req'd.	88895099	-
Pontiac	2000	Gr. Prtx	Neutral	52I	YF302183	YF318654	Frt RH Pass.	Repl. Only - No Insp. Req'd.	88895102	-
Pontiac	2000	Gr. Prtx	Neutral	52I	YF302183	YF318654	Rear (all)	Insp. and Repl. if Necessary	12369754	154001 154002 154003 162003

Division	Model Year	Model	Interior Color	Interior Color RPO	Beginning VIN(s)	Ending VIN(s)	Seating Position to Insp./Repl.	Repair Action Req'd.	Service Part No.	Suspect Date Codes
Pontiac	2000	Montana	Grey	141	YD309842	YD339845	Driver	Insp. and Repl. if Necessary	12457479	135002 158001 158002 157001 157002 161002
Pontiac	2000	Montana	Grey	141	YD309842	YD339845	Frt RH Pass.	Insp. and Repl. if Necessary	12457483	138001 138002 141002 142001 162001
Pontiac	2000	Montana	Grey	141	YD309842	YD339845	2nd Row 60/40 Bench RH (AT5)	Insp. and Repl. if Necessary	88895093	154001 161002
Pontiac	2000	Montana	Grey	141	YD309842	YD339845	2nd Row Capt. Chair LH and RH	Repl. Only - No Insp. Req'd.	12531150	-
Pontiac	2000	Montana	Grey	141	YD309842	YD339845	3rd Row AM9 Split Bench (all)	Insp. and Repl. if Necessary	88894663	145009 154001 154002 154003 161002 162001 162003
Pontiac	2000	Montana	Grey	141	YD309842	YD339845	3rd Row Capt. Chair LH and RH	Repl. Only - No Insp. Req'd.	12531150	-
Pontiac	2000	Montana	Neutral	521	YD309842	YD339845	2nd Row 60/40 Bench RH (AT5)	Insp. and Repl. if Necessary	88895094	161002
Pontiac	2000	Montana	Neutral	521	YD309842	YD339845	3rd Row AM9 Split Bench (all)	Insp. and Repl. if Necessary	88894664	151001 151007
Pontiac	2000	Montana	Beige	641	YD309842	YD339845	Frt RH Pass.	Insp. and Repl. if Necessary	12457486	157002 161001 161002
Pontiac	2000	Montana	Beige	641	YD309842	YD339845	2nd Row 60/40 Bench RH (AT5)	Insp. and Repl. if Necessary	88895095	161002
Pontiac	2000	Montana	Beige	641	YD309842	YD339845	2nd Row Capt. Chair LH and RH	Repl. Only - No Insp. Req'd.	88894671	-
Pontiac	2000	Montana	Beige	641	YD309842	YD339845	3rd Row Capt. Chair LH and RH	Repl. Only - No Insp. Req'd.	88894671	-

Division	Model Year	Model	Interior Color	Interior Color RPO	Beginning VIN(s)	Ending VIN(s)	Seating Position to Insp./Repl.	Repair Action Req'd.	Service Part No.	Suspect Data Codes
Pontiac	2001	Gr. Prix	Grph/Char	12I/17I	1F100033	1F100046	Driver	Repl. Only - No Insp. Req'd.	88896429	--
Pontiac	2001	Gr. Prix	Grph/Char	12I/17I	1F100033	1F100046	Frt RH Pass.	Repl. Only - No Insp. Req'd.	88896430	--
Pontiac	2001	Gr. Prix	Grph/Char	12I/17I	1F100033	1F100046	Rear (all)	Insp. and Repl. if Necessary	88894563	154001 154002
Pontiac	2001	Gr. Prix	Neutral	52I	1F100033	1F100046	Driver	Repl. Only - No Insp. Req'd.	88895099	--
Pontiac	2001	Gr. Prix	Neutral	52I	1F100033	1F100046	Frt RH Pass.	Repl. Only - No Insp. Req'd.	88895102	--
Pontiac	2001	Gr. Prix	Neutral	52I	1F100033	1F100046	Rear (all)	Insp. and Repl. if Necessary	12388754	154001 154002 154003 162003
Pontiac	2001	Montana	Grey	14I	1D100004	1D100081	Driver	Insp. and Repl. if Necessary	12457479	135002 156001 156002 157001 157002 161002
Pontiac	2001	Montana	Grey	14I	1D100004	1D100081	Frt RH Pass.	Insp. and Repl. if Necessary	12457483	136001 136002 141002 142001 162001
Pontiac	2001	Montana	Grey	14I	1D100004	1D100081	2nd Row 60/40 Bench RH (AT5)	Insp. and Repl. if Necessary	88895093	154001 161002
Pontiac	2001	Montana	Grey	14I	1D100004	1D100081	2nd Row Capt. Chair LH and RH	Repl. Only - No Insp. Req'd.	12531150	--
Pontiac	2001	Montana	Grey	14I	1D100004	1D100081	3rd Row AM9 Split Bench (all)	Insp. and Repl. if Necessary	88894663	145009 154001 154002 154003 161002 162001 162003
Pontiac	2001	Montana	Grey	14I	1D100004	1D100081	3rd Row Capt. Chair LH and RH	Repl. Only - No Insp. Req'd.	12531150	--

Division	Model Year	Model	Interior Color	Interior Color RPO	Beginning VIN(s)	Ending VIN(s)	Seating Position to Insp./Repl.	Repair Action Req'd.	Service Part No.	Suspect Date Codes
Pontiac	2001	Montana	Neutral	52I	1D100004	1D100081	2nd Row 60/40 Bench RH (AT5)	Insp. and Repl. if Necessary	88895094	161002
Pontiac	2001	Montana	Neutral	52I	1D100004	1D100081	3rd Row AM9 Split Bench (all)	Insp. and Repl. if Necessary	88894664	151001 151007
Pontiac	2001	Montana	Beige	64I	1D100004	1D100081	Frt RH Pass.	Insp. and Repl. if Necessary	12457498	157002 161001 161002
Pontiac	2001	Montana	Beige	64I	1D100004	1D100081	2nd Row 60/40 Bench RH (AT5)	Insp. and Repl. if Necessary	88895095	161002
Pontiac	2001	Montana	Beige	64I	1D100004	1D100081	2nd Row Capt. Chair LH and RH	Repl. Only - No Insp. Req'd.	88894671	-
Pontiac	2001	Montana	Beige	64I	1D100004	1D100081	3rd Row Capt. Chair LH and RH	Repl. Only - No Insp. Req'd.	88894671	-

May, 2001

Dear Chevrolet S-10 / GMC Sonoma Customer:

General Motors recently notified you regarding a campaign involving the inspection and possible replacement of seat belt buckles on your vehicle. Upon further investigation, we have determined that your vehicle was not built with any suspect part(s), and does not need to be included in this campaign.

If you have already had your vehicle serviced under this campaign, we apologize for any inconvenience our error may have caused you.

If you have not yet had your vehicle serviced for this campaign, no further action is necessary. We apologize if this error has caused you any concern regarding the integrity of the safety belts in your vehicle.

If you have any questions regarding this matter, please contact the appropriate Customer Assistance Center at the listed number below:

Division	Number	Deaf, Hearing Impaired or Speech Impaired *
Chevrolet	1-800-222-1020	1-800-833-2438
GMC	1-800-462-8782	1-800-462-8583
GMODC	(805) 644-4112	
Puerto Rico - English	1-800-496-9992	
Puerto Rico - Español	1-800-496-9993	
Virgin Islands	1-800-496-9994	

* Utilizes Telecommunication Devices for the Deaf/Text Telephones (TDD/TTY)

We are sorry for this inconvenience; however, we have taken this action in the interest of your safety and continued satisfaction with our products.

General Motors Corporation

Enclosure

(SUGGESTED DEALER LETTER)

We recently notified you regarding a campaign involving the inspection and possible replacement of seat belt buckles on your vehicle. Upon further investigation, General Motors has determined that your vehicle was not built with any suspect part(s), and does not need to be included in this campaign.

If you have already had your vehicle serviced under this campaign, we apologize for any inconvenience our error may have caused you.

If you have not yet had your vehicle serviced for this campaign, no further action is necessary. We apologize if this error has caused you any concern regarding the integrity of the safety belts in your vehicle.

We are sorry for this inconvenience; however, we have taken this action in the interest of your safety and continued satisfaction with our products.

GMODC
General Motors Corporation

00067B

/s/

RECEIVED
00 OCT 17 AM 10:12
OFFICE
DEFECTS INVESTIGATION



JAGUAR
JAGUAR NORTH AMERICA, INC.
300 BROADWAY, JEFFERSON CITY, MO 64101
TEL: 816.251.2000 FAX: 816.251.2001
WWW.JAGUAR.COM

10 October 2000

Mr. Jonathan White, Chief
Recall Analysis Division
National Highway Traffic Safety Administration
US Department of Transportation
400 Seventh Street S.W.
Washington, D.C. 20590

RE: 00V-228-004
Jaguar Recall R134

Dear Mr. White:

The attached pages provide you with items covered by 49CFR
Part 573.5(c)9:

- Owner letter – sent to RL Polk week of 10 October for mailing to owners
- Dealer letter, a copy of the owner letter, and the technical service bulletin
- To be mailed to dealers week of 17 October

As further information becomes available, we will provide you with copies in a timely manner.

Attached: Owner letter
Dealer letter
Technical Service Bulletin

Sincerely yours,

C. Dianne Black-Nixon
C. Dianne Black-Nixon, Manager
Product Legislation and Compliance



JAGUAR CARS
111 NEW WATFORD ROAD
AVONDALE, NEW JERSEY 07001
TEL: 908.641.7000
FAX: 908.641.9700

October 9, 2000

Dear Jaguar Owner:

This notice is sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act.

As a result of ongoing quality assessments, Jaguar Cars has identified a defect on a small number of S-TYPE vehicles involving the Front Safety Belt Buckle Assembly.

Jaguar has voluntarily decided to recall affected vehicles to inspect and replace, if required, both front safety belt buckle assemblies on S-TYPE vehicles produced between May 4th and July 19th, 2000, including your vehicle.

On the vehicles involved, it is possible that the latching mechanism within the front safety belt buckle assemblies may not have received sufficient heat treatment during the production process. As a result, the component may not be adequately hardened. Under loads in excess of the Federal Motor Vehicle Safety Standard 209 – Seat Belt Assemblies, the part could deform and release the latch that holds the safety belt tongue.

For your personal safety and that of your passengers, we would ask that you arrange for the belt buckle inspection as soon as possible. Labor time to inspect or replace the front seat buckles is approximately 1 hour; however, to accommodate service scheduling, your dealer may require your car for the day. All replacement Front Safety Belt Buckle Assemblies will be replaced Free of Charge by Jaguar Franchised Dealers.

Should your dealer be unable or unwilling to repair your Jaguar within 60 days or a reasonable time, we would ask you to contact the Jaguar Customer Assistance Center at 1 800 4 JAGUAR. In the event you are still not satisfied, you may submit a complaint to the Administrator, National Highway Traffic Safety Administration, 400 Seventh Street S.W., Washington, D.C. 20590, or call the toll free Auto Safety Hotline at 1-800-424-9393; Washington D.C. area residents may call (202) 366-0123.

Sincerely yours,

Gary L. Temple
Vice President Customer Care

GLT/tml



JAGUAR CARS
555 NEW ARTHUR BOULEVARD
MAHWAH, NEW JERSEY 07430-2127
TELEPHONE: (201) 818-0300
FAX: (201) 818-9270

October 3, 2000

To All Jaguar Dealer Principals & Service Managers:

As a result of ongoing quality assessments, we have identified a defect on a number of S-TYPE vehicles within the VIN range of L73665-L85960.

On the vehicles involved, it is possible that the latching mechanism within the front safety belt buckle assembly may not have received sufficient heat treatment during the production process. As a result, the component may not be adequately hardened. Under extreme load, the part could deform and release the latch that holds the safety belt tongue.

There have been no instances of failure involving production vehicles. This issue will not affect the drivability of the vehicle and no other restraint systems on the vehicle are involved.

We have taken the decision to recall affected vehicles to check and replace, where necessary, the front safety belt buckle assemblies on all S-TYPE vehicles produced between the VIN ranges mentioned in paragraph one of this letter.

Vehicles from VIN L73665 to L78262 will require the front safety belt buckle assemblies to be checked for a date code. If one or both of the front safety belt buckle assemblies are stamped with a date code that falls within the affected date code range then both front safety belt buckle assemblies should be replaced.

Vehicles from VIN L78263 to L85960 do not require the date code check, but should instead have both front safety belt buckle assemblies replaced.

A number of vehicles have been reworked at the factory prior to dispatch. The vehicles that have been reworked are listed in the technical bulletin and do not require any further action.

We are writing to all affected customers in the USA, Canada, and Mexico within the next 14 days requesting them to contact their nearest authorized dealer as soon as possible to arrange for the front safety belt buckle assemblies to be checked and replaced if necessary. (A copy of this letter is attached as well as a preliminary draft copy of the technical bulletin.)

Parts Information: A partial allotment of replacement seat belt buckles will be shipped directly to you based on the color/trim specification of the vehicles allocated to your dealership within the specified VIN range. After you receive this initial shipment, you may order additional quantities required through normal channels.

Sincerely,

Gary Temple
Vice President Customer Care

GLT/tml

Enclosures

**S-TYPE**

DATE 10/00

S501-R134

SERVICE

TECHNICAL BULLETIN**Recall R134 –
Front Seat Belt Buckle –
Replace With Proper Specification Buckle**MODEL 2000-01 MY
S-TYPE

VIN L73665-L85960

Issue:

As a result of ongoing quality assessments, Jaguar has identified a defect on a number of S-TYPE vehicles within the above VIN range of L73665-L85960.

On the vehicles involved, it is possible that the latching mechanism within the front safety belt buckle assembly may not have received sufficient heat treatment during the production process. As a result, the component may not be adequately hardened. Under extreme load, the part could deform and release the latch that holds the safety belt tongue.

There have been no instances of failure involving production vehicles. This issue will not affect the drivability of the vehicle and no other restraint systems on the vehicle are involved.

Jaguar has decided to recall affected vehicles to check and replace, where necessary, the front safety belt buckle assemblies on all S-TYPE vehicles produced in the above VIN range.

Vehicles from VIN L73665 to L78262 will require a check of the date code on the front safety belt buckle assemblies. If one or both of the front safety belt buckle assemblies are stamped with a date code that falls within the affected date code range then both front safety belt buckle assemblies should be replaced.

Vehicles from VIN L78263 to L85960 do not require the date code check, but will instead have both front safety belt buckle assemblies replaced.

A number of vehicles have been reworked at the factory before being shipped. The vehicles that have been reworked are listed in this bulletin and do not require any further action.

Jaguar is contacting all affected customers requesting them to contact their nearest Dealer as soon as possible to arrange for the front safety belt buckle assemblies to be checked and replaced if necessary.

Action:

PROCEDURE FOR VEHICLES VIN L73665 TO L78262

On vehicles equipped with a soft plastic cover protecting the front safety belt buckle assembly it is possible to check the date stamp (see table) without removing the seat. Follow the workshop procedure below for vehicles equipped with this type of front safety belt buckle assembly.

The six-digit date code is interpreted as follows:

Example: *ABCDEX*.

AB = Week Number (i.e. 01-52)

C = Day number (i.e. Monday = 1)

DE = Year (i.e. 00 = 2000)

X = Shift Number (i.e. 1,2,3)

Affected date codes:

13200X	13300X	13400X	13500X	13600X
13700X	14200X	15300X	15700X	16200X
17100X	17200X	17300X	17400X	17500X

CHECK CODE PROCEDURE

1. Open both front doors.
2. Push back the soft plastic cover on the front safety belt buckle for access to the buckle code. (See Illustration 1).

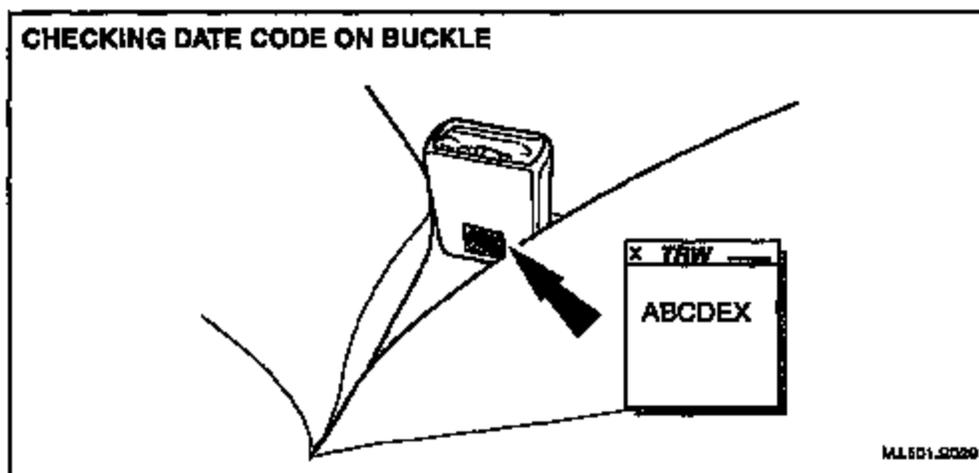


ILLUSTRATION 1

3. Check and record the buckle code against the affected codes provided in the table. Ensure the code is safe.

4. Reposition the front safety belt buckle soft plastic cover to its original condition.
 5. Repeat the procedure for the opposite side safety belt.
- If one buckle code is not safe, both front safety belt buckle assemblies must be replaced.

PROCEDURE TO REPLACE FRONT SAFETY BELT BUCKLE ASSEMBLY

1. At the driver side of the vehicle, position the front seat fully rearward and the front of the cushion fully upward.
2. Reposition the floor carpet flaps for access to the front bolts that secure the front seat to the body.
3. Loosen and remove the front bolts that secure the front seat to the body.
4. Reposition the front seat fully forward.
5. Displace and remove the front seat slide rear inner and outer plastic covers.
6. Loosen and remove the rear bolts that secure front seat to the body.
7. Place a clean protective covering over the rear door opening tread plate area to protect the front seat.
8. Carefully reposition the front seat for access to the seat harness connector.

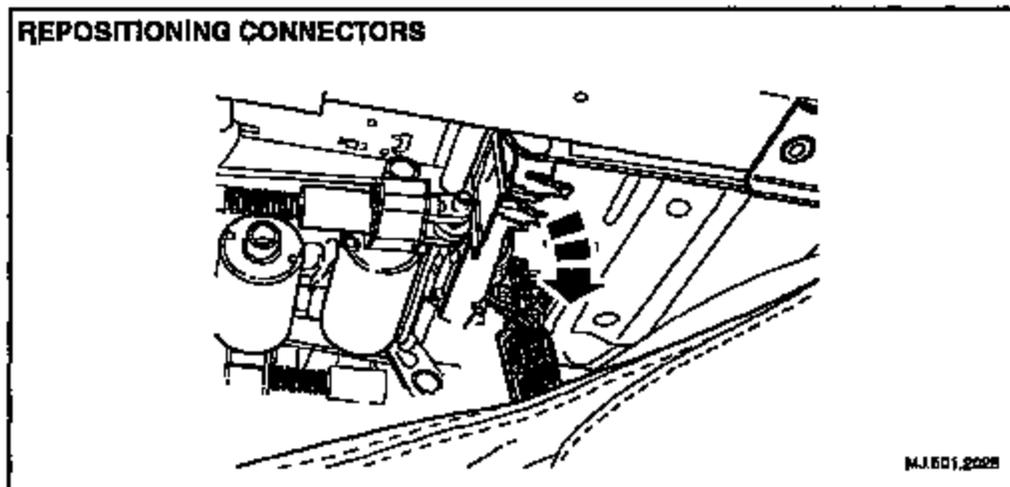


ILLUSTRATION 2

9. Remove the seat harness connectors from their seat frame mounting tangs (Illustration 2). Do not unplug the connector.

Note: To eliminate the need to disconnect the battery, ensure the connectors remain connected.

The previous operation is required to allow harness more free play when maneuvering the front seat (Illustration 2)

10. Pull the front safety belt against spring tension to gain more slack to assist front seat maneuverability.

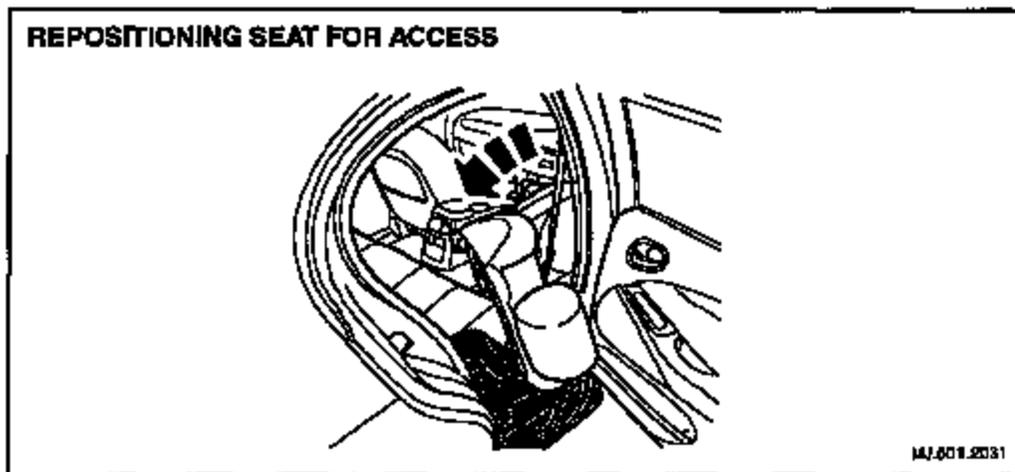


ILLUSTRATION 3

11. Carefully reposition front seat on its side for access to the safety belt buckle. During this operation, the seat back protrudes through the rear door opening. (Illustration 3).

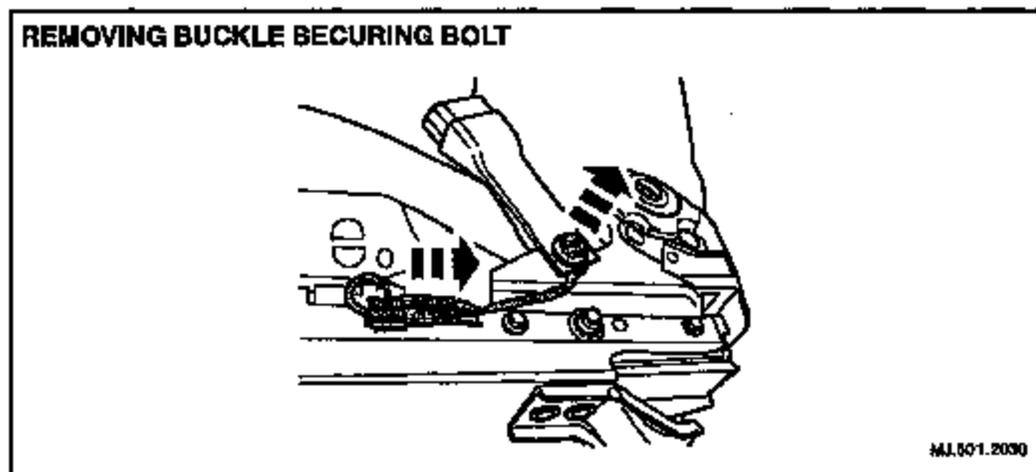


ILLUSTRATION 4

12. Disconnect the front safety belt buckle assembly connector. Loosen and remove the bolt securing the front safety belt buckle. Remove the safety belt buckle assembly and place to one side. (Illustration 4).
13. Install the new safety belt buckle on the front seat – ensure that the buckle lug locates correctly in the seat frame hole.
14. Tighten the new securing bolt for the front safety belt buckle to 40 Nm (29 lb. ft.)
15. Connect the front safety belt buckle connector.
16. Reposition the front seat upright.
17. Engage and seat the front seat harness connectors on their seat frame mounting tangs.
18. Reposition and align the front seat with the body.
19. Remove the protective covering from the rear door opening tread plate area.
20. Install, but do not fully tighten, the rear bolts that secure front seat to the body.

21. Reposition front seat fully rearwards.
22. Tighten the front bolts that secures the front seat to the body to 40 Nm (29 lb. ft.).
23. Reposition the floor carpet flaps in their original location.
24. Reposition the front seat fully forward.
25. Tighten the rear bolts that secure the front seat to the body to 47 Nm (34 lb. ft.)
26. Install the rear inner and outer plastic covers on the front seat slide.
27. Return the front seat to its original position.
28. Repeat procedure for the passenger side front safety belt buckle assembly.

For vehicles from VIN L78263 to L85960, follow the procedure to replace the front safety belt buckle assembly.

Repeat procedure for the opposite side front safety belt buckle assembly.

VEHICLES NOT AFFECTED BY THIS RECALL

The following Vehicles were reworked at the factory before being shipped and therefore do **not** require the Recall Action.

Note: No Mexican specification vehicles were reworked at the factory.

CANADIAN VEHICLES		Model	
Model		Code	VIN
Code	VIN		
6100	L85032	6100	L85608
6100	L85177	6100	L85612
6100	L85239	6100	L85624
6100	L85317	6100	L85637
6100	L85397	6100	L85645
6100	L85405	6100	L85649
6100	L85413	6100	L85654
6100	L85417	6100	L85659
6100	L85442	6100	L85663
6100	L85457	6100	L85692
6100	L85462	6100	L85710
6100	L85466	6100	L85715
6100	L85490	6100	L85720
6100	L85495	6100	L85725
6100	L85499	6100	L85735
6100	L85510	6100	L85739
6100	L85542	6100	L85744
6100	L85552	6100	L85759
6100	L85579	6100	L85765
6100	L85587	6100	L85775
6100	L85600	6100	L85778
		6100	L85783

Model Code	VIN
6100	L85787
6100	L85792
6100	L85796
6100	L85800
6100	L85805
6100	L85817
6100	L85823
6100	L85836
6100	L85852
6100	L85862
6100	L85867
6100	L85872
6100	L85876
6100	L85885
6100	L85895
6100	L85910
6100	L85915
6100	L85921
6100	L85937
6100	L85950
6300	L85296
6300	L85371
6300	L85389
6300	L85425
6300	L85429
6300	L85438
6300	L85478
6300	L85487
6300	L85505
6300	L85514
6300	L85518
6300	L85523
6300	L85527
6300	L85531
6300	L85558
6300	L85567
6300	L85571
6300	L85592
6300	L85596
6300	L85604
6300	L85616
6300	L85620
6300	L85629

Model Code	VIN
6300	L85641
6300	L85669
6300	L85674
6300	L85678
6300	L85683
6300	L85687
6300	L85696
6300	L85731
6300	L85749
6300	L85754
6300	L85771
6300	L85829
6300	L85843
6300	L85847
6300	L85856
6300	L85881
6300	L85891
6300	L85900
6300	L85905
6300	L85927
6300	L85931
6300	L85954

USA VEHICLES

Model	
Code	VIN
6100	L75917
6100	L81290
6100	L84980
6100	L84642
6100	L84797
6100	L84897
6100	L85026
6100	L85027
6100	L85116
6100	L85125
6100	L85187
6100	L85217
6100	L85302
6100	L85307
6100	L85392
6100	L85395
6100	L85399



Model Code	VIN
6100	L85415
6100	L85424
6100	L85441
6100	L85455
6100	L85459
6100	L85463
6100	L85472
6100	L85473
6100	L85476
6100	L85486
6100	L85493
6100	L85503
6100	L85504
6100	L85513
6100	L85515
6100	L85517
6100	L85520
6100	L85528
6100	L85537
6100	L85559
6100	L85560
6100	L85566
6100	L85568
6100	L85572
6100	L85574
6100	L85595
6100	L85597
6100	L85599
6100	L85603
6100	L85615
6100	L85623
6100	L85630
6100	L85632
6100	L85635
6100	L85640
6100	L85655
6100	L85662
6100	L85664
6100	L85670
6100	L85694
6100	L85699
6100	L85703
6100	L85726

Model Code	VIN
6100	L85728
6100	L85743
6100	L85747
6100	L85750
6100	L85753
6100	L85756
6100	L85757
6100	L85774
6100	L85777
6100	L85782
6100	L85812
6100	L85830
6100	L85840
6100	L85859
6100	L85873
6100	L85875
6100	L85886
6100	L85894
6100	L85897
6100	L85934
6100	L85956
6100	L85957
6300	L81289
6300	L81292
6300	L85029
6300	L85074
6300	L85154
6300	L85287
6300	L85358
6300	L85376
6300	L85394
6300	L85398
6300	L85411
6300	L85416
6300	L85420
6300	L85443
6300	L85447
6300	L85451
6300	L85456
6300	L85460
6300	L85465
6300	L85491
6300	L85500

Model Code	VIN
6300	L85509
6300	L85540
6300	L85545
6300	L85554
6300	L85563
6300	L85580
6300	L85585
6300	L85601
6300	L85607
6300	L85611
6300	L85625
6300	L85634
6300	L85638
6300	L85644
6300	L85647
6300	L85651
6300	L85656
6300	L85660
6300	L85665
6300	L85691
6300	L85700
6300	L85705

Model Code	VIN
6300	L85714
6300	L85718
6300	L85723
6300	L85727
6300	L85740
6300	L85745
6300	L85758
6300	L85763
6300	L85767
6300	L85780
6300	L85794
6300	L85798
6300	L85803
6300	L85807
6300	L85811
6300	L85820
6300	L85825
6300	L85834
6300	L85838
6300	L85851
6300	L85865
6300	L85896
6300	L85958

Parts Information:

<u>DESCRIPTION</u>	<u>PART NUMBER</u>	<u>QTY</u>
Driver seat belt buckle - Sable	XR8 23164AEK	1
Passenger seat belt buckle - Sable	XR8 23162AEK	1
Driver seat belt buckle - Warm Charcoal	XR8 23164LEG	1
Passenger seat belt buckle - Warm Charcoal	XR8 23162LEG	1

Note: A partial allotment of replacement seat belt buckles will be shipped directly to you based on the color/trim specification of the vehicles allocated to your dealership within the specified VIN range. After you receive this initial shipment, you may order additional quantities required through normal channels.

Warranty Information:

Recall R 134

2000-01 MY S-TYPE

VIN L73665-L78262

<u>OPERATION</u>	<u>R.O. NUMBER</u>	<u>TIME ALLOWANCE</u>	<u>SUMMARY CODE</u>
Check buckle date code - No Action Required	76.93.84	0.10 hrs.	UA

<u>OPERATION</u>	<u>R.O. NUMBER</u>	<u>TIME ALLOWANCE</u>	<u>SUMMARY CODE</u>
Check buckle date code - No Action Required	76.93.84	0.10 hrs.	UK
Drive in/Drive out	10.10.10	0.15 hrs.	

<u>OPERATION</u>	<u>R.O. NUMBER</u>	<u>TIME ALLOWANCE</u>	<u>SUMMARY CODE</u>
Check buckle date code - Replace both front seat buckles	76.93.85	0.65 hrs.	UB

<u>Part Numbers</u>	<u>Description</u>	<u>Qty</u>
XR8 23164/AEK	Driver side buckle - sable	1
XR8 23162/AEK	Pass. side seat buckle - sable	1

<u>OPERATION</u>	<u>R.O. NUMBER</u>	<u>TIME ALLOWANCE</u>	<u>SUMMARY CODE</u>
Check buckle date code - Replace both front seat buckles	76.93.85	0.65 hrs.	UC
Drive in/Drive out	10.10.10	0.15 hrs.	

<u>Part Numbers</u>	<u>Description</u>	<u>Qty</u>
XR8 23164/AEK	Driver side buckle - sable	1
XR8 23162/AEK	Pass. side buckle - sable	1

<u>OPERATION</u>	<u>R.O. NUMBER</u>	<u>TIME ALLOWANCE</u>	<u>SUMMARY CODE</u>
Check buckle date code - Replace both front seat buckles	76.93.85	0.65 hrs.	UD
<u>Part Numbers</u>	<u>Description</u>	<u>Qty</u>	
XR8 23164/LEG	Driver side buckle - warm charcoal	1	
XR8 23162/LEG	Pass. side buckle - warm charcoal	1	

<u>OPERATION</u>	<u>R.O. NUMBER</u>	<u>TIME ALLOWANCE</u>	<u>SUMMARY CODE</u>
Check buckle date code - Replace both front seat buckles	76.93.85	0.65 hrs.	UE
Drive in/Drive out	10.10.10	0.15 hrs.	
<u>Part Numbers</u>	<u>Description</u>	<u>Qty</u>	
XR8 23164/LEG	Driver side seat buckle - warm charcoal	1	
XR8 23162/LEG	Pass. side seat buckle - warm charcoal	1	

2000-01 MY S-TYPE
VIN L73665-L85960

<u>OPERATION</u>	<u>R.O. NUMBER</u>	<u>TIME ALLOWANCE</u>	<u>SUMMARY CODE</u>
Replace both front seat buckles	76.93.86	0.65 hrs.	UF
<u>Part Numbers</u>	<u>Description</u>	<u>Qty</u>	
XR8 23164/AEK	Driver side buckle - sable	1	
XR8 23162/AEK	Pass. side buckle - sable	1	

<u>OPERATION</u>	<u>R.O. NUMBER</u>	<u>TIME ALLOWANCE</u>	<u>SUMMARY CODE</u>
Replace both front seat buckles	76.93.86	0.65 hrs.	UG
Drive in/Drive out	10.10.10	0.15 hrs.	
<u>Part Numbers</u>	<u>Description</u>	<u>Qty</u>	
XR8 23164/AEK	Driver side seat buckle - sable	1	
XR8 23162/AEK	Pass. side seat buckle - sable	1	

<u>OPERATION</u>	<u>R.O. NUMBER</u>	<u>TIME ALLOWANCE</u>	<u>SUMMARY CODE</u>
Replace both front seat buckles	76.93.86	0.65 hrs.	UH
<u>Part Numbers</u>	<u>Description</u>	<u>Qty</u>	
XR8 23164/LEG	Driver side buckle - warm charcoal	1	
XR8 23162/LEG	Pass. side buckle - warm charcoal	1	

<u>OPERATION</u>	<u>R.O. NUMBER</u>	<u>TIME ALLOWANCE</u>	<u>SUMMARY CODE</u>
Replace both front seat buckles	76.93.86	0.65 hrs.	UJ
Drive in/Drive out	10.10.10	0.15 hrs.	
<u>Part Numbers</u>	<u>Description</u>	<u>Qty</u>	
XR8 23164/LEG	Driver side seat buckle - warm charcoal	1	
XR8 23162/LEG	Pass. side seat buckle - warm charcoal	1	

NOTE: Always perform a DCS claim search first to determine whether this service action has been performed on this vehicle. The warranty selection under the vehicle inquiry will give a listing of all claims against the vehicle. If R134 appears in the fault code field, do not perform this recall.

CLAIM SUBMISSION PROCEDURE:

Warranty summary codes have been assigned to this service action in order to simplify claim submission. The dealership will be reimbursed the parts and labor time allowance as indicated.

DCS DEALERS

Submit claims using the appropriate summary code for the vehicle model and work performed. Follow standard campaign submission procedures.

NON-DCS DEALERS

Submit claims on the Recall Campaign Summary form W-25. Enter the appropriate summary code for the vehicle model and work performed in the Repair Code column. Do not use the W-1 warranty claim form.



SERVICE

S-TYPE

DATE 10/00

7-17

00V-228.004

ADMINISTRATION BULLETIN



**Recall R134 –
Front Seat Belt Buckle –
Replace With Proper Specification Buckle**

MODEL 2000-01 MY
S-TYPE
VIN L73665-L85960

Issue:

As a result of ongoing quality assessments, Jaguar has identified a defect on a number of S-TYPE vehicles within the above VIN range of L73665-L85960.

On the vehicles involved, it is possible that the latching mechanism within the front safety belt buckle assembly may not have received sufficient heat treatment during the production process. As a result, the component may not be adequately hardened. Under extreme load, the part could deform and release the latch that holds the safety belt tongue.

There have been no instances of failure involving production vehicles. This issue will not affect the drivability of the vehicle and no other restraint systems on the vehicle are involved.

Jaguar has decided to recall affected vehicles to check and replace, where necessary, the front safety belt buckle assemblies on all S-TYPE vehicles produced in the above VIN range.

Vehicles from VIN L73665 to L78203 will require a check of the date code on the front safety belt buckle assemblies. If one of both of the front safety belt buckle assemblies are stamped with a date code that falls within the affected date code range then both front safety belt buckle assemblies should be replaced.

Vehicles from VIN L78203 to L85960 do not require the date code check, but will instead have both front safety belt buckle assemblies replaced.

A number of vehicles have been reworked at the factory before being shipped. The vehicles that have been reworked are listed in this bulletin and do not require any further action.

Jaguar is contacting all affected customers requesting them to contact their nearest Dealer as soon as possible to arrange for the front safety belt buckle assemblies to be checked and replaced if necessary.



Action:

PROCEDURE FOR VEHICLES VIN L73665 TO L78262

On vehicles equipped with a soft plastic cover protecting the front safety belt buckle assembly it is possible to check the date stamp (see table) without removing the seat. Follow the workshop procedure below for vehicles equipped with this type of front safety belt buckle assembly.

The six-digit date code is interpreted as follows:

Example: *ABCDEX*.

AB = Week Number (i.e. 01-52)

C = Day number (i.e. Monday = 1)

DE = Year (i.e. 00 = 2000)

X = Shift Number (i.e. 1,2,3)

Affected date codes:

13200X	13300X	13400X	13500X	13800X
13700X	14200X	15300X	15700X	16200X
17100X	17200X	17300X	17400X	17500X

CHECK CODE PROCEDURE

1. Open both front doors.
2. Push back the soft plastic cover on the front safety belt buckle for access to the buckle code. (See Illustration 1).

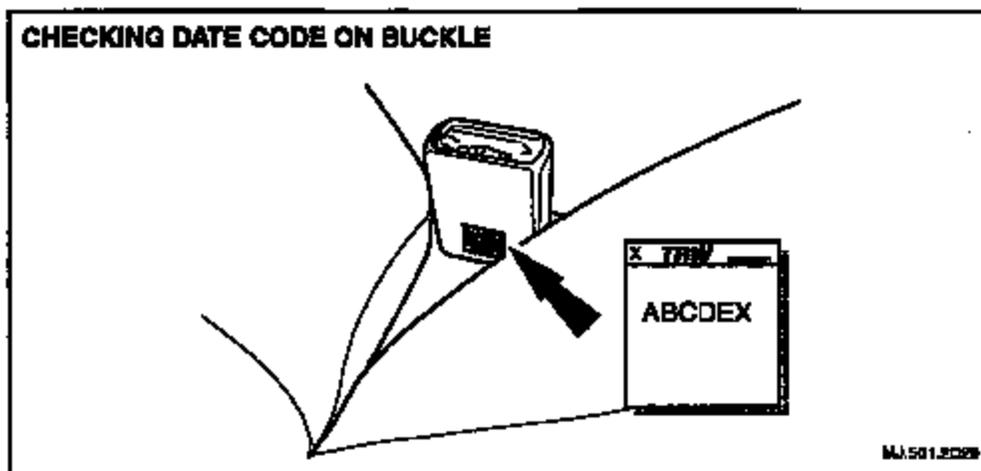


ILLUSTRATION 1

3. Check and record the buckle code against the affected codes provided in the table. Ensure the code is safe.

4. Reposition the front safety belt buckle soft plastic cover to its original condition.
 5. Repeat the procedure for the opposite side safety belt.
- If one buckle code is not safe, both front safety belt buckle assemblies must be replaced.

PROCEDURE TO REPLACE FRONT SAFETY BELT BUCKLE ASSEMBLY

1. At the driver side of the vehicle, position the front seat fully rearward and the front of the cushion fully upward.
2. Reposition the floor carpet flaps for access to the front bolts that secure the front seat to the body.
3. Loosen and remove the front bolts that secure the front seat to the body.
4. Reposition the front seat fully forward.
5. Displace and remove the front seat slide rear inner and outer plastic covers.
6. Loosen and remove the rear bolts that secure front seat to the body.
7. Place a clean protective covering over the rear door opening tread plate area to protect the front seat.

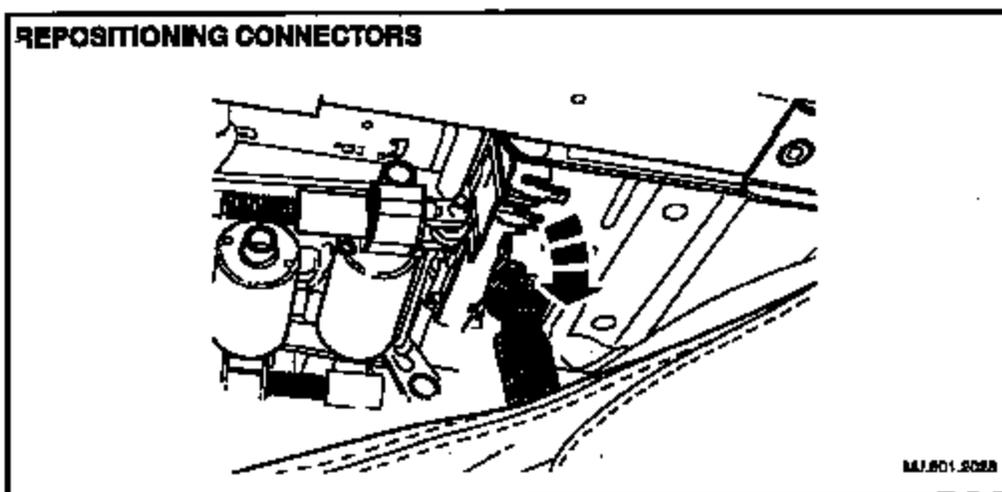


ILLUSTRATION 2

8. Carefully reposition the front seat for access to the seat harness connector.
9. Remove the seat harness connectors from their seat frame mounting tangs (Illustration 2). Do not unplug the connector.

Note: To eliminate the need to disconnect the battery, ensure the connectors remain connected.

The previous operation is required to allow harness more free play when maneuvering the front seat (Illustration 2)

10. Pull the front safety belt against spring tension to gain more slack to assist front seat maneuverability.


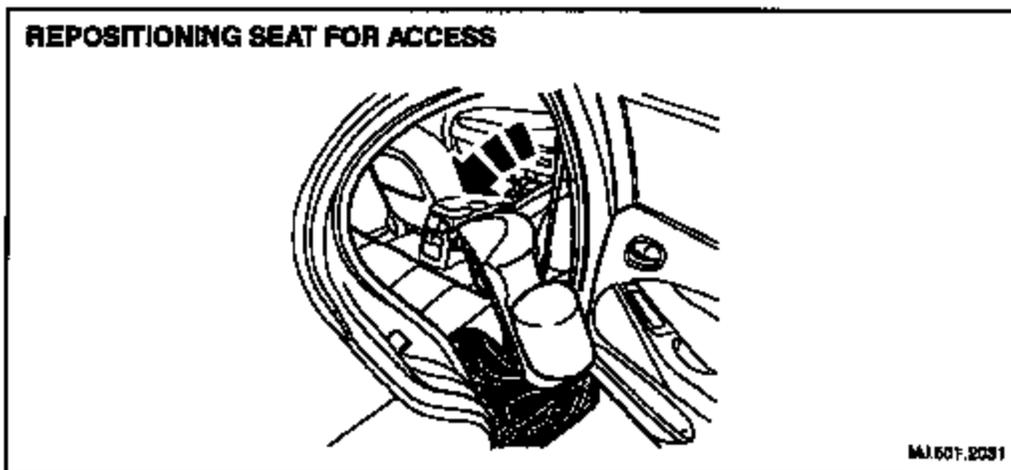


ILLUSTRATION 3

11. Carefully reposition front seat on its side for access to the safety belt buckle. During this operation, the seat back protrudes through the rear door opening. (Illustration 3).

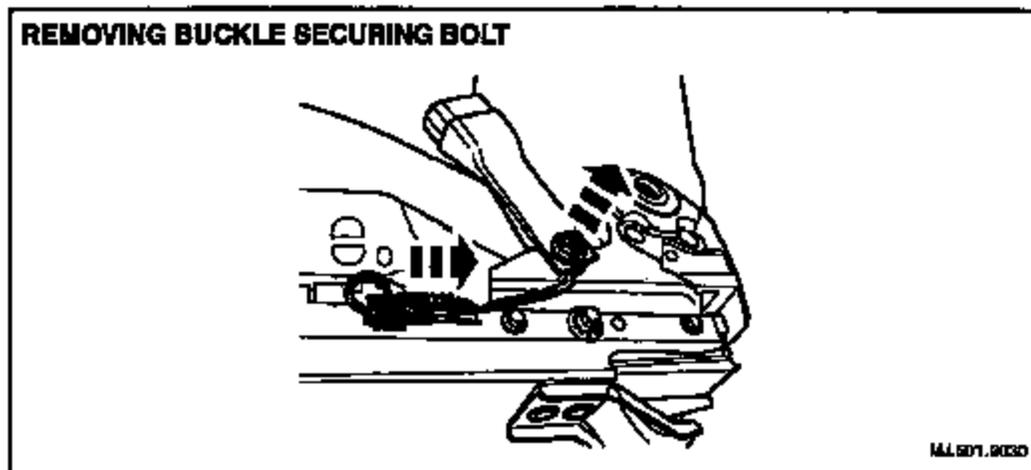

12. Disconnect the front safety belt buckle assembly connector. Loosen and remove the bolt securing the front safety belt buckle. Remove the safety belt buckle assembly and place to one side. (Illustration 4).
13. Install the new safety belt buckle on the front seat – ensure that the buckle lug locates correctly in the seat frame hole.
14. Tighten the new securing bolt for the front safety belt buckle to 40 Nm (29 lb. ft.)
15. Connect the front safety belt buckle connector.
16. Reposition the front seat upright.
17. Engage and seat the front seat harness connectors on their seat frame mounting tangs.
18. Reposition and align the front seat with the body.
19. Remove the protective covering from the rear door opening tread plate area.
20. Install, but do not fully tighten, the rear bolts that secure front seat to the body.

21. Reposition front seat fully rearwards.
 22. Tighten the front bolts that secures the front seat to the body to 40 Nm (29 lb. ft.).
 23. Reposition the floor carpet flaps in their original location.
 24. Reposition the front seat fully forward.
 25. Tighten the rear bolts that secure the front seat to the body to 47 Nm (34 lb. ft.)
 26. Install the rear inner and outer plastic covers on the front seat slide.
 27. Return the front seat to its original position.
 28. Repeat procedure for the passenger side front safety belt buckle assembly.
For vehicles from VIN L78263 to L86960, follow the procedure to replace the front safety belt buckle assembly.
- Repeat procedure for the opposite side front safety belt buckle assembly.

VEHICLES NOT AFFECTED BY THIS RECALL

The following Vehicles were reworked at the factory before being shipped and therefore do not require the Recall Action.

Notes: No Mexican specification vehicles were reworked at the factory.

CANADIAN VEHICLES		Model	
Model		Code	VIN
Code	VIN		
6100	L85032	6100	L85608
6100	L85177	6100	L85612
6100	L85239	6100	L85624
6100	L85317	6100	L85637
6100	L85397	6100	L85645
6100	L85405	6100	L85649
6100	L85413	6100	L85654
6100	L85417	6100	L85659
6100	L85442	6100	L85663
6100	L85457	6100	L85692
6100	L85462	6100	L85710
6100	L85466	6100	L85715
6100	L85490	6100	L85720
6100	L85495	6100	L85725
6100	L85499	6100	L85735
6100	L85510	6100	L85739
6100	L85542	6100	L85744
6100	L85552	6100	L85759
6100	L85579	6100	L85765
6100	L85587	6100	L85775
6100	L85600	6100	L85779
		6100	L85783

Model Code	VIN
6100	L85787
6100	L85792
6100	L85796
6100	L85800
6100	L85805
6100	L85817
6100	L85823
6100	L85836
6100	L85852
6100	L85862
6100	L85867
6100	L85872
6100	L85876
6100	L85885
6100	L85895
6100	L85910
6100	L85915
6100	L85921
6100	L85937
6100	L85950
6300	L85296
6300	L85371
6300	L85389
6300	L85425
6300	L85429
6300	L85438
6300	L85478
6300	L85487
6300	L85505
6300	L85514
6300	L85518
6300	L85523
6300	L85527
6300	L85531
6300	L85558
6300	L85567
6300	L85571
6300	L85592
6300	L85596
6300	L85604
6300	L85616
6300	L85620
6300	L85629

Model Code	VIN
6300	L85641
6300	L85669
6300	L85674
6300	L85678
6300	L85683
6300	L85687
6300	L85696
6300	L85731
6300	L85749
6300	L85754
6300	L85771
6300	L85829
6300	L85843
6300	L85847
6300	L85856
6300	L85881
6300	L85891
6300	L85900
6300	L85905
6300	L85927
6300	L85931
6300	L85954

USA VEHICLES

Model Code	VIN
6100	L75917
6100	L81290
6100	L84380
6100	L84642
6100	L84797
6100	L84897
6100	L85026
6100	L85027
6100	L85116
6100	L85125
6100	L85187
6100	L85217
6100	L85302
6100	L85307
6100	L85392
6100	L85395
6100	L85399



Model Code	VIN
6100	L85415
6100	L85424
6100	L85441
6100	L85455
6100	L85459
6100	L85463
6100	L85472
6100	L85473
6100	L85476
6100	L85486
6100	L85493
6100	L85503
6100	L85504
6100	L85513
6100	L85515
6100	L85517
6100	L85520
6100	L85528
6100	L85537
6100	L85559
6100	L85560
6100	L85566
6100	L85568
6100	L85572
6100	L85574
6100	L85595
6100	L85597
6100	L85599
6100	L85603
6100	L85615
6100	L85623
6100	L85630
6100	L85632
6100	L85635
6100	L85640
6100	L85655
6100	L85662
6100	L85664
6100	L85670
6100	L85694
6100	L85699
6100	L85703
6100	L85726

Model Code	VIN
6100	L85728
6100	L85743
6100	L85747
6100	L85750
6100	L85753
6100	L85756
6100	L85757
6100	L85774
6100	L85777
6100	L85782
6100	L85812
6100	L85830
6100	L85840
6100	L85859
6100	L85873
6100	L85875
6100	L85886
6100	L85894
6100	L85897
6100	L85934
6100	L85956
6100	L85957
6300	L81289
6300	L81292
6300	L85029
6300	L85074
6300	L85154
6300	L85287
6300	L85358
6300	L85376
6300	L85394
6300	L85398
6300	L85411
6300	L85416
6300	L85420
6300	L85443
6300	L85447
6300	L85451
6300	L85456
6300	L85460
6300	L85465
6300	L85491
6300	L85500

Model Code	VIN
6300	L85509
6300	L85540
6300	L85545
6300	L85554
6300	L85563
6300	L85580
6300	L85585
6300	L85601
6300	L85607
6300	L85611
6300	L85625
6300	L85634
6300	L85638
6300	L85644
6300	L85647
6300	L85651
6300	L85656
6300	L85660
6300	L85665
6300	L85691
6300	L85700
6300	L85705

Model Code	VIN
6300	L85714
6300	L85718
6300	L85723
6300	L85727
6300	L85740
6300	L85745
6300	L85758
6300	L85763
6300	L85767
6300	L85780
6300	L85794
6300	L85798
6300	L85803
6300	L85807
6300	L85811
6300	L85820
6300	L85825
6300	L85834
6300	L85838
6300	L85851
6300	L85865
6300	L85896
6300	L85958

Parts Information:

<u>DESCRIPTION</u>	<u>PART NUMBER</u>	<u>QTY</u>
Driver seat belt buckle - Sable	XR8 23164AEK	1
Passenger seat belt buckle - Sable	XR8 23162AEK	1
Driver seat belt buckle - Warm Charcoal	XR8 23164LEG	1
Passenger seat belt buckle - Warm Charcoal	XR8 23162LEG	1

Note: A partial allotment of replacement seat belt buckles will be shipped directly to you based on the color/trim specification of the vehicles allocated to your dealership within the specified VIN range. After you receive this initial shipment, you may order additional quantities required through normal channels.

Warranty Information:

Recall R 134

2000-01 MY S-TYPE

VIN L73665-L78262

<u>OPERATION</u>	<u>R.O. NUMBER</u>	<u>TIME ALLOWANCE</u>	<u>SUMMARY CODE</u>
Check buckle date code - No Action Required	76.93.84	0.10 hrs.	UA

<u>OPERATION</u>	<u>R.O. NUMBER</u>	<u>TIME ALLOWANCE</u>	<u>SUMMARY CODE</u>
Check buckle date code - No Action Required	76.93.84	0.10 hrs.	UK
Drive In/Drive out	10.10.10	0.15 hrs.	

<u>OPERATION</u>	<u>R.O. NUMBER</u>	<u>TIME ALLOWANCE</u>	<u>SUMMARY CODE</u>
Check buckle date code - Replace both front seat buckles	76.93.85	0.65 hrs.	UB

<u>Part Numbers</u>	<u>Description</u>	<u>Qty</u>
XR8 23164/AEK	Driver side buckle - sable	1
XR8 23162/AEK	Pass. side seat buckle - sable	1

<u>OPERATION</u>	<u>R.O. NUMBER</u>	<u>TIME ALLOWANCE</u>	<u>SUMMARY CODE</u>
Check buckle date code - Replace both front seat buckles	76.93.85	0.65 hrs.	UC

Drive in/Drive out	10.10.10	0.15 hrs.	
<u>Part Numbers</u>	<u>Description</u>	<u>Qty</u>	
XR8 23164/AEK	Driver side buckle - sable	1	
XR8 23162/AEK	Pass. side buckle - sable	1	

<u>OPERATION</u>	<u>R.O. NUMBER</u>	<u>TIME ALLOWANCE</u>	<u>SUMMARY CODE</u>
Check buckle date code - Replace both front seat buckles	76.93.85	0.65 hrs.	UD
<u>Part Numbers</u>	<u>Description</u>	<u>Qty</u>	
XRB 23164/LEG	Driver side buckle - warm charcoal	1	
XRB 23162/LEG	Pass. side buckle - warm charcoal	1	

<u>OPERATION</u>	<u>R.O. NUMBER</u>	<u>TIME ALLOWANCE</u>	<u>SUMMARY CODE</u>
Check buckle date code - Replace both front seat buckles	76.93.85	0.65 hrs.	UE
Drive in/Drive out	10.10.10	0.15 hrs.	
<u>Part Numbers</u>	<u>Description</u>	<u>Qty</u>	
XRB 23164/LEG	Driver side seat buckle - warm charcoal		1
XRB 23162/LEG	Pass. side seat buckle - warm charcoal		1

**2000-01 MY S-TYPE
VIN L73665-L85960**

<u>OPERATION</u>	<u>R.O. NUMBER</u>	<u>TIME ALLOWANCE</u>	<u>SUMMARY CODE</u>
Replace both front seat buckles	76.93.86	0.65 hrs.	UF
<u>Part Numbers</u>	<u>Description</u>	<u>Qty</u>	
XRB 23164/AEK	Driver side buckle - sable	1	
XRB 23162/AEK	Pass. side buckle - sable	1	

<u>OPERATION</u>	<u>R.O. NUMBER</u>	<u>TIME ALLOWANCE</u>	<u>SUMMARY CODE</u>
Replace both front seat buckles	76.93.86	0.65 hrs.	UG
Drive in/Drive out	10.10.10	0.15 hrs.	
<u>Part Numbers</u>	<u>Description</u>	<u>Qty</u>	
XRB 23164/AEK	Driver side seat buckle - sable	1	
XRB 23162/AEK	Pass. side seat buckle - sable	1	

<u>OPERATION</u>	<u>R.O. NUMBER</u>	<u>TIME ALLOWANCE</u>	<u>SUMMARY CODE</u>
Replace both front seat buckles	76.93.86	0.65 hrs.	UH
<u>Part Numbers</u>	<u>Description</u>	<u>Qty</u>	
XRB 23164/LEG	Driver side buckle - warm charcoal	1	
XRB 23162/LEG	Pass. side buckle - warm charcoal	1	



<u>OPERATION</u>	<u>R.O. NUMBER</u>	<u>TIME ALLOWANCE</u>	<u>SUMMARY CODE</u>
Replace both front seat buckles	76.93.86	0.85 hrs.	UJ
Drive in/Drive out	10.10.10	0.15 hrs.	
<u>Part Number</u>	<u>Description</u>	<u>Qty</u>	
XR8 23164/LEG	Driver side seat buckle - warm charcoal	1	
XR8 23162/LEG	Pass. side seat buckle - warm charcoal	1	

NOTE: Always perform a DCS claim search first to determine whether this service action has been performed on this vehicle. The warranty selection under the vehicle inquiry will give a listing of all claims against the vehicle. If R134 appears in the fault code field, do not perform this recall.

CLAIM SUBMISSION PROCEDURE:

Warranty summary codes have been assigned to this service action in order to simplify claim submission. The dealership will be reimbursed the parts and labor time allowance as indicated.

DCS DEALERS

Submit claims using the appropriate summary code for the vehicle model and work performed. Follow standard campaign submission procedures.

NON-DCS DEALERS

Submit claims on the Recall Campaign Summary form W-25. Enter the appropriate summary code for the vehicle model and work performed in the Repair Code column. Do not use the W-1 warranty claim form.



JAGUAR
3000 W. WASHINGTON
ANN ARBOR MI 48106-1000
TEL: 734.761.1000
FAX: 734.761.1000

October, 2000

Dear Jaguar Owner:

This notice is sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act.

As a result of ongoing quality assessments, Jaguar Cars has identified a defect on a small number of S-TYPE vehicles involving the Front Safety Belt Buckle Assembly.

Jaguar has voluntarily decided to recall affected vehicles to inspect and replace, if required, both front safety belt buckle assemblies on S-TYPE vehicles produced between May 4th and July 19th, 2000, including your vehicle.

On the vehicles involved, it is possible that the latching mechanism within the front safety belt buckle assemblies may not have received sufficient heat treatment during the production process. As a result, the component may not be adequately hardened. Under loads in excess of the Federal Motor Vehicle Safety Standard 209 – Seat Belt Assemblies, the part could deform and release the latch that holds the safety belt tongue.

For your personal safety and that of your passengers, we would ask that you arrange for the belt buckle inspection as soon as possible. Labor time to inspect or replace the front seat buckles is approximately 1 hour; however, to accommodate service scheduling, your dealer may require your car for the day. All replacement Front Safety Belt Buckle Assemblies will be replaced Free of Charge by Jaguar Franchised Dealers.

Should your dealer be unable or unwilling to repair your Jaguar within 60 days or a reasonable time, we would ask you to contact the Jaguar Customer Assistance Center at 1 800 4 JAGUAR. In the event you are still not satisfied, you may submit a complaint to the Administrator, National Highway Traffic Safety Administration, 400 Seventh Street S.W., Washington, D.C. 20590, or call the toll free Auto Safety Hotline at 1-800-424-9393; Washington D.C. area residents may call (202) 366-0123.

Sincerely yours,

Gary L. Temple
Vice President Customer Care

GLT/tml



SERVICE

S-TYPE

DATE 10/00
Amended 12/00

7-17

Recall

00V-228.004

ADMINISTRATION BULLETIN

**Recall R134 –
Front Seat Belt Buckle –
Replace With Proper Specification Buckle**

MODEL 2000-01 MY
S-TYPE
VIN L73665-L85960

Remove and destroy Bulletin 7-17, dated 10/00.
Replace with this Bulletin.
Revisions are marked with a bar and in bold text.

Issue:

As a result of ongoing quality assessments, Jaguar has identified a defect on a number of S-TYPE vehicles within the above VIN range of L73665-L85960.

On the vehicles involved, it is possible that the latching mechanism within the front safety belt buckle assembly may not have received sufficient heat treatment during the production process. As a result, the component may not be adequately hardened. Under extreme load, the part could deform and release the latch that holds the safety belt tongue.

There have been no instances of failure involving production vehicles. This issue will not affect the drivability of the vehicle and no other restraint systems on the vehicle are involved.

Jaguar has decided to recall affected vehicles to check and replace, where necessary, the front safety belt buckle assemblies on all S-TYPE vehicles produced in the above VIN range.

Vehicles from VIN L73665 to L8262 will require a check of the date code on the front safety belt buckle assemblies. If one or both of the front safety belt buckle assemblies are stamped with a date code that falls within the affected date code range then both front safety belt buckle assemblies should be replaced.

Vehicles from VIN L73663 to L85960 do not require the date code check, but still need both front safety belt buckle assemblies replaced.

A number of vehicles have been reworked at the factory before being shipped. The vehicles that have been reworked are listed in this bulletin and do not require any further action.

Jaguar is contacting all affected customers requesting them to contact their nearest Dealer as soon as possible to arrange for the front safety belt buckle assemblies to be checked and replaced if necessary.



Action:

PROCEDURE FOR VEHICLES VIN L73665 TO L78262

On vehicles equipped with a soft plastic cover protecting the front safety belt buckle assembly it is possible to check the date stamp (see table) without removing the seat. Follow the workshop procedure below for vehicles equipped with this type of front safety belt buckle assembly.

The six-digit date code is interpreted as follows:

Example: *ABCDEX*.

AB = Week Number (i.e. 01-52)

C = Day number (i.e. Monday = 1)

DE = Year (i.e. 00 = 2000)

X = Shift Number (i.e. 1,2,3)

Affected date codes:

13200X	13300X	13400X	13500X	13600X
13700X	14200X	15300X	15700X	16200X
17100X	17200X	17300X	17400X	17500X

CHECK CODE PROCEDURE

1. Open both front doors.
2. Push back the soft plastic cover on the front safety belt buckle for access to the buckle code. (See Illustration 1).

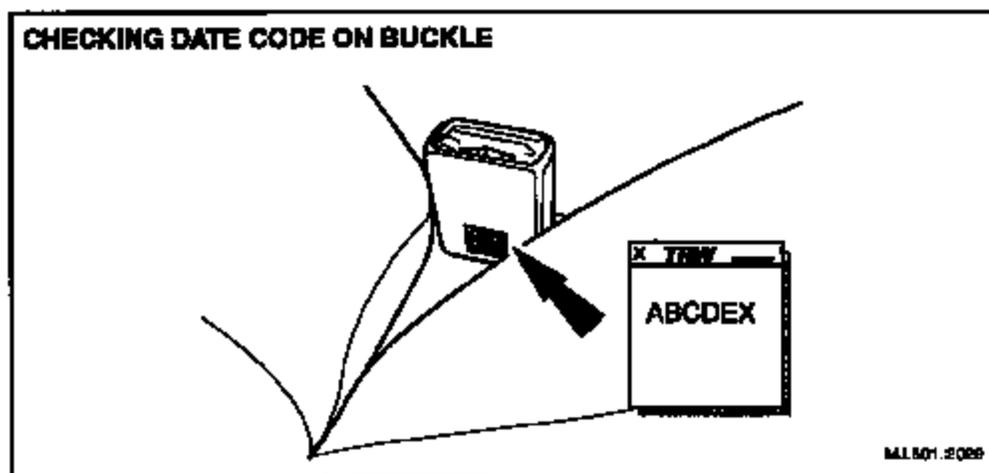


ILLUSTRATION 1

3. Check and record the buckle code against the affected codes provided in the table. Ensure the code is safe.

4. Reposition the front safety belt buckle soft plastic cover to its original condition.
5. Repeat the procedure for the opposite side safety belt.

If one buckle code is not safe, both front safety belt buckle assemblies must be replaced.

PROCEDURE TO REPLACE FRONT SAFETY BELT BUCKLE ASSEMBLY - ALL AFFECTED VEHICLES

1. At the driver side of the vehicle, position the front seat fully rearward and the front of the cushion fully upward.
2. Reposition the floor carpet flaps for access to the front bolts that secure the front seat to the body.
3. Loosen and remove the front bolts that secure the front seat to the body.
4. Reposition the front seat fully forward.
5. Displace and remove the front seat slide rear inner and outer plastic covers.
6. Loosen and remove the rear bolts that secure front seat to the body.
7. Place a clean protective covering over the rear door opening tread plate area to protect the front seat.

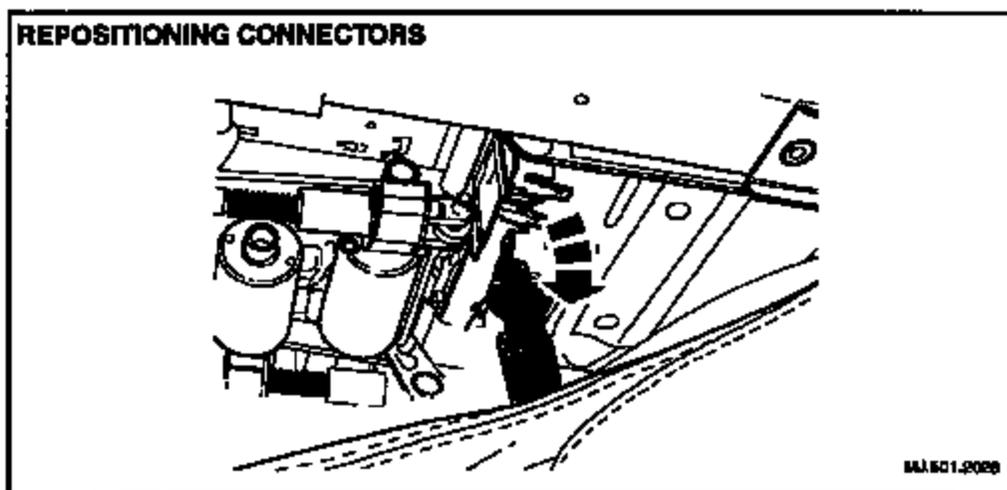


ILLUSTRATION 2

8. Carefully reposition the front seat for access to the seat harness connector.
9. Remove the seat harness connectors from their seat frame mounting tangs (Illustration 2). Do not unplug the connector.

Note: To eliminate the need to disconnect the battery, ensure the connectors remain connected.

The previous operation is required to allow harness more free play when maneuvering the front seat (Illustration 2)

10. Pull the front safety belt against spring tension to gain more slack to assist front seat maneuverability.


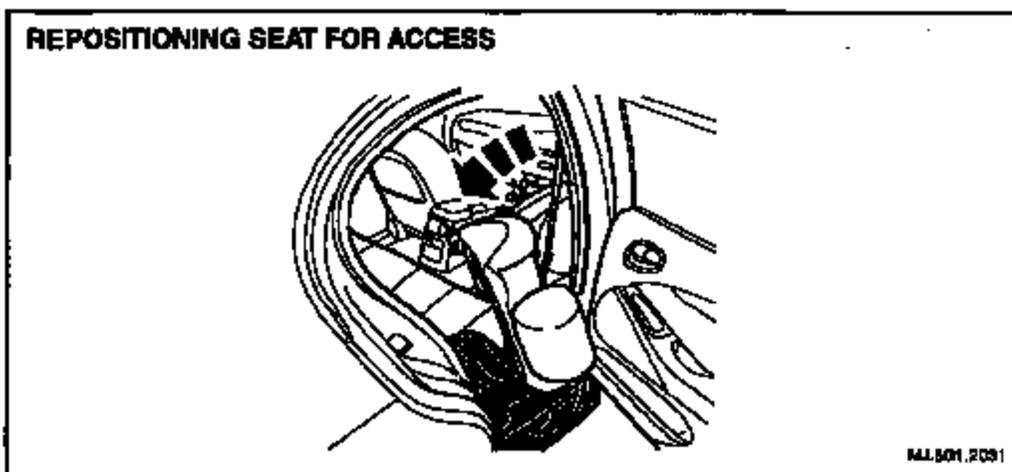


ILLUSTRATION 3

11. Carefully reposition front seat on its side for access to the safety belt buckle. During this operation, the seat back protrudes through the rear door opening. (Illustration 3).

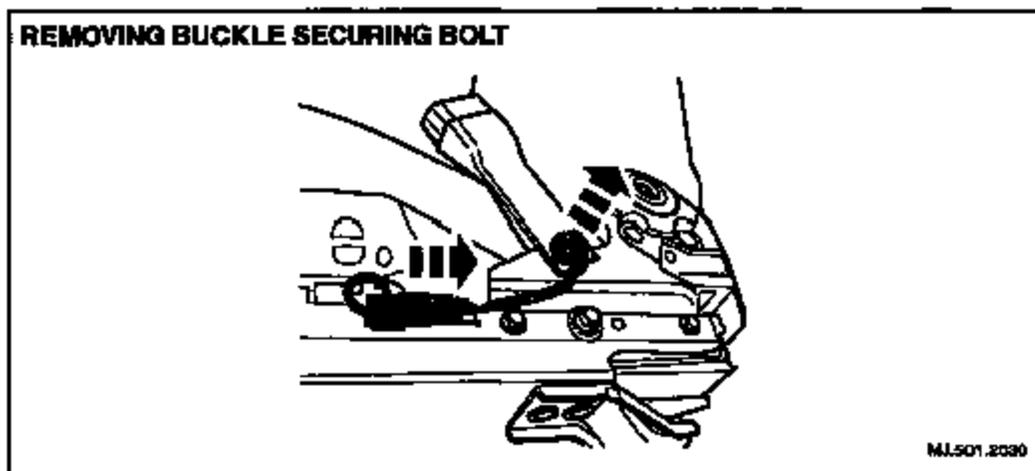

12. Disconnect the front safety belt buckle assembly connector. Loosen and remove the bolt securing the front safety belt buckle. Remove the safety belt buckle assembly and place to one side. (Illustration 4).
13. Install the new safety belt buckle on the front seat – ensure that the buckle lug locates correctly in the seat frame hole.
14. Tighten the new securing bolt for the front safety belt buckle to 40 Nm (29 lb. ft.)
15. Connect the front safety belt buckle connector.
16. Reposition the front seat upright.
17. Engage and seat the front seat harness connectors on their seat frame mounting tangs.
18. Reposition and align the front seat with the body.
19. Remove the protective covering from the rear door opening tread plate area.
20. Install, but do not fully tighten, the rear bolts that secure front seat to the body.

21. Reposition front seat fully rearwards.
 22. Tighten the front bolts that secures the front seat to the body to 40 Nm (29 lb. ft.).
 23. Reposition the floor carpet flaps in their original location.
 24. Reposition the front seat fully forward.
 25. Tighten the rear bolts that secure the front seat to the body to 47 Nm (34 lb. ft.)
 26. Install the rear inner and outer plastic covers on the front seat slide.
 27. Return the front seat to its original position.
 28. Repeat procedure for the passenger side front safety belt buckle assembly.
For vehicles from VIN L78263 to L85960, follow the procedure to replace the front safety belt buckle assembly.
- Repeat procedure for the opposite side front safety belt buckle assembly.

VEHICLES NOT AFFECTED BY THIS RECALL

The following Vehicles were reworked at the factory before being shipped and therefore do not require the Recall Action.

Note: No Mexican specification vehicles were reworked at the factory.

CANADIAN VEHICLES		Model	
Model		Code	VIN
Code	VIN		
6100	L85032	6100	L85608
6100	L85177	6100	L85612
6100	L85239	6100	L85624
6100	L85317	6100	L85637
6100	L85397	6100	L85645
6100	L85405	6100	L85649
6100	L85413	6100	L85654
6100	L85417	6100	L85659
6100	L85442	6100	L85663
6100	L85457	6100	L85692
6100	L85462	6100	L85710
6100	L85466	6100	L85715
6100	L85490	6100	L85720
6100	L85495	6100	L85725
6100	L85499	6100	L85735
6100	L85510	6100	L85739
6100	L85542	6100	L85744
6100	L85552	6100	L85759
6100	L85579	6100	L85765
6100	L85587	6100	L86775
6100	L85600	6100	L85779
		6100	L85783

Model Code	VIN
6100	L85787
6100	L85792
6100	L85796
6100	L85800
6100	L85805
6100	L85817
6100	L85823
6100	L85836
6100	L85852
6100	L85862
6100	L85867
6100	L85872
6100	L85876
6100	L85885
6100	L85895
6100	L85910
6100	L85915
6100	L85921
6100	L85937
6100	L85950
6300	L85296
6300	L85371
6300	L85389
6300	L85425
6300	L85429
6300	L85438
6300	L85478
6300	L85487
6300	L85505
6300	L85514
6300	L85518
6300	L85523
6300	L85527
6300	L85531
6300	L85558
6300	L85567
6300	L85571
6300	L85592
6300	L85596
6300	L85604
6300	L85616
6300	L85620
6300	L85629

Model Code	VIN
6300	L85641
6300	L85669
6300	L85674
6300	L85678
6300	L85683
6300	L85687
6300	L85696
6300	L85731
6300	L85749
6300	L85754
6300	L85771
6300	L85829
6300	L85843
6300	L85847
6300	L85856
6300	L85881
6300	L85891
6300	L85900
6300	L85905
6300	L85927
6300	L85931
6300	L85954

USA VEHICLES

Model Code	VIN
6100	L75917
6100	L81290
6100	L84380
6100	L84642
6100	L84797
6100	L84897
6100	L85026
6100	L85027
6100	L85116
6100	L85125
6100	L85187
6100	L85217
6100	L85302
6100	L85307
6100	L85392
6100	L85395
6100	L85399



Model Code	VIN
6100	L85415
6100	L85424
6100	L85441
6100	L85455
6100	L85459
6100	L85463
6100	L85472
6100	L85473
6100	L85476
6100	L85486
6100	L85493
6100	L85503
6100	L85504
6100	L85513
6100	L85515
6100	L85517
6100	L85520
6100	L85528
6100	L85537
6100	L85559
6100	L85560
6100	L85566
6100	L85568
6100	L85572
6100	L85574
6100	L85595
6100	L85597
6100	L85599
6100	L85603
6100	L85615
6100	L85623
6100	L85630
6100	L85632
6100	L85635
6100	L85640
6100	L85655
6100	L85662
6100	L85664
6100	L85670
6100	L85694
6100	L85699
6100	L85703
6100	L85726

Model Code	VIN
6100	L85728
6100	L85743
6100	L85747
6100	L85750
6100	L85753
6100	L85758
6100	L85757
6100	L85774
6100	L85777
6100	L85782
6100	L85812
6100	L85830
6100	L85840
6100	L85859
6100	L85873
6100	L85875
6100	L85886
6100	L85894
6100	L85897
6100	L85934
6100	L85956
6100	L85957
6300	L81289
6300	L81292
6300	L85029
6300	L85074
6300	L85154
6300	L85287
6300	L85358
6300	L85376
6300	L85394
6300	L85398
6300	L85411
6300	L85416
6300	L85420
6300	L85443
6300	L85447
6300	L85451
6300	L85456
6300	L85460
6300	L85465
6300	L85491
6300	L85500

Model Code	VIN
6300	L85509
6300	L85540
6300	L85545
6300	L85554
6300	L85563
6300	L85580
6300	L85585
6300	L85601
6300	L85607
6300	L85611
6300	L85625
6300	L85634
6300	L85638
6300	L85644
6300	L85647
6300	L85651
6300	L85656
6300	L85660
6300	L85665
6300	L85691
6300	L85700
6300	L85705

Model Code	VIN
6300	L85714
6300	L85718
6300	L85723
6300	L85727
6300	L85740
6300	L85745
6300	L85758
6300	L85763
6300	L85767
6300	L85780
6300	L85794
6300	L85798
6300	L85803
6300	L85807
6300	L85811
6300	L85820
6300	L85825
6300	L85834
6300	L85838
6300	L85851
6300	L85865
6300	L85896
6300	L85958

Parts information:

<u>DESCRIPTION</u>	<u>PART NUMBER</u>	<u>QTY</u>
Driver seat belt buckle - Sable	XR8 23164AEK	1
Passenger seat belt buckle - Sable	XR8 23162AEK	1
Driver seat belt buckle - Warm Charcoal	XR8 23164LEG	1
Passenger seat belt buckle - Warm Charcoal	XR8 23162LEG	1

Note: A partial allotment of replacement seat belt buckles will be shipped directly to you based on the color/trim specification of the vehicles allocated to your dealership within the specified VIN range. After you receive this initial shipment, you may order additional quantities required through normal channels.

Warranty Information:

Recall R 134

2000-01 MY S-TYPE

VIN L73665-L78262

<u>OPERATION</u>	<u>R.O. NUMBER</u>	<u>TIME ALLOWANCE</u>	<u>SUMMARY CODE</u>
Check buckle date code - No Action Required	76.93.84	0.10 hrs.	UA

<u>OPERATION</u>	<u>R.O. NUMBER</u>	<u>TIME ALLOWANCE</u>	<u>SUMMARY CODE</u>
Check buckle date code - No Action Required	76.93.84	0.10 hrs.	UK
Drive in/Drive out	10.10.10	0.15 hrs.	

<u>OPERATION</u>	<u>R.O. NUMBER</u>	<u>TIME ALLOWANCE</u>	<u>SUMMARY CODE</u>
Check buckle date code - Replace both front seat buckles	76.93.85	0.65 hrs.	UB

<u>Part Numbers</u>	<u>Description</u>	<u>Qty</u>
XR8 23164/AEK	Driver side buckle - sable	1
XR8 23162/AEK	Pass. side seat buckle - sable	1

<u>OPERATION</u>	<u>R.O. NUMBER</u>	<u>TIME ALLOWANCE</u>	<u>SUMMARY CODE</u>
Check buckle date code - Replace both front seat buckles	76.93.85	0.65 hrs.	UC

<u>OPERATION</u>	<u>R.O. NUMBER</u>	<u>TIME ALLOWANCE</u>
Drive In/Drive out	10.10.10	0.16 hrs.

<u>Part Numbers</u>	<u>Description</u>	<u>Qty</u>
XR8 23164/AEK	Driver side buckle - sable	1
XR8 23162/AEK	Pass. side buckle - sable	1

<u>OPERATION</u>	<u>R.O. NUMBER</u>	<u>TIME ALLOWANCE</u>	<u>SUMMARY CODE</u>
Check buckle date code - Replace both front seat buckles	76.93.85	0.65 hrs.	UD

<u>Part Numbers</u>	<u>Description</u>	<u>Qty</u>
XR8 23164/LEG	Driver side buckle - warm charcoal	1
XR8 23162/LEG	Pass. side buckle - warm charcoal	1

<u>OPERATION</u>	<u>R.O. NUMBER</u>	<u>TIME ALLOWANCE</u>	<u>SUMMARY CODE</u>
Check buckle date code - Replace both front seat buckles	76.93.85	0.65 hrs.	UE

<u>Part Numbers</u>	<u>Description</u>	<u>Qty</u>
XR8 23164/LEG	Driver side seat buckle - warm charcoal	1
XR8 23162/LEG	Pass. side seat buckle - warm charcoal	1

**2000-01 MY S-TYPE
VIN L78263-L85960**

<u>OPERATION</u>	<u>R.O. NUMBER</u>	<u>TIME ALLOWANCE</u>	<u>SUMMARY CODE</u>
Replace both front seat buckles	76.93.86	0.65 hrs.	UF

<u>Part Numbers</u>	<u>Description</u>	<u>Qty</u>
XR8 23164/AEK	Driver side buckle - sable	1
XR8 23162/AEK	Pass. side buckle - sable	1

<u>OPERATION</u>	<u>R.O. NUMBER</u>	<u>TIME ALLOWANCE</u>	<u>SUMMARY CODE</u>
Replace both front seat buckles	76.93.86	0.65 hrs.	UG
Drive in/Drive out	10.10.10	0.15 hrs.	

<u>Part Numbers</u>	<u>Description</u>	<u>Qty</u>
XR8 23164/AEK	Driver side seat buckle - sable	1
XR8 23162/AEK	Pass. side seat buckle - sable	1

<u>OPERATION</u>	<u>R.O. NUMBER</u>	<u>TIME ALLOWANCE</u>	<u>SUMMARY CODE</u>
Replace both front seat buckles	76.93.86	0.65 hrs.	UH

<u>Part Numbers</u>	<u>Description</u>	<u>Qty</u>
XR8 23164/LEG	Driver side buckle - warm charcoal	1
XR8 23162/LEG	Pass. side buckle - warm charcoal	1

<u>OPERATION</u>	<u>R.O. NUMBER</u>	<u>TIME ALLOWANCE</u>	<u>SUMMARY CODE</u>
Replace both front seat buckles	76.93.86	0.65 hrs.	UJ
Drive in/Drive out	10.10.10	0.15 hrs.	
<u>Part Numbers</u>	<u>Description</u>	<u>Qty</u>	
XR8 23164/LEG	Driver side seat buckle - warm charcoal		1
XR8 23162/LEG	Pass. side seat buckle - warm charcoal		1

NOTE: Always perform a DCS claim search first to determine whether this service action has been performed on this vehicle. The warranty selection under the vehicle inquiry will give a listing of all claims against the vehicle. If R134 appears in the fault code field, do not perform this recall.

CLAIM SUBMISSION PROCEDURE:

Warranty summary codes have been assigned to this service action in order to simplify claim submission. The dealership will be reimbursed the parts and labor time allowance as indicated.

DCS DEALERS

Submit claims using the appropriate summary code for the vehicle model and work performed. Follow standard campaign submission procedures.

NON-DCS DEALERS

Submit claims on the Recall Campaign Summary form W-25. Enter the appropriate summary code for the vehicle model and work performed in the Repair Code column. Do not use the W-1 warranty claim form.

October 9, 2000

Dear Jaguar Owner:

This notice is sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act.

As a result of ongoing quality assessments, Jaguar Cars has identified a defect on a small number of S-TYPE vehicles involving the Front Safety Belt Buckle Assembly.


Jaguar has voluntarily decided to recall affected vehicles to inspect and replace, if required, both front safety belt buckle assemblies on S-TYPE vehicles produced between May 4th and July 19th, 2000, including your vehicle.

On the vehicles involved, it is possible that the latching mechanism within the front safety belt buckle assemblies may not have received sufficient heat treatment during the production process. As a result, the component may not be adequately hardened. Under loads in excess of the Federal Motor Vehicle Safety Standard 209 – Seat Belt Assemblies, the part could deform and release the latch that holds the safety belt tongue.

For your personal safety and that of your passengers, we would ask that you arrange for the belt buckle inspection as soon as possible. Labor time to inspect or replace the front seat buckles is approximately 1 hour; however, to accommodate service scheduling, your dealer may require your car for the day. All replacement Front Safety Belt Buckle Assemblies will be replaced Free of Charge by Jaguar Franchised Dealers.

Should your dealer be unable or unwilling to repair your Jaguar within 60 days or a reasonable time, we would ask you to contact the Jaguar Customer Assistance Center at 1 800 4 JAGUAR. In the event you are still not satisfied, you may submit a complaint to the Administrator, National Highway Traffic Safety Administration, 400 Seventh Street S.W., Washington, D.C. 20590, or call the toll free Auto Safety Hotline at 1-800-424-9393; Washington D.C. area residents may call (202) 366-0123.

Sincerely yours,

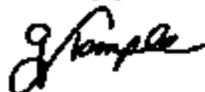

Gary L. Temple
Vice President Customer Care

GLT/tml



NISSAN NORTH AMERICA, INC.

November 16, 2000

Mr. Jonathan D. White
Chief, Recall Analysis Division
Office of Defects Investigation
Safety Assurance
National Highway Traffic Safety Administration
400 Seventh Street, S.W.
Washington, D.C. 20590

Ref: 00V-228,005

Dear Mr. White:

The enclosed communication is being provided pursuant to 49 CFR Part 573.5(c)(9).

Very truly,

Frank D. Slaveter
Corporate Manager
Technical Compliance

Encl.

RECEIVED
NOV 28 2000
OFFICE OF DEFECTS INVESTIGATION

Slaveter, Frank

From: Hastie, Joe
Sent: Wednesday, November 15, 2000 8:41 PM
To: *NNA NIS DPSM; *NNA SALES RPSM; *NNA PSS Nissan DTS; Walker, David S.; McConathy, Vickie; Hankin, Bob; Lieske, Randy; Behling, Brian; Schoonover, David; Suckow, Fred; Davis, Mitch; Stancalo, Joe
Cc: Sparks, Alicia; Sakimoto, Alan; Burns, Richard; Hambly, Rick; Bolls, Richard; Lawrence, Doug; Treadwell, Gary; Slaveter, Frank; Carranza, Richard; Hastie, Joe
Subject: RE: B0083 Quest Steering Rack Bolt Voluntary Safety Recall Campaign

The following Nissan net message is being sent to all Nissan dealers this evening, November 15, 2000.

NISSAN NET BROADCAST MESSAGE

SUBJECT: 2000 QUEST SEAT BELT BUCKLE INSPECTION/REPLACEMENT VOLUNTARY SAFETY RECALL CAMPAIGN

ATTENTION - DEALER PRINCIPALS, SALES, PARTS AND SERVICE MANAGERS

ON NOVEMBER 20, 2000, NISSAN WILL LAUNCH THE 2000 QUEST SEAT BELT BUCKLE INSPECTION/REPLACEMENT VOLUNTARY SAFETY RECALL CAMPAIGN. THE CAMPAIGN AFFECTS APPROXIMATELY 9,500 2000 MODEL YEAR QUEST VEHICLES. USE SERVICE COMM TO DETERMINE IF A SPECIFIC VEHICLE, INCLUDING VEHICLES IN DEALER INVENTORY, IS INVOLVED IN THE CAMPAIGN (B0090).

SOME 2000 MODEL YEAR QUEST VEHICLES MAY HAVE SEAT BELT BUCKLE ASSEMBLIES THAT DO NOT COMPLY WITH FEDERAL MOTOR VEHICLE SAFETY STANDARDS. NISSAN IS PROVIDING AN INSPECTION PROCEDURE AND A RELATED REPAIR PROCEDURE.

NOTE: all affected VEHICLES WILL REQUIRE THE INSPECTION PROCEDURE. based upon our data, ONLY a small number of inspected vehicles will require the campaign repair.

NISSAN WILL NOTIFY CURRENT OWNERS ON NOVEMBER 20, 2000. OWNERS WILL BE INSTRUCTED TO BRING THEIR VEHICLE TO THEIR NEAREST NISSAN DEALERSHIP TO HAVE THE VEHICLE INSPECTED AND TO HAVE THE CONDITION CORRECTED, IF NECESSARY.

DETAILED INSTRUCTIONS TO COMPLETE THE CAMPAIGN INSPECTION/REPAIR ARE OUTLINED IN RECALL CAMPAIGN BULLETIN NTB00-087. 10 COPIES OF THIS BULLETIN ARE BEING SHIPPED TO YOUR SERVICE MANAGER.

SINCE A VERY LOW NUMBER OF VEHICLES ARE EXPECTED TO REQUIRE SEAT BELT REPLACEMENT, STOCK ORDERS WILL NOT BE ACCEPTED. USE THE VOR PROCESS TO ORDER PARTS FOR SPECIFIC VEHICLES REQUIRING REPAIR.

YOUR CONTINUED SUPPORT OF THE SAFETY AND CUSTOMER SATISFACTION OF NISSAN QUEST OWNERS IS APPRECIATED.

NISSAN PARTS AND SERVICE OPERATIONS
11/15/2000



RECALL CAMPAIGN BULLETIN

Reference:

NTB00-087

Date:

November 15, 2000

VOLUNTARY RECALL CAMPAIGN 2000 QUEST SEAT BELT BUCKLE INSPECTION/REPLACEMENT

CAMPAIGN I.D. / NHTSA #: B0090 / 00V-228, 005

APPLIED VEHICLE: 2000 Quest (V41)

APPLIED VIN: 4N2XN11T*YD826830 - 845035

NOTE: Since Quest vehicles are not built in VIN sequence, it is mandatory to confirm campaign eligibility by using Service Comm.

INTRODUCTION

Nissan has determined that some 2000 model year Nissan Quest vehicles may have seat belt buckle assemblies that do not comply with the applicable Federal Motor Vehicle Safety Standard and must be replaced. In the event of a severe crash, the seat belt buckle's metal base may fracture and cause the seat belt assembly to pull apart, which will increase the chance of injury.

IDENTIFICATION NUMBER

Nissan has assigned identification number B0090 to this campaign. This number must appear on all communications and documentation of any nature dealing with this Campaign.

NUMBER OF VEHICLES POTENTIALLY AFFECTED

The number of vehicles potentially affected is approximately 9,500.

DEALER RESPONSIBILITY

It is the retailer's responsibility to check Service Comm for the campaign status on each vehicle falling within the range of this voluntary safety recall which for any reason enters the service department. This includes vehicles purchased from private parties or presented by transient (tourist) owners and vehicles in a dealer's inventory. **Federal law requires that new vehicles in dealer inventory which are the subject of a safety recall must be corrected prior to sale. Failure to do so can result in civil penalties by the National Highway Traffic Safety Administration.** While federal law applies only to new vehicles, Nissan strongly encourages dealers to correct any used vehicles in their inventory before they are retailed.

SERVICE PROCEDURE

Seat Belt Buckle Inspection

Check the date code on the seat belt buckles. Refer to Figure 1 or Figure 2 to determine which seat belt buckles need to be inspected. Not all seat belt buckles need to be inspected.

Figure 1 is for vehicles equipped with second row captain's seats. Figure 2 is for vehicles equipped with a second row bench seat.

- If a seat belt buckle has date code 156001 or 157001, replace it. Refer to Figure 1 or Figure 2 for the inspection procedure and the related seat belt buckle P/Ns.
- If none of the seat belt buckles have lot number 156001 or 157001, return the vehicle to the customer and submit a warranty claim for the inspection **ONLY**.

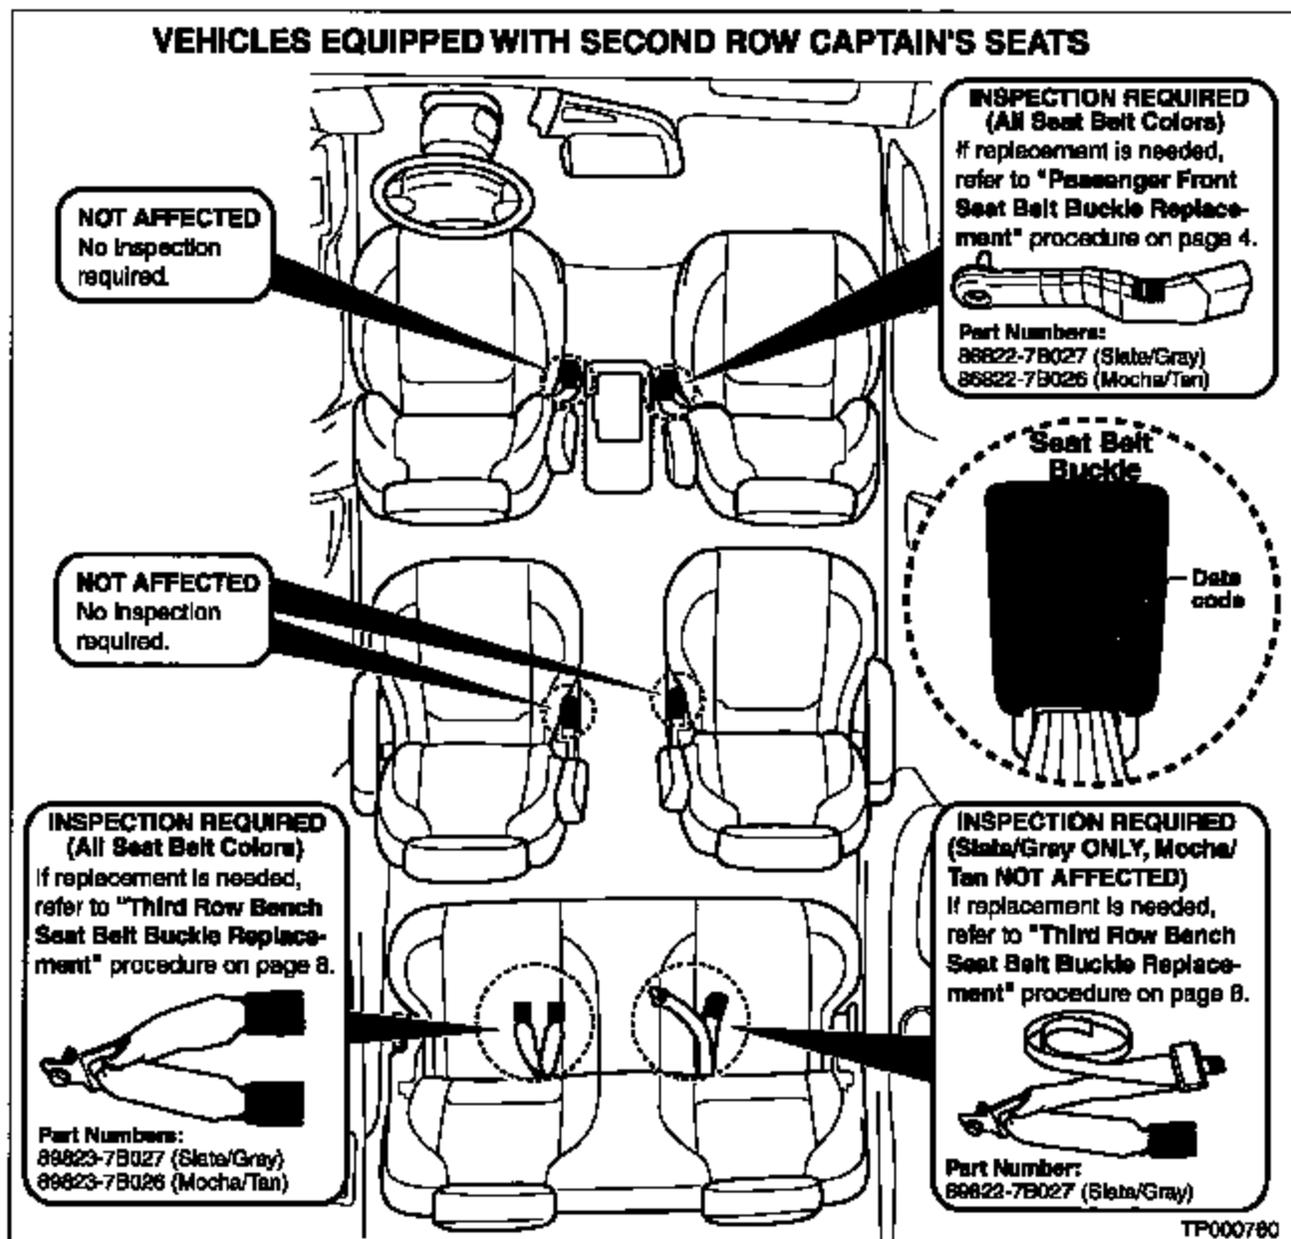


Figure 1

VEHICLES EQUIPPED WITH SECOND ROW BENCH SEAT

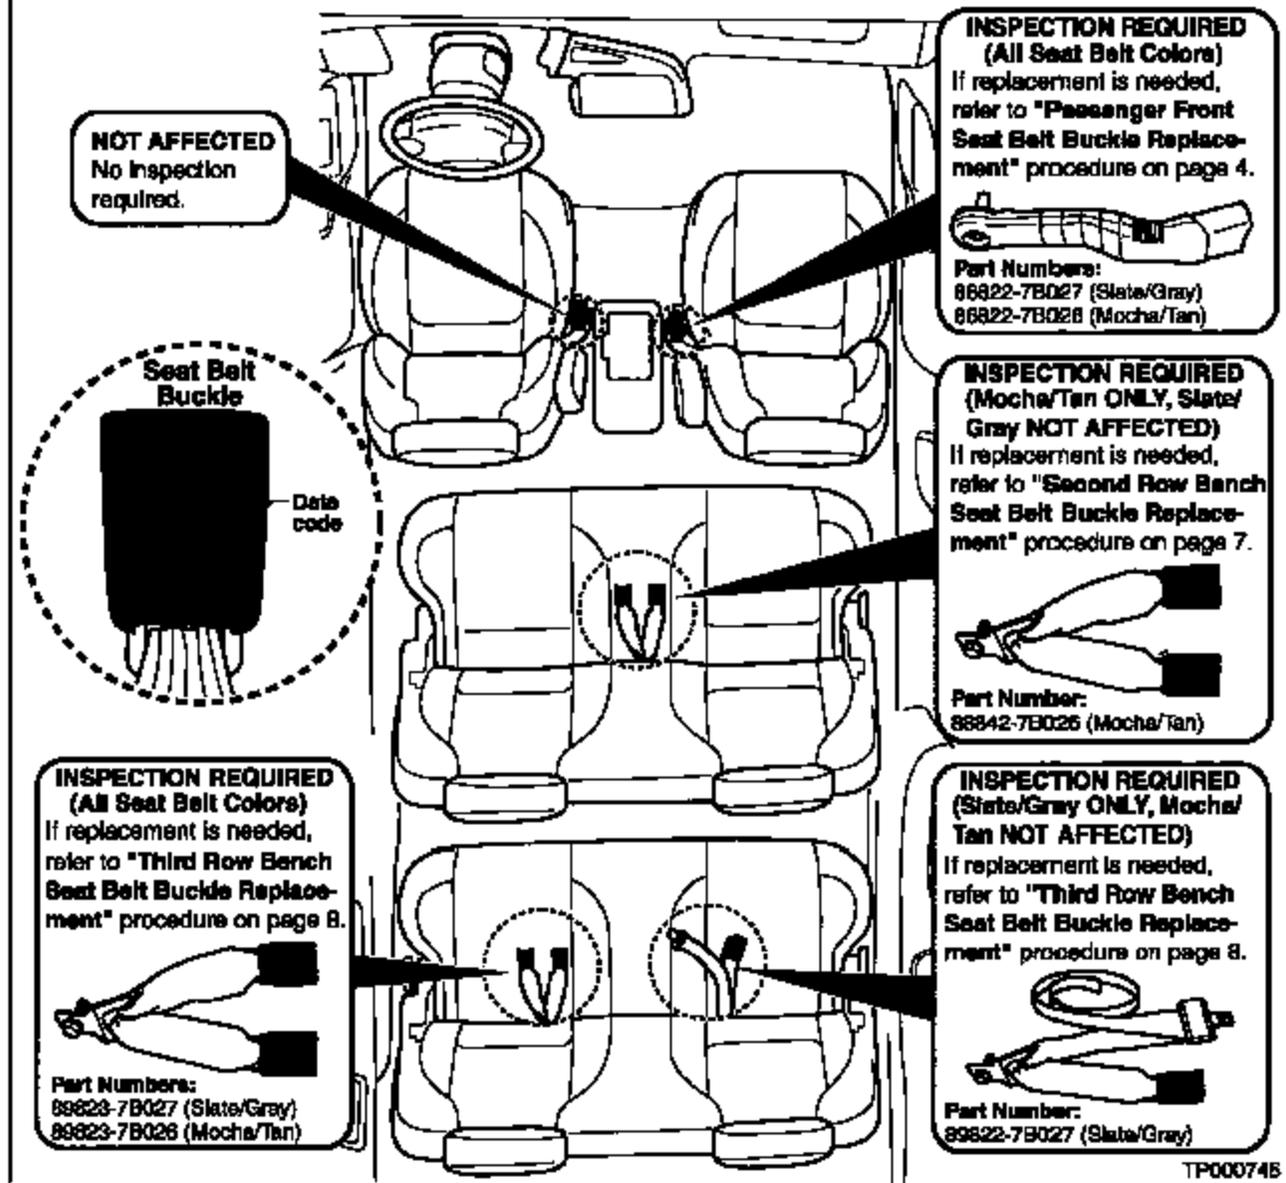


Figure 2

Passenger Front Seat Belt Buckle Replacement

1. Re-position the Nissan Vehicle Entertainment System (NVES) console, located between the front seats, as follows:
 - A. Make sure the ash tray and cup holder tray (located below the A/C controls) are pushed in all the way.
 - B. Re-position the floor mat between the front seats and the second row seating to access the two rear NVES console mounting bolts (see Figure 3).

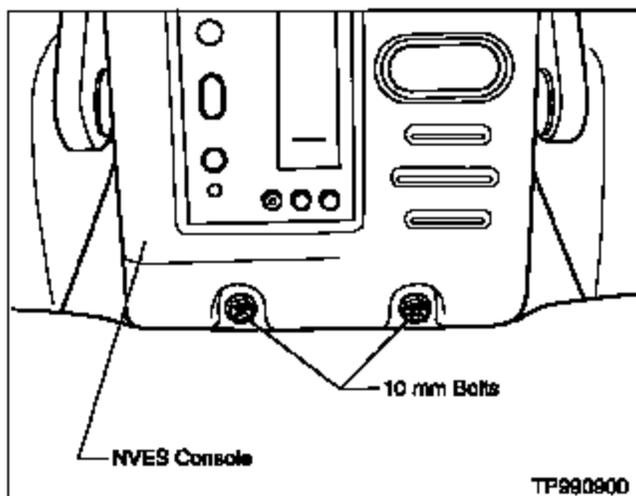


Figure 3

- C. Remove the two, rear console mounting bolts (see Figure 3).
- D. Pull the console rearward 2 inches so it slides out of the front mounting bracket (see Figure 4).

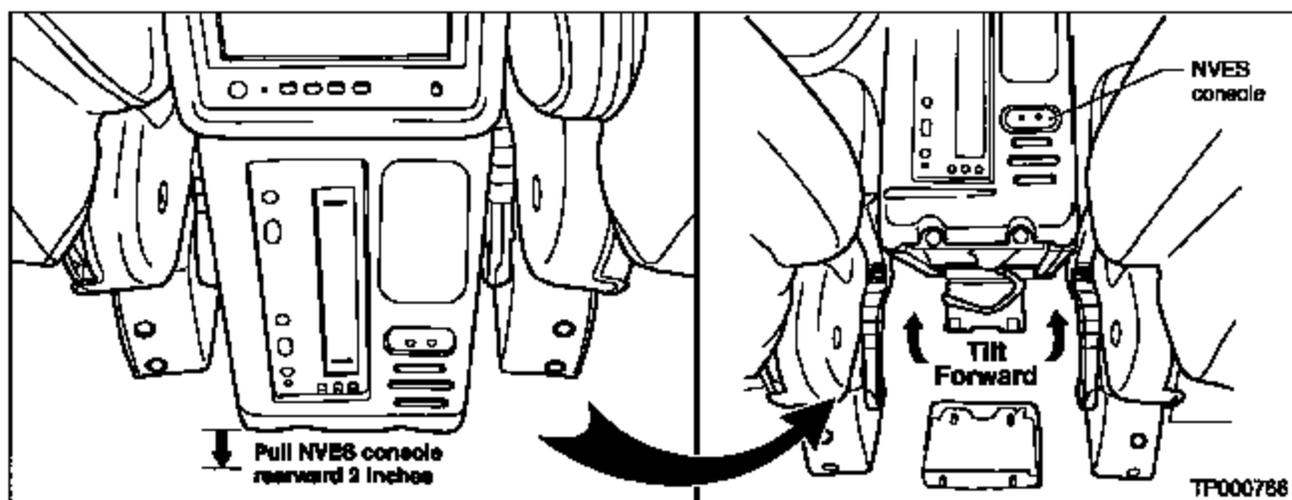


Figure 4

- E. Carefully tilt the rear of the console upward just enough to access the passenger front seat belt buckle.

CAUTION: Do not stretch or pinch the NVES wire harness (located under the front of the console) when tilting the console forward. Also, be careful not to scratch or mar the console. Also, do not hit or put pressure on the NVES screen as it can crack.

2. Unscrew (using a Torx-bit #T50) and remove the trim cover over the seat belt buckle mounting bolt (see Figure 5).

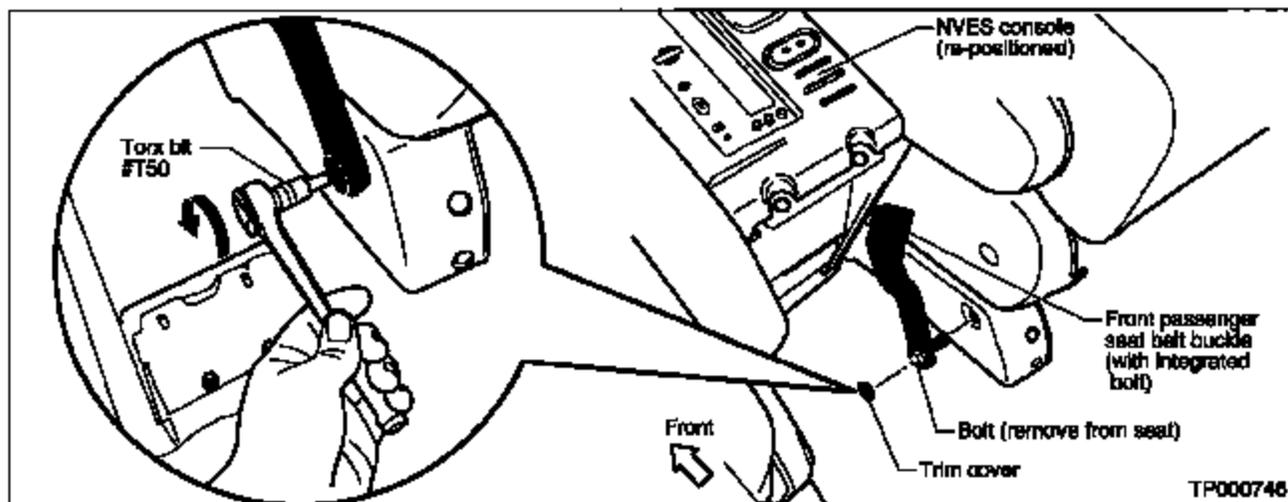


Figure 5

3. Unscrew the bolt and remove the front passenger seat belt buckle (see Figure 5).
4. Install the new seat belt buckle and tighten the mounting bolt to 34 – 46 Nm (3.5 – 4.7 Kg-m, 25.1 – 33.9 ft-lbs). See Figure 6.

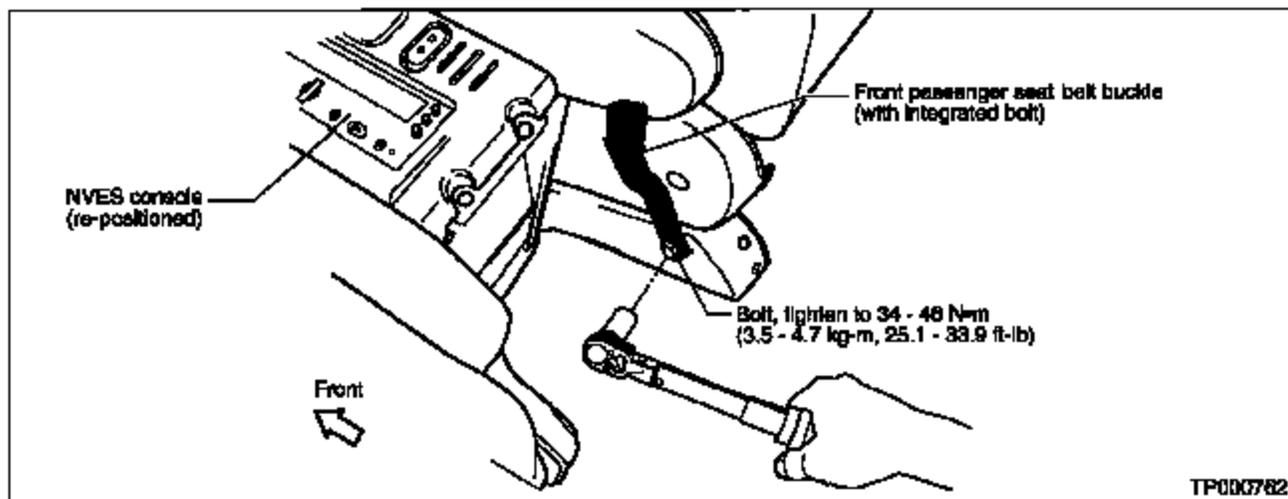


Figure 6

5. Re-install the seat belt buckle trim cover.
6. Confirm the seat belt latch plates insert and correctly latch in the seat belt buckles.

7. Re-install the NVES console as follows:

- A. Verify the wire harness (located under the front of the console) is correctly positioned before lowering the console (see Figure 7). Confirming the harness is properly positioned will prevent it from being pinched/damaged.

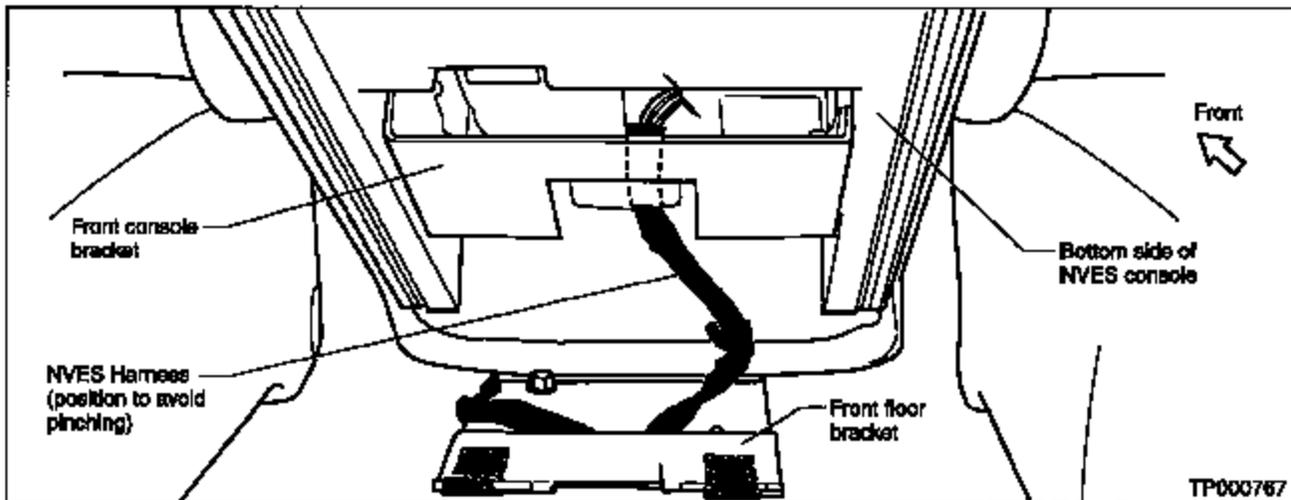


Figure 7

- B. Lower the console into place, then slide the console forward to engage the front bracket of the console with the front floor bracket.

CAUTION:

- Make sure the wire harness does not get kinked or pinched between the console and the front mounting bracket (on the floor).
 - If it is difficult to align the bolts in the rear mounting holes and/or if the bolts are difficult to tighten, lift up the console and make sure the harness is not pinched between the console and the floor. Re-route the harness as necessary and re-seat the console.
 - Be careful not to catch the front edge of the console in the carpet opening (in front of the floor bracket).
- C. Gently pull up on the front of the console to make sure it is engaged (secured) in the front mounting bracket.
- D. Re-install both mounting bolts at the rear of the console.
- E. Re-position the carpet between the front and the second-row seats.

Second Row Bench Seat Belt Buckle Replacement

NOTE: The second row Captain's seats are NOT affected.

1. Fold the top half of the second row bench seat forward (see Figure 8).

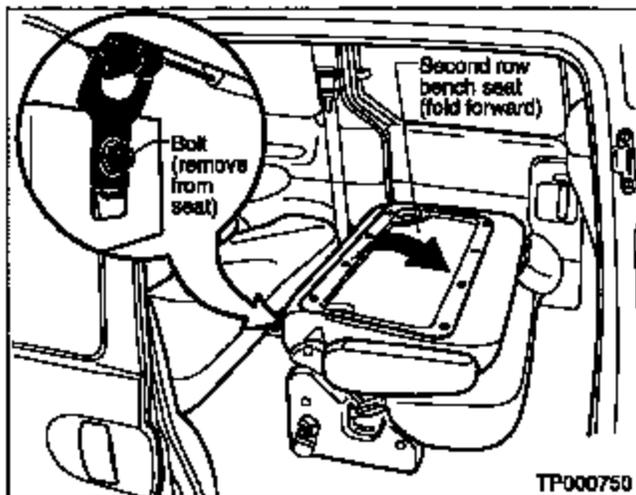


Figure 8

2. Unscrew the bolt and remove the seat belt buckles (see Figure 8).
3. Install the new seat belt buckles and tighten the mounting bolt to 34 – 46 Nm (3.5 – 4.7 Kg-m, 25.1 – 33.9 ft-lbs). See Figure 9.

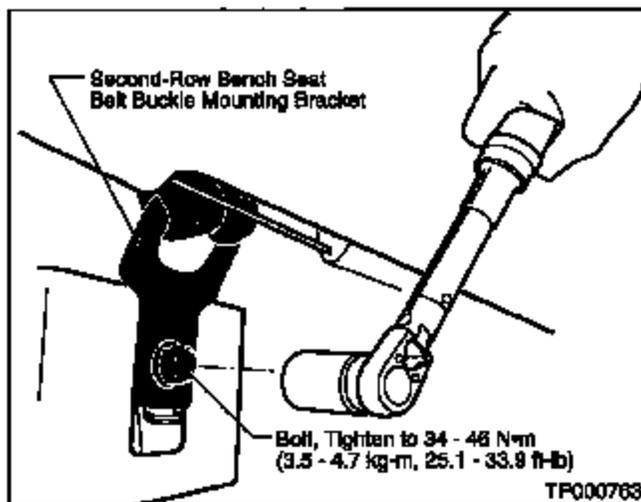


Figure 9

4. Move the seat to its original position.
5. Confirm the seat belt latch plates insert and correctly latch in the seat belt buckles.

Third Row Bench Seat Belt Buckle Replacement

1. Fold up the bottom seat cushion by pulling on the release handle located under the seat and on the passenger side (see Figure 10).

NOTE: Folding up the bottom seat cushion makes it easier to remove and install the seat belt buckles between the bottom and top seat cushions.

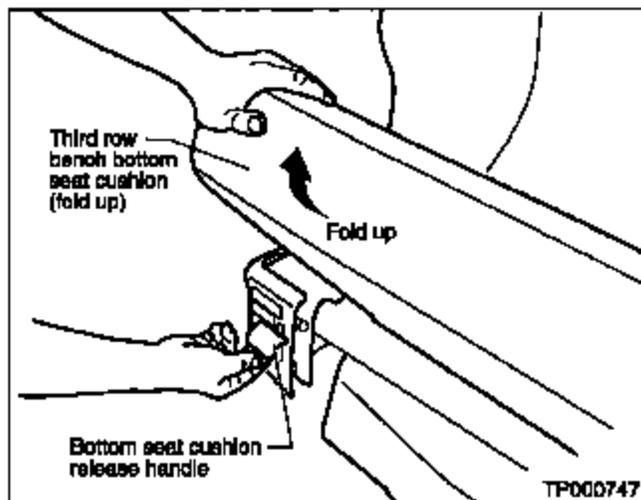


Figure 10

2. Working at the back of the third-row bench seat, remove the bolt(s) and remove the seat belt buckle(s) as required by the Seat Belt Buckle Inspection results (see Figure 11).

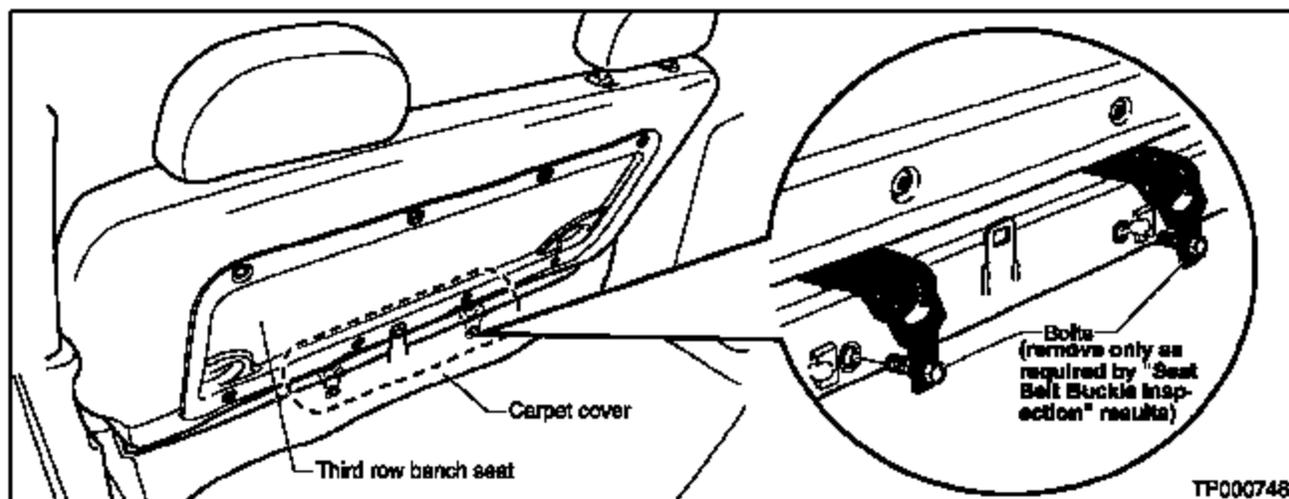


Figure 11

3. Install the new seat belt buckle(s) and tighten the mounting bolt(s) to 34 – 46 Nm (3.5 – 4.7 Kg-m, 25.1 – 33.9 ft-lbs). See Figure 12.

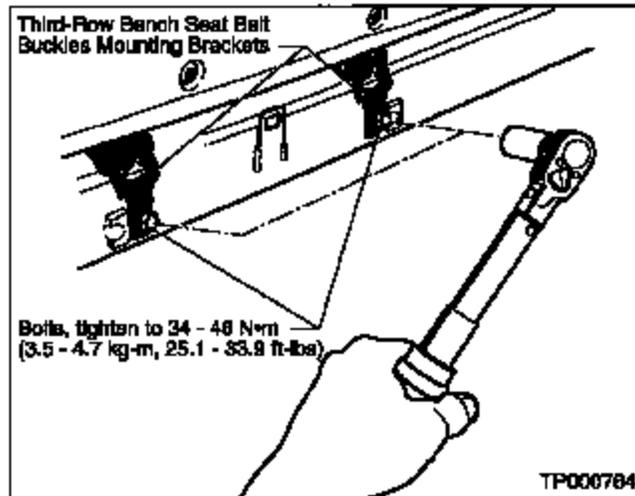


Figure 12

WARNING: Make sure the seat belt buckle mounting bracket(s) is correctly positioned after tightening the mounting bolt(s) (see Figure 13).

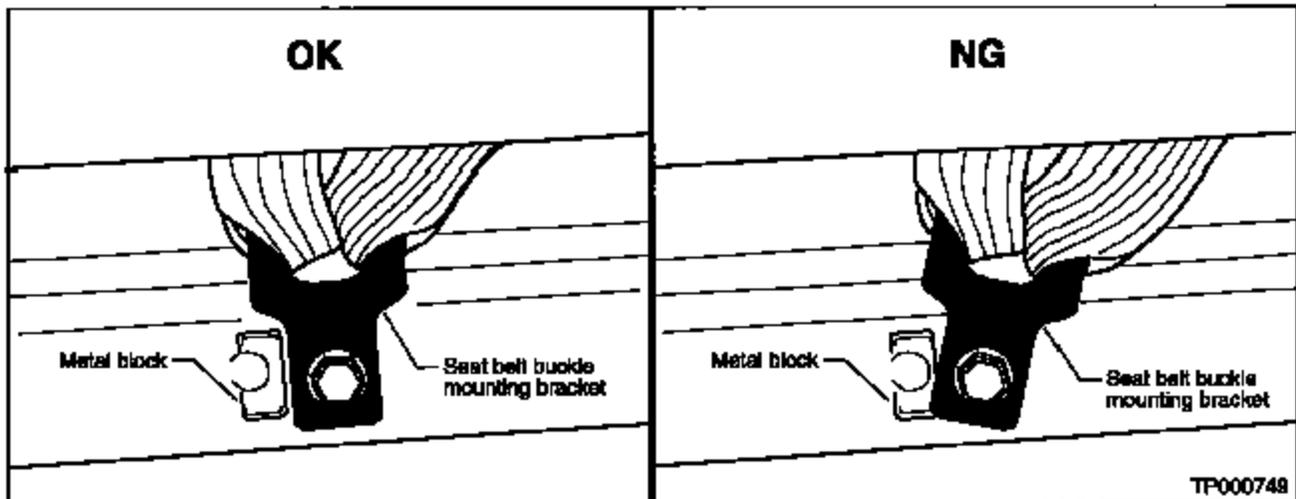


Figure 13

4. Move the bottom seat cushion to its original position, making sure it is locked into position.
5. Confirm the seat belt latch plates insert and correctly latch in the seat belt buckles.

PARTS INFORMATION

DESCRIPTION	PART NUMBER	QTY
Passenger Front Seat Belt Buckle – Slate/Gray	86822-7B027	1*
Passenger Front Seat Belt Buckle – Mocha/Tan	86822-7B026	1*
Second Row Bench Seat Belt Buckle – Mocha/Tan	88842-7B026	1*
Third Row Bench Seat Belt Buckle/Tongue (RH) – Slate/Gray	89822-7B027	1*
Third Row Bench Seat Belt Buckle (LH) – Slate/Gray	89823-7B027	1*
Third Row Bench Seat Belt Buckle (LH) – Mocha/Tan	89823-7B026	1*

* Replace ONLY as required according to the "Seat Belt Buckle Inspection" results.

CLAIMS INFORMATION

Submit a Campaign Line (CM) type claim using the following claims coding:

Campaign I.D.: B0090

DESCRIPTION	OP CODE	FRT
Inspect Seat Belt Buckles	B00900	0.2 hrs
R & R Passenger Front Seat Belt Buckle (includes R & R of Nissan Vehicle Entertainment System Console)	B00901	0.2 hrs
R & R Second-Row Bench Seat Belt Buckle	B00902	0.1 hrs
R & R Third-Row Bench Seat R/H Side Belt Buckle	B00903	0.1 hrs
R & R Third-Row Bench Seat L/H Side Belt Buckle	B00904	0.1 hrs

OWNER'S LETTER

Dear Nissan owner:

This notice is sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act. Nissan has determined that seat belt assemblies in some 2000 model year Nissan Quest vehicles fail to comply with Federal Motor Vehicle Safety Standard No. 209 – Seat Belt Assemblies. This standard specifies various requirements for seat belt assemblies.

Reason for Recall

On some 2000 model year Nissan Quest vehicles, a component of the seat belt buckle assembly for some of the seat belts in your vehicle may not have been manufactured to the proper specification. The buckle assemblies with this component may not meet the strength requirements of Standard No. 209. In the event of a severe crash, the seat belt latch plate may pull out of the buckle, and increase the chance of injury.

What Nissan Will Do

Your Nissan dealer will inspect potentially affected seat belt buckles and replace them, if necessary, at no charge to you. This free service should take about one hour to complete, but your Nissan dealer may require your vehicle for a longer period of time based upon their work schedule, or parts availability.

What You Should Do

Contact your Nissan dealer at your earliest convenience in order to arrange an appointment to have your vehicle repaired. Please bring this notice with you when you keep your service appointment. Instructions have been sent to your Nissan dealer. If the dealer falls, or is unable to make the necessary repairs free of charge, you may contact the National Consumer Affairs Office, Nissan North America, Inc. at P.O. Box 191, Gardena, California 90248-0191. The toll free number is 1-800-NISSAN1 (1-800-647-7261). If you reside in Hawaii, please call 1-808-836-0888.

You may also contact the Administrator of the National Highway Traffic Safety Administration, 400 Seventh Street SW, Washington, D.C. 20590 or call the toll free Safety Hotline at (888) 327-4236.

Thank you for your cooperation. We are indeed sorry for any inconvenience this may cause you.