

RECEIVED

By Recall Management division at 11:02 am, Nov 22, 2013

Part 573 Report

Date: November 20, 2013

This report serves as notification by Jayco Corporation to the National Highway Traffic Safety Administration (“NHTSA”) that a motor vehicle safety-related issue exists in certain travel trailer locks supplied by Fastec Industrial Corp., a division of WESCO Distribution, Inc., for installation in the doors of Recreational Vehicles (“RVs”). Additional information concerning the recalled locks can be found in Fastec’s Part 573 Report that was separately filed on July 11, 2013 with an assigned NHTSA Recall #13E039 EQ,13-006

I. Manufacturer, Designated Agent, and Other Chain of Distribution Information

Filing Firm Name: **Jayco Corporation**
Address 1: 903 South Main
City: Middlebury
State: IN
Postal Code: 46540
Email address: terri_tobias@jayco.com
Telephone: 574-825-5861 x2073
Fax: 574-825-7354
Web Site:

Contact Person: Terri Tobias
Title: Regulatory Compliance Manager
Email address: terri_tobias@jayco.com
Telephone: 574-825-5861 x2073
Fax: 574-825-7354

Importer/Distributor: Fastec Industrial Corp.
2219 Eddie Williams Rd
Johnson City, TN 37601

Manufacturer: Zhongshan Huafeng Locks Co., Ltd.
South of Yongning Industrial Avenue
Xiaolan Town, Zhongshan, Guangdong
People’s Republic of China

II. Identification of the Recall Population and Its Size

Type of Equipment:

The product consists of certain travel trailer locks with a keyed paddle handle and deadbolt (the “locks”) installed in the doors of RVs. Only FIC locks that have an integrated deadbolt are affected by this recall. The RVs potentially affected by the recall are as follows:

Brand: Jayco, Starcraft, Entegra
Model Nos: ALL
Model years: 2006 – 2014.
Body Style/Type: Travel Trailers, Fifth Wheels, Camping Trailers

Total Product Sold:

Jayco Corporation sold a total of **226,560** towable trailers within the timetable of January 1, 2006 and April 30, 2013. This total includes **all** towable product manufactured under the divisions of Jayco Corporation: Jayco, Starcraft and Entegra. The inclusion of all units is due to the fact that there is no way to track what kind of lock was present at the time of production, since the locks are already installed in the door by another vendor prior to delivery to our production lines.

Current Inventory Estimates:

Jayco Corporation has reviewed its current inventory of travel trailers and has no travel trailers in its inventory with any potentially affected locks.

Percentage of Recall Population Estimated to be Affected:

Jayco Corporation believes that some unknown subset of travel trailers with an FIC deadbolt lock sold between January 2006 and April 2013 may potentially be affected. Only upon inspection under the recall will it be clear if unit is affected.

III. Description of Issue and Type of Hazard

In or about June/July 2013, Fastec notified Jayco Corporation that Fastec intended to initiate a recall of the potentially affected locks due to a potential jamming issue with the deadbolt cylinder. If a lock is affected, the key may be able to be removed from the locked door when the key in the deadbolt cylinder is in the horizontal 9 o'clock position, potentially jamming the deadbolt and potentially causing the red lever on the interior side of the lock to become inoperable. In that event, a person inside the travel trailer may not be able to unlock and open the main RV door, but he or she could still exit the trailer from the emergency exit.

IV. The Remedy Program and Its Schedule

Jayco Corporation has submitted retail contact information to Fastec for all units as noted above. Fastec will mail notification to all Jayco, Starcraft and Entegra owners affected. Included in the notification will be the NHTSA approved letter on Fastec Letterhead and the NHTSA approved letter on Jayco Corporation letterhead which will note the Jayco Corporation recall number, once assigned. (Approved NHTSA letters are included)

Jayco Corporation will coordinate the recall efforts with Fastec referring consumers to Fastec for free replacement of the cylinders in any affected locksets as described more fully in Fastec's Part 573 Report.