



RECALL CAMPAIGN BULLETIN

Reference:

NTB14-065

Date:

July 9, 2014

VOLUNTARY SAFETY RECALL CAMPAIGN 2014 NV PASSENGER VAN; SEATBELT RETRACTOR BOLT

CAMPAIGN I.D. #: PC308

APPLIED VEHICLE: 2014 NV Passenger Van (F80)

Check Service Comm to confirm campaign eligibility.

INTRODUCTION

Nissan is conducting a Voluntary Safety Recall Campaign on a small subset of MY2014 NV Passenger Van (F80) vehicles to inspect the Seatbelt Retractor Bolts on the removable passenger seats.

IDENTIFICATION NUMBER

Nissan has assigned identification number PC308 to this campaign. This number must appear on all communications and documentation of any nature dealing with this Campaign.

DEALER RESPONSIBILITY


It is the dealer's responsibility to check Service Comm for the campaign status on each vehicle falling within the range of this voluntary safety recall which for any reason enters the service department. This includes vehicles purchased from private parties or presented by transient (tourist) owners and vehicles in a dealer's inventory. Federal law requires that new vehicles in dealer inventory which are the subject of a safety recall must be corrected prior to sale. Failure to do so can result in civil penalties by the National Highway Traffic Safety Administration. While federal law applies only to new vehicles, Nissan strongly encourages dealers to correct any used vehicles in their inventory before they are retailed.

SERVICE PROCEDURE


For the removable passenger seats only:

Working on one seat at a time:

1. Unzip the seat back covers using a suitable tool (tool shown in Figure 4).
2. Unhook the J-clips that attach the seatback to the bottom of the seat frame.

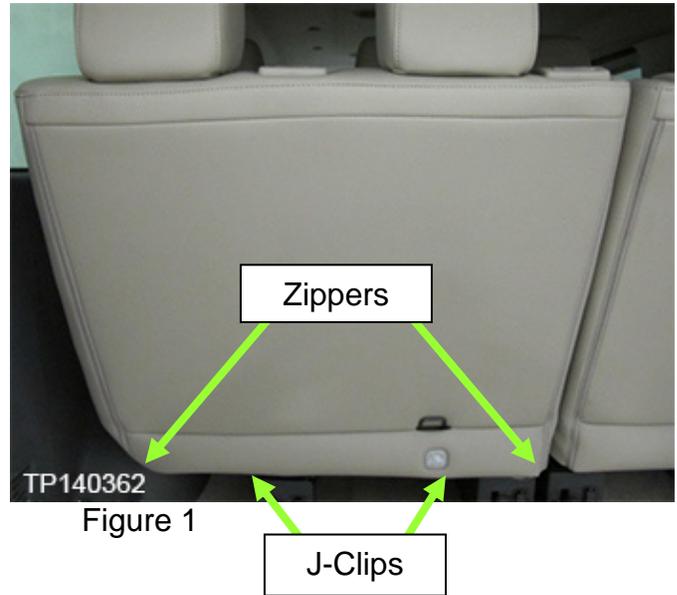

3. Fold the seat back cover forward over the seat to allow a visual inspection of the seat belt retractor retaining bolts (Figure 2).
4. Verify that the seatbelt retractor retaining bolts are in place (Figure 2).

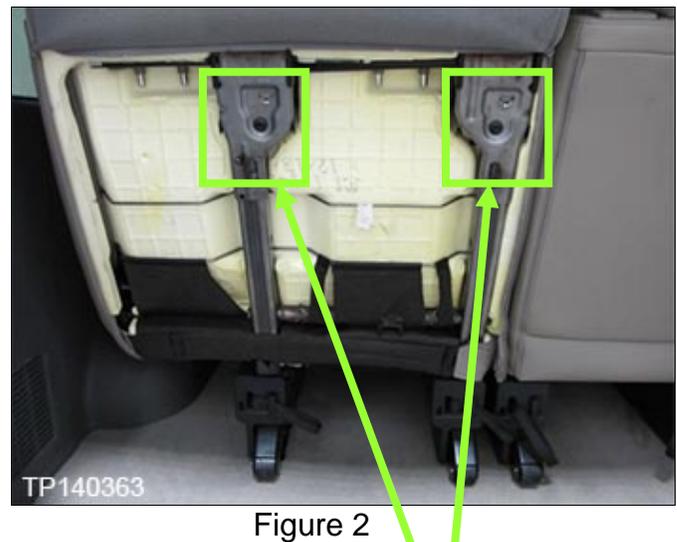

5. Verify the correct torque of each retractor retaining bolt (TORX® T50) with a torque wrench (Figure 3).

Retractor Retaining Bolt Torque:
55 N•m (5.6 kg-m, **40 ft-lb**)

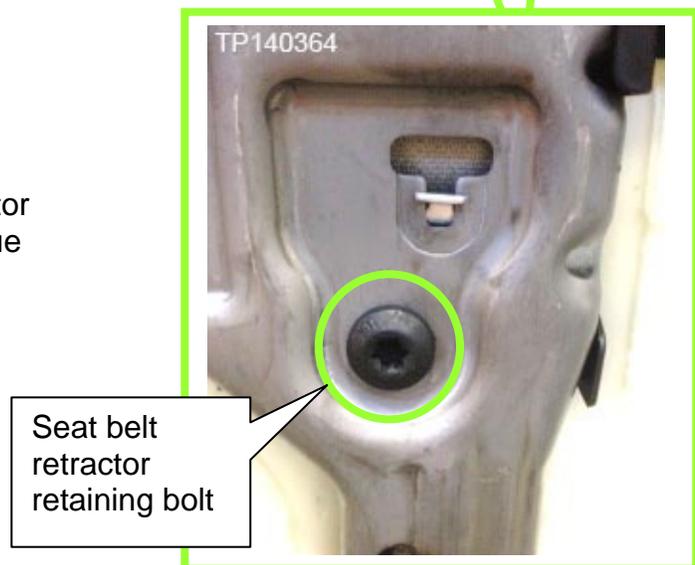


Figure 3

6. Return the rear seat back cover to its original position.
7. Re-hook the J-clips that attach the seatback to the bottom of the seat frame.
8. Zip the seat back covers using a suitable tool (Figure 4).

IMPORTANT: Ensure that the seat back cover is positioned such that the child seat upper tether anchor is clearly visible/exposed and accessible.

9. Repeat steps 1-8 on the rest of the seat belt retractors bolts for all removable passenger seats (up to 10 Total).

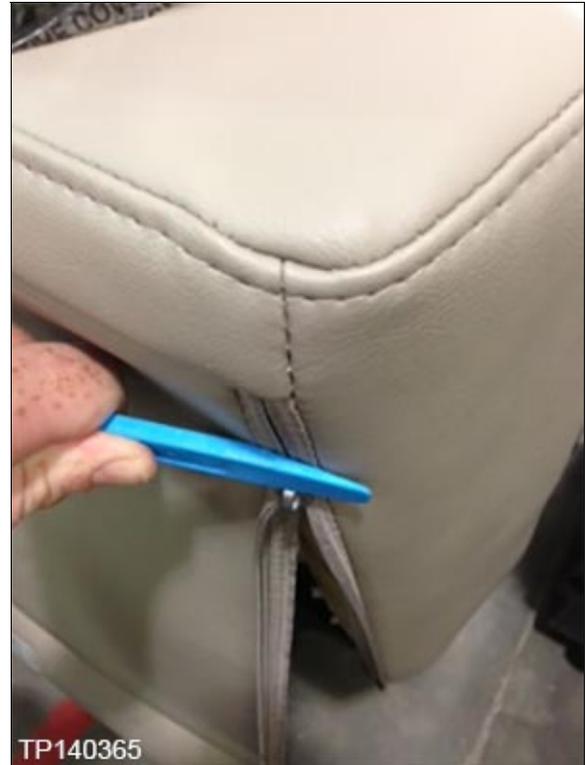


Figure 4

If any of the retractor bolts are missing, as shown in figure 5, replace the bolt(s) with one from the Parts Information table.

Retractor Retaining Bolt Torque:
55 N•m (5.6 kg-m, **40 ft-lb**)

IMPORTANT: Confirm that the T-shaped tab is positioned as shown in Figure 5 before tightening the bolt(s).

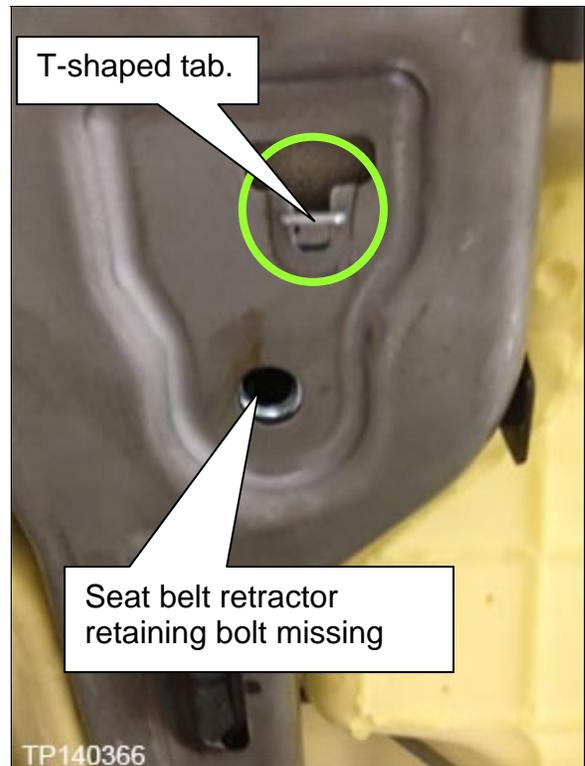


Figure 5

PARTS INFORMATION

DESCRIPTION	PART #	QUANTITY
Seat Belt Retractor Bolt	88798-1PC1A	As needed

CLAIMS INFORMATION

Submit a "CM" line claim using the following claims coding:

"CM" I.D.: PC308

PC308	Inspect torque on Seat Belt Retractor Bolt, and if necessary replace missing bolt.	PC3080	0.6 hrs.
-------	---	--------	----------

