

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2014**

Published October 1, 2014

CHILD SEATS:

None during August 2014.

EQUIPMENT:

Lippert Components, Inc. (Lippert) is recalling certain recreational vehicle frames manufactured February 13, 2014, to February 28, 2014 and equipped with 4.25" spring hangers. The affected spring hangers may fracture. A fracture of the spring hanger while traveling could result in a loss of vehicle control, increasing the risk of a crash. Owners began being notified by their RV manufacturers in April 2014. Dealers for the RV manufacturers will inspect and replace the the spring hangers, as necessary, free of charge. Owners may contact their RV manufacturer or Lippert customer service at 1-574-537-8900.

14E-052

Buyers Products Company (Buyers Products) is recalling certain warning triangles, part numbers ERT10 (3 pack), and ERT01 (single piece) manufactured March 2011 to June 2014. Due to having an insufficiently rigid joint between the base and the triangle and being improperly filled with ballast, the affected triangles may blow over from wind gusts. As such, the triangles fail to comply with Federal Motor Vehicle Safety Standard No. 125 "Warning Devices." If the triangle blows over in wind gusts, such as those from passing vehicles, other drivers may not be adequately warned of a stopped vehicle, increasing the risk of a crash. Buyers Products dealers will notify owners, and refunds will be given for the purchased warning triangles. Buyers Products notified its dealers beginning on August 26, 2014. Owners may contact Buyers Products customer service at 1-440-974-8888. Buyers Products' number for this recall is TSB-ERT10.

14E-054

Thermo King Corporation (Thermo King) is recalling certain 1100W, 1500W, and 2000W inverters sold May 15, 2014, to July 31, 2014, as a standalone option with both the Thermo King TriPac EVOLUTION and TriPac-e Auxiliary Power Units ("APU"). The Thermo King inverters provide 120V AC household power to a tractor cabin. The inverters may spark or overheat, resulting in a potential fire. An inverter fire may result in a vehicle fire. Thermo King will notify owners, and dealers will either replace the inverter free of charge or offer a full refund. The recall is expected to begin in October 2014. Owners may contact Thermo King customer service at 1-866-776-2708.

14E-055

Agility Fuel Systems (Agility) is recalling certain model Side-Mount compressed natural gas (CNG) Fuel Systems, Part No. 23736011, manufactured August 1, 2013, to August 21, 2014 and equipped with Motion Industries T1700-06 flexible fuel hoses. The stainless steel braid reinforcement may corrode prematurely near the fitting crimp inside the slave tank enclosure. If the corrosion progresses and goes undetected, the hose could begin to leak CNG, increasing the risk of a fire in the presence of an ignition source. Agility will notify owners, and dealers will replace the defective hose assemblies, free of charge. The recall is expected to begin in September 2014. Owners may contact Agility customer service at 1-949-236-5520.

14E-056

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2014**

Published October 1, 2014

Navistar, Inc. (Navistar) is recalling certain FLTTRIKIT3 warning triangle kits manufactured August 15, 2012, to July 25, 2014. The affected warning triangles may reflect an inadequate amount of light. As such, these warning triangles fail to comply with Federal Motor Vehicle Safety Standard No. 125, "Warning devices." Warning triangles that do not properly reflect light may fail to warn others that a vehicle is parked, increasing the risk of a crash. Navistar will send notices to all North American dealers to post recall notices at their service desks and service parts counters, to provide dealer communications for contacting their customers regarding the suspect triangle kits, and provide customers with a replacement triangle replacement kit, free of charge. The recall is expected to begin on October 20, 2014. Owners may contact Navistar customer service at 1-800-448-7825. Navistar's number for this recall is 14513.

14E-057

TIRES:

Continental Tire the Americas, LLC (Continental) is recalling certain ContiAttack SM, ContiSportAttack, ContiSportAttack2, ContiRaceAttack Comp. Soft, ContiRaceAttack Comp. Medium, ContiRaceAttack Comp. Endurance, and ContiRoadAttack 2 GTW motorcycle tires, in sizes 120/70ZR17 and 120/70R17. For a complete list of affected tire identification numbers and affected dates of production please see the "Defect Notice (Part 573)" in the Associated Documents area. The subject tires may experience a separation between the tread, belt, and carcass resulting in a loss of tire inflation pressure. A loss of tire inflation could increase the risk of a motorcycle crash. Continental will notify owners, and dealers will replace the subject tires with new tires, free of charge. The recall is expected to begin in October 2014. Owners may contact Continental customer service at 1-800-847-3349.

14T-009

TBC Corporation (TBC) is recalling certain Wild Country Radial XTX Sport tires, size 265/65R18, manufactured by Cooper Tire and Rubber Company from June 1, 2014, to June 28, 2014 (weeks 2214-2514). The affected tires may experience cracking or broken ply cords in the lower sidewall on the white sidewall side. As such, these tires fail to comply with the regulations of the Federal Motor Vehicle Safety Standard No. 139, "New Pneumatic Radial Tires For Light Vehicles." A tire with sidewall cracking and broken ply cords may have a sudden loss of air pressure, increasing the risk of tire failure and a crash. TBC will notify owners, and dealers will replace any affected tires, free of charge. The recall began on September 2, 2014. Owners may contact TBC customer service at 1-800-739-7698. TBC's number for this recall is 159.

14T-010

VEHICLES:

Porsche Cars North America, Inc. (Porsche) is recalling certain model year 2015 Macan vehicles. During manufacturing, the brake booster may have been damaged during installation. If the brake booster was damaged during installation, the vacuum in the brake booster may drop when the brakes are actuated, resulting in a reduced brake force boost, increasing the risk of a crash. Porsche will notify owners, and dealers will inspect and replace the brake booster, as necessary, free of charge. The manufacturer has not yet provided a notification

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2014**

Published October 1, 2014

schedule. Owners may contact Porsche customer service at 1-800-545-8039. Porsche's number for this recall is AE02.

14V-470

Subaru of America, Inc. (Subaru) is conducting a limited regional recall for certain model year 2003-2005 Subaru Legacy, Outback, and Baja vehicles, as well as 2004-2005 Subaru Impreza (including WRX/STI) vehicles, that are currently or have ever been registered in Florida, Puerto Rico, Hawaii and the U.S. Virgin Islands, and equipped with Takata-brand passenger side air bag inflators. Upon deployment of the passenger side frontal air bag, excessive internal pressure may cause the inflator to rupture. In the event of a crash necessitating deployment of the passenger side frontal air bag, the inflator could rupture with metal fragments striking and potentially seriously injuring the vehicle occupants. Subaru will notify owners, and dealers will replace the passenger side air bag inflators free of charge. The recall is expected to begin in October 2014. Owners may contact Subaru at 1-800-782-2783. Owners of Saab vehicles should call toll-free at 1-800-955-9007.

14V-471

American Honda Motor Co., Inc. (Honda) is recalling certain model year 2001-2010 and 2012 GL1800 and 2001-2005 GL1800A motorcycles. The rear brakes of the affected motorcycles may drag after the brakes are released. A rear brake that drags may increase the risk of a vehicle crash. Additionally, extended riding with the rear brake dragging could generate enough heat to result in a fire. The remedy for this issue has not been determined. Honda will send owners an interim notification describing how to inspect their motorcycle for rear brake drag. A second notification will be sent when a remedy is available. The recall is expected to begin in September 2014. Owners may contact Honda customer service at 1-866-784-1870. Note: Motorcycles that were remedied under recall 11V-567 for rear brake drag must have their motorcycles remedied again under this campaign.

14V-472

Nova Bus (Nova) is recalling certain model year 2013 Nova LFS transit buses. The bolt used to secure the windshield wiper linkage to the wiper motor may become loose over time. If the windshield wiper linkage loosens from the wiper motor, the wipers may become inoperable, reducing the driver's visibility and increasing the risk of a crash. Nova will notify owners, and dealers will replace the bolt and nut that attach the windshield wiper linkage to the wiper motor, free of charge. The recall is expected to begin in late September 2014. Owners may contact Nova customer service at 1-800-350-6682.

14V-473

Vanco USA, LLC (Vanco) is recalling certain model year 2015 Semi-Trailers, model 2WIL2A530SAR114/116, manufactured in April 2014, and equipped with certain SAF-Holland-brand CBX Trailer Suspension Air Ride Axle Systems. The affected trailer suspensions have pivot bolts that may fail. Failure of the pivot bolts may cause the suspension and attached axle to separate from the trailer, increasing the risk of a crash. Vanco will notify owners, and SAF-Holland-approved repair shops will replace the defective pivot bolts with new pivot bolts, free of charge. The recall began in August 2014. Owners may contact Vanco customer service at 1-609-499-4141 or SAF-Holland at 1-888-396-6501.

14V-474

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2014**

Published October 1, 2014

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain model year 2008-2014 FJ Cruiser and Tacoma vehicles equipped with accessory wheels and tires installed by Toyota or dealers prior to the vehicle's first sale. The affected vehicles may list incorrect spare tire size and/or cold tire inflation information on the tire placard. As such, these vehicles fail to comply with Federal Motor Vehicle Safety Standard No. 110, "Tire Selection and Rims for Passenger Cars." If the spare tire is inflated to the incorrect pressure provided on the placard, tire failure may occur while it is being driven on, increasing the risk of a crash. For the involved vehicles, overlay stickers to correct the tire placard will either be mailed to owners or provided to dealers for placement over the incorrect information on the placard. The recall is expected to begin in September 2014. Owners may contact Toyota customer service at 1-800-331-4331.

14V-475

Grand Design RV, LLC (Grand Design) is recalling certain model year 2014 Momentum 355th, 380th, and 385th fifth wheel trailers manufactured June 24, 2013, to March 21, 2014 and built with 8,000lb capacity axles. The affected trailers may have been built with suspension bolts that can shear. These bolts connect the axle springs to the frame, and after they shear, the axle spring may detach from the frame hanger or "shackle". A spring that detaches from the hanger may result in a loss of control of the trailer, increasing the risk of a crash. Grand Design will notify owners, and dealers will replace the suspension bolts with ones that have a shorter thread depth, free of charge. The recall began in August 2014. Owners may contact Grand Design customer service at 1-574-825-9679. Grand Design's number for this recall is 910002.

14V-476

Daimler Trucks North America LLC (Daimler) is recalling certain model year 2006-2015 Thomas Built Buses FS-65, Saf-T-Liner C2, Saf-T-Liner HDX, Saf-T-Liner EF, Saf-T-Liner EFX, and Minotour DRW school buses manufactured January 3, 2006, to August 1, 2014. The affected vehicles are equipped with certain model S2005, S2010, S5005, S5010, S5505, and S5510 wheelchair lifts manufactured by Ricon Corporation. The platform side plate of the affected wheelchair lifts may crack. If the platform side plates crack, the lift platform can separate from the lift and come to rest against the vehicle's lift door. When the doors are opened, the platform may fall out, increasing the risk of injury to the lift operator. Daimler will notify owners, and dealers will install supplemental platform support bumpers. Any platform that has already started cracking will be replaced, free of charge. The recall is expected to begin on October 2, 2014. Owners may contact Daimler customer service at 1-800-385-4357. Daimler's number for this recall is FL-663.

14V-477

Daimler Trucks North America (Daimler) is recalling certain model year 2006-2015 Thomas Built Buses Saf-T-Liner HDX, Saf-T-Liner EF, Saf-T-Liner EFX, and Minotour DRW transit buses manufactured January 3, 2006, to August 1, 2014. The affected vehicles are equipped with certain model S2005, S2010, S5005, S5010, S5505, and S5510 wheelchair lifts manufactured by Ricon Corporation. The affected vehicles are equipped with certain model S2005, S2010, S5005, S5010, S5505, and S5510 wheelchair lifts manufactured by Ricon Corporation. The platform side plate of the affected wheelchair lifts may crack. If the platform side plates crack, the lift platform can separate from the lift and come to rest against the vehicle's lift door. When the doors are opened, the platform may fall out, increasing the risk of injury to the lift operator. Daimler will notify owners, and dealers will install supplemental platform support bumpers. Any platform that has already started

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2014**

Published October 1, 2014

cracking will be replaced, free of charge. The recall is expected to begin on October 2, 2014. Owners may contact Daimler customer service at 1-800-385-4357. Daimler's number for this recall is FL-663.

14V-478

Kaffenbarger Truck Equipment Company (Kaffenbarger) is recalling certain model year 2012-2013 Ford F-550 Super Duty vehicles modified by Kaffenbarger and equipped with certain Muncie Power Products PTO Assemblies. In the affected vehicles, oil may leak from the PTO pressure switch onto a thermal blanket covering the exhaust. The leaking oil may soak into the thermal blanket covering the exhaust, which when combined with heat from exhaust, may result in an increased risk of fire. Kaffenbarger will notify owners, and dealers will replace the old PTO assembly with a new pressure switch kit, free of charge. The recall began during September 2014. Owners may contact Kaffenbarger customer service at 1-877-465-5832.

14V-479

Chrysler Group LLC (Chrysler) is recalling certain model year 2015 Chrysler 200 vehicles manufactured May 19, 2014, to June 21, 2014. The affected vehicles may have been built with a driver side door wiring harness of an insufficient wire gauge, resulting in excessive heat which may melt the wiring insulation. Excessive heat and melting wiring insulation may result in an electrical short, increasing the risk of a fire. Chrysler will notify owners, and dealers will replace the door wiring harness, free of charge. The recall is expected to begin in September 2014. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is P43.

14V-480

Chrysler Group LLC (Chrysler) is recalling certain model year 2014-2015 Fiat 500L vehicles manufactured March 3, 2012, to July 25, 2014. Irregularities in the folding process during assembly of the driver's knee airbag may result in its improper deployment. As such, these vehicles fail to comply with Federal Motor Vehicle Safety Standard No. 208, "Occupant Crash Protection." If the knee airbag air bag does not deploy properly during a crash, there is an increased risk of driver injury. Chrysler will notify owners, and dealers will replace the driver's knee air bag, free of charge. The recall is expected to begin in September 2014. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is P42.

14V-481

Ford Motor Company (Ford) is recalling certain model year 2015 Transit vehicles manufactured April 3, 2014, to May 27, 2014 built at the Kansas City Assembly Plant (KCAP). The affected vehicles may experience a brake fluid leak at the rear caliper brake hose joint. This could cause illumination of the red brake warning lamp and display the "Brake Fluid Low-Service Now" message causing needed increased stopping distance. If the rear caliper brake hose leaks brake fluid it will increase the stopping distance needed, and increase the risk of a vehicle crash. Ford will notify owners, and dealers will replace the sealing washers on both rear brake caliper to brake hose joints, free of charge. The recall began in August 2014. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 14S15.

14V-482

Ford Motor Company (Ford) is recalling certain model year 2015 Transit cargo vans without rear seating

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2014**

Published October 1, 2014

positions manufactured March 12, 2014, to June 24, 2014 and equipped with windowless sliding doors. The affected vehicles may have been manufactured without the epoxy reinforcement on the windowless sliding doors. A sliding door without the epoxy reinforcement has an increased potential of unlatching in certain side impact crashes. A door that unlatches may open, allowing for a vehicle occupant to be ejected in a crash, increasing the risk of injury. Ford will notify owners, and dealers will install a reinforcement plate into the windowless sliding door, free of charge. The recall is expected to begin during September 2014. Owners may contact Ford customer service at 1-800-392-3673. Ford's number for this recall is 14S16.

14V-483

Ford Motor Company (Ford) is recalling certain model year 2015 Lincoln MKC vehicles manufactured August 20, 2013, to June 6, 2014 built at the Louisville Assembly Plant. The affected vehicles may experience air bubbles in the windshield. Thus, these vehicles fail to comply with the requirements of the Federal Motor Vehicle Safety Standards No. 205, "Glazing Materials." If air bubbles exist in the windshield it could impact the occupants ability to see, increasing the risk of a vehicle crash. Ford will notify owners, and dealers will inspect the windshield for air bubbles and replace if necessary, free of charge. The recall began in August 2014. Owners may contact Ford customer service at 1-800-392-3673. Ford's number for this recall is 14C07.

14V-484

Newmar Corporation (Newmar) is recalling certain model year 2014 Dutch Star motorhomes manufactured April 14, 2014, to June 20, 2014. An incorrectly wired headlight wiring harness may have been installed in the affected vehicles. As a result, if one of the two headlight circuit breakers fails, both headlights and both fog lights may go out. If the headlights and fog lights go out, there is an increased risk of a crash. Newmar will notify owners, and dealers will install an auxillary headlight harness, free of charge. The recall is expected to begin in September 2014. Owners may contact Newmar customer service at 1-800-731-8300.

14V-485

PACCAR Incorporated (PACCAR) is recalling certain model year 2015 Kenworth K270, T270, K370, T370, T440, T470, and W900 chassis manufactured May 13, 2014, to July 23, 2014, and certain model year 2015 Peterbilt 210, 220, 320, 325, 330, 337, 348, 365, 382, 384, and 567 chassis manufactured May 8, 2014, to July 22, 2014. The Cummins ISB or ISL engines in these vehicles may have been equipped with Fleetguard UFF-XT fuel filters, part number FF63009, whose filter shell may separate from the fuel filter nut plate causing the engine to stall without warning. If the engine stalls unexpectedly there is an increased risk of a crash. Cummins will notify owners on behalf of PACCAR, and Cummins dealers will replace the fuel filter with a non-defective one, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Kenworth customer service at 1-425-828-5000, or Peterbilt customer service at 1-940-591-4000. Owners may also contact Cummins customer service at 1-812-377-3713. Kenworth's number for this recall is 14KWJ. Peterbilt's number for this recall is 814-H.

14V-486

Ferrari North America, Inc. (Ferrari) is recalling certain model year 2010-2014 F458 Italia and F458 Spider vehicles manufactured March 5, 2010, to May 20, 2013. In the affected vehicles, the secondary latch for the front trunk storage compartment may not release when the vehicle is stationary. As such, these vehicles fail to

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2014**

Published October 1, 2014

comply with the requirements of Federal Motor Vehicle Safety Standard No. 401, "Interior Trunk Release." In the event an individual is trapped in the trunk and the latch system does not release the trunk lid, it increases the risk of personal injury or possibly death. Ferrari will notify owners, and dealers will modify the existing front trunk latch system with a new component that will meet requirements, free of charge. The recall began in September 2014. Owners may contact Ferrari customer service at 1-866-551-2828. Ferrari's number for this recall is 54.

14V-487

General Motors LLC (GM) is recalling certain model year 2013 Buick Encore vehicles manufactured August 23, 2012, to March 1, 2013, and model year 2013 Cadillac ATS vehicles manufactured April 23, 2012, to May 1, 2013. In the affected vehicles, the driver and passenger lap belt pretensioner cables may not lock in a retracted position, allowing the seat belts to extend when pulled upon. If the seat belts do not remain locked in the retracted position when under load, the seat occupant may not be adequately restrained in a crash, increasing the risk of injury. GM will notify owners, and dealers will replace both front the driver's and the passenger's lap belt pretensioners, free of charge. Parts are not currently available. GM will send an interim notification in early October 2014 and will send a second notification when remedy parts are available. Owners may contact Buick customer service at 1-800-521-7300, or Cadillac customer service at 1-800-458-8006. GM's number for this recall is 14171.

14V-488

General Motors LLC (GM) is recalling certain model year 2014-2015 Chevrolet Impala vehicles manufactured May 7, 2014, to July 28, 2014. In the event of an accident, the center storage console may not stay latched. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard No. 201, "Occupant Protection In Interior Impact." The storage compartment door may not remain closed in the event of a crash, increasing the risk of occupant injury. Parts to remedy this condition are not currently available. GM will send owners an interim notification in early October 2014, and will send a second letter when parts are available. At that time dealers will replace the console storage compartment door inertia latch, free of charge. Owners may contact Chevrolet customer service at 1-800-222-1020. GM's number for this recall is 14476.

14V-489

General Motors LLC (GM) is recalling certain model year 2002-2004 Saturn Vue vehicles manufactured September 11, 2001, to April 6, 2004. In the affected vehicles, it may be possible for the key to be removed from the ignition when the ignition is not in the "Off" position. If the key can be removed from the ignition when the ignition is not in the "off" position, the vehicle could roll away: (a) for an automatic transmission, if the transmission is not in the "Park" position; or (b) for a manual transmission, if the parking brake is not engaged and the transmission is not in the "Reverse" position. This potential for rollaway increases the risk for a crash and occupant or pedestrian injuries. GM will notify owners, and dealers will inspect the vehicle to see if the key can be pulled out when the ignition is off. If it can, dealers will replace the ignition cylinder and keys, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Saturn customer service at 1-800-553-6000. GM's number for this recall is 14506. Note: Until a vehicle has been remedied, owners and operators are advised that when exiting, to be sure that the vehicle is in "Park," or in the case of a manual transmission, that the vehicle is in the "Reverse" position and the parking brake is engaged.

14V-490

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2014**

Published October 1, 2014

All Wheel Drive Equipment Mfg., Inc. (All Wheel) is recalling certain 2011-2012 Ford F-550 Super Duty chassis with a 6.8L gasoline engine, modified by All Wheel and equipped with certain Muncie Power Products PTO Assemblies. In the affected vehicles, oil may leak from the PTO pressure switch onto a thermal blanket covering the exhaust. The leaking oil may soak into the thermal blanket covering the exhaust, which when combined with heat from exhaust, may result in an increased risk of fire. All Wheel has notified the affected owners, and dealers will install a new pressure switch kit that moves the switch away from the exhaust system, free of charge. Owners were notified on June 10, 2014 by certified mail. Owners may contact All Wheel customer service at 1-800-311-4778.

14V-491

Vanair Manufacturing, Inc. (Vanair) is recalling certain model year 2009-2013 Ford F-350, F-450, and F-550 SuperDuty chassis modified by Vanair and equipped with certain Muncie Power Products PTO Assemblies used with model 60-85 UDSM, 125-185 USDM, and Genair 125-185 driven air compressor systems. In the affected vehicles, oil may leak from the PTO pressure switch onto a thermal blanket covering the exhaust. The leaking oil may soak into the thermal blanket covering the exhaust, which when combined with heat from exhaust, may result in an increased risk of fire. Vanair will notify owners, and dealers will inspect and install a new pressure switch kit that moves the switch away from the exhaust system, free of charge. The recall is expected to begin in September 2014. Owners may contact Vanair customer service at 1-800-526-8817.

14V-494

Ford Motor Company (Ford) is recalling certain model year 2013-2014 Escape vehicles manufactured October 5, 2011, to April 1, 2013, and equipped with 2.0 liter engines and Focus ST vehicles manufactured February 14, 2012, to October 14, 2013, and equipped with 2.0 liter engines. Insufficient compression in the engine wiring harness splices to the Manifold Absolute Pressure (MAP) sensor may provide incorrect signals to the powertrain control module (PCM). The incorrect signals could cause the vehicle to hesitate or the engine to stall, increasing the risk of a crash. Ford will notify owners, and dealers will replace the current crimped splices with new splices, free of charge. The recall is expected to begin September 29, 2014. Owners may contact Ford customer service at 1-800-392-3673. Ford's number for this recall is 14S17.

14V-495

Versalift East, LLC (Versalift) is recalling certain Aerial devices manufactured on 2009-2013 Ford, F-350, F-450, and F-550 Super Duty 6.8L gas engine chassis, modified by Versalift and equipped with certain Muncie Power Products FR67 PTO Assemblies. In the affected vehicles, oil may leak from the PTO pressure switch onto a thermal blanket covering the exhaust. The leaking oil may soak into the thermal blanket covering the exhaust, which when combined with heat from exhaust, may result in an increased risk of fire. Versalift will notify owners, and dealers will install a new pressure switch kit that moves the switch away from the exhaust system, free of charge. The recall began on September 14, 2014. Owners may contact Versalift customer service at 1-888-866-1400.

14V-496

PJ's Truck Bodies & Equipment Co., (PJ's) is recalling certain 2009-2013 Ford F-350, F-450, and F-550 Super Duty chassis modified by PJ's and equipped with certain Muncie Power Products PTO Assemblies. In

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2014**

Published October 1, 2014

the affected vehicles, oil may leak from the PTO pressure switch onto a thermal blanket covering the exhaust. The leaking oil may soak into the thermal blanket covering the exhaust, which when combined with heat from exhaust, may result in an increased risk of fire. PJ's has notified owners and dealers will install a new pressure switch kit that moves the switch away from the exhaust system, free of charge. The recall began on August 28, 2014. Owners may contact PJ's customer service at 1-866-475-8782.

14V-498

Forest River, Inc. (Forest River) is recalling certain model year 2012-2015 Coachmen 2150LE Prism motor homes manufactured July 2011 to May 2014. Due to the welds being in an improper location, the liquid propane (LP) tank support braces may not be secure, allowing the LP tank to drop and fall off the vehicle while in transit. If the LP tank drops or falls off the vehicle while in transit, there is an increased risk of fire or explosion. Forest River will notify owners, and dealers will install a repair kit, free of charge. The recall is expected to begin during October 2014. Owners may contact Coachmen customer service at 1-800-353-7383.

14V-499

General Motors LLC (GM) is recalling certain model year 2011-2014 Chevrolet Express compressed natural gas (CNG) vehicles manufactured September 10, 2010, to April 28, 2014, and GMC Savana CNG vehicles manufactured May 23, 2011, to April 21, 2014. The affected vehicles may leak natural gas from the CNG high pressure regulator. A natural gas leak in the presence of an ignition source increases the risk of a fire or explosion. GM will notify owners, and dealers will replace the high pressure regulator, free of charge. The manufacturer has not yet provided a notification date. Owners may contact Chevrolet customer service at 1-800-222-1020 or GMC customer service at 1-800-462-8782. GM's number for this recall is 14321.

14V-500

Adrian Steel Company (Adrian) is recalling certain model year 2012 Ford E-150, E-250 and E-350 Commercial Cargo Vans modified by Adrian between September 21, 2012, to September 24, 2012. The affected vehicles are equipped with certain propane fuel system conversion kits with an aluminum fuel line fitting manufactured by Roush CleanTech. Due to a reaction between the different metals, the affected kits may develop a propane leak where the aluminum fuel line fitting contacts the brass supply valve housing. A propane leak in the presence of an ignition source increases the risk of a fire. Adrian will notify owners, and dealers will replace the aluminum fuel line fittings with stainless steel fittings, free of charge. The recall began during July 2014. Owners may contact Adrian customer service at 1-800-677-2726.

14V-501

Jayco, Inc. (Jayco) is recalling certain model year 2014-2015 Precept motorhomes manufactured January 3, 2013, to July 14, 2014. Due to the routing and inadequate protection of the wiring for the driver's and passenger's electric seats, the wires may get damaged by the seats moving up and down, and back and forth. Damaged wires may short, increasing the risk of a fire. Jayco will notify owners, and dealers will reroute the electric seat wires and install an additional 10 amp circuit breaker, free of charge. The recall began in September 2014. Owners may contact Jayco customer service at 1-800-283-8267.

14V-502

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2014**

Published October 1, 2014

Altec Industries, Inc. (Altec) is recalling certain model year 2000-2013 Aerial Device and Digger Derrick trucks, equipped with Sure Power Battery Equalizers containing a particular epoxy sealing, aka 'potting', compound. The specific potting compound used in the subject products for insulation was found to be capable of conducting electricity after being exposed to heat. Once electrically conductive, the material is capable of melting and burning, increasing the risk of a fire. Altec will notify owners, and dealers will replace any affected battery equalizer, free of charge. The recall is expected to begin in September 2014. Owners may contact Altec customer service at 1-877-462-5832. Altec's number for this recall is CSN 603.

14V-503

Dakota Trailer Manufacturing, Inc. (Dakota) is recalling certain model year 2014 Air Ride Grain aggregate trailers manufactured October 2013 to January 2014, and Air Ride side dump trailers manufactured December 2013 to December 2014, and equipped with certain SAF-Holland-brand CBX Trailer Suspension Air Ride Axle Systems. The affected trailer suspensions have pivot bolts that may fail. Failure of the pivot bolts may cause the suspension and attached axle to separate from the trailer, increasing the risk of a crash. Dakota began notifying owners in August 2014. Dealers or SAF-Holland-approved repair shops will replace the defective pivot bolts with new pivot bolts, free of charge. Owners may contact Dakota customer service at 1-605-665-8415, or SAF-Holland customer service at 1-888-396-6501.

14V-504

Spartan Motors Chassis, Inc. (Spartan) is recalling certain model year 2014-2015 Gladiator emergency vehicles, 2013-2014 Metrostar emergency vehicles, 2015 motorhome chassis, and 2015 school buses chassis. The Cummins ISB or ISL engines in these vehicles may have been equipped with Fleetguard UFF-XT fuel filters, part number FF63009, whose filter shell may separate from the fuel filter nut plate causing the engine to stall without warning. If the engine stalls unexpectedly, there is an increased risk of a crash. Spartan has notified the final stage manufacturers, and Cummins will replace the affected fuel filters, free of charge. The recall began in August 2014. Owners may contact Spartan customer service at 1-517-543-6400. Owners may also contact Cummins customer service at 1-800-223-4583.

14V-505

Winnebago Industries, Inc. (Winnebago) is recalling certain model year 2015 Winnebago Vista and Itasca Sunstar motorhomes manufactured April 26, 2014, through June 27, 2014. The affected vehicles may be missing a damper plate on the inside air conditioner shroud. This damper plate is to help prevent disruption of the range flame by air discharge from the roof air conditioner. If the air conditioner blows out the range flame but the propane gas continues to flow, an ignition source may ignite the leaking propane, resulting in a fire. Winnebago will notify owners, and dealers will remove the current diverter and replace it with a damper plate, free of charge. The recall is expected to begin in September 2014. Owners may contact Winnebago customer service at 1-800-537-1885. Winnebago's number for this recall is 131.

14V-506

Jerr-Dan Corporation (Jerr-Dan) is recalling certain model year 2009-2014 Ford F-350 Super Duty, F-450 Super Duty, and F-550 Superduty chassis modified by Jerr-Dan and equipped with certain Muncie Power Products PTO Assemblies. In the affected vehicles, oil may leak from the PTO pressure switch onto a thermal

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2014**

Published October 1, 2014

blanket covering the exhaust. The leaking oil may soak into the thermal blanket covering the exhaust, which when combined with heat from exhaust, may result in an increased risk of fire. Jerr-Dan will notify owners, and dealers will install a new pressure switch kit that moves away from the exhaust system, free of charge. The recall is expected to begin in October 2014. Owners may contact Jerr-Dan customer service at 1-800-926-9666.

14V-507

NABI Bus, LLC (NABI) is recalling certain model year 2014 LFW and BRT transit buses manufactured May 2, 2014, to August 8, 2014. The Cummins ISB or ISL engines in these vehicles may have been equipped with Fleetguard UFF-XT fuel filters, part number FF63009, whose filter shell may separate from the fuel filter nut plate causing the engine to stall without warning. If the engine stalls unexpectedly, there is an increased risk of a crash. NABI will work with Cummins to notify owners, and Cummins service centers will install a new fuel filter, free of charge. The recall began in September 2014. Owners may contact NABI customer service at 1-256-831-4296 or Cummins customer service at 1-800-223-4583. NABI's number for this recall is 20144.

14V-508

Starcraft RV (Starcraft) is recalling certain model year 2015 16RB Launch travel trailers equipped with the Extreme Package Option, manufactured April 16, 2014, to April 21, 2014. The information on the Federal ID label incorrectly indicates an 80psi cold tire inflation pressure instead of the correct pressure of 50psi. As such, these vehicles fail to comply with Federal Motor Vehicle Safety Standard No. 120, "Tire selection and rims and motor home/recreation vehicle trailer load carrying capacity information for motor vehicles with a GVWR of more than 4,536 kilograms (10,000 pounds)." If the user inflates the tire to the incorrect psi noted on the label, a tire blowout could occur, increasing the risk of a crash. Starcraft will notify owners, and dealers will remove the incorrect labels and replace them with a new label with the correct information, free of charge. The recall began in late August 2014. Owners may contact Starcraft customer service at 1-800-945-4787.

14V-509

Blue Bird Body Company (Blue Bird) is recalling certain model year 2007-2015 All American and Vision, 2007-2011 Micro Bird, and 2007-2008 Conventional school buses equipped with certain model S2005, S2010, S5005, S5010, S5505, and S5510 wheelchair lifts manufactured by Ricon Corporation. The platform side plate of the affected wheelchair lifts may crack. If the platform side plates crack, the lift platform can separate from the lift and come to rest against the vehicle's lift door. When the doors are opened, the platform may fall out, increasing the risk of injury to the lift operator. Blue Bird will notify owners to take buses to a Ricon dealer or service center who will install supplemental platform support bumpers. Any platform that has already started cracking will be replaced, free of charge. The recall is expected to begin during September 2014. Owners may contact Blue Bird customer service at 1-478-822-2242 or Ricon customer service at 1-800-322-2884. Blue Bird's number for this recall is R14XN.

14V-510

Blue Bird Body Company (Blue Bird) is recalling certain model year 2007-2015 All American, 2007-2010 Micro Bird, and 2007-2014 Vision non-school buses equipped with certain model S2005, S2010, S5005, S5010, S5505, and S5510 wheelchair lifts manufactured by Ricon Corporation. The platform side plate of the affected wheelchair lifts may crack. If the platform side plates crack, the lift platform can separate from the lift

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2014**

Published October 1, 2014

and come to rest against the vehicle's lift door. When the doors are opened, the platform may fall out, increasing the risk of injury to the lift operator. Blue Bird will notify owners to take buses to a Ricon dealer or service center who will install supplemental platform support bumpers. Any platform that has already started cracking will be replaced, free of charge. The recall is expected to begin during September 2014. Owners may contact Blue Bird customer service at 1-478-822-2242 or Ricon customer service at 1-800-322-2884. Blue Bird's number for this recall is R14XN.

14V-511

Autocar Industries, LLC (Autocar) is recalling certain model year 2015 Xspotter heavy duty trucks manufactured May 23, 2014, to June 13, 2014. The Cummins ISB or ISL engines in these vehicles may have been equipped with Fleetguard UFF-XT fuel filters, part number FF63009, whose filter shell may separate from the fuel filter nut plate causing the engine to stall without warning. If the engine stalls unexpectedly there is an increased risk of a crash. Cummins will notify owners for Autocar, and Cummins service centers will replace the fuel filter, free of charge. The recall began in August 2014. Owners may contact Autocar customer service at 1-765-489-5499 or Cummins customer service at 1-800-223-4583. Autocar's number for this recall is T-1409.

14V-512

Spartan Motors, Inc. (Spartan) is recalling certain model year 2013-2015 Gladiator, and 2011 and 2013-2014 MetroStar emergency vehicles manufactured June 15, 2011, to January 14, 2014. The affected vehicles are equipped with a pressure governor or hand throttle supplied by Fire Research Corporation (FRC). Due to an issue with the software for the pressure governor or hand throttle, the affected vehicles may experience an engine surge. A surge in engine speed can cause increased water pressure at the end of a fire hose, increasing the risk of personal injury. Spartan will notify owners, and dealers will install a software update, free of charge. The recall is expected to begin in September 2014. Owners may contact Spartan customer service at 1-517-543-6400. Spartan's number for this recall is 14013.

14V-513

Ford Motor Company (Ford) is recalling certain model year 2014 Focus and C-Max vehicles manufactured August 8, 2014, to August 15, 2014. Some of the affected vehicles are equipped with steering gears that may be missing 21 of the intended 84 internal ball bearings. Steering gears with this condition may experience deformation and degradation of the ball bearings in the gear during operation, potentially resulting in impaired steering, including the loss of steering control, which could increase the risk of a vehicle crash. Vehicles with a suspect steering gear will have the gear replaced, free of charge at the dealer.

In accordance with Part 573.13(d)(1), Ford is excluding reimbursement for costs incurred by owners for repair of this concern because Ford's original warranty program would provide for a free repair for this concern for customers.

14V-514

Jayco, Inc. (Jayco) is recalling certain model year 2015 Seismic 19A, 19E, and 19F fifth wheel trailers manufactured June 2, 2014, to July 24, 2014. The affected vehicles may have incorrect cargo carrying capacity (CCC) information printed on the CCC Label. As such, these vehicles fail to comply with the requirements of

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2014**

Published October 1, 2014

Federal Motor Vehicle Safety Standard number 110, "Tire Selection and Rims and Motor Home/Recreation Vehicle Trailer Load Carrying Capacity Information For Motor Vehicles With a GVWR of 4,536 kilograms (10,000 pounds) or less." If the user overloads the trailer by following the incorrect information on CCC label, it could affect drivability and cause premature tire wear or tire failure, increasing the risk of a crash. Jayco will notify owners, and dealers will replace the existing CCC Label with a corrected CCC Label, free of charge. The recall is expected to begin in September 2014. Owners may contact Jayco customer service at 1-800-283-8267. Jayco's number for this recall is 9901219.

14V-515

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain model year 2013 Audi Q7 vehicles manufactured June 5, 2012, to November 29, 2012 and equipped with a 3.0L TDI engine. In the affected vehicles, a check valve in the engine may become contaminated with plastic debris and allow engine oil to leak into the brake booster. If oil leaks into the brake booster, the brake booster diaphragm may rupture causing a loss of power braking assist, and increasing the risk of a crash. Volkswagen will notify owners, and dealers will replace a vacuum line, free of charge. Dealers will also inspect the brake booster system for oil contamination and, if oil contamination is present, additional components will be replaced, free of charge. The recall began on September 24, 2014. Owners may contact Audi at 1-800-253-2834. Volkswagen's number for this recall is 47L8.

14V-516

NABI Bus, LLC (NABI) is recalling certain model year 2013-2014 31LFW transit buses manufactured February 10, 2013, to March 10, 2014, and 2012-2014 40LFW transit buses manufactured October 5, 2012, to June 2, 2014, and equipped with Compressed Natural Gas (CNG) fuel systems manufactured by Agility Fuel Systems. The tanks for the CNG fuel system may be abraded by Pressure Relief Devices (PRDs) mounted adjacent to the tanks. Contact between the PRD and the tank may result in a CNG leak, increasing the risk of a fire. NABI will notify owners, and dealers will install a temporary flexible cover over the PRD. A permanent improvement is still under development by Agility. Owners will receive a second notification when the permanent remedy becomes available. The recall is expected to begin in September 2014. Owners may contact NABI customer service at 1-256-241-1298. NABI's number for this recall is 20145.

14V-517

General Motors LLC (GM) is recalling certain model year 2013-2014 Cadillac XTS vehicles manufactured April 11, 2013, to June 27, 2013, and 2014 Chevrolet Impala vehicles manufactured May 13, 2013, to November 5, 2013. The affected vehicles may have left the factory with the sensing and diagnostic module (SDM) set to "manufacturing mode." In manufacturing mode, the vehicle's air bags will not deploy in the event of a crash, increasing the risk of occupant injury. GM will notify owners, and dealers are to reprogram the SDM to the correct mode, free of charge. The recall is expected to begin in September 2014. Owners may contact Cadillac customer service at 1-800-458-8006 or Chevrolet customer service at 1-800-222-1020. GM's number for this recall is 14532.

14V-518

New Flyer Industries Ltd. (New Flyer) is recalling certain model year 2014 MD30, XD40, XD60, XDE40, and

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2014**

Published October 1, 2014

XDE60 transit buses. The Cummins ISB or ISL engines in these vehicles may have been equipped with Fleetguard UFF-XT fuel filters, part number FF63009, whose filter shell may separate from the fuel filter nut plate causing the engine to stall without warning. If the engine stalls unexpectedly there is an increased risk of a crash. New Flyer will notify owners, and Cummins dealers will replace the fuel filter with a new one, free of charge. The recall began in August 2014. Owners may contact New Flyer customer service at 1-204-934-4876 or Cummins customer service at 1-812-377-3713. New Flyer's number for this recall is R14-018.

14V-519

Navistar, Inc. (Navistar) is recalling certain model year 1999-2002 International 4800 4x4 trucks manufactured June 1, 1999, through May 31, 2002, and equipped with Fabco TC-200 transfer cases. The field remedy that these vehicles received as part of Navistar recall 05501 (NHTSA recall number 03V-415), a double Cardan front driveshaft, may seize under certain conditions. If the double Cardan joint of the driveshaft seizes, the front driveshaft may separate and under certain conditions, potentially cause axle lockup, increasing the risk of a crash. The remedy for this campaign is still under development. Navistar will send owners an interim notification, and dealers will disconnect the front double Cardan driveshaft if the vehicle will be operated on the highway. Owners will be sent a second notification when a permanent remedy is available. The recall is expected to begin in September 2014. Owners may contact Navistar customer service at 1-800-448-7825. Navistar's number for this recall is 14514.

14V-520

Gillig LLC (Gillig) is recalling certain model year 2014 Low Floor transit buses manufactured from May 23, 2014, through August 1, 2014. The Cummins ISB or ISL engines in these vehicles may have been equipped with Fleetguard UFF-XT fuel filters, part number FF63009, whose filter shell may separate from the fuel filter nut plate causing the engine to stall without warning. If the engine stalls unexpectedly there is an increased risk of a crash. Cummins will notify owners on behalf of Gillig, and Cummins service centers will replace the fuel filter, free of charge. The recall is expected to begin in late September 2014. Owners may contact Gillig at 1-510-785-1500 or Cummins customer service at 1-812-377-3713.

14V-521