

**Part 573 Safety Recall Report****14V-668****Manufacturer Name :** Nissan North America, Inc.**Submission Date :** OCT 22,2014**NHTSA Recall No. :** 14V-668**Manufacturer Recall No. :** NR**Manufacturer Information :**

Manufacturer Name : Nissan North America, Inc.

Address : P. O. BOX 685001

Franklin TN 37068-5009

Company phone : (999) 999-9999

**Population :**

Number of potentially involved : 1,848

Estimated percentage with defect : 0

**Vehicle Information :**

Vehicle : 2013-2013 Infiniti QX56

Vehicle Type : LIGHT VEHICLES

Body Style : 4-DOOR

Power Train : GAS

None of the potentially affected driver's front air bag inflators were installed in any other Nissan or Infiniti vehicles in the United States.

The name and address of the driver's front air bag inflator supplier is:

Descriptive Information : TK HOLDINGS INC.  
 2500 Takata Drive  
 Auburn Hills, MI 48326  
 Phone 248-373-8040  
 Fax 248-373-2897

Production Dates : SEP 01, 2012 - APR 26, 2013

**VIN (Vehicle Identification Number) Range**

Begin : NR

End : NR

 Not sequential VINs

Vehicle : 2014-2014 Infiniti QX80

Vehicle Type : LIGHT VEHICLES

Body Style : 4-DOOR

Power Train : GAS

None of the potentially affected driver's front air bag inflators were installed in any other Nissan or Infiniti vehicles in the United States.

The name and address of the driver's front air bag inflator supplier is:

Descriptive Information : TK HOLDINGS INC.  
2500 Takata Drive  
Auburn Hills, MI 48326  
Phone 248-373-8040  
Fax 248-373-2897

Production Dates : JUN 18, 2013 - FEB 11, 0204

**VIN (Vehicle Identification Number) Range**

Begin : NR

End : NR

Not sequential VINs

**Description of Defect :**

Description of the Defect : Some air bags may contain an inflator that was built with an incorrect outer baffle component that could cause excessive inflator internal pressure that can lead to a rupture during a deployment.

Description of the Safety Risk : In a vehicle crash event, this may cause inflator components to separate and potentially be propelled toward the interior of the vehicle, increasing a risk of injury in a crash.

Description of the Cause : NR

Identification of Any Warning that can Occur : NR

**Supplier Identification :**

**Component Manufacturer**

Name : TK HOLDINGS INC.

Address : 2500 Takata Drive

Auburn Hills MICHIGAN 48326

Country : United States

**Chronology :**

June 27, 2014 - Nissan became aware of a General Motors (GM) recall involving the driver's front air bag. Nissan contacted Takata and requested further investigation to determine whether Nissan vehicles are affected.

July 7, 2014 - Takata informed Nissan that they were currently investigating whether the air bag inflators manufactured for Nissan vehicles were similarly affected.

July 2014 - Takata continued to investigate whether the root cause of the GM recall affected Nissan vehicles. The investigation involved reviewing the inflator production records to determine if the components built for Nissan during the same timeframe were affected.

August 2014 to September 2014 - Nissan received a preliminary data set from the Takata investigation and analyzed the results. After review, it was decided to refine the methodology for identifying potentially misbuilt inflators.

Throughout this process, Nissan actively monitored available field information and had not identified any field issues related to the subject defect.

Using the revised methodology, Takata provided new data detailing the potentially misbuilt inflators. Nissan used the supplied information to determine if any U.S. models were affected.

October 17, 2014 - Upon determining certain vehicles in the U.S. market could potentially be affected, Nissan made a safety defect determination and that a recall campaign will be conducted.

**Description of Remedy :**

Description of Remedy Program : Owners of all potentially affected vehicles will be notified to take their vehicle to an Infiniti retailer. The front driver air bag inflator will be replaced with a new one at no cost to owners for parts or labor.

We will include a statement in the Part 577 owner notification concerning reimbursement for the cost of obtaining a pre-notification remedy.

How Remedy Component Differs from Recalled Component : NR

Identify How/When Recall Condition was Corrected in Production : NR

**Recall Schedule :**

Description of Recall Schedule : Nissan plans to notify dealers and owners within 60 days.

Planned Dealer Notification Date : NR - NR

Planned Owner Notification Date : NR - NR

\* NR - Not Reported