



**TO:** All Mazda Dealership General Managers, Service Managers, and Parts Managers

**DATE:** October 2014

**SUBJECT:** **Front Air Bag Inflator Replacement - Safety Recall 7914J**

Mazda Motor Corporation has decided that a defect which relates to motor vehicle safety exists in certain 2003-2007 Mazda6, 2004-2008 RX-8, 2006-2007 Mazdaspeed6, 2004-2005 MPV, and 2004 B-Series Trucks that were originally sold in, or currently or previously registered in Florida, Hawaii, Puerto Rico or the U.S. Virgin Islands, which had consistent high levels of humidity.

In the subject vehicles, continued exposure to high levels of humidity may cause the front air bag inflator housing to rupture if the vehicle is involved in a crash where the front air bag is designed to deploy. If this occurs, it may increase the risk of injury to the vehicle occupants.

Dealers are to replace the potentially affected driver side and/or passenger side front air bag inflators of subject vehicles with new one(s). The original inflator must be returned to the manufacturer for analysis according to the instructions described in Attachment IV.

Owners of subject vehicles (except B-Series Truck) will be notified by first class mail beginning October 17, 2014. We anticipate replacement parts for B-Series Truck will be available by late November 2014, and those owners will be notified at that time.

#### **PARTS INFORMATION**

A web page to order parts for this recall is available in MXConnect. A complete VIN is needed to process the order.

Replacement parts for B-Series Truck will be available in late November 2014.

Description	Part Number	Quantity	Notes
Passenger Side Front Air Bag Inflator	GJYA-57-K80	1	Mazda6, Mazdaspeed6, MPV
	FEY1-57-K80A	1	RX-8
	<i>available late Nov. 2014</i>	1	B-Series Truck
Driver Side Front Air Bag Inflator	GKYA-57-K80	1	Mazda6, Mazdaspeed6, RX-8

This package contains important information about Safety Recall 7914J:

Attachment I	Dealer Service and Parts Information
Attachment II	Repair procedure
Attachment III	Owner notification letter
Attachment IV	Air Bag Inflator Return Instructions

**Important Safety Notice:** The National Traffic and Motor Vehicle Safety Act prohibits the delivery of any subject vehicle without performing the necessary repair for defects or failures. Failure to perform applicable recalls before delivery can result in extensive dealer fines and penalties from the Federal Government. Therefore, you must complete this recall for all affected vehicles in your inventory prior to delivery.

To help you effectively perform this recall, Mazda has developed the following resources:

1. The attached service information, repair procedure, parts information, and air bag inflator return instructions are available on eMDCS and MS3 (Mazda Service Support System) websites via MXConnect.
2. For technical assistance, contact the Technical Assistance Hotline at (888) 832-8477, Option 3 for English speaking Hotline Specialist, Option 4 for Spanish speaking Hotline Specialist.
3. For parts questions, contact the Corporate Dealer Assistance Group at (877) 727-6626, Option 2.
4. For warranty questions, contact the Warranty Hotline at (877) 727-6626, Option 3.
5. We recommend using the Recall Reminder Report #JS30R165-1 and Recall Reminder Labels available in Web Reporting to encourage customers to come in for the recall (with recall reminder postcards). Dealers may use such owner information for the sole purpose of conducting and performing this recall, and for no other purpose. **Using it for marketing activities is strictly prohibited and could subject your dealership to serious fines.** The information in the report is protected by state privacy and other applicable laws regarding disclosure of personal and/or confidential, restricted or blocked information. It is the dealer's responsibility to protect the confidentiality of owner records and prevent the release of information to other parties.

Please make certain the appropriate personnel in your dealership are aware of these resources and are familiar with the details of this recall before responding to customer inquiries.

We apologize for any inconvenience this recall may cause you and your customers. Your understanding and support in carrying out this campaign is greatly appreciated.

Sincerely,



Satoshi Takahashi  
Director, Technical Services Division  
Mazda North American Operations

**CONDITION OF CONCERN**

In certain vehicles with continued exposure to high levels of humidity over long periods, the driver and/or front passenger air bag inflator could produce excessive internal pressure in the event of a crash where the front air bag is designed to deploy. The excessive internal pressure may cause the inflator housing to rupture with metal fragments, which may increase the risk of injury to the vehicle occupants.

Dealers are to replace the potentially affected driver side and/or passenger side front air bag inflators of subject vehicles with new one(s).

A web page to order parts for Recall 7914J is available in MXConnect. A complete VIN is needed to process the order. For each VIN order request, the appropriate part(s) will be automatically selected and ordered based on the VIN.

***IMPORTANT: The part replacement is based on VIN, not model year. Do not use the warranty information to determine which airbag inflators are replaced. The Mazda Special Restricted Parts Ordering website is the only accurate source for part replacement information.***

**MANDATORY AIR BAG INFLATOR RETURN**

Upon receiving the replacement air bag inflator, the original air bag inflator should be returned the same day the repair is performed. Do not wait for Warranty Claim Entry or Warranty Parts Requests. Failure to return the original inflator will result in a Warranty Claim Debit.

Detailed air bag inflator return instructions are provided in Attachment IV and can also be found on MS3 and the Dealer Assistance Group website.

**SUBJECT VEHICLES**

<b>Model</b>	<b>VIN Range</b>	<b>Build Date Range</b>
2004-2008 RX-8	JM1FE1***40 100063 - 140879 JM1FE1***50 140895 - 161156 JM1FE1***60 200013 - 207444 JM1FE1***70 207473 - 214011 JM1FE1***80 214012 - 214178	From April 10, 2003 through July 4, 2007
2003-2007 Mazda6	1YVFP8*** 35 M16528 - M57051 1YVFP8***45 N07463 - N99292 1YVFP8***55 M01113 - M76942 1YVFP8***65 M00408 - M59667 1YVHP8***35 M16533 - M54148 1YVHP8***45 N07480 - N99243 1YVHP8***55 M00054 - M77517 1YVHP8***65 M00086 - M63629 1YVHP8***75 M38074 - M55181	From January 17, 2003 through April 17, 2007
2006-2007 Mazdaspeed6	JM1GG1***61 100091 - 108029 JM1GG1***71 108061 - 110732	From August 18, 2005 through June 28, 2007

2004-2005 MPV	JM3LW2***40 500023 - 531782 JM3LW2***50 531899 – 532952	From August 21, 2003 through August 18, 2004
2004 B-Series	4F4 Y R12** 4T M00089- M12957 4F4 Y R16** 4T M00023 - M13004 4F4 Y R17** 4T M01807 - M12717 4F4 Y R46** 4T M00276 - M11764 4F4 Y R47** 4T M00075 - M03517 4F4 Z R16** 4T M00472 - M12580 4F4 Z R17** 4T M01789 - M12709 4F4 Z R47** 4T M04732 - M12624	From August 11, 2003 through February 19, 2004

The asterisk symbol “\*” can be any letter or number.

**OWNER NOTIFICATION**

Mazda will notify U.S. owners by first class mail beginning October 17, 2014.

**PARTS INFORMATION**

Description	Part Number	Quantity	Notes
Passenger Side Front Air Bag Inflator	GJYA-57-K80	1	Mazda6, MPV
	FEY1-57-K80A	1	RX-8
	<i>available late Nov. 2014</i>	1	B-Series Truck
Driver Side Front Air Bag Inflator	GKYA-57-K80	1	Mazda6, Mazdaspeed6, RX-8
Campaign Label	9999-95-065A-06	1=50 labels	Obtain in MStore (no charge)

**PARTS ORDERING**

A web page to order parts for this recall is available in MXConnect. A complete VIN is needed to process the order.

Replacement parts for B-Series Truck will be available in late November 2014.

**WARRANTY CLAIM PROCESSING INFORMATION**

Repair	<b>Replacement of Passenger Side Front Air Bag Inflator</b>	
Applicable Model	2003-2004 Mazda6 2004-2005 RX-8 2004-2005 MPV	2004 B-Series Truck
Warranty Type	<b>R</b>	<i>available late Nov. 2014</i>
Process Number	AE020A	
Symptom Code	99	
Damage Code	99	
Part Number Main Cause & Quantity	7777-SP-J67 & 0	
Related Part Number & Quantity	GJYA-57-K80 & 1 or FEY1-57-K80A & 1	
Labor Operation Number	XXKAHARX	
Labor Hours	0.4 hrs. Mazda6, RX-8 0.5 hrs. MPV	

Repair	<b>Replacement of Driver Side Front Air Bag Inflator</b>
Applicable Model	2004-2007 Mazda6 2006-2007 Mazdaspeed6 2004-2008 RX-8
Warranty Type	<b>R</b>
Process Number	AE020B
Symptom Code	99
Damage Code	99
Causal Part Number & Quantity	7777-SP-J67 & 0
Related Part Number & Quantity	GKYA-57-K80 & 1
Labor Operation Number	XXKAHBRX
Labor Hours	0.3 hrs.

Repair	<b>Replacement of BOTH Passenger &amp; Driver Side Front Air Bag Inflators</b>
Applicable Model	2004-2005 Mazda6 2004-2005 RX-8
Warranty Type	<b>R</b>
Process Number	AE020C
Symptom Code	99
Damage Code	99
Causal Part Number & Qty	7777-SP-J67 & 0
Related Part Number & Qty	GKYA-57-K80 &1 and GJYA-57-K80 or FEY1-57-K80A & 1
Labor Operation Number & Labor Hours	XXKAHCRX & 0.5 hrs. RX-8 XXKAHDRX & 0.5 hrs. Mazda6 without NAVI XXKAHERX & 0.6 hrs. Mazda6 with NAVI

**RENTAL CAR INFORMATION**

Mazda will authorize rental and service loaner vehicles on a limited basis. We are requesting dealer understanding and partnership regarding rental and loaner vehicle utilization. Please make every effort to utilize alternative transportation solutions in place of rental use. Rental is covered if customer has no alternative means of transportation.

**Rental Car Warranty Claim Information**

Please submit rentals on a separate claim problem number as follows:

	<b>Rental Agency Vehicle</b>	<b>Dealer Loaner Car Fleet Vehicle</b>
Warranty Type Code	A	A
Symptom Code	99	99
Damage Code	99	99
Part Number Main Cause	5555-79-14J <u>R</u>	5555-79-14J <u>L</u>
Part Quantity	0	Number of days loaner car was used Mazda pays \$35.00/day
Labor Operation Code	MM024XRX	MM024XRX
Labor Hours	0.0	0.0
Sublet – Rental Car		
Sublet Invoice Number	Number from Rental Invoice or Dealer Purchase Order	
Sublet Type Code	Enter “Z9” (other)	
Sublet Amount	Up to \$30.00 per day for the number of days customer had rental car	
Sublet Text	Number of days rental car was supplied to customer	

Rental expenses exceeding the two-day limit will require prior DSM Authorization, as outlined in the Mazda Rental Car Reimbursement Program policy.

**VERIFY THE VEHICLE NEEDS THE RECALL**

1. Verify the vehicle is within the following ranges:

<b>Model</b>	<b>VIN Range</b>	<b>Build Date Range</b>
2004-2008 RX-8	JM1FE1***40 100063 - 140879 JM1FE1***50 140895 - 161156 JM1FE1***60 200013 - 207444 JM1FE1***70 207473 - 214011 JM1FE1***80 214012 - 214178	From April 10, 2003 through July 4, 2007
2003-2007 Mazda6	1YVFP8***35 M16528 - M57051 1YVFP8***45 N07463 - N99292 1YVFP8***55 M01113 - M76942 1YVFP8***65 M00408 - M59667 1YVHP8***35 M16533 - M54148 1YVHP8***45 N07480 - N99243 1YVHP8***55 M00054 - M77517 1YVHP8***65 M00086 - M63629 1YVHP8***75 M38074 - M55181	From January 17, 2003 through April 17, 2007
2006-2007 Mazdaspeed6	JM1GG1***61 100091 - 108029 JM1GG1***71 108061 - 110732	From August 18, 2005 through June 28, 2007
2004-2005 MPV	JM3LW2***40 500023 - 531782 JM3LW2***50 531899 – 532952	From August 21, 2003 through August 18, 2004
2004 B-Series	4F4 Y R12** 4T M00089- M12957 4F4 Y R16** 4T M00023 - M13004 4F4 Y R17** 4T M01807 - M12717 4F4 Y R46** 4T M00276 - M11764 4F4 Y R47** 4T M00075 - M03517 4F4 Z R16** 4T M00472 - M12580 4F4 Z R17** 4T M01789 - M12709 4F4 Z R47** 4T M04732 - M12624	From August 11, 2003 through February 19, 2004

The asterisk symbol “\*” can be any letter or number.

- If the vehicle is within the above ranges, go to Step 2.
- If the vehicle is not within the above ranges, Recall 7914J is not applicable.

2. Perform a Warranty Vehicle Inquiry using your eMDCS System and inspect the vehicle for an Authorized Campaign Label RECALL 7914J attached to the vehicle’s hood or bulkhead.

**eMDCS System – Warranty Vehicle Inquiry Results:**

<b>If eMDCS displays:</b>	<b>Campaign Label is:</b>	<b>Action to perform:</b>
RECALL 7914J	Present	Contact the Warranty Hotline at (877) 727-6626, option 3, to update vehicle history.
	Not present	Proceed to “REPAIR PROCEDURE”.
RECALL 7914J CLOSED	Present	Return vehicle to inventory or customer.
	Not present	Complete a label and apply to vehicle's hood or bulkhead.
RECALL 7914J is not displayed	Does not apply	Recall does not apply to this vehicle. Return vehicle to customer.

**REPAIR PROCEDURE**

Please refer to Attachment II.

**2003-07 MAZDA6, 2006-07 MAZDASPEED6, 2004-08 RX-8, 2004-05 MPV, 2004 B-SERIES TRUCK - AIR BAG SAFETY RECALL 7914J**

**A. VEHICLE INSPECTION PROCEDURE**


1. Verify that the vehicle is within the following ranges:

Model	VIN Range	Build Date Range
2003-2007 Mazda6	1YVFP8***35 M16528 - M57051	From January 17, 2003 through April 17, 2007
	1YVFP8***45 N07463 - N99292	
	1YVFP8***55 M01113 - M76942	
	1YVFP8***65 M00408 - M59667	
	1YVHP8***35 M16533 - M54148	
	1YVHP8***45 N07480 - N99243	
	1YVHP8***55 M00054 - M77517	
	1YVHP8***65 M00086 - M63629	
	1YVHP8***75 M38074 - M55181	
2006-2007 Mazdaspeed6	JM1GG1***61 100091 - 108029	From August 18, 2005 through June 28, 2007
	JM1GG1***71 108061 - 110732	
2004-2008 RX-8	JM1FE1***40 100063 - 140879	From April 10, 2003 through July 4, 2007
	JM1FE1***50 140895 - 161156	
	JM1FE1***60 200013 - 207444	
	JM1FE1***70 207473 - 214011	
	JM1FE1***80 214012 - 214178	
2004-2005 MPV	JM3LW2***40 500023 - 531782	From August 21, 2003 through August 18, 2004
	JM3LW2***50 531899 - 532952	
2004 B-Series	4F4YR12**4T M00089 - M12957	From August 11, 2003 through February 19, 2004
	4F4YR16**4T M00023 - M13004	
	4F4YR17**4T M01807 - M12717	
	4F4YR46**4T M00276 - M11764	
	4F4YR47**4T M00075 - M03517	
	4F4ZR16**4T M00472 - M12580	
	4F4ZR17**4T M01789 - M12709	
	4F4ZR47**4T M04732 - M12624	

- If the vehicle is within the above ranges, proceed to Step 2.
- If the vehicle is not within the above ranges, return vehicle to the customer or inventory.

2. Perform a Warranty Vehicle Inquiry using your eMDCS System and inspect vehicle for Campaign Labels **Recall 7914J** attached to the vehicle’s hood or bulkhead. Refer to eMDCS System - Warranty Vehicle Inquiry Results table below.

**NOTE:** Be sure to verify Recall number as the vehicle may have multiple Recall labels.

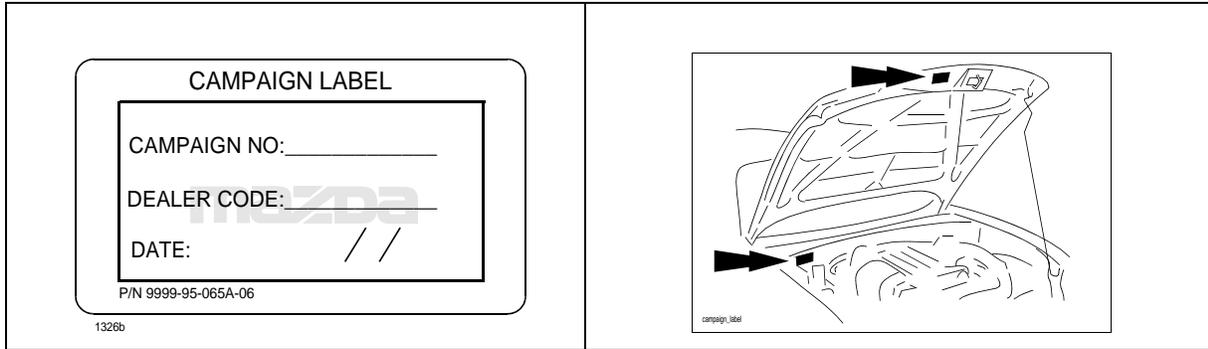

**eMDCS System - Warranty Vehicle Inquiry Results:**

If eMDCS displays:	Campaign Label is:	Action to perform:
RECALL 7914J OPEN	Present	Contact the Warranty Hotline at (877) 727-6626 option 3 to update vehicle history.
	Not present	Proceed to "B. REPAIR PROCEDURE".
RECALL 7914J CLOSED	Present	Return vehicle to inventory or customer.
	Not present	Proceed to "C. CAMPAIGN LABEL INSTALLATION".
RECALL 7914J is not displayed	Does not apply	Recall does not apply to this vehicle. Return vehicle to inventory or customer.


**B. REPAIR PROCEDURE**

Year / Model	Airbag Inflator	Page No.
2003-2005 Mazda6	Passenger side	3
2004-2005 RX-8	Passenger side	10
2004-2005 MPV	Passenger side	17
2004 B-Series	Passenger side	24
2004-2007 Mazda6, 2006-2007 Mazdaspeed6, 2004-2008 RX-8	Driver side	32

2003-2005 Mazda6:


Passenger-Side Air Bag Inflator Replacement Procedure:

Parts Information: The service parts are available in one box [Inflator (A), Stopper Plate (B), and 4 Nuts (C)].

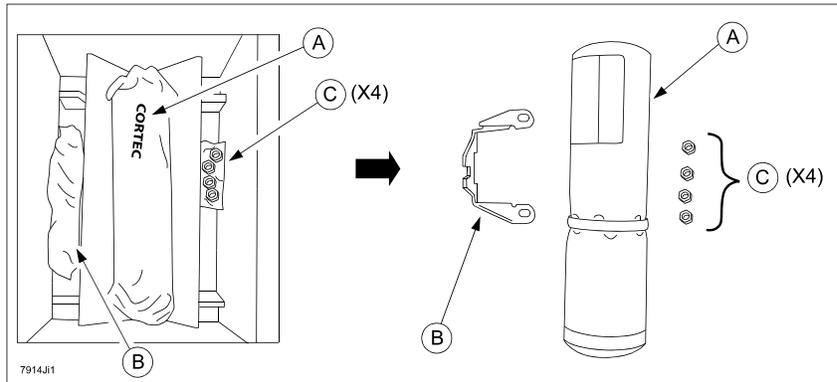

Outline:

1. Remove the inflator from the passenger-side air bag module (A), then replace it with a modified one (B) identified with a yellow stripe (C).

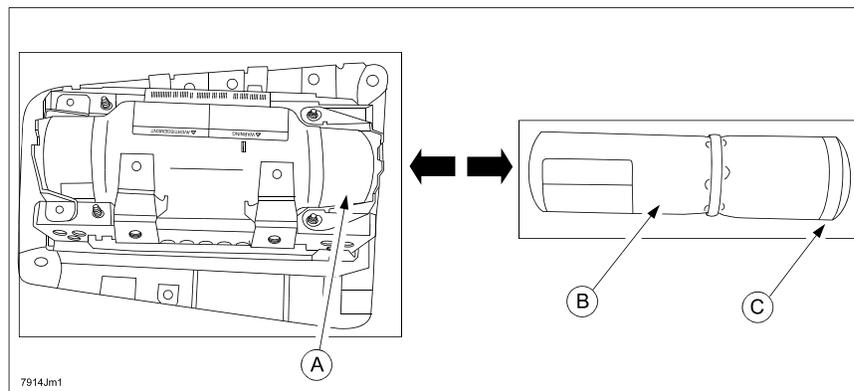


2. Pack and return the removed inflator as follows:

**IMPORTANT: Be sure to follow the packing and shipping instructions provided in the carton and in Attachment IV, Air Bag Inflator Return Instructions.**

**CAUTION:**

- Use the same carton which was used to deliver a new inflator. It is a specialized box that is internationally accepted for shipping an inflator.
- Pack the old inflator in the box exactly in the same manner as the new inflator was packed.

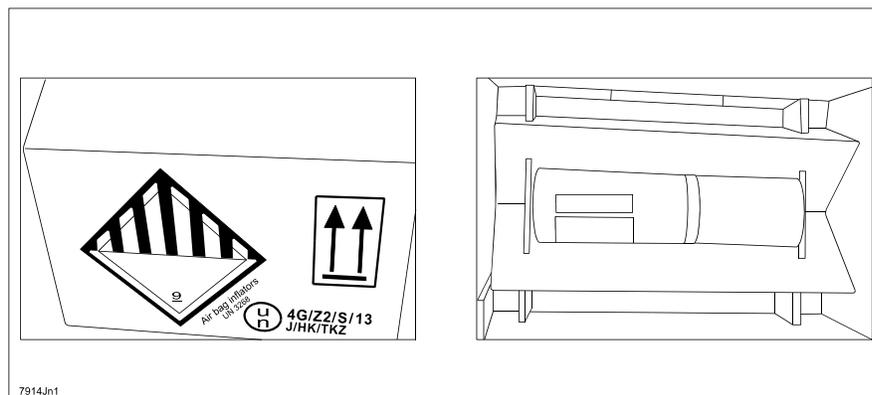


**Air Bag Module Removal:**


**WARNING:**

- Perform the replacement in a clean environment. Oil, grease, water, etc. on components may cause the air bag modules to fail to deploy in an accident, which may cause serious injury. Do not allow oil, grease, water, etc., on components.
- Inserting a screwdriver, etc., into the connector of an air bag module may damage the connector and cause the air bag module to deploy improperly, which may cause serious injury. Do not insert any foreign objects into the connector.
- Do not disassemble the vehicle, other than instructed here.
- Do not make an attempt to directly supply electrical power to the module and the inflator.
- Keep the module facing of the pad surface upwards at all times, except during replacement.
- Do not use the module and new inflator if they were dropped on the ground.
- Avoid module and inflator exposure to temperatures of 194 degrees F (90 degrees C) or more.


1. Turn the ignition switch to the LOCK position.
2. Record the customer's preset radio stations.
3. Disconnect the negative battery cable and wait for one (1) minute or more.
4. Remove the glove compartment.
  - a. Detach the string from the glove compartment.

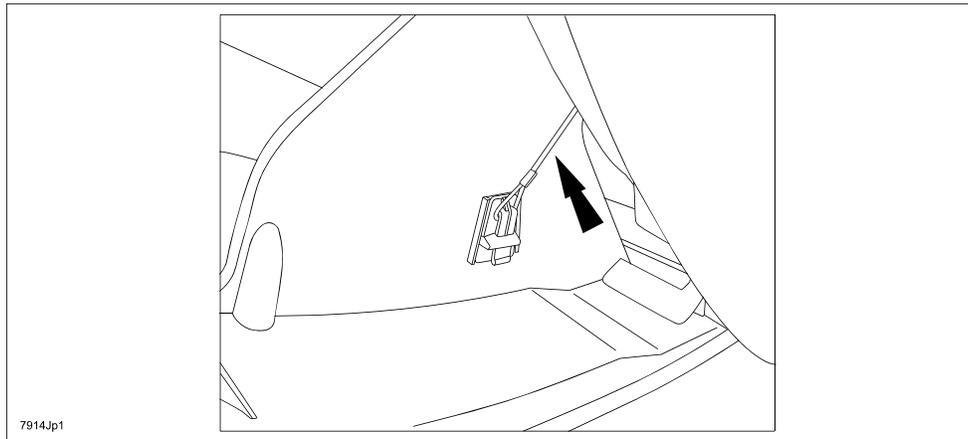

- b. Press the glove compartment stoppers (A) inward.
- c. Lower the glove compartment (B) downward and pull the clips (C) to remove it.

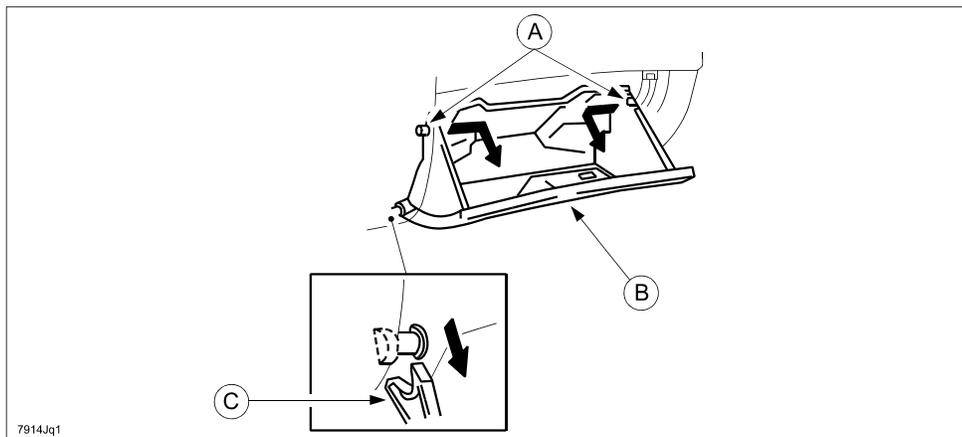


5. Remove the navigation unit (if equipped).
  - a. Remove the bolts.
  - b. Remove the navigation unit.

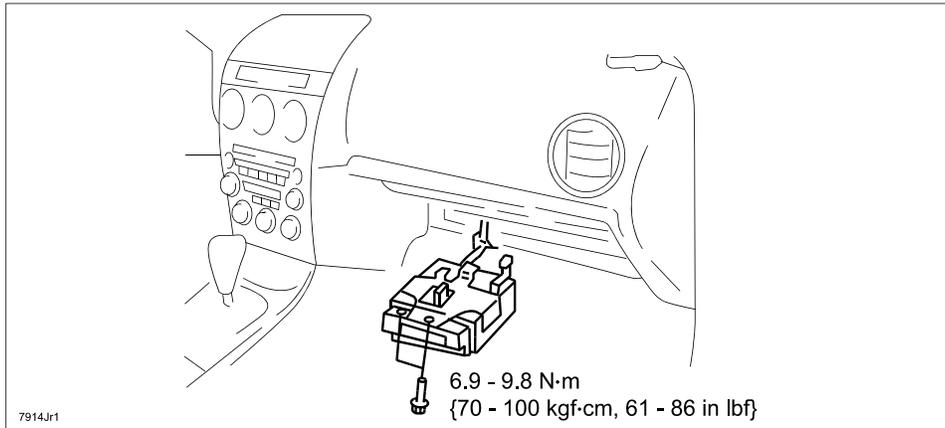

6. Remove the air bag module.
  - a. Using a flathead screwdriver, gently pry out the connector stopper plate.
  - b. Disconnect the connectors (A).

**NOTE:** Be careful not to pop off the stopper plate and lose it. It is not available as a separate part.

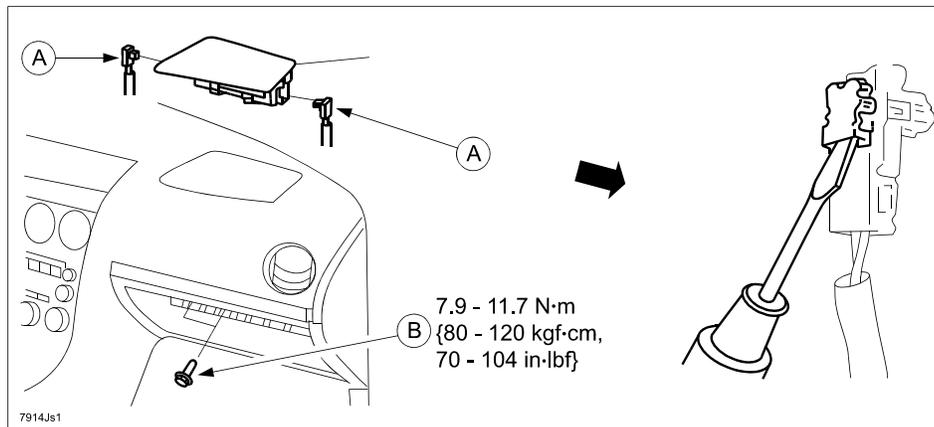


- c. Remove the bolt (B).
7. Lay a protective cloth on the work bench, then place the air bag module on it to avoid any damage or scratches to the surface.

**Inflator Replacement:**


1. Loosen four (4) nuts until the upper surface of the nuts are aligned with the top edge of the screw thread. For easier inflator removal, depress the four (4) nuts and make a gap between the inflator and air bag module.

**NOTE:** Do not depress excessively as the module body may detach.

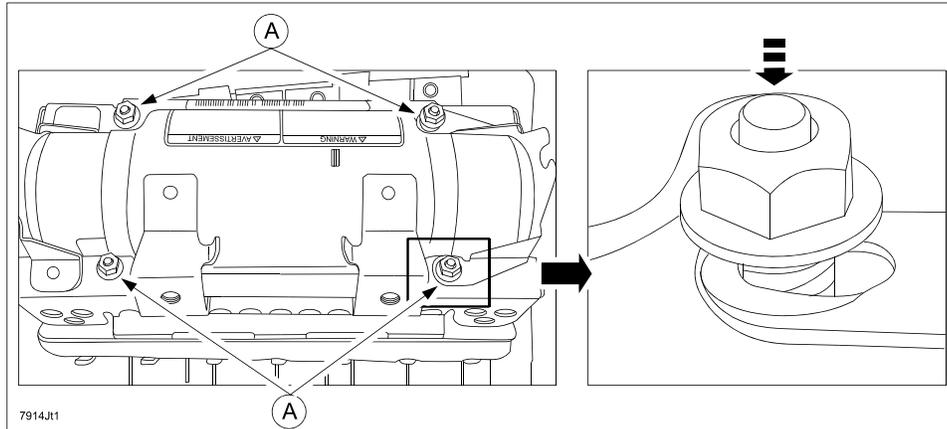


2. Remove the four (4) nuts, then remove the stopper plate from the air bag module.

**NOTE:** Discard all of the nuts and stopper plate.

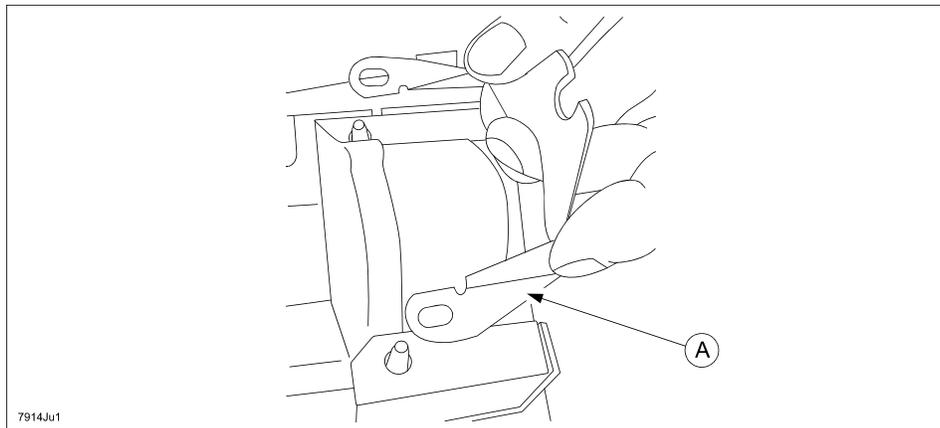


3. Push the inflator end with fingers, then remove it by sliding it in the direction shown below.


**IMPORTANT:** Return the removed inflator in the same carton in which the new part was received. Carefully follow the packing and shipping instructions included in the carton.

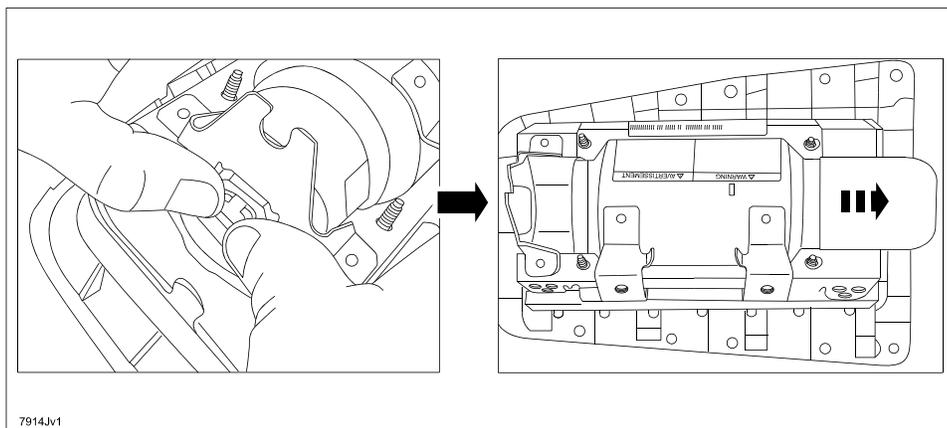


4. Insert the modified inflator from the opposite side of where the yellow identification tape (A) is located.

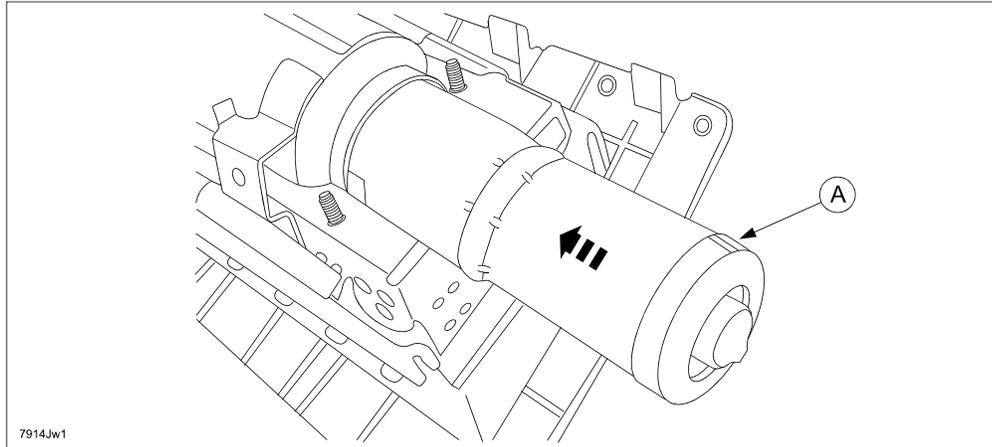


5. Insert the inflator up to the position where it touches the stopper (A), aligning the D-shape end of the inflator with the stopper opening (B).

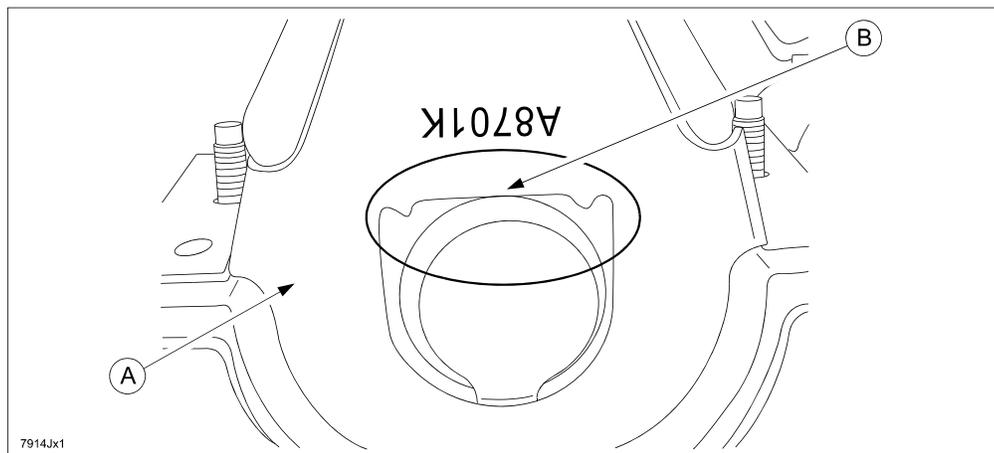


6. Set the new stopper plate (A) by gently pushing until it touches with the inflator side (B).

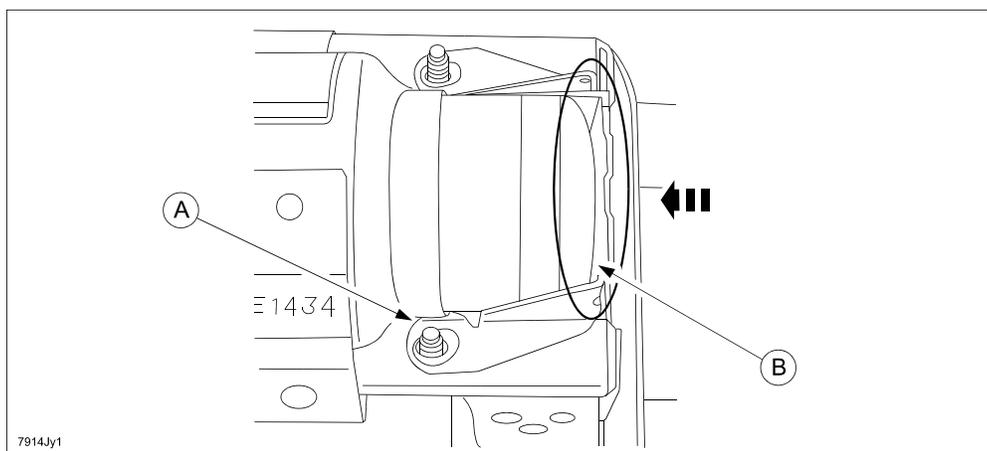

7. Keeping the position above, hand tighten the four (4) new nuts.
8. Tighten the four (4) new nuts to the specified torque in the order shown below (1, 2, 3, 4).  
**Tightening Torque: 35 +/- 1.8 in-lbf. {39.8 +/- 2.0 kgf-cm, 3.9 +/- 0.4 Nm}**

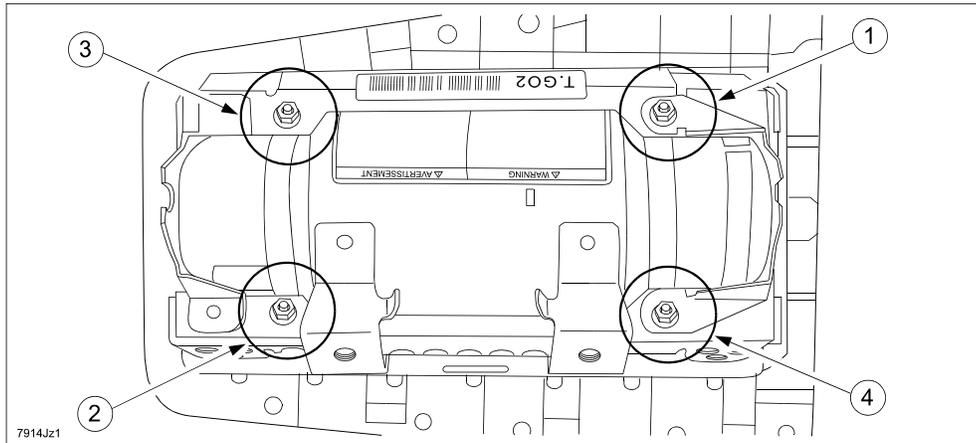


9. Remove the seal (A) from the end of the inflator on both sides.

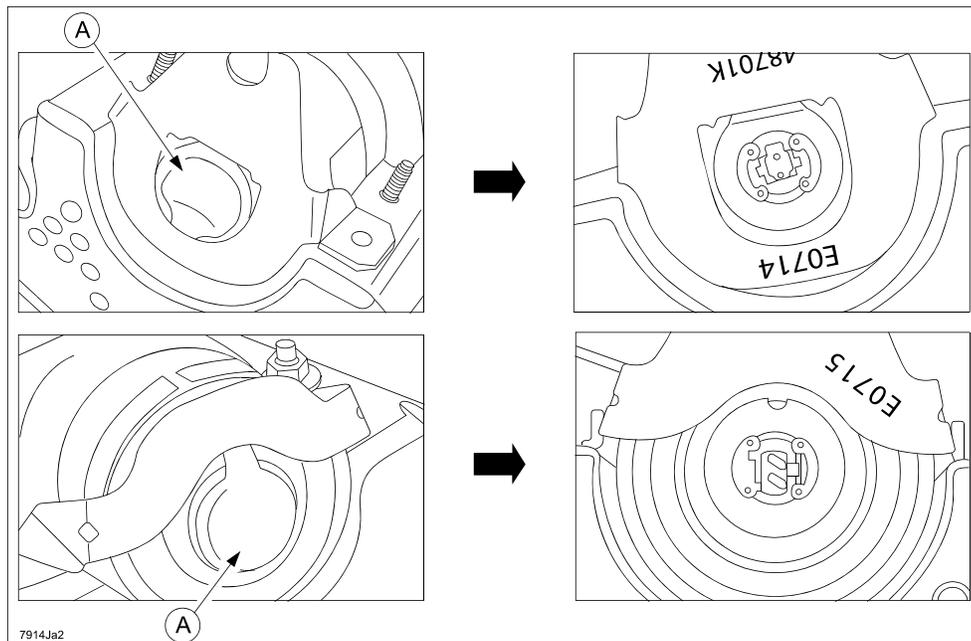


**Air Bag Module Reinstallation:**

1. Install the air bag module assembly.
2. Tighten the bolt (A) to the specified torque.  
**Tightening Torque: 70 - 104 in-lbf. {80 - 120 kgf-cm, 7.9 - 11.7 Nm}**

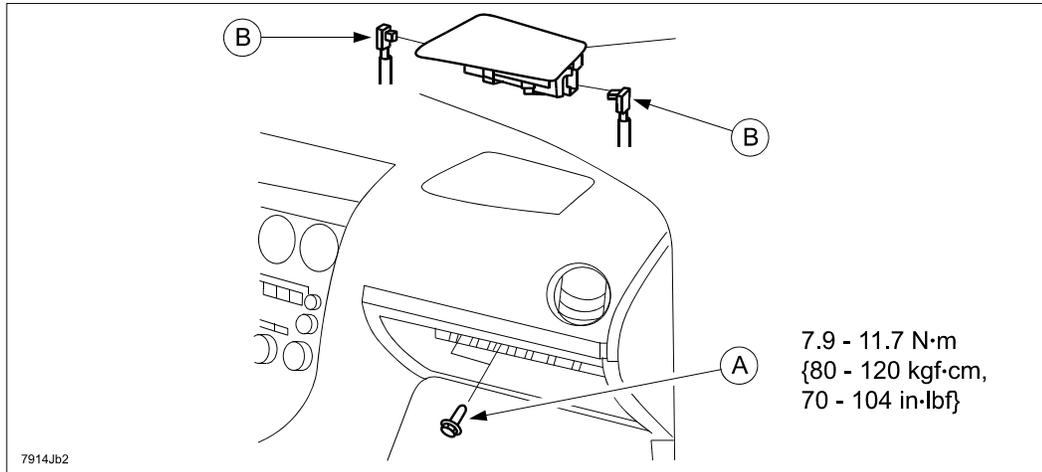

3. Re-connect the connectors (B) to air bag module.
4. Securely lock the connectors by depressing the stoppers (A) on the back of the connector.

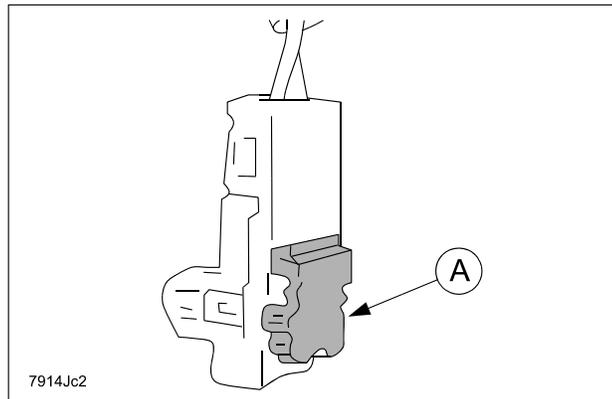

5. Reconnect the negative battery cable.
6. Turn the ignition switch to the ON position.
7. Verify that the air bag system warning light illuminates for approx. 6 sec., then goes out.


**NOTE:** If the air bag system warning light does not operate in the manner described above, there is a malfunction in the system. Inspect the system following the on-board diagnostic system procedure according to MS3 online or the Workshop Manual (section 08 Restraints).

8. Reinstall the navigation unit (if equipped).
9. Reinstall the glove box.
10. Re-enter the customer's preset radio stations.
11. Proceed to "C. CAMPAIGN LABEL INSTALLATION".

2004-2005 RX-8:


**Passenger-Side Air Bag Inflator Replacement Procedure:**

Parts Information: The service parts are available in one box [Stopper plate (A), Inflator (B), and 4 Nuts (C)].

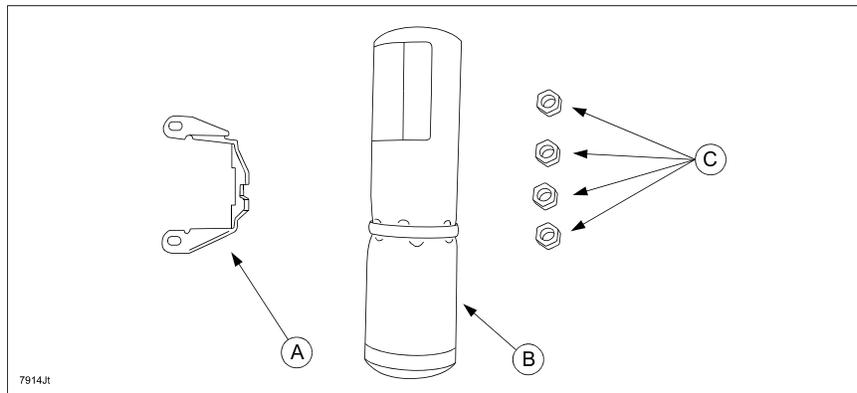

**Outline:**

1. Remove the inflator from the passenger-side air bag module (A), then replace it with a modified one (B) identified with a yellow stripe (C).

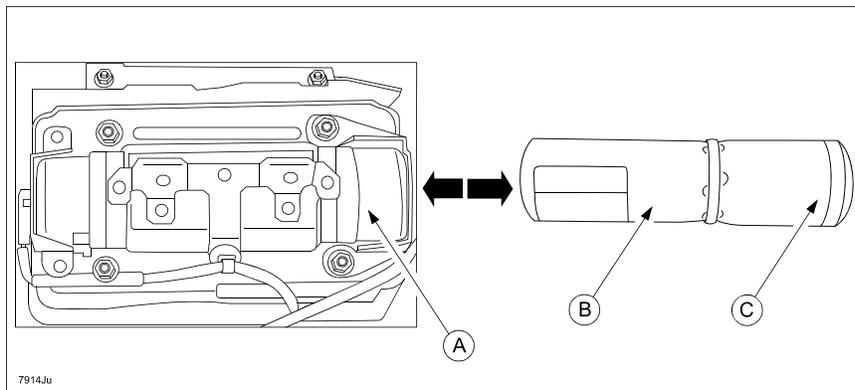


2. Pack and return the removed inflator as follows:

**IMPORTANT:** Be sure to follow the packing and shipping instructions provided in the carton and in Attachment IV, Air Bag Inflator Return Instructions.


**CAUTION:**

- Use the same carton which was used to deliver a new inflator. It is a specialized box that is internationally accepted for shipping an inflator.
- Pack the old inflator in the box exactly in the same manner as the new inflator was packed.

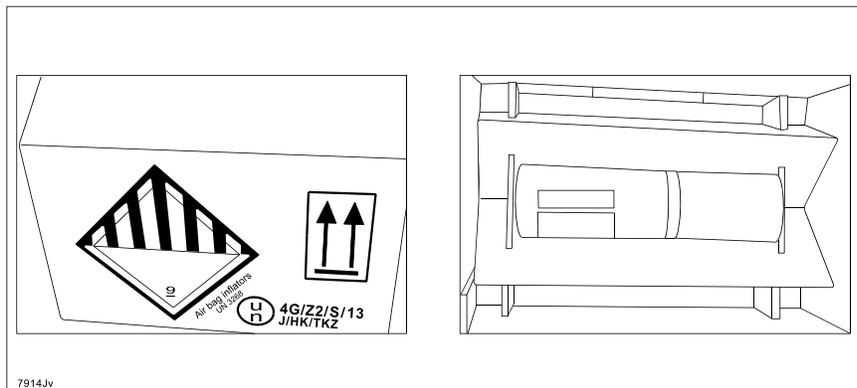


**Air Bag Module Removal:****WARNING:**


- Perform the replacement in a clean environment. Oil, grease, water, etc. on components may cause the air bag modules to fail to deploy in an accident, which may cause serious injury. Do not allow oil, grease, water, etc., on components.
  - Inserting a screwdriver, etc., into the connector of an air bag module may damage the connector and cause the air bag module to deploy improperly, which may cause serious injury. Do not insert any foreign objects into the connector.
  - Do not disassemble the vehicle, other than instructed here.
  - Do not make an attempt to directly supply electrical power to the module and the inflator.
  - Keep the module facing of the pad surface upwards at all times, except during replacement.
  - Do not use the module and new inflator if they were dropped on the ground.
  - Avoid module and inflator exposure to temperatures of 194 degrees F (90 degrees C) or more.
1. Turn the ignition switch to the LOCK position.
  2. Record the customer's preset radio stations.
  3. Disconnect the negative battery cable and wait for one (1) minute or more.
  4. Remove the glove compartment.
    - a. Pull the stay damper in the direction shown below.
    - b. Detach the glove compartment from the stay damper.

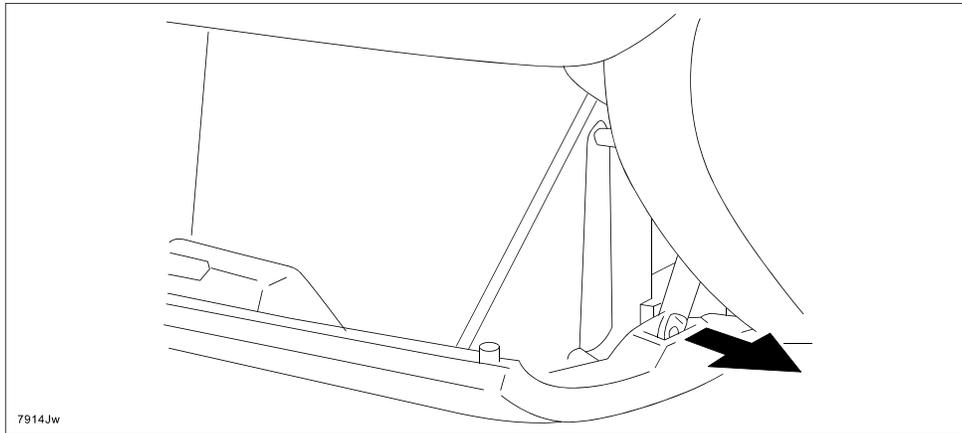

- c. Press the glove compartment stoppers inward.
- d. Lower the glove compartment downward.
- e. Detach the clips from the dashboard and remove the glove compartment.

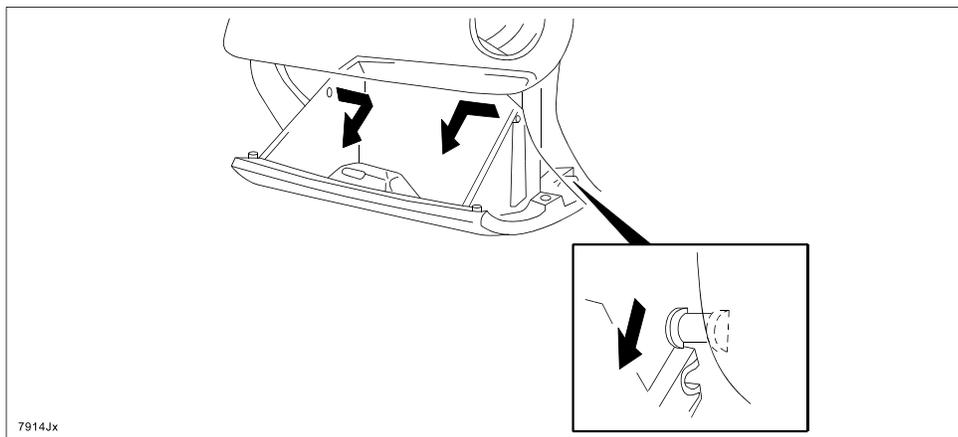

5. Remove the air bag module.
  - a. Remove the bolts (A).
  - b. Disconnect the connector (B).
  - c. Remove the air bag module (C).

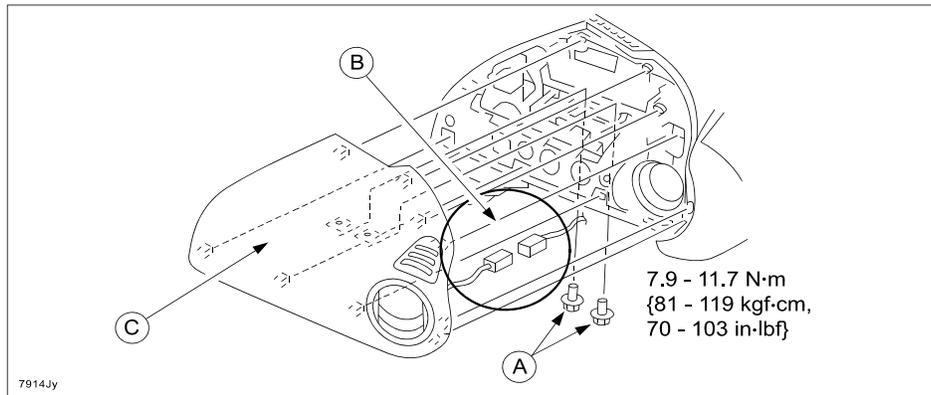


6. Lay a protective cloth on the work bench, then place the air bag module on it to avoid any damage or scratches to the surface.

**Inflator Replacement:**


1. Using a flathead screwdriver, pry out the connector stopper plate, then disconnect the connector (both sides).

**NOTE:** Be careful not to pop off and lose the stopper plate. It is not available as a separate part.

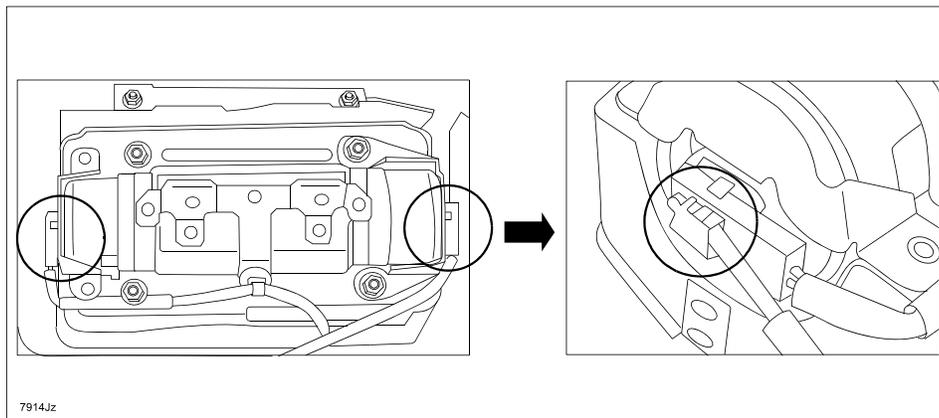


2. Loosen four (4) nuts until the upper surface of the nuts are aligned with the top edge of the screw thread.
3. For easier inflator removal, depress the four (4) nuts and make a gap between the inflator and air bag module.

**NOTE:** Do not depress excessively as the module body may detach.

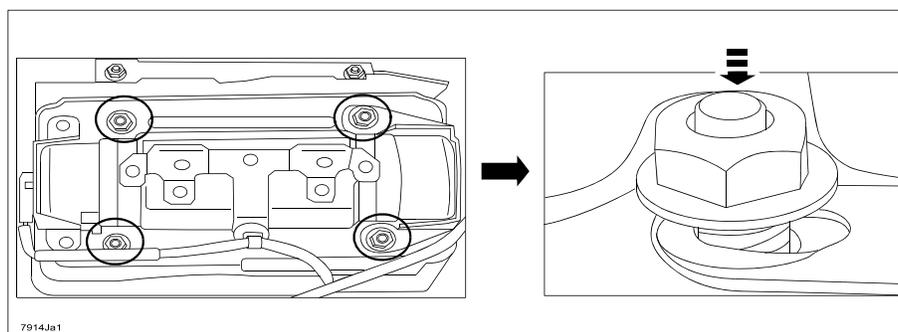


- Remove the four (4) nuts, then remove the stopper plate from the air bag module.

**NOTE:** Discard all of the nuts and stopper plate.

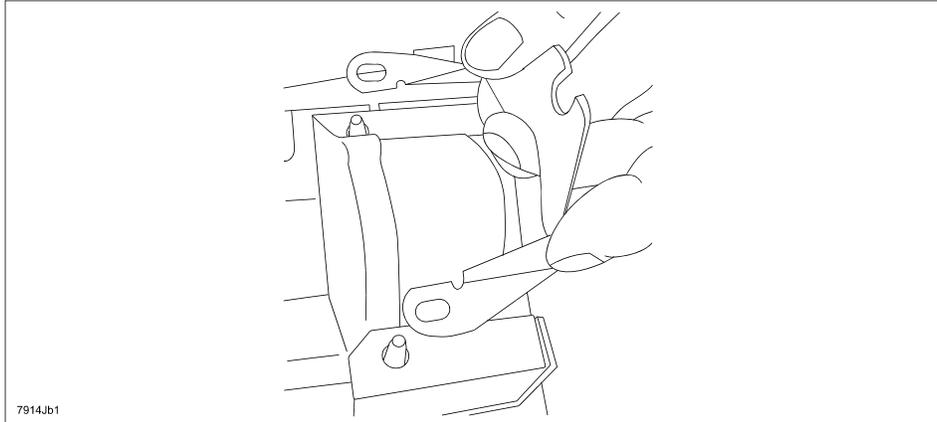


- Push the inflator end with fingers, then remove it by sliding it in the direction shown below.


**IMPORTANT:** Return the removed inflator in the same carton in which the new part was received. Carefully follow the packing and shipping instructions included in the carton.

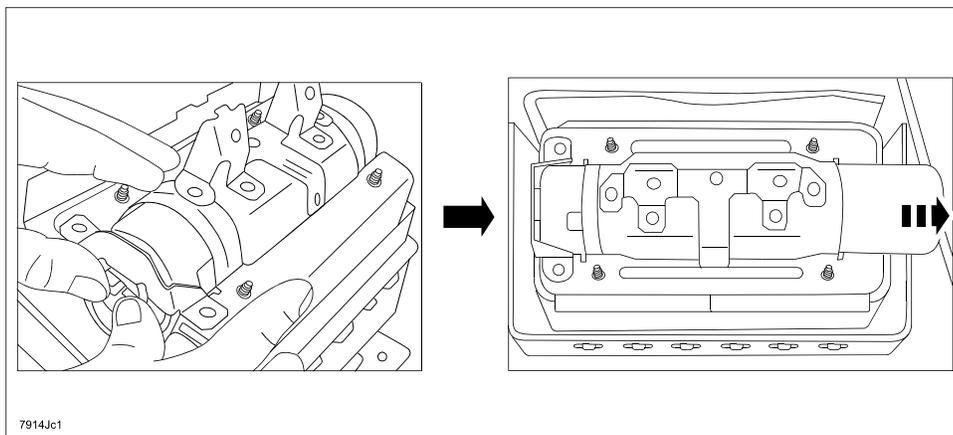


- Insert the modified inflator from the opposite side of where the yellow identification tape (A) is located.

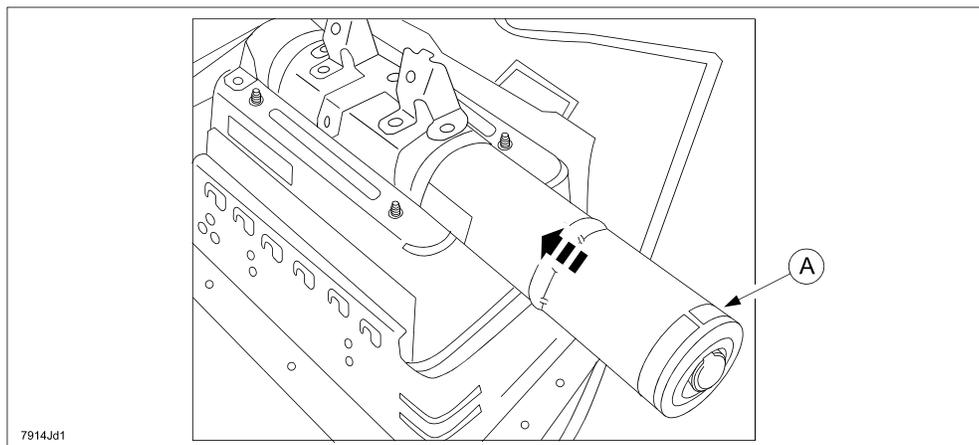


7. Insert the inflator up to the position where it touches the stopper (B), aligning the D-shape end of the inflator with the stopper opening (A).

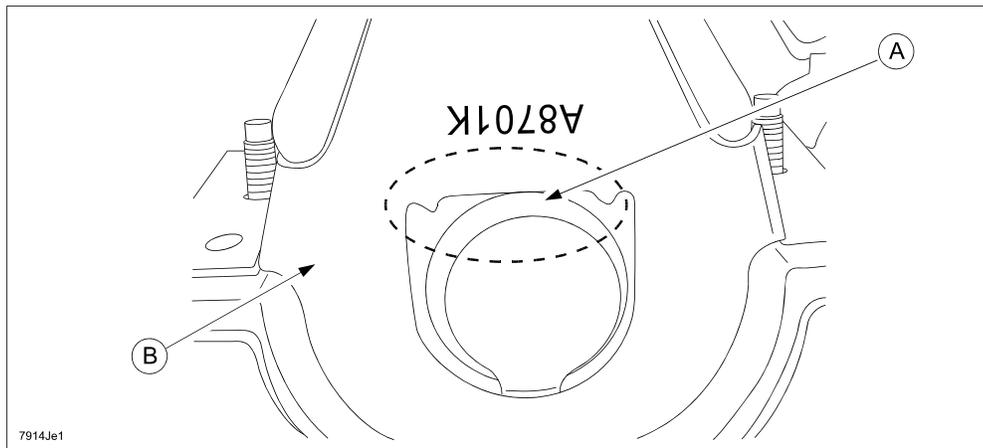


8. Set the new stopper plate (A) by gently pushing until it touches with the inflator side (B).

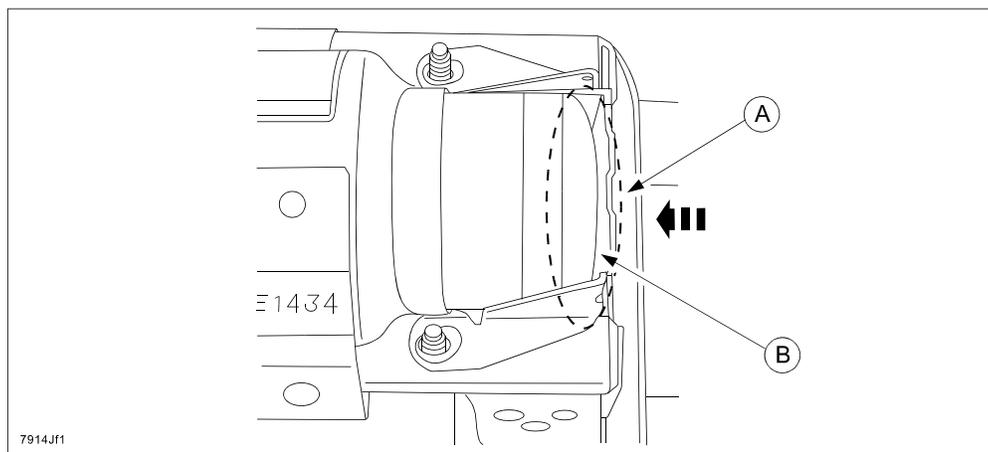

9. Keeping the position above, hand tighten the four (4) new nuts.
10. Tighten the four (4) new nuts to the specified torque in the order shown below (1, 2, 3, 4).  
**Tightening Torque: 35 +/- 1.8 in-lbf. {39.8 +/- 2.0 kgf-cm, 3.9 +/- 0.4 Nm}**

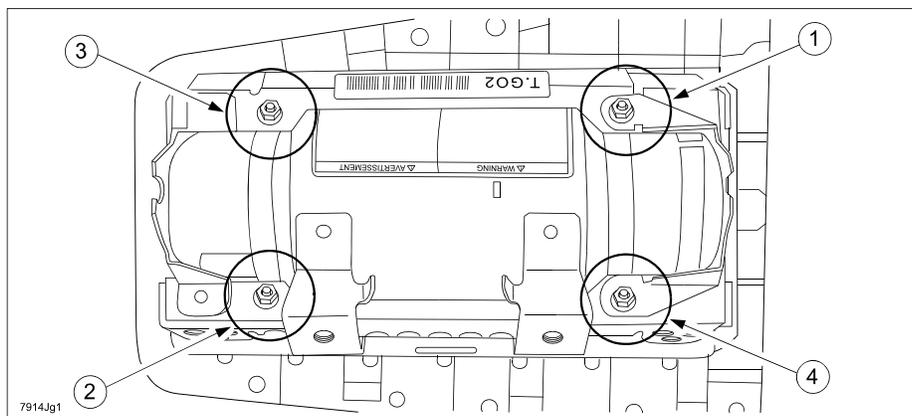


11. Remove the seal (A) from the end of the inflator on both sides.

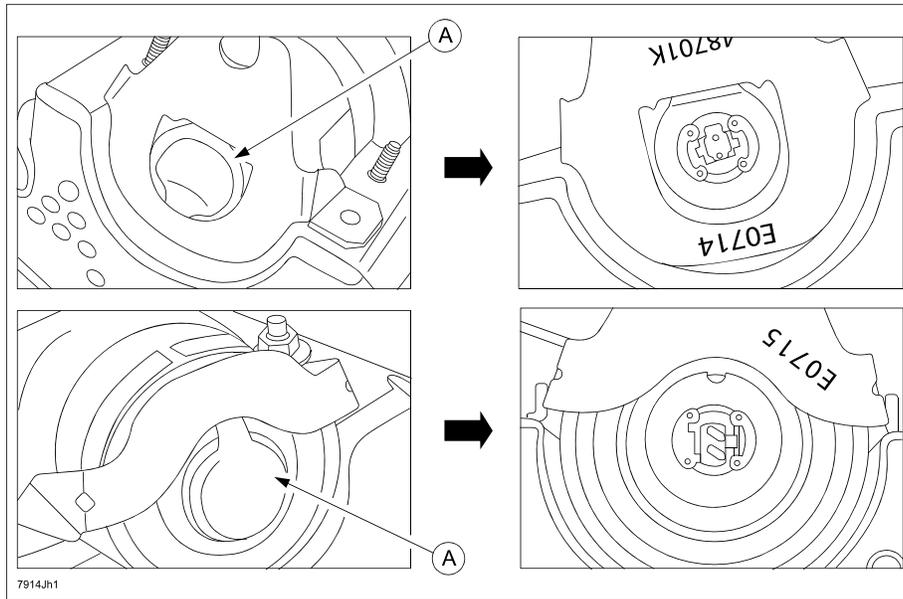


12. Install the new short harness to the inflator.

13. Securely lock the connectors by depressing the stoppers on the back of the connector (A).

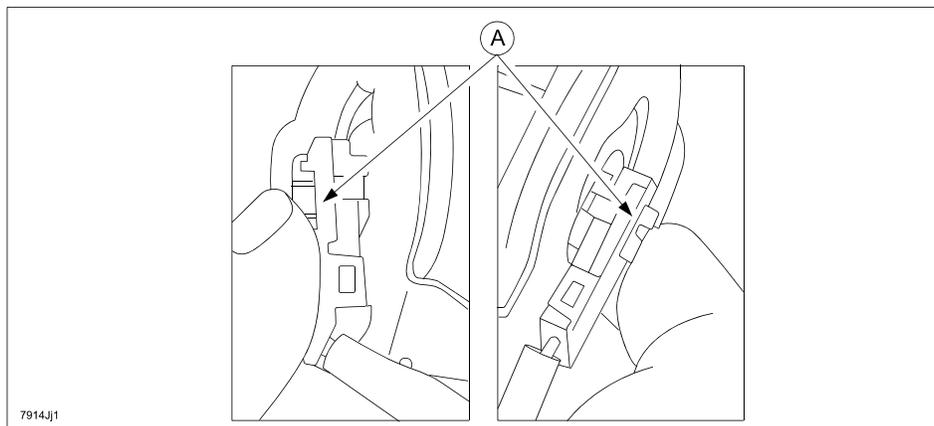


14. Verify that the clip of the harness (A) is securely fixed to the bracket.

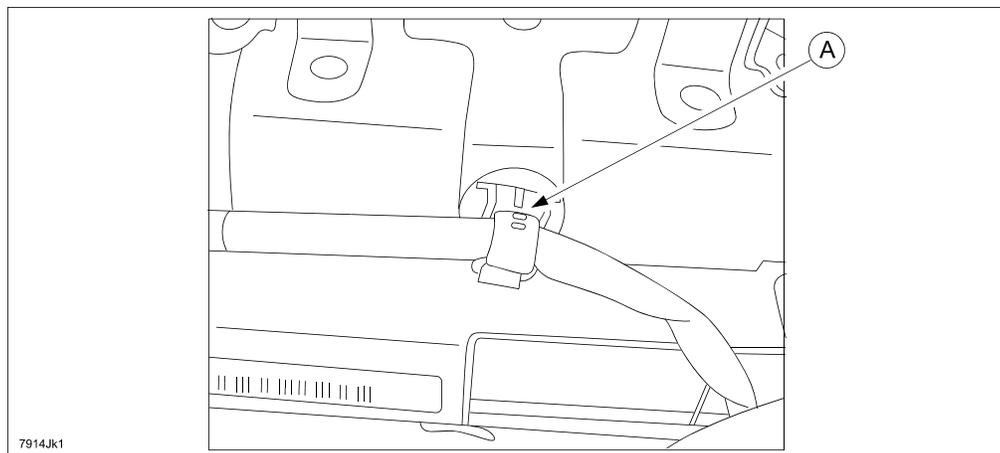

**Air Bag Module Reinstallation:**

1. Re-connect the connector (A), then install the air bag module (B) and the bolts (C).  
**Tightening Torque: 70 - 103 in-lbf. {81 - 119 kgf-cm, 7.9 - 11.7 Nm}**

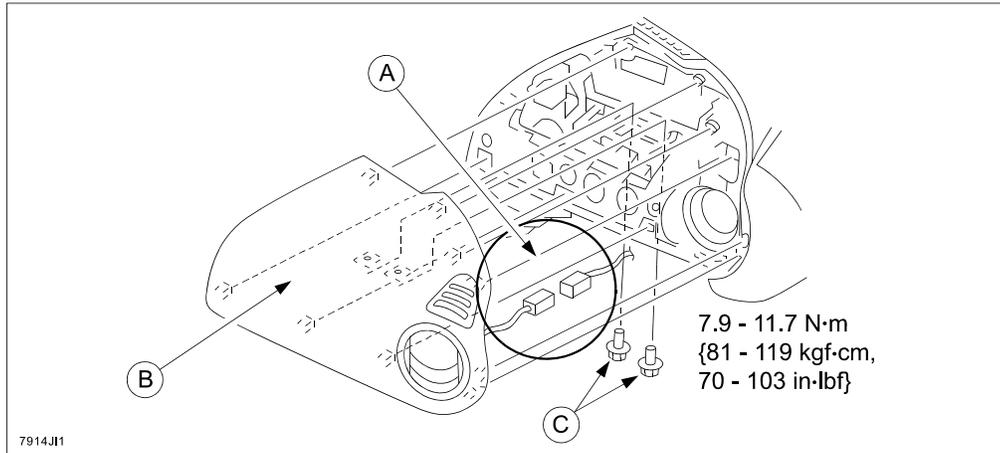

2. Reinstall the glove box.
3. Reconnect the negative battery cable.
4. Turn the ignition switch to the ON position.
5. Verify that the air bag system warning light illuminates for approx. 6 sec., then goes out.


**NOTE:** If the air bag system warning light does not operate in the manner described above, there is a malfunction in the system. Inspect the system following the on-board diagnostic system procedure according to MS3 online or the Workshop Manual (section 08 Restraints).

6. Re-enter the customer's preset radio stations.
7. Proceed to "C. CAMPAIGN LABEL INSTALLATION".

2004-2005 MPV:


**Passenger-Side Air Bag Inflator Replacement Procedure:**

Parts information: The service parts are available in one box [Stopper plate (A), Inflator (B), and 4 Nuts (C)]

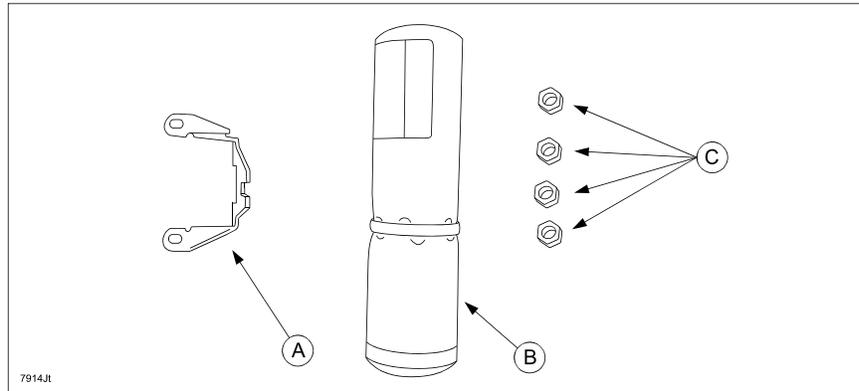

**Outline:**

1. Remove the inflator from the passenger-side air bag module (A), then replace it with a modified one (B) identified with a yellow stripe (C).

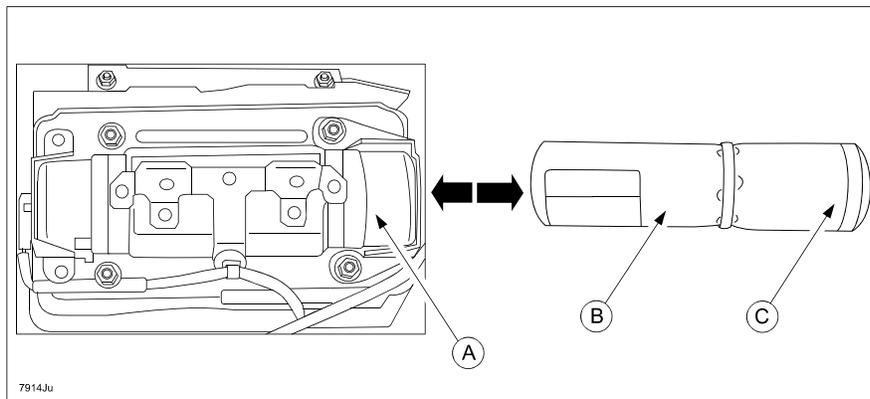


2. Pack and return the removed inflator as follows:

**IMPORTANT: Be sure to follow the packing and shipping instructions provided in the carton and in Attachment IV, Air Bag Inflator Return Instructions.**

**CAUTION:**


- Use the same carton which was used to deliver a new inflator. It is a specialized box that is internationally accepted for shipping an inflator.
- Pack the old inflator in the box exactly in the same manner as the new inflator was packed.

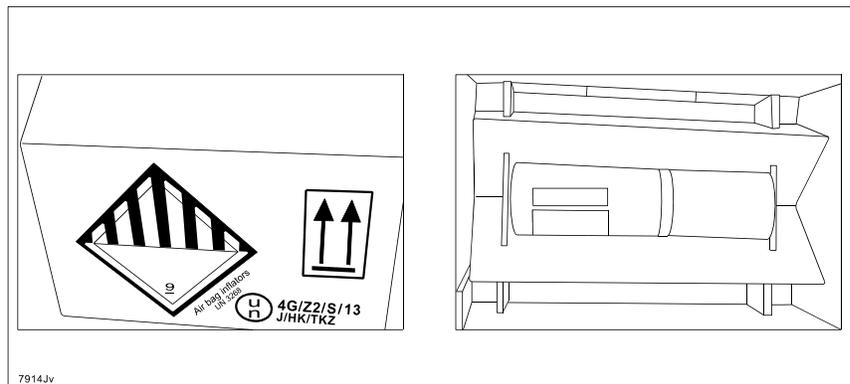


**Air Bag Module Removal:****WARNING:**

- Perform the replacement in a clean environment. Oil, grease, water, etc. on components may cause the air bag modules to fail to deploy in an accident, which may cause serious injury. Do not allow oil, grease, water, etc., on components.
- Inserting a screwdriver, etc., into the connector of an air bag module may damage the connector and cause the air bag module to deploy improperly, which may cause serious injury. Do not insert any foreign objects into the connector.
- Do not disassemble the vehicle, other than instructed here.
- Do not make an attempt to directly supply electrical power to the module and the inflator.
- Keep the module facing of the pad surface upwards at all times, except during replacement.
- Do not use the module and new inflator if they were dropped on the ground.
- Avoid module and inflator exposure to temperatures of 194 degrees F (90 degrees C) or more.


1. Turn the ignition switch to the LOCK position.
2. Record the customer's preset radio stations.
3. Disconnect the negative battery cable and wait for one (1) minute or more.
4. Remove the glove compartment.
  - a. Bend the stoppers inward (A), then remove.

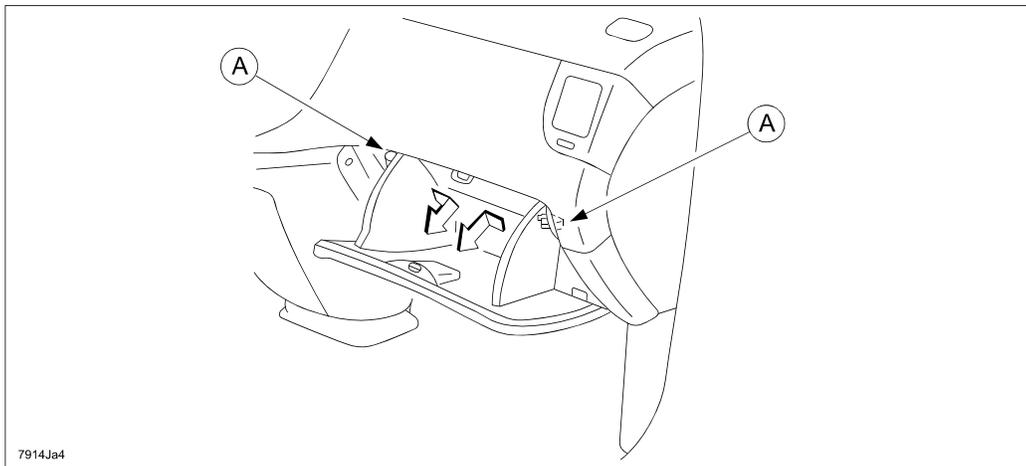

- b. Pull the glove compartment toward you while pushing it downward (1), then remove clip (A).
- c. Slide the glove compartment toward driver's side door (2).

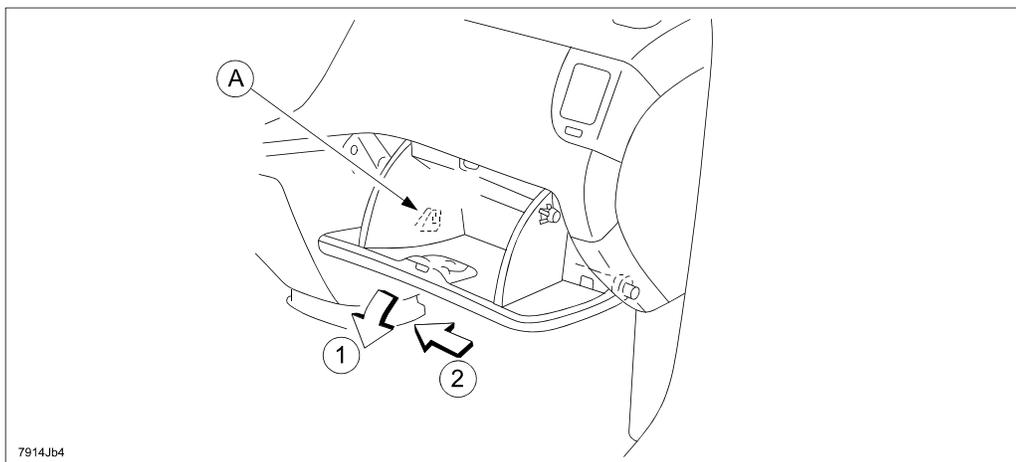


5. Remove the air bag module (A).
  - a. Disconnect the connector (B).
  - b. Remove the bolts (C).

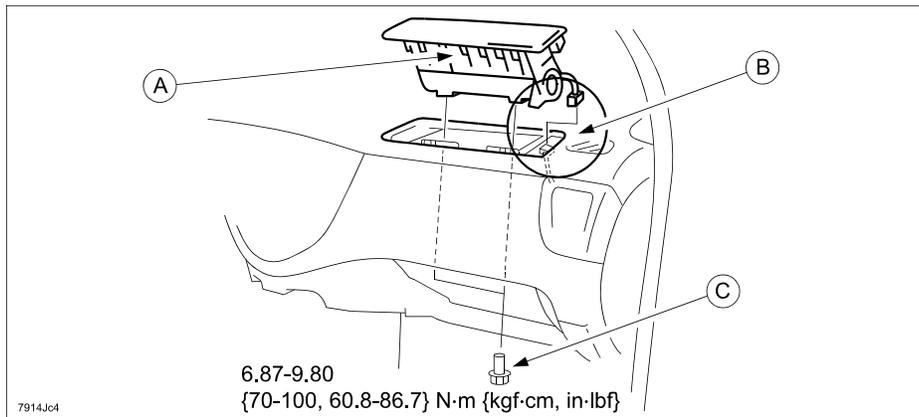

6. Lay a protective cloth on the work bench, then place the air bag module on it to avoid any damage or scratches to the surface.


**Inflator Replacement:**

1. Using a flathead screwdriver, pry out the connector stopper plate (A), then disconnect the connector.

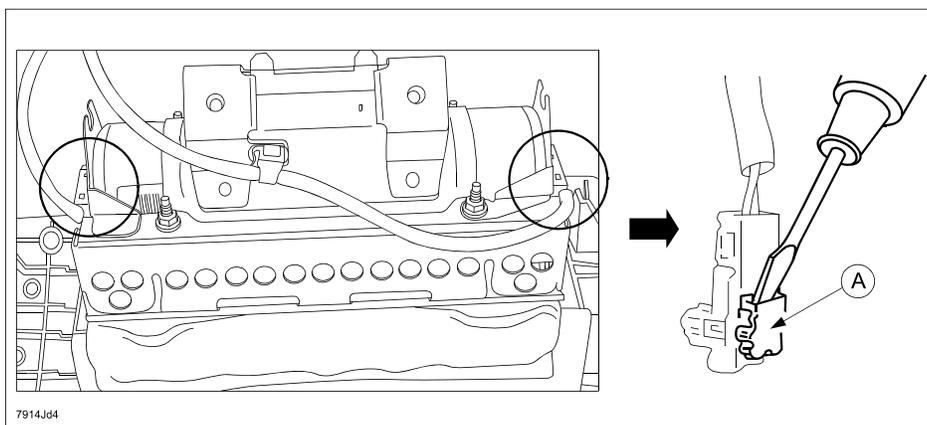


2. Loosen four (4) nuts until the upper surface of the nuts are aligned with the top edge of the screw thread.
3. For easier inflator removal, depress the four (4) nuts and make a gap between the inflator and air bag module.

**NOTE:** Do not depress excessively as the module body may detach.

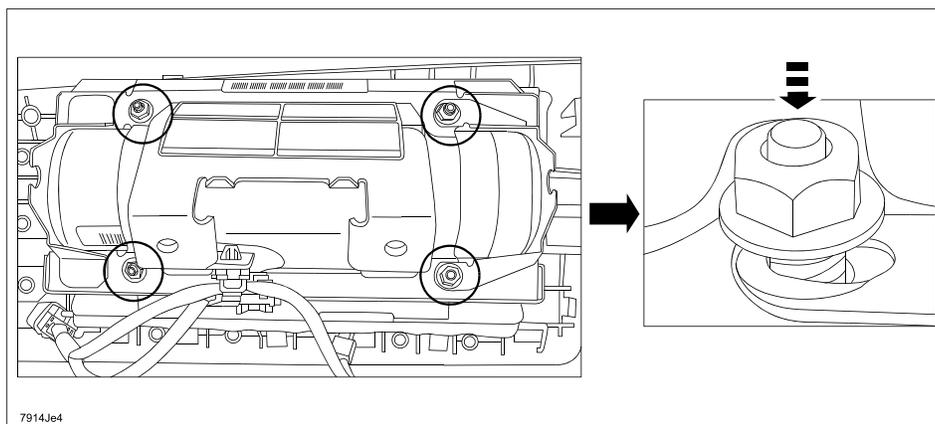


- Remove the four (4) nuts, then remove the stopper plate from the air bag module.

**NOTE:** Discard all of the nuts and stopper plate.

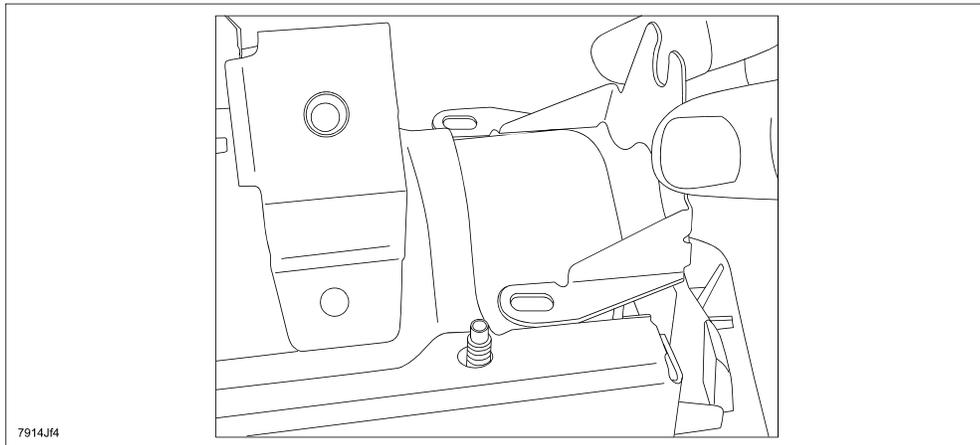


- Push the inflator end with fingers, then remove it by sliding it in the direction shown.


**IMPORTANT:** Return the removed inflator in the same carton in which the new part was received. Carefully follow the packing and shipping instructions included in the carton.

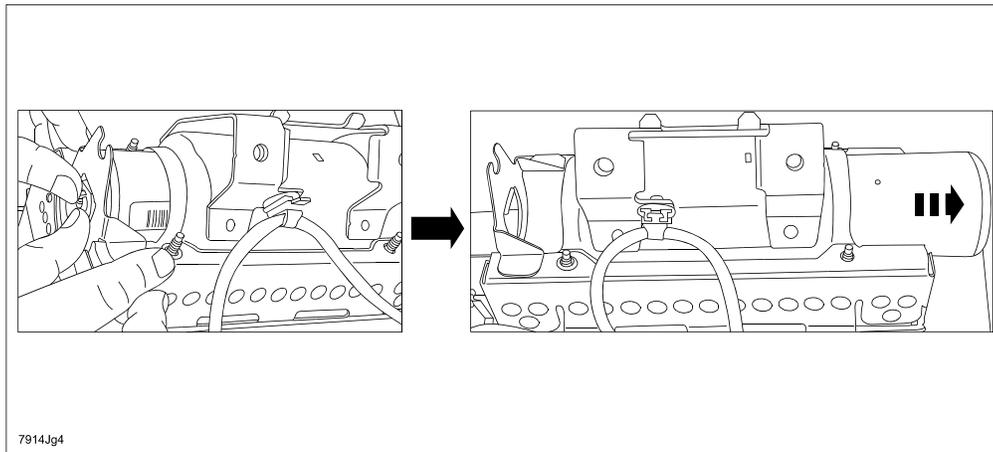


- Insert the modified inflator from the opposite side of where the yellow identification tape (A) is located.

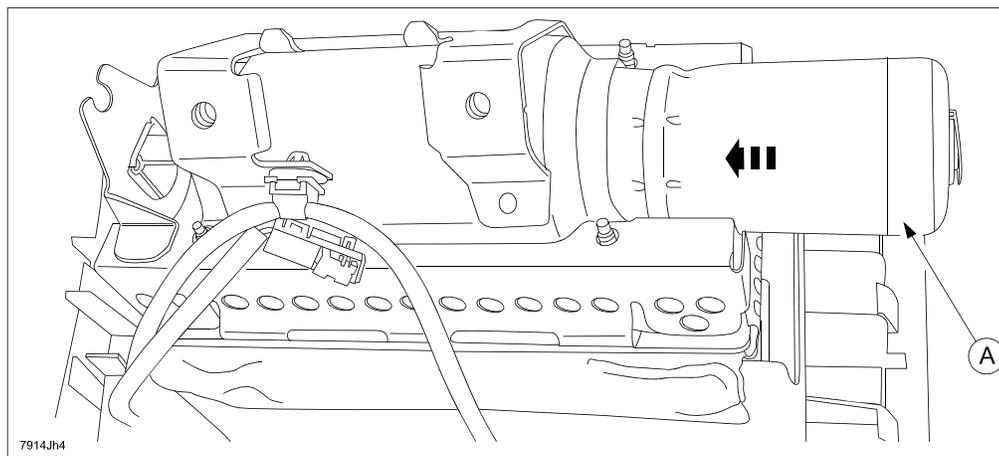


7. Insert the inflator up to the position where it touches the stopper (A), aligning the D-shape end of the inflator with the stopper opening (B).

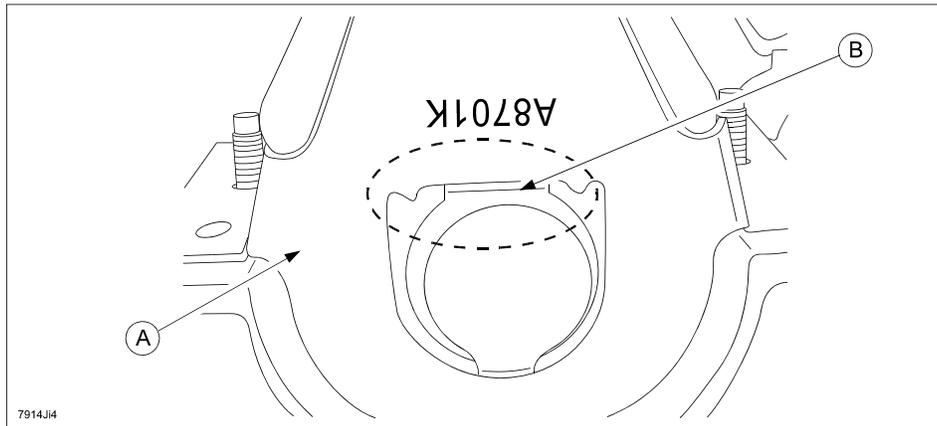


8. Set the new stopper plate (A) by gently pushing until it touches with the inflator side (B).

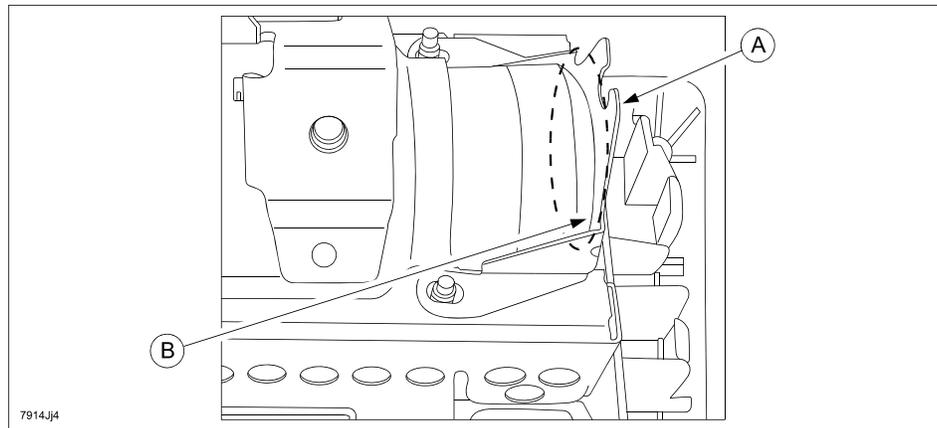


9. Keeping the position above, hand tighten the four (4) new nuts.
10. Tighten the four (4) new nuts to the specified torque in the order shown below (1, 2, 3, 4).  
**Tightening Torque: 35 +/- 1.8 in-lbf. {39.8 +/- 2.0 kgf-cm, 3.9 +/- 0.4 Nm}**

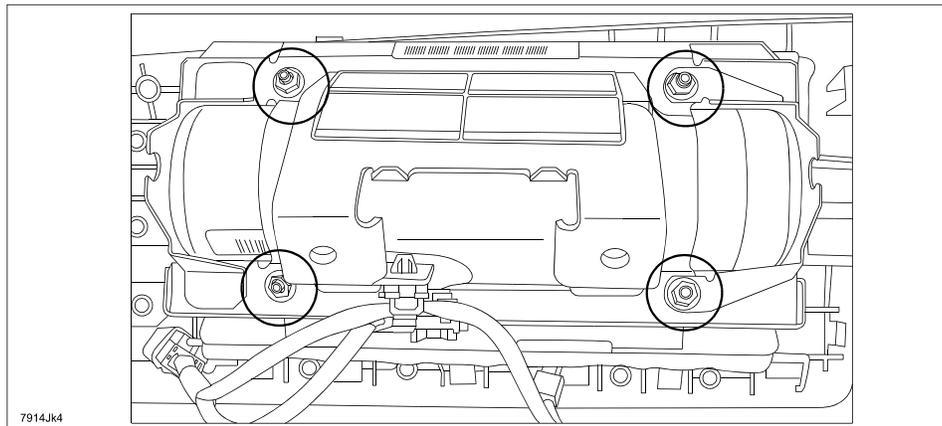

11. Remove the seal (A) from the end of the inflator on both sides.

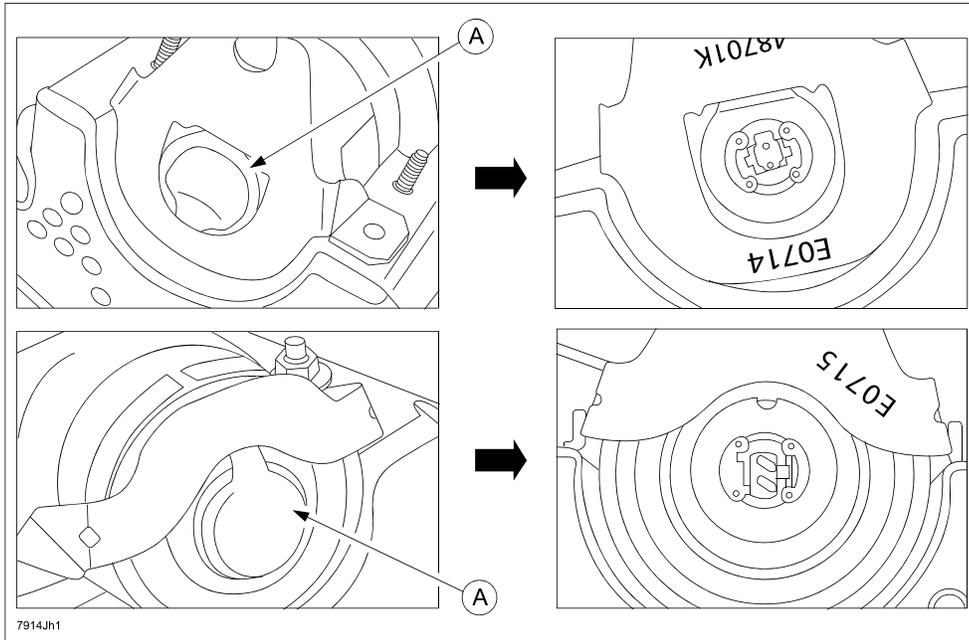


12. Securely lock the connectors by depressing the stoppers on the back of the connector (A).

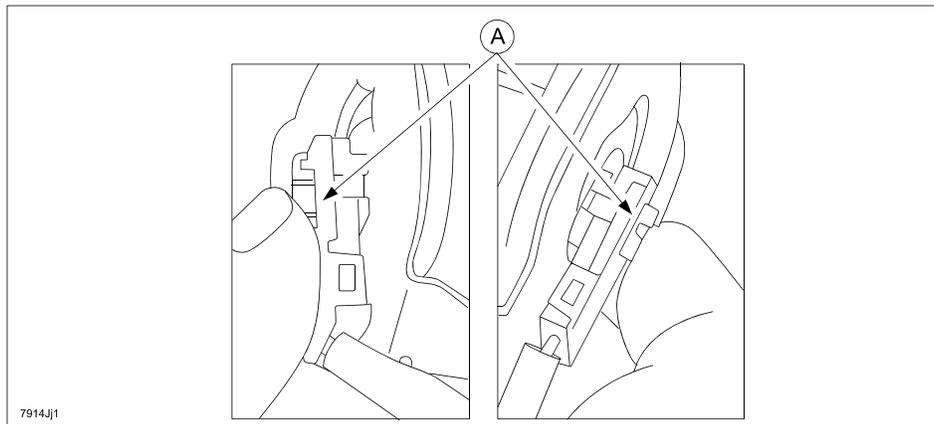


**Air Bag Module Reinstallation:**

1. Re-connect the connector (B), then install the air bag module (A) and the bolt (C).  
**Tightening Torque: 60.8 - 86.7in-lbf. {70 - 100 kgf-cm, 6.8 - 9.8 Nm}**

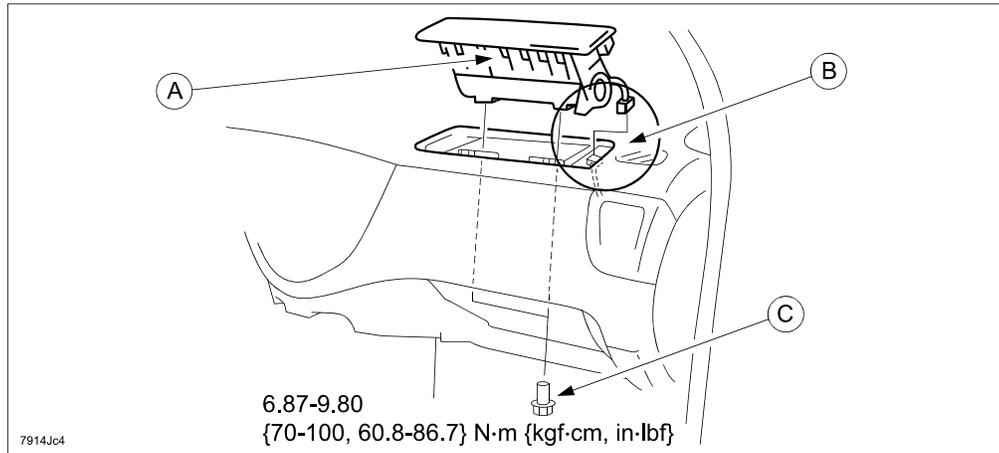

2. Install the connector as shown.

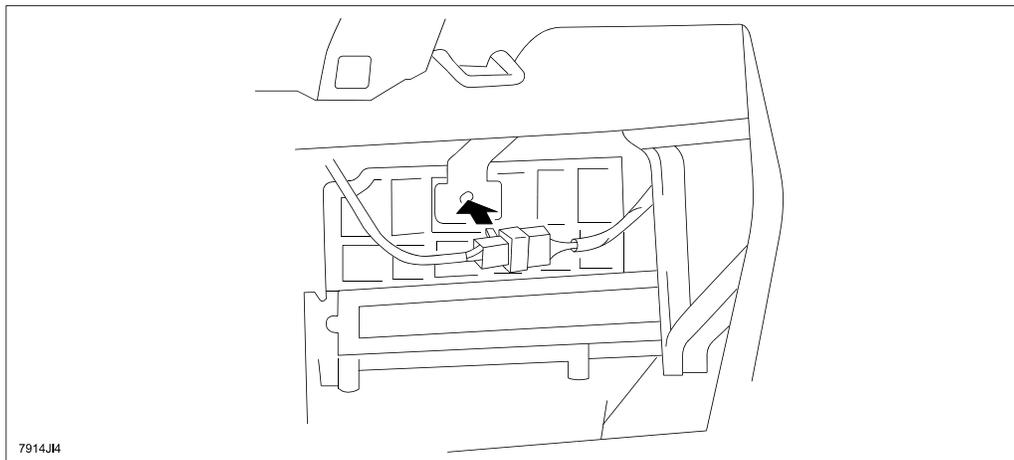

3. Reconnect the negative battery cable.
4. Turn the ignition switch to the ON position.
5. Verify that the air bag system warning light illuminates for approx. 6 sec., then goes out.

**NOTE:** If the air bag system warning light does not operate in the manner described above, there is a malfunction in the system. Inspect the system following the on-board diagnostic system procedure according to MS3 online or the Workshop Manual (section 08 Restraints).

6. Reinstall the glove box.
7. Re-enter the customer's preset radio stations.
8. Proceed to "C. CAMPAIGN LABEL INSTALLATION".


**2004 B-Series:**

**Passenger-Side Air Bag Inflator Replacement Procedure:**

Parts Information: The service parts are available in one box.

**Outline:**

1. Remove the inflator from the passenger-side air bag module (A), then replace it with a modified one (B) identified with a yellow stripe (C).

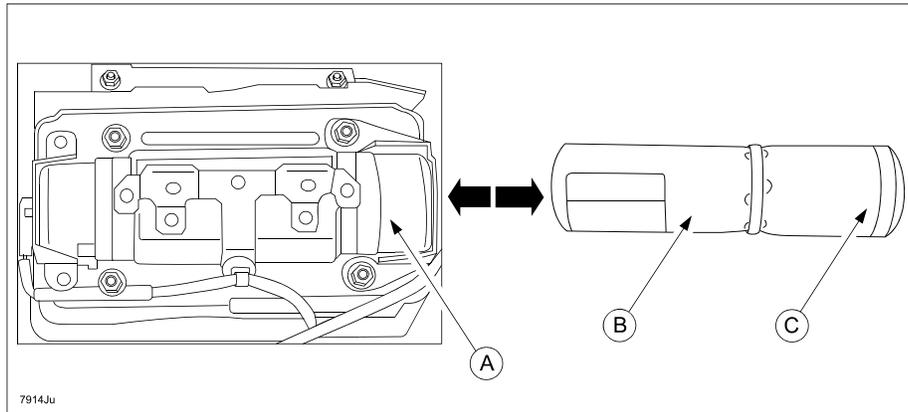


2. Pack and return the removed inflator as follows:

**IMPORTANT: Be sure to follow the packing and shipping instructions provided in the carton and in Attachment IV, Air Bag Inflator Return Instructions.**


**CAUTION:**

- Use the same carton which was used to deliver a new inflator. It is a specialized box that is internationally accepted for shipping an inflator.
- Pack the old inflator in the box exactly in the same manner as the new inflator was packed.

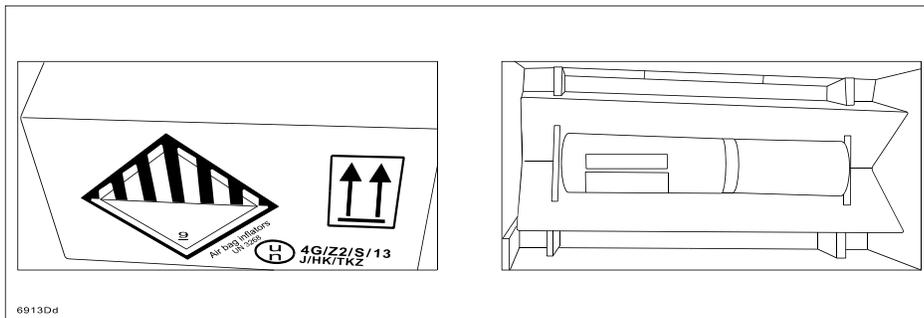


**Air Bag Module Removal:****WARNING:**


- Perform the replacement in a clean environment. Oil, grease, water, etc. on components may cause the air bag modules to fail to deploy in an accident, which may cause serious injury. Do not allow oil, grease, water, etc., on components.
  - Inserting a screwdriver, etc., into the connector of an air bag module may damage the connector and cause the air bag module to deploy improperly, which may cause serious injury. Do not insert any foreign objects into the connector.
  - Do not disassemble the vehicle, other than instructed here.
  - Do not make an attempt to directly supply electrical power to the module and the inflator.
  - Keep the module facing of the pad surface upwards at all times, except during replacement.
  - Do not use the module and new inflator if they were dropped on the ground.
  - Avoid module and inflator exposure to temperatures of 194 degrees F (90 degrees C) or more.
1. Turn the ignition switch to the LOCK position.
  2. Record the customer's preset radio stations.
  3. Disconnect the negative battery cable and wait for one (1) minute or more.
  4. Open the glove compartment door to access the passenger air bag electrical connector.

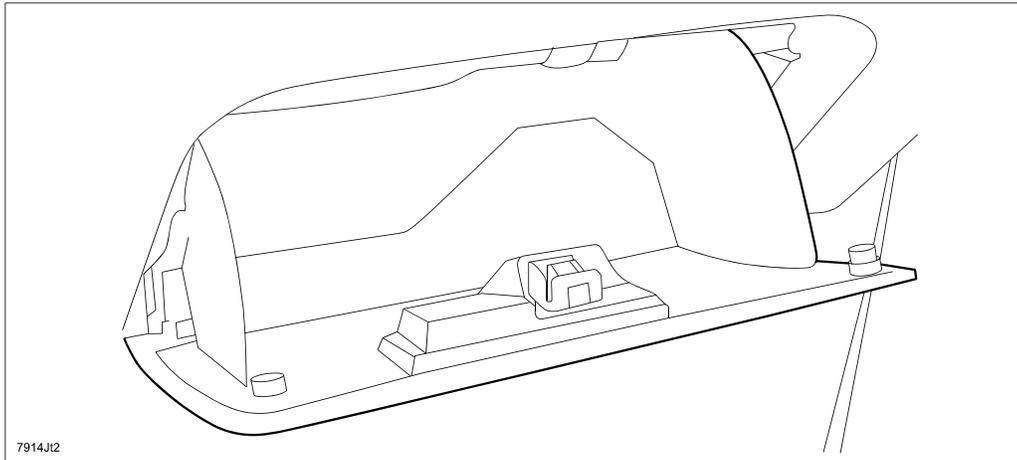

5. Release the tab and disconnect the passenger air bag module electrical connector

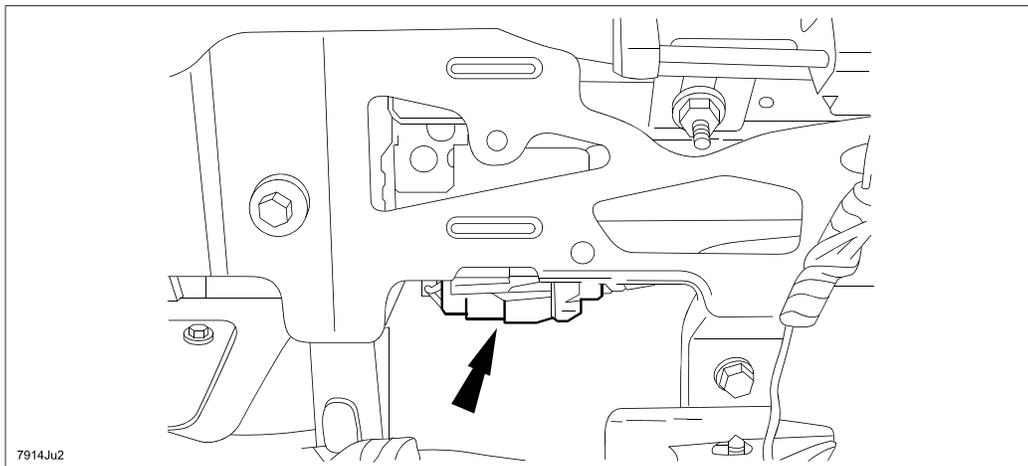


6. Remove the two passenger air bag module bolts (A).

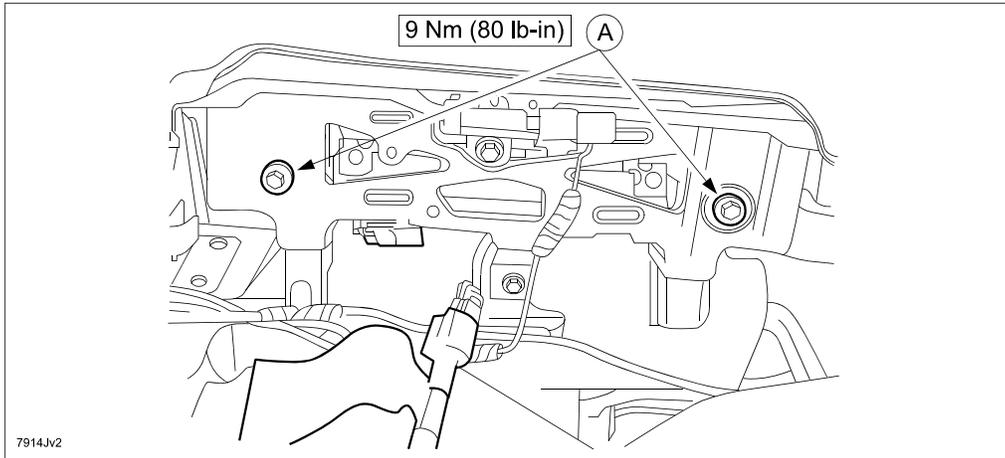


7. Remove the passenger airbag. If necessary, push down on the top and up on the bottom of the deployment door while pushing out on the passenger air bag module, releasing the clips from the instrument panel and remove the passenger air bag module

**CAUTION:** Do not handle the passenger air bag module by grabbing the edges of the deployment doors. Place one hand in the glove compartment and push the passenger air bag out.

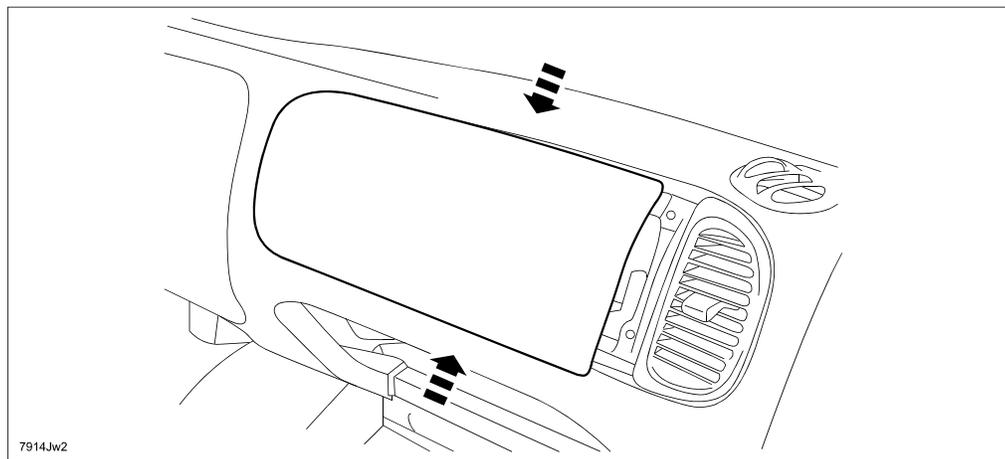


**Inflator Replacement:**

1. Set the airbag face down onto a surface that will not scratch or damage the airbag face.
2. Remove the wiring harness connector retaining clip (A) from the wiring harness connector. (B)

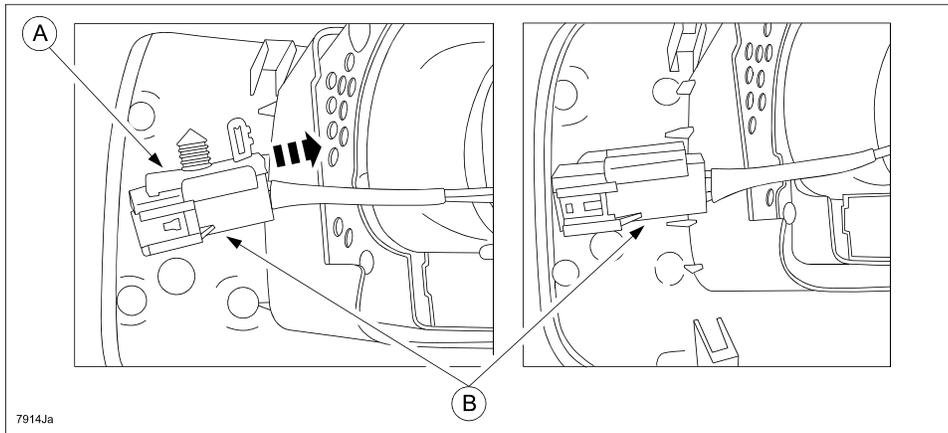

3. Remove the two airbag inflator retaining bracket nuts (A) and the airbag inflator retaining bracket (B). Discard the nuts.


**WARNING:** Do not allow any debris or retainers on or around the airbag once the inflator is removed.

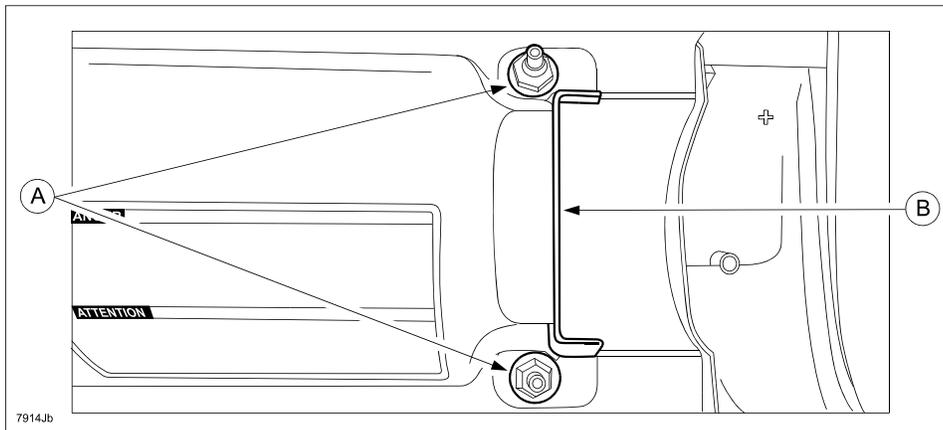

- With an assistant holding the airbag assembly, remove the inflator (A) from the airbag assembly by pushing outward on the inflator. Set the airbag inflator aside for return shipping.

**IMPORTANT:**


- If required, use of a brass punch (B) is permitted only at the location shown to free the inflator from its mounted position.
- Return the removed inflator in the same carton in which the new part was received. Carefully follow the packing and shipping instructions included in the carton.

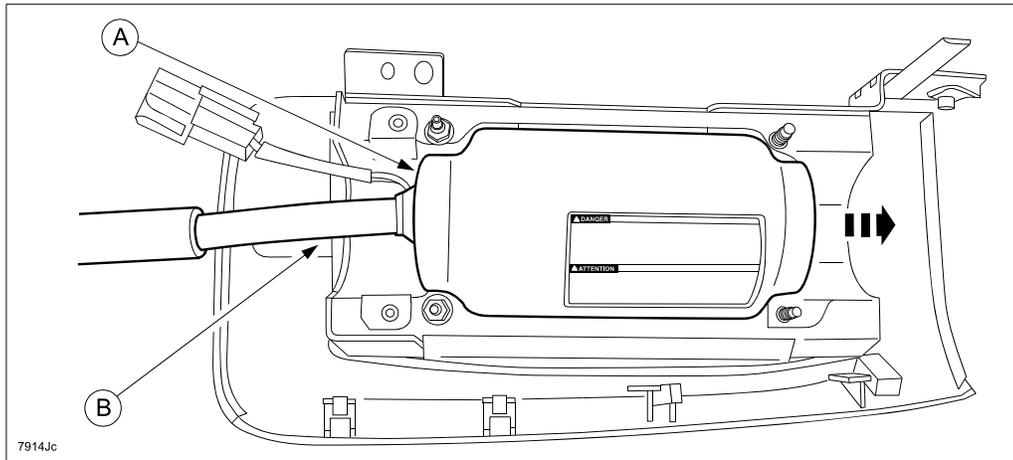


- Install the new passenger side airbag inflator into the airbag assembly.

**NOTE:**


- The new airbag inflator can be identified by a yellow stripe (A).
- The indexed end of the airbag inflator must be installed first (B) to mate with the permanently mounted bracket.

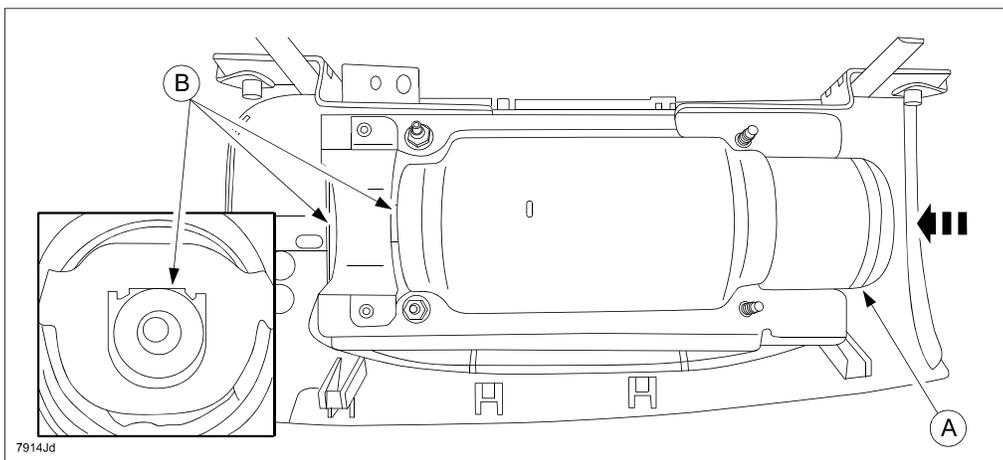

6. Install the passenger side air bag inflator retaining bracket (B) and install the two nuts (A).  
**Tightening Torque: 35 +/- 1.8 in-lbf. {39.8 +/- 2.0 kgf-cm, 3.9 +/- 0.4 Nm}**

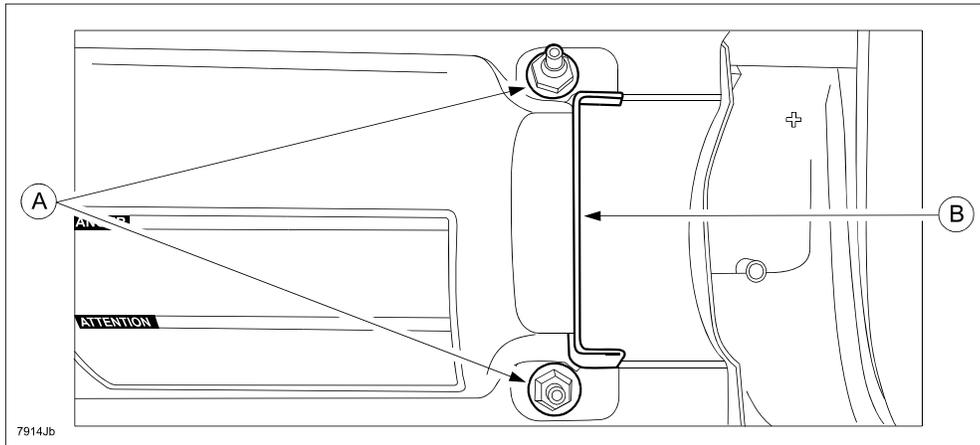


7. Connect the new wiring harness (A) to the passenger air bag inflator.

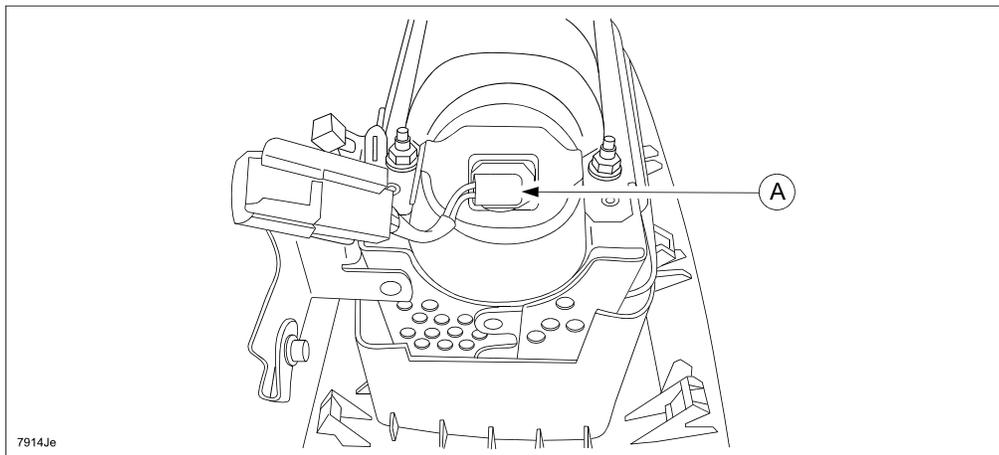


**Air Bag Module Reinstallation:**

1. Install the air bag module assembly. Angle the top of the passenger air bag module into the instrument panel first so that the deployment door upper clips engage to the instrument panel. Push up and in at the top and down and in at the bottom of the deployment door to seat all the clips to the instrument panel.


**CAUTION:** DO NOT handle the passenger air bag module by grabbing the edges of the deployment doors. Position the passenger air bag module into the instrument panel.

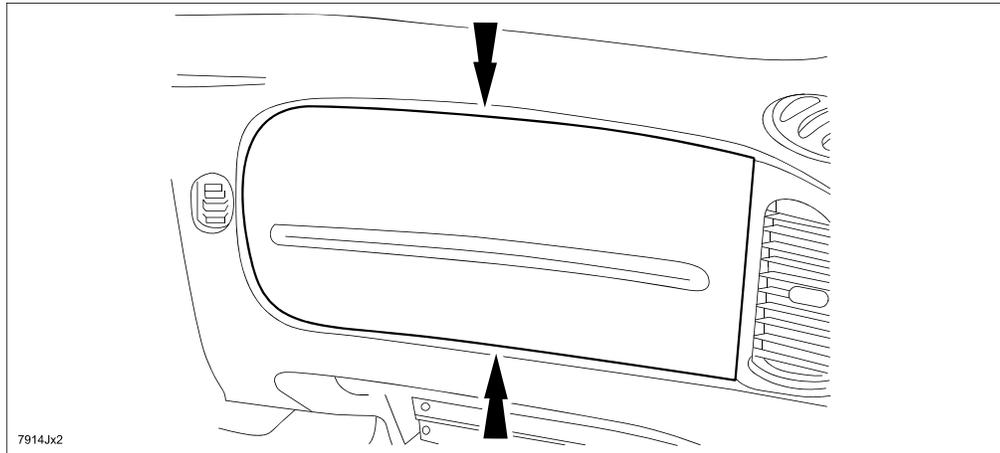

2. Align the passenger air bag module and install the bolts (A).  
**Tightening Torque: 80 in-lbf. {9 Nm}**

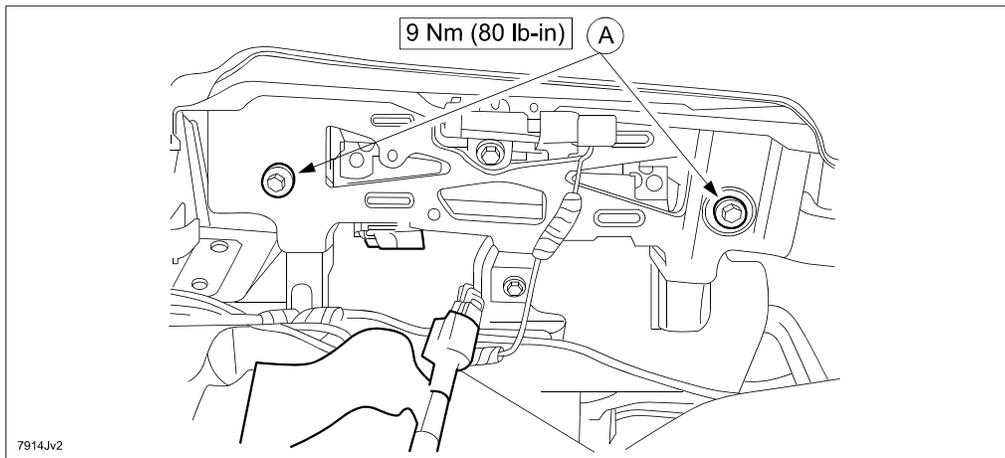

3. Connect the passenger air bag module electrical connector.

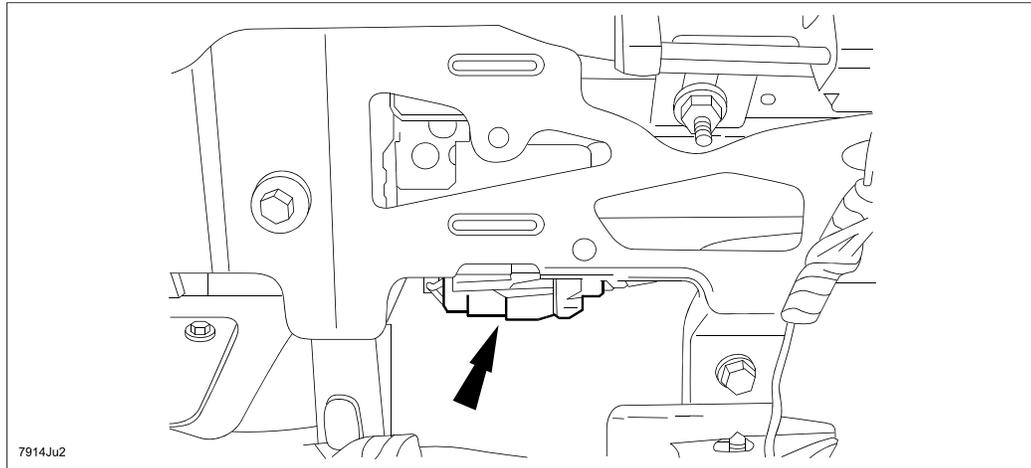

4. Close the glove compartment door.
5. Reconnect the negative battery cable.
6. Turn the ignition switch to the ON position.
7. Verify that the air bag system warning light illuminates for approx. 6 sec., then goes out.


**NOTE:** If the air bag system warning light does not operate in the manner described above, there is a malfunction in the system. Inspect the system following the on-board diagnostic system procedure according to MS3 online or the Workshop Manual (section 08 Restraints).

8. Re-enter the customer's preset radio stations.
9. Proceed to "C. CAMPAIGN LABEL INSTALLATION".

2004-2007 Mazda6, 2006-2007 Mazdaspeed6, and 2004-2008 RX-8:


**Driver-Side Air Bag Inflator Replacement Procedure:**

Parts Information: The service parts are available in one box [Inflator (A) and 4 Nuts (B)].

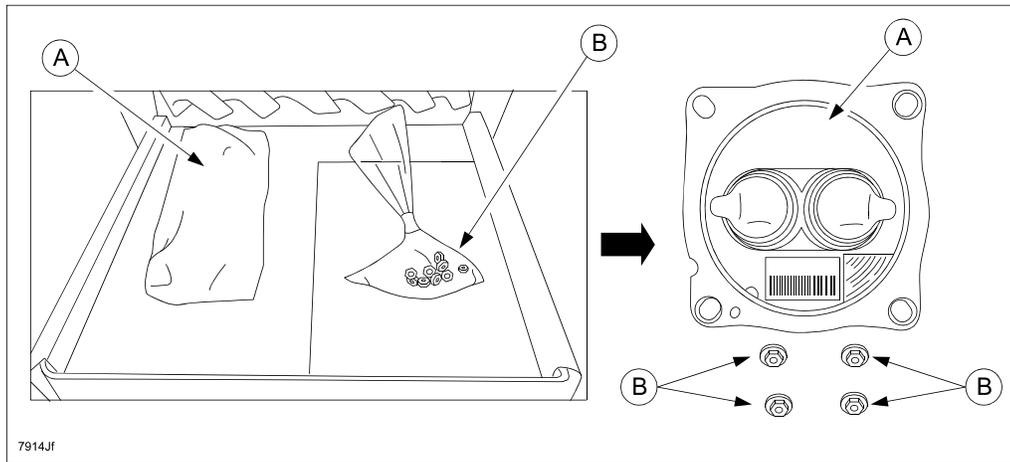

**Outline:**

1. Remove the inflator (A) from the air bag module then replace it with a modified one.

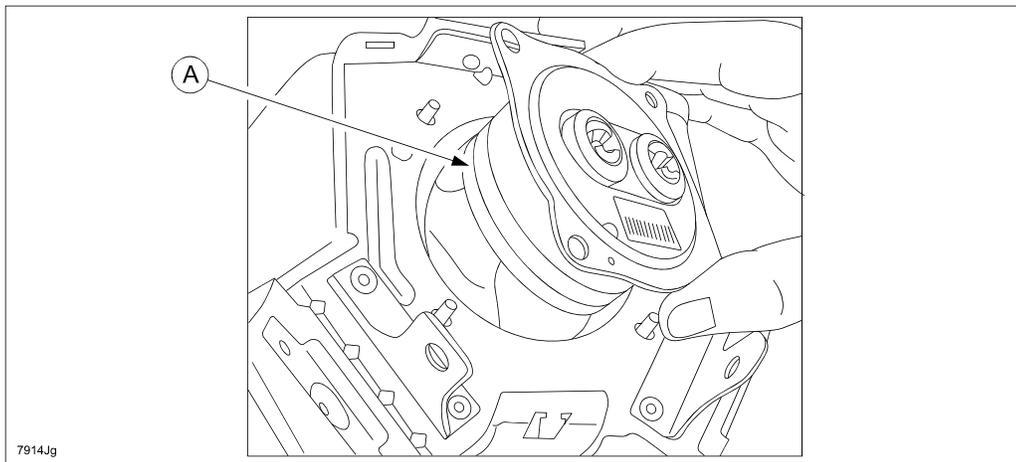

2. Pack and return the removed inflator as follows:

**IMPORTANT:** Be sure to follow the packing and shipping instructions provided in the carton and in Attachment IV, Air Bag Inflator Return Instructions.


**CAUTION:**

- Use the same carton which was used to deliver a new inflator. It is a specialized box that is internationally accepted for shipping an inflator.
- Pack the old inflator in the box exactly in the same manner as the new inflator was packed.

**Air Bag Module Removal:****WARNING:**

- Perform the replacement in a clean environment. Oil, grease, water, etc. on components may cause the air bag modules to fail to deploy in an accident, which may cause serious injury. Do not allow oil, grease, water, etc., on components.
- Inserting a screwdriver, etc., into the connector of an air bag module may damage the connector and cause the air bag module to deploy improperly, which may cause serious injury. Do not insert any foreign objects into the connector.
- Do not disassemble the vehicle, other than instructed here.
- Do not make an attempt to directly supply electrical power to the module and the inflator.
- Keep the module facing of the pad surface upwards at all times, except during replacement.
- Do not use the module and new inflator if they were dropped on the ground.
- Avoid module and inflator exposure to temperatures of 194 degrees F (90 degrees C) or more.

1. Turn the ignition switch to the LOCK position.
2. Record the customer's preset radio stations.
3. Disconnect the negative battery cable and wait for one (1) minute or more.
4. Remove the driver-side air bag module.
  - a. Remove the covers (A).
  - b. Remove the bolts (B).
  - c. Disconnect the connectors (D). Using a flathead screwdriver, pry out the connector's stopper plate.
  - d. Remove the air bag module (C).

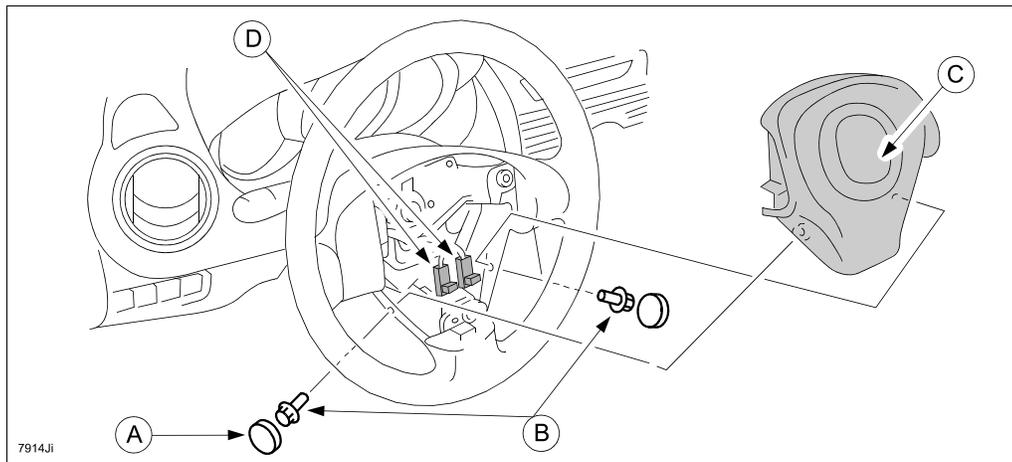


7914Ji

**Inflator Replacement:**


1. Set the airbag face down onto a surface that will not scratch or damage the airbag face.
2. Remove the 4 nuts, then remove the inflator from the air bag body. Discard the original nuts

**NOTE:** DO NOT use an impact wrench.

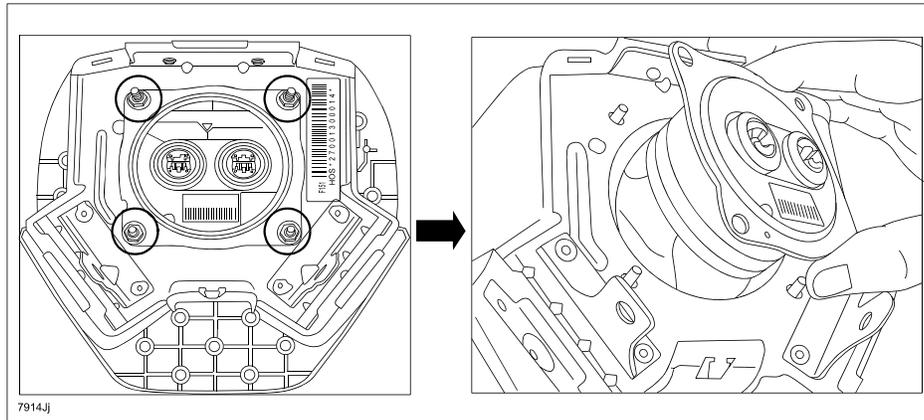


**CAUTION:**


- DO NOT touch the bolts (A) or the cloth (B).
- DO NOT drop nuts or foreign materials in the air bag body.

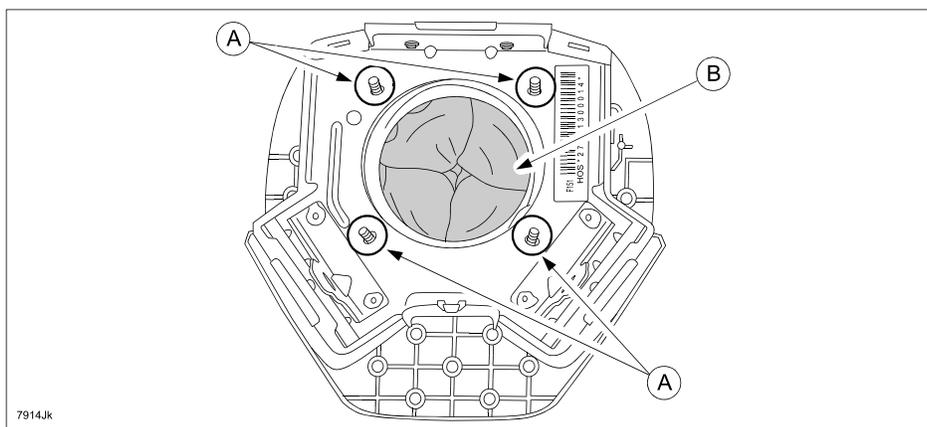

3. Make sure that the installing inflator is a modified one by looking the description of “2014” on the label (A) as shown.

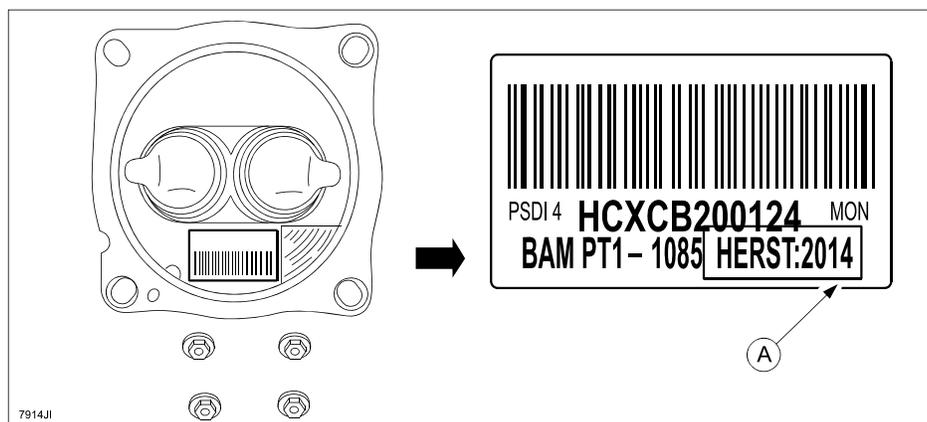


- Facing the side having the label (A) downward, carefully insert the modified inflator into the air bag body as shown

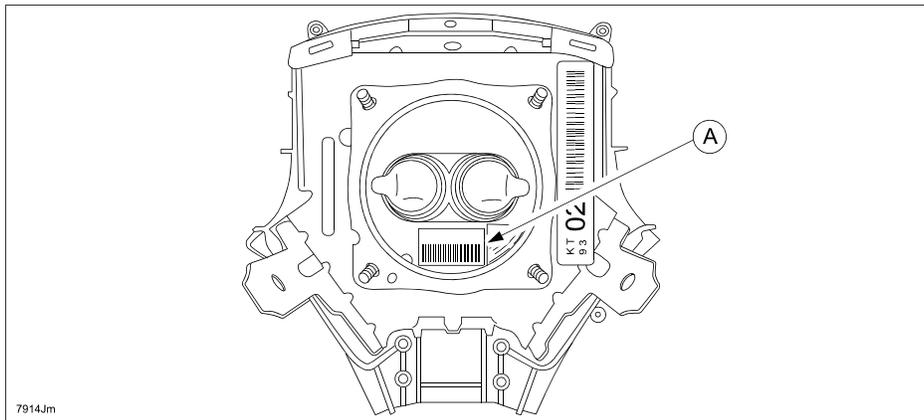


- Tighten the new nuts (with self-lock) finger tight at first, then tighten them to the specified torque in the order of (1) – (2) – (3) – (4) as shown.

**Tightening Nut Torque:  $3.9 \pm 0.4$  Nm ( $34 \pm 3.5$  in-lb)**

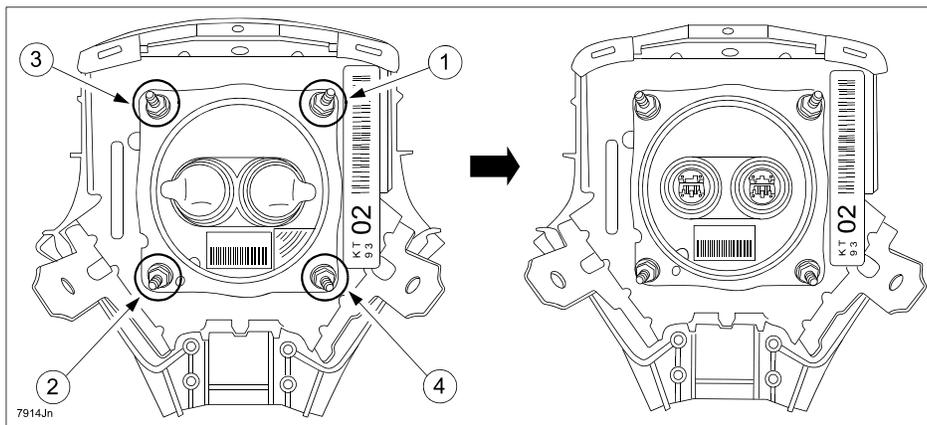


**NOTE:**


- Peel off the dust-proof seal and confirm the two terminals of red and yellow layouts correctly as shown in the right photo.
- In the event that it is difficult to install the nut because the bolt is not coming out enough (A), refer to the following steps:

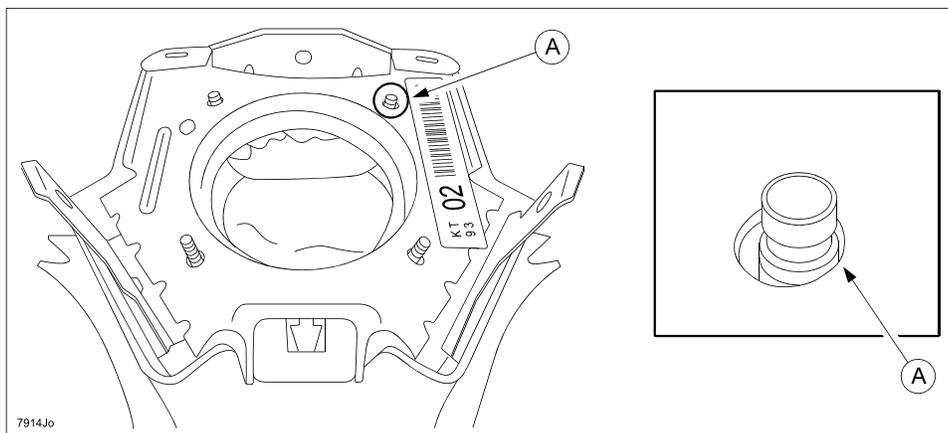


- a. Get out the bolts out as much as possible by pulling up on the bag ring by hand.

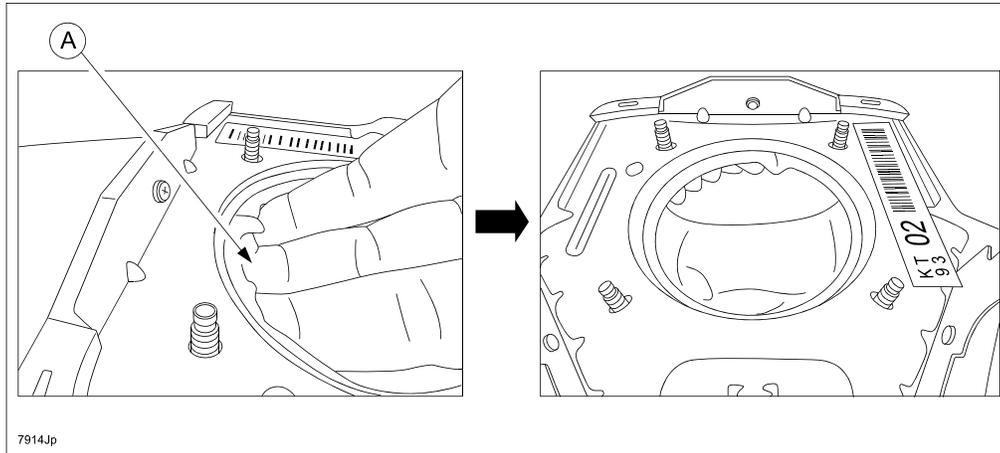

- b. Install one nut to one bolt (A), then pull out the next bolt diagonally from that one using needle-nose pliers (B), being careful not to damage the bolt threads.

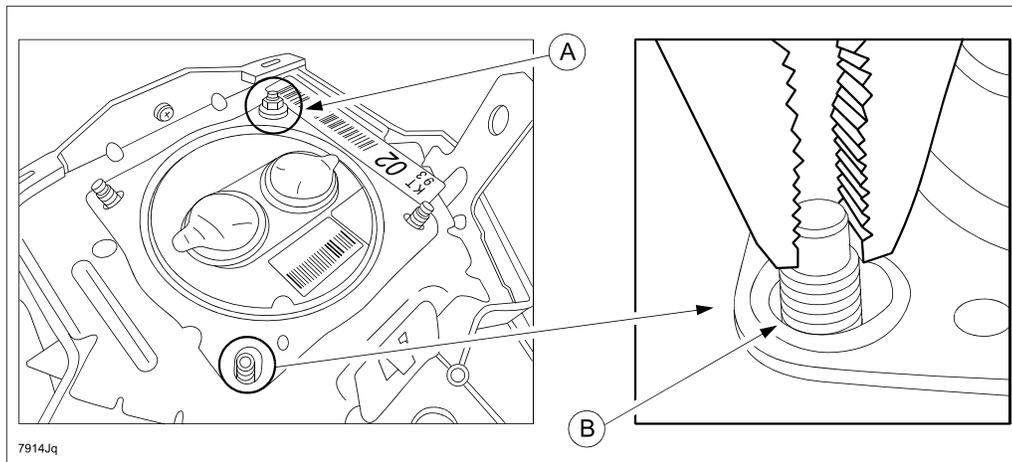

- c. Install the nut to the bolt which has been pulled out with pliers, then install the other nuts to the two remaining bolts.

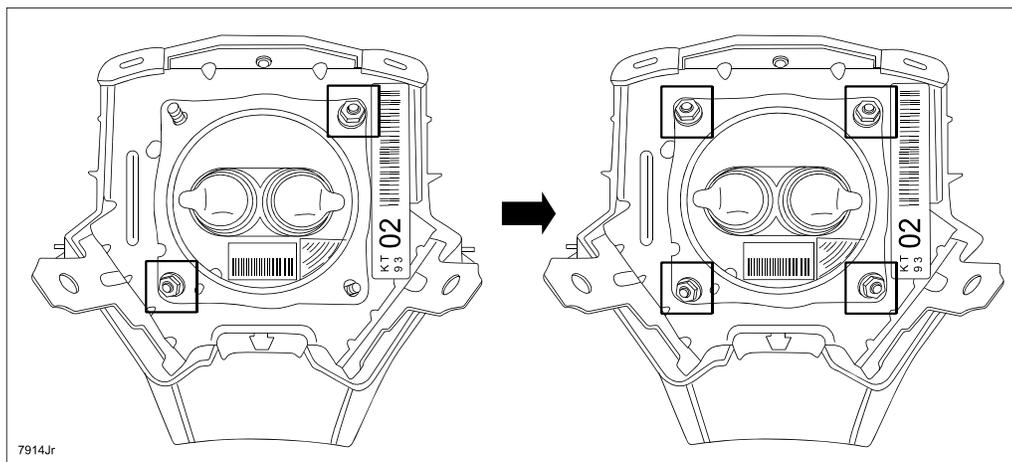


**Air Bag Module Reinstallation:**

1. Install the driver-side air bag module.
  - a. Re-connect the connectors (A) to air bag module, securely locking the connectors by depressing the stoppers on the connector back.
  - b. Install the air bag module (B).
  - c. Install the bolts (C).

**Tightening Torque: 70 - 103 in-lbf. {81 - 119 kgf-cm, 7.9 - 11.7 Nm}**

  - d. Install the covers (D).

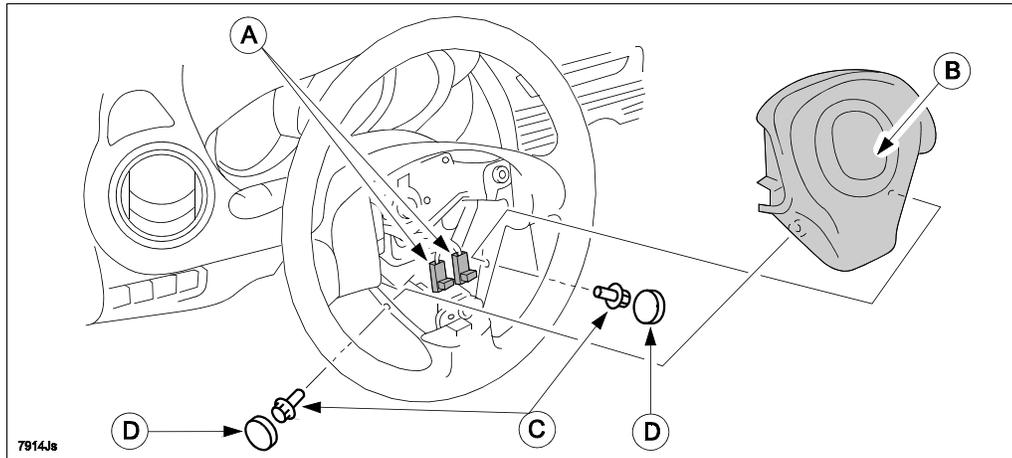

2. Reconnect the negative battery cable.
3. Turn the ignition switch to the ON position.
4. Verify that the air bag system warning light illuminates for approx. 6 sec., then goes out.

**NOTE:** If the air bag system warning light does not operate in the manner described above, there is a malfunction in the system. Inspect the system following the on-board diagnostic system procedure according to MS3 online or the Workshop Manual (section 08 Restraints).

5. Re-enter the customer's preset radio stations.
6. Proceed to "C. CAMPAIGN LABEL INSTALLATION".

### C. CAMPAIGN LABEL INSTALLATION


1. Fill out a blue "Campaign Label" (9999-95-065A-06) with Campaign No: "7914J", your dealer code, today's date.

CAMPAIGN LABEL	
CAMPAIGN NO:	_____
DEALER CODE:	_____
DATE:	/  /

P/N 9999-95-065A-06

1326b

2. Affix it to the hood or bulkhead as shown:

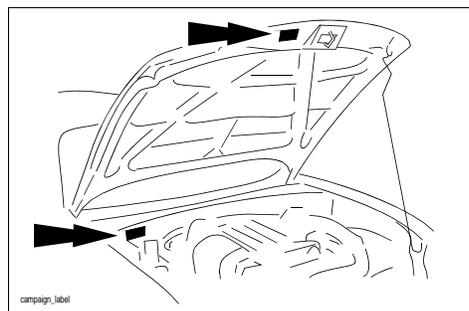

3. Return the vehicle to customer.

# DRIVER SIDE AIR BAG INFLATOR PACKING & SHIPPING INSTRUCTIONS

## 48 State FedEx Ground Shipment Preparation

Instructions for mandatory return of original airbag inflators for [Mazda Safety Recall 7914J](#).

Dealers in **Alaska, Hawaii, Puerto Rico, and Canada** **CANNOT** follow these shipping instructions. These dealers **MUST** contact the following Takata USA representative directly for shipping instructions: Miguel Prigadaa – Tel #: 210-250-5079 or Email: [MLGTakataRestraints\\_International@menloworldwide.com](mailto:MLGTakataRestraints_International@menloworldwide.com).

**CAUTION:** Do not deploy the inflator. Return the inflator promptly after completing the repair.

1. Place the undeployed air bag inflator in the carton the new inflator was shipped in. **Do not include any other hardware that may rattle, causing rejection of your shipment.**



2. Close the top box flap, per box instructions use 2 inch clear packing tape and firmly apply a minimum of 2 inches tape on front flap extending a minimum of 2 inches on bottom side of box.
3. Complete and/or affix the provided FedEx Ground paperwork; PRP address label, OP-900PRP, and the adhesive document pouch, which were provided with the new inflator.
  - **OP-900PRP Hazardous Materials Certification form**
    - a) Separate the bottom four labels and place them in the zip lock pouch. Remove the pouch backing and firmly place on bottom side of box.
    - b) Fill in Shipper Name, Address and Chemtrek Contract Number (CCN) in 3 locations: the Box, FedEx, and Customer Copy. **The Chemtrek Contract Number (CCN) assigned to your dealership is available on MS3 with 7914J documents. This CCN is to be used only for 7914J.**
    - c) Date the FedEx and Customer Copy (forms are already pre-signed).
    - d) Peel off the Box Copy and firmly apply to the front side of the box flap.
    - e) On the FedEx and Customer copy, complete Tracking ID box by listing the 15 digit tracking ID found beneath the large bar code or peel off the SHIPPER RECEIPT and RECEIPT tabs found at top of the PRP Shipping Label and apply to the Tracking ID box.
    - f) Keep Customer Copy for dealer records and retain for a minimum of 2 years.
    - g) Give the FedEx Copy to the FedEx Ground driver.
  - **FedEx Ground PRP Shipping Label**
    - a) Fill in Shipper Name & Address at upper section of label (RA# is not required)
    - b) Peel off the label backing and affix to top of box to left of the Class 9 label. Use the scribe marks on the box as a guide so the PRP label does not touch any portion of the Class 9 label or its border.
    - c) When shipment is ready, call for FedEx Ground pick up using number listed for business locations (888-777-6040), or if you receive regular pickups, give the package to your FedEx Ground driver.
- Remove or black out any **old** shipping labels or barcodes (not hazard marks).
- Do not cover any portion of the Class 9 label, shipping name, UN number and UN box specifications.
- Prior to shipment, ensure all steps have been properly completed. All packages must be prepared in accordance with all DOT and FedEx Ground requirements. Incomplete or missing information will result in return to sender.

# Driver Side Air Bag Inflator Return Procedure – Lower 48 States Only

## *Top of Inflator Box and Shipping Forms*



## *Bottom of Inflator Shipping Box*

Affix adhesive pouch containing all 4 bottom labels from OP-900PRP form



# DRIVER SIDE AIR BAG INFLATOR PACKING & SHIPPING INSTRUCTIONS

## 48 State FedEx Ground Shipment Preparation

Instructions for mandatory return of original airbag inflators for [Mazda Safety Recall 7914J](#).

Dealers in **Alaska, Hawaii, Puerto Rico, and Canada** **CANNOT** follow these shipping instructions. These dealers **MUST** contact the following Takata USA representative directly for shipping instructions: Miguel Prigadaa – Tel #: 210-250-5079 or Email: [MLGTakataRestraints\\_International@menloworldwide.com](mailto:MLGTakataRestraints_International@menloworldwide.com).

**CAUTION:** Do not deploy the inflator. Return the inflator promptly after completing the repair.

1. Place the undeployed air bag inflator in the carton the new inflator was shipped in. **Do not include any other hardware that may rattle, causing rejection of your shipment.**



2. Close the top box flap, per box instructions use 2 inch clear packing tape and firmly apply a minimum of 2 inches tape on front flap extending a minimum of 2 inches on bottom side of box.
3. Complete and/or affix the provided FedEx Ground paperwork; PRP address label, OP-900PRP, and the adhesive document pouch, which were provided with the new inflator.
  - **OP-900PRP Hazardous Materials Certification form**
    - a) Separate the bottom four labels and place them in the zip lock pouch. Remove the pouch backing and firmly place on bottom side of box.
    - b) Fill in Shipper Name, Address and Chemtrek Contract Number (CCN) in 3 locations: the Box, FedEx, and Customer Copy. **The Chemtrek Contract Number (CCN) assigned to your dealership is available on MS3 with 7914J documents. This CCN is to be used only for 7914J.**
    - c) Date the FedEx and Customer Copy (forms are already pre-signed).
    - d) Peel off the Box Copy and firmly apply to the front side of the box flap.
    - e) On the FedEx and Customer copy, complete Tracking ID box by listing the 15 digit tracking ID found beneath the large bar code or peel off the SHIPPER RECEIPT and RECEIPT tabs found at top of the PRP Shipping Label and apply to the Tracking ID box.
    - f) Keep Customer Copy for dealer records and retain for a minimum of 2 years.
    - g) Give the FedEx Copy to the FedEx Ground driver.
  - **FedEx Ground PRP Shipping Label**
    - a) Fill in Shipper Name & Address at upper section of label (RA# is not required)
    - b) Peel off the label backing and affix to top of box to left of the Class 9 label. Use the scribe marks on the box as a guide so the PRP label does not touch any portion of the Class 9 label or its border.
    - c) When shipment is ready, call for FedEx Ground pick up using number listed for business locations (888-777-6040), or if you receive regular pickups, give the package to your FedEx Ground driver.
- Remove or black out any **old** shipping labels or barcodes (not hazard marks).
- Do not cover any portion of the Class 9 label, shipping name, UN number and UN box specifications.
- Prior to shipment, ensure all steps have been properly completed. All packages must be prepared in accordance with all DOT and FedEx Ground requirements. Incomplete or missing information will result in return to sender.

# Driver Side Air Bag Inflator Return Procedure – Lower 48 States Only

## *Top of Inflator Box and Shipping Forms*



## *Bottom of Inflator Shipping Box*

Affix adhesive pouch containing all 4 bottom labels from OP-900PRP form



Dealer Name	Dealer Code	Chemtrec Customer Number
UNIVERSITY MAZDA	10102	CCN689693
MILAM MAZDA	10130	CCN689694
DOUG'S LYNNWOOD MAZDA	10131	CCN689695
FOOTHILLS MAZDA	10158	CCN689696
PARR MAZDA	10169	CCN689697
ALAN WEBB MAZDA	10171	CCN689698
CASCADE MAZDA	10172	CCN689699
FUGATE MAZDA	10176	CCN689700
LEE JOHNSON MAZDA	10177	CCN689701
ROBBERSON MAZDA	10216	CCN689702
ROYAL MOORE MAZDA	10258	CCN689703
MOCK'S MAZDA	10263	CCN689704
RON TONKIN MAZDA	10275	CCN689705
HERZOG/MEIER MAZDA	10276	CCN689706
SUNWEST MAZDA	10277	CCN689707
DENNIS DILLON MAZDA	10316	CCN689708
CONTINENTAL MAZDA	10503	CCN689709
DON BESSETTE MAZDA	10614	CCN689710
BILLION MAZDA	10707	CCN689711
EICH MAZDA	10803	CCN689712
MORRIES MAZDA	10809	CCN689713
POLAR MAZDA	10823	CCN689714
JN MAZDA	10901	CCN689715
BOB HALL'S MAZDA	10913	CCN689716
HILO MAZDA	10919	CCN689717
KONA MAZDA	10920	CCN689718
APPLEWAY MAZDA	10924	CCN689719
MCCURLEY INTEGRITY MAZDA	10930	CCN689720
KIEFER MAZDA	10935	CCN689721
JIM DORAN MAZDA	10936	CCN689722
SKYLAND MAZDA	23203	CCN689723
FREMA MAZDA	23227	CCN689724
PARKS MAZDA	23235	CCN689725
BOB KING MAZDA	23241	CCN689726
MONTGOMERY MAZDA	23245	CCN689727
JIM ELLIS MAZDA OF MARIETTA	23454	CCN689728
RICK CASE MAZDA	23456	CCN689729
JIM ELLIS MAZDA OF CHAMBLEE	23466	CCN689730
FIVE STAR MAZDA	23472	CCN689731
QUALITY MAZDA	23644	CCN689732
TOM BUSH MAZDA	23658	CCN689733
GUNTHER MAZDA	23670	CCN689734
BONIFACE-HIERS MAZDA	23684	CCN689735
MAZDA CITY OF ORANGE PARK	23688	CCN689736
OCEAN MAZDA	23710	CCN689737

HENNESSY MAZDA	23716	CCN689738
PALM MAZDA OF PUNTA GORDA	23723	CCN689739
GERALD JONES MAZDA	23725	CCN689740
MED CENTER MAZDA	23731	CCN689741
MITCHELL MAZDA	23739	CCN689742
BERGLUND MAZDA	23747	CCN689743
CHARLIE OBAUGH MAZDA	23755	CCN689744
FERMAN MAZDA	23756	CCN689745
WHITTEN BROS. MAZDA	23759	CCN689746
STOKES MAZDA	23760	CCN689747
MOSS ROBERTSON MAZDA	23769	CCN689748
JOHN FINGER MAZDA	23775	CCN689749
ED MORSE MAZDA	23778	CCN689750
JAY MAZDA	23786	CCN689751
CORY FAIRBANKS MAZDA	23794	CCN689752
HAMPTON MAZDA	23797	CCN689753
FAIRWAY MAZDA	23802	CCN689754
ED HOWARD MAZDA	23803	CCN689755
PRINCE MAZDA	23807	CCN689756
MAZDA OF DOTHAN	23816	CCN689757
VIC BAILEY MAZDA	23820	CCN689758
WRAY MAZDA	23823	CCN689759
SPORT DURST MAZDA	23836	CCN689760
CLASSIC MAZDA EAST	23837	CCN689761
PEARSON MAZDA	23846	CCN689762
CAPITAL MAZDA OF CARY	23850	CCN689763
BROWN & WOOD MAZDA	23853	CCN689764
GRIECO MAZDA OF DELRAY BEACH	23855	CCN689765
WALLACE MAZDA	23856	CCN689766
STEVENSON MAZDA	23861	CCN689767
SANDY SANSING MAZDA	23867	CCN689768
COX MAZDA	23871	CCN689769
GEM MAZDA	23875	CCN689770
MAZDA OF ROSWELL	23879	CCN689771
FLOW MAZDA	23882	CCN689772
LOU BACHRODT MAZDA	23885	CCN689773
ALLIANCE MAZDA	23888	CCN689774
MCKINNEY MAZDA	23894	CCN689775
TYRONE SQUARE MAZDA	23895	CCN689776
FERMAN MAZDA OF BRANDON	23899	CCN689777
SOUTHERN STATES MAZDA	23901	CCN689778
HILTON HEAD MAZDA	23903	CCN689779
MEDLIN MAZDA	23909	CCN689780
DAYTONA MAZDA	23913	CCN689781
FLOW MAZDA OF FAYETTEVILLE	23915	CCN689782
STEVENSON MAZDA OF JACKSONVIL	23923	CCN689783
LEHMAN MAZDA	23925	CCN689784

NAPLES MAZDA	23926	CCN689785
HALL MAZDA	23927	CCN689786
JENKINS MAZDA	23928	CCN689787
DUVAL MAZDA AT THE AVENUES	23929	CCN689788
LYNCHBURG MAZDA	23931	CCN689789
MAZDA OF WESLEY CHAPEL	23932	CCN689790
ALEXANDER MAZDA	23934	CCN689791
BEACH MAZDA	23936	CCN689792
BILL SMITH MAZDA	23937	CCN689793
DEAN MCCRARY MAZDA	23938	CCN689794
SOUTH MOTORS MAZDA	23940	CCN689795
SAM GALLOWAY MAZDA	23941	CCN689796
SPORT MAZDA	23942	CCN689797
ROYAL PALM MAZDA	23944	CCN689798
DYER MAZDA	23945	CCN689799
PANAMA CITY MAZDA	23946	CCN689800
CAVALIER MAZDA	23947	CCN689801
SCOTT WILL MAZDA	23948	CCN689802
CROSSROADS MAZDA	23950	CCN689803
LUMBERTON MAZDA	23955	CCN689804
GAINESVILLE MAZDA	23956	CCN689805
FLOW MAZDA OF GREENSBORO	23957	CCN689806
HILEY MAZDA OF HUNTSVILLE	23958	CCN689807
COUNTRYSIDE MAZDA	23960	CCN689808
MAZDA OF NEW BERN	23961	CCN689809
LOU BACHRODT MAZDA POMPANO BE	23962	CCN689810
ANDERSON MAZDA	23963	CCN689811
SERRA MAZDA	23964	CCN689812
DICK SHIRLEY MAZDA	23966	CCN689813
MOMENTUM MAZDA OF GASTONIA	23968	CCN689814
HYMAN BROS. MAZDA	23969	CCN689815
MCDANIELS MAZDA	23970	CCN689816
MAZDA OF SOUTH CHARLOTTE	23971	CCN689817
STIVERS MAZDA	23972	CCN689818
HICKORY MAZDA MITSUBISHI	23973	CCN689819
ED MORSE MAZDA LAKELAND	23975	CCN689820
ASHEBORO MAZDA	23976	CCN689821
CARLOCK MAZDA OF TUSCALOOSA	23977	CCN689822
MALL OF GEORGIA MAZDA	23978	CCN689823
KEFFER MAZDA	23980	CCN709235
NELSON MAZDA OF COOL SPRINGS	23981	CCN709236
MAZDA OF LAKE LANIER	23983	CCN709218
RIVERTOWN MAZDA	23984	CCN709220
PRECISION MAZDA	23985	CCN709222
O'BRIEN MAZDA OF FT MYERS	23986	CCN709226
INDEPENDENCE MAZDA	23987	CCN709227
MAZDA OF MERIDIAN	23988	CCN709232

SUNBELT MAZDA	33723	CCN689824
FLOYD TRAYLOR MAZDA	33902	CCN689825
LEE EDWARDS MAZDA	34016	CCN689826
MOFFITT MAZDA	34017	CCN689827
DICK BARKER MAZDA	34024	CCN689828
DIAMOND MAZDA	34030	CCN689829
HOLLINGSWORTH RICHARDS MAZDA	34032	CCN689830
NELSON MAZDA	34245	CCN689831
FREEMAN MAZDA	34302	CCN689832
ROGER BEASLEY MAZDA CENTRAL	34318	CCN689833
CLASSIC MAZDA	34347	CCN689834
JAMES MEARS MAZDA	34356	CCN689835
BERT OGDEN MAZDA	34377	CCN689836
TOWN NORTH MAZDA	34391	CCN689837
SAMES MAZDA	34392	CCN689838
AUTONATION MAZDA FORT WORTH	34398	CCN689839
GARLYN SHELTON MAZDA OF BRYAN	34400	CCN689840
MILLER MAZDA	34405	CCN689841
GARLYN SHELTON MAZDA	34407	CCN689842
WORLD CAR MAZDA	34421	CCN689843
AUTONATION MAZDA CRPUS CHRSTI	34424	CCN689844
HERB EASLEY MAZDA	34428	CCN689845
LAWRENCE HALL MAZDA	34429	CCN689846
RANDY HILEY MAZDA ARLINGTON	34430	CCN689847
JOE MYERS MAZDA	34432	CCN689848
CHAMPION MAZDA	34438	CCN689849
DEERY MAZDA	34439	CCN689850
STUART POWELL MAZDA	34448	CCN689851
JEFF HAAS MAZDA	34451	CCN689852
ALTON BLAKLEY MAZDA	34458	CCN689853
EL DORADO MAZDA	34459	CCN689854
COGSWELL MAZDA	34465	CCN689855
BOMMARITO MAZDA	34469	CCN689856
HIXSON AUTO OF ALEX MAZDA	34476	CCN689857
CARDENAS MAZDA	34477	CCN689858
SUPERIOR MAZDA	34482	CCN689859
DICK EDWARDS MAZDA	34483	CCN689860
INGRAM PARK MAZDA	34486	CCN689861
NORTHTOWNE MAZDA	34487	CCN689862
MAZDA SOUTH	34491	CCN689863
LAIRD NOLLER MAZDA	34495	CCN689864
KINSEL MAZDA	34498	CCN689865
BERT OGDEN MISSION MAZDA	34512	CCN689866
TWIN CITY MAZDA	34517	CCN689867
C&S CAR COMPANY MAZDA	34521	CCN689868
TANNER MAZDA	34525	CCN689869
ATZENHOFFER MAZDA	34528	CCN689870

BRIAN HARRIS MAZDA	34531	CCN689871
G & G MAZDA	34541	CCN689872
REYNOLDS MAZDA	34545	CCN689873
NELSON MAZDA	34547	CCN689874
WORLD CAR MAZDA - SAN ANTONIO	34548	CCN689875
LEGEND MAZDA	34549	CCN689876
JIM BASS MAZDA	34550	CCN689877
NORTH POINT MAZDA	34554	CCN689878
RELIABLE MAZDA	34556	CCN689879
GULLO MAZDA OF CONROE	34564	CCN689880
ANDERSON MAZDA	34566	CCN689881
NOLLER MAZDA	34567	CCN689882
LUNDE MAZDA OF FARGO	34569	CCN689883
VICKSBURG MAZDA	34570	CCN689884
WALSER BURNSVILLE MAZDA	34575	CCN689885
MAZDA OF CLEAR LAKE	34576	CCN689886
GENE MESSER MAZDA	34580	CCN689887
BOMMARITO MAZDA SOUTH	34581	CCN689888
ROY'S GRAND MAZDA	34583	CCN689889
ROGER BEASLEY MZ GEORGETOWN	34584	CCN689890
BOB MOORE MAZDA	34589	CCN689891
NELSON MAZDA	34592	CCN689892
BILL HOOD MAZDA	34593	CCN689893
MUNDAY MAZDA	34594	CCN689894
GOSSETT MAZDA	34597	CCN689895
MILO GORDON MAZDA	34598	CCN689896
MAZDA OF MIDLAND	34600	CCN689897
NORTH PARK MAZDA	34601	CCN689898
PADUCAH MAZDA	34602	CCN689899
GORMAN MCCRACKEN MAZDA	34603	CCN689900
EVANSVILLE MAZDA	34606	CCN689901
GRAY EPPERSON MAZDA	34607	CCN689902
WYATT-JOHNSON MAZDA	34611	CCN689903
HILEY MAZDA OF HURST	34612	CCN689904
BENING MAZDA	34615	CCN689905
WOODHOUSE MAZDA	34616	CCN689906
CRAIN MAZDA	34617	CCN689907
CLASSIC MAZDA	34622	CCN689908
PARETTI MAZDA	34625	CCN689909
RUSSELL & SMITH MAZDA	34626	CCN689910
TUMMINIA MAZDA	34635	CCN689911
BUTCH OUSTALET MAZDA	34637	CCN689912
OXMOOR MAZDA	34638	CCN689913
FANNIN MAZDA	34646	CCN689914
RAY BRANDT MAZDA	34648	CCN689915
GWATNEY MAZDA OF GERMANTOWN	34651	CCN689916
RUDOLPH MAZDA EAST	34653	CCN689917

MAZDA OF LAKE CHARLES	34656	CCN689918
PARKWAY FAMILY MAZDA	34657	CCN689919
GWATNEY MAZDA OF JACKSON	34658	CCN689920
COURTESY MAZDA MORGAN CITY	34659	CCN689921
ADRIAN VEGA ACADIANA MAZDA	34660	CCN689922
GATEWAY MAZDA	34661	CCN689923
MAZDA OF MESQUITE	34662	CCN689924
BARNES CROSSING MAZDA	34664	CCN689925
EDD KIRBY'S ADVENTURE MAZDA	34666	CCN689926
MAZDA OF COOL SPRINGS	34667	CCN689927
RUDOLPH MAZDA WEST	34669	CCN689928
OVERLAND PARK MAZDA	34670	CCN689929
ROGER BEASLEY MAZDA KILLEEN	34671	CCN689930
MAZDA OF RIDGELAND	34672	CCN689931
SKY MAZDA	34673	CCN689932
FENTON MAZDA OF TYLER	34674	CCN689933
LOVING MAZDA	34677	CCN689934
DEETER MAZDA	34678	CCN689935
FENTON MAZDA OF AMARILLO	34679	CCN709216
PREMIER MAZDA	34680	CCN709237
VELOCITY MAZDA	34681	CCN709221
GREELEY MAZDA	34682	CCN709224
SHORTLINE MAZDA	34683	CCN709229
BARKER MAZDA	34684	CCN709233
JOHN HINE MAZDA	40202	CCN689936
WESTCOTT MAZDA	40206	CCN689937
BERGE MAZDA	40212	CCN689938
BILLALEXANDERFLIGHTLINE MAZDA	40213	CCN689939
BORMAN MAZDA	40336	CCN689940
UNIVERSITY MAZDA	40337	CCN689941
BERNIE BISHOP MAZDA	40500	CCN689942
REGANIS MAZDA	40501	CCN689943
MARIN MAZDA	40602	CCN689944
DIABLO MAZDA	40603	CCN689945
MID CITY MAZDA	40709	CCN689946
FREEWAY MAZDA	40807	CCN689947
PHILLIPS MAZDA	41133	CCN689948
WHEELER MAZDA	41147	CCN689949
CAPITOL MAZDA	41178	CCN689950
RAZZARI MAZDA	41185	CCN689951
KEN FOWLER MAZDA	41192	CCN689952
AUTO WEST MAZDA	41194	CCN689953
PUTNAM MAZDA	41200	CCN689954
JIM CLICK MAZDA, AUTOMALL	41219	CCN689955
BOB PENKHUS VOLVO MAZDA, INC.	41301	CCN689956
GATEWAY MAZDA, INC.	41318	CCN689957
MCDONALD AUTOMOTIVE GRP MAZDA	41320	CCN689958

STEPHEN WADE MAZDA	41815	CCN689959
CAMELBACK MAZDA	41902	CCN689960
SELMA MAZDA	41926	CCN689961
CARDINALE MAZDA	41949	CCN689962
CYPRESS COAST MAZDA	41957	CCN689963
BROWNING MAZDA	41959	CCN689964
SANTA FE MAZDA	41965	CCN689965
MAZDA SAN FRANCISCO	41976	CCN689966
ROMERO MAZDA	41978	CCN689967
GALPIN MAZDA	41981	CCN689968
SPRADLEY/BARR MAZDA, INC.	41985	CCN689969
SKAGIT MAZDA	41988	CCN689970
KUHIO MAZDA	41999	CCN689971
LITHIA MAZDA OF FRESNO	42002	CCN689972
MAZDA OF STOCKTON	42003	CCN689973
OAK TREE MAZDA	42004	CCN689974
PERRY MAZDA	42013	CCN689975
CON PAULOS MAZDA	42018	CCN689976
SPRADLEY BARICKMAN MAZDA	42020	CCN689977
BOB SMITH MAZDA	42023	CCN689978
JIM CLICK MAZDA, EASTSIDE	42024	CCN689979
SILL-TERHAR MOTORS, INC.	42025	CCN689980
RIVERSIDE MAZDA	42030	CCN689981
STAR MAZDA	42031	CCN689982
GALPIN MAZDA	42033	CCN689983
POWER MAZDA	42035	CCN689984
MAZDA OF OLYMPIA	42037	CCN689985
SANTA MARIA MAZDA	42040	CCN689986
D DAHLE MAZDA OF MURRAY	42045	CCN689987
BOUNTIFUL MAZDA	42046	CCN689988
COURTESY MAZDA - HENDERSON	42053	CCN689989
BAKERSFIELD MAZDA	42057	CCN689990
CARUSO MAZDA	42063	CCN689991
TUSTIN MAZDA	42066	CCN689992
GALPIN MAZDA	42067	CCN689993
MAZDA OF OAKLAND	42069	CCN689994
MAZDA OF EVERETT	42076	CCN689995
TRACY MAZDA	42077	CCN689996
BOB PENKHUS MAZDA AT POWERS	42078	CCN689997
CARDINALEWAY MAZDA AT S.S.	42079	CCN689998
TEAM MAZDA	42081	CCN689999
SPRADLEY BARR MOTORS MAZDA	42086	CCN690000
TEAM MAZDA	42089	CCN690001
MAZDA OF ESCONDIDO	42090	CCN690002
SIERRA MAZDA OF MONROVIA	42092	CCN690003
MAZDA OF ORANGE	42095	CCN690004
CRATER LAKE MAZDA	42099	CCN690005

MAZDA OF LAKEWOOD	42101	CCN690006
PALM SPRINGS MAZDA	42102	CCN690007
CHAPMAN MAZDA	42103	CCN690008
HUNTINGTON BEACH MAZDA	42104	CCN690009
COLE MAZDA	42110	CCN690010
JOHN HINE TEMECULA MAZDA	42112	CCN690011
WALKER'S RENTON MAZDA	42116	CCN690012
JIM FALK MAZDA	42117	CCN690013
NEFTIN WESTLAKE MAZDA	42123	CCN690014
BOB BAKER MAZDA	42124	CCN690015
ANTELOPE VALLEY MAZDA	42126	CCN690016
SOUTH TACOMA MAZDA	42127	CCN690017
TUTTLE-CLICK MAZDA	42128	CCN690018
SANTA CRUZ MAZDA	42130	CCN690019
MAZDA OF ELK GROVE	42131	CCN690020
COURTESY MAZDA	42132	CCN690021
OREM MAZDA	42133	CCN690022
KENDALL MAZDA OF FAIRBANKS	42134	CCN690023
FLANAGAN MOTORS MAZDA	42136	CCN690024
CUTTER MAZDA OF WAIPAHU	42137	CCN690025
QUALITY MAZDA	42139	CCN690026
GROOVE MAZDA	42140	CCN690027
FINDLAY MAZDA	42141	CCN690028
CUTTER MAZDA OF HONOLULU	42142	CCN690029
REDLANDS MAZDA	42143	CCN690030
MAZDA OF ALHAMBRA	42145	CCN690031
CENTENNIAL MAZDA	42146	CCN690032
AVONDALE MAZDA	42149	CCN690033
EHRlich MAZDA	42151	CCN690034
MORE MAZDA	42153	CCN690035
TOM DOLAN'S RENO MAZDA	42154	CCN690036
DUBLIN MAZDA	42156	CCN690037
HANSEL MAZDA	42157	CCN690038
MAITA MAZDA	42158	CCN690039
MAZDA OF PUENTE HILLS	42159	CCN690040
VICTORVILLE MAZDA	42161	CCN690041
CARDINALEWAY MAZDA AT PEORIA	42162	CCN690042
BUNNIN MAZDA	42163	CCN690043
TOWNE MAZDA	42164	CCN690044
MAZDA OF GLADSTONE	42165	CCN690045
CULVER CITY MAZDA	42166	CCN690046
FREMONT MAZDA	42167	CCN690047
EL CAJON MAZDA	42169	CCN690048
SOUTH BAY MAZDA	42170	CCN690049
SANTA MONICA MAZDA	42171	CCN690050
PLANET MAZDA	42172	CCN709234
CONCORD MAZDA	42173	CCN709239

GOODE MOTOR MAZDA	42174	CCN709219
CENTENNIAL MAZDA	42175	CCN709223
BROWNING MAZDA OF ALHAMBRA	42176	CCN709225
CJ WILSON OF VENTURA	42177	CCN709228
BURDICK MAZDA	50127	CCN690051
WANTAGH MAZDA	50129	CCN690052
NORTHTOWN MAZDA	50153	CCN690053
COOLEY MAZDA	50156	CCN690054
ORANGE MAZDA	50166	CCN690055
MAPLE SHADE MAZDA	50202	CCN690056
CRYSTAL MAZDA	50217	CCN690057
SCHWARTZ MAZDA	50219	CCN690058
WEISLEDER MAZDA	50223	CCN690059
MAPLE SHADE MAZDA,TURNERSVILL	50234	CCN690060
RAMSEY MAZDA	50237	CCN690061
LANCASTER MAZDA	50322	CCN690062
BILLCO MAZDA	50325	CCN690063
SUSSMAN MAZDA	50338	CCN690064
YOUNG MAZDA	50339	CCN690065
BERGER MAZDA	50342	CCN690066
COLONIAL MAZDA	50345	CCN690067
NORTH PENN MAZDA	50347	CCN690068
JACK GIAMBALVO MAZDA	50348	CCN690069
DEAN PATTERSON MAZDA	50350	CCN690070
FAULKNER MAZDA	50351	CCN690071
SMAIL MAZDA	50356	CCN690072
MOON TOWNSHIP MAZDA	50358	CCN690073
PACIFICO MAZDA	50359	CCN690074
RAY PRICE MAZDA	50360	CCN690075
COOK MAZDA	50414	CCN690076
SHARRETT MAZDA	50420	CCN690077
ROSENTHAL MAZDA - ARLINGTON	50501	CCN690078
DUNCAN MAZDA	50514	CCN690079
BILL BRITT MAZDA	50522	CCN690080
NELSON MAZDA	50534	CCN690081
BROWN'S ALEXANDRIA MAZDA	50537	CCN690082
MODERN MAZDA	50704	CCN690083
PARTYKA MAZDA	50709	CCN690084
THOMPSON MAZDA	50906	CCN690085
MORONG FALMOUTH MAZDA	50908	CCN690086
ROWE MAZDA	50911	CCN690087
MAZDA GALLERY	51027	CCN690088
CHAMPION MAZDA	51028	CCN690089
GRAPPONE MAZDA	51101	CCN690090
P.J.'S MAZDA	51305	CCN690091
RAINES MAZDA	51401	CCN690092
LARRY SIMMONS MAZDA	51407	CCN690093

PRESTON MAZDA	51416	CCN690094
SANSONE'S ROUTE 1 MAZDA	51424	CCN690095
CHAMPION MAZDA	51428	CCN690096
HERITAGE MAZDA	51434	CCN690097
QUIRK MAZDA	51435	CCN690098
FREYSINGER MAZDA	51439	CCN690099
BROWN'S FAIRFAX MAZDA	51441	CCN690100
ONTARIO MAZDA	51444	CCN690101
LADD HANFORD MAZDA	51447	CCN690102
MAZDA OF ERIE	51450	CCN690103
MARTIN MAZDA	51454	CCN690104
GOODWIN'S MAZDA	51458	CCN690105
BAGLIER MAZDA	51469	CCN690106
AUTEX MAZDA	51474	CCN690107
HAMILTON MAZDA	51479	CCN690108
FUCCILLO MAZDA	51480	CCN690109
FITZGERALD MAZDA	51482	CCN690110
OPEN ROAD MAZDA	51484	CCN690111
NUCAR MAZDA	51485	CCN690112
GAITHERSBURG MAZDA	51486	CCN690113
MAXON MAZDA	51492	CCN690114
WYOMING VALLEY MAZDA	51495	CCN690115
GALLO MAZDA	51499	CCN690116
HERITAGE MAZDA OF BEL AIR	51502	CCN690117
MALLOY MAZDA	51509	CCN690118
NEW COUNTRY MAZDA	51513	CCN690119
TULLEY MAZDA	51516	CCN690120
RUSSEL MAZDA	51518	CCN690121
WALKER MAZDA	51519	CCN690122
BALISE MAZDA	51530	CCN690123
MAZDA 112	51532	CCN690124
FAULKNER MAZDA	51536	CCN690125
MAZDA OF MILFORD	51537	CCN690126
ROHRICH MAZDA	51538	CCN690127
EAGLE MAZDA	51539	CCN690128
MANHATTAN MAZDA	51543	CCN690129
SMITH-CAIRNS MAZDA	51547	CCN690130
WELLESLEY MAZDA	51553	CCN690131
RICH MORTON MAZDA	51559	CCN690132
HERTRICH'S CAPITOL MAZDA	51560	CCN690133
I-79 MAZDA	51561	CCN690134
FITZGERALD MAZDA OF ANNAPOLIS	51562	CCN690135
WAYNE MAZDA	51563	CCN690136
SENTRY WEST MAZDA	51564	CCN690137
VARNEY MAZDA	51565	CCN690138
ROSENTHAL MAZDA	51566	CCN690139
TASCA MAZDA	51567	CCN690140

TOM MASANO MAZDA	51570	CCN690141
JOHN KENNEDY MAZDA	51572	CCN690142
IRWIN MAZDA	51574	CCN690143
SEACOAST MAZDA	51575	CCN690144
COLONIAL MAZDA	51578	CCN690145
CENTRAL MAZDA	51580	CCN690146
KOEPPEL MAZDA	51582	CCN690147
GIUFFRE MAZDA	51584	CCN690148
BUDD BAER MAZDA	51588	CCN690149
NORTH END MAZDA	51589	CCN690150
WERNER MAZDA	51590	CCN690151
OURISMAN MAZDA	51592	CCN690152
FLOOD MAZDA	51593	CCN690153
MURRAY MAZDA	51595	CCN690154
LIBERTY MAZDA	51596	CCN690155
MAZDA OF LODI	51597	CCN690156
SCOTT MAZDA	51598	CCN690157
TASCA MAZDA	51599	CCN690158
WESTCHESTER MAZDA	51600	CCN690159
REEDMAN TOLL MAZDA	51601	CCN690160
KELLY MAZDA	51602	CCN690161
MANFREDI MAZDA	51603	CCN690162
JOHN KENNEDY MAZDA	51606	CCN690163
LIBERTY MAZDA	51608	CCN690164
BERKSHIRE MAZDA	51609	CCN690165
COMPASS MAZDA	51610	CCN690166
MATTHEWS MAZDA	51611	CCN690167
PRIME MAZDA	51613	CCN690168
OPEN ROAD MAZDA OF MORRISTOWN	51614	CCN690169
RILEY MAZDA	51615	CCN690170
BROWN'S CHANTILLY MAZDA	51617	CCN690171
WHALING CITY MAZDA	51618	CCN690172
CHAPMAN MAZDA SALES	51619	CCN690173
PIAZZA MAZDA OF WEST CHESTER	51620	CCN690174
MONROEVILLE MAZDA	51621	CCN690175
THOMPSON MAZDA	51622	CCN690176
PALISADES MAZDA	51623	CCN690177
MAZDA OF MANCHESTER	51624	CCN690178
GARDEN CITY MAZDA	51626	CCN690179
SMITH HAVEN MAZDA	51627	CCN690180
BRIGHT BAY MAZDA	51628	CCN690181
MAZDA OF WINCHESTER	51629	CCN690182
MAZDA OF POUGHKEEPSIE	51631	CCN690183
LESTER GLENN MAZDA	51633	CCN690184
CAPE COD MAZDA	51634	CCN690185
LANNAN MAZDA	51636	CCN690186
KOONS MAZDA	51637	CCN690187

ROMANO MAZDA	51638	CCN690188
BLAISE ALEXANDER MAZDA	51640	CCN690189
MAZDA OF OLD SAYBROOK	51642	CCN690190
HERITAGE MAZDA TOWSON	51643	CCN690191
MAZDA OF WEST RIDGE	51644	CCN690192
STEET PONTE MAZDA	51645	CCN690193
ALDEN MAZDA	51648	CCN690194
TOWNE MAZDA	51649	CCN690195
HUNTINGTON MAZDA	51650	CCN690196
DICK IDE MAZDA	51651	CCN690197
KENNY ROSS MAZDA	51652	CCN690198
MAZDA OF NEW ROCHELLE	51653	CCN690199
MASTRIA MAZDA	51654	CCN690200
PAUL BLOUIN MAZDA	51655	CCN690201
NORTH SHORE MAZDA	51656	CCN690202
OURISMAN MAZDA OF ROCKVILLE	51657	CCN690203
MAZDA 31	51658	CCN690204
MARKETPLACE MAZDA	51660	CCN690205
COCHRAN MAZDA	51661	CCN709215
PERUZZI MAZDA	51662	CCN709217
WALDORF MAZDA	51663	CCN709238
PREMIER MAZDA	51664	CCN709240
PASSPORT MAZDA	51667	CCN709242
MAZDA OF FREDERICKSBURG	51668	CCN709231
ANDERSON MAZDA	60135	CCN690206
WILKINS MAZDA	60170	CCN690207
MAZDA OF CRYSTAL LAKE	60172	CCN690208
SIERRA MAZDA	60175	CCN690209
BILL JACOBS MAZDA	60181	CCN690210
SCHAUMBURG MAZDA	60188	CCN690211
NAPLETON'S MAZDA	60193	CCN690212
ROSEN MAZDA	60194	CCN690213
MAZDA OF BEDFORD	60207	CCN690214
CASCADE MAZDA	60233	CCN690215
MATT CASTRUCCI MAZDA	60247	CCN690216
BROWN MAZDA	60249	CCN690217
JAKE SWEENEY MAZDA	60257	CCN690218
JEFF WYLER MAZDA	60258	CCN690219
BORGMAN MAZDA	60304	CCN690220
THELEN MAZDA	60324	CCN690221
HALBINSEL MAZDA	60326	CCN690222
SUBURBAN MAZDA OF FARMINGTON	60344	CCN690223
SIEMANS MAZDA	60346	CCN690224
CROWN MAZDA	60351	CCN690225
HAYES MAZDA	60355	CCN690226
CRIPPEN MAZDA	60356	CCN690227
TOM ROUSH MAZDA	60402	CCN690228

ROYAL MAZDA	60405	CCN690229
BASNEY MAZDA	60433	CCN690230
O'DANIEL MAZDA	60434	CCN690231
CONCOURS MAZDA	61416	CCN690232
HOLIDAY MAZDA	61420	CCN690233
HALL MAZDA	61429	CCN690234
PUGI MAZDA	61432	CCN690235
KEMPTHORN MAZDA	61439	CCN690236
BILL MARINE MAZDA	61446	CCN690237
FRANK BOUCHER MAZDA RACINE	61449	CCN690238
RICART MAZDA	61454	CCN690239
CHUCK NICHOLSON MAZDA	61459	CCN690240
KERRY MAZDA OF FLORENCE	61460	CCN690241
KENNEDY MAZDA	61471	CCN690242
AMATO MAZDA	61481	CCN690243
LIBERTY MAZDA	61482	CCN690244
O'BRIEN MAZDA	61496	CCN690245
ROTO MAZDA	61504	CCN690246
KINGS MAZDA	61505	CCN690247
VOGLER MAZDA	61510	CCN690248
BYERS MAZDA	61511	CCN690249
CLIFF WALL MAZDA	61515	CCN690250
PARK MAZDA OF WOOSTER	61516	CCN690251
SUBURBAN MAZDA OF TROY	61521	CCN690252
BOB-BOYD MAZDA	61522	CCN690253
SAM LEMAN MAZDA	61523	CCN690254
DON MILLER MAZDA	61528	CCN690255
CLASSIC MAZDA	61530	CCN690256
WAGNER MAZDA	61531	CCN690257
SESI MAZDA	61532	CCN690258
LUTHER MAZDA	61534	CCN690259
THE AUTOBARN MAZDA EVANSTON	61535	CCN690260
ROSEN MAZDA OF LAKE VILLA	61538	CCN690261
COMMUNITY MAZDA	61539	CCN690262
RUSS DARROW MAZDA	61540	CCN690263
BIGGERS MAZDA	61542	CCN690264
APOSTOLAKIS MAZDA	61544	CCN690265
MORRIES CHIPPEWA VALLEY MAZDA	61545	CCN690266
FOX MAZDA	61549	CCN690267
HUBLER MAZDA	61551	CCN690268
GREEN MAZDA	61554	CCN690269
RALPH THAYER MAZDA LIVONIA	61556	CCN690270
BASS MAZDA	61558	CCN690271
OAK LAWN MAZDA	61561	CCN690272
LIBERTY MAZDA	61562	CCN690273
BRIAN BEMIS MAZDA	61565	CCN690274
JENSEN MAZDA	61566	CCN690275

KC SUMMERS MAZDA	61567	CCN690276
MONTROSE MAZDA	61568	CCN690277
REINEKE MAZDA	61569	CCN690278
FRED MUELLER MAZDA	61571	CCN690279
DIXON MAZDA	61573	CCN690280
BILL BARTH MAZDA	61576	CCN690281
RAY SKILLMAN MAZDA WEST	61578	CCN690282
LUJACK MAZDA	61579	CCN690283
ELITE MAZDA	61580	CCN690284
GORDIE BOUCHER MAZDA	61582	CCN690285
ALEXANDRIA MAZDA	61583	CCN690286
SUBURBAN MAZDA STERLING HGTS	61584	CCN690287
JEFF SCHMITT MAZDA	61585	CCN690288
MIKE RAISOR MAZDA	61586	CCN690289
FOX MAZDA GRAND TRAVERSE	61588	CCN690290
BERGSTROM MAZDA	61590	CCN690291
DAHL MAZDA	61591	CCN690292
ROCHESTER MAZDA	61593	CCN690293
CONTINENTAL MAZDA OF NAPERVIL	61594	CCN690294
MONTROSE MAZDA KENT	61595	CCN690295
JUNGE MAZDA	61596	CCN690296
RAY SKILLMAN NORTHEAST MAZDA	61597	CCN690297
JAKE SWEENEY MAZDA WEST	61598	CCN690298
BRIGHTON MAZDA	61599	CCN690299
SCHERER MAZDA	61601	CCN690300
EASTSIDE MAZDA	61602	CCN690301
GERMAIN MAZDA OF COLUMBUS	61604	CCN690302
PRESTON MAZDA	61605	CCN690303
BRUNSWICK MAZDA	61606	CCN690304
VAN HORN MAZDA	61607	CCN690305
CJ WILSON MAZDA	61608	CCN690306
PARK MAZDA	61609	CCN690307
RUSS DARROW MAZDA-MADISON	61610	CCN690308
ART HILL MAZDA	61611	CCN690309
MORRIES INVER GROVE MAZDA	61612	CCN709241
CJ WILSON OF ORLAND PARK	61613	CCN709230
KEY MAZDA	70150	CCN690310
AUFFENBERG MAZDA	70151	CCN690311
RILEY'S MAZDA	70510	CCN690312
CAROUSEL MAZDA	70526	CCN690313
RAMSEY MAZDA	70533	CCN690314
LAIRD NOLLER MAZDA	70623	CCN690315
DAVIS-MOORE MAZDA	70624	CCN690316
PAUL MILLER MAZDA	70719	CCN690317
BRUCE WALTERS MAZDA	70720	CCN690318
NEIL HUFFMAN MAZDA	70723	CCN690319
LOU FUSZ MAZDA	70925	CCN690320

FRANK BOMMARITO MAZDA	70927	CCN690321
SELLERS-SEXTON MAZDA	70933	CCN690322
LEE'S SUMMIT MAZDA	70941	CCN690323
JOE MACHENS MAZDA	70945	CCN690324
SID DILLON MAZDA	71012	CCN690325
STAN OLSEN MAZDA	71020	CCN690326
MAZDA KNOXVILLE	71329	CCN690327
BILL GATTON MAZDA OF JOHNSON CITY	71339	CCN690328
BILL GATTON MAZDA BRISTOL	71340	CCN690329