

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2015**

Published March 13, 2015

CHILD SEATS:

None during February 2015.

EQUIPMENT:

Dana Driveshaft Manufacturing, LLC (Dana) is recalling certain commercial vehicle lightweight driveshafts, model SPL250, sizes 1610-2200 or 2220-2830, manufactured January 2, 2013, through June 30, 2013. In affected driveshafts, the welded bond of the driveshaft and the rear yoke may fail, leading to slippage between the driveshaft and yoke and, potentially, to loss of torque to the rear wheels. If the welded bond fails and results in a loss of torque to the rear wheels, the vehicle operator may be unable to move the vehicle, or may experience deceleration if the vehicle is in motion, increasing the risk of a vehicle crash. Dana will notify owners, and dealers will replace the driveshafts, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Dana customer service at 1-419-887-3000. Note: This recall is an expansion of 14E-050.

15E-005

Suomy SPA (Suomy) is recalling certain Apex-S1R-EX motorcycle helmets, sizes Extra Small, Small, and Medium manufactured January 1, 2013, to July 31, 2013. The affected motorcycle helmets may not meet the penetration requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 218, "Motorcycle Helmets." In the event of a motorcycle crash, the wearer may not be adequately protected, increasing the risk of personal injury. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. For more information owners may contact Suomy Motosport America Customer Relations by email at: Jim@Suomy.com.

15E-006

Airtex Products, LP (Airtex) is recalling certain replacement equipment fuel pump modules, part numbers C8006, PF2032, and DW3950, manufactured May 21, 2012, to June 2, 2014, and sold on or after July 23, 2014, through January 28, 2015. The affected fuel pumps have a flexible line that connects the fuel pump to an external fuel filter. Due to an improper seal, the flexible line may leak fuel where it connects to the fuel filter. A fuel leak increases the risk of a fire. Airtex will notify owners and will replace the defective fuel pumps, free of charge. The recall is expected to begin during March 2015. Owners may contact Airtex customer service at 1-800-880-3056.

15E-007

Johnson Controls, Inc. (Johnson Controls) is recalling certain Recaro Automotive Seating Ergo M bus driver seats manufactured from May 8, 2003, to January 13, 2015. The affected seats were manufactured in a way that the tether bar may push into the retractor panel door and potentially interfere with the seat belt locking mechanism. If the seat belt locking mechanism does not function as intended, the bus driver may not be properly restrained, increasing the risk of personal injury in the event of a crash. Johnson Controls has notified the affected vehicle manufacturers and will correct the orientation of the seat belt retractor and tether bar, free of charge. For more information, owners may contact Johnson Controls at 1-414-524-2397.

15E-008

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2015**

Published March 13, 2015

Gillig LLC (Gillig) is recalling certain S26 Eaton-brand hydraulic pumps manufactured January 1, 2011, to November 1, 2014 that were sold through Gillig's aftermarket parts department. The affected hydraulic pumps may have manufacturing inconsistencies with the spool assembly which may result in unexpected changes in the steering effort. Unexpected changes in steering effort may cause a loss of vehicle control, increasing the risk of a vehicle crash. Gillig will notify owners and will replace the pump, free of charge. Owners may contact Gillig customer service at 1-800-735-1500.

15E-009

Gillig LLC (Gillig) is recalling certain S5510 series wheelchair lifts sold as aftermarket accessory parts and manufactured by Ricon Corporation from November 30, 2010, to February 25, 2011. The platform side plate of the affected wheelchair lifts may crack. If the platform side plates crack, the lift platform can separate from the lift and come to rest against the vehicle's lift door. When the doors are opened, the platform may fall out, increasing the risk of injury to the lift operator. Gillig will notify owners to contact Ricon and have supplemental platform support bumpers installed. Any platform that has already started cracking will be replaced, free of charge. Owners may contact Gillig customer service at 1-800-735-1500, or Ricon customer service at 1-800-322-2884.

15E-010

Harley-Davidson Motor Company (Harley-Davidson) is recalling certain accessory LED Bullet Turn Signal Kits manufactured May 31, 2011, to December 16, 2014, sold for installation on 2012 and later Dyna-family motorcycles and 2011 and later Softail family motorcycles. The affected Turn Signal Kits may not flash brightly enough to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 108, "Lamps, Reflective Devices, and Associated Equipment." If the turn signals do not flash brightly enough, other drivers may fail to see that motorcycle is turning or changing lanes, increasing the risk of a crash. Harley-Davidson will notify owners, and dealers will replace the turn signals with updated and compliant ones, free of charge. The recall is expected to begin in March 2015. Owners may contact Harley-Davidson customer service at 1-800-258-2464. Harley-Davidson's number for this recall is 0619.

15E-011

Meritor, Inc. (Meritor) is recalling certain Front Non-Drive Axles, model numbers FH941, FH945, and MFS12155 manufactured July 25, 2014, to December 5, 2014. The affected axles have castellated nuts on the tie rod that may not be properly torqued. If the castellated nuts are not properly torqued, the tie rod may not be adequately secured, resulting in a loss of vehicle control and increasing the risk of a crash. Meritor will notify the affected vehicle manufacturers who will notify the vehicle owners, and their dealers will inspect the torque on the tie rod end nuts, replacing the damaged components, as necessary, free of charge. The recall is expected to begin on March 23, 2015. Owners may contact Meritor customer service at 1-866-668-7221. Meritor's number for this recall is C15AB.

15E-012

Hickory Springs Manufacturing Company (HSM) is recalling certain RV quad entry steps, models 24" RV Step 8x8 PRCD RAD, 24" RV Step 8x8 RAD, 24" RV Step 8x8 ST PRC RAD RGR, 24" 8x8 Quad PRCD RAD Boxed, and 24" RV Step 8x8 ST PRC RAD W/BRKT, all manufactured October 18, 2012, to February 14,

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2015**

Published March 13, 2015

2014. The rivets joining the 2nd and 3rd steps may shear and fail when weight is placed upon the steps. If the rivet shears under occupant load, the occupant may fall, increasing the risk of personal injury. HSM will notify the manufacturers that purchased the steps for use in recreational vehicles, and those manufacturers will notify the vehicle owners. To remedy the steps, the rivets will be removed and the step sections will be bolted together, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact HSM customer service at 1-800-438-5341.

15E-013

TIRES:

Toyo Tire Holdings of Americas Inc. (Toyo) is recalling certain Open Country M/T tires, size 40X15.5R22 127Q, manufactured October 26, 2014, to November 1, 2014 (week code 4314). During production, the affected tires were made with their belts off center which may result in tread separation and/or loss of inflation pressure. Tread separation or loss of inflation pressure may increase the risk of a crash. Toyo will notify owners, and dealers will replace the tires, free of charge. The recall began on March 6, 2015. Owners may contact Toyo customer service at 1-800-442-8696.

15T-003

Tireco Inc. (Tireco) is recalling certain Milestar BS623 Premium All Position tires, size 225/70R19.5, and Milestar BD733 Regional Open Shoulder Drive tires, size 225/70R19.5, manufactured June 9, 2014, to September 28, 2014. The affected tires may crack in the lower sidewall. Tires that have cracks in the lower sidewall have an increased risk of a sudden failure, increasing the risk of a crash. Tireco will notify owners, and purchasers of the affected tires will receive full refunds. The recall is expected to begin during March 2015. Owners may contact Tireco customer service at 1-310-767-7990.

15T-004

Alliance Tire Americas, Inc. (Alliance) is recalling certain model 396 tires, size 445/65R22.5 manufactured April 22, 2013, to November 23, 2014, and size 600/50R22.5 manufactured May 27, 2013, to November 2, 2014. In the affected tires, the tread may separate from the tire. If the tread separates, the tire may have a rapid loss of air, increasing the risk of a crash. Alliance will notify owners, and dealers will reimburse consumers for the defective tires. The recall is expected to begin in March 2015. Owners may contact Alliance customer service at 1-800-343-3276. Alliance's number for this recall is ATG-396HS-001.

15T-007

VEHICLES:

Brammo, Inc. (Brammo) is recalling certain model year 2013-2014 Empulse and Empulse R motorcycles manufactured November 19, 2012, to July 8, 2014. Oil leaking from the transmission breather tube may blow onto the rear fender and tire. If oil leaks and contacts the rear tire, a loss of control may occur, increasing the risk of crash. Brammo will notify owners, and dealers will install a new transmission breather baffle kit, free of charge. Brammo issued an interim notification to owners on February 24, 2015. Owners may contact Brammo customer

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2015**

Published March 13, 2015

service at 1-541-482-9555.

15V-053

Nissan North America, Inc. (Nissan) is recalling certain model year 2008 Infiniti EX35 vehicles equipped with the power tilt/telescope option included in the premium package, manufactured June 29, 2007, to April 25, 2008, 2009 Infiniti FX35 and FX45 vehicles manufactured October 31, 2007, to April 16, 2008, and 2009 Nissan GT-R vehicles manufactured March 14, 2007, to April 25, 2008. The steering column outer tube may not be round, resulting in extra stress being applied to the upper steering bearing. This stress may cause the bearing retainer to fracture, creating extra play in the steering wheel or a possible loss of steering. Extra play in the steering wheel or a loss of steering may increase the risk of a crash. Nissan will notify owners, and dealers will replace the steering shaft on the Infiniti EX35, FX35, and FX45 vehicles, and will replace the steering column assembly on the Nissan GT-R vehicles, free of charge. The recall began on March 9, 2015. Infiniti owners may contact customer service at 1-800-662-6200. Nissan owners may contact the GT-R hotline at 1-866-668-1487.

15V-054

KTM North America, Inc. (KTM) is recalling certain model year 2015 Husqvarna FE 350 S and FE 501 S motorcycles manufactured from July 23, 2014, to October 17, 2014. In the forks of the affected motorcycles, the threaded connection between the piston rod and fork cap may not have been sufficiently tightened and therefore the piston rod could become stuck within the fork leg. If the piston rod detaches within the fork leg, the front suspension could malfunction and destabilize the motorcycle, increasing the risk of a crash. KTM will notify owners, and Husqvarna motorcycle dealers will inspect the torque of the fork piston rod to the fork cap, correcting it as necessary, free of charge. The recall began January 21, 2015. Owners may contact KTM customer service at 1-888-985-6090. KTM's number for this recall is TB 1503. Note: This recall supersedes recall 14V-772 in its entirety.

15V-055

Mack Trucks, Inc. (Mack) is recalling certain model year 2015 Mack LEU trucks manufactured March 31, 2014, to December 12, 2014. In the affected vehicles, a component of the door opening mechanism may be too short and as a result, the door may not be able to be opened by someone inside the truck. If the door cannot be opened from the inside, egress from the vehicle could be hindered which would increase the risk of injury in the event of an emergency. Mack will notify owners, and dealers will replace the inner door latches, free of charge. The recall is expected to begin March 26, 2015. Owners may contact Mack customer service at 1-800-528-6586. Mack's number for this recall is SC0388.

15V-056

Mack Trucks, Inc. (Mack) is recalling certain model year 2014-2015 CXU trucks manufactured June 1, 2013, to November 28, 2014. These trucks may be equipped with an 88 liter air reservoir for the brakes instead of a 96 liter air reservoir. The lower volume of air may result in increased distances being needed to stop the truck. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard No. 121, "Air Brake Systems." If the truck unexpectedly requires extra distance to stop, there is an increased risk of a crash. Mack will notify owners, and dealers will install a larger air brake reservoir tank, free of charge. The recall

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2015**

Published March 13, 2015

is expected to begin March 26, 2015. Owners may contact Mack customer service at 1-800-528-6586. Mack's number for this recall is SC0389.

15V-057

Terex South Dakota, Inc. (Terex) is recalling certain model year 2013 Hi-Ranger HR, HRX, TC, TCX, OM, and TLM trucks manufactured July 12, 2013, to December 26, 2013. On the affected vehicles, due to a problem with the bearing installation, the platform rotate cylinder can separate from the brackets and allow the platform to rotate without operator control. If the platform rotates without operator control, there is an increased risk of injury. Terex will notify owners, and dealers will replace the cylinder, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Terex customer service at 1-605-882-4000. Terex's number for this recall is SN614.

15V-058

Blue Bird Body Company (Blue Bird) is recalling certain model year 2011-2016 All American rear engine school buses manufactured June 5, 2010, to January 13, 2015. In the affected school buses, the exhaust system hangers may fail, possibly causing damage to the Selective Catalytic Reduction (SCR) and the Diesel Particulate Filter (DPF) housings. If all the exhaust hangers were to fail, the housings may fall onto the roadway, creating a road hazard and increasing the risk of a crash. Blue Bird will notify owners, and dealers will install new bolted hanger assemblies and support cables, free of charge. The recall began on March 6, 2015. Owners may contact Blue Bird customer service at 1-478-822-2242. Blue Bird's number for this recall is R15YB-SB.

15V-059

Blue Bird Body Company (Blue Bird) is recalling certain model year 2011-2016 All American rear engine transit buses manufactured June 5, 2010, to January 13, 2015. In the affected transit buses, the exhaust system hangers may fail, possibly causing damage to the Selective Catalytic Reduction (SCR) and the Diesel Particulate Filter (DPF) housings. If all the exhaust hangers were to fail, the housings may fall onto the roadway, creating a road hazard and increasing the risk of a crash. Blue Bird will notify owners, and dealers will install new bolted hanger assemblies and support cables, free of charge. The recall began on March 5, 2015. Owners may contact Blue Bird customer service at 1-478-822-2242. Blue Bird's number for this recall is R15YB-NSB.

15V-060

Newmar Corporation (Newmar) is recalling certain model year 2014-2015 Newmar King Aire, and Essex vehicles manufactured December 9, 2013, to December 16, 2014, equipped with certain Wabco Quick Release Valves with Double Check. In the affected valves, the rubber diaphragm may be damaged by sharp edges on the valve seat ribs, reducing the available air pressure in the air tanks. The reduced air pressure levels may reduce braking performance and/or the parking brakes could reapply, increasing the risk of a crash. Newmar will notify owners, and dealers will inspect and replace the valve, free of charge. The recall began on February 26, 2015. Owners may contact Newmar customer service at 1-800-731-8300.

15V-061

Newmar Corporation (Newmar) is recalling certain model year 2015 Essex motorhomes manufactured March 13, 2014, to November 13, 2014, built on Spartan chassis. Due to the steering column having inadequate spline

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2015**

Published March 13, 2015

engagement at the steering gear, the steering shaft may disconnect or slip. If the steering shaft disconnects or slips there would be a loss of steering control, increasing the risk of a crash. Spartan will notify owners on behalf of Newmar, and dealers will replace the steering shaft, free of charge. The recall began on February 26, 2015. Owners may contact Newmar customer service at 1-800-731-8300.

15V-062

Utility Trailer Manufacturing Company (Utility) is recalling certain model year 2014-2015 FS2CHA, VS2DX, VS1DC, VS2RA, and VS1RA trailers manufactured April 14, 2014, to November 4, 2015, equipped with certain Haldex Life Seal Type 30/30 Long Stroke Air Brake Actuators manufactured January 9, 2014, to October 28, 2014. The affected actuators may have an incomplete attachment of the internal rubber diaphragm to the actuation mechanism of the parking brake section of the Life Seal actuator. If the diaphragm is not completely attached, there may be internal leakage from the service section past the diaphragm, potentially trapping air pressure in the parking brake section. This air pressure in turn, if not vented, may prevent full release of the actuator unit, and may induce brake drag and may result in overheated wheelend service brakes, increasing the risk of a fire. Utility will notify owners and dealers will replace the actuators, free of charge. Owners may contact Utility customer service at 1-800-423-6591. Utility's number for this recall is 14E075.

15V-063

General Motors LLC (GM) is recalling certain model year 2006-2007 Chevrolet Malibu and Malibu Maxx vehicles manufactured April 1, 2006, to June 30, 2006, and 2006-2007 Pontiac G6 vehicles manufactured April 18, 2006, to June 30, 2006. In the affected vehicles, there may be a sudden loss of electric power steering (EPS) assist that could occur at any time while driving. If power steering assist is lost, greater driver effort would be required to steer the vehicle at low speeds, increasing the risk of a crash. GM will notify owners, and dealers will replace the torque sensor assembly, free of charge. The recall began February 24, 2015. Owners may contact Chevrolet customer service at 1-800-222-1020 or Pontiac customer service at 1-800-762-2737. GM's number for this recall is 14772. Note: This is an expansion of recall 14V-153 to cover additional vehicles built between April 1, 2006 and June 30, 2006.

15V-064

Morgan Olson Corporation (Morgan Olson) is recalling certain model year 2014 Service Body trucks built on Sprinter cab chassis manufactured April 11, 2014, to December 18, 2014. The affected vehicles may have the rear identification lamps mounted below the doors. Also, the license plate illumination lamp may be mounted incorrectly which may result in incomplete illumination of the license plate. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 108, "Lamps, Reflective Devices, and Associated Equipment." If the rear identification lamps and the license plate lamp are not mounted correctly, the vehicle may have reduced visibility, increasing the risk of a vehicle crash. Morgan Olson will notify owners, and dealers will modify the trucks to add rear identification lights above the door, and remount the license plate lamp, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Morgan Olson customer service at 1-800-262-3437.

15V-065

Piaggio Group Americas Inc. (Piaggio) is recalling certain model year 2008-2010 Vespa GTS 250, GTV 250,

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2015**

Published March 13, 2015

GTS Super 250, 2011 Vespa LX 150, LXV 150, S 150, 2010-2011 Vespa GTS 300, GTV 300, GTS Super 300, 2009-2010 Piaggio MP3 250, BV 250 Tourer, and 2010 BV 300 Tourer motorcycles. Due to a defective fuel pump, the affected motorcycles may stall while being operated or may fail to restart after being shut off for 15-20 minutes. If the motorcycle stalls, there is an increased risk of a crash. Piaggio will notify owners, and dealers will replace the defective fuel pump, free of charge. The recall is expected to begin March 16, 2015. Owners may contact Piaggio customer service at 1-212-380-4433.

15V-066

Newmar Corporation (Newmar) is recalling certain model year 2013-2014 King Aire and Essex vehicles manufactured April 12, 2013, to October 18, 2013, and built on Spartan Chassis. In the affected vehicles, the steering linkage castlenuts may loosen without warning and the steering linkage may separate from the bell cranks. If the steering linkage separates from the bell cranks, a loss of vehicle control may result, increasing the risk of a crash. Newmar will notify owners, and Spartan dealers will inspect the steering linkage castle nuts and tighten them, as necessary, free of charge. The recall began February 27, 2015. Owners may contact Newmar customer service at 1-800-731-8300.

15V-067

OBS, Inc. (OBS) is recalling certain model year 2012 Chevrolet CG33803 vehicles manufactured January 6, 2012, to January 9, 2013, 2007 Collins Midstar 20IS vehicles manufactured March 10, 2007, to August 27, 2007, Blue Bird A3FE2803a vehicles manufactured September 25, 2006, to March 23, 2007, and 2010 Blue Bird BBCV3011s vehicles manufactured May 10, 2009, to November 4, 2009, equipped with certain model S2005, S2010, S5005, S5010, S5505, and S5510 wheelchair lifts manufactured by Ricon Corporation. The platform side plate of the affected wheelchair lifts may crack. If the platform side plates crack, the lift platform can separate from the lift and come to rest against the vehicle's lift door. When the doors are opened, the platform may fall out, increasing the risk of injury to the lift operator. OBS will notify owners to take buses to a Ricon dealer or service center who will inspect and install supplemental platform support bumpers. Any platform that has already started cracking will be replaced, free of charge. Owners may contact OBS customer service at 1-330-453-3725. OBS' number for this recall is OBS # 01-15.

15V-068

Jaguar Land Rover North America, LLC (Land Rover) is recalling one model year 2015 Range Rover Sport vehicle manufactured November 16, 2014, and one 2015 LR4 vehicle manufactured November 11, 2014. In the affected vehicles, the 3.0L V6 supercharged engines may have improperly torqued connecting rod bolts. As a result, the connecting rod may separate from the crankshaft and the engine may seize. If the engine seizes there is an increased risk of a crash. Land Rover will notify owners, and dealers will replace the affected engines, free of charge. The recall began February 27, 2015. Owners may contact Land Rover customer service at 1-800-637-6837. Land Rover's number for this recall is P055.

15V-069

Altec Industries Inc. (Altec) is recalling certain model year 2005-2013 Altec Crane Telescopic Jib's manufactured March 1, 2005, to August 30, 2013. There may be un-impeded movement of the telescopic jib if the limiting pin is not inserted in the correct position. The un-impeded movement of the jib may increase the risk

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2015**

Published March 13, 2015

of injury to the operator or those nearby. Altec will notify owners, and dealers will install a retrofit kit that will aid the operator in the proper placement of the pin, free of charge. The recall began on March 10, 2015. Owners may contact Altec customer service at 1-877-462-5832. Altec's number for this recall is CSN 610.

15V-070

Nova Bus (Nova) is recalling certain model year 2009-2010 LFS transit buses manufactured January 1, 2009, to December 31, 2010 with ZFAV132 rear axles. The affected vehicles may have been produced with rear axle half shafts that received an inadequate surface treatment which may result in axle shaft failure. If the axle half shaft fails, the bus would be disabled, increasing the risk of a crash. Nova has notified the affected owners, and all affected buses have been repaired, free of charge. Owners may contact Nova customer service at 1-450-472-6410. Nova's number for this recall is BS1555.

15V-071

Nova Bus (Nova) is recalling certain model year 2006 LFS transit buses manufactured January 1, 2006, to December 31, 2006. In the affected vehicles, the air lines for the rear brake system may have an incorrectly positioned retaining ring (ferrule). The incorrectly positioned retaining ring may allow the air line to detach, compromising the rear axle braking performance and increasing the risk of a crash. Nova has notified owners, and dealers have inspected the air lines and repositioned the ferrules, as necessary, free of charge. Owners may contact Nova customer service at 1-450-472-6410. Nova's number for this recall is CR1247R1.

15V-072

Nova Bus (Nova) is recalling certain model year 2007 LFS transit buses manufactured January 1, 2007, to December 31, 2007. In the affected vehicles, the band clamp on the flex pipe between the turbocharger and the diesel particulate filter may be incorrectly located allowing the exhaust pipe to leak hot exhaust gases onto nearby components. If the components are exposed to hot exhaust gases, there is an increased risk of a fire. Nova notified owners, and dealers correctly positioned the clamps on the affected vehicles, free of charge. Owners may contact Nova customer service at 1-450-472-6410. Nova's number for this recall is CR1261.

15V-073

Nova Bus (Nova) is recalling certain model year 2006-2007 LFS transit buses manufactured January 1, 2006, to December 31, 2007. In the affected vehicles, the rear exit door controls may not function properly. If the rear exit door does not open and close as expected, there is an increased risk of injury to bus occupants. Nova notified owners, and dealers corrected the exit door control programming, free of charge. Owners may contact Nova customer service at 1-450-472-6410. Nova's number for this recall is CR1300.

15V-075

Nova Bus (Nova) is recalling certain model year 2008 LFS transit buses manufactured January 1, 2008, to December 31, 2008. Surrounding material may interfere with opening of the emergency exit windows, making them more difficult to open. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 217, "Bus Emergency Exits and Window Retention and Release." An emergency exit that is difficult to open may hinder egress in the event of an emergency, increasing the risk of injury. Nova has notified owners, and dealers removed any material that restricted the opening of the emergency

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2015**

Published March 13, 2015

exit, free of charge. Owners may contact Nova customer service at 1-450-472-6410. Nova's number for this recall is CR1314.

15V-076

Nova Bus (Nova) is recalling certain model year 2007-2009 LFS transit buses manufactured January 1, 2007, to December 31, 2009. A power feed cable in the battery compartment may have been incorrectly routed and clipped. As a result, the battery cable may prematurely wear and short to ground. A battery cable that shorts to ground increases the risk of a fire. Nova notified owners, and dealers inspected the buses and correctly routed the battery power feed cable, as necessary, free of charge. Owners may contact Nova customer service at 1-450-472-6410. Nova's number for this recall is CR1332.

15V-077

Nova Bus (Nova) is recalling certain model year 2009 LFS transit buses manufactured January 1, 2009, to December 31, 2009. In the affected buses, the brake hose fitting crimping ring may have been damaged and, as a result, the crimping ring may fail where the brake hose attaches to the air brake chamber. Failure of the crimping rings may affect the braking performance, increasing the risk of a crash. Nova has notified owners, and dealers inspected and replaced the damaged fittings, as necessary, free of charge. Owners may contact Nova customer service at 1-450-472-6410. Nova's number for this recall is CR1430.

15V-079

Forest River, Inc. (Forest River) is recalling certain model year 2014 Rockwood and Flagstaff recreational vehicles manufactured June 26, 2014, to October 9, 2014, and equipped with the Chill Chaser option. In the affected vehicles, excessive foam insulation and/or loose wiring may touch the Chill Chaser heating element. If the foam insulation or loose wiring contacts the heating element, there is an increased risk of fire. Forest River will notify owners, and dealers will inspect the foam insulation and wiring, making any necessary repair, free of charge. The recall is expected to begin during March 2015. Owners may contact Forest River customer service at 1-574-642-2640. Forest River's number for this recall is SB111014.

15V-080

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain model year 2014 FJ Cruiser vehicles manufactured August 7, 2013, to August 20, 2013. In the affected vehicles, the intermediate steering shaft which connects the steering wheel and the steering gear box may have an inadequate weld. If the intermediate steering shaft weld fails, there would be a loss of steering control, increasing the risk of a vehicle crash. Toyota will notify owners, and dealers will replace the intermediate steering shaft, free of charge. The recall is expected to begin in March 2015. Owners may contact Toyota customer service at 1-800-331-4331.

15V-081

Mercedes-Benz USA, LLC - DBA Sprinter (Sprinter) is recalling certain model year 2015 Sprinter 2500 and 3500 vehicles manufactured July 1, 2014, to October 14, 2014. In the affected vehicles, the abutting wedge, a component attached to the door jam to make opening the door easier after a severe frontal impact, may have been installed incorrectly. If a vehicle that has an incorrectly installed abutting wedge is involved in a severe frontal accident, a greater force may be necessary to open the doors, increasing the risk of injury. Sprinter will

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2015**

Published March 13, 2015

notify owners, and dealers will check the installation of the abutting wedge, correcting it as necessary, free of charge. The recall is expected to begin in March 2015. Owners may contact Sprinter customer service at 1-877-762-8267.

15V-082

Novae Corporation (Novae) is recalling certain model year 2015 Sure-Trac Single Ram SD Dump Trailers manufactured September 10, 2014, to November 15, 2014. In the affected dump trailers, the hydraulic cylinder lift ram mount attached to the dump bed may fail because it is too thin. If the mount fails, the dump bed could collapse during use, increasing the risk of personal injury. Novae will notify owners, and dealers will install a hydraulic cylinder lift ram mount reinforcement kit, free of charge. Owners may contact Novae customer service at 1-260-758-9838.

15V-083

Navistar, Inc. (Navistar) is recalling certain model year 2015 IC CE school buses manufactured October 3, 2013, to September 4, 2014. In the affected school buses, the powertrain wiring harness may contact the high pressure fuel line for one of the fuel injectors, possibly resulting in a fuel leak. If the high pressure fuel line leaks, fuel may spray into the engine compartment, increasing the risk of a fire. Navistar will notify owners, and dealers will install an additional harness saddle and cable tie strap to provide proper clearance, free of charge. The recall began February 20, 2015. Owners may contact Navistar customer service at 1-800-448-7825. Navistar's number for this recall is 15501.

15V-084

General Motors LLC (GM) is recalling certain model year 2014 Chevrolet Impala vehicles manufactured November 15, 2012, to May 27, 2014. In the affected vehicles, the electronic parking brake piston actuation arm may not fully retract causing the brake pads to stay partially engaged. Thus, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Systems (FMVSS) No. 135 "Light Vehicle Brake Systems." Brake pads that remain partially engaged with the rotors may cause excessive brake heat that may result in a fire. GM will notify owners, and dealers will reprogram the electronic parking brake control module with new software, free of charge. The recall began March 5, 2015. Owners may contact Chevrolet customer service at 1-800-222-1020 (Chevrolet). GM's number for this recall is 15100. Note: This recall covers a limited population of vehicles that were remedied incorrectly under recall 14V-541.

15V-085

Airstream, Inc. (Airstream) is recalling certain model year 2014-2015 Land Yacht, Eddie Bauer, International, Flying Cloud, and Sport travel trailers manufactured August 1, 2013, to February 4, 2015. The screws that secure the tray for the liquid propane (LP) tanks may fail and the LP tanks may fall from the trailer. If the screws that secures the tank to the trailer fails, the tank can separate from the trailer becoming an object that can impact another vehicle on the road. There is also an increased risk of a fire. Airstream will notify owners, and dealers will install new attaching screws to secure the LP tank tray, free of charge. The recall began on February 25, 2015. Owners may contact Airstream customer service at 1-937-596-6111.

15V-086

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2015**

Published March 13, 2015

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain model year 2013-2015 E350 Sedan, E350 4Matic Sedan, E350 4Matic Station Wagon, E400 Hybrid Sedan, CLS 550 CGI, and CLS550 4Matic, 2013-2014 E550 4Matic Sedan, 2013 E63 Sedan, E63 Station Wagon and CLS63, 2014-2015 CLS63 4Matic, E63 4Matic Sedan, E63 4Matic Sedan "S", and E63 4Matic Station Wagon, 2015 CLS400, 2015 E400 Sedan, E400 4Matic Sedan and CLS400 4Matic and 2014 CLS63 "S". The affected vehicles have a rubber seal at the back of the engine bay that may temporarily stick to the hood when it is opened and then may fall into the engine bay when the hood is closed. If the rubber seal falls into the engine compartment, it may contact parts of the exhaust system, increasing the risk of a fire. MBUSA will notify owners, and dealers will attach four additional retaining clips to the rubber seal, free of charge. The recall is expected to begin by mid-March 2015. Owners may contact MBUSA customer service at 1-201-573-5339. MBUSA's number for this recall is 2015020001.

15V-088

Kia Motors America (Kia) is recalling certain model year 2016 Sorento vehicles manufactured October 27, 2014, to January 29, 2015. Due to an improperly soldered component in the accelerator pedal assembly, the driver may not be able to accelerate the vehicle. If the vehicle is unable to be accelerated, there is an increased risk of a crash. Kia will notify owners, and dealers will replace the accelerator assembly, free of charge. The recall began on February 19, 2015. Owners may contact Kia customer service at 1-800-333-4542. Kia's number for this recall is SC115.

15V-089

Chrysler (FCA US LLC) is recalling certain model year 2015 Chrysler 200 vehicles manufactured March 9, 2014, to December 15, 2014, and equipped with a 9-speed automatic transmission. The automatic transmission parking pawl may become contaminated or the park rod may become dislodged or broken. This may prevent the transmission from shifting into the Park position. If the shift indicator displays "Park" but the park lock does not engage, the vehicle may roll away increasing the risk of a crash. Chrysler will notify owners, and dealers inspect the transmission. Any transmission found with contamination or a park rod will be replaced, free of charge. The recall is expected to begin on April 10, 2015. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is R08.

15V-090

Jaguar Land Rover North America, LLC (Jaguar) is recalling certain model year 2013 XF vehicles manufactured September 11, 2012, to October 8, 2012. The electronic modules which control the fuel pump may shut down causing the fuel pump to stop pumping fuel. The fuel pump shutdown will result in the vehicle stalling. The vehicle would also lose power-assisted braking and power-assisted steering. Any of these conditions may increase the risk of a vehicle crash. Jaguar will notify owners, and dealers will inspect, and install if necessary, an additional wiring harness to the in-tank fuel pump, free of charge. The recall is expected to begin April 17, 2015. Owners may contact Jaguar customer service at 1-800-452-4827. Jaguar's number for this recall is J051.

15V-091

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain model year 2015 Land Rover Range Rover, Range Rover Sport, and LR4 vehicles manufactured January 6, 2015, to January 23, 2015. The affected vehicles have wheel lug nuts that may crack and detach from the wheel hub stud. If one or more of the wheel lug

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2015**

Published March 13, 2015

nuts crack or detach from the wheel hub, the remaining lug nuts may be unable to keep the wheel secured to the vehicle. If the wheel detaches, loss of vehicle control would result, increasing the risk of a crash. Land Rover will notify owners, and dealers will replace the wheel nuts with new wheel nuts, free of charge. The recall is expected to begin April 17, 2015. Owners may contact Land Rover customer service at 1-800-637-6837. Land Rover's number for this recall is P056.

15V-092

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain model year 2013-2015 Land Rover Range Rover vehicles manufactured August 23, 2012, to February 5, 2015, and 2014-2015 Range Rover Sport vehicles manufactured June 16, 2013, to February 5, 2015. In the affected vehicles, a light weight adult front seat passenger may be improperly classified by the occupant classification system (OCS) and, as a result, the front seat passenger air bag may be disabled. If the front passenger air bag is disabled during a vehicle crash, there is an increased risk of injury. Land Rover will notify owners, and dealers will update the OCS software, free of charge. The recall is expected to begin April 17, 2015. Owners may contact Land Rover customer service at 1-800-637-6837. Land Rover's number for this recall is P059.

15V-093

Daimler Trucks North America LLC (DTNA) is recalling certain model year 2015 Freightliner Business Class M2 vehicles manufactured June 4, 2014, to December 1, 2014 that are equipped with hydraulic brakes and a Bosch Hydro-Max Brake Boost Pump. Due to an incompatibility between the boost pump switch and the instrument cluster, certain instrument display brake warnings may not illuminate correctly when there is a problem with the brake system. If the instrument panel doesn't display warnings, the driver may be unaware that braking force is reduced, increasing the risk of a crash. DTNA will notify owners, and dealers will install the correct brake switch, free of charge. The recall is expected to begin April 13, 2015. Owners may contact DTNA customer service at 1-800-745-8000. DTNA's number for this recall is FL-677.

15V-094

Bombardier Recreational Products Inc. (BRP) is recalling all model year 2013 Can-Am Spyder RT motorcycles. Prolonged idling or slow speed riding in warmer temperatures may result very high temperatures in the engine compartment. Very high temperatures in the engine compartment may increase the risk of skin burns or a vehicle fire. The remedy for this recall campaign is still under development. BRP will send an interim notification to owners in on February 26, 2015, and will mail a second notice when a remedy is available. Owners may contact BRP customer service at 1-888-272-9222.

15V-095

Altec Industries, Inc. (Altec) is recalling certain model year 2011-2014 Aerial Devices, models L36A, LRV, and LR7, manufactured June 1, 2011, to September 30, 2014, and built with Texas Hydraulics upper boom drive cylinders. In the affected aerial devices, the cylinder base end lug casting may develop cracks. If the cylinder lug castings crack, they may fail, resulting in unintended movement of the boom, increasing the risk of personal injury or death to the aerial device user or those nearby. Altec will notify owners, and dealers will inspect the cylinders for specific casting suspect lots. If both upper boom drive cylinders are not of the suspect lots, no further action is required. If a cylinder is found to be of one of the suspect lots, it will be inspected for visible cracks. If cracks

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2015**

Published March 13, 2015

are found the unit should be removed from service immediately and the cylinder will be replaced. If no cracks are found, the unit will be scheduled for magnetic particle inspection of the cylinder lug within 60 days. All of these actions will be performed free of charge. The recall is expected to begin on March 30, 2015. Owners may contact Altec customer service at 1-800-860-0183. Altec's number for this recall is CSN 611.

15V-096

Hyundai Motor America (Hyundai) is recalling certain model year 2015 Genesis vehicles manufactured February 21, 2014, to January 24, 2015. Water may leak into the rear combination lamp assemblies and cause an incorrect gear display on the instrument panel or a delay in the engagement of the selected gear when the vehicle is shifted from Park to Reverse or Drive. If the incorrect gear is being displayed, the vehicle may move in an unintended direction, increasing the risk of a crash. Hyundai will notify owners, and dealers will apply pads to prevent water intrusion into the combination lamp housing, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Hyundai customer service at 1-855-671-3059. Hyundai's number for this recall is 128.

15V-097

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain model year 2015 Yaris vehicles manufactured September 8, 2014, to January 9, 2015. The affected vehicles may have improperly tightened rear axle bearing bolts. The improperly tightened bolts may loosen during vehicle operation and may potentially cause the wheel to lock up or may damage the rear brake components, reducing their effectiveness. Either condition increases the risk of a crash. Toyota will notify owners, and dealers will inspect the rear axle bearing bolts, tightening them as necessary, free of charge. The recall is expected to begin during March 2015. Owners may contact Toyota customer service at 1-800-331-4331.

15V-098

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain model year 2015 Tacoma pickup trucks manufactured August 7, 2014, to December 22, 2014. The affected vehicles may have had their tires and wheels changed to TRD PRO accessory tires and wheels, causing the inflation information on the tire placard to be incorrect which may result in the tire being improperly inflated. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 110, "Tire Selection and Rims and Motor Home/Recreation Vehicle Trailer Load Carrying Capacity Information for Motor Vehicles with a GVWR of 4,536 kilograms (10,000 pounds) or less." Improperly inflated tires may increase the risk of a vehicle crash. Toyota will notify owners, and dealers will send a revised tire placard with correct tire size and inflation information to owners, free of charge. The recall is expected to begin in March 2015. Owners may contact Toyota customer service at 1-800-331-4331.

15V-099

Hyundai Motor America (Hyundai) is recalling certain model year 2008-2010 Elantra vehicles manufactured June 1, 2008, to April 30, 2010, and 2009-2010 Elantra Touring vehicles manufactured November 1, 2008, to April 30, 2010. The electronic power steering (EPS) electronic control unit (ECU) may sense a discrepancy in the steering input signals and, as a result, disable the steering power assist. If power steering assist is lost, greater driver effort would be required to steer the vehicle at low speeds, increasing the risk of a crash. Hyundai will

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2015**

Published March 13, 2015

notify owners, and dealers will verify the proper operation of the Electronic Power Steering and update the EPS control unit, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Hyundai customer service at 1-855-671-3059. Hyundai's number for this recall is 127.

15V-100

Altec Industries Inc. (Altec) is recalling certain model year 2012-2014 Digger Derrick and Aerial Device vehicles manufactured October 1, 2012, to June 30, 2014, and mounted on Freightliner chassis. In the event of a short circuit condition, the 30 amp breaker to the trailer relay module may react too slowly to prevent the module from overheating. If the module overheats, there is an increased risk of a fire. Altec will notify owners, and dealers will replace the 30 amp circuit breaker with a 20 amp one, free of charge. The recall is expected to begin April 7, 2015. Owners may contact Altec customer service at 1-800-860-0183. Altec's number for this recall is CSN 612.

15V-101

Keystone RV Company (Keystone) is recalling certain model year 2013-2015 Montana vehicles manufactured November 1, 2012, to May 22, 2014, 2014-2015 Raptor vehicles manufactured February 3, 2014, to January 15, 2015, and 2015 Dutchmen Voltage vehicles manufactured May 6, 2014, to February 3, 2015. In the affected vehicles, a rivet for the quad entry steps may shear and fail, causing the steps to give when being used. If the rivet shears causing the quad step to fail, the step user may fall, increasing the risk of personal injury. Keystone will notify owners, and dealers will inspect and replace two rivets joining the second and third step, and replace four rivets on the top step with fasteners, free of charge. The recall is expected to begin March 16, 2015. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 15-224.

15V-102

Cruiser RV (Cruiser) is recalling certain model year 2016 Stryker Toy and Stryker Toy Hauler trailers manufactured July 21, 2014, to January 9, 2015, and equipped with an optional slide floor. In the affected trailers, the slide floor can be flipped up to access the storage space underneath. If the floor is flipped up while the trailer is stationary, the trailer occupants may be exposed to exhaust fumes from the generator or fumes from the exterior fueling station. If the optional slide floor is opened and the occupants are exposed to fumes, there is an increased risk of injury. Cruiser will notify owners, and dealers will secure the slide floor so that it cannot be opened, completely sealing it from the occupant space, free of charge. The recall is expected to begin March 16, 2015. Owners may contact Cruiser customer service at 1-866-277-5630.

15V-103

Gulf Stream Coach, Inc. (Gulf Stream) is recalling certain model year 2010-2014 Conquest SE, Trailmaster, and Kingsport recreational trailers, models 265BHS and 265BHG, manufactured October 28, 2009, to August 22, 2013. The tire label on the affected trailers does not contain the correct tire size and tire pressure information. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." A tire blowout may result if the operator over inflates the tires due to incorrect label information, increasing the risk of a crash. Gulf Stream will notify owners and will send owners corrected labels with instructions for the proper installation of the labels, free of charge. The recall is expected to begin in March 2015. Owners may contact Gulf Stream

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2015**

Published March 13, 2015

customer service at 1-800-289-8787. Gulf Stream's number for this recall is EWR ID 00309.

15V-104

Daimler Trucks North America LLC (DTNA) is recalling certain model year 2014-2015 Freightliner Cascadia trucks manufactured November 19, 2013, to July 14, 2014, and equipped with certain model Side-Mount compressed natural gas (CNG) Fuel Systems, Part No. 23736011, manufactured August 1, 2013, to August 21, 2014 and Motion Industries T1700-06 flexible fuel hoses. The stainless steel braid hose reinforcement may corrode prematurely near the fitting crimp inside the slave tank enclosure. If the corrosion progresses and goes undetected, the hose could begin to leak CNG, increasing the risk of a fire in the presence of an ignition source. DTNA will notify owners and dealers will replace the defective hose, free of charge. The recall is expected to begin April 18, 2015. Owners may contact DTNA customer service at 1-800-745-8000. DTNA's number for this recall is FL-678.

15V-105

General Motors LLC (GM) is recalling certain model year 2013-2015 Cadillac ATS vehicles manufactured April 25, 2012, to February 9, 2015. In the affected vehicles, the power-operated roof panels auto-close when the non-recessed "Slide" or "Tilt" switches are pressed. As such, these vehicles fail to comply with the requirements of the Federal Motor Vehicle Safety Standards (FMVSS) No. 118, "Power-Operated Window, Partition, and Roof Panel Systems." Because the switch is not recessed, the roof panel switch may inadvertently be pressed resulting in unintended auto-closure of the roof panel, increasing the risk of personal injury. GM will notify owners, and dealers will replace the roof console accessory switch trim plate, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Cadillac customer service at 1-800-458-8006. GM's number for this recall is 15119.

15V-106

Prevost Cars, Inc. (Prevost) is recalling certain model year 2014 X3-45 commuter coaches manufactured October 1, 2014, to January 29, 2015, and equipped with Recaro-brand driver seats with a two-point seat belt and inward-facing retractor configuration. These seats have a seat belt retractor that may not lock as intended when the occupant has the seat in the full back position. If the seat belt retractor does not lock, the seat occupant may not be properly restrained during a vehicle crash, increasing their risk of personal injury. Prevost will notify owners, and dealers will inspect and reconfigure the seat belt to provide the needed clearance, free of charge. The recall is expected to begin in March 2015. Owners may contact Prevost customer service at 1-877-773-8678. Prevost's number for this recall is SR15-308.

15V-107

PACCAR Incorporated (PACCAR) is recalling certain model year 2009-2015 Peterbilt 320, 365, 367, 388, and 389 trucks manufactured July 21, 2008, to February 28, 2014. The front axle tie rod end clamp bolts may be improperly torqued. Undertorqued tie rod end clamp bolts are susceptible to corrosion, which may cause loose bolts to separate resulting in a loss of vehicle control and an increased risk of a crash. PACCAR will notify owners, and dealers will replace the front axle tie rod assembly on any vehicle where the factory installed assembly has not been previously replaced, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Peterbilt customer service at 1-940-591-4220. PACCAR's number for this

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2015**

Published March 13, 2015

recall is 215-C.

15V-108

Lance Camper Manufacturing Corp. (Lance) is recalling certain model year 2015 Slide-In Campers, and Travel Trailers built April 10, 2014, to December 15, 2014, and equipped with certain Latitude Awnings, styles GX and G, manufactured by Carefree of Colorado. The affected awnings may have screws that attach the lateral arm brackets to the mounting brackets that were not manufactured to specification. The screws could fail, causing the supporting bracket to fail, and the awning to fall and potentially strike and injure a person beneath it. Lance will notify owners, and dealers will remove and replace the defective screws, free of charge. The recall began on February 20, 2015. Owners may contact Lance customer service at 1-661-949-3322.

15V-109

McNeilus Truck & Manufacturing, Inc. (McNeilus) is recalling certain model year 2005-2014 Bridgemaster V Mixer vehicles manufactured October 1, 2005, to December 31, 2014. The affected vehicles are built with the optional Bridgemaster parking brake system on the trailing liftable axle. This parking brake system includes a valve that allows the secondary brake pressure to fall below the required 45 psi after one treadle application. As such, these vehicles fail to comply with Federal Motor Vehicle Safety Standard (FMVSS) No. 121, "Air Brake Systems." If the primary braking system fails, the emergency brake system may not achieve the level of performance needed, increasing the risk of a crash. McNeilus will notify owners, and dealers will install a check valve, free of charge. The recall began on March 10, 2015. Owners may contact McNeilus customer service at 1-888-686-7278. McNeilus' number for this recall is VSR-TSB-009.

15V-111

Farber Specialty Vehicles (Farber) is recalling various specialty vehicles modified by Farber and equipped with model S2005, S2010, S5005, S5010, S5505, and S5510 wheelchair lifts manufactured by Ricon Corporation. The platform side plate of the affected wheelchair lifts may crack. If the platform side plates crack, the lift platform can separate from the lift and come to rest against the vehicle's lift door. When the doors are opened, the platform may fall out, increasing the risk of injury to the lift operator. Farber will notify owners to take their vehicles to a Ricon dealer or service center who will install supplemental platform support bumpers. Any platform that has already started cracking will be replaced, free of charge. The recall is expected to begin during March 2015. Owners may contact Farber customer service at 1-800-331-3188, or Ricon customer service at 1-800-322-2884. Farber's number for this recall is 14E-041.

15V-112

General Motors LLC (GM) is recalling certain model year 2015 Chevrolet Cruze vehicles manufactured February 4, 2015, to February 9, 2015. The left-rear or right-rear parking brake cable brackets may not have been properly fastened during the assembly process. As a result, the fastening bolts may back out completely, causing the parking brake bracket to separate and the parking brake to not hold the vehicle in place. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 135, "Light Vehicle Brake Systems." If the parking brake bracket separates, the parking brake may not hold the vehicle, increasing the risk of a vehicle roll away and a crash. GM will notify owners, and dealers will inspect the left-rear and right-rear parking brake brackets bolts, tightening them as necessary, free of charge. The recall is

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2015**

Published March 13, 2015

expected to begin in March 2015. Owners may contact Chevrolet customer service at 1-800-222-1020. GM's number for this recall is 15135.

15V-113

Chrysler (FCA US LLC) is recalling certain model year 2015 Dodge Challenger SRT and Dodge Charger SRT vehicles manufactured September 18, 2014, to February 5, 2015, and equipped with a 6.2L supercharged engine. O-ring seal and fuel rail crossover hose damage may result in the fuel rail hose connection leaking fuel. A fuel leak in the presence of an ignition source such as hot engine or exhaust components increases the risk of a vehicle fire. Chrysler will notify owners and dealers will replace the engine fuel rail injector crossover hose, free of charge. The recall is expected to begin April 24, 2015. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is R07.

15V-114

Chrysler (FCA US LLC) is recalling certain model year 2012-2013 Jeep Grand Cherokee vehicles manufactured September 17, 2010, to August 19, 2013, and equipped with a 3.6, 5.7 or 6.4 liter engine, and 2012-2013 Dodge Durango vehicles manufactured January 18, 2011, to August 19, 2013, and equipped with a 3.6 or 5.7 liter engine. In the affected vehicles, the fuel pump relay inside the Totally Integrated Power Module (TIPM-7) may fail, causing the vehicle to stall without warning. A vehicle stall increases the risk of a crash. Chrysler will notify owners, and dealers will replace the fuel pump relay with one external to the TIPM. The recall is expected to begin April 24, 2015. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is R09. Note: This recall is an expansion of recall 14V-530.

15V-115

Nissan North America, Inc. (Nissan) is recalling certain model year 2013-2015 Nissan Altima vehicles manufactured March 1, 2013, to December 31, 2014. In the affected vehicles, the secondary hood latch may bind and remain in the unlatched position when the hood is closed. If the primary latch is inadvertently released and the secondary latch is not engaged, the hood could unexpectedly open while driving, increasing the risk of a vehicle crash. The manufacturer has not yet provided a remedy plan or notification schedule. Owners may contact Nissan customer service at 1-800-647-7261. Note: This recall is an expansion of recall 14V-565.

15V-116

Kawasaki Motors Corp., U.S.A. (Kawasaki) is recalling certain model year 2009-2013 Kawasaki Concours 14 and 14ABS motorcycles manufactured May 8, 2008, to February 20, 2013, and modified for police authority use. The additional police accessories may cause the 30-amp main fuse to blow. Also, the additional police wiring harness may chafe leading to a short, which may blow the main fuse. If the fuse blows, the engine will stall, increasing the risk of a crash. Kawasaki has notified the affected police departments and will send trained personnel to repair the motorcycles, free of charge. The recall is expected to begin in March 2015. Owners may contact Kawasaki customer service at 1-866-802-9381. Kawasaki's number for this recall is MC15-02. Note: This recall is an expansion of recalls 12V-134, 13V-370 and 13V-387.

15V-117

Blue Bird Body Company (Blue Bird) is recalling certain 2016 All American transit buses manufactured from

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2015**

Published March 13, 2015

September 15, 2014, through January 12, 2015. In the affected vehicles, a clamp on the steering shaft may come in contact with the rubber boot at the floor. If the steering shaft clamp comes into contact with the rubber boot, additional effort would be needed to steer the vehicle, increasing the risk of a crash. Blue Bird will notify owners, and dealers will relocate the rubber boot and install a new steering shaft clamp, free of charge. The recall is expected to begin on March 26, 2015. Owners may contact Blue Bird Customer Service 1-478-822-2242. Blue Bird's number for this recall is R14XE. Note: This recall is an expansion of recall 14V-306.

15V-118