

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING APRIL 2015**

*Published May 27, 2015*

**CHILD SEATS:**

None during April 2015.

**EQUIPMENT:**

Buy4easy Inc. (Buy4easy) is recalling certain TMS HY-809 motorcycle half-helmets, size Large, manufactured March 20, 2012, to October 31, 2012. The affected motorcycle helmets may insufficiently dampen impacts. Additionally, the helmets may be missing, or have incomplete, manufacturing dates and instructions to the purchaser. As such, these helmets fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 218, "Motorcycle Helmets." By wearing a noncompliant helmet, the user may not be adequately protected in the event of a crash, increasing the risk of personal injury. Buy4easy will notify owners and will offered a full refund. The recall began on May 6, 2015. Owners may contact Buy4easy customer service at 1-626-388-9898.

**15E-027**

Robert Bosch LLC (Bosch) is recalling certain Bosch Fuel Delivery Modules manufactured September 9, 2013, to April 16, 2014. Improper nickel plating of components within the fuel pump may result in the fuel pump failing. If the fuel pump fails, the engine will stop running and the vehicle will stall without warning, increasing the risk of a crash. Bosch has notified the vehicle manufacturers that purchased the pumps. The vehicle manufacturers that installed these fuel pumps in their products will notify the affected vehicle owners and will replace the pumps, free of charge. Owners may contact Bosch customer service at 1-248-553-9000.

**15E-028**

Lippert Components, Inc. (Lippert) is recalling certain Axle Hubs, part number 122093, manufactured March 12, 2015, to March 26, 2015. The affected axle hubs have wheel mounting studs that may fail. If the wheel studs break while the trailer is being used, wheel separation may occur, increasing the risk of a vehicle crash. Lippert has notified the trailer manufacturers that purchased the axles built with the affected hubs. The trailer manufacturers will notify the vehicle owners and their dealers will replace the hubs with hubs from a different supplier, free of charge. The recall began March 27, 2015. Owners may contact Lippert customer service at 1-574-537-8900. Lippert's number for this recall is LCI-TRP-0315001.

**15E-029**

Cummins Inc. (Cummins) and Cummins Westport Inc. are recalling certain Cummins Westport ISL G engines, part number G6LTAA8.9E, manufactured February 26, 2007, to April 14, 2015. Excessive engine crankcase pressures may cause the 90-degree elbow of the vent tube assembly to detach from the crankcase ventilation breather, possibly allowing engine oil to come into contact with hot surfaces. If engine oil comes into contact with a hot surface, there is an increased risk of a fire. Cummins has begun the process of notifying the affected vehicle manufacturers and vehicle owners. Dealers will secure the ends of the 90-degree elbow. In addition, the electronic control module (ECM) will be reprogrammed with software that can adjust the engine output under misfire conditions to limit crankcase pressures. These repairs will be performed free of charge. The recall began on May 1, 2015. Owners may contact Cummins customer service at 1-800-343-7357. Cummins number for this recall is C1627.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING APRIL 2015**

*Published May 27, 2015*

**15E-030**

**TIRES:**

Shandong Jinyu Industrial Co. LTD, (Shandong) is recalling certain Jinyu YS78 and Evergreen ES89 AT tires, size LT225/75R16, manufactured April 1, 2011, to August 31, 2014 (DOT date codes 1611 through 4314). The affected tires may not be able to properly dissipate heat, and as a result, the tire belts may separate. If the tire belts separate, the tire may suddenly lose air, increasing the risk of a crash. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Shandong customer service at 1-786-521-1296.

**15T-009**

**VEHICLES:**

Oshkosh Corporation (Oshkosh) is recalling certain model year 2014-2015 S-Series Front Discharge Concrete Mixer vehicles manufactured September 24, 2013, to November 12, 2014. The affected vehicles have air tanks that hold less than the required 12 times the combined volume of the service brake chambers. As a result, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 121, "Air Brake Systems." With the air tank volume being less than required, in certain situations the vehicle may have an insufficient quantity of air to operate the brakes, increasing the risk of a crash. Oshkosh will notify owners and dealers will install a larger capacity air tank, free of charge. The recall began April 15, 2015. Owners may contact Oshkosh customer service at 1-888-686-7278. Oshkosh's number for this recall is VSR-TSB-010.

**15V-193**

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain model year 2009 Routan vehicles manufactured June 25, 2008, to June 10, 2009, and 2010 Routan vehicles manufactured October 1, 2009, to August 11, 2010. This defect can affect the safe operation of the airbag system. Until this recall is performed, customers should remove all items from their key rings, leaving only the ignition key. The key fob (if applicable), should also be removed from the key ring.

Road conditions or some other jarring event may cause the ignition switch to move out of the run position, turning off the engine. If the ignition key inadvertently moves into the OFF or ACCESSORY position, the engine will turn off, which will then depower various key safety systems including, but not limited to, air bags, power steering, and power braking. Loss of functionality of these systems may increase the risk of crash and/or increase the risk of injury in the event of a crash. Volkswagen will notify owners, and dealers will replace the ignition switch and key FOBs, free of charge. The recall is expected to begin in May 2015. Owners may contact Volkswagen customer service at 1-800-822-8987. Volkswagen's number for this recall is 28H1. Note: This recall supersedes recalls 11V151 and 14V396. Vehicles that previously received an ignition switch trim ring as a recall remedy must have their vehicles remedied again under this campaign. Vehicles that have already received a new ignition switch are not covered by this campaign.

**15V-194**

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING APRIL 2015**

*Published May 27, 2015*

Mitsubishi Fuso Truck of America, Inc. (MFTA) is recalling certain model year 2014-2015 FEC72 vehicles manufactured November 8, 2013, to January 28, 2014, and 2012-2015 FEC92 vehicles manufactured April 22, 2011, to February 1, 2014. On the affected vehicles, the lower engine timing chain bolt may have been insufficiently tightened during assembly. A timing chain bolt that was not properly tightened may result in an engine oil leak, possibly causing the engine to seize, increasing the risk of a crash. MFTA will notify owners, and dealers will tighten the lower engine timing chain bolt to the proper torque, free of charge. The manufacturer has not yet provided a notification schedule. MFTA's number for this recall C1007710.

**15V-195**

PACCAR Incorporated (PACCAR) is recalling certain model year 2015-2016 Kenworth T680 and T880 trucks manufactured November 17, 2014, to January 5, 2015. The affected vehicles are equipped with Meritor MT-40-14X rear drive axles that may circulate an inadequate amount of lubricant to the wheel end hub assembly. Without adequate lubrication to the wheel end hub assembly, the bearings may fail prematurely, increasing the risk of a wheel-end fire or crash. Kenworth will notify owners, and dealers will replace the defective rear drive axle and inspect the wheel ends for damage, replacing them, as needed, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Kenworth customer service at 1-425-828-5000. PACCAR's number for this recall is 15KWB.

**15V-196**

Nissan North America, Inc. (Nissan) is recalling certain model year 2014 Nissan Rogue vehicles manufactured June 11, 2013, to June 7, 2014. Improper nickel plating of components within the fuel pump may result in the fuel pump failing. If the fuel pump fails, the vehicle may stall without warning, increasing the risk of a crash. Nissan will notify owners, and dealers will replace the fuel pump, free of charge. The recall is expected to begin in May 2015. Owners may contact Nissan customer service at 1-800-647-7261.

**15V-197**

Heartland Recreational Vehicles, LLC (Heartland) is recalling certain model year 2015 Bighorn, Cyclone, Edge, Elkridge, Landmark 365, Road Warrior, and Torque fifth wheel and travel trailers. In the affected vehicles, a rivet for the quad entry steps may shear and fail, causing the steps to give when being used. If the rivet shears causing the quad step to fail, the step user may fall, increasing the risk of personal injury. Heartland has notified owners, and dealers will replace the defective rivets with bolts, free of charge. The recall began on April 13, 2015. Owners may contact Heartland customer service at 1-877-262-8032. Heartland's number for this recall is 99-01-20.

**15V-198**

Heartland Recreational Vehicles, LLC (Heartland) is recalling certain model year 2016 Big Country, Bighorn, Cyclone, Edge, Elkridge, North Trail, Prowler, Road Warrior, Sundance XLT, Torque, Wilderness and 2015-2016 Landmark 365 fifth wheel and travel trailers. In the affected vehicles, the bolts that attach the expanding room to the sliding mechanism chain may fail allowing the room to extend unintentionally while the vehicle is in motion. If the room extends while vehicle is in motion, there is an increased risk of a crash. Heartland will notify owners, and dealers will replace the defective bolts, free of charge. The recall began April 16, 2015. Owners may contact Heartland customer service at 1-877-262-8032. Heartland's number for this recall is 99-01-21.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING APRIL 2015**

*Published May 27, 2015*

**15V-199**

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain model year 2015 Audi Q3 vehicles manufactured April 4, 2014, to November 5, 2014. If the vehicle is turned off while the sunroof is closing, the sunroof may continue to close instead of stopping. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) 118, "Power-Operated Window, Partition, and Roof Panel Systems." If the sunroof is closing while the vehicle is shut off and a vehicle occupant is in its path, there is an increased risk of injury. Audi will notify owners, and dealers will update the sunroof control module software, free of charge. The recall began on April 13, 2015. Owners may contact Audi customer service at 1-800-253-2834. Volkswagen's number for this recall is 60C1.

**15V-200**

General Motors LLC (GM) is recalling certain model year 2004 Buick Regal vehicles manufactured April 9, 2003, to June 26, 2003, 2004 Chevrolet Impala vehicles manufactured April 8, 2003, to June 25, 2003, and 2004 Chevrolet Monte Carlo vehicles manufactured April 7, 2003, to June 25, 2003. In the affected vehicles, the valve cover gasket may leak. The leaking engine oil can drip onto the hot surface of the exhaust manifold, increasing the risk of a fire. GM will notify owners, and dealers will replace the spark plug wire retainer to redirect the dripping oil. Vehicles that have a 3.8L V6 supercharged engine will also have the left valve cover gasket replaced. These repairs will be done free of charge. The recall began on April 24, 2015. Owners may contact Buick customer service at 1-800-521-7300 or Chevrolet customer service at 1-800-222-1020. GM's number for this recall is 14574.

**15V-201**

General Motors LLC (GM) is recalling certain model year 2014 Chevrolet Impala vehicles manufactured March 22, 2013, to May 22, 2014. In the affected vehicles, the electronic parking brake piston actuation arm may not fully retract causing the brake pads to stay partially engaged. Thus, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Systems (FMVSS) No. 135 "Light Vehicle Brake Systems." Brake pads that remain partially engaged with the rotors may cause excessive brake heat that may result in a fire. GM will notify owners, and dealers will reprogram the electronic parking brake control module with new software, free of charge. The recall began on May 6, 2015. Owners may contact Chevrolet customer service at 1-800-222-1020 (Chevrolet). GM's number for this recall is 15259.

**15V-202**

Forest River, Inc. (Forest River) is recalling certain model year 2015 Georgetown GT335, FR3 FR30, Pursuit 31BD, and 29SB, and 2016 Cardinal CAF3825FL and Tracer TRT270AIR and TRT3200BHT fifth wheel and travel trailers. In the affected vehicles, the screws that attach the expanding room to the sliding mechanism cable may fail allowing the room to extend unintentionally while the vehicle is in motion. If the room extends while vehicle is in motion, there is an increased risk of a crash. Forest River will notify owners, and dealers will replace the slide room mechanism cable attaching screws, free of charge. The recall began on May 5, 2015. Owners may contact Forest River customer service at 1-574-642-0437. Forest River's number for this recall is 51-0331201501.

**15V-203**

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING APRIL 2015**

*Published May 27, 2015*

Autocar, LLC (Autocar) is recalling certain model year 2013-2015 Autocar ACX front-end loader garbage trucks manufactured March 8, 2013, to September 24, 2014. The mounting brackets of the first cross member behind the engine may fail and cause the cross member to detach from the frame rails. Other components that are supported by the cross member may separate from the vehicle if the cross member detaches, becoming road hazards and increasing the risk of a crash. Autocar will notify owners, and dealers will replace the aluminum mounting brackets with a high tensile steel brackets, free of charge. The recall is expected to begin June 2, 2015. Owners may contact Autocar customer service at 1-888-218-3611. Autocar's number for this recall is ACX-1501.

**15V-204**

BMW of North America, LLC (BMW) is recalling certain model year 2005-2006 MINI Cooper and Cooper S vehicles manufactured January 5, 2005, to November 28, 2006, and 2005-2008 MINI Cooper Convertible and Cooper S Convertible vehicles manufactured January 5, 2005, to July 31, 2008. Due to manufacturing, installation, and exposure issues, the front passenger seat occupant detection mat may not function properly and, as a result, the front passenger air bag may not deploy in a crash. An improperly functioning mat may cause the passenger frontal air bag to be inactive when the seat is occupied, and in the event of a crash, the air bag will not deploy, increasing the passenger's risk of injury. MINI will notify owners, and dealers will replace the front passenger seat occupant detection mat, free of charge. Owners may contact MINI customer service at 1-866-825-1525.

**15V-205**

PACCAR Incorporated (PACCAR) is recalling certain model year 2015-2016 Peterbilt 220 and Kenworth K300 trucks manufactured September 1, 2014, to March 30, 2015. Each time the cruise control speed decrease button is pressed, the vehicle speed will actually increase by one mile per hour. If a driver is intending to slow down a vehicle but instead it inadvertently speeds up, there is an increased risk of a crash. PACCAR will notify owners, and dealers will update the cab controller software, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Peterbilt customer service at 1-940-591-4000, or Kenworth customer service at 1-425-828-5000. PACCAR's numbers for this recall are 415-E and 15KWC.

**15V-206**

Keystone RV Company (Keystone) is recalling certain model year 2015 Keystone Sprinter trailers, models 252RLS, 269RLS, 295RKS, 298RLS, 299RET, 31BH, and 313BHS, and 2015 Dutchmen Denali trailers, models 2461RK and 262RLX. In the affected trailers, the studs that are used to attach the wheels to the axle hubs may break. If the wheel studs break, the wheel could detach from the vehicle, increasing the risk of a crash. Keystone will notify owners, and dealers will replace the wheel hubs, free of charge. The recall is expected to begin in May 2015. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 15-230.

**15V-207**

Hino Motor Sales U.S.A., Inc. (Hino) is recalling certain model year 2015-2016 238, 258, 268, and 338 trucks manufactured January 5, 2015, to March 20, 2015. In the affected vehicles, the U-bolt that connects the suspension springs to the front axle may have been overtightened. If the U-bolt was overtightened, the bolt may

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING APRIL 2015**

*Published May 27, 2015*

stretch resulting in it loosening or failing. Either result may cause a loss of steering ability, increasing the risk of a vehicle crash. Hino will notify owners, and dealers will replace the front axle U-bolts on the subject vehicles free of charge. The recall is expected to begin June 5, 2015. Owners may contact Hino customer service at 1-248-699-9300.

**15V-208**

Highland Ridge RV (Highland) is recalling certain model year 2015-2016 Roamer, Mesa Ridge, Light, 3X, and Journeyer travel and fifth wheel trailers manufactured March 6, 2015, to March 26, 2015. In the affected vehicles, the screws that attach the expanding room to the sliding mechanism cable may fail allowing the room to extend unintentionally while the vehicle is in motion. If the room extends while vehicle is in motion, there is an increased risk of a crash. Highland will notify owners, and dealers will replace the slide room mechanism attaching screws, free of charge. The recall began on May 5, 2015. Owners may contact Highland customer service at 1-260-768-7771.

**15V-209**

KTM North America, Inc. (KTM) is recalling certain model year 2015 690 Enduro R motorcycles manufactured November 1, 2014, to February 28, 2015. The rear brake line from the ABS pressure modulator to the foot brake cylinder may have been damaged during the assembly process and/or be subject to subsequent damage caused by contact with the spring clamp of the crank case ventilation hose. A damaged brake line may cause a loss of rear braking ability, increasing the risk of a crash. KTM will notify owners, and dealers will inspect the positioning of the crank case ventilation hose clamp, correcting it as necessary. Any damaged brake line will be replaced. These repairs will be performed free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact KTM customer service at 1-888-985-6090. Note: Owners are advised to not ride their motorcycle until the recall has been remedied.

**15V-210**

Spartan Motors, Inc. (Spartan) is recalling certain model year 2015 K3 chassis manufactured February 28, 2014, to October 21, 2014. In the affected chassis, the tag axle suspension hangers may move allowing the tag axle assembly to shift off center. If the tag axle moves off center, vehicle handling may suddenly be affected, increasing the risk of a crash. Spartan will notify owners, and dealers will weld the tag axle suspension hangers to the main frame, free of charge. The recall began on April 17, 2015. Owners may contact Spartan customer service at 1-517-543-6400. Spartan's number for this recall is 15001.

**15V-211**

Grand Design RV, LLC (Grand Design) is recalling certain model year 2015-2016 Reflection 303RLS, 308BHTS and 313RLTS trailers manufactured March 12, 2015, to April 6, 2015. In the affected trailers, the studs that are used to attach the wheels to the axle hubs may break. If the wheel studs break, the wheel could detach from the vehicle, increasing the risk of a crash. Grand Design has notified owners, and dealers will replace any affected wheel hub, free of charge. The recall began on April 14, 2015. Owners may contact Grand Design customer service at 1-574-825-9679. Grand Design's number for this recall is 910003.

**15V-212**

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING APRIL 2015**

*Published May 27, 2015*

Trans-Air Manufacturing Corp. (Trans-Air) is recalling certain model year 2006-2014 GM G3500 and G4500 vehicles modified with Trans-Air add-on compressor mount kits, part numbers 4012506-01, 4012506-02, 4013126-01, 4013126-02, 4013235-01, 4013235-02, 4012909, 4013125, 4013222 and 717173 installed by Trans-Air personnel. After installing a compressor, a power distribution terminal strip may not have been properly reconnected. If the power distribution terminal strip has a poor connection or a loose connection, the strip may arc or overheat, increasing the risk of a vehicle fire. Trans-Air will notify owners, and dealers will inspect the power distribution terminal strip connection, correcting it as necessary, free of charge. The recall is expected to begin during May 2015. Owners may contact Trans-Air customer service at 1-800-673-2446.

**15V-213**

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain model year 2015 LR4 vehicles manufactured August 19, 2014, to February 9, 2015. Due to an Anti-Lock Braking System (ABS) software error, the Dynamic Stability Control (DSC), Roll Stability Control (RSC), Traction Control (TC) and Hill Decent Control (HDC) systems may be disabled. If these safety systems are disabled, a loss of vehicle stability and control may occur, increasing the risk of crash. Land Rover will notify owners, and dealers will update the ABS software, free of charge. The recall began on May 21, 2015. Owners may contact Land Rover customer service at 1-800-637-6837. Land Rover's number for this recall is P062.

**15V-214**

DS Corp DBA Crossroads RV (Crossroads) is recalling certain model year 2016 Cruiser, Cruiser Aire, ReZerve, and Sunset Trail recreational trailers manufactured March 19, 2015, to April 6, 2015. In the affected trailers, the studs that are used to attach the wheels to the axle hubs may break. If the wheel studs break, the wheel could detach from the vehicle, increasing the risk of a crash. Crossroads has notified owners, and dealers will replace the defective hubs, free of charge. The recall began on April 14, 2015. Owners may contact Crossroads customer service at 1-855-226-7496. Crossroads number for this recall is 37.

**15V-215**

Harley-Davidson Motor Company (Harley-Davidson) is recalling certain model year 2014-2015 Electra Glide Ultra Classic (FLHTCU), Electra Glide Ultra Classic - Twin Cooled (FLHTCU TC), Ultra Limited (FLHTK), Police Electra Glide (FLHTP), Street Glide (FLHX), Street Glide Special (FLHXS), CVO Street Glide (FLHXSE), 2015 Electra Glide Ultra Classic Low (FLHTCUL), Ultra Limited Low (FLHTKL), Electra Glide Ultra Classic Low - Twin Cooled (FLHTCUL TC), Road Glide Special (FLTRXS), Road Glide (FLTRX), and 2014 CVO Road King (FLHRSE) motorcycles manufactured April 28, 2014, to October 24, 2014. In the affected motorcycles, the clutch master cylinder may lose the ability to generate enough lift to disengage the clutch, especially if the motorcycle has been parked for an extended period of time. When the engine is running and the motorcycle is in gear, if the clutch cannot be fully disengaged, the motorcycle may move unexpectedly, increasing the risk of a crash. Harley-Davidson will notify owners, and dealers will flush the clutch system and rebuild the clutch master cylinder, free of charge. The recall began on April 23, 2015. Owners may contact Harley-Davidson customer service at 1-800-258-2464. Harley-Davidson's number for this recall is 0165.

**15V-216**

Harley-Davidson Motor Company (Harley-Davidson) is recalling certain model year 2015 XG500 motorcycles

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING APRIL 2015**

*Published May 27, 2015*

manufactured January 28, 2014, to March 9, 2015, and 2015 XG750 motorcycles manufactured May 12, 2014, to March 9, 2015. The affected motorcycles may have been manufactured without a rear reflector assembly. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." If the motorcycle is missing the rear reflector it can reduce the vehicle's visibility to other drivers, increasing the risk of a crash. Harley-Davidson will notify owners, and dealers will install a rear reflector assembly, free of charge. The recall began on April 29, 2015. Owners may contact Harley-Davidson customer service at 1-800-258-2464. Harley-Davidson's number for this recall is 0620.

**15V-217**

Hyundai Motor America (Hyundai) is recalling certain model year 2015 Accent vehicles manufactured September 15, 2014, to February 10, 2015. In very cold temperatures, the occupant detection system (ODS) may not be able to determine if a child restraint seat is in the front passenger seat. If the ODS fails to detect that the seat is occupied by a child restraint seat, the front air bag will not be deactivated and, in the event of a crash necessitating front air bag deployment, the air bag deployment could cause increased risk of injury to the occupant in the child restraint seat. Hyundai will notify owners, and dealers will correct ODS software, free of charge. The recall is expected to begin on June 5, 2015. Owners may contact Hyundai customer service at 1-855-671-3059. Hyundai's number for this recall is 129.

**15V-218**

Gillig LLC (Gillig) is recalling certain model year 2013-2015 Low Floor transit buses manufactured July 8, 2013, to February 7, 2015 and equipped with disc brakes. The front left and right brake air hoses that connect to the brake chamber may touch and rub against the air bag suspension towers. If the front brake hoses rub the air bag suspension tower, a hole may develop and the resulting air leak may reduce the brake air pressure, lengthening the distance needed to stop the transit bus and increasing the risk of a crash. Gillig has notified owners, and dealers will replace the brake hoses with shorter ones that will not contact the suspension tower, free of charge. The recall began on April 28, 2015. Owners may contact Gillig customer service at 1-800-735-1500.

**15V-219**

Fontaine Modification (Fontaine) is recalling certain model year 2006-2015 Freightliner M2 trucks manufactured January 2, 2006, to January 23, 2015 and modified by Fontaine to have dual steering. Brake lights of the affected vehicles will not illuminate if the primary brake air supply is depleted below 6 psi. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 121, "Air Brake Systems." If the primary brake air system fails causing the truck to rely on the secondary brake air system, the brakes lights may not illuminate when the brakes are applied, increasing the risk of a crash. Fontaine will notify owners, and dealers will install a repair kit to resolve the issue, free of charge. The recall is expected to begin during May 2015. Owners may contact Fontaine customer service at 1-800-366-8246.

**15V-220**

Yamaha Motor Corporation, USA (Yamaha) is recalling certain model year 2015 YZFR1M motorcycles manufactured January 19, 2015, to March 23, 2015. The affected motorcycles may have been built with an

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING APRIL 2015**

*Published May 27, 2015*

improperly manufactured rear shock absorber. The nut on the damper rod for these shock absorbers may loosen, resulting in a loss of damping and the possible disassembling of the shock. If the damper rod nut loosens, shock absorber performance would be affected, possibly causing a loss of vehicle control and increasing the risk of a crash. Yamaha will notify owners, and dealers will inspect the motorcycles and replace any affected rear shock absorbers, free of charge. The recall began on April 29, 2015. Owners may contact Yamaha customer service at 1-800-962-7926. Yamaha's number for this recall is 990095.

**15V-221**

Chrysler (FCA US LLC) is recalling certain model year 2006 Dodge Viper and Jeep Wrangler and Liberty vehicles manufactured July 1, 2005, to July 31, 2006. In the affected vehicles, the springs within the clutch pedal position switch that prevents the vehicle from starting unless the clutch pedal is pushed down may break. As a result, the vehicle may not be started when the clutch pedal is pushed down or the engine may crank and start without the clutch pedal being pushed down causing the vehicle to unexpectedly lurch. If the vehicle unexpectedly moves there is an increased risk of a crash. Chrysler will notify owners, and dealers will replace the clutch ignition interlock switch, free of charge. Parts are currently unavailable. Owners will be mailed an interim notification beginning in June 2015, and will receive a second notification when remedy parts are available. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is R13.

**15V-222**

Chrysler (FCA US LLC) is recalling certain model year 2015 Ram ProMaster City vehicles manufactured November 6, 2014, to March 17, 2015. The affected cargo and passenger vehicles have side air bag inflatable curtains that, due to an installation issue, may not deploy properly. As a result, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 214, "Side Impact Protection." In the event of a crash, side air bag inflatable curtains that do not deploy properly may increase the risk of vehicle occupant injury. Chrysler will notify owners, and dealers will modify the installation of side air bag inflatable curtains, free of charge. The recall began on May 6, 2015. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is R19.

**15V-223**

Thor Motor Coach (TMC) is recalling certain model year 2016 Four Winds, Citation, Outlaw, Chateau, Siesta, and Freedom Elite motorhomes manufactured February 14, 2015, to April 6, 2015. The affected vehicles may be missing the water weight carrying capability information on the Occupant and Cargo Carrying Capacity (OCCC) label. As a result, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 120, "Tire Selection and Rims and Motor Home/Recreation Vehicle Trailer Load Carrying Capacity Information for Motor Vehicles with a GVWR of more than 4,536 kilograms (10,000 pounds)." If the vehicle is loaded to its weight capacity without including the weight of the water carried onboard, the motorhome may be overloaded. This can cause a loss of vehicle control, increasing the risk of a crash. TMC will notify owners and will provide a new OCCC label with the correct information, free of charge. The recall began on May 1, 2015. Owners may contact TMC customer service at 1-877-500-1020. TMC's number for this recall is RC000099.

**15V-224**

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING APRIL 2015**

*Published May 27, 2015*

General Motors LLC (GM) is recalling certain model year 2004-2007 Cadillac CTS-V vehicles manufactured between September 6, 2003, and June 11, 2007, currently registered, or originally sold, in Connecticut, Delaware, Illinois, Indiana, Iowa, Maine, Maryland, Massachusetts, Michigan, Minnesota, Missouri, New Hampshire, New Jersey, New York, Ohio, Pennsylvania, Rhode Island, Vermont, West Virginia, Wisconsin and the District of Columbia. In the affected vehicles, snow or water containing road salt or other contaminants may corrode the front brake hose fitting at the caliper. Corrosion may cause the brake system to leak which could lengthen the distance needed to stop the vehicle and increase the risk of a crash. GM will notify owners, and dealers will replace both front brake hose assemblies, free of charge. The recall began on May 8, 2015. Owners may contact Cadillac customer service at 1-800-458-8006. GM's number for this recall is 15149. Note: This recall is an expansion of recall 10V-105.

**15V-225**

Nissan North America, Inc. (Nissan) is recalling certain model year 2006 Sentra vehicles manufactured January 2, 2006, to August 26, 2006, originally sold, or currently registered, in geographic locations associated with high absolute humidity. Specifically, vehicles sold, or currently registered, in Puerto Rico, Hawaii, the U.S. Virgin Islands, Guam, Saipan, American Samoa, Florida and adjacent counties in southern Georgia, as well as the coastal areas of Alabama, Louisiana, Mississippi and Texas. Upon deployment of the passenger side frontal air bag, excessive internal pressure may cause the inflator to rupture. In the event of a crash necessitating deployment of the passenger side frontal air bag, the inflator could rupture with metal fragments striking and potentially seriously injuring the vehicle occupants. Nissan will notify owners, and dealers will replace the passenger air bag inflator, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Nissan customer service at 1-800-647-7261. Note: This recall is an expansion of recall 14V-701.

**15V-226**

Highland Ridge RV (Highland Ridge) is recalling certain model year 2015 Residential 417RS fifth wheel recreational trailers manufactured May 14, 2014, to June 10, 2014. The flexible gas line for the kitchen slideout section is too short. When the kitchen area is expanded, the gas line may be pulled excessively, resulting in a gas leak, increasing the risk of a fire. Highland Ridge will notify owners, and dealers will replace the existing gas line with a new longer gas line, free of charge. The recall began on May 21, 2015. Owners may contact Highland Ridge customer service at 1-260-768-7771. Highland Ridge's number for this recall is 9904236. Note: This recall is an expansion of recall 14V254.

**15V-227**

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain model year 2015 Toyota Scion tC vehicles manufactured December 3, 2014, to January 30, 2015 and equipped with accessory coil springs as part of an optional Release Series 9 trim package. During installation of these coil springs, the rear suspension components may not have been properly tightened. If the rear suspension components were not properly tightened, the rear suspension arms may detach, increasing the risk of a crash. Toyota will notify owners, and dealers will replace the bolts, nuts, rear suspension arms, and rear suspension member sub assembly, free of charge. The recall is expected to begin during June 2015. Owners may contact Scion customer service at 1-866-707-2466.

**15V-228**

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING APRIL 2015**

*Published May 27, 2015*

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain model year 2015 Volkswagen Golf, GTI, and Audi A3 vehicles. Improper nickel plating of components within the fuel pump may result in the fuel pump failing. If the fuel pump fails, the vehicle will not start, or if the engine is running, it will stop and the vehicle will stall, increasing the risk of a crash. Volkswagen will notify owners, and dealers will inspect the vehicles and replace any affected fuel pumps, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Volkswagen at 1-800-893-5298 or Audi at 1-800-253-2834.

**15V-229**

Honda (American Honda Motor Co.) is recalling certain model year 2014 Honda CBR1000S motorcycles manufactured December 9, 2013, to March 28, 2014, and 2015 Honda CBR1000S motorcycles manufactured October 20, 2014, to February 27, 2015. The affected motorcycles may have been built with an improperly manufactured rear shock absorber. The nut on the damper rod for these shock absorbers may loosen, resulting in a loss of damping and the possible disassembling of the shock. If the damper rod nut loosens, shock absorber performance would be affected, possibly causing a loss of vehicle control and increasing the risk of a crash. Honda will notify owners, and dealers will remove the shock assembly and send it to the supplier's service center for repair. Once repaired, the supplier's service center will ship the shock assembly back to the dealer and the dealership will reinstall the shock on the motorcycle. This work will be performed free of charge. The recall began on May 8, 2015. Owners may contact Honda customer service at 1-866-784-1870. Honda's number for this recall is JQ3.

**15V-230**

Forest River, Inc. (Forest River) is recalling certain model year 2016 Amera-Lite ATTX and WATTX, Forest River Cherokee, Cherokee Grey Wolf, Cherokee Wolf Pup, Salem, Salem Laminated, Salem Limited Edition, Vengeance, Wildwood, Wildwood Laminated, and Wildwood Limited Edition, Cargo Mate Blazer, E Series, E Series Wedge, Eliminator, and Qualifier, Continental Cargo Auto Master, Elite Series, Tailwind and Value Hauler, Coachmen Catalina and Freedom Express, Palomino Puma and US Cargo Patriot X, Phantom, Trail & Sport and Trail Master trailers manufactured March 1, 2015, to March 31, 2015. In the affected trailers, the studs that are used to attach the wheels to the axle hubs may break. If the wheel studs break, the wheel could detach from the vehicle, increasing the risk of a crash. Forest River will notify owners, and dealers will replace any affected wheel hub, free of charge. The recall is expected to begin in May 2015. Owners may contact Forest River customer service at 1-800-453-6064. Forest River's number for this recall is 51-03312015-0025.

**15V-231**

Mitsubishi Motors North America, Inc. (Mitsubishi) is recalling certain model year 2009-2010 Mitsubishi Lancer vehicles manufactured January 12, 2009, to July 6, 2010, 2009-2010 Outlander vehicles manufactured January 12, 2009, to August 27, 2010, 2010 Lancer Sportback vehicles manufactured June 17, 2009, to June 8, 2010, and 2010 Lancer Evolution vehicles manufactured July 14, 2009, to August 4, 2010. The affected vehicles have an electronic control unit (ECU) that controls the head lights, tail lights, and windshield wipers. Due to a manufacturing error, the voltage inside this ECU may be unstable. Unstable voltage could result in intermittent failure of the vehicle's head lights, tail lights, and windshield wipers. If the headlights and/or windshield wipers fail, the driver could have reduced visibility. If the tail lights fail, the vehicle could be less visible. Either condition increases the risk of a crash. Mitsubishi will notify owners, and dealers will replace the affected ECU, free of

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING APRIL 2015**

*Published May 27, 2015*

charge. The manufacturer has not yet provided a notification schedule. Owners may contact Mitsubishi customer service at 1-888-648-7820. Mitsubishi's number for this recall is SR-15-002.

**15V-232**

Mitsubishi Motors North America, Inc. (Mitsubishi) is recalling certain model year 2009-2011 Lancer vehicles manufactured March 16, 2009, to March 30, 2011, 2010-2011 Lancer Sportback vehicles manufactured June 17, 2009, to December 1, 2010, 2010-2011 Lancer Evolution vehicles manufactured July 14, 2009, to January 7, 2011, 2009-2011 Outlander vehicles manufactured February 10, 2009, to June 22, 2011, and 2011 Outlander Sport vehicles manufactured August 26, 2010, to November 19, 2010. In the affected vehicles, the blower motor may fail. Failure of the blower motor may reduce the performance of the windshield defroster, diminishing the driver's visibility and increasing the risk of a crash. Mitsubishi will notify owners, and dealers will replace a suspect blower motor, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Mitsubishi customer service at 1-888-648-7820. Mitsubishi's number for this recall is SR-15-003.

**15V-233**

Cruiser RV (Cruiser) is recalling certain model year 2015 Viewfinder recreational trailers manufactured September 4, 2014, to March 30, 2015. In the affected vehicles, the liquid propane (LP) compartment in the slide room is not properly sealed to the interior of the trailer. If a leak occurs in the LP compartment, propane gas could dissipate into the interior of the trailer. A propane gas leak into the interior of the trailer increases the risk of a fire in the presence of an ignition source. Cruiser will notify owners, and dealers will modify the recreational trailer so that the LP compartment is sealed from the passenger area, free of charge. The recall began on May 14, 2015. Owners may contact Cruiser customer service at 1-866-277-5630. Cruiser's number for this recall is 11041R.

**15V-234**

Starcraft RV (Starcraft) is recalling certain model year 2016 Autumn Ridge 284, 285, 288, 28D, and 28G trailers manufactured March 23, 2015, to April 2, 2015. In the affected trailers, the studs that are used to attach the wheels to the axle hubs may break. If the wheel studs break, the wheel could detach from the vehicle, increasing the risk of a crash. Starcraft will notify owners, and dealers will replace any affected wheel hub, free of charge. Owners may contact Starcraft customer service at 1-800-945-4787. Starcraft's numbers for this recall are 9902237 and 9902238.

**15V-235**

Southeast Toyota Distributors, LLC (SET) is recalling certain model year 2015 Sienna vehicles manufactured September 1, 2014, to April 13, 2015 and equipped with overhead entertainment accessories installed by SET. During reassembly of the interior after the overhead entertainment system installation, a trim panel securing clip may have been reused instead of being replaced. If the clip was damaged during the entertainment system installation, in the event of a side curtain air bag deployment, the trim panel may detach and strike one of the vehicle occupants, increasing the risk of injury. SET will notify owners, and dealers will replace the trim panel securing clip, free of charge. The recall began on May 22, 2015. Owners may contact SET customer service at 1-866-405-4226. SET's number for this recall is SET15B.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING APRIL 2015**

*Published May 27, 2015*

**15V-236**

Forest River, Inc. (Forest River) is recalling certain model year 2015-2016 Coachmen Freelanders vehicles manufactured February 14, 2014, to April 1, 2015, and 2015 Coachmen Leprechaun vehicles manufactured on June 10, 2014. The affected vehicles, manufactured on a Ford 158" wheelbase chassis with a 5.4L V-8 engine, may have a Federal Certification label that lists an incorrect gross vehicle weight rating (GVWR), gross axle weight rating (GAWR) and wrong cargo carrying capacity information. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." With incorrect GVWR, GAWR, and cargo carrying capacity information, the operator may overload the trailer, increasing the risk of a crash. Forest River will notify owners and will provide replacement labels with the corrected information, free of charge. The recall is expected to begin in May 2015. Owners may contact Coachmen customer service at 1-800-453-6064. Forest River's number for this recall is 51-04172015-0031.

**15V-237**

Highland Ridge RV (Highland) is recalling certain model year 2016 Open Range Mesa Ridge, Light, and Roamer travel trailers and fifth wheels, models 16LF, 16MF, 16RF, 16LT, 16MR, and 16RT, manufactured March 18, 2015, to April 6, 2015. In the affected trailers, the studs that are used to attach the wheels to the axle hubs may break. If the wheel studs break, the wheel could detach from the vehicle, increasing the risk of a crash. Highland will notify owners, and dealers will replace any affected wheel hub, free of charge. Owners may contact Highland customer service at 1-260-768-7771. Highland's numbers for this recall are 9904237 and 9904238.

**15V-238**

Polaris Industries, Inc. (Polaris) is recalling certain model year 2009-2010 GEM eLXD L09GVHA4X and L10GVHA4X hybrid electric vehicles manufactured November 25, 2008, to December 30, 2010. The affected vehicles have frame welds between the cab and cargo bed that may crack. If the frame welds crack, the frame may fall and contact the pavement, stopping the vehicle suddenly and increasing the risk of a crash. Polaris will notify owners, and dealers will repair the vehicles free of charge. The recall is expected to begin in May 2015. Owners may contact Polaris customer service at 1-888-704-5290.

**15V-239**

Gulf States Toyota, Inc. (GST) is recalling certain model year 2015 Toyota Sienna vehicles manufactured January 23, 2015, to April 13, 2015, and equipped with non-Toyota-brand overhead entertainment accessories installed by GST. During reassembly of the interior after the overhead entertainment system installation, a trim panel securing clip may have been reused instead of being replaced. If the clip was damaged during the entertainment system installation, in the event of a side curtain air bag deployment, the trim panel may detach and strike one of the vehicle occupants, increasing the risk of injury. GST will notify owners, and dealers will replace the trim panel securing clip, free of charge. The recall is expected to begin June 8, 2015. Owners may contact GST customer service at 1-800-444-1074. GST's number for this recall is 15R1.

**15V-240**

Navistar, Inc. (Navistar) is recalling certain model year 2011-2015 International DuraStar, ProStar, TranStar and WorkStar, 2012-2015 International TerraStar, 2013-2015 International LoneStar and IC Bus HC, and

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING APRIL 2015**

*Published May 27, 2015*

2014-2015 IC Bus AC vehicles. A vehicle double battery jump start or electrical load dump event could result in an overvoltage condition of a component within the HVAC system linear power module (LPM) which is used to control the blower speed. The overvoltage condition could result in the overheating and failure of the LPM. If the LPM overheats and fails, there is an increased risk of a fire. Navistar will notify owners, and dealers will replace the LPM with an upgraded one, free of charge. The recall is expected to begin June 22, 2015. Owners may contact Navistar customer service at 1-800-448-7825. Navistar's number for this recall is 15509.

**15V-241**

Navistar, Inc. (Navistar) is recalling certain model year 2014-2015 IC Bus AE school buses manufactured February 14, 2013, to March 10, 2014. A vehicle double battery jump start or electrical load dump event could result in an overvoltage condition of a component within the HVAC system linear power module (LPM) which is used to control the blower speed. The overvoltage condition could result in the overheating and failure of the LPM. If the LPM overheats and fails, there is an increased risk of a fire. Navistar will notify owners, and dealers will replace the LPM with an upgraded one, free of charge. The recall is expected to begin June 22, 2015. Owners may contact Navistar customer service at 1-800-448-7825. Navistar's number for this recall is 15510.

**15V-242**

Capacity of Texas (Capacity) is recalling certain model year 2013-2015 ISB13 Yard Tractors manufactured January 3, 2013, to April 22, 2015. The affected vehicles were manufactured without a dimmer switch to control the backlighting illumination on the dashboard. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 101, "Controls and displays." If the driver can not adjust the amount of dash illumination, the driver may not be able to easily see the dash controls. This distraction may increase the risk of a crash. Capacity will notify owners, and fleets will install a switch with dimming capability, free of charge. The recall is expected to begin in May 2015. Owners may contact Capacity customer service at 1-800-323-0135.

**15V-243**

Jet Company, In. (Jet Co) is recalling certain model year 2011-2012 38, 40, and 42-foot Aluminum Grain Trailers, manufactured January 22, 2010 through November 30, 2011 and equipped with a 6061-T6 aluminum extrusion 2x5 top tube. The top rail on the sides of the trailer may be too weak to prevent the trailer from buckling. If the trailer buckles, a loss of control may result, increasing the risk of a crash. Jet Co will notify owners, and dealers will measure the strength of the top rail, adding an aluminum reinforcement, as necessary, free of charge. The recall began on May 19, 2015. Owners may contact Jet Co. customer service at 1-515-332-3117. Note: This recall is an expansion of 13V-582.

**15V-244**

General Motors LLC (GM) is recalling certain model year 2013 Chevrolet Malibu vehicles manufactured April 10, 2012, to August 2, 2012. In the affected vehicles, the console transmission gear selection indicator may not illuminate the shift position selected. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 102, "Transmission Shift Position Sequence, Starter Interlock, and Transmission Braking Effect." If the console shift indicator does not illuminate the transmission gear selection, a driver could inadvertently select a transmission position other than the position the driver intended,

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING APRIL 2015**

*Published May 27, 2015*

increasing the risk of a crash. GM has notified owners, and dealers will replace the transmission gear selection control module, free of charge. The recall began on April 20, 2015. Owners may contact Chevrolet customer service at 1-800-222-1020. GM's number for this recall is 12162.

**15V-245**

Ford Motor Company (Ford) notified the agency on April 23, 2015, that they are recalling certain model year 2013-2014 Ford Fusion and Lincoln MKZ vehicles manufactured July 1, 2012, to May 31, 2013, and 2012-2014 Fiesta vehicles manufactured February 1, 2012, to May 31, 2013. On April 30, 2015, Ford expanded the recall to cover an additional 119,567 vehicles, including certain model year 2011 Ford Fiestas manufactured from November 11, 2009, to May 31, 2013 and certain model year 2013 Ford Fusion and Lincoln MKZ vehicles manufactured from February 1, 2012, to June 30, 2012. A component within the door latches may break making the doors difficult to latch and/or leading the driver or a passenger to believe a door is securely closed when, in fact, it is not. A door that is not securely latched could open while the vehicle is in motion, increasing the risk of injury to a vehicle occupant. Ford will notify owners, and dealers will replace all four door latches with an improved part, free of charge. The recall is expected to begin June 1, 2015. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 15S16.

**15V-246**

Spartan Motors, Inc. (Spartan) is recalling certain model year 2012-2015 Utilimaster Walk-in vans and truck body vehicles manufactured January 21, 2014, to March 12, 2015. The affected vehicles are equipped with a back up camera system which may display images from the camera in reverse. If an object or person are on the left side of the screen but are actually on the right side of the vehicle, or vice versa, there is an increased risk of a crash. Spartan will notify owners, and dealers will inspect the vehicles and replace any camera that is not displaying the correct images. The manufacturer has not yet provided a notification schedule. Owners may contact Spartan customer service at 1-800-582-3454.

**15V-247**

Ford Motor Company (Ford) is recalling certain model year 2015 Lincoln MKZ vehicles manufactured February 17, 2014, to March 19, 2015, and equipped with daytime running lights (DRL). In the affected vehicles, the parking lights do not reduce their light output from a DRL level when used in conjunction with the headlights. As such, the light output may exceed the the permissible amount allowed by Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." If the light output is excessive, oncoming traffic may be temporarily blinded, increasing the risk of a crash. Ford has notified owners, and dealers will update the lighting control software, free of charge. The recall began on May 8, 2015. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for the recall is 15C02.

**15V-248**

Spartan Motors, Inc. (Spartan) is recalling certain model year 2014 Utilimaster Walk-In Vans manufactured December 8, 2014, to January 23, 2015, and altered by Lippert Components. Due to inadequately torqued fasteners, the driveshaft may disconnect. If the driveshaft disconnects there would be a loss of power delivery to the rear axle, increasing the risk of a crash. Spartan will notify owners, and dealers will inspect the torque of the driveshaft fasteners, tightening them as necessary, free of charge. The manufacturer has not yet provided a

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING APRIL 2015**

*Published May 27, 2015*

notification schedule. Owners may contact Spartan customer service at 1-800-582-3484.

**15V-249**

Ford Motor Company (Ford) is recalling certain model year 2013-2015 Ford Fusion and Lincoln MKZ vehicles manufactured February 3, 2012, to March 20, 2015, and 2015 Ford Edge vehicles manufactured February 26, 2015, to February 28, 2015, and originally sold, or currently registered in, Connecticut, Delaware, Illinois, Indiana, Iowa, Maine, Maryland, Massachusetts, Michigan, Minnesota, Missouri, New Hampshire, New Jersey, New York, Ohio, Pennsylvania, Rhode Island, Vermont, West Virginia, Wisconsin and the District of Columbia.

In the affected vehicles, snow or water containing road salt or other contaminants may corrode the electric power steering gear motor attachment bolts. If the bolts corrode, the steering gear motor may detach from the gear housing resulting in a loss of power steering assist. Loss of power steering assist would require a higher steering effort, especially at lower speeds, which may increase the risk of a crash. Ford will notify owners, and dealers will apply sealer and replace the steering gear motor bolts as required. If one or more of the steering gear motor attachment bolts are broken or missing, a new steering gear will be installed in the vehicle. These repairs will be performed free of charge. The recall is expected to begin June 22, 2015. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 15S14.

**15V-250**

Ford Motor Company (Ford) is recalling certain model year 2015 Ford F-150 vehicles manufactured January 30, 2015, to January 31, 2015. The affected vehicles may have loose or missing underbody heat shields. A missing underbody heat shield can lead to degradation or melting of the fuel or vapor lines, increasing the risk of a fire. Ford will notify owners, and dealers will inspect the vehicle for missing underbody heat shields and fasteners, and will install the missing components as required, free of charge. The recall began on May 13, 2015. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 15S12.

**15V-251**

Mastercraft Boat Company Inc (Mastercraft) is recalling certain model year 2015 boat trailers manufactured April 1, 2014, to March 11, 2015. The trailer tongue bolt may fail allowing the trailer swing tongue to disengage from the tow ball of the vehicle. If the trailer tongue disconnects from the tow vehicle, there is an increased risk of a crash. Mastercraft will notify owners, and dealers will replace the swing tongue bolt and hardware, as necessary, free of charge. The recall began on May 11, 2015. Owners may contact Mastercraft customer service at 1-423-884-2221. Mastercraft's numbers for this recall are RC-01 and RC-02.

**15V-253**

Navistar, Inc. (Navistar) is recalling certain model year 2016 International PayStar trucks manufactured January 19, 2015, to January 20, 2015, and 2016 International WorkStar trucks manufactured on January 19, 2015. The affected vehicles are equipped with Meritor MT-40-14X rear drive axles that may circulate an inadequate amount of lubricant to the wheel end hub assembly. Without adequate lubrication to the wheel end hub assembly, the bearings may fail prematurely, increasing the risk of a crash. Navistar has already repaired the affected vehicles, free of charge. The recall was completed in April 2015. Owners may contact Navistar customer service at 1-800-448-7825.

**15V-254**

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING APRIL 2015**

*Published May 27, 2015*

Triumph Motorcycles America, LTD (Triumph) is recalling certain model year 2014-2015 Daytona 675 R and Speed Triple R motorcycles manufactured January 1, 2014, to April 1, 2015. The affected motorcycles may have been built with an improperly manufactured rear shock absorber. The nut on the damper rod for these shock absorbers may loosen, resulting in a loss of damping and the possible disassembling of the shock. If the damper rod nut loosens, shock absorber performance would be affected, possibly causing a loss of vehicle control and increasing the risk of a crash. Triumph will notify owners, and dealers will replace the rear shock absorber, free of charge. The recall is expected to begin during May 2015. Owners may contact Triumph customer service at 1-678-854-2010. Triumph's number for this recall is SB524.

**15V-255**

Lakota Corporation (Lakota) is recalling one model year 2016 Lakota Charger C39 trailer manufactured on March 24, 2015. In the affected trailer, the studs that are used to attach the wheels to the axle hubs may break. If the wheel studs break, the wheel could detach from the trailer, increasing the risk of a crash. Lakota has notified the owner, and a dealer will replace any affected wheel hub, free of charge. Owners may contact Lakota customer service at 1-574-848-1636. Lakota's number for this recall is 160230.

**15V-256**