

**Part 573 Safety Recall Report****15V-260****Manufacturer Name :** Eldorado National- California, Inc.**Submission Date :** MAY 01,2015**NHTSA Recall No. :** 15V-260**Manufacturer Recall No. :** NR**Manufacturer Information :**

Manufacturer Name : Eldorado National- California, Inc.

Address : 9670 GALENA STREET

RIVERSIDE CA 92509

Company phone : 909-591-9557

**Population :**

Number of potentially involved : 117

Estimated percentage with defect : 35

**Vehicle Information :**

Vehicle : 2012-2014 Eldorado National CA Passport HD

Vehicle Type : BUSES, MEDIUM &amp; HEAVY VEHICLES

Body Style : OTHER

Power Train : DIESEL

Descriptive Information : Low floor cutaway bus built on a Navistar IC chassis with MAXXFORCE VII engines

Production Dates : MAY 01, 2012 - JUN 30, 2014

**VIN (Vehicle Identification Number) Range**

Begin : NR

End : NR

 Not sequential VINs**Description of Defect :**

Description of the Defect : Cable running from starter to alternator can potentially chafe on an auxillary air conditioning compressor bracket installed by Eldorado National California.

Description of the Safety Risk : Wires may short out and potentially cause a fire.

Description of the Cause : NR

Identification of Any Warning that can Occur : NR

**Supplier Identification :****Component Manufacturer**

Name : NR

Address : NR

FOREIGN STATES

Country : NR

**Chronology :**

EIDorado National was notified by a customer of a fire in one of the described buses on March 17, 2015. A second incident occurred on April 22, 2015 at which time EIDorado National sent a representative to the customer to investigate the incident and discovered that the source was located near the installed A/C compressor bracket. Further inspection revealed that there was excessive wear on the insulation on the wiring near the compressor bracket. On May 1, 2015 EIDorado determined that there was safety related defect.

**Description of Remedy :**

Description of Remedy Program : EIDorado National has identified a remedy that involves inspecting and replacing and protecting the wire(s) that are located near the compressor bracket.

How Remedy Component Differs from Recalled Component : NR

Identify How/When Recall Condition was Corrected in Production : Production ended on this configuration in June 2014.

**Recall Schedule :**

Description of Recall Schedule : NR

Planned Dealer Notification Date : MAY 15, 2015 - JUN 05, 2015

Planned Owner Notification Date : MAY 15, 2015 - JUN 05, 2015

\* NR - Not Reported