

Bulletin

TIMKEN

Subject: PRODUCT RECALL

Bulletin: PB510072 - B150400123DX

Part Number: 510072

Concern: Timken is contacting our customers who may have purchased the double row wheel bearing (510072), which may be dimensionally incorrect.

The incorrect part has the number 510072 marked on the bearing as well as the manufacturing number - IJ121002, Country of Origin - Korea, and a batch code - JLHA. These parts are contained to this batch only, and would have been received between January 22, 2015 and April 20, 2015.



May 2015

CUSTOMER NOTIFICATION OF MARKING ERROR

⚠ WARNING Failure to observe the following warnings could create a risk of death or serious injury.


Do not install incorrectly marked bearings. Installation of an incorrectly marked bearing will adversely affect braking and steering of the vehicle.

Product:

The correct product specifications are as follows:

Significant Characteristics:

- Bore (d) - 42mm
- OD (D) - 78mm
- Width (C) - 45mm

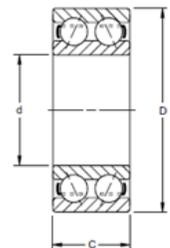

Action:

- Quarantine all of the 510072 product in your inventory. Contact your customers that may have purchased this product in the specified timeframe and direct them not to install it and to return it.
- Contact your Timken Customer Service Representative, they will provide an RGA to return all of this 510072 product.
- Timken will replace your inventory with the correct product, confirmed through our inspection process.