

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JUNE 2015**

*Published July 23, 2015*

**CHILD SEATS:**

None during June 2015.

**EQUIPMENT:**

The Timken Company (Timken) is recalling certain aftermarket front wheel bearings, part number 510072, sold from January 22, 2015, to May 21, 2015, to be used as service parts on 2001-2012 Ford Escape, 2001-2011 Mazda Tribute, and 2005-2011 Mercury Mariner vehicles. The affected wheel bearings have incorrect dimensions of a 42mm bore, 76mm outer dimension, and 39mm width, instead of a 42mm bore, 78mm outer dimension and a 45mm width. Use of an incorrectly sized wheel bearing can adversely affect the braking and steering of the vehicle, increasing the risk of a crash. Timken has begun notifying distributors who will offer purchasers replacement wheel bearings, free of charge. The recall began on May 21, 2015. Owners may contact Timken customer service at 1-866-984-6536.

**15E-045**

Strange Engineering, Inc. (Strange) is recalling certain Modified Street Axles, part numbers P3109F05, P3509F05, P3509F0558, P3509F0558S, and P3509F05S, manufactured December 8, 2011, to April 17, 2015. The affected drive axles were modified after being heated treated and, as a result, the axles may have reduced strength. The reduction in strength may result in premature axle failure, increasing the risk of a vehicle crash. Strange will notify owners, and repair shops will replace the axles and install new wheel bearings, sleeves, and seals, free of charge. The recall is expected to begin in July 2015. Owners may contact Strange customer service at 1-847-663-1701.

**15E-046**

ADVICS North America, Inc. (ADVICS) is recalling certain anti-lock brake system (ABS) Actuators manufactured December 4, 2014, to December 23, 2014. These ABS actuators may have contamination in the solenoid valves, potentially affecting the valves ability to completely close and allow a build up of hydraulic brake pressure, or fully open and allow the hydraulic brake pressure to completely drop. Under some driving conditions, when the ABS is activated, the malfunctioning ABS actuator could cause a loss of vehicle stability, increasing the risk of a crash. ADVICS has notified the affected vehicle manufacturers. The vehicle manufacturers will contact the vehicle owners, and their dealers will inspect and replace the ABS actuator, as necessary, free of charge.

**15E-047**

ZF Group North America Operations (ZF) is recalling certain Hub Carriers manufactured January 17, 2014, to June 1, 2015. Due to casting problems, the affected hub carriers may have areas of porosity which may result in the hub carrier leaking oil or cracking. Cracks in the hub may result in hub failure, which could cause a loss of vehicle control, increasing the risk of a crash. ZF has notified the affected bus manufacturers, and their dealers will begin a routine inspection process to identify any hub carrier leaks. When parts become available, the affected hub carriers will be replaced, free of charge. Owners may contact ZF customer service at 1-734-416-6200.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JUNE 2015**

*Published July 23, 2015*

**15E-048**

Yakima Products, Inc. (Yakima) is recalling certain Q-Tower Roof Racks, part numbers 8000124 and 8000135, manufactured January 26, 2015, to May 26, 2015, and Q-Tower Stripped Replacement towers, part number 8880048, manufactured April 1, 2015, to April 15, 2015. The affected roof racks have crossbar clamping wedges that may slide on the crossbars during the installation process, causing the rack to have a loose fit on the vehicle. A rack that does not snugly fit the roof may eject from the vehicle while it is in motion increasing the risk of a vehicle crash. Yakima will notify owners and will provide owners with proper crossbar clamping wedges, free of charge. The recall began on June 17, 2015. Owners may contact Yakima customer service at 1-888-266-3085 or email them at qtowerrecall@yakima.com.

**15E-049**

ASA Electronics, LLC. (ASA) is recalling certain Voyager rear cameras, model number VCMS140I, manufactured November 25, 2014, to April 14, 2015. The affected rear cameras may reverse the display image, possibly displaying images on the right that should appear on the left and vice versa. If the camera displays the image in reverse, the driver may inadvertently turn the wrong direction to avoid hitting an object behind the vehicle, increasing the risk of a crash. ASA will notify owners, and dealers will replace the rear camera, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact ASA customer service at 1-(877) 384-4400.

**15E-050**

Alcoa Inc. (Alcoa) is recalling certain 22.5" X 8.25" aluminum wheels, model number 88367X, manufactured from April 27, 2015, through May 19, 2015. Due to a forging problem, the wheel rim flange section may separate during the initial tire mounting and inflation process. Personal injury could occur if the flange separates during the initial tire mounting and inflation process. Alcoa will notify its original equipment manufacturers, fleets and distributor customers, and will inspect and replace as necessary, free of charge, that has not yet had a tire mounted and subjected to full operating inflation pressure. The recall is expected to begin in early July 2015. Owners may contact Alcoa customer service at 1-844-276-1567 or 88367Xquestions@alcoa.com.

**15E-051**

Performance Machine, Inc. (PM) is recalling certain Coastal Moto Phantom wheels manufactured January 1, 2010 to July 8, 2014. The affected five spoke motorcycle wheels, offered in Contrast Cut, Contrast Cut Platinum, and Chrome in thirteen sizes, have spokes that may crack. A cracked spoke may result in spoke failure and impair vehicle handling, increasing the risk of a crash. Performance Machine will notify owners and will replace the wheels, free of charge. The recall is expected to begin in July 2015. Owners may contact PM customer service at 1-800-479-4037.

**15E-052**

Suzuki Motor of America, Inc. (Suzuki) is recalling certain Accessory Backrest Mounting Hardware kits, part numbers 990A0-75148 and 990A0-75148-BLK, manufactured March 1, 2012, to April 21, 2015. The affected hardware kits are for installing accessory backrests on 2006-2015 Suzuki VZR1800 (Boulevard M109R) motorcycles. The mounting hardware kits may include four 110mm bolts instead of two 75mm bolts

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JUNE 2015**

*Published July 23, 2015*

and two 95mm bolts. If the backrest is installed with bolts that are too long, the mounting bolts may contact the rear tire, causing a loss of control and increasing the risk of a crash. Suzuki will notify owners, and dealers will correct the mounting hardware as needed, free of charge. The recall is expected to begin in July 2015. Owners may contact Suzuki customer service at 1-800-444-5077.

**15E-053**

Dannmar Equipment (Dannmar) is recalling certain MaxJax Portable Two-Post automatic car lift systems, part number 17152001, sold between September 2, 2014, to January 15, 2015. The affected car lifts may have lower carriage plates that may be insufficiently welded to the inside of the carriage. If the lower carriage plates are not properly welded, they may not be able to hold the rated weight while lifting a vehicle. As a result, the lift arms may snap and the vehicle could fall from the lift, increasing the risk of personal injury. Dannmar has begun notifying owners and will supply owners with replacement carriages, free of charge. The recall began March 18, 2015. Owners may contact Dannmar customer service at 1-877-432-6627.

**15E-054**

**TIRES:**

None during June 2015.

**VEHICLES:**

Oshkosh Corporation (Oshkosh) is recalling certain model year 2012-2014 S-Series Front Discharge Concrete Mixer vehicles manufactured February 29, 2012, to November 13, 2013, and equipped with certain Cummins Westport ISL G engines. Excessive engine crankcase pressures may cause the 90-degree elbow of the vent tube assembly to detach from the crankcase ventilation breather, possibly allowing engine oil to come into contact with hot surfaces. If engine oil comes into contact with a hot surface, there is an increased risk of a fire. Cummins will notify owners on behalf of Oshkosh, and dealers will secure the ends of the 90-degree elbow. In addition, the electronic control module (ECM) will be reprogrammed with software that can adjust the engine output under misfire conditions to limit crankcase pressures. These repairs will be performed free of charge. The recall began on June 12, 2015. Owners may contact Oshkosh customer service at 1-888-686-7278 or Cummins customer service at 1-800-343-7357.

**15V-330**

Van Hool N.V. (Van Hool) is recalling certain model year 2014 C2045, 2014-2015 CX45, TD925, TX40, TX45, and 2015 TDX25 coaches. The affected vehicles have a left front steering knuckle carrier that may break. If the front steering knuckle carrier breaks, the coach wheel may separate from the vehicle, increasing the risk of a crash. ABC Bus will notify owners on behalf of Van Hool, and dealers will inspect and replace the affected steering knuckles, as necessary, free of charge. The recall began on July 6, 2015. Owners may contact ABC Bus at 1-877-427-7278. Van Hool's number for this recall is P750.

**15V-331**

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JUNE 2015**

*Published July 23, 2015*

New Flyer Industries Ltd. (New Flyer) is recalling certain model year 2013 C40LFR, XE40, XN35, and XN60, 2014 XD35, XDE40, and XT60, 2014-2015 XD60, and XT40, 2013-2014 XDE35, and XN40, and 2015 XDE60 transit buses. These vehicles have door controller assemblies that may have a software defect which can cause the rear passenger doors to open, without warning, when the bus accelerates from a stopped position. If the rear bus door opens while the bus is in motion, there is an increased risk of injury for the passengers. New Flyer will notify owners, and dealers will update the Door Controller Assembly software, free of charge. The recall began on June 24, 2015. Owners may contact New Flyer customer service at 1-204-224-6706. New Flyer's number for this recall is R15-006.

**15V-333**

Accubuilt, Inc. (Accubuilt) is recalling certain model year 1998-2005 Lincoln Town Car 120" Limousines manufactured January 2, 1998, to July 21, 2005 by DaBryan Coachbuilders. In certain situations, such as when overloaded or in the event of rear suspension failure, the driveshaft may rub against the vehicle body, below the rear seating area. The rubbing driveshaft may generate significant heat, increasing the risk of a fire. The remedy for this recall is still under development. Owners were mailed interim notifications on July 15, 2015. Owners will receive a second notice when a remedy is available. Owners may contact Accubuilt customer service at 1-419-222-1501.

**15V-334**

Porsche Cars North America, Inc. (Porsche) is recalling certain model year 2015 918 Spyder vehicles manufactured February 25, 2014, to April 29, 2015. In the affected vehicles, the wiring harness for the left rear radiator fan may contact an engine heat insulation plate. If the harness contacts the insulation plate, the harness may chafe and result in an electrical short which could increase the risk of a fire. Porsche will notify owners, and dealers will inspect the wiring harness and secure it to a coolant tube using a tie-wrap clip, free of charge. The recall is expected to begin in July 2015. Owners may contact Porsche customer service at 1-800-767-7243. Porsche's number for this recall is AF05. Note: The wiring harness could short and result in a fire even when the vehicle is unattended. As a precaution, owners are advised to park outside until the remedy has been made.

**15V-335**

Airstream, Inc. (Airstream) is recalling certain model year 2015-2016 Airstream Interstate NCV3 B motorhomes manufactured August 1, 2014, to May 18, 2015. In the affected vehicles, if the screen door is in the closed position and the vehicle's curbside sliding door is closed, the motorhome occupants may not be able to move the screen door in order to open the sliding door to exit the vehicle. If occupants are unable to open the sliding door and exit the vehicle in the event of an emergency, they would be at an increased risk of injury. Airstream will notify owners, and dealers will attach a stop on the screen door to keep the sliding door from shutting if the screen door is closed, free of charge. The recall began on June 29, 2015. Owners may contact Airstream customer service at 1-937-596-6111 extension 7401 or 7411.

**15V-336**

Mitsubishi Motors North America, Inc. (MMNA) is recalling certain model year 2006-2009 Eclipse vehicles manufactured April 20, 2005, to February 13, 2009, and 2007-2009 Eclipse Spyder vehicles manufactured December 23, 2005, to February 13, 2009. Due to corrosion inside the anti-lock brake system (ABS) unit,

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JUNE 2015**

*Published July 23, 2015*

one or more of the internal valves may seize. In a braking event that uses the ABS, a seized valve would increase brake pedal travel and reduce braking ability. A sudden reduction of braking performance may increase the risk of a crash. MMNA will notify owners, and dealers will inspect, flush and clean the ABS hydraulic unit using high grade brake fluid, free of charge. If the inspection shows that the valves may seize, the ABS unit will be replaced. The recall is expected to begin during July 2015. Owners may contact MMNA customer service at 1-888-648-7820. MMNA's number for this recall is SR-15-004.

**15V-337**

Mitsubishi Motors North America, Inc. (MMNA) is recalling certain model year 2000-2005 Eclipse vehicles manufactured April 5, 1999, to December 17, 2004, 2001-2005 Eclipse Spyder vehicles manufactured January 19, 2000, to March 18, 2005, 2001-2005 Chrysler Sebring vehicles manufactured April 17, 2000, to February 21, 2005, and 2001-2005 Dodge Stratus vehicles manufactured April 17, 2000, to February 22, 2005. In the affected vehicles, the passenger side sun visor may be folded down in such a position that, if the passenger frontal air bag deploys, the passenger side sun visor may detach. If the passenger side sun visor detaches and is propelled rearward, there is an increased risk of occupant injury. MMNA will notify their owners, and Chrysler will notify the Chrysler and Dodge owners. Dealers will install a tether strap to retain the passenger sun visor, free of charge. The recall is expected to begin during July 2015. Owners may contact MMNA customer service at 1-888-648-7820. MMNA's number for this recall is SR-15-005. Chrysler and Dodge owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is R30.

**15V-338**

Ford Motor Company (Ford) is recalling certain model year 2015 Ford Mustang vehicles manufactured February 14, 2014, to February 10, 2015, and equipped with 2.3L engines. Prolonged exposure to elevated underbody temperatures can cause degradation of the fuel tank and/or fuel vapor lines, which may eventually result in a fuel leak. In addition, this condition could cause seals in the parking brake cable to degrade, potentially affecting parking brake function. If the vehicle experiences a fuel leak in the presence of an ignition source it can, increase the risk of a vehicle fire. Reduced parking brake function could potentially result in unexpected vehicle movement, which may increase the risk of injury. Ford will notify owners, and dealers will replace the fuel tank shield, add thermal patches to the fuel tank and parking brake cable, and add thermal wraps to the fuel vapor lines. The repairs will be performed free of charge. The recall began on July 9, 2015. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 15S19.

**15V-339**

Ford Motor Company (Ford) is recalling certain model year 2011-2012 Ford Fusion vehicles without a 3.5L engine and Lincoln MKZ hybrid electric vehicles, 2011 Mercury Milan vehicles, 2011-2012 Ford Taurus, Ford Flex, Lincoln MKS, and Lincoln MKT vehicles equipped with a 3.5L GTDI engine and 2013 Ford Taurus, Ford Flex, Lincoln MKS, and Lincoln MKT vehicles equipped with any available engine. The affected vehicles have electric power steering assist systems that may shut down as a result of a steering motor sensor fault. If the vehicle experiences a loss of power steering assist, extra steering effort will be required at lower speeds, increasing the risk of a vehicle crash. Ford will notify owners, and dealers will check the Power Steering Control Module (PSCM) for Diagnostic Trouble Codes (DTC). If dealers find any loss of steering assist DTCs, the steering gear will be replaced, free of charge. If, no codes are found during the PSCM inspection, the PSCM

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JUNE 2015**

*Published July 23, 2015*

software will be updated, free of charge. The recall is expected to begin during July 2015. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 15S18.

**15V-340**

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain model year 2015 Lexus NX200t vehicles manufactured December 18, 2014, to February 2, 2015. These vehicles are equipped with an Anti-Lock Braking System (ABS), Traction Control System (TRAC), and Vehicle Stability Control System (VSC) which are controlled by an ABS actuator. A component inside the actuator may have been damaged during its assembly and may cause the actuator to not function properly. Under some driving conditions, when the ABS is activated, the malfunctioning ABS actuator could cause a loss of vehicle stability, increasing the risk of a crash. Toyota will notify owners, and dealers will inspect and replace the ABS actuator, as necessary, free of charge. The recall began on July 21, 2015. Owners may contact Toyota customer service at 1-800-331-4331.

**15V-341**

Volvo Cars of N.A., LLC (Volvo) is recalling certain model year 2016 Volvo XC90 vehicles manufactured January 27, 2015, to May 19, 2015. The affected vehicles have front seats whose wiring harness for the Side Impact Protection System (SIPS) may have been routed incorrectly. If the wiring harness is routed incorrectly, the wiring may be damaged, disabling the front seat side impact air bag, and increasing the risk of injury to the seat occupant in the event of a crash necessitating deployment of the front seat side impact air bag. Volvo will notify owners, and dealers will inspect the routing of the SIPS wiring, correcting the routing and installing a protective sleeve as necessary, free of charge. The recall began on June 30, 2015. Owners may contact Volvo customer service at 1-800-458-1552. Volvo's number for this recall is R89571.

**15V-342**

Daimler Trucks North America LLC (DTNA) is recalling certain model year 2007-2016 Freightliner 114SD and M2 Business Class trucks, 2008-2009 Sterling LT8500 trucks and Thomas Built Bus Saf-T-Liner HDX transit buses equipped with certain Cummins Westport ISL G engines. Excessive engine crankcase pressures may cause the 90-degree elbow of the vent tube assembly to detach from the crankcase ventilation breather, possibly allowing engine oil to come into contact with hot surfaces. If engine oil comes into contact with a hot surface, there is an increased risk of a fire. Cummins will notify owners on behalf of DTNA, and dealers will secure the ends of the 90-degree elbow. In addition, the electronic control module (ECM) will be reprogrammed with software that can adjust the engine output under misfire conditions to limit crankcase pressures. These repairs will be performed free of charge. The recall is expected to begin on July 27, 2015. Owners may contact DTNA customer service at 1-800-745-8000 or Cummins customer service at 1-800-343-7357. DTNA's number for this recall is FL-681.

**15V-343**

Daimler Trucks North America LLC (DTNA) is recalling certain model year 2008-2015 Thomas Built Buses Saf-T-Liner HDX school buses manufactured May 25, 2008, to December 18, 2014, and equipped with certain Cummins Westport ISL G engines. Excessive engine crankcase pressures may cause the 90-degree elbow of the vent tube assembly to detach from the crankcase ventilation breather, possibly allowing engine oil to come into contact with hot surfaces. If engine oil comes into contact with a hot surface, there is an increased risk of a

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JUNE 2015**

*Published July 23, 2015*

fire. Cummins will notify owners on behalf of DTNA, and dealers secure the ends of the 90-degree elbow. In addition, the electronic control module (ECM) will be reprogrammed with software that can adjust the engine output under misfire conditions to limit crankcase pressures. These repairs will be performed free of charge. The recall began on June 12, 2015. Owners may contact DTNA customer service at 1-800-745-8000, or Cummins customer service at 1-800-343-7357. DTNA's number for this recall is FL-681.

**15V-344**

Mazda North American Operations (Mazda) is recalling certain model year 2003-2008 Mazda6 vehicles manufactured May 29, 2002, to May 5, 2008, 2004-2008 RX-8 vehicles manufactured April 10, 2003, to February 18, 2008, and 2006-2007 Mazdaspeed6 vehicles manufactured August 4, 2005, to June 29, 2007. The affected vehicles are equipped with a dual-stage driver frontal air bag that may be susceptible to moisture intrusion and other factors, including manufacturing variability that, over time, could cause the inflator to rupture. In the event of a crash necessitating deployment of the driver's frontal air bag, the inflator could rupture with metal fragments striking the driver or other occupants resulting in serious injury or death. Mazda will notify owners, and dealers will replace the driver's frontal air bag inflator, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Mazda customer service at 1-800-222-5500. Mazda's number for this recall is 7914J. Note: This recall supersedes recall 14V344 in its entirety. Additionally, vehicles that have had their driver's frontal air bag replaced previously as part of a recall remedy need to have their air bag replaced under this recall as well.

**15V-345**

Mazda North American Operations (Mazda) is recalling certain model year 2004-2006 Mazda B-series light trucks manufactured from April 17, 2003, through May 2, 2006. The affected vehicles are equipped with a passenger side frontal air bag that may be susceptible to moisture intrusion which, over time, could cause the inflator to rupture upon deployment. In the event of a crash necessitating deployment of the passenger's frontal air bag, the inflator could rupture with metal fragments striking the vehicle occupants, potentially resulting in serious injury or death. Mazda will notify owners, and dealers will replace the the passenger side frontal air bag inflator, free of charge. The recall is expected to begin by the end of July 2015. Owners may contact Mazda at 1-800-222-5500. Mazda's number for this recall is 8315F. Note: This recall expands and partially supersedes recall 14V773 as to the model year 2004 through 2006 Mazda B-series vehicles only.

**15V-346**

Prevost Cars, Inc. (Prevost) is recalling certain model year 2015 X3-45, and H3-45 coaches manufactured October 1, 2014, to April 30, 2015. Bolts in the front suspensions of the affected coaches may fail due to a problem with the bolt manufacturing process. Suspension bolt failure may cause a loss of vehicle control, increasing the risk of a vehicle crash. Prevost will notify owners, and dealers will replace the affected bolts, free of charge. The recall is expected to begin on, or about, July 24, 2015. Owners may contact Prevost customer service at 1-800-463-7738. Prevost's number for this recall is SR15-29.

**15V-347**

Prevost Cars, Inc. (Prevost) is recalling certain model year 2010-2014 X3-45, XLII-45, H3-41, and H3-45 coaches manufactured November 30, 2009, to August 12, 2014. In the affected vehicles, the wires for the

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JUNE 2015**

*Published July 23, 2015*

Automatic Fire Suppression System (AFSS) Linear Thermal Detector (LTD) may be damaged by temperatures in the engine compartment. The damaged wires may activate the AFSS and shutdown the engine, increasing the risk of a vehicle crash. Prevest will notify owners, and dealers will relocate the AFSS LTD wiring, free of charge. The recall began on July 17, 2015. Owners may contact Prevest customer service at 1-800-463-7738. Prevest's number for this recall is SR15-30.

**15V-348**

Prevest Cars, Inc. (Prevest) is recalling certain model year 2006-2010 X3-45 coaches manufactured January 11, 2006, to April 12, 2010. The affected vehicles have booster stud connections that may rust. As they rust, the stud may weaken and break, allowing the power cable to ground against the vehicle frame. If the power cable electrically shorts against the frame, there would be an increased risk of a fire. Prevest will notify owners, and dealers will install a protective box over the connection to prevent the power cable from contacting the frame if it comes loose. Any cable that is corroded will be replaced, free of charge. The recall is expected to begin July 24, 2015. Owners may contact Prevest customer service at 1-800-463-7738. Prevest's number for this recall is SR15-27.

**15V-349**

Nova Bus is recalling certain model year 2001-2004 LFS buses manufactured January 1, 2001, to December 31, 2004. The affected vehicles have certain air hoses that may have been incorrectly connected to the R14 valve, causing a delay when applying the parking brake. A delay in the application of the parking brake may result in the bus rolling forward or rearward a few feet, increasing the risk of a crash. Nova Bus is confirming that all buses were inspected and repaired. Nova Bus will notify the owner of any unremedied bus and dealers will correct the hose connection, free of charge. Owners may contact Nova Bus customer service at 1-450-472-6410. Nova Bus' number for this recall is CR3405.

**15V-350**

Mercedes-Benz USA, LLC (Mercedes) is recalling certain model year 2015 E250 BlueTec vehicles manufactured November 3, 2014, to December 15, 2014, E250 BlueTec 4Matic vehicles manufactured November 4, 2014, December 17, 2014, GLK250 vehicles manufactured November 13, 2014, to January 30, 2015, and 2015 ML250 BlueTec vehicles manufactured December 12, 2014, to February 9, 2015. In the affected vehicles, oil may leak from around the chain tensioner gasket area. Leaking oil may drip onto a hot engine surface, increasing the risk of a fire. Additionally, the leaking oil may be a road hazard for other vehicles, increasing the risk of a crash. Mercedes will notify owners, and dealers will replace the chain tensioner gasket, free of charge. The recall is expected to begin in July 2015. Owners may contact Mercedes customer service at 1-800-367-6372. Mercedes' number for this recall is 2015050005. Note: This is an expansion of NHTSA recall 14V-762.

**15V-351**

Fontaine Trailer Company (Fontaine) is recalling certain model year 2016 Revolution flat deck platform and step deck platform semi-trailers manufactured April 20, 2015, to May 13, 2015. In the affected trailers, the hardened washers used in the bolted connections that secure the upper coupler, landing gear and suspensions to the trailer sub-frame may crack. Failure of the washers can cause the bolted joints to loosen, causing

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JUNE 2015**

*Published July 23, 2015*

detachment of the trailer's structural components, increasing the risk of a crash. Fontaine will notify owners, and dealers will replace the affected washers as well as the nuts and bolts used in the connections, free of charge. The recall is expected to begin in July 2015. Owners may contact Fontaine customer service at 1-205-485-1300.

**15V-352**

Terex South Dakota, Inc. (Terex) is recalling certain model year 2002 Hi-Ranger XT55 and XT60 trucks manufactured June 21, 2002, to December 31, 2002. The affected trucks may have been built with lower booms made of material that does not meet the strength specifications necessary. Booms made from weaker materials than required may crack and fail, increasing the risk of injury to the boom operator or those nearby. Terex will notify owners, and dealers will inspect the lower boom to verify that it was made with the correct material. Any boom that was made with an improper material will be replaced, free of charge. The recall began on July 13, 2015. Owners may contact Terex customer service at 1-800-982-8975.

**15V-353**

Daimler Vans USA, LLC (DVUSA) is recalling certain model year 2007-2008 Freightliner Sprinter 2500 and 3500, and 2007-2008 Dodge Sprinter 2500 and 3500 vehicles manufactured July 1, 2005, to July 31, 2008. The affected vehicles are equipped with a passenger side frontal air bag that may be susceptible to moisture intrusion which, over time, could cause the inflator to rupture upon its deployment. In the event of a crash necessitating deployment of the front passenger's frontal air bag, the inflator could rupture with metal fragments striking the passenger seat occupant or other occupants possibly causing serious injury or death. Daimler Vans USA will notify the Freightliner owners and Fiat Chrysler will notify the Dodge owners. Dealers will replace the passenger air bag inflator, free of charge. The manufacturer has not yet provided a notification schedule. Freightliner owners may contact DVUSA customer service at 1-877-762-8267. Dodge owners may contact Fiat Chrysler customer service at 1-800-853-1403.

**15V-354**

Vermeer Manufacturing Company (Vermeer) is recalling certain model year 2015 TLR30HD trailers manufactured April 21, 2015, to May 15, 2015, and 2015 TLR30LD trailers manufactured April 17, 2015, and May 14, 2015. The affected trailers may have an incorrectly installed safety chain. If the trailer hitch becomes unhooked from the tow vehicle, the safety chain will not prevent the trailer from completely separating from the tow vehicle, increasing the risk of a crash. Vermeer will notify owners and dealers will install a field repair kit. The recall began on July 14, 2015. Owners may contact Vermeer customer service at 1-800-829-0051 or by email at [productsafety@vermeer.com](mailto:productsafety@vermeer.com). Vermeer's number for this campaign is IK3175.

**15V-355**

Gulf Stream Coach, Inc. (Gulf Stream) is recalling certain model year 2015 Canyon Trail and Sedona trailers manufactured April 3, 2014, to September 30, 2014. In the affected vehicles, a rivet for the quad entry steps may shear and fail, causing the steps to give when being used. If the rivet shears causing the quad step to fail, the step user may fall, increasing the risk of personal injury. Gulf Stream will notify owners, and dealers will remove the rivets and the step sections will be bolted together, free of charge. The recall began on June 30, 2015. Owners may contact Gulf Stream customer service at 1-800-289-8787. Gulf Stream's number for this recall is

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JUNE 2015**

*Published July 23, 2015*

HS060215.

**15V-356**

Kalmar Solutions, LLC (Kalmar) is recalling certain model year 2010-2014 Ottawa tractors manufactured December 6, 2010, to July 21, 2014, equipped with certain Cummins Westport ISL G engines. Excessive engine crankcase pressures may cause the 90-degree elbow of the vent tube assembly to detach from the crankcase ventilation breather, possibly allowing engine oil to come into contact with hot surfaces. If engine oil comes into contact with a hot surface, there is an increased risk of a fire. Cummins will notify owners on behalf of Kalmar, and dealers will secure the ends of the 90-degree elbow. In addition, the electronic control module (ECM) will be reprogrammed with software that can adjust the engine output under misfire conditions to limit crankcase pressures. These repairs will be performed free of charge. The recall began on June 12, 2015. Owners may contact Kalmar customer service at 1-785-229-6327 or Cummins customer service at 1-800-343-7357.

**15V-357**

General Motors LLC (GM) is recalling certain model year 2015 Cadillac ATS and CTS vehicles. The affected vehicles have a bracket between the brake pedal assembly and the rod that actuates the brakes that may fracture during normal brake pedal operation. If the bracket fractures, the driver would not be able to apply the brakes, increasing the risk of a crash. GM will notify owners, and dealers will inspect the vehicle and replace any affected bracket, free of charge. The recall began July 6, 2015. Owners may contact Cadillac customer service at 1-800-458-8006. GM's number for this recall is 15352.

**15V-358**

Forest River, Inc. (Forest River) is recalling certain model year 2016 Evo, Salem, Sandstorm, Shockwave, Stealth, Wildwood, Cherokee Grey Wolf, Wildcat Maxx, Vibe, R-Pod, and Surveyor trailers. In the affected trailers, the studs that are used to attach the wheels to the axle hubs may break. If the wheel studs break, the wheel could detach from the vehicle, increasing the risk of a crash. Forest River will notify owners, and dealers will inspect and replace any affected wheel hub, free of charge. The recall is expected to begin August 1, 2015. Owners may contact Forest River customer service at 1-909-873-3777. Forest River's number for this recall is 51-05142015-0037.

**15V-359**

Kia Motors America (Kia) is recalling certain model year 2011 Sportage vehicles manufactured March 7, 2011, to June 8, 2011. In the affected vehicles, the brake light switch may intermittently fail. Whenever the brake switch is not working, the brake lights will not illuminate, reducing the ability to warn other motorists of the driver's intentions of stopping, increasing the risk of a crash. Kia will notify owners, and dealers will replace the brake light switch, free of charge. The recall began on July 7, 2015. Owners may contact Kia customer service at 1-800-333-4542. Kia's number for this recall is SC121.

**15V-360**

Daimler Trucks North America LLC (DTNA) is recalling certain model year 2008-2009 Sterling Bullet 4500 and 5500 trucks manufactured October 15, 2007, to November 10, 2008. The affected vehicles are equipped

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JUNE 2015**

*Published July 23, 2015*

with a dual-stage driver frontal air bag that may be susceptible to moisture intrusion which, over time, could cause the inflator to rupture. In the event of a crash necessitating deployment of the driver's frontal air bag, the inflator could rupture with metal fragments striking and potentially seriously injuring the driver or other occupants. DTNA will notify owners, and dealers will replace the driver's frontal air bag, free of charge. Interim notices were sent to owners on July 16, 2015. Owners will receive a second notice when remedy parts become available. Owners may contact DTNA customer service at 1-800-745-8000. DTNA's number for this recall is FL-684.

**15V-361**

Silver Eagle Manufacturing Company (Silver Eagle) is recalling certain model year 2014-2015 VAST-20N, VAST-20W, and CTL-40W Converter Dollies manufactured February 6, 2014, to March 4, 2015. Due to a problem with the brake valve, the affected dollies may experience brake drag. If the brakes drag on the converter dolly, the wheel end may overheat, increasing the risk of a fire. Silver Eagle will notify owners, and dealers will replace the brake valve, free of charge. The recall is expected to begin in July 2015. Owners may contact Silver Eagle customer service at 1-800-547-6792.

**15V-362**

Winnebago Industries, Inc. (Winnebago) is recalling certain model year 2014-2015 Metro Link transit buses manufactured December 20, 2013, to April 9, 2015. The affected buses may have been built without shims and flat washers on the seat pedestal, allowing the seat to detach from the floor in the event of a crash. If the seat detaches from the floor during a vehicle crash, the seat occupant would be at an increased risk of personal injury. Winnebago will work with Metro Worldwide, the transit bus distributor, to notify owners and remedy the vehicles, free of charge. The recall is expected to begin in July 2015. Owners may contact Metro Worldwide customer service at 1-641-903-7377. Winnebago's number for this recall is 132.

**15V-363**

Nissan North America, Inc. (Nissan) is recalling certain model year 2015 Murano vehicles manufactured December 4, 2014, to March 17, 2015. These vehicles are equipped with Anti-Lock Braking System (ABS) actuators which may have contamination in the solenoid valves, potentially affecting the valves' ability to completely close and allow a build up of hydraulic brake pressure, or fully open and allow the hydraulic brake pressure to completely drop. Under some driving conditions, when the ABS is activated, the malfunctioning ABS actuator could cause a loss of vehicle stability, increasing the risk of a crash. Nissan will notify owners, and dealers will inspect and replace the ABS actuator, as necessary, free of charge. The recall is expected to begin by early August 2015. Owners may contact Nissan customer service at 1-800-647-7261.

**15V-364**

Rush Truck Centers of Texas, LP (Rush), doing business as Custom Vehicle Solutions, is recalling certain modified 2011-2016 Peterbilt 337 trucks manufactured March 26, 2010, to March 9, 2015, modified 2013-2015 Peterbilt 348 trucks manufactured May 14, 2012, to March 25, 2014, and modified 2014 Peterbilt 382 trucks manufactured on November 1, 2013. The affected trucks, converted from conventional day cabs to crew cabs, may be equipped with seat belt anchorage assemblies that may come unanchored when under load. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS)

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JUNE 2015**

*Published July 23, 2015*

number 210, "Seat Belt Assembly Anchorages." If the seat belt anchor pulls away, the seat occupant may not be properly secured in the event of a crash, increasing the risk of occupant injury. Rush will notify owners, and dealers will repair the vehicles free of charge. The recall began on July 16, 2015. Owners may contact Rush customer service at 1-713-766-3007.

**15V-365**

Subaru of America, Inc. (Subaru) is recalling certain model year 2015 Legacy vehicles manufactured March 10, 2014, to April 16, 2015, Outback vehicles manufactured February 24, 2014, to April 16, 2015, Impreza vehicles manufactured September 9, 2014, to April 14, 2015, XV Crosstrek vehicles manufactured October 16, 2014, to April 15, 2015, and 2016 WRX vehicles manufactured March 23, 2015, and equipped with the Eyesight Driver Assist System. If the switch that activates the brake lights fails, the automatic pre-collision braking component of the driver assist system will not function. If the automatic pre-collision braking system does not function as intended, the vehicle will not react to an obstacle in its path, increasing the risk of a crash. Subaru will notify owners, and dealers will reprogram the driver assist system, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Subaru customer service at 1-800-782-2783. Subaru's number for this recall is WQS-54.

**15V-366**

Nissan North America, Inc. (Nissan) is recalling certain model year 2015 Rogue Select vehicles manufactured November 17, 2014, to December 12, 2014 and equipped with seventeen-inch wheels. The affected vehicles have incorrect tire size information on the tire labels. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 110, "Tire Selection and Rims and Motor Home/Recreation Vehicle Trailer Load Carrying Capacity Information for Motor Vehicles with a GVWR of 4,536 kilograms (10,000 pounds) or less." The labels list the incorrect tire size. Installing tires of the incorrect size may increase the risk of a crash. Nissan will notify owners, and will send them new labels with the corrected information, free of charge. The recall is expected to begin by early August 2015. Owners may contact Nissan customer service at 1-800-647-7261.

**15V-368**

Forest River, Inc. (Forest River) is recalling certain model year 2015 Shasta Airflyte SAT16 and SAT19 recreational travel trailers manufactured September 15, 2014, to October 22, 2014. The affected trailers have a Federal Certification Label that incorrectly lists the tire size, gross axle weight rating (GAWR), gross vehicle weight rating (GVWR) and cargo carrying capacity. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." If the operator overloads the trailer due to the incorrect information on the Certification label, the tires may fail suddenly, increasing the risk of a crash. Forest River will notify owners, and dealers will install a corrected label, free of charge. The recall is expected to begin in July 2015. Owners may contact Forest River customer service at 1-574-825-8717. Forest River's number for this recall is 54-06052015-0047.

**15V-369**

Honda (American Honda Motor Co.) is recalling certain model year 2003-2007 Honda Accord vehicles manufactured August 16, 2002, to August 28, 2007 and equipped with a four cylinder engine, and 2001-2005

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JUNE 2015**

*Published July 23, 2015*

Honda Civic vehicles manufactured April 25, 2000, to September 2, 2005. The affected vehicles have a passenger side frontal air bag that may be susceptible to moisture intrusion which, over time, could cause the inflator to rupture upon its deployment. In the event of a crash necessitating deployment of the passenger's frontal air bag, the inflator could rupture with metal fragments striking the passenger seat occupant or other occupants possibly causing serious injury or death. Honda will notify owners, and dealers will replace the passenger air bag inflator, free of charge. The recall is expected to begin July 13, 2015. Owners may contact Honda customer service at 1-888-234-2138. Honda's numbers for this recall are JS1 and JS2. Note: Vehicles that have already received a replacement passenger air bag inflator as part of the recall remedy for an earlier campaign such as 13V132, 14V349, 14V353 or 14V700 (Honda recall numbers S95, JH6, JH7, JH8, JH9, JJ0, JJ1, JJ2, JJ6, JM5 and JM6) are not included in this recall.

**15V-370**

HME, Inc. is recalling certain emergency vehicles manufactured January 1, 2014, to March 31, 2015 and built on a model year 2014-2015 Ford F-550 chassis. The affected vehicles may detect an incorrect Exhaust Gas Temperature Sensor (EGT) fault indicating that the vehicle is too hot, causing the engine management system to shut down the engine and prevent its immediate restart. Engine shut down and a subsequent cool down period may delay medical treatment or assistance to those needing it, increasing their risk of injury. HME will notify owners, and dealers will update the Powertrain Control Module (PCM) software, free of charge. The recall began on July 7, 2015. Owners may contact HME customer service at 1-616-261-2636.

**15V-371**

Braun Corporation (Braun) is recalling certain model year 2013-2015 Braun-modified Chrysler and Dodge vehicles manufactured December 19, 2012, to May 5, 2015. The affected vehicles have certification labels that may have incorrect gross vehicle weight rating (GVWR) information, and front and rear gross axle weight rating (GAWR) information printed on the Certification labels. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." If the operator loads the vehicle based on information on the Certification label, the operator may overload the vehicle, adversely affecting the vehicle handling and braking and increasing the risk of crash. Braun will notify owners, and dealers will install a corrected certification label, free of charge. The recall is expected to begin in August 2015. Owners may contact Braun customer service at 1-800-488-0359.

**15V-372**

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain model year 2015 Passat vehicles manufactured May 18, 2015, to May 21, 2015. The affected vehicles may have been manufactured with an improperly torqued brake line connection at the rear left wheelhouse. This can cause a brake fluid leak, causing the brake line to come loose reducing braking performance. If the brake line becomes loose, causing reduction in braking performance it can increase stopping distance, increasing the risk of vehicle crash. Volkswagen will notify owners, and dealers will correctly torque the brake line fitting to correct specification, free of charge. The recall began on June 11, 2015. Owners may contact Volkswagen customer service at 1-800-822-8987. Volkswagen's number for this recall is 47M3.

**15V-373**

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JUNE 2015**

*Published July 23, 2015*

New Horizons RV Corporation (New Horizons) is recalling certain model year 2013-2015 Summit and Majestic recreational vehicles manufactured March 11, 2013, to January 30, 2015. In the affected vehicles, a rivet for the quad entry steps may shear and fail, causing the steps to give when being used. If the rivet shears under occupant load, the steps may give and the occupant may fall, increasing the risk of personal injury. New Horizons will notify owners, and dealers will remove the rivets and the step sections will be bolted together, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact New Horizons customer service at 1-800-238-3140.

**15V-374**

Newmar Corporation (Newmar) is recalling certain model year 2015 Essex and King Aire vehicles manufactured March 26, 2014, to December 4, 2014. The affected vehicles have tag axle suspension hangers that may move, allowing the tag axle assembly to shift off center. If the tag axle moves off center, vehicle handling may suddenly be affected, increasing the risk of a crash. Newmar has notified owners, and dealers will weld the tag axle suspension hangers to the chassis frame, free of charge. The recall began on June 22, 2015. Owners may contact Newmar customer service at 1-800-731-8300.

**15V-375**

EverGreen Recreational Vehicles, LLC (EverGreen) is recalling certain model year 2015 i-Go, Ever-Lite, Sun Valley and Ascend travel trailers manufactured March 12, 2015, to May 29, 2015. In the affected trailers, the studs that are used to attach the wheels to the axle hubs may break. If the wheel studs break, the wheel could detach from the vehicle, increasing the risk of a crash. EverGreen will notify owners, and dealers will replace any affected wheel hub, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact EverGreen customer service at 1-574-825-4298.

**15V-376**

EverGreen Recreational Vehicles, LLC (EverGreen) is recalling certain model year 2014-2016 Lifestyle, Bay Hill, Alpha Gold and Tesla fifth wheel recreational trailers manufactured March 11, 2014, to January 23, 2015. In the affected vehicles, a rivet for the quad entry steps may shear and fail, causing the steps to give when being used. If the rivet shears under occupant load, the steps may give and the occupant may fall, increasing the risk of personal injury. Evergreen will notify owners, and dealers will remove the rivets and the step sections will be bolted together, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact EverGreen customer service at 1-574-825-4298.

**15V-377**

Great Dane Trailers (Great Dane) is recalling certain model year 2015 Converter Dolly trailers manufactured February 18, 2014, October 27, 2014. Due to a problem with the brake valve, the affected dollies may experience brake drag. If the brakes drag on the converter dolly, the wheel end may overheat, resulting in a fire. Also, the wheel may detach. Either condition increases the risk of a crash. Great Dane will notify owners, and dealers will replace the affected brake valves, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Great Dane customer service at 1-877-369-3493.

**15V-378**

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JUNE 2015**

*Published July 23, 2015*

Vactor Manufacturing (Vactor) is recalling certain model year 2014-2015 Vactor HXX PD, HXX Fan, HXX Prodigy, and 2100 Plus, and Guzzler Guzzcavator trucks manufactured January 10, 2014, to June 2, 2015. The affected vacuum trucks have boilers that may have been assembled with incorrect hardware and/or improper tightening procedures. If the boiler assembly was not correctly mounted, the cabinet and boiler may detach from the truck, increasing the risk of a crash. Vactor will notify owners and dealers will inspect and repair the units, as needed, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Vactor customer service at 1-877-342-5374.

**15V-379**

Elgin Sweeper Company Inc. (Elgin) is recalling certain model year 2009-2015 Megawind MX vehicles manufactured January 1, 2009, to February 4, 2015. The affected street sweepers have boom mounting pins that may lose their retaining pins, allowing the mounting pins to move out of position and the boom to move. If the mounting pin moves out of position, the boom may detach from the truck, increasing the risk of crash or personal injury. Elgin will notify owners, and dealers will inspect and replace the mounting pins and retainers with a revised mounting pin, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Elgin customer service at 1-877-342-5374.

**15V-380**

Heartland Recreational Vehicles, LLC (Heartland) is recalling certain model year 2016 Torque T27, T28, T29, and T33 travel trailers manufactured May 11, 2015, to May 29, 2015. The affected trailers have Federal Certification labels that may be missing the gross axle weight rating (GAWR) information. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." The vehicle operator may unintentionally overload the trailer due to the missing GAWR information, increasing the risk of a vehicle crash. Heartland will notify owners, and dealers will replace the incorrect certification label with a corrected label, free of charge. The recall is expected to begin in July 2015. Owners may contact Heartland customer service at 1-877-262-8032. Heartland's number for this recall is 99.01.22.

**15V-381**

Mazda North American Operations (Mazda) is recalling certain model year 2003-2008 Mazda6 vehicles manufactured May 29, 2002, to May 5, 2008, 2004-2008 RX-8 vehicles manufactured April 10, 2003, to February 18, 2008, and 2006-2007 Mazdaspeed6 vehicles manufactured August 4, 2005, to June 29, 2007. The affected vehicles are equipped with a dual-stage driver frontal air bag that may be susceptible to moisture intrusion and other factors, including manufacturing variability that, over time, could cause the inflator to rupture. In the event of a crash necessitating deployment of the driver's frontal air bag, the inflator could rupture with metal fragments striking the driver or other occupants resulting in serious injury or death. Mazda will notify owners, and dealers will replace the driver's frontal air bag inflator, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Mazda customer service at 1-800-222-5500. Mazda's number for this recall is 8215F. Note: The remedy for this recall is not yet available. In the meantime, Mazda will install a new production air bag inflator in these same vehicles under safety recall 15V-345. The interim-remedy air bag inflator will be of the same specification as the original air bag inflator to reduce the amount of time that the air bag inflator has been exposed to humidity. However, the interim air bag inflator does not eliminate the long-term potential for rupture and will only be installed as a stop-gap measure until the newly

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JUNE 2015**

*Published July 23, 2015*

designed air bag inflators can be produced. Owners need to have their vehicle remedied under recall 15V-345 as soon as possible and, when the new air bag inflators are available, have their vehicles remedied again under this recall.

**15V-382**

Daimler Trucks North America, LLC (DTNA) is recalling certain model year 2015 Western Star 4700, 4800 and 4900 trucks manufactured November 15, 2014, to January 30, 2015. In the affected vehicles, the speedometer may not operate properly, possibly not displaying the vehicle's speed. If the speedometer does not show the vehicle speed, the driver may unknowingly exceed the posted speed limit, increasing the risk of a crash. DTNA will notify owners, and dealers will install a new speedometer, free of charge. The recall is expected to begin August 7, 2015. Owners may contact DTNA customer service at 1-800-745-8000. DTNA's number for this recall is FL-683.

**15V-383**

Transportation Collaborative, Inc. (TCI) is recalling certain model year 2012-2015 Trans Tech Bus Student Safety Transporter school buses manufactured December 1, 2012, to April 23, 2015. The affected vehicles were built to accommodate 35 children or 23 adults. However, when the bus is loaded to this capacity, the load may exceed the rated capacity of the rear axle and tires. If the vehicle is loaded to the listed capacity, the rear axle or tires may fail, increasing the risk of a crash. TCI will notify owners, and dealers will remove two seats, and install a corrected capacity label, free of charge. The recall began on July 1, 2015. Owners may contact TCI customer service at 1-845-988-0419.

**15V-384**

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain model year 2013-2016 Range Rover vehicles manufactured July 26, 2012, to March 9, 2015, and 2014-2016 Range Rover Sport vehicles manufactured February 18, 2013, to March 5, 2015. In the affected vehicles, the doors may unlatch unexpectedly when closed. If a vehicle door unlatches, the distraction may increase the risk of a crash and/or a vehicle occupant may fall out of the vehicle if they are not wearing a seatbelt, increasing their risk of injury. Land Rover will notify owners, and dealers will update the keyless entry software, free of charge. The recall is expected to begin August 7, 2015. Owners may contact Land Rover customer service at 1-800-637-6837. Land Rover's number for this recall is P068.

**15V-385**

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain model year 2012-2013 Land Rover LR4 vehicles manufactured August 15, 2012, to September 18, 2012. Due to the use of an incorrect primer, the panoramic roof adhesive may not adequately secure the roof assembly. The insufficient bond may result in the panoramic roof assembly detaching from the vehicle, increasing the risk of a crash. Land Rover will notify owners, and dealers will apply the correct primer, free of charge. The recall is expected to begin August 7, 2015. Owners may contact Land Rover customer service at 1-800-637-6837. Land Rover's number for this recall is P065.

**15V-386**

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JUNE 2015**

*Published July 23, 2015*

Spartan Motors, Inc. (Spartan) is recalling certain model year 2015-2016 K2, K3 and MM chassis manufactured October 2, 2013, to April 2, 2015. In the affected vehicles, the fasteners that attach the stay rod (v-rod) to the rear drive axle may not have been installed with thread locker or tightened in the correct sequence. If the fasteners come loose, the stay rod may disconnect from the rear axle, resulting in a loss of control, increasing the risk of a crash. Spartan will notify owners, and dealers will replace the fasteners using thread lock, tightening them in the proper sequence and with the required torque values, free of charge. The recall is expected to begin in August 2015. Owners may contact Spartan customer service at 1-800-582-3454. Spartan's number for this recall is 15010.

**15V-388**

Motor Coach Industries (MCI) is recalling certain model year 2014 D4500 vehicles manufactured December 19, 2013, to April 14, 2014, 2013-2014 D4505 vehicles manufactured February 1, 2013, to April 22, 2014, and 2013-2015 J4500 vehicles manufactured November 26, 2013, to May 22, 2015. The affected motorcoaches are equipped with hub carriers that may have areas of porosity which could result in the hub carrier leaking oil or cracking. Cracks in the hub may result in hub failure, which could cause a loss of vehicle control, increasing the risk of a crash. MCI will notify owners, and dealers will begin a routine inspection process to identify any hub carrier leaks. When parts become available, the affected hub carriers will be replaced, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact MCI customer service at 1-800-241-2947. MCI's number for this recall is SB 425.

**15V-389**

Forest River, Inc. (Forest River) is recalling certain model year 2013 XLR and Vengeance, 2010 Sandpiper, 2004 Auto Plus, 2008 Cargo Mate and 2015-2016 Hydra-Lift trailers. In the affected trailers, the studs that are used to attach the wheels to the axle hubs may break. If the wheel studs break, the wheel could detach from the vehicle, increasing the risk of a crash. Forest River will notify owners, and dealers will replace any affected wheel hub, free of charge. The recall is expected to begin in August 2015. Owners may contact Forest River customer service at 1-574-534-3167. Forest River's number for this recall is 51-05282015-0042.

**15V-390**

Champion Bus, Inc. (Champion) is recalling certain model year 2013-2015 American Crusader, American Coach, Challenger, Crusader, CTS-FE, CTS-RE, Defender, EZ Trans, HCAC, HC, DFUC, LF Transport, Premier, and Spirit transit buses manufactured March 1, 2013, to June 12, 2015. In the affected vehicles, the passenger seat belts may rub against the metal seat frame and fray. As a result, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 209, "Seat Belt Assemblies." A frayed seat belt may fail to properly restrain the seat occupant in the event of a crash, increasing the risk of injury. Champion will notify owners, and dealers will install a plastic sleeve over the metal seat frame, and replace any seat belts that show evidence of fraying, free of charge. The recall is expected to begin in July 2015. Owners may contact Champion customer service at 1-810-724-1753 extension 562.

**15V-391**

Chrysler (FCA US LLC) is recalling certain model year 2014-2015 Jeep Cherokee vehicles manufactured January 4, 2013, to February 18, 2015 and equipped with a Power Liftgate option. In the affected vehicles,

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JUNE 2015**

*Published July 23, 2015*

water may enter the Power Liftgate Control Module and cause a high resistance short circuit in the module. A short circuit in the liftgate control module may result in a fire. Chrysler will notify owners, and dealers will inspect the power liftgate control module and connectors for corrosion, substitute a bolt for the threaded grommet installed to seal an attachment point used in non-power liftgate vehicles and cover the power liftgate control module in a foam water shield, free of charge. The manufacturer has not provided a recall schedule yet. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is R27.

**15V-393**

Navistar, Inc. (Navistar) is recalling certain model year 2010-2014 International Durastar trucks manufactured May 13, 2009, to June 24, 2013, 2011-2012 International Workstar trucks manufactured November 30, 2010, to September 26, 2011, and 2010-2014 IC Bus HC transit buses manufactured November 19, 2009, to April 24, 2013. The affected vehicles may have an improperly routed engine grid heater power feed cable which can result in the cable contacting the metal edge on the cab. If the cable contacts the metal edge of the cab, it may cause an electrical short, increasing the risk of a fire. Navistar will notify owners, and dealers will secure the power feed cable so that it cannot contact the cab, free of charge. The recall is expected to begin July 31, 2015. Owners may contact Navistar customer service at 1-800-448-7825. Navistar's number for this recall is 15514.

**15V-394**

Entegra Coach (Entegra) is recalling certain model year 2015 Aspire vehicles manufactured October 24, 2013, to February 11, 2015. In the affected vehicles, the fasteners that attach the stay rod (v-rod) to the rear drive axle may not have been installed with thread locker or tightened in the correct sequence. If the fasteners come loose, the stay rod may disconnect from the rear axle, resulting in a loss of control, increasing the risk of a crash. Entegra will notify owners, and dealers will replace the fasteners using thread lock, tightening them in the proper sequence and with the required torque values, free of charge. The recall is expected to begin July 17, 2015. Owners may contact Entegra customer service at 1-800-945-4787.

**15V-395**

Turtle Top is recalling certain model year 2006-2014 Odyssey, 2011 Odyssey LT, 2006-2012 Terra Transport, 2014 Terra Transport, and 2014 Van Terra vehicles built on a GM chassis with a 6.6L engine. The affected transit buses and MPV specialty vehicles are equipped with Trans-Air add-on compressor mount kits, part numbers 4012506-01, 4012506-02, 4013126-01, 4013126-02, 4013235-01, 4013235-02, 4012909, 4013125, 4013222 and 717173 installed by Trans-Air personnel. After installing the compressor, a power distribution terminal strip may not have been properly reconnected. If the power distribution terminal strip has a poor connection or a loose connection, the strip may arc or overheat, increasing the risk of a vehicle fire. Turtle Top will notify owners, and dealers will inspect the power distribution terminal strip connection, correcting it as necessary, free of charge. The recall is expected to begin in August 2015. Owners may contact Turtle Top customer service at 1-800-673-2446.

**15V-396**

Forest River, Inc. (Forest River) is recalling certain model year 2015 Dynamax Rev vehicles manufactured November 25, 2014, to November 26, 2014. The affected vehicles may have been manufactured with head restraints that exceed the maximum backset measurement limit of 55mm. As such, these vehicles fail to comply

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JUNE 2015**

*Published July 23, 2015*

with the requirements of the Federal Motor Vehicle Safety Standard number 202a, "Head Restraints." If the vehicle is struck from behind, the head restraint may not properly limit the seat occupant's head movement rearward, increasing the risk of injury. Forest River will notify owners, and Chrysler dealers will replace the front seat head restraints, free of charge. The recall began on July 8, 2015. Owners may contact Forest River customer service at 1-574-262-3474 ext. 212. Forest River's number for this recall is 55-06112015-0051.

**15V-397**

General Motors LLC (GM) is recalling certain model year 2011-2013 Chevrolet Caprice vehicles manufactured October 15, 2010, to October 22, 2013, and 2008-2009 Pontiac G8 vehicles manufactured July 25, 2007, to February 18, 2009. In the affected vehicles, the flexible steel cables that connect the seat belts to the vehicle at the outside of the driver seat and the front passenger seat may be bent from being sat on while entering the vehicle. This repeated bending may result in the cable breaking. If the cable breaks, the seat occupant may not be properly restrained in the event of a crash, increasing their risk of injury. GM will notify owners, and dealers will replace the seat belt tensioner assembly which includes the steel cable, free of charge. These replacement parts reposition the tensioner cable out of the path of entry into the vehicle and uses a more flexible cable, set at a more upright angle. The manufacturer has not yet provided a notification schedule. Owners may contact Chevrolet customer service at 1-800-222-1020 or Pontiac customer service at 1-800-762-2737. GM's number for this recall is 15206.

**15V-399**

Starcraft RV (Starcraft) is recalling certain model year 2014-2016 AR-ONE TT trailers and 2014-2016 Comet CT Hard Sided camping trailers, models 28V, 28P, 28R, 28S, 28V, 28W, BC, and BH, manufactured June 3, 2013, to February 6, 2015 and equipped with the Extreme Package Option. The affected trailers have Certification labels that incorrectly state a tire size of ST205/75R 14C when the actual tire size is LT235/75R 15C. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." If the operator installs the incorrect tires due to the information on the certification label, vehicle handling could be affected, increasing the risk of a crash. Starcraft will notify owners, and dealers will install a corrected label, free of charge. The recall began on July 17, 2015. Owners may contact Starcraft customer service at 1-800-945-4787. Starcraft's number for this recall is 9902240.

**15V-400**

Cruiser RV (Cruiser) is recalling certain model year 2016 Stryker travel trailers manufactured March 23, 2015, to April 20, 2015. In the affected trailers, the studs that are used to attach the wheels to the axle hubs may break. If the wheel studs break, the wheel could detach from the vehicle, increasing the risk of a crash. Cruiser will notify owners, and dealers will replace any affected wheel hub, free of charge. The recall began on July 14, 2015. Owners may contact Cruiser customer service at 1-866-277-5630. Cruiser's number for this recall is 11043R & 11044R.

**15V-401**

Ford Motor Company (Ford) is recalling certain model year 2015 Transit vehicles manufactured March 1, 2015, to April 10, 2015. The affected vehicles may have been built with seat belt assemblies that have seat belt labels that are missing the required belt model and model year and instead state "prototype sample." As such, these

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JUNE 2015**

*Published July 23, 2015*

vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) 209, "Seat Belt Assemblies." In the event of a safety issue with the affected seat belts, the vehicle owner may not be able to identify the seat belt if the seat belt label does not include a date of manufacturer. Ford has notified the one fleet owner affected, and a Ford representative will travel to the vehicle locations to install a new label that includes all of the required information. There will be no charge for this service. The recall began on June 12, 2015. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 15C05.

**15V-402**

Spartan Motors, Inc. (Spartan) is recalling certain model year 2010-2015 Furion, Gladiator, and Metrostar emergency response vehicles manufactured November 10, 2009, to June 16, 2015. In the affected vehicles, the engine cooling fan may crack and the fan blades may detach while the fan is spinning. If the cab is raised, such as during a repair, and the engine cooling fan is operating and comes apart, those in close proximity could be injured from the shattered parts. Spartan will notify the vehicle manufacturers that purchased the affected emergency vehicle chassis, and their dealers will install a new engine cooling fan, free of charge. The recall is expected to begin July 31, 2015. Owners may contact Spartan customer service at 1-517-543-6400. Spartan's number for this recall is 15011.

**15V-403**

Roadtrek Motorhomes Inc. (Roadtrek) is recalling certain model year 2014 CS Adventurous, E-Trek, RS Adventurous, SS Agile, and TS Adventurous vehicles manufactured from September 18, 2013, through April 9, 2015, and built on a Mercedes-Benz Sprinter Chassis. The affected vehicles have electrical wiring connections under the front seats that can become dislodged or damaged and prevent the optional front seat SH9 Thorax air bags from deploying. If the front thorax air bag fails to deploy in the event of a crash, the seat occupant has an increased risk of injury. Roadtrek will notify owners, and dealers will modify the electrical connections, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Roadtrek customer service at 1-888-762-3873.

**15V-404**

Shred-Tech Corporation (Shred-Tech) is recalling certain model year 2011-2013 MDS-20GT vehicles manufactured July 1, 2011, to March 1, 2013, 2010-2013 MDS-26GTX vehicles manufactured August 2, 2010, to March 1, 2013, 2013-2015 MDS 1/26 vehicles manufactured April 1, 2013, to May 1, 2015, and 2013-2015 MDS 2/26 vehicles manufactured March 1, 2015, to May 29, 2015. The affected vehicles were built on Hino 258LP and Freightliner M2 106 chassis and are equipped with EPA 2010 Emission Controls. With the EPA controls, the vehicles exceed the front axle Gross Axle Weight Rating (GAWR) specified on the certification label. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." If the axle weight on the certification label is exceeded, it can cause poor vehicle handling or front axle failure, increasing the risk of a vehicle crash. Shred-Tech will notify owners, and dealers will install a revised certification label on vehicles built on Freightliner M2 chassis increasing the GAWR to 9,000 pounds, and will modify the wheel base to redistribute the weight on vehicles built on Hino 258LP chassis, free of charge. The recall is expected to begin during July 2015. Owners may contact Shred-Tech customer service at 1-800-465-3214.

**15V-405**

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JUNE 2015**

*Published July 23, 2015*

Ford Motor Company (Ford) is recalling certain model year 2014-2015 Ford Escape vehicles manufactured May 19, 2014, to February 6, 2015, and Transit Connect vehicles manufactured May 11, 2014, to July 2, 2015. Due to a software incompatibility issue, the instrument panel cluster be inoperative including a blank multiple functional display (MFD), and non-functional warning chimes, messages and warning lights. Specific warning chimes, messages and warning lights. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 101, "Control and Displays." If the instrument cluster is inoperative, the driver of may not be warned of safety related issues such as low tire pressures or disabled air bags, increasing the risk of personal injury or a crash. Ford will notify owners, and dealers will update the instrument panel software, free of charge. The recall is expected to begin August 10, 2015. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 15C03.

**15V-406**

Chrysler (FCA US LLC) is recalling certain model year 2015 Jeep Grand Cherokee and Dodge Durango vehicles manufactured June 12, 2015, to June 20, 2015. Due to a manufacturing error, the affected vehicles have rear lower control arms that may fracture. If the rear lower control arm fractures, the vehicle may have a sudden change in ride height, rear end instability and/or reduced braking, increasing the risk of a crash. Chrysler will notify owners, and dealers will inspect the vehicles and replace any affected rear lower control arms, free of charge. The recall began on July 10, 2015. Owners may contact Chrysler customer service at 1-800-853-1403. Note: Owners are advised not to drive their vehicle until it has been inspected at the owner's location. Vehicles will be towed to dealers for repairs as necessary.

**15V-407**

Carson Trailer, Inc. (Carson) is recalling certain model year 2009-2012 Fun Runner trailers manufactured May 12, 2006, to June 7, 2012, and equipped with a Fastec-brand door lock. It may be possible to remove the key from the lock in a way that potentially jams the deadbolt. If the deadbolt jams, the interior side of the door lock may also jam. A person inside the travel trailer at the time will then be locked in and be unable to exit the vehicle without using the emergency exit, increasing the risk of injury. Carson will notify owners, and Fastec will coordinate the inspection and replacement of the cylinders, as needed, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Carson at 1-310-516-6046 or Fastec at 1-800-837-2505.

**15V-408**

Keystone RV Company (Keystone) is recalling certain model year 2013 Montana trailers, models 3100RL, 3150RL13, 3400RL, 3402RL, 3582RL, 3625RE, 3725RL, 3750FL and 3900FB, manufactured November 12, 2012, to January 30, 2013, and 2014 Mountaineer trailers, models 331RLT, 356TBF and 375FLF, manufactured August 21, 2013, to September 18, 2013. In all models except the Mountaineer 375FLF, the rear windows are labeled with an exit sticker, but the rear window is not intended to be a secondary emergency exit. With the Mountaineer 375FLF, the rear window is intended as the secondary emergency exit, but it may be blocked by the rear ladder. In the event of an emergency, occupants could try to escape through the rear window, but would not be able to. This delay in their escape may increase the risk of injury. Keystone has notified owners, and dealers will remove the emergency exit sticker from the windows that were not intended to be emergency exits. Mountaineer 375FLF vehicles will have the window replaced, so that egress section of the

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JUNE 2015**

*Published July 23, 2015*

window is on the opposite side of where the ladder is installed. These repairs will be performed free of charge. The recall began on July 9, 2015. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 15-232.

**15V-409**

Yamaha Motor Corporation, USA (Yamaha) is recalling certain model year 2008-2011 WR250X motorcycles manufactured June 1, 2008, to June 1, 2011 and 2008-2015 WR250R motorcycles manufactured June 1, 2008, to June 1, 2015. In the affected motorcycles, the insulation on the stator coil, a component of the alternator, may become damaged and short circuit to due insufficient heat resistance. If the stator coil is not insulated, the motorcycle will not charge and the battery will go dead, causing the engine to stall which increases the risk of a crash. Yamaha will notify owners, and dealers will replace the stator coil with one that has sufficient heat resistance, free of charge. The recall is expected to begin in July 2015. Owners may contact Yamaha customer service at 1-800-962-7926.

**15V-410**

Newmar Corporation (Newmar) is recalling certain model year 2015-2016 King Aire and Essex vehicles manufactured from March 13, 2014, and May 13, 2015, and model year 2016 Mountain Aire vehicles manufactured from March 17, 2015, through April 17, 2015. The affected vehicles, built on a Spartan Chassis, have fasteners that attach the stay rod (v-rod) to the rear drive axle that may not have been installed with thread locker or tightened in the correct sequence. If the fasteners loosen, the stay rod may disconnect from the rear axle, allowing the rear axle to move freely, increasing the risk of a vehicle crash. Spartan will notify owners on behalf of Newmar, and dealers will replace the fasteners using thread lock, tightening them in the proper sequence and with the required torque values, free of charge. The recall began on July 13, 2015. Owners may contact Newmar customer service at 1-800-731-8300 or Spartan customer service at 1-800-582-3454.

**15V-411**

Oshkosh Corporation (Oshkosh) is recalling certain model year 2015 S-Series Front Discharge concrete mixer glider trucks manufactured February 10, 2015, to March 20, 2015. The affected vehicles have Allison HD4500 transmissions that were remanufactured by Valley Truck Parts that may be coated with a thick layer of paint on the torque converter to adaptation kit mounting surface which can soften during vehicle operation. This may result in the mounting bolts loosening. If the mounting bolts loosen, the bolts on the torque converter bolt flange may shear, resulting in a sudden loss of drive power, and increasing the risk of a crash. Oshkosh has notified owners, and Valley Truck Parts will remove the paint from the mating surface of the torque converter, and replace the bolts, free of charge. The recall began on May 8, 2015. Owners may contact Oshkosh customer service at 1-888-686-7278.

**15V-412**

Goshen Coach (Goshen) is recalling certain model year 2013-2015 Pacer, Pacer LS, Pacer LTD, GCII, Impulse, Connection, Commander, G-Force, G-Force Access, G-Force LTD, Sentinel, Sentinel UC, and Mainstream Low Floor buses manufactured August 26, 2013, to June 18, 2015. In the affected vehicles, the passenger seat belts may rub against the metal seat frame and fray. As a result, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 209, "Seat Belt Assemblies." A

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JUNE 2015**

*Published July 23, 2015*

frayed seat belt fray may fail to properly restrain the seat occupant in the event of a crash, increasing the risk of injury. Goshen will notify owners, and dealers will install a plastic sleeve over the metal seat frame, and replace any seat belts that show evidence of fraying, free of charge. The recall is expected to begin in August 2015. Owners may contact Goshen customer service at 1-877-734-4943.

**15V-413**

Hyundai Motor America (Hyundai) is recalling certain model year 2015 Sonata vehicles manufactured April 25, 2014, to December 4, 2014. The affected vehicles have a front passenger seat belt whose buckle latch assembly may prevent the front passenger from fastening the seat belt. If the front passenger seat belt cannot be latched, an occupant sitting in the front passenger seat has an increased risk of injury in the event of a crash. Hyundai will notify owners, and dealers will repair or replace the front passenger seat belt buckle, free of charge. The recall is expected to begin August 21, 2015. Owners may contact Hyundai customer service at 1-855-671-3059. Hyundai's number for this recall is 130.

**15V-414**

General Motors LLC (GM) is recalling certain model year 2008-2012 Buick Enclave vehicles manufactured January 3, 2007, to February 29, 2012, 2009-2012 Chevrolet Traverse vehicles manufactured July 6, 2008, to February 29, 2012, 2007-2012 GMC Acadia vehicles manufactured September 15, 2006, to February 29, 2012, and 2007-2010 Saturn Outlook vehicles manufactured August 17, 2006, to March 18, 2010. The affected vehicles, equipped with the power liftgate option, have gas struts that hold the power liftgate up when open. These struts may prematurely wear and the open liftgate may suddenly fall. If the open liftgate unexpectedly falls, it may strike a person, increasing their risk of injury. GM will notify owners, and dealers will update the software for the power liftgate actuator motor control unit so that the motor will prevent the rapid closing of the lift gate, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Buick customer service at 1-800-521-7300, Chevrolet customer service at 1-800-222-1020, GMC customer service at 1-800-462-8782, and Saturn customer service at 1-800-553-6000. GM's number for this recall is 15240.

**15V-415**

General Motors LLC (GM) is recalling certain model year 2014-2015 Chevrolet Spark vehicles manufactured April 30, 2014, to May 20, 2015, and 2015 Chevrolet Sonic vehicles manufactured June 18, 2014, to June 10, 2015. In the affected vehicles, equipped with the base radio and OnStar, the radio may lock up due to a software issue, causing the display to go blank and all audio functions to cease. Because of this, there may be no warning chimes such as the reminder to buckle the seat belt and the key being left in ignition when the driver goes to exit the vehicle. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 208 "Occupant Crash Protection", and 114 "Theft Protection." Without audible indicators, the driver may leave the key in the ignition, increasing the risk of theft. If a driver or front passenger does not buckle their seat belt, there would be no chime to remind them to fasten their seat belts. If a driver or passenger does not buckle their seat belt there is an increased risk that they will be injured in a crash. GM will notify owners, and dealers will update the radio software, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Chevrolet customer service at 1-800-222-1020. GM's number for this recall is 15504.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JUNE 2015**

*Published July 23, 2015*

**15V-416**