


	GROUP Safety Recall Campaign	MODEL 2011MY Sportage (SL)
	NUMBER SC 121	DATE July 2015
VOLUNTARY SAFETY RECALL CAMPAIGN		
STOP LAMP SWITCH REPLACEMENT (SC121)		

This bulletin provides information relating to the replacement of the stop lamp switch of some 2011MY Sportage (SL) vehicles, produced from March 7, 2011 through June 8, 2011. The stop lamp switch may experience interruption in the electrical current flow in the switch contacts. This condition could potentially result in intermittent operation of the cruise control feature, the intermittent illumination of the ESC indicator lamp or interfere with brake light illumination. To correct this condition, and improve customer satisfaction, Kia is requesting the completion of this Safety Recall Campaign on all affected vehicles.

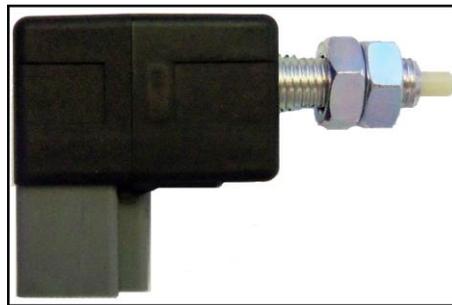

*** NOTICE**

There is no charge to the vehicle owner for this repair. Under applicable law, you may not sell or otherwise deliver any affected vehicle until it has been repaired pursuant to the procedures set forth in this bulletin.

*** NOTICE**

To improve customer satisfaction, always remember to refer to WebDCS Warranty Coverage (validation) Inquiry Screen (Service> Warranty Coverage> Warranty Coverage Inquiry) for a list of any additional campaigns or service actions that may need to be performed on the vehicle before returning it to the customer.

File Under: <Voluntary Safety Recall Campaign>



-
- Circulate To:** **General Manager** **Service Manager** **Parts Manager**
 Service Advisors **Technicians** **Body Shop Manager** **Fleet Repair**

Service Procedure:


1. Turn the ignition switch to the OFF position and slide the driver's seat as far back as possible.
2. Locate the stop lamp switch under the driver's lower panel.

*** NOTICE**

Images shown are for demonstration ONLY purposes and will vary in appearance by model.

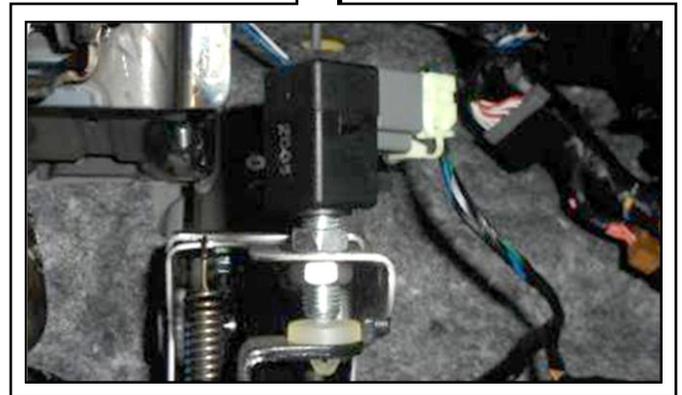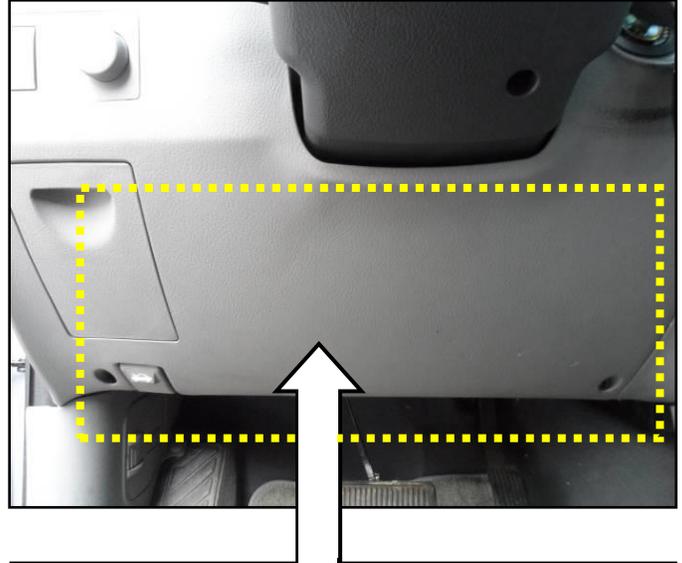


3. Disconnect the stop lamp switch wiring connector.

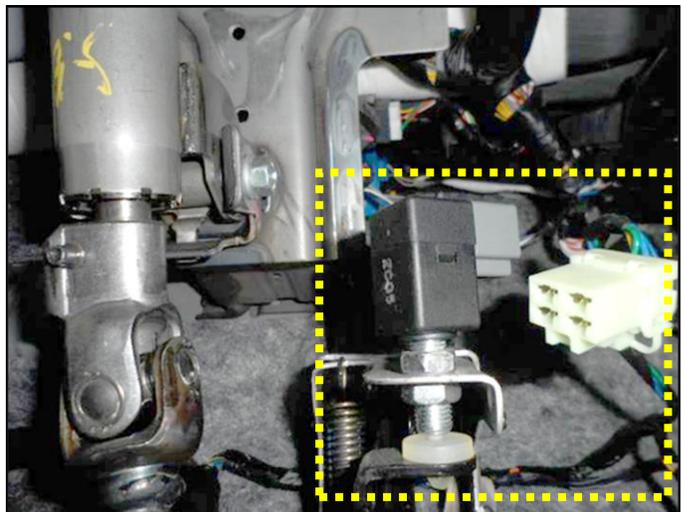


SUBJECT:

STOP LAMP SWITCH REPLACEMENT (SC 121)


- Using an open end wrench, loosen the upper mounting nut for the stop lamp switch.

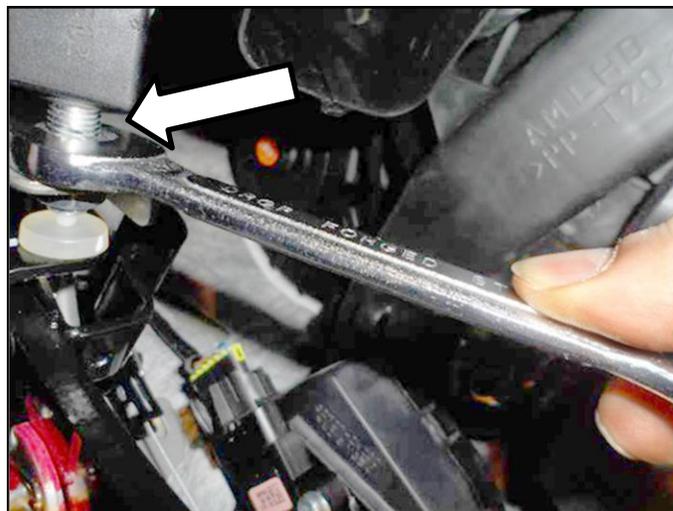

- Remove the lower mounting nut for the stop lamp switch.

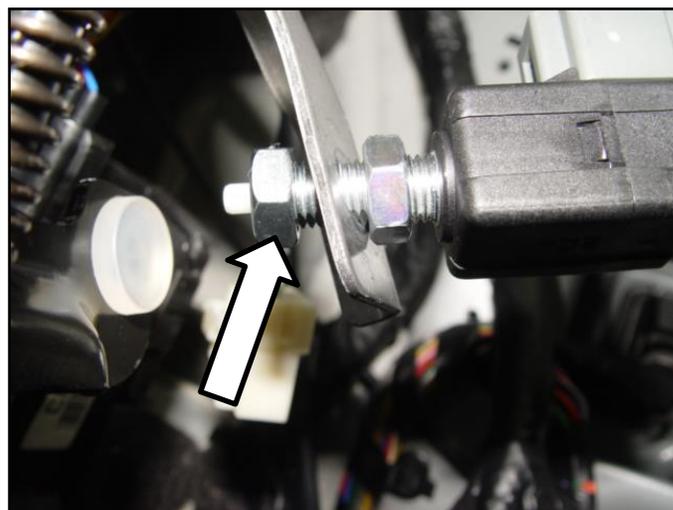


- Remove the stop lamp switch assembly by pulling it away from the mounting bracket, as shown.

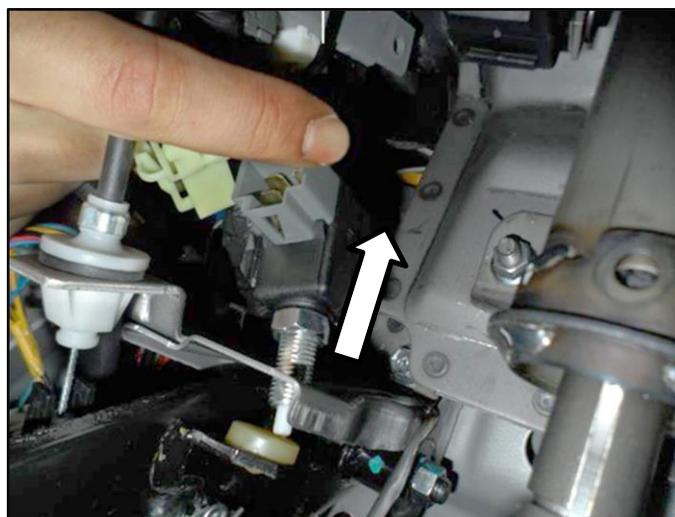


SUBJECT: STOP LAMP SWITCH REPLACEMENT (SC 121)

- 7. Install the new stop lamp switch assembly by reversing the order of removal.

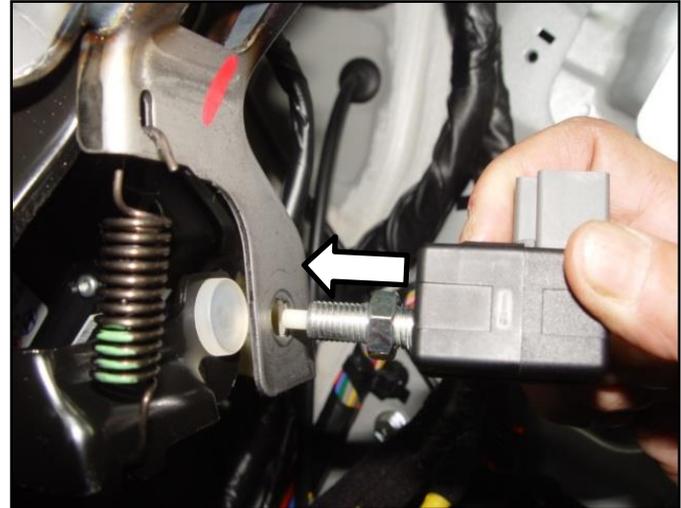

- 8. Adjust the gap to 1.0 ~ 2.0 mm (0.04" ~ 0.08") between the stop lamp switch lower mounting end and the brake pedal switch stopper, without applying the brake pedal.

*** NOTICE**
Failure to properly adjust the switch may result in check engine and/or ESC malfunction indicator lamp illumination.

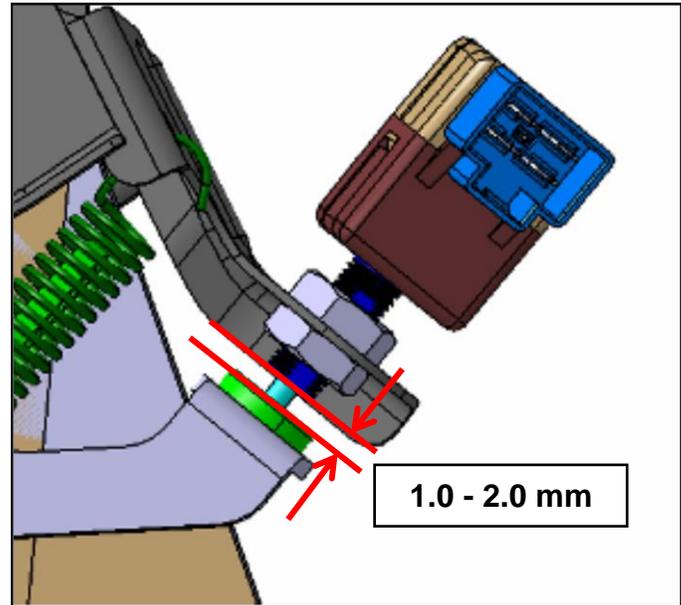

- 9. Check for proper operation of all stop lamps before releasing the vehicle to the customer and address any concern(s) that may interfere with proper brake lamp operation.

SUBJECT: STOP LAMP SWITCH REPLACEMENT (SC 121)

AFFECTED VEHICLE PRODUCTION DATE RANGE:

Model	Production Date Range
Sporage (SL)	March 7, 2011 through June 8, 2011

REQUIRED PARTS:

Part Name	Part Number	Figure
Stop Lamp Switch	93810 3KR0AQQK	

WARRANTY INFORMATION:

N Code = N66 C Code= C63

Claim Type	Causal P/N	Qty.	Repair Description	Labor Op Code	Op Time	Replacement P/N	Qty.
R	93810 3K000	0	Stop Lamp Switch Replacement	151060R0	0.3 M/H	93810 3KR0AQQK	1

*** NOTICE**

To assure complete customer satisfaction, always remember to refer to WebDCS Warranty Coverage (validation) Inquiry Screen (Service > Warranty Coverage >Warranty Coverage Inquiry) for a list of any additional campaigns that may need to be performed on the vehicle before returning it to the customer.