

Federal Recall Information

513-E

Supplier

Pollack

Description

Recall 513-E - Ignition Switch

Release Date

6/11/2013

Introduction

Peterbilt Motor Company has decided that a defect which relates to motor vehicle safety exists in certain Peterbilt vehicles manufactured between May 6, 2013 and May 17, 2013. A total of 1274 US chassis and 130 Canadian chassis are involved in this recall. The chassis list and a copy of the customer letter are attached. The SIR online system indicates chassis involved in this recall with the designator of **"513-E"**.

Situation

An internal defect in the ignition switches with a date code of "183" can cause the starter to engage when a key is partially inserted, before the key is turned. Unintended engine startup may produce unexpected movement, which may result in personal injury or a crash. Unintended engine startup could also cause injury to a person working in the engine compartment.

Resolution

Replace Part No. 16-09149PKG ignition switches that have a date code of "183".
See Procedure section below for details.

It is a violation of Federal law for a dealer to sell or lease new vehicles covered by this recall until the defect or noncompliance has been corrected.

Warranty

SIR will indicate chassis involved in this recall with the designator of "**513-E**" in the campaign field.

File your Quick Claim per the table below:

Quick Claim	Condition
513-E1	Ignition switch date code is legible and is NOT "183" – DO NOT REPLACE ignition switch
513-E2	Ignition switch date code is either illegible or IS "183" – REPLACE ignition switch

Parts

If required (i.e. – ignition switch date code in the truck is either illegible or is "183"), use a replacement switch part number 16-09149PKG with a date code OTHER than "183", which will be paid at dealer net + 30% mark-up.

Please Note: Part returns are required


Procedure

Follow this procedure for inspection and/or replacement of the ignition switch.

WARNING: DO NOT open the hood, crawl under the truck, or stand in front of or behind a truck that is on the attached chassis list until this recall is completed.

1. Ensure the park brake is set and the transmission is in neutral
2. Remove the ignition switch P/N 16-09149PKG (supplier P/N 31-400)
3. Inspect the ignition switch for date code 183 (see attached date code picture)
4. Replace date coded "183" and any illegible date coded switches with an ignition switch with any other date code than "183".
5. Ship the "183" and any illegible date coded switches to Pollack/Stoneridge after Quick Claim 513-E produces a packing slip. Write "513-E" on the outside of the box.
6. Safety Recall # 513-E will be posted shortly. File one of the following recall quick claims as soon as possible:
 - a. 513-E1 - inspect only - 0.3 hr
 - b. 513-E2 - inspect, replace - 0.3 hr

Example of Date Code:

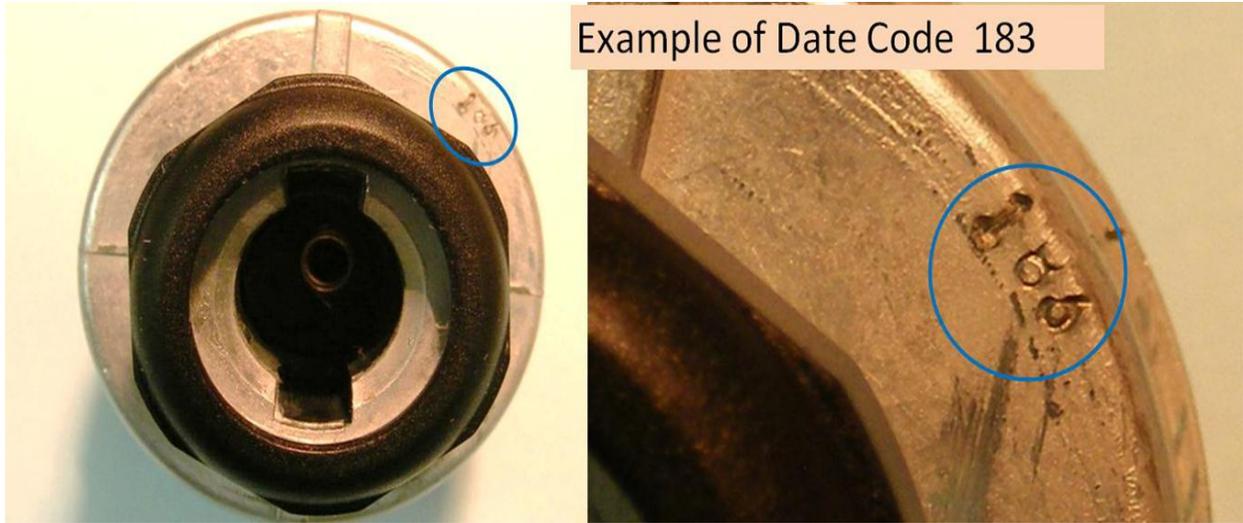

Attachments

[513-E Ignition Chassis List](#)

[513-E Sample Customer Letter](#)
