

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2016**

Published March 18, 2016

CHILD SEATS:

Graco Children's Products, Inc. (Graco) is recalling certain Extend2Fit Convertible child seats manufactured November 27, 2015, to January 20, 2016. The affected child seats may have the recline label affixed at the wrong location, resulting in confusion about how to use the seat properly. As such, these child seats fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 213, "Child Restraint Systems." If the instructions are followed as shown, a rear-facing infant could be placed in an upright position and/or a forward-facing toddler could be placed in a recline position. Either scenario may increase the risk of injury to the child in the event of a crash. Graco will notify owners and provide a new corrected label with application instructions, free of charge. Owners may contact Graco customer service at 1-800-345-4109.

16C-002

Evenflo Company, Inc. (Evenflo) is recalling certain Transitions 3-in-1 Combination Booster Seats, model numbers 34411686, 34411695, and 34411029, produced from December 18, 2014, through January 29, 2016. The central front adjuster (CFA) button that is used to loosen the seat's internal harness may be within the child's reach, allowing the child to activate the CFA and loosen the internal harness. If the internal harness is not tightened snugly around the child, the child would be at an increased risk of injury in the event of a crash. Evenflo will notify owners and provide a remedy kit that includes a newly-designed seat pad and CFA assembly, free of charge. Owners may contact Evenflo at www.transitions.evenflo.com or 1-800-233-5921. The recall began on March 14, 2016. Note: This safety issue only impacts the use of the seat in the forward-facing harnessed booster (22-65 lbs. and 28-50 in.) configuration.

16C-003

EQUIPMENT:

Helmet City, Inc. (HCI) is recalling certain model 100 motorcycle helmets, sizes Medium and X-Large, both in Gloss Black, manufactured from December 1, 2013, through December 31, 2013. The affected helmets may not be strong enough to adequately protect a user's head in an impact. As such, these helmets fail to comply with the impact attenuation and penetration requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 218, "Motorcycle Helmets." The wearer of the helmet may not be adequately protected in the event of a crash, increasing the risk of serious injury. HCI will notify owners and will provide a replacement model 100 helmet, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact HCI customer service at 1-888-550-3731. HCI's number for this recall is 100 XL/M (dec 2013).

16E-008

Takata Corporation (Takata) is recalling certain seat-mounted, SSI-20 design type, Side Air Bag Inflators manufactured December 13, 2014, to December 14, 2014. A suspected manufacturing error during production of certain inflator lots may result in unusually high pressures in the inflators upon deployment of the side air bags. This over pressure could cause the inflator to rupture, causing metal fragments to be propelled into the passenger compartment. An inflator rupture may result in metal fragments striking the driver or other occupants resulting in serious injury or death. Takata is working with the vehicle manufacturers that used these inflators in their vehicles. Those manufacturers are contacting their vehicle owners and their dealers will replace the seat-mounted side air bag inflators, free of charge. General Motors vehicles are covered by recall 15V-666 and Volkswagen vehicles

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2016**

Published March 18, 2016

are covered by recall 16V-045.

16E-009

Helmet City, Inc. (HCI) is recalling certain model 115 German helmets, size XL, manufactured from April 1, 2014, through April 30, 2014. During a load situation such as during a crash, the straps that secure the affected helmets may stretch excessively. As such, these helmets fail to comply with the retention requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 218, "Motorcycle Helmets." If the helmet straps stretch significantly in the event of a crash, the helmet may not remain secured to the user's head increasing their risk of injury. HCI will notify owners and will replace the model 115 helmets with a model 100 helmet, free of charge. The recall began on February 19, 2016. Owners may contact HCI customer service at 1-888-550-3731. HCI's number for this recall is 115 XL (Apr 2014).

16E-010

Haier America (Haier) is recalling certain 55" LED Televisions, model number 55E3500, manufactured September 1, 2015, to October 27, 2015, installed in fifth-wheel recreational vehicles. The affected televisions have bottom brackets for mounting the televisions to wall mounts, and these bottom brackets may separate from the wall mounts when installed in recreational vehicles, causing the televisions to fall. An affected television installed in a recreational vehicle may fall, increasing the risk of injury to people in the vehicle. Haier notified the recreational vehicle manufacturer on February 8, 2016, and will work with them to remove the affected televisions from the vehicles, free of charge. Owners may contact Haier customer service at 1-877-337-3639.

16E-011

Iowa Mold Tooling Co., Inc. (IMT) is recalling certain Series III Cranes, models 6000, 7500, 8600, 9500, 10000, 12000, and 14000, manufactured April 4, 2013, to January 22, 2016. The affected cranes have a valve bank cover that may crack and fall from the crane while the crane is being transported. If the valve bank cover detaches from the crane it could be a road hazard, increasing the risk of a crash. IMT will notify owners, and dealers will replace the valve cover with a thicker cover, free of charge. The recall is expected to begin during March 2016. Owners may contact IMT customer service at 1-800-247-5958. IMT's number for this recall is TB2016001.

16E-012

Daystar Products International, Inc. (Daystar) is recalling certain aftermarket replacement rear control arm brackets included in Daystar's 2015-2016 Jeep Renegade 1.5" spacer kit, part KJ09168BK, shipped from Daystar to distributors between October 27, 2015 and November 5, 2015. The affected spacers may have improper or incomplete welds on the top flange on the rear control arm bracket, that can allow the rear axle to shift while driving. If the axle moves there could be an increased risk of a crash. Daystar will notify owners, and direct them to repair shops to have the brackets inspected and replaced as needed, free of charge. The recall began on March 11, 2016. Owners may contact Daystar customer service at 1-623-907-0081 or by email at Jbilyeu@daystarweb.com. Daystar's number for this recall is 16-01.

16E-013

Vapor Bus International (Vapor Bus) is recalling certain Electric Transit Operator (ETO) Controller Assemblies,

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2016**

Published March 18, 2016

part number 51220550, manufactured March 7, 2013, to December 21, 2015. These assemblies, which control a bus door operator motor and brake, may have a software defect which can cause failure of the rear door guide roller linkage resulting in a bus' rear door opening unexpectedly while the bus is in motion. If the rear bus door opens expectedly while the bus is in motion, there is an increased risk of injury for the passengers. Vapor Bus will notify owners, and dealers will update the ETO Controller Assembly software, and replace all of the roller brackets, free of charge. Vapor Bus will notify the affected bus manufacturers in March 2016. Owners may contact Vapor Bus customer service at 1-847-777-6423.

16E-014

Walser Asia Pacific Ltd. (Walser) is recalling certain accessory Auto XS Heated Car Seat Cushions, model number 16478, manufactured June 30, 2015, to August 30, 2015, and sold exclusively through ALDI USA stores between December 20, 2015 and February 10. The seat covers may overheat causing the fabric to melt. If the seat cover overheats melting the fabric, it can increase the risk of personal injury to the seat occupant or may result in a vehicle fire. Walser does not know the contact information for the purchasers of the heated seat covers. Walser will work with the exclusive seller, ALDI USA to issue a joint press release instructing owners to return the affected seat covers back to ALDI for a refund. The recall began on February 11, 2016. Owners may contact Walser customer service at 1-800-222-0999.

16E-015

TIRES:

Bridgestone Americas Tire Operations, LLC (BATO) is recalling certain FS561 replacement tires, size 255/70R22.5, manufactured January 25, 2015, to January 27, 2016 (DOT weeks 0515-0416) for use on trailers. The affected tires may experience possible tread separation or detachment due to scrubbing during use. Tread separation or detachment may result in a sudden loss of air pressure, increasing the risk of a crash. BATO will notify owners, and dealers will replace the tires, free of charge. The recall began on February 4, 2016. Owners may contact BATO customer service at 1-800-847-3272.

16T-002

VEHICLES:

Snake River Trailer Company (Snake) is recalling certain model year 2015-2016 Horse Trailers manufactured October 27, 2014, to January 29, 2015, equipped with 3500lb-capacity torsion model axles, part numbers B-7100A, B-7110A, HT-35XL, T35545EB, T35545I, T35550EB, T35550HB, T35550I, T35655EB and T35655I, manufactured by Henderson Wheel. The weld that secures the torsion arm assembly may fail allowing the tire, wheel, hub, and torsion arm to separate from the trailer. A separation of the torsion arm can result in a reduction in vehicle stability, increasing the risk of a crash. Snake River will notify owners, and the axle manufacturer will supply a replacement axle free of charge and cover the labor costs needed to replace it. The recall is expected to begin February, 2016. Owners may contact Snake River customer service at 1-208-455-2768.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2016**

Published March 18, 2016

16V-052

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain model year 2016 Lexus RX350 and RX450h vehicles manufactured November 16, 2015, to December 23, 2015. Due to an improper weld, the gas needed to inflate the driver's knee air bag may escape from the inflator. A defective inflator may increase the risk of injury in the event of a crash. Toyota will notify owners, and dealers will inspect and, if necessary, replace the knee air bag assembly, free of charge. The recall began March 7, 2016. Owners may contact Toyota customer service at 1-800-331-4331. Toyota's number for this recall is GLA.

16V-053

General Motors LLC (GM) is recalling certain model year 2015 Chevrolet Colorado vehicles manufactured January 6, 2015, to March 17, 2015, and 2015 GMC Canyon vehicles manufactured January 6, 2015, to March 19, 2015. A poor electrical connection within the steering gear connector may cause a loss of power steering assist. A loss or reduction in power steering assist may increase the risk of a crash. GM will notify owners, and dealers will replace the steering gear pinion sensor cover assembly, free of charge. The recall began March 1, 2016. Owners may contact Chevrolet customer service at 1-800-222-1020 or GMC customer service at 1-800-462-8782. GM's number for this recall is 15595.

16V-054

Newmar Corporation (Newmar) is recalling certain model year 2015 Ventana, and 2015-2016 Ventana LE vehicles manufactured January 16, 2015, to January 13, 2016 built on Freightliner Chassis. The affected vehicles may have a front rim maximum pounds per square inch (psi) rating of 120psi which is lower than the Michelin tires maximum inflation rating of 130 psi. If the tires are inflated to their maximum pressure, the rims may suddenly fail due to being over pressurized, increasing the risk of a crash. The remedy for this recall is still under development. The recall is expected to begin March 28, 2016. Owners may contact Newmar customer service at 1-574-773-7791.

16V-055

American Honda Motor Company, Inc. (Honda) is recalling certain model year 2008-2010 Accord vehicles. In the affected vehicles, the air bag control units may corrode and fail. If the air bag control unit fails, the air bags may not deploy in the event of a crash, increasing the risk of occupant injury. Honda will notify owners, and dealers will replace the air bag control units, free of charge. Parts are expected to be available in Fall 2016. Interim notifications will be mailed to owners beginning on March 15, 2016, and a second notice will be mailed when remedy parts are available. Owners may contact Honda customer service at 1-888-234-2138. Honda's number for this recall is JW9.

16V-056

Highland Ridge RV (Highland) is recalling certain model year 2015-2016 Highlander, Mesa Ridge, Roamer, and Journeyer travel trailers manufactured April 7, 2014, to January 11, 2016. The affected vehicles are equipped with safety chains on the A-frame that are rated for 11,700lb instead of being rated equal to or greater than the gross vehicle weight rating (GVWR) of the travel trailer. In the event the main trailer connection fails, the weight of the trailer can break the safety chains if the chains are not strong enough, allowing the trailer to separate from

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2016**

Published March 18, 2016

the vehicle, increasing the risk of a crash. Highland will notify owners, and dealers will replace the existing safety chains with chains that have a 16,200lb rating, free of charge. The recall began on February 25, 2016. Owners may contact Highland customer service at 1-260-768-7771. Highland's number for this recall is 9904277.

16V-058

Forest River, Inc. (Forest River) is recalling certain model year 2016 Wildcat recreational trailers, models WCF28SGX, WCF29RKP, WCF29RLX, and WCF31SAX, manufactured from September 25, 2015, through January 20, 2016. The affected vehicles may have been produced with an incorrect Federal placard that has an improperly reduced Gross Axle Weight Rating (GAWR) of 3500lbs. The correct GAWR is 5200lbs. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." Incorrect Federal Placard information such as the Gross Axle Weight Rating could lead to reduced handling of the vehicle, potentially leading to loss of control or a crash. Forest River will notify owners, and dealers will provide a corrected Federal placard, free of charge. The recall began on February 19, 2016. Owners may contact Forest River customer service at 1-574-862-2071. Forest River's number for this recall is 23-01262016-0131.

16V-059

Subaru of America, Inc. (Subaru) is recalling certain model year 2006-2014 Tribeca vehicles manufactured November 16, 2004, to January 27, 2014. Due to a possible malfunction of the hood safety system and hood lock system, the hood may open unexpectedly while driving. If the hood unexpectedly opens while driving, it may interfere with the driver's visibility, increasing the risk of a crash. Subaru will notify owners, and dealers will complete this recall in two phases. Phase one will involve inspection, cleaning, and lubricating the hood safety and hood lock systems. If after this is performed the hood latch does not operate properly, it will be replaced with a new current style part. Phase two will involve installing an improved hood safety system and hood lock system. The manufacturer has not yet provided a notification schedule. Owners may contact Subaru customer service at 1-800-782-2783. Subaru's number for this recall is WQX-59 (phase one) and WQY-60 (phase two).

16V-060

Honda (American Honda Motor Co.) is recalling certain model year 2007-2011 Honda CR-V, 2011-2015 CR-Z, 2010-2014 FCX, and Insight, 2009-2013 Fit, 2013-2014 Fit EV, 2007-2014 Ridgeline, 2013-2016 Acura ILX, 2013-2014 Acura ILX Hybrid, 2007-2016 RDX, 2005-2012 Acura RL, 2009-2014 Acura TL, and 2010-2013 Acura ZDX vehicles. The affected vehicles are equipped with a dual-stage driver frontal air bag that may be susceptible to moisture intrusion which, over time, could cause the inflator to rupture. In the event of a crash necessitating deployment of the driver's frontal air bag, the inflator could rupture with metal fragments striking the driver or other occupants resulting in serious injury or death. Honda will notify owners, and dealers will replace the inflator, free of charge. Remedy parts are expected to be available in Summer 2016. Interim notices will be mailed to owners during March 2016. Owners will receive a second notice when remedy parts become available. Owners may contact Honda customer service at 1-888-234-2138. Honda's numbers for this recall are JY0, JY1, and JY2.

16V-061

Forest River, Inc. (Forest River) is recalling certain model year 2016 Surveyor recreational vehicles, model

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2016**

Published March 18, 2016

SVF275BHSS, manufactured from November 4, 2015, through November 11, 2015. In the affected vehicles, the general circuit receptacle may be incorrectly wired, and as a result, too much current may travel through the receptacle. Too much electrical current can cause an electrical arc, and potentially electrocute the user. Forest River will notify owners, and dealers will repair any wiring, breakers, and other items, as necessary, free of charge. The recall began on February 19, 2016. Owners may contact Forest River customer service at 1-574-642-3119 extension 205. Forest River's number for this recall is 37-01152016-0131.

16V-062

General Motors LLC (GM) is recalling certain model year 2003-2011 Saab 9-3 vehicles manufactured May 31, 2002, to February 15, 2011, 2010-2011 Saab 9-5 vehicles manufactured June 23, 2010, to February 21, 2011, and 2008-2009 Saturn Astra vehicles manufactured April 11, 2007, to July 24, 2008. Upon deployment of the driver's frontal air bag, excessive internal pressure may cause the inflator to rupture. In the event of a crash necessitating deployment of the driver's frontal air bag, the inflator could rupture with metal fragments striking the driver or other occupants resulting in serious injury or death. GM will notify owners, and dealers will replace the driver's frontal air bag inflator on Saab 9-3 and 9-5 vehicles and will replace the driver's frontal airbag module on Saturn Astra vehicles, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Saab customer service at 1-800-955-9007 or Saturn customer service at 1-800-553-6000. GM's number for this recall is 28810.

16V-063

Mazda North American Operations (Mazda) is recalling certain model year 2014-2016 Mazda CX-5 vehicles manufactured June 27, 2013, to February 2, 2016. The affected vehicles have a fuel filler pipe that may rupture in the event of a crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 301, "Fuel System Integrity." A rupture of the fuel filler pipe may result in a fuel leak, increasing the risk of a fire. Mazda will notify owners, and dealers will alter the attachment between the fuel filler pipe and the left rear side of the bracket of the fuel filler pipe, free of charge. The recall began on February 25, 2016. Owners may contact Mazda customer service at 1-800-222-5500, option 6. Mazda's number for this recall is 9216B.

16V-064

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain model year 2003-2006 Toyota Land Cruiser and Lexus LX470, 2005-2006 Toyota Tundra and Sequoia, 2004-2006 Toyota 4Runner and Lexus GX470 vehicles equipped with side curtain-shield-air bags. The affected vehicles have an air bag control module that may be improperly programmed, causing the side curtain-shield-air bags to deploy inadvertently. If the side curtain-shield-air bags deploy unexpectedly, it can increase the risk of occupant injury. Toyota will notify owners, and dealers will replace the air bag control module with one that has improved programming, free of charge. The recall is expected to begin April 2, 2016. Owners may contact Toyota customer service at 1-888-271-9371. Toyota's number for this recall is G0C and GLB.

16V-065

PACCAR Incorporated (PACCAR) is recalling certain model year 2015-2016 Peterbilt 365 and 367 vehicles manufactured from August 27, 2014, through June 5, 2015, and equipped with drive axles manufactured by

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2016**

Published March 18, 2016

Marmon-Herrington. The affected axles have hex nuts on the flange yoke that may not have been properly tightened. If the hex nuts are not tightened to specification, the driveshaft may disconnect from the drive axle, resulting in a loss of propulsion and increasing the risk of a crash. Peterbilt will notify the owners, and dealers will inspect the torque and, if necessary, tighten the bolts, free of charge. The recall is expected to begin during March 2016. Owners may contact Peterbilt customer service at 1-940-591-4000. PACCAR's number for this recall campaign is 216-A.

16V-066

Genie Industries, Inc. (Genie) is recalling certain model year 2016 TZ 34/20 trailer-mounted boom lifts manufactured January 5, 2016, to January 20, 2016. The affected lifts have bolts that attach the turntable to the rotation bearing that may not have been properly tightened. If the bolts are not properly tightened, they may shear and the platform can fall, increasing the risk of injury. Genie will notify owners, and dealers will correctly tighten the bolts attaching the turntable to the rotation bearing, free of charge. The recall began on March 9, 2016. Owners may contact Genie customer service at 1-800-536-1800. Genie's number for this recall is Issue 121.

16V-067

Nova Bus (Nova) is recalling certain model year 2010-2015 Nova LFS Artic transit buses manufactured from September 1, 2010, through April 30, 2015, and equipped with Allison transmissions. The main power cable within the energy guiding system (EGS) may have been incorrectly routed and, as a result, the cable may disconnect. If the main power cable disconnects, there will be a loss of power that could disable the vehicle, increasing the risk of a crash. Nova will notify owners, and dealers will inspect the main power cable, re-routing it as necessary, free of charge. The recall is expected to begin on March 28, 2016. Owners may contact Nova customer service at 1-450-472-6410. Nova's recall number for this campaign is CR3590.

16V-068

General Motors LLC (GM) is recalling certain model year 2015-2016 Chevrolet Silverado 2500 and 3500 heavy duty trucks manufactured October 1, 2013, to February 1, 2016, 2015-2016 Chevrolet Tahoe Police Pursuit Vehicles (PPV) manufactured March 1, 2014, to February 1, 2016, and 2015-2016 GMC Sierra 2500 and 3500 heavy duty trucks manufactured October 29, 2013, to February 1, 2016. On the affected vehicles, the brake pedal pivot nut may loosen, causing the brake pedal to be loose or inoperative. If the brake pedal becomes loose or inoperative, the driver may be unable to stop the vehicle by using the brake pedal. Additionally, a loose pedal may also interfere with the accelerator pedal. Either condition may increase the risk of a crash. GM will notify owners, and dealers will inspect the brake pedal pivot nuts, adding thread adhesive and tightening the nut as necessary, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Chevrolet customer service at 1-800-222-1020 or GMC customer service at 1-800-462-8782. GM's number for this recall is 20760.

16V-069

Kia Motors America (Kia) is recalling certain model year 2011 Forte vehicles manufactured August 27, 2010, to November 11, 2010. The affected vehicles have a transmission fluid cooler hose that may have been improperly manufactured, resulting in a transmission fluid leak. If enough transmission fluid leaks out, the transmission may

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2016**

Published March 18, 2016

not function properly and the vehicle may stop moving, increasing the risk of a crash. Kia will notify owners, and dealers will replace the transmission cooler hose, free of charge. The recall is expected to begin March 30, 2016. Owners may contact Kia customer service at 1-800-333-4542. Kia's number for this recall is SC129.

16V-070

BMW of North America, LLC (BMW) is recalling certain model year 2008-2013 128i and 135i coupes and convertibles and 1 Series M coupes, 2006-2011 325i, 325xi, 328i, 328xi, 328i xDrive, 330i, 330xi, 335i, 335xi, 335i xDrive Sedans, 2009-2011 335d sedans, 2006-2012 325xiT, 328i and 328xi sports wagons, 2007-2013 328i, 328xi, 328i xDrive, 335i, 335xi, 335i xDrive, 335is and M3 Coupes and Convertibles, 2013-2015 X1 sDrive28i, X1 xDrive28i and X1 xDrive35i SAVs, 2007-2010 X3 xDrive30i SAVs, 2007-2013 X5 xDrive30i, X5 xDrive35i, X5 xDrive48i, X5 xDrive50i and X5 M SAVs, 2009-2013 BMW X5 xDrive35d SAVs, 2008-2014 X6 xDrive35i, X6 xDrive50i, and X6 M SACs, 2010-2011 BMW X6 xDrive50i SACs and 2008-2011 M3 Sedan vehicles. Upon deployment of the driver's frontal air bag, excessive internal pressure may cause the inflator to rupture. In the event of a crash necessitating deployment of the driver's frontal air bag, the inflator could rupture with metal fragments striking the driver or other occupants resulting in serious injury or death. BMW will notify owners, and dealers will replace the driver's frontal air bag, free of charge. Parts are not currently available. Owners will be mailed an interim notification beginning March 31, 2016. A second notice will be mailed when remedy parts are available. Owners may contact BMW customer service at 1-800-525-7417.

16V-071

Stoughton Trailers, LLC (Stoughton) is recalling certain model year 2015-2016 Barrett P gooseneck trailers manufactured July 1, 2014, to December 31, 2015. The affected trailers have an Upper Coupler Section with a Gross Trailer Weight Rating (GTWR) of 25,000lbs, however the trailer has an assigned Gross Vehicle Weight Rating (GVWR) of over 25,000lbs. If the trailer is loaded past 25,000lbs, the upper coupler may fail causing separation of the trailer from the tow vehicle and increasing the risk of a crash. Stoughton will notify owners and depending on the trailer GVWR, dealers will either replace the upper coupler slide-in inner tube or the trailers will need to be returned to the manufacturer to have the upper coupler replaced. These repairs will be made free of charge. The recall is expected to begin in March 2016. Owners may contact Stoughton customer service at 1-608-873-2500.

16V-072

Kalmar Solutions, LLC (Kalmar) is recalling certain model year 2014-2016 Ottawa T2 trucks manufactured July 14, 2014, to November 2, 2015. The affected vehicles are equipped with a chassis power board that is not protected from moisture. Additionally, the bolts that mount the chassis power board may rub against the circuit board and cause an electrical short. Exposure to moisture or rubbing from mounting bolts may result in an electrical short which can increase the risk of a fire. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Kalmar customer service at 1-785-229-6341.

16V-073

Honda (American Honda Motor Co.) is recalling certain model year 2016 Civic vehicles manufactured

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2016**

Published March 18, 2016

September 22, 2015, to February 3, 2016 and equipped with 2.0L engines. The affected vehicles have engines with piston assemblies that may have been manufactured without a piston wrist pin circlip or with an incorrectly installed piston wrist pin circlip. If a circlip is missing or incorrectly installed, the piston wrist pin may not be secure and may drift and damage the engine cylinder causing the engine to seize, and increasing the risk of a crash or a fire. Honda will notify owners, and dealers will inspect and replace the piston assemblies and damaged engine components, as necessary, free of charge. Parts are expected to be available in the Summer of 2016. Owners will be mailed an interim notification beginning March 31, 2016, and will be mailed a second notice when parts are available. Owners may contact Honda customer service at 1-888-234-2138. Honda's number for this recall is JX9.

16V-074

Toyota Motor Company (Toyota) is recalling certain model year 2013-2016 Toyota Scion FR-S vehicles manufactured March 13, 2012, to January 14, 2016 and equipped an automatic transmission and ignition key. Vehicles with a push-to-start button are not affected. In the affected vehicles, it may be possible to remove the ignition key without the transmission being in the "Park" position. As such, these vehicles fail to conform to the requirements of Federal Motor Vehicle Safety Standard number 114, "Theft Protection and Rollaway Prevention." If the key can be removed from the ignition when the transmission is not in the "Park" position, the vehicle could roll away increasing the risk of a crash and occupant or pedestrian injuries. Toyota will notify owners, and dealers will inspect the ignition key/transmission interlock wiring connections, correcting them as necessary, free of charge. The recall is expected to begin during March 2016. Owners may contact Toyota customer service at 1-800-331-4331. Toyota's number for this recall is G0E.

16V-075

Chrysler (FCA US LLC) is recalling certain model year 2016 Ram ProMaster vans manufactured October 21, 2015, to December 17, 2015 and equipped with 3.0L diesel engines. If the driver has disabled the electronic stability control (ESC) system, the system is required to be reactivated the next time the vehicle is started. The recalled vehicles have an Anti-Lock Brake System (ABS) control module that may not reset the ESC to active status when the key is turned off and back on quickly. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 126, "Electronic Stability Control Systems." Operating the vehicle with the ESC off may increase the risk of a crash. FCA will notify owners, and dealers will the update ABS control module software, free of charge. The recall began March 1, 2016. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is S04.

16V-076

Daimler Vans USA, LLC (Daimler Vans) is recalling certain model year 2007-2014 Dodge, Freightliner, and Mercedes Benz Sprinter 2500 and 3500 vehicles manufactured July 1, 2006, to July 31, 2014. Upon deployment of the driver's frontal air bag, excessive internal pressure may cause the inflator to rupture. In the event of a crash necessitating deployment of the driver's frontal air bag, the inflator could rupture with metal fragments striking the vehicle occupants potentially resulting in serious injury or death. Daimler Vans will notify the Mercedes-Benz and Freightliner owners and Fiat Chrysler will notify the Dodge owners. The respective dealers will replace the driver frontal air bag inflator, free of charge. The manufacturer has not yet provided a notification schedule. Mercedes-Benz and Freightliner owners may contact Daimler Van's customer service at

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2016**

Published March 18, 2016

1-877-762-8267. Dodge owners may contact Fiat Chrysler customer service at 1-800-853-1403.

16V-077

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain model year 2010-2014 Golf and Jetta SportWagen, 2007-2010 Passat sedans and wagon, 2012-2014 Passat sedan and Eos, 2009-2014 CC, 2009-2012 Audi Q5, and 2010-2011 Audi A5 Cabriolet vehicles. Upon deployment of the driver's frontal air bag, excessive internal pressure may cause the inflator to rupture. In the event of a crash necessitating deployment of the driver's frontal air bag, the inflator could rupture with metal fragments striking the vehicle occupants potentially resulting in serious injury or death. Volkswagen will notify owners, and dealers will replace the driver's frontal air bag inflators, free of charge. The manufacturer has not yet provided a notification schedule. Volkswagen owners may contact Volkswagen customer service at 1-800-893-5298. Audi owners may contact Audi customer service at 1-800-253-2834.

16V-078

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain model year 2006 Volkswagen Passat sedans and wagons, 2005-2013 Audi A3, and 2006-2009 Audi A4 Cabriolet vehicles. Upon deployment of the driver's frontal air bag, excessive internal pressure may cause the inflator to rupture. In the event of a crash necessitating deployment of the driver's frontal air bag, the inflator could rupture with metal fragments striking the driver or other occupants resulting in serious injury or death. Volkswagen will notify owners, and dealers will replace the driver's frontal air bag inflators, free of charge. The manufacturer has not yet provided a notification schedule. Volkswagen owners may contact Volkswagen customer service at 1-800-893-5298. Audi owners may contact Audi customer service at 1-800-253-2834.

16V-079

Daimler Trucks North America LLC (DTNA) is recalling certain model year 2016-2017 Thomas Built Buses Saf-T-Liner C2, Saf-T-Liner HDX, Saf-T-Liner EFX, and Minotour DRW school buses manufactured from May 1, 2015, through November 16, 2015, equipped with certain Transpec T6000, T6100, and T7000 series school bus stop arms. The affected stop arms have a reflective decal that may peel loose from the stop arm. As such, these stop arms fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 131, "School Bus Pedestrian Safety Devices." Without a reflective decal, the stop arms would have reduced visibility to other drivers, increasing the risk of a crash. DTNA will notify owners, and the stop arm blade assemblies will be replaced, free of charge. The recall is expected to begin April 9, 2016. Owners may contact DTNA customer service at 1-800-745-8000 or Transpec at 1-800-951-7837. DTNA's number for this recall is FL-700.

16V-080

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain model year 2009-2010 ML320 BlueTec 4Matic, GL320 BlueTec 4Matic and R320 CDI 4Matic, 2011 E350 Cabriolet and E550 Cabriolet, 2009-2011 ML350, ML350 4Matic, ML550 4Matic, ML63 AMG, and C63 AMG, 2010-2011 ML450 4Matic Hybrid, E350 Coupe, E350 4Matic, E550 Coupe, E550 4Matic, and E63 AMG, 2011-2012 GL350 BlueTec 4Matic and R350 BlueTec 4Matic, 2009-2012 GL450 4Matic, GL550 4Matic and R350 4Matic, 2007-2008 SLK280, SLK350, and SLK55 AMG, 2011-2014 SLS AMG Coupe, 2012 SLS AMG Cabriolet, 2013-

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2016**

Published March 18, 2016

2014 SLS AMG GT and SLS AMG GT Cabriolet, 2005 C230 Kompressor and C320, 2006-2007 C230, 2006-2011 C350, 2008-2011 C300 and C300 4Matic, 2010-2012 GLK350 and GLK350 4Matic and 2006-2007 Chrysler Crossfire vehicles. Upon deployment of the driver's frontal air bag, excessive internal pressure may cause the inflator to rupture. In the event of a crash necessitating deployment of the driver's frontal air bag, the inflator could rupture with metal fragments striking the driver or other occupants resulting in serious injury or death. MBUSA will their notify owners, and Fiat Chrysler will notify the affected Chrysler owners. Dealers for the respective brands will replace the driver's frontal air bag module, free of charge. A notification schedule has not yet been provided. Mercedes-Benz owners may contact MBUSA customer service at 1-800-367-6372 and Chrysler owners may contact Fiat Chrysler customer service at 1-800-853-1403.

16V-081

Starcraft RV (Starcraft) is recalling certain model year 2016 Solstice and Travel Star fifth wheel trailers manufactured July 31, 2015, to September 14, 2015 and equipped with Atwood on demand water heaters. The affected water heaters have a water and gas valve that may cause the water heater to overheat the water in the hot water supply tap. The overheating of the water may result in the release of steam, possibly causing the operator to scald themselves, increasing the risk of injury. Starcraft will notify owners, and dealers will install a water flow adjustment stop key that prevents the recall condition from occurring, free of charge. The recall began on March 9, 2016. Owners may contact Starcraft customer service at 1-800-945-4787. Starcraft's number for this recall is 9902282.

16V-082

Volkswagen Group of America, Inc. (VW) is recalling certain model year 2009 Volkswagen Routan vehicles manufactured February 7, 2008, to August 28, 2008. In the affected vehicles, the air bag control units may corrode and fail. If the air bag control unit fails, the air bags may not deploy in the event of a crash, increasing the risk of occupant injury. Additionally, the air bags may inadvertently deploy, increasing the risk of a crash. VW will notify owners, and dealers will replace the air bag control unit, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Volkswagen customer service at 1-800-893-5298.

16V-083

Genera Motors LLC (GM) is recalling certain model year 2016 Chevrolet Camaro, Malibu, Silverado and GMC Sierra vehicles. The radio may intermittently fail to provide an audio warning when the key has been left in the ignition and the door is opened or when the driver does not fasten their seat belt. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standards (FMVSS) number 114, "Theft Protection", and/or 208, "Occupant Crash Protection." An unbelted driver is at a greater risk of injury in a crash. GM will notify owners, and dealers will update the radio software, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Chevrolet customer service at 1-800-222-1020, or GMC customer service at 1-800-462-8782. GM's number for this recall is 15808.

16V-084

Transportation Collaborative, Inc. (Transportation Collaborative) is recalling certain model year 2012-2015 Trans Tech Student Safety Transporter school buses manufactured from December 1, 2012, through April 23, 2015. In the event of a crash, the barrier on the driver's side may not deform as intended. As such, these

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2016**

Published March 18, 2016

vehicles fail to comply with the requirements of Federal Motor Vehicle Standard (FMVSS) number 222, "School Bus Passenger Seating and Crash Protection." If the barrier does not deform properly, vehicle occupants are at a greater risk of injuries should they impact the barrier in a crash. The remedy for this recall is still under development. The recall is expected to begin during March 2016. Owners may contact Transportation Collaborative customer service at 1-845-988-0419.

16V-085

Starcraft RV (Starcraft) is recalling certain model year 2016 AR-One toy hauler trailers, model 17XTH, manufactured from October 28, 2015, through January 19, 2016. The affected trailers may be equipped with labels that indicate incorrect tire size and tire inflation information. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 119, "New Pneumatic Tires-Other than Passenger Cars." If the tires are replaced with ones that are of an incorrect size and pressure, the handling of the trailer may be adversely affected or tire failure may occur. Either condition increases the risk of a crash. Starcraft will notify owners and will mail them corrected labels, free of charge. The recall began on February 22, 2016. Owners may contact Starcraft customer service at 1-800-945-4787. Starcraft's number for this recall is 9902260.

16V-086

Mercedes-Benz USA, LLC (MBUSA) is recalling certain model year 2016 C300 vehicles manufactured December 11, 2015, to December 23, 2015, C300 4Matic vehicles manufactured December 12, 2015, to December 29, 2015, and C450 AMG 4Matic vehicles manufactured December 12, 2015, to December 22, 2015. The affected vehicles may be equipped with a panoramic sunroof that may not be properly bonded, allowing the glass to detach and fall from the vehicle during operation. If the panoramic glass detaches during vehicle operation, it can increase the risk of injury or crash. MBUSA will notify owners, and dealers will inspect the bonding of the rear sunroof glass panel, replacing it as necessary, free of charge. The recall is expected to begin in late March 2016. Owners may contact MBUSA customer service at 1-800-367-6372.

16V-087

Iowa Mold Tooling Co., Inc. (IMT) is recalling certain model year 2013-2016 Dominator-Propane, Dominator I, Dominator II, Dominator III, and Dominator IV vehicles manufactured April 4, 2013, to January 22, 2016. The affected vehicles are fitted with IMT Series III cranes, models 6000, 7500, 8600, 9500, 10000, 12000, and 14000, which have a valve bank cover that may crack and fall from the crane while the vehicle is being driven. If the valve bank cover detaches from the crane it could be a road hazard, increasing the risk of a crash. IMT will notify owners, and dealers will replace the valve bank cover with a thicker one, free of charge. The recall is expected to begin in March 2016. Owners may contact IMT customer service at 1-800-247-5958. IMT's number for this recall is TB2016002.

16V-088

Keystone RV Company (Keystone) is recalling certain model year 2016 Sprinter vehicles manufactured July 28, 2015, to November 19, 2015, and equipped with a Haier television, model 55E2500, mounted to the wall. These televisions may break off of the wall mounting inside the vehicle. If the television falls while people are in the vehicle, there would be an increased risk of injury. Keystone will notify owners, and dealers will replace the

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2016**

Published March 18, 2016

television, free of charge. The recall began on February 23, 2016. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 16-247.

16V-089

Navistar, Inc. (Navistar) is recalling certain model year 2016 IC CE commercial buses manufactured from March 4, 2015, through December 14, 2015. In the affected vehicles, the hood straps used to latch the hood closed may become elongated and not return to their original length. As a result, the hood may open unexpectedly when the bus is braking. If the hood opens while braking, the driver's vision may be obstructed, increasing the risk of a crash. Navistar will notify owners, and dealers will replace the hood straps, free of charge. The recall is expected to begin on April 17, 2016. Owners may contact Navistar customer service at 1-800-448-7825. Navistar's number for this recall is 16503.

16V-090

Navistar, Inc. is recalling certain model year 2016-2017 IC CE school buses manufactured from March 2, 2015, through January 13, 2016. In the affected vehicles, the hood straps used to latch the hood closed may become elongated and not return to their original length. As a result, the hood may open unexpectedly when the bus is braking. If the hood opens while braking, the driver's vision may be obstructed, increasing the risk of a crash. Navistar will notify owners, and dealers will replace the hood straps, free of charge. The recall is expected to begin on April 17, 2016. Owners may contact Navistar customer service at 1-800-448-7825. Navistar's number for this recall is 16502.

16V-091

Highland Ridge RV (Highland) is recalling certain model year 2015-2016 Highland Toy Hauler, Light, Mesa Ridge, and Roamer travel and fifth wheel trailers manufactured May 6, 2014, to August 31, 2015. The Gross Vehicle Weight Rating calculation on the label may be incorrect, which can allow the vehicle to be overloaded. If the vehicle is overloaded due to incorrect Weight Rating information on the label, tire failure may result, increasing the risk of a crash. Highland will notify owners and will provide a corrected label, free of charge. One model, the HT31RGR Highland Toy Hauler will require two heavier axles installed and five larger tires as well. These repairs will be provided free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Highland customer service at 1-260-768-7771. Highland's number for this recall is 9904283.

16V-092

Daimler Vans USA, LLC (DVUSA) is recalling certain model year 2015-2016 Mercedes-Benz and Freightliner Sprinter 2500 and 3500 vans manufactured April 29, 2015, to December 15, 2015. The affected vehicles have a tire pressure label that incorrectly states a higher maximum load capacity than the vehicle is designed for. The vehicle may be overloaded if loaded to the incorrect weight shown on the label, possibly resulting in axle or tire failure, increasing the risk of a crash. DVUSA will notify owners, and Mercedes-Benz and Freightliner dealers will replace the incorrect tire pressure label, free of charge. The recall is expected to begin in March 2016. Owners may contact DVUSA customer service at 1-877-762-8267.

16V-093

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2016**

Published March 18, 2016

Forest River, Inc. (Forest River) is recalling certain model year 2016 Coachmen Galleria motorhomes manufactured from October 30, 2015, through February 15, 2016. The Federal Placards on the affected vehicles incorrectly lists the number of seatbelts as zero. Additionally, the placards did not factor in the fresh water capacity in the vehicle weight calculation and the Gross Vehicle Weight Rating (GVWR) is missing from the label. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." Without the GVWR listed on the label, the operator may overload the vehicle, increasing the risk of a crash. Forest River will notify owners, and dealers will install a corrected Federal Placard, free of charge. The recall is expected to begin April 22, 2016. Owners may contact Forest River customer service 1-574-825-8628. Forest River's number for this recall is 225-02102016-0134.

16V-094

Volvo Trucks North America (Volvo) is recalling certain model year 2009-2010 VT trucks manufactured from April 9, 2008, through September 24, 2009, and certain 2016 model VNL and VNM trucks manufactured from January 2, 2015, through to November 6, 2015. The affected vehicles are equipped with USK non-greasable drag links that may experience corrosion of the ball joints due to the seals being compromised, possibly resulting in accelerated wear and failure of the ball joint. Failure of the ball joint may cause separation of the socket and a complete loss of steering, increasing the risk of a crash. Volvo will notify owners, and dealers will replace the drag links, free of charge. The recall is expected to begin April 15, 2016. Owners may contact Volvo customer service at 1-800-528-6586. Volvo's number for this recall is RVXX1601. Note: This recall is an expansion of a previous recall 15V-651.

16V-095

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain model year 2006-2012 RAV4 vehicles manufactured July 28, 2005, to December 19, 2012, and 2012-2014 RAV4 EV vehicles manufactured July 24, 2012, to August 29, 2014. In the event of a frontal collision, the rear seat belts for the outboard seats may be cut by the seat cushion frame. A cut seat belt may not properly restrain the seat occupant, increasing their risk of injury in a crash. Toyota will notify owners, and dealers will install a protector over both rear seat cushion frames, free of charge. Parts for the remedy are not currently available. Interim notification letters will be mailed to owners beginning March 31, 2016. A second notice will be mailed when parts are available. Owners may contact Toyota customer service at 1-800-331-4331. Toyota's number for this recall is GOF.

16V-096

Volvo Trucks North America (Volvo) is recalling certain model year 2016-2017 VNL, VNX, and VNM trucks manufactured from May 11, 2015, through March 8, 2016. The trucks may have been manufactured without a roll pin on the steering shafts. If the roll pin is missing, the lower steering shaft may disconnect from the junction block. Also, the bolt connecting the upper steering shaft to the lower steering shaft may not have been properly tightened. Either condition can lead to separation of the steering shaft. Separation of the steering shaft will result in complete loss of steering which may lead to a vehicle crash. Volvo is strongly recommending that the affected vehicles not be driven until the final remedy is available. Volvo is validating an interim remedy that it expects to make available very shortly while it develops a final remedy. Both remedies are free of charge. Volvo expects to mail all owners notifying them of the defect and the interim remedy by mid-March 2016. A second notice will be sent when the final remedy is available. Owners may contact Volvo customer service at 1-877-800-4945

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2016**

Published March 18, 2016

opt #1. Volvo's recall numbers for this campaign are RVXX1602 and RVXX1603. This recall supersedes safety recall 15V-786.

16V-097

Mack Trucks, Inc. (Mack) is recalling certain model year 2016-2017 Granite (GU) and TerraPro (MRU) trucks manufactured from November 9, 2015, through January 19, 2016. The affected trucks may be missing a roll pin to secure the upper steering yoke to the steering shaft. If the roll pin is missing, the steering shaft may disconnect from the yoke, resulting in a complete loss of steering and increasing the risk of a crash. Mack will notify owners, and dealers will inspect the vehicles and replace the steering shaft if the roll pin is missing, free of charge. The recall is expected to begin on March 11, 2016. Owners may contact Mack customer service at 1-610-709-2131. Mack's recall campaign number for this recall is SC0400.

16V-098

Mack Trucks, Inc. (Mack) is recalling certain model year 2012-2015 Granite (GU), Pinnacle (CHU, CXU), TerraPro (LEU, MRU), and Titan (TD) and model year 2015 LR trucks manufactured from September 1, 2011, through April 30, 2014. The cap nut that retains the interaxle driveshaft yoke to the rear axle input shaft may loosen. If the cap nut loosens and falls off, the yoke can separate from the axle input shaft and allow the drive shaft to disconnect, increasing the risk of a crash. Mack will notify owners, and dealers will replace the cap nut. The input shaft threads will be inspected for damage. Any damaged input shaft will be replaced. These repairs will be performed free of charge. The recall is expected to begin on April 15, 2016. Owners may contact Mack customer service at 1-610-709-2131. Mack's recall campaign number for this recall is SC0399.

16V-099

Blue Bird Body Company (Blue Bird) is recalling certain model year 2008-2009 Vision school buses manufactured from May 10, 2007, through March 5, 2008 and equipped with Caterpillar C707 engines. In the affected buses, the positive starter cable may be incorrectly attached to the same Power Distribution Unit (PDU) stud as the battery cable, exposing the smaller battery cable to a higher current draw during cranking. Exposure to high current draw may cause the battery cable to overheat, melt the wire insulation and increase the risk of a short circuit and a fire. Blue Bird will notify owners, and dealers will relocate the starter cable to the chassis power stud. Any damaged battery cables will be replaced. These repairs will be made free of charge. The recall began on March 10, 2016. Owners may contact Blue Bird customer service at 1-478-822-2242. Blue Bird's recall number for this campaign is R16YL-SB.

16V-100

Blue Bird Body Company (Blue Bird) is recalling certain model year 2009 Vision transit buses manufactured from November 27, 2007, through February 18, 2008, and equipped with Caterpillar C707 engines. In the affected buses, the positive starter cable may be incorrectly attached to the same Power Distribution Unit (PDU) stud as the battery cable, exposing the smaller battery cable to a higher current draw during cranking. Exposure to high current draw may cause the battery cable to overheat, melt the wire insulation and increase the risk of a short circuit and a fire. Blue Bird will notify owners, and dealers will relocate the starter cable to the chassis power stud. Any damaged battery cables will be replaced. These repairs will be made free of charge. The recall began on March 10, 2016. Owners may contact Blue Bird customer service at 1-478-822-2242. Blue

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2016**

Published March 18, 2016

Bird's recall number for this campaign is R16YL-NSB.

16V-101

Kawasaki Motors Corp., U.S.A. (Kawasaki) is recalling certain model year 2016 Ninja ZX-10R and Ninja ZX-10R ABS motorcycles, models ZX1000RGFAL, ZX1000RGFL, ZX1000SGFAL and ZX1000SGFL, manufactured October 28, 2015, to January 18, 2016. In the affected motorcycles, the steering damper bracket mounting bolts may break due to being over tightened. If the steering damper bracket mounting bolts break, the steering damper bracket would detach and could interfere with steering the motorcycle, increasing the risk of a crash. Kawasaki will notify owners, and dealers will replace the steering damper bracket mounting bolts, free of charge. The recall began February 29, 2016. Owners may contact KMC customer service at 1-866-802-9381. Kawasaki's number for this recall is MC16-03.

16V-102

Daimler Trucks North America LLC (DTNA) is recalling certain model year 2012-2017 Thomas Built Buses Minotour school buses manufactured from October 26, 2010, through December 14, 2015 and built on a GM chassis. The affected school buses have a body control module that may fail resulting in intermittent or total loss of exterior lighting or windshield wiper function. Loss of exterior lighting or windshield wiper function can decrease visibility, increasing the risk of a crash. DTNA will notify owners, and dealers will modify the wiring to the body control module, free of charge. The recall is expected to begin on April 18, 2016. Owners may contact DTNA customer service at 1-800-745-8000. DTNA's recall number for this campaign is FL-701.

16V-103

Isuzu Technical Center of America, Inc. (Isuzu) is recalling certain model year 2016 NPR-HD, NPR-XD, NQR, and NRR trucks manufactured July 3, 2015, to September 2, 2015 and equipped with 5.2L diesel engines. The certification label on the affected vehicles may have typographical errors in the rim size, tire pressure and weight information that may prevent the owner from accurately loading and maintaining the vehicle. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." If the rim size, tire pressure and weight information cannot be referenced and understood, the owner may overload the vehicle or underinflate the tires. These conditions may increase the risk of a crash. Isuzu will provide owners with a corrected certification label, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Isuzu customer service at 1-866-441-9638.

16V-105

Temsa Global Sanayi Ve Ticaret A.S. (Temsa) is recalling certain model year 2016 TS35C buses manufactured September 1, 2015, to January 31, 2016, and 2016 TS45 buses manufactured September 1, 2015, to December 31, 2015. In the affected buses, the front lower control arm housings may crack, allowing the components to separate. If the control arm cracks and the components separate, a loss of steering would occur, increasing the risk of a vehicle crash. Temsa will notify owners, and dealers will replace the lower control arms of the front axles, free of charge. The recall is expected to begin in March 2016. Owners may contact Temsa representative CH Bus Sales at 1-407-271-8935.

16V-106

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2016**

Published March 18, 2016

DS Corp DBA Crossroads RV (Crossroads) is recalling certain model year 2016-2017 Z1 Lite travel trailers manufactured January 2, 2016, to February 4, 2016. The affected trailers are equipped with a Suburban furnace, model #NT-20SEQ, that may have an exhaust cover that incorrectly identifies the hot exhaust tube location. If the cover indicates the wrong hot tube location, someone may unexpectedly touch the hot exhaust tube, increasing their risk of injury. Additionally, if a plastic return tube was installed there is an increased risk of fire. Crossroads will notify owners, and dealers will replace the exhaust cover, free of charge. The recall began February 26, 2016. Owners may contact Crossroads customer service at 1-855-226-7496. Crossroad's number for this recall is 40-2015.

16V-107

General Motors LLC (GM) is recalling certain model year 2016 Buick Regal Vehicles manufactured August 30, 2015, to February 12, 2016. The affected vehicles have a power-steering assist system that may fail. A loss of power steering assist may increase the risk of a crash. GM will notify owners, and dealers will replace the electric belt drive rack and pinion steering gear assembly, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Buick customer service at 1-800-521-7300. GM's number for this recall is 21510.

16V-108

Honda (American Honda Motor Co.) is recalling certain model year 2014 NSS300, and NSS300A scooters manufactured June 18, 2013, to September 12, 2013. The rear brake line joint on the affected vehicles may be improperly torqued, causing a brake fluid leak resulting in loss of rear brake pressure. If there is a loss of rear brake pressure due to a fluid leak, it can increase the risk of a crash. Honda will notify owners, and dealers will torque the rear brake line joint to specification, and fill the brake fluid reservoir, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Honda customer service at 1-800-999-1009. Honda's number for this recall is JY3.

16V-109

Ford Motor Company (Ford) is recalling certain model year 2016 F-150 trucks manufactured April 27, 2015, to November 22, 2015, and equipped with Multi-Contour Seats (MCS). The front passenger seat Occupant Classification System (OCS) that calibrates the air bag deployment level may incorrectly classify an adult as a child when the seat massage feature is activated. If an adult is incorrectly classified as a child, the passenger frontal air bag will not deploy during a crash, increasing the risk of injury. Ford will notify owners, and dealers will update the Occupant Classification System Module (OCSM) with new software, free of charge. The recall is expected to begin during March 2016. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 16S05.

16V-110

Ford Motor Company (Ford) is recalling certain model year 2015-2016 Transit vehicles manufactured February 13, 2014, to January 13, 2016 and equipped with rear passenger seats. The rear seat belt buckles may be damaged if a heavy object is placed on, or impacts, the top of the buckle. The damage may prevent the buckle from latching or from remaining latched. An unlatched seat belt increases the risk of injury to the occupant in the event of a crash. Ford will notify owners, and dealers will modify or replace the seat belt buckles, depending on

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2016**

Published March 18, 2016

their location in the vehicle, free of charge. Remedy parts are currently unavailable. Owners were sent interim notices March 9, 2016. Owners will receive a second notice when remedy parts become available. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 16S06.

16V-111

Open Range R.V. Company (Open Range) is recalling certain model year 2012-2015 Journeyer trailers, models JT 337 RLS and JT340FLR, manufactured September 6, 2011, to April 30, 2014. The affected vehicles are equipped with safety chains on the A-frame that are rated for 11,700lbs instead of being rated equal to, or greater than, the gross vehicle weight rating (GVWR) of the travel trailer. In the event the main trailer connection fails, the weight of the trailer can break the safety chains if the chains are not strong enough, allowing the trailer to separate from the vehicle, increasing the risk of a crash. Open Range will notify owners, and dealers will replace the existing safety chains with chains that have a 16,200lb rating, free of charge. The recall began on February 29, 2016. Owners may contact Open Range customer service at 1-260-768-7771. Open Range's number for this recall is 9905277.

16V-112

Chrysler (FCA US LLC) is recalling certain model year 2016 Dodge Dart vehicles manufactured July 25, 2015, to December 16, 2015 and equipped with a 2.0L engine and a manual transmission. Additionally included are certain 2015 Dodge Dart vehicles similarly equipped and brought in for dealer service between September 15, 2015 and January 12, 2016. In the affected vehicles, the powertrain control module that monitors the engine torque output may be missing a backup layer of software. Without a backup layer of software, the control module may fail to prevent an un-commanded torque event, increasing the risk of a crash. Chrysler will notify owners, and dealers will update the Engine Control Module software, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is S10.

16V-113

Chrysler (FCA US LLC) is recalling certain model year 2015 Chrysler 200 vehicles manufactured April 7, 2014, to August 3, 2015. During service work, the affected vehicles may have had either the Occupant Classification Module (OCM) or the Seat Cushion Foam (SCF) of the front passenger seat replaced instead of the both pieces together, which make up a complete calibrated set. If both pieces were not replaced together, the occupant detection and classification system may not be properly calibrated and the passenger air bag may improperly deploy in the event of a crash, increasing the risk of injury. Chrysler will notify owners, and dealers will install a new OCM-SCF seat service kit, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is S09.

16V-114

Open Range R.V. Company (Open Range) is recalling certain model year 2012-2014 Mesa Ridge and Roamer trailers, and 2013-2014 Light trailers manufactured March 23, 2011, to March 20, 2014. In the affected fifth wheel and travel trailers, the Gross Vehicle Weight Rating (GVWR) calculation on the label may be incorrect, which may result in the overloading of the vehicles. If the owners load the trailers based on the incorrect labels,

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2016**

Published March 18, 2016

the trailers may be overloaded, resulting in tire failure, and increasing the risk of a crash. Open Range will notify owners and will provide a label with the corrected weight information, free of charge. The recall is expected to begin during March 2016. Owners may contact Highland customer service at 1-260-768-7771. Open Range's number for this recall is 9905283.

16V-115

Mitsubishi Fuso Truck of America, Inc. (MFTA) is recalling certain model year 2012-2016 FEC52, FEC72, FEC92 trucks manufactured February 4, 2011, to March 31, 2015, and 2012-2015 FGB72 trucks manufactured June 22, 2011, to April 8, 2014. The affected vehicles are equipped with an optional cold weather PVC heater kit. In these vehicles, the PVC pipe heater wiring may chafe on a metal clamp possibly resulting in the wire short circuiting. A short circuit increases the risk of a fire. MFTA will notify owners, and dealers will replace the PVC pipe heater, free of charge. The manufacturer has not yet provided a notification schedule. Owners may call MFTA customer service at 1-877-711-0707. MFTA's number for this recall is C1008310.

16V-116

Hyundai Motor America (Hyundai) is recalling certain model year 2012 Genesis vehicles manufactured August 1, 2011, to April 30, 2012, and 2011-2013 Equus vehicles manufactured July 10, 2011, to June 12, 2012. The windshield wiper motor cover seal on the affected vehicles may degrade allowing corrosion on the wiper motor's circuit board. The corrosion can cause intermittent or total loss of wiper function. Inoperative wipers during inclement weather can decrease driver visibility, increasing the risk of a crash. Hyundai will notify owners, and dealers will replace the wiper motor cover and seal, free of charge. The recall is expected to begin April 22, 2016. Owners may contact Hyundai customer service at 1-800-633-5151. Hyundai's number for this recall is 140.

16V-117

Terex South Dakota, Inc. (Terex) is recalling certain 2008-2015 TLM37, TLM37P, TLM39, TLM41, TLM50, TLM55, and TLLM60 aerial devices manufactured June 18, 2008, to September 28, 2015. On the affected devices, both the boom tip leveling cylinder and the master cylinder at the elbow may make contact with the structural components, potentially damaging the boom tip leveling cylinder rod eye and the master cylinder rod eye. Repeated contact may result in the rod eyes cracking. This cracking can lead to the failure of the boom tip leveling cylinder rod eye and the platform tilting unexpectedly which could cause the occupants to fall from the aerial platform, increasing their risk of injury. Terex will notify owners, and dealers will modify the aerial devices to prevent the components from making contact. The manufacturer has not yet provided a notification schedule. Owners may contact Terex customer service at 1-800-982-8975. Terex's number for this recall is SN621.

16V-118

Nissan North America, Inc. (Nissan) is recalling certain model year 2013-2015 LEAF vehicles manufactured November 19, 2012, to July 31, 2015. During very cold temperatures, the relay inside the electronic brake booster may freeze, requiring the driver to exert more effort to slow the vehicle down. If the brake relay fails, longer distances or additional brake effort would be required to stop the vehicle, increasing the risk of a crash. Nissan will notify owners, and dealers will reprogram the Intelligent Brake Control Unit software, free of charge.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2016**

Published March 18, 2016

The manufacturer has not yet provided a notification schedule. Owners may contact Nissan customer service at 1-800-647-7261.

16V-119

Jayco, Inc. (Jayco) is recalling certain model year 2016 Eagle Half Ton fifth wheels and Eagle travel trailers manufactured April 8, 2015, to February 19, 2016. In the affected trailers, the positive cable (B+) connecting the battery box to the roof-mounted solar panel preparation package may not be protected by a circuit breaker. Without circuit protection, the wire may short circuit, increasing the risk of a fire. Jayco will notify owners, and dealers will tie the unprotected circuit into a 30amp circuit breaker, free of charge. The recall is expected to begin in March 2016. Owners may contact Jayco customer service at 1-800-283-8267. Jayco's number for this recall is 9901286.

16V-120