

MIL LIGHT ON—DTCS P0011, P0016, P0015 AND/OR P0017	TSB 13-5-33
--	-------------

**FORD:**  
2013 Fusion, Escape

This article supersedes TSB 12-10-8 to update the production fix date, update the Part List and Service Procedure.

**ISSUE**

Some 2013 Fusion and Escape vehicles equipped with a 1.6L Gasoline Turbocharged Direct Injection (GTDI) engine and built on or before 4/1/2013, may exhibit Diagnostic Trouble Codes (DTCs) P0011, P0016, P0015 and/or P0017.

**ACTION**

Follow the Service Procedure steps to correct the concern.

**SERVICE PROCEDURE**

1. Replace both variable camshaft timing (VCT) oil control solenoids. Refer to Workshop Manual, Section 303-14.
2. Replace the PCV hose with the new PCV hose which includes 2.5 mm rubber spacers on the hose.

PART NUMBER	PART NAME
CN1Z-6M280-A	Oil Control Solenoid - Intake Camshaft
CN1Z-6M280-B	Oil Control Solenoid - Exhaust Camshaft
BM5Z-6A664-B	PCV Hose

**WARRANTY STATUS:** Eligible Under Provisions Of New Vehicle Limited Warranty Coverage And Emissions Warranty Coverage  
Warranty/ESP coverage limits/policies/prior approvals are not altered by a TSB. Warranty/ESP coverage limits are determined by the identified causal part and verified using the OASIS part coverage tool.

OPERATION	DESCRIPTION	TIME
130533A	2013 Escape, Fusion 1.6L G-TDI: Check DTC And Replace Both Oil Control Solenoids And PCV Hose (Do Not Use With Any Other Labor Operations)	0.5 Hr.

**DEALER CODING**

BASIC PART NO.  
6M280

CONDITION CODE  
49

**NOTE:** The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford or Lincoln dealership to determine whether the Bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supercede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.