

SB-10056146-5973**FORD:**

2012-2014 Focus

ISSUE

Some 2012-2014 Focus vehicles may exhibit a customer concern of early shut-off of the fuel filler nozzle or slow fuel fill.

ACTION

Follow the Service Procedure steps to correct the condition.

SERVICE PROCEDURE

1. Does the customer state the fuel filler nozzle consistently shuts off early while trying to fill the fuel tank?
 - a. Yes - proceed to Step 2.
 - b. No - this procedure does not apply. Refer to Workshop Manual (WSM), Section 310-00 for normal diagnostics.
2. Disconnect and remove the Evaporative Emission (EVAP) canister fresh air vent hose. From the canister end of hose, blow the vent hose out with shop air.
3. Inspect the screen at the open end of fresh air vent hose. Is the interior of the screen contaminated with debris or a spider nest?
4.
 - a. Yes - replace the EVAP canister fresh air vent hose.
 - b. No - install and connect the EVAP canister fresh air vent hose. Refer to WSM, Section 310-00 for normal diagnostics.

PART NUMBER	PART NAME
BV6Z-9G271-E	Hose - Connecting — 5 Door
BV6Z-9G271-C	Hose - Connecting — 4 Door

OPERATION	DESCRIPTION	TIME
140112A	2012-2014 Focus: Disconnect And Blow Air Through The Carbon Canister Fresh-Air Vent Hose. Replace The Carbon Canister Fresh-Air Vent Hose (Do Not Use With Any Other Labor Operations)	0.3 Hr.

WARRANTY STATUS:

Eligible Under Provisions Of New Vehicle Limited Warranty Coverage And Emissions Warranty Coverage
Warranty/ESP coverage limits/policies/prior approvals are not altered by a TSB. Warranty/ESP coverage limits are determined by the identified causal part and verified using the OASIS part coverage tool.

DEALER CODING

BASIC PART NO.	CONDITION CODE
9G271	49

NOTE: The information contained in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford, Lincoln, or Mercury dealership to determine whether the bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supersede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.