

<b>HIGH ROOF BUS/WAGON - HEADLINER LOOSE OR GAP BETWEEN THE HEADLINER AND THE SIDE TRIM PANEL - BUILT ON OR BEFORE 6/1/2015</b>	<b>TSB 15-0133</b>
---	--------------------

**FORD:**  
2015 Transit

**ISSUE**

Some 2015 Transit Bus/Wagon vehicles equipped with a high roof and built on or before 6/1/2015 may experience a loose headliner or a gap of 3-5 mm (1/8 – 1/4 inch) between the headliner and the side trim panel at the C and/or C 1/2 pillar(s).

**ACTION**

Follow the Service Procedure steps to correct the condition.

**SERVICE PROCEDURE**

1. Check the vehicle build date. Refer to Workshop Manual (WSM), Section 100-01. Was the vehicle built on or after 1/15/2015?
  - a. Yes - the vehicle was built on or after 1/15/2015. Use headliner kit A.
  - b. No - the vehicle was built before 1/15/2015. Use headliner kit B.

PART NUMBER	PART NAME
EK4Z-6151916-A	Headliner Kit - A
EK4Z-6151916-B	Headliner Kit - B

OPERATION	DESCRIPTION	TIME
150133A	2015 Transit High Roof With Auxiliary A/C: Install New Pillar Tabs Where Necessary (Do Not Use With Any Other Labor Operations)	0.7 Hr.
150133B	2015 Transit High Roof With Auxiliary A/C: Install New AC Vent Foam Gaskets And Pillar Tabs Where Necessary Includes Time To Remove And Install Middle And Rear Sections Of Headliner (Do Not Use With Any Other Labor Operations)	1.2 Hrs.

**WARRANTY STATUS:**

Eligible Under Provisions Of New Vehicle Limited Warranty Coverage

Warranty/ESP coverage limits/policies/prior approvals are not altered by a TSB. Warranty/ESP coverage limits are determined by the identified causal part and verified using the OASIS part coverage tool.

**DEALER CODING**

BASIC PART NO.	CONDITION CODE
6151916	07

NOTE: The information contained in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford, Lincoln, or Mercury dealership to determine whether the bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supersede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.