



**SB-10056360-6569**

File in Section: -

Bulletin No.: PIP5205

Date: August, 2014

# Service Bulletin

## PRELIMINARY INFORMATION

**Subject:** Rattle Tick From The Fuel Line At The Fuel Tank

**Models:** 2015 Cadillac Escalade  
2015 Chevrolet Suburban, Tahoe  
2015 GMC Yukon Yukon XL  
with engines 5.3L, 6.2L RPO's L83, L86

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

### Condition/Concern

A vehicle may have a concern of a rattle, tick and/or a vibration from the rear of the vehicle.  
This could be coming from the fuel feed line between the fuel tank and ethanol sensor.

### Recommendation/Instructions

If the above concern is encountered, apply pressure to the fuel line to determine if this is the source of the concern.  
If it is determined the fuel line is the source of this concern replace the fuel feed pipe p/n: 12618338 between the chassis line and the high pressure pump.

### Warranty Information

For vehicles repaired under warranty use:

Labor Operation	Description	Labor Time
4026830	Fuel Feed Pipe Replacement	Use Published Labor Operation Time

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.