



TECH TIP: DTCs POC17 and P1C76 not clearing

NUMBER: TT040

MODEL: Optima Hybrid (All)

DATE: 01/13/2014

Symptom: Replaced HPCU results in two codes that will not clear: POC17 (Drive motor "A" position sensor not learned) and P1C76 (Generator position sensor not learned).

Repair: Perform the motor/HSG resolver calibration located in the S/W management section of the "Motor Control Unit" (MCU) system.

Note: Tech Tips are not a substitute for proper diagnosis.