



**KIA MOTORS**  
*The Power to Surprise®*

GROUP  
Body

MODEL  
2011-2013 Optima  
(TF & QF)

NUMBER  
PS235

DATE  
January 2013



**TECHNICAL OPERATIONS**

SUBJECT: HORN CHIRP AND PARKING LAMPS INOP WHEN  
LOCKING DOORS WITH RKE FOB

If you encounter a customer complaint relating to the vehicle not producing an audible tone, or horn chirp, and the parking lamps not flashing when locking the vehicle with the RKE fob, check to make sure the rubber hood stopper (A) is in place on the hood. The rubber stopper depresses the hood switch (B) and if not in place, may cause this condition, and may also prevent the alarm system from operating correctly.

