

# Part 573 Safety Recall Report

# 16V-588

**Manufacturer Name :** Pagani Automobili SpA**Submission Date :** AUG 08, 2016**NHTSA Recall No. :** 16V-588**Manufacturer Recall No. :** NR**Manufacturer Information :**

Manufacturer Name : Pagani Automobili SpA

Address : Via dell'Artigianato, 5  
San Cesario sul Panaro 00 41018

Company phone : 0594739201

**Population :**

Number of potentially involved : 32

Estimated percentage with defect : 100 %

**Vehicle Information :**

Vehicle 1 : 2014-2016 Pagani Huayra

Vehicle Type : LIGHT VEHICLES

Body Style : 2-DOOR

Power Train : GAS

Descriptive Information : All 2014 and 2016 MY Pagani Huayra in the production date range.

Production Dates : APR 21, 2014 - JUL 29, 2016

VIN Range 1 : Begin : NR End : NR

 Not sequential**Description of Defect :**

Description of the Defect : There is a possibility that driver front airbag performance may be affected due to the fastener holes of the driver airbag assembly on the steering wheel assembly are out of tolerances.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : This safety defect could lead to an improper deployment of the airbag and increase the risk of occupant injury in the event of airbag deployment. Pagani does not know of any cases of personal injury or death arising from the defect. Nevertheless, to minimize the risk of a serious incident Pagani is taking the recall action.

Description of the Cause : NR

Identification of Any Warning that can Occur : NR

## Supplier Identification :

### Component Manufacturer

Name : NR  
Address : NR  
NR  
Country : NR

## Chronology :

On July 28th 2016 Pagani conducted routine sample quality control tests on the driver airbag assembly. After a correct deployment of the driver airbag, analysis on the structure of the steering wheel showed marks of excessive damage to the structure near the fastening points of the airbag assembly.

Despite having deployed correctly, Pagani determined that the fastener holes of the airbag assembly were out of tolerances and Pagani could determine that there was a risk of improper airbag deployment in certain circumstances, and that vehicles in the field would be subject to the same defect.

Based on this, Pagani determined on August 1st 2016, that a recall was necessary.

## Description of Remedy :

Description of Remedy Program : Pagani Automobili SpA will provide notice to all customers and dealers to inform them about the safety defect.

Pagani has determined that changing the fasteners on the steering wheel/airbag assembly are an effective remedy to the issue.

This program shall include a plan for reimbursing an owner or purchaser who incurred costs to obtain a remedy for the problem addressed by the recall within a reasonable time in advance of the notification of owners, purchasers and dealers.

How Remedy Component Differs from Recalled Component : The new fasteners compensate for the tolerances of the fastener holes on the steering wheels of the vehicles included in the recall. These fasteners ensure correct positioning and attachment of the airbag assembly.

The remedy solution has been successfully tested and test results confirm the effectiveness of the remedy solution in addressing the safety issue.

The new fasteners to be installed under the recall have different part number, shape and color than the fasteners being replaced under the recall. Further detail is provided in the Pagani technical bulletin to

Identify How/When Recall Condition was Corrected in Production : NR  
dealers.

**Recall Schedule :**

Description of Recall Schedule : NR  
Planned Dealer Notification Date : AUG 05, 2016 - AUG 12, 2016  
Planned Owner Notification Date : AUG 16, 2016 - AUG 26, 2016

\* NR - Not Reported