

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2014**

Published April 30, 2014

CHILD SEATS:

None during March 2014.

EQUIPMENT:

Tucker Rocky Distribution is recalling certain Cyber U-72 size large motorcycle helmets manufactured in June 2012. The affected helmets fail to conform to the impact requirements of Federal Motor Vehicle Safety Standard No. 218, "Motorcycle Helmets." In wearing a noncompliant helmet, the user may not be adequately protected in the event of a crash, increasing the risk of personal injury. Tucker Rocky will attempt to notify owners via signs in dealerships and media outlets since they have no record of the owners. Tucker Rocky will replace the affected helmets, free of charge. The recall began on April 25, 2014. Owners may contact Tucker Rocky at 1-817-258-9018.

14E-005

Meritor Wabco Vehicle Control Systems (Meritor Wabco) is recalling certain trailer spring brake control valves sold as replacement parts with dates codes ending in 0113 through 1113. The affected spring brake control valves (SBCV) have an intake/exhaust valve which may come apart and prevent the parking brake from engaging. If the trailer parking brakes do not engage, an unattached trailer could unexpectedly roll away, increasing the risk of a crash or injury to those nearby. Meritor Wabco will notify owners, and dealers will replace the spring brake control valves, free of charge. The recall is begin on April 7, 2014. Owners may contact Meritor Wabco at 1-248-435-8001.

14E-006

The Gates Corporation (Gates) is recalling certain aftermarket Tru-Flow Water Pumps, part number TFW 41127, sold at certain NAPA Auto Parts and/or installed by automotive service technicians after November 1, 2013 (and manufactured August 2013 through October 2013) that have a black-colored pulley/sprocket or do not have 'US9377' stamped on the water pump housing. These service replacement parts were sold for use in model year 1999-2005 Audi A4, 2000-2006 Audi TT, 1998-2005 Volkswagen Beetle, 1999-2006 Golf, 1999-2008 and 2011-2013 Volkswagen Jetta, and 2000-2005 Volkswagen Passat. In the affected water pumps, the pulley or sprocket that turns the timing belt may develop microfractures causing the timing belt to fail. A failure of the timing belt may cause the engine to shut down, potentially increasing the risk of a vehicle crash. Gates will notify owners, and dealers will replace the water pump, free of charge. The recall is expected to begin on May 5, 2014. Owners may contact The Gates Corporation at 1-303-744-1911.

14E-007

Airtex Products, LP (Airtex) is recalling certain aftermarket replacement fuel pumps, model numbers E8692M, E8692MAX, and E8692UAP, used as service replacement parts for model year 2005-2010 Honda Odyssey vehicles. The fuel pump strainer may begin to deteriorate allowing fuel to leak out. A fuel leak increases the risk of a fire. The manufacturer has not yet provided a notification schedule or remedy plan. Owners may contact Airtex at 1-800-880-3056.

14E-008

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2014**

Published April 30, 2014

Ricon Corporation is recalling certain S series and K series wheelchair lifts manufactured January 1, 2013, through January 4, 2014, and equipped with an optional armored pendant cable. The affected model numbers start with S2003, S2005, S2010, S5505, S5510, K2010, K5505, or K5510 and all of the model numbers end with a 'B' to denote being equipped with an armored pendant cord. The armored cable may be positioned such that it does not clear the wheelchair lift. If the cable does not clear the wheel chair lift it may contact the power lug and if it does not have a nonconductive cover, or it has an improperly installed non-conductive cover, then a short circuit may occur that could result in a fire. Ricon will notify the affected vehicles manufacturers, and will provide a supplemental cover kit and instructions, free of charge. The recall is expected to begin in May 2014. Owners may contact Ricon at 1-818-267-3000. This recall is an expansion of 13E-001.

14E-010

Speedway Motors, Inc. (Speedway) is recalling certain brake light switches with a 3/8 inch IFM adapter fitting, part number 910-31303, used in hot rod and street rod applications. The affected brake light switch may crack under the pressure caused by pushing on the brake pedal, allowing the electrical contact housing to separate from the metal housing. A crack or separation would result in a leak of brake fluid and a loss of hydraulic brake pressure, lengthening the vehicle's stopping distance and increasing the risk of a crash. Speedway will notify owners and will replace the affected part with a redesigned part, free of charge. Owners may contact Speedway Motors at 1-800-979-0122.

14E-011

Muncie Power Products, Inc. (Muncie) is recalling certain PTO Assembly Pressure Switches, part number 30T37594, manufactured June 2009 through June 2013, used in power take off (PTO) assemblies. The installation of these pressure switches when used with a PTO assembly installed on a 2009-2014 Ford F350, F450 or F550 Super Duty chassis with a 6.8L gasoline engine, may result in the switch leaking oil. The leaking oil may soak into the thermal blanket covering the exhaust, which when combined with heat from exhaust, may result in an increased risk of fire. Muncie notified owners under a service campaign on February 10, 2014. Dealers will install a new pressure switch kit that moves the switch away from the exhaust system, free of charge. This action is the same as the service campaign action. Owners may contact Muncie at 1-800-367-7867.

14E-016

TIRES:

None during March 2014.

VEHICLES:

New Flyer Industries Canada ULC (New Flyer) is recalling certain model year 2009 C35LF and L40LFR, model year 2009-2012 C35LFR, model year 2008-2013 C40LF and C40LFR, model year 2013 XN35, model year 2011-2013 XN40 and model year 2012-2013 XN60 transit buses equipped with certain Cummins Westport Model ISL G engines. In the affected vehicles, condensation in the intake manifold may freeze during

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2014**

Published April 30, 2014

cold weather conditions and interfere with the proper operation of the intake manifold pressure sensor. The improper operation of the sensor could induce elevated exhaust temperatures or flames from the exhaust pipe, increasing the risk of a vehicle fire or burn injury to a person near the exhaust pipe. New Flyer will notify owners, and authorized Cummins Inc. and Cummins Wesport Inc. facilities will upload a new ECM calibration, free of charge. The recall began on March 21, 2014. Customers may contact New Flyer at 1-204-934-4876 or Cummins Inc. at 1-800-343-7357. New Flyer's number associated with this recall is R14-006.

14V-087

Porsche Cars North America, Inc. (Porsche) is recalling certain model year 2014 911 GT3 vehicles manufactured October 19, 2013, through January 16, 2014. In the affected vehicles, a piston connecting rod may come loose and damage the engine crankcase. A damaged crankcase may allow engine oil to leak onto hot components in the engine bay which may result in a fire. Porsche will notify owners, and dealers will install a new engine with improved piston connecting rod connections, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Porsche at 1-800-545-8039. Porsche's number for this recall is AE01. Note: Owners are advised not to drive their vehicles until the engine has been replaced.

14V-090

Volvo Bus Corporation (Volvo) is recalling certain model year 2009-2014 9700 coaches equipped with a wheelchair lift. In the affected vehicles, the sliding seats, which can be moved to make room for wheelchair passengers, have lock down handles which can be forced to latch in an incorrect location. Locking the seats incorrectly may cause damage to the handle and allow the seat to not latch properly.

If the sliding seat is not locked in place, the seat may move forward and backwards on the track, increasing the risk of injury to the seat passenger if the coach is involved in a crash. Volvo will notify owners, and dealers will install plates along the sliding seat rail to show correct locking positions and provide an addendum to the operator's manual. The recall began on April 28, 2014. Owners may contact Volvo at 1-800-528-6586. Volvo's number associated with this recall is SR14-82.

14V-091

Prevost Cars, Inc. (Prevost) is recalling certain model year 2013-2014 H3-45 VIP coaches and model year 2014 H3-45 and H3-41 coaches manufactured with KALAS-brand battery cables. In the affected vehicles, the insulation at the crimped terminal ends may not have been stripped back on the power cable to the engine electronic control unit. If the power cable loses connection to the engine electronic control unit, the engine may shut down, increasing the risk of a crash. Prevost will notify owners, and dealers will inspect and replace the battery cables, as necessary, free of charge. The recall began on April 23, 2014. Owners may contact Prevost at 1-877-773-8678. Prevost's number associated with this recall is SR14-10.

14V-095

Prevost Cars, Inc. (Prevost) is recalling certain model year 2011-2012 XLII and X3 shell converted coaches manufactured with an Automatic Fire Suppression System (AFSS) pressure tank in the engine compartment. In the affected vehicles, due to engine compartment temperatures, the AFSS pressure relief tank may discharge its fire extinguishing agent. If the AFSS tank discharges and there is a vehicle fire, the Automatic Fire Suppression System will be unavailable to assist in extinguishing the vehicle fire, increasing the risk of injury. Prevost will notify

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2014**

Published April 30, 2014

owners, and dealers will relocate the pressure relief tank, free of charge. Owners may contact Prevost at 1-877-773-8678. Prevost's number associated with this recall is SR14-16.

14V-096

Landi Renzo USA is recalling certain model year 2011-2014 Ford E-150, E-250, and E-350 vehicles modified January 2, 2011, through February 24, 2014 to operate on compressed natural gas (CNG). In the affected vehicles, the left and right rear brackets that support the rear CNG cylinder may fail, allowing the cylinder to dislodge from the vehicle. If the cylinder dislodges, a CNG leak may result, increasing the risk of a fire. Landi Renzo USA will notify owners, and dealers will inspect and replace the side arm brackets, as necessary, free of charge. The recall began on March 27, 2014. Owners may contact Landi Renzo USA at 1-855-526-3400.

14V-097

Newmar Corporation (Newmar) is recalling certain model year 2013-2014 Bay Star Sport, Bay Star, Canyon Star, Ventana LE, Ventana, Dutch Star, Mountain Aire, and Essex recreational vehicles manufactured February 18, 2013, through November 15, 2013, and equipped with Frigidaire KG series microwaves. In the affected vehicles, the microwave may start on its own. If the microwave starts on its own and there are contents inside, a fire could result. Newmar will notify owners and dealers. The manufacturer has not yet provided a remedy plan or notification schedule. Owners may contact Newmar at 1-800-731-8300.

14V-098

Chrysler Group LLC (Chrysler) is recalling certain model year 2014 Ram 5500 trucks manufactured August 14, 2013, through January 7, 2014. The certification label has the incorrect Gross Vehicle Weight Rating (GVWR). Thus, these vehicles do not conform to Federal Motor Vehicle Safety Standard (FMVSS) number 567 "Certification Regulations." If the Certification Label has the incorrect Gross Vehicle Weight Rating (GVWR), the operator may overload the vehicle, increasing the risk of a crash. Chrysler will notify owners, and dealers will replace all existing certification labels with corrected certification labels, free of charge. The recall began on April 10, 2014. Owners may contact Chrysler at 1-800-853-1403. Chrysler's number associated with this recall is P07.

14V-100

Chrysler Group LLC (Chrysler) is recalling certain model year 2011-2012 Dodge Charger vehicles manufactured May 20, 2010, through November 8, 2011, and equipped with halogen headlamps. In the affected vehicles, a sub-harness for the headlights may overheat and cause the low beam headlights to go out. Loss of headlights reduces the driver's visibility, increasing the risk of a crash. Chrysler will notify owners, and dealers will replace the headlamp jumper harnesses and bulbs, or the headlamp assemblies, as necessary, free of charge. The recall is expected to begin in May 2014. Owners may contact Chrysler at 1-800-853-1403. Chrysler's number associated with this recall is P08. This recall concerns non-police vehicles. A separate campaign was launched in 2012 to address police vehicles. See NHTSA recall 12V-042.

14V-101

Starcraft Bus is recalling certain model year 2009 and 2010 Prodigy and Quest school buses manufactured August 20, 2009, through March 30, 2010, and equipped with A & M Systems-brand door actuators. Voltage

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2014**

Published April 30, 2014

spikes may damage the electrical components and electrical circuits of the door actuator, causing the circuit board to develop high resistance. High resistance may cause the board to overheat, increasing the risk of a fire. Starcraft Bus will notify owners and dealers will replace the affected circuit boards, free of charge. The recall began on March 20, 2014. Owners may contact Starcraft Bus at 1-800-348-7440.

14V-102

Chrysler Group LLC (Chrysler) is recalling certain model year 2014 Fiat 500L vehicles manufactured April 5, 2013, through January 22, 2014. In certain temperatures, moving the transmission shift lever may have a delayed effect or no effect on selecting a transmission gear. If there is no effect, the vehicle might not shift out of the Park position. If there is a delayed effect, the vehicle may move in an unintended or unexpected direction, increasing the risk of a crash. Chrysler will notify owners, and dealers will replace the shifter module or update the shifter software, as necessary, free of charge. The recall began on March 31, 2014. Owners may contact Chrysler at 1-800-853-1403. Chrysler's number associated with this recall is P06.

14V-103

Chrysler Group LLC (Chrysler) is recalling certain model year 2012-2013 Dodge Durango and Jeep Grand Cherokee vehicles manufactured October 11, 2011, through October 1, 2012. Under certain braking events, the Ready Alert Braking System (RAB) may result in the driver experiencing a hard brake pedal feel. If the driver experiences a hard brake pedal, the driver may not push the pedal as intended, lengthening the distance needed to stop the vehicle and increasing the risk of a crash. Chrysler will notify owners, and dealers will update the ABS module software, free of charge. The recall began on April 3, 2014. Owners may contact Chrysler at 1-800-853-1403. Chrysler's number associated with this recall is P05.

14V-104

Daimler Buses North America (DBNA) is recalling certain model year 2007-2012 Orion VII transit buses manufactured January 2007 through October 2012 equipped with certain Cummins Westport Model ISL G engines. Condensation in the intake manifold may freeze during cold weather conditions and interfere with the proper operation of the intake manifold pressure sensor. The improper operation of the sensor could induce elevated exhaust temperatures or flames from the exhaust pipe, increasing the risk of a vehicle fire or burn injury to a person near the exhaust pipe. Cummins Inc. and Cummins Westport Inc. will notify owners, and authorized Cummins service facilities will upload a new ECM calibration, free of charge. The recall began on April 12, 2014. Owners may contact DBNA at 1-905-403-7807 or Cummins Inc. at 1-800-343-7357. Cummins' number for this recall is C1462 (for ISL G engines) or C1461 (for ISX12 G engines).

14V-106

Navistar, Inc. is recalling certain model year 2014 International Prostar trucks manufactured September 2013 through December 2013, and equipped with feature code 14GXP 6X2 rear axles with 'R' hubs and Dual Track rear axles. In the affected vehicles, axle shafts of an incorrect length may have been installed which can cause the splines on the axle shafts to be only partially engaged into the side gears of the rear axle differential. The partial engagement could cause the axle shaft splines or side gears to fail which may result in loss of power to the drive wheels causing the vehicle to stall on the roadway, increasing the risk of a crash. Navistar will notify owners, and dealers will replace the incorrect wheel hubs and axle shafts with the correct ones and replace any damaged side

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2014**

Published April 30, 2014

gears, free of charge. The recall began on March 18, 2014. Owners may contact Navistar at 1-800-448-7825. Navistar's number associated with this recall is 14506.

14V-107

Eldorado National-California, Inc. (Eldorado) is recalling certain model year 2007-2014 Axess transit buses, 2008-2014 E-Z Rider II transit buses, and 2008-2012 XHF transit buses, equipped with certain Cummins Westport Model ISL G or ISX12 G engines. Condensation in the intake manifold may freeze during cold weather conditions and interfere with the proper operation of the intake manifold pressure sensor. The improper operation of the sensor could induce elevated exhaust temperatures or flames from the exhaust pipe, increasing the risk of a vehicle fire or burn injury to a person near the exhaust pipe. Cummins Inc. and Cummins Westport Inc. will notify owners, and authorized Cummins service facilities will upload a new ECM calibration, free of charge. The manufacturer has not yet provided a notification schedule. Owners may also contact Eldorado National-California, Inc. at 1-909-591-9557 or Cummins at 1-800-343-7357.

14V-108

American Honda Motor Co., Inc. (Honda) is recalling certain model year 2014 Honda Civic LX vehicles manufactured November 26, 2013, through January 21, 2014. In the affected vehicles, during mounting of the tires, the tire bead may have gotten pinched between the assembly equipment and the steel wheel rims, resulting in damage to the tire. The tire damage could cause the tire to lose air, increasing the risk of a crash. Honda will notify owners, and dealers will inspect and replace any damaged tire, free of charge. The recall began on April 16, 2014. Owners may contact Honda at 1-800-999-1009. Honda's number for this recall is JD8.

14V-109

Blue Bird Body Company (Blue Bird) is recalling certain model year 2014 Vision and All American school buses manufactured January 21, 2013, through February 28, 2013. In the affected vehicles, the joint between the rear wheelhousing and body gusset panel may have partially separated during manufacturing. Thus, these vehicles do not conform to Federal Motor Vehicle Safety Standard (FMVSS) number 221, "School Bus Body Joint Strength." A joint separation between the rear wheelhousing and body gusset panel may increase the risk the injury to bus occupants in the event of a crash. Blue Bird will notify owners, and dealers will inspect the joint connections and install a two part adhesive and mechanical fasteners, as necessary, free of charge. The recall began on April 24, 2014. Owners may contact Blue Bird at 1-478-822-2242. Blue Bird's number for this recall is R14XC.

14V-110

Contract Manufacturer, LLC (CM Trailers) is recalling certain model year 2012 Cargo Van and Revolution trailers equipped with certain Hydrastar and Hydrastar XL trailer brake actuators produced from October 5, 2011, through December 9, 2011. One of the rotating components in the hydraulic pump missed a heat treat operation causing the actuator to wear at a higher than normal rate. As a result, the hydraulic pump could fail and result in a loss of braking ability in the trailer. Loss of braking ability can lead to loss of control of the trailer, increasing the risk of a crash, serious injuries, or property damage. CM Trailers will notify owners, and dealers will replace the hydraulic pumps, free of charge. The recall began on March 21, 2014. Owners may contact CM Trailers at 1-888-268-7577.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2014**

Published April 30, 2014

14V-111

American Honda Motor Co., Inc. (Honda) is recalling certain 2005-2010 Honda Odyssey vehicles manufactured June 23, 2004, through September 4, 2010. In the affected vehicles, the fuel pump strainer cover may deteriorate allowing fuel to leak out. A fuel leak increases the risk of a fire. Parts to permanently repair the affected vehicles are not currently available. Honda will notify owners with an interim letter during May 2014. A second notice will be mailed to owners when the remedy becomes available, currently expected to be during the summer of 2014. Any vehicles that are currently leaking from the fuel pump cover will get a replacement, original cover. All vehicles, including those receiving the interim repair, will get an improved cover when they are available. Owners may contact Honda at 1-800-999-1009. The recall numbers associated with this campaign are JD9 (inspection and/or preliminary part replacement) and JE0 (final parts replacement).

14V-112

Great Dane Trailers (Great Dane) is recalling certain model year 2013-2015 flatbed trailers. In the affected trailers, the brackets used to store aluminum J-hook cargo restraint plates may break and allowing the cargo restraint plates that are stored on the bracket to fall from the trailer. If the bracket breaks, the falling restraint plates may become a road hazard for drivers of other vehicles, increasing the risk of a crash. Great Dane will notify owners, and dealers will replace the defective brackets with a newly designed bracket, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Great Dane at 1-800-633-4176.

14V-113

Mazda North America Operations (Mazda) is recalling certain model year 2010-2012 Mazda6 vehicles manufactured September 14, 2009, through May 2, 2011, and equipped with 2.5L engine. In the affected vehicles, spiders may weave a web in the evaporative canister vent hose, blocking it and causing the fuel tank to have an excessive amount of negative pressure. Negative pressure could cause the fuel tank to crack resulting in a fuel leak, increasing the risk of a fire. Mazda will notify owners, and dealers will reprogram the powertrain control module and inspect and clean the canister vent line. If a web was found in the line, the fuel tank and check valve on canister vent line will be replaced. These repairs will be done free of charge. The recall began on April 30, 2014. Owners may contact Mazda at 1-800-222-5500. Mazda's recall number associated with this campaign is 7214C.

14V-114

Triple E Recreational Vehicles (Triple E RV) is recalling certain model year 2014 Free Spirit FS22, FS22SS, and FS22TE motorhomes manufactured September 2013 through March 2014. In the affected vehicles, the spare tire carrier and spare tire cover obstructs the visibility of the driver's side taillight. If the driver's side taillight is obstructed, drivers behind the vehicle may not see the motorhome's intention to turn left, increasing the risk of a crash. Triple E RV will notify owners, and dealers will replace the old tire carrier with a newly designed one, free of charge. The recall began on April 9, 2014. Owners may contact Triple E RV at 1-877-992-9906. Triple E RV's number associated with this recall is CA#7841-1.

14V-115

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2014**

Published April 30, 2014

General Motors LLC (GM) is recalling certain model year 2013-2014 Cadillac XTS vehicles manufactured February 14, 2012, through March 7, 2014. In the affected vehicles, a cavity plug on the brake booster pump connector may dislodge allowing corrosion of the brake booster pump relay connector. The corrosion of the brake booster pump relay connector may cause a resistive short and melt the connector, increasing the risk of a fire. GM will notify owners, and dealers will apply sealant to the connector cavity plugs, re-route the vacuum pump vent hose and replace the front body wiring harnesses as needed, free of charge. The recall began on April 7, 2014. Owners may contact Cadillac at 1-866-982-2339. GM's number for this recall is 14062.

14V-116

General Motors LLC (GM) is recalling certain model year 2009-2014 Chevrolet Express and GMC Savana vans manufactured January 27, 2009, through March 7, 2014 with a gross vehicle weight rating of 10,000 pounds and less and equipped with front passenger air bags. In the affected vehicles, during a frontal impact below the air bag deployment threshold, if an unbelted front passenger's head hits the instrument panel above where the passenger air bag is located, the panel may not sufficiently absorb the impact. As such, these vehicles fail to meet the requirements of Federal Motor Vehicle Safety Standard number 201, "Occupant Protection in Interior Impact." In the event of a crash below the air bag deployment threshold, an unbelted front passenger seat occupant has an increased risk of injury. GM will notify owners, and dealers will modify the passenger instrument panel free of charge. Notices to the owners of the heavy duty vans were mailed on April 28, 2014. Notification to owners of the light vans is expected to begin on May 16, 2014. Chevrolet owners may call 1-800-630-2438. GMC owners may call 1-866-996-9463. GM's number for this recall is 14082.

14V-117

General Motors LLC (GM) is recalling certain model year 2008-2013 Buick Enclave and GMC Acadia and 2009-2013 Chevrolet Traverse and 2008-2010 Saturn Outlook vehicles. In the affected vehicles, increased resistance in the driver and passenger seat mounted side impact air bag (SIAB) wiring harnesses may result in the SIAB and seat belt pretensioners not deploying in the event of a crash. Failure of the side impact air bags and seat belt pretensioners to deploy in a crash increase the risk of injury to the driver and front seat occupant. GM will notify owners, and dealers will replace the affected harness connections with soldered connections, free of charge. The recall began on April 29, 2014. Buick owners may contact the owner center at 1-800-521-7300, Chevrolet owners at 1-866-694-6546, Saturn at 1-800-553-6000, and GMC owners at 1-866-996-9463. GM's number for this recall is 14030. Note: Vehicles repaired as part of Customer Satisfaction Campaign 10085 and special coverage 10335 have already had the subject condition repaired and therefore are not included in the safety recall.

14V-118

Zero Motorcycles, Inc. (Zero) is recalling certain model year 2014 Zero SR motorcycles manufactured December 30, 2013, through February 20, 2014, 2014 Zero S motorcycles manufactured December 26, 2013, through February 18, 2014, Zero DS motorcycles manufactured January 24, 2013, through February 4, 2014, and 2014 Zero FX motorcycles manufactured January 14, 2014, through January 27, 2014. Due to a possible manufacturing defect, the motor rotor may contact the stator while riding. If the rotor contacts the stator, the motor could seize, locking up the rear wheel which could increase the risk of a crash. Zero will notify owners, and dealers will test the motor and if it fails testing, replace it, free of charge. The recall is expected to begin in

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2014**

Published April 30, 2014

May 2014. Owners may contact Zero at 1-888-786-9316 (1-888-RUN-ZERO).

14V-119

Keystone RV Company (Keystone) is recalling certain model year 2014 Cougar, Springdale, Hideout, Passport, and Bullet fifth wheels and travel trailers manufactured January 13, 2014, through February 12, 2014. In the affected vehicles, the inner wheel bearings on the axle may have insufficient lubrication. With an insufficient amount of lubrication, the wheel bearing and hub may become overheated and the wheel may seize or separate from the vehicle, increasing the risk of a crash. Keystone will notify owners, and dealers will inspect the axle hubs and bearings for the proper lubrication. Any damaged bearings will be replaced. These repairs will be performed, free of charge. The recall began on April 7, 2014. Owners may contact Keystone at 1-866-425-4369. Keystone's number associated with this recall is 14-202.

14V-120

Winnebago Industries, Inc. (Winnebago) is recalling certain model year 2014-2015 Travato, 2014 Trend, and 2014 Itasca Viva! motorhomes manufactured November 13, 2013, through February 11, 2014, and built on the Ram ProMaster chassis. In the affected vehicles, if the accelerator pedal is pushed downward at a certain angle, the pedal may get stuck in the wide open throttle position due to interference with the accelerator pedal stopper. A stuck accelerator pedal can result in uncontrolled acceleration, increasing the risk of a crash. Chrysler has notified owners, and dealers will replace the accelerator pedal stopper with a larger one, free of charge. The recall began on March 27, 2014. Owners may contact Winnebago at 1-800-537-1885.

14V-121

Terex Aerial Work Platforms (Terex) is recalling certain model year 2014 TZ-50 trailer-mounted aerial work platforms. A process change in welding of the tubes may result in a crack in one of the welds on the extendable boom section. This could cause failure of the welds in that section. If the welding of the tubes crack, the aerial platform may fall, increasing the risk of injury to the individual on the platform or people around it. Terex has notified owners, and dealers will replace the boom sections, free of charge. The recall began on March 14, 2014. Owners may contact Terex at 1-800-536-1800.

14V-122

Jaguar Land Rover North America, LLC (Jaguar) is recalling certain model year 2013 XF and XJ vehicles manufactured March 26, 2013, through April 10, 2013. In these vehicles, the certification label that is intended to specify the required Gross Vehicle Weight Rating (GVWR), Gross Axle Weight Rating (GAWR) front, Gross Axle Weight Rating (GAWR) rear, the manufacture date and country of manufacture is absent. Thus, the vehicles do not conform to Part 567, "Certification." If the certification label does not specify all the necessary information or the vehicle weight range could result in the vehicle being overloaded and increase the risk of a crash. Jaguar will notify owners and dealers will re-acquire and will provide a replacement vehicle or a full refund of the purchase, free of charge. Owners may contact Jaguar at 1-855-524-8278. Jaguar's number associated with this recall is J039.

14V-123

Crane Carrier Company (Crane) is recalling certain model year 2008-2014 LET2, COE, LDT2, and LE2 refuse

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2014**

Published April 30, 2014

vehicles manufactured April 16, 2008, through February 28, 2014, and equipped with certain Cummins Westport Model ISL G engines. Condensation in the intake manifold may freeze during cold weather conditions and interfere with the proper operation of the intake manifold pressure sensor. The improper operation of the sensor could induce elevated exhaust temperatures or flames from the exhaust pipe, increasing the risk of a vehicle fire or burn injury to a person near the exhaust pipe. Cummins Inc. and Cummins Westport Inc. will notify owners, and authorized Cummins service facilities will upload a new ECM calibration, free of charge. The manufacturer has not yet provided a notification schedule. Customers may contact Crane at 1-918-832-7305 or Cummins Inc. at 1-800-343-7357.

14V-124

Volkswagen Group of America (Volkswagen) is recalling certain model year 2012-2013 Passat vehicles manufactured January 2011 through November 2012. In the affected vehicles, the low beam headlight bulb may become loose and lose electrical contact. A loss of low beam headlights may reduce the driver's visibility and increase the risk of a crash. Volkswagen will notify owners, and dealers will replace the bulb holder, free of charge. The recall is expected to begin in May 2014. Owners may contact Volkswagen at 1-800-822-8987. Volkswagen recall number associated with this campaign is 94G8/7V.

14V-125

Thor Motor Coach (Thor) is recalling certain model year 2013-2014 Challenger and Tuscan recreational vehicles, and 2014 Tuscan XTE and Palazzo recreational vehicles manufactured March 8, 2013, through August 8, 2013, and equipped with certain Frigidaire KG-series microwave models CFMV152CLB and CFMV154CLS manufactured January 27, 2013, through April 10, 2013 in the serial number range KG30607951 through KG31600670. In the affected vehicles, the microwave may start on its own and begin heating when unattended. If the microwave starts on its own and there are contents inside, a fire could result. Thor will notify owners, and dealers will repair the membrane/keypad component, free of charge. The recall is expected to begin in May 2014. Owners may contact Thor Motor Coach at 1-877-500-1020. Thor's number for this recall is RC000088. Note: Until the microwave has been repaired, owners should not store anything in the microwave while it is unattended.

14V-127

Heartland Recreational Vehicles, LLC (Heartland) is recalling certain model year 2013 Bighorn Silverado, 2014 Bighorn and 2013-2014 Cyclone, and Landmark fifth wheel trailers equipped with certain Frigidaire KG-series microwaves, models CFMV152CLB and CFMV154CLS, manufactured January 27, 2013, through April 10, 2013 in the serial number range KG30607951 through KG31600670. In the affected vehicles, the microwave may start on its own and begin heating when unattended. If the microwave starts on its own and there are contents inside, a fire could result. Heartland will notify owners and dealers will repair the membrane/keypad component, free of charge. The recall is expected to begin in May 2014. Owners may contact Heartland at 1-877-262-8032. Heartland's number for this recall is 99-01-17. Note: Until the microwave has been repaired, owners should not store anything in the microwave while it is unattended.

14V-128

Nissan North America, Inc. (Nissan) is recalling certain model year 2014 Infiniti QX80 vehicles manufactured

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2014**

Published April 30, 2014

December 2, 2013, through January 27, 2014, and equipped with 20 inch wheels. In the affected vehicles, the Certification label incorrectly lists the Gross Axle Weight Rating (GAWR) as 4,497 lb instead of the correct 4,343 lb. As such, the vehicles do not comply with Part 567 "Certification Regulation." An incorrect GAWR listing may result in the vehicle being overloaded which may increase the risk of a crash. Nissan will notify owners, and will mail owners a corrected Certification label, free of charge. The recall is expected to begin in May 2014. Owners may contact Infiniti at 1-800-662-6200.

14V-129

Autocar Industries, LLC, (Autocar) is recalling certain model year 2014 Xpert trucks manufactured November 7, 2013, through January 13, 2014, and equipped with certain Cummins Westport Model ISL G or ISX12 G engines. Condensation in the intake manifold may freeze during cold weather conditions and interfere with the proper operation of the intake manifold pressure sensor. The improper operation of the sensor could induce elevated exhaust temperatures or flames from the exhaust pipe, increasing the risk of a vehicle fire or burn injury to a person near the exhaust pipe. Cummins Inc. and Cummins Westport Inc. will notify owners, and authorized Cummins service facilities will upload a new ECM calibration, free of charge. The recall is expected to begin May 1, 2014. Owners may contact Autocar at 1-765-489-5499 or Cummins Inc. at 1-800-343-7357. Autocar's number for this recall is M-1404.

14V-130

Autocar Industries, LLC (Autocar) is recalling certain model year 2010-2014 Xspotter vehicles manufactured November 23, 2009, through October 21, 2013, and equipped with Cummins Westport Model ISL G and ISX12 G engines. Condensation in the intake manifold may freeze during cold weather conditions and interfere with the proper operation of the intake manifold pressure sensor. The improper operation of the sensor could induce elevated exhaust temperatures or flames from the exhaust pipe, increasing the risk of a vehicle fire or burn injury to a person near the exhaust pipe. Cummins Inc. and Cummins Westport Inc. will notify owners, and authorized Cummins service facilities will upload a new ECM calibration, free of charge. The recall began on April 12, 2014. Owners may contact Autocar at 1-765-489-5499 or Cummins Inc. at 1-800-343-7357. Autocar's number for this recall is T-1403.

14V-131

Autocar, LLC (Autocar) is recalling certain model year 2008-2014 ACX, WX, and WXLL vehicles manufactured July 30, 2007, through February 10, 2014, and equipped with certain Cummins Westport Model ISL G or ISX12 G engines. Condensation in the intake manifold may freeze during cold weather conditions and interfere with the proper operation of the intake manifold pressure sensor. The improper operation of the sensor could induce elevated exhaust temperatures or flames from the exhaust pipe, increasing the risk of a vehicle fire or burn injury to a person near the exhaust pipe. Cummins Inc. and Cummins Westport Inc. will notify owners, and authorized Cummins service facilities will upload a new ECM calibration, free of charge. The recall is expected to begin May 1, 2014. Owners may contact Autocar at 1-765-489-5499 or Cummins Inc. at 1-800-343-7357. Autocar's number for this recall is A-1402.

14V-132

Autocar Industries, LLC (Autocar) is recalling certain model year 2012-2014 Xpert vehicles manufactured July

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2014**

Published April 30, 2014

11, 2011, through March 5, 2014. The bolts used to anchor the seat belts may be insufficiently tight to withstand the forces experienced in certain crashes. As such, these vehicles do not conform to Federal Motor Vehicles Safety Standard (FMVSS) number 209, "Seat Belt Assemblies." If the seat belt does not properly restrain the seat occupant, there is an increased risk of injury in the event of a crash. Autocar will notify owners, and dealers will tighten the seat belt mounting bolts, free of charge. The recall is expected to begin in May 2014. Owners may contact Autocar at 1-765-489-5499. Autocar's number for this recall is M-1401.

14V-133

Crossroads RV is recalling certain model year 2014 Redwood trailers manufactured March 12, 2013, through July 22, 2013, equipped with certain Frigidaire KG-series microwaves, models CFMV152CLB and CFMV154CLS, manufactured January 27, 2013, through April 10, 2013, in the serial number range KG30607951 through KG31600670. In the affected vehicles, the microwave may start on its own and begin heating when unattended. If the microwave starts on its own and there are contents inside, a fire could result. Crossroads RV will notify owners, and dealers will repair the membrane/keypad component, free of charge. The recall is expected to begin in May 2014. Owners may contact Crossroads at 1-855-226-7496.

14V-134

McNeilus Truck & Manufacturing, Inc. (McNeilus) is recalling certain model year 2013-2014 McNeilus Concrete Standard and Bridgemaster V concrete mixers, manufactured October 25, 2013, through February 14, 2014, and equipped with the optional vertical chute rack design. The subject vehicles have extension chutes that can unexpectedly fall out of the rack. An extension chute that falls from the rack may create a road hazard, increasing the risk of a crash. McNeilus will notify owners, and dealers will replace the vertical chute rack with a new design, free of charge. Owners may contact McNeilus at 1-507-374-6321. McNeilus' number for this recall is 41-0967369.

14V-135

Keystone RV Company (Keystone) is recalling certain model year 2013-2014 Montana, 2014 Alpine, Big Sky, and Fuzion, and 2014 Dutchmen Infinity and Voltage fifth wheel trailers equipped with Frigidaire KG series microwaves, models CFMV152CLB and CFMV154CLS, manufactured January 27, 2013, through April 10, 2013, in the serial number range KG30607951 through KG31600670. In the affected vehicles, the microwave may start on its own and begin heating when unattended. If the microwave starts on its own and there are contents inside, a fire could result. Keystone will notify owners, and dealers will repair the membrane/keypad component, free of charge. The recall began on April 30, 2014. Owners may contact Keystone Customer Service by calling 1-866-425-4369. Keystone's number for this recall is 14-204.

14V-136

Mack Trucks Inc. (Mack) is recalling certain model year 2014-2015 CXU, 2010-2015 LEU, and 2011-2015 MRU vehicles manufactured with certain Cummins Westport Model ISL G and ISX12 G engines. Condensation in the intake manifold may freeze during cold weather conditions and interfere with the proper operation of the intake manifold pressure sensor. The improper operation of the sensor could induce elevated exhaust temperatures or flames from the exhaust pipe, increasing the risk of a vehicle fire or burn injury to a person near the exhaust pipe. Cummins and Cummins Westport will notify owners, and authorized Cummins

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2014**

Published April 30, 2014

service facilities will upload a new ECM calibration, free of charge. The manufacturer has not yet provided a notification schedule. Customers may contact Mack at 1-336-393-2000 or Cummins Inc. at 1-800-343-7357. Mack's number for this recall is SC0377.

14V-137

Nissan North America, Inc. (Nissan) is recalling certain model year 2013-2014 Altima, LEAF, Pathfinder, and Sentra, model year 2013 NV200 (aka Taxi) and Infiniti JX35 and model year 2014 Infiniti Q50 and QX60 vehicles. In the affected vehicles, the occupant classification system (OCS) software may incorrectly classify the passenger seat as empty, when it is occupied by an adult. If the OCS does not detect an adult occupant in the passenger seat, the passenger airbag would be deactivated. Failure of the passenger airbag to deploy during a crash (where deployment is warranted) could increase the risk of injury to the passenger. Nissan will notify owners, and dealers will update the OCS software, free of charge. The recall is expected to begin in mid-May 2014. Owners may contact Nissan at 1-800-647-7261.

14V-138

Volvo Trucks North America (Volvo) is recalling certain model year 2013-2015 VNL trucks, and 2013-2014 VNM trucks equipped with certain Cummins Westport Model ISL G and ISX12 G engines. Condensation in the intake manifold may freeze during cold weather conditions and interfere with the proper operation of the intake manifold pressure sensor. The improper operation of the sensor could induce elevated exhaust temperatures or flames from the exhaust pipe, increasing the risk of a vehicle fire or burn injury to a person near the exhaust pipe. Cummins Inc. and Cummins Westport Inc. will notify owners, and authorized Cummins service facilities will upload a new ECM calibration, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Volvo at 1-800-528-6586. Volvo's number for this recall is RVXX1401.

14V-139

Forest River, Inc. (Forest River) is recalling certain model year 2014 Crusader fifth wheel trailers, model CSF315RST, manufactured September 26, 2013, through March 3, 2014. In the affected trailers, the slide room actuator bracket may come into contact with the tire under certain road conditions. If the bracket comes in contact with the tire, sudden tire failure may result, increasing the risk of a crash. Forest River will notify owners, and dealers will install a replacement bracket that will adequately clear the tire, free of charge. Parts are not currently available. Forest River expects to send an interim notification in April 2014. When parts are available, owners will be mailed a second letter to come in to have the part installed. Owners may contact Forest River at 1-574-862-3001.

14V-140

KZRV, L.P. (KZ) is recalling certain 2014 Sportsmen, model S290IKSS, towable travel trailers manufactured November 4, 2013 through February 24, 2014. The affected trailers were built with axles not designed to accommodate the weight carrying capacity of the trailer. Overloaded axles may result in failure of the suspension or the axle, and/or tire blowouts, resulting in an increased risk of a crash or injury. KZRV, L.P. will notify owners, and dealers will replace the axles with ones that have the correct load capacity, free of charge. The recall is scheduled to begin in May 2014. Owners may contact KZRV L.P. at 1-800-768-4016.

14V-141

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2014**

Published April 30, 2014

Nissan North America (Nissan) is recalling certain model year 2013 Pathfinder vehicles manufactured April 18, 2012, through October 3, 2012, and equipped with a continuously variable transmission (CVT). In the affected vehicles, the internal oil cooler (ITOC) hose may detach from the cooler due to inadequate clamping force, allowing transmission fluid to leak. The loss of transmission fluid could cause the transmission to function improperly and the vehicle to stop accelerating, increasing the risk of a crash. Nissan will notify owners, and dealers will install an oil hose repair kit, free of charge. The recall will begin in May 2014. Owners may contact Nissan at 1-800-647-7261.

14V-142

NABI Bus, LLC (NABI) is recalling certain model year 2013-2014 40LFW transit buses manufactured October 5, 2012, through March 17, 2014, 2013 35LFW transit buses manufactured October 21, 2013, through January 14, 2014, and 2013 31LFW transit buses manufactured February 10, 2013, through October 19, 2013, and equipped with compressed natural gas (CNG) fuel systems. In the subject vehicles, a bolt on the latch assembly that holds the CNG top covers closed may come into contact with the CNG fuel cylinder. Bolt contact with the CNG cylinder may damage the CNG fuel cylinder, potentially causing a fuel leak, increasing the risk of a fire. NABI Bus, LLC will notify owners, and dealers will eliminate the possible interference, free of charge. Owners may contact NABI Bus at 1-256-831-4296. NABI's number for this recall is 20142.

14V-143

General Motors LLC (GM) is recalling certain model year 2014 Cadillac ELR vehicles not equipped with adaptive cruise control and manufactured September 26, 2013, through February 14, 2014, and equipped without adaptive cruise control. In these vehicles, the electronic stability control (ESC) system software may inhibit certain ESC diagnostics, preventing the system from alerting the driver that the ESC system is partially or fully disabled. As such, these vehicles fail to conform with Federal Motor Vehicle Safety Standard (FMVSS) number 126, "Electronic Stability Control Systems." If the driver is not alerted to an ESC malfunction they may continue driving with a disabled ESC system which may result in loss of directional control, increasing the risk of a crash. GM will notify owners, and dealers will recalibrate the Electronic Brake Control Module (EBCM), free of charge. The recall is expected to begin on May 16, 2014. Owners may contact Cadillac at 1-800-458-8006. GM's number for this recall is 14087.

14V-144

PACCAR, Inc. (PACCAR) is recalling certain model year 2008-2013 Peterbilt 365, 367, 388, 389 trucks manufactured October 6, 2007, through September 23, 2013. The affected vehicles were built with 16.5" x 7" front drum brakes and Bendix ES-420 brake linings installed on front axles rated to carry between 20,001 and 22,000 lbs GAWR and larger SLR (20.5" to 21.5") tires, however these brake linings are not rated for this configuration. Thus, these vehicles fail to comply with Federal Motor Vehicle Safety Standard (FMVSS) number 121, "Air Brake Systems." The improper brake configuration could lengthen the braking distance needed to stop the vehicle, increasing the risk of a crash. PACCAR will notify owners and dealers will install new 16.5" x 7" brake shoes with ES-600 linings, free of charge. The recall is expected to begin in May 2014. Owners may contact at Peterbilt at 1-800-473-8372. Peterbilt's number for this recall is 314-D.

14V-145

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2014**

Published April 30, 2014

Keystone RV Company (Keystone) is recalling certain model year 2014 Summerland, Springdale, Bullet, and Cougar recreational travel trailers and fifth wheels. The affected vehicles may have been built with frame spring hangers that may be brittle and susceptible to fracturing. A spring hanger that fractures may result in a loss of control of the trailer, increasing the risk of a crash. Keystone will notify owners, and dealers will inspect and replace the spring hanger, as necessary, free of charge. The recall began on April 17, 2014. Owners may contact Keystone at 1-866-425-4369. Keystone's number for this recall is 14-205.

14V-146

Toyota is recalling certain model year 2003-2004 Avalon vehicles manufactured June 5, 2002, through December 20, 2004. In these vehicles, the supplemental restraint system (SRS) circuits are susceptible to internal shorting. The electrical short may create an abnormal current flow and increased heat which can damage the circuits. This could result in an inadvertent deployment of the front air bags and/or seat belt pretensioners. Inadvertent deployment of the air bags or the seat belt pretensioners increases the risk of an injury or crash. Toyota will notify owners and dealers will install a noise filter between the air bag control module and the wire harness, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Toyota at 1-800-331-4331.

14V-147

Toyota is recalling certain model year 2013 Highlander vehicles manufactured March 13, 2013, through August 6, 2013. In the affected vehicles, the second row left hand seat may not lock in place when positioned in the forward front or second adjusting position. As such, the vehicles do not conform to Federal Motor Vehicle Safety Standard (FMVSS) number 207, "Seating Systems." If the seat does not lock into the seat track, there may be an increased risk of injury to an occupant in the event of a crash. Toyota will notify owners, and dealers will modify the second row left hand seat so that it will lock into the seat track, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Toyota at 1-800-331-4331.

14V-148

Tiffany Coach Builders (Tiffany) is recalling certain model year 2009-2010 Coach, Limo, and Shuttle Buses built on Ford E-450 and E550 chassis, equipped with A&M Systems-brand door actuators. Voltage spikes may damage electrical components and electrical circuits, causing the circuit board to develop high resistance. High resistance may cause the board to overheat, increasing the risk of a fire. Tiffany will work with A&M Systems to notify owners and dealers will replace the circuit board, free of charge. The recall is expected to begin in May 2014. Owners may contact Tiffany at 1-800-338-5872.

14V-149

Daimler Trucks North America LLC (DTNA) is recalling certain model year 2014 Freightliner 108SD, 114SD, 122SD, Coronado, Argosy, Cascadia, Columbia, and M2 Business Class, and Western Star 4700, and 4900 vehicles manufactured August 5, 2013, through November 15, 2013, and equipped with IMMI-brand L9 seat belt buckles. When the button is pressed to release the seat belt, the latch plate can become partially engaged with the buckle, making the seat belt difficult to unlatch. Thus, these vehicles fail to conform to the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 209, "Seat Belt Assemblies." If the latch plate remains partially engaged after the button is pressed, egress from the vehicle could be hindered which would increase the

SAFETY DEFECT/NONCOMPLIANCE NOTICES RECEIVED DURING MARCH 2014

Published April 30, 2014

risk of injury in the event of an emergency. DTNA will notify owners, and dealers will inspect and replace the seat belt buckle, as necessary, free of charge. The recall is expected to begin by May 27, 2014. Owners may contact Daimler at 1-800-385-4357. DTNA's number for this campaign is FL-661. Note: This is an expansion of recall 13V-604.

14V-150

General Motors LLC (GM) is recalling certain model year 2013 and 2014 Chevrolet Cruze vehicles equipped with a 1.4L turbo engine, and manufactured between November 28, 2012, and March 7, 2014. On the affected vehicles, the right front half shaft may fracture and separate. If the half shaft fractures and separates while driving, the vehicle would lose power and coast to a stop. If a vehicle with a fractured half shaft is parked without the parking brake applied, the vehicle could move unexpectedly. Either condition increases the risk of a crash. GM will notify owners, and dealers will inspect and replace the right half shaft, as needed, free of charge. Parts for the remedy are not currently available. GM will send an interim letter to owners May 2014. A second owner letter will be mailed when parts are available. Owners may contact Chevrolet at 1-866-694-6546. GM's number for this recall is 14079. This is an expansion of recall 13V-452. NOTE: Some vehicles subject to this recall were subject to the recall campaign initiated in 2013. Some of those vehicles were repaired using defective parts. Those owners will be advised that they must have their vehicles remedied again under this campaign and that having the earlier recall completed did not remedy their vehicles.

14V-151

General Motors LLC (GM) is recalling certain model year 2014 Chevrolet Silverado Light Duty Regular Cab, Double Cab, and Crew Cab 1500 series and model year 2015 Suburban and Tahoe; GMC model year 2014 Sierra Regular Cab, Double Cab, and Crew Cab 1500 Series and model year 2015 Yukon and Yukon XL vehicles equipped with a 6-Speed Automatic Transmission (feature code MYC). The subject vehicles may have a transmission oil cooler line that is not securely seated in the fitting. If the line is not securely seated and transmission oil leaks from the fitting, the oil could contact a hot surface and cause a vehicle fire. GM will notify owners, and dealers will inspect the transmission oil cooler line connection and repair the vehicles, as needed, free of charge. The recall is expected to begin May 2014. Owners may contact Chevrolet at 1-866-694-6546 or GMC owners may contact GMC at 1-866-996-9463. GM's number for this recall is 14121.

14V-152

General Motors LLC (GM) is recalling certain model year 2004-2006 and 2008-2009 Chevrolet Malibu, 2004-2006 Malibu Maxx, 2009-2010 HHR (non-turbo), 2010 Cobalt, 2008-2009 Saturn Aura and 2004-2007 Ion, and 2005-2009 Pontiac G6. In the affected vehicles, there may be a sudden loss of electric power steering (EPS) assist that could occur at any time while driving. If power steering assist is lost, greater driver effort would be required to steer the vehicle at low speeds, increasing the risk of a crash. GM will notify owners, and dealers will perform one of four bulletins. Parts are not currently available. GM expects to send an interim notification around May 28, 2014. When parts are available, owners will be mailed a second letter to come in to have the applicable bulletin applied. Bulletin 14115 covers model year 2004-2007 Saturn Ion, 2009-2010 Chevrolet HHR and 2010 Chevrolet Cobalts. Dealers will replace the EPS motor. Bulletin 14116 covers model year 2004-2006 Chevrolet Malibu and Malibu Maxx, 2005-2006 Pontiac G6 and 2008-2009 Chevrolet Malibu, Pontiac G6 and Saturn Aura built from March 1, 2008, through June 27, 2008. Dealers will replace the torque

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2014**

Published April 30, 2014

sensor assembly. Bulletin 14117 covers model year 2008 Chevrolet Malibu, Pontiac G6 and Saturn Aura built from February 1, 2008, through February 28, 2008. Dealers will replace the torque sensor assembly and EPS motor controller unit. Bulletin 14118 covers model year 2008 Chevrolet Malibu, Pontiac G6 and Saturn Aura built from October 1, 2007, through January 31, 2008. Dealers will replace the EPS motor controller unit. Owners may contact Chevrolet at 1-800-630-2438, Saturn at 1-800-553-6000, and Pontiac at 1-800-620-7668. GM's number for this recall is N140115. Note: GM bulletin number 14119 will be implemented for model year 2006-2008 and early production of 2009 Chevrolet HHR (non-turbo) and model year 2003 Saturn ION to provide EPS Motor replacement for the life of the vehicle.

14V-153

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain model year 2014 Range Rover Evoque vehicles manufactured November 27, 2013 and December 4, 2013. The bolts connecting the right hand rear suspension link arm may have been damaged during vehicle production. The damaged bolts may fail, allowing the link arm to separate from the vehicle, resulting in a loss of control and increasing the risk of a crash. Land Rover will notify owners, and dealers will replace the connecting bolts for the right hand rear suspension link arm, free of charge. The recall is expected to begin in May 2014. Land Rover's number for this recall is P040.

14V-155

Crossroads RV is recalling certain model year 2015 Sunset Trail, Zinger, and Reserve recreational trailers manufactured February 20, 2014, through February 28, 2014. The affected trailers may have been built with frame spring hangers that may be brittle and susceptible to fracturing. A spring hanger that fractures may result in a loss of control of the trailer, increasing the risk of a crash. Crossroads RV will notify owners, and dealers will inspect and replace the frame spring hangers, as necessary, free of charge. The recall is expected to begin in May 2014. Owners may contact Crossroads at 1-855-226-7496.

14V-156

Jaguar Land Rover North America, LLC (Jaguar) is recalling certain model year 2013-2014 XJ, XF and XK vehicles. In the affected vehicles, the toe links, components used to control the alignment of the rear wheels, can separate from the rear sub-frame. If a toe link separates from the rear sub-frame, a loss of vehicle stability and directional control may result, increasing the risk of a crash. Jaguar will notify owners, and dealers will replace the nut and washer assembly on the rear toe links, free of charge. The recall is expected to begin around May 27, 2014. Owners may contact Jaguar at 1-855-524-8278. Jaguar's number for this recall is J037.

14V-157

Mercedes Benz USA, LLC (Mercedes) is recalling certain model year 2014 GL350 BlueTEC 4Matic, GL450 4Matic, GL550 4Matic, and GL63 AMG vehicles manufactured November 4, 2013, through November 15, 2013. In the affected vehicles, the foldable second row seat bottom may not fold down low enough to allow proper use of the child seat anchors. As such, these vehicles do not conform to Federal Motor Vehicle Safety Standard (FMVSS) number 225, "Child Restraint Anchorage Systems." Without the use of the lower anchor points, a child restraint may be insufficiently or improperly anchored to the seat, increasing the risk of injury to the child in the event of a crash. Mercedes will notify owners, and dealers will inspect and, if necessary, replace the

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2014**

Published April 30, 2014

seat pan of the second row seat, free of charge. The recall is expected to begin in May 2014. Owners may contact Mercedes at 1-800-367-6372.

14V-158

Vactor Manufacturing Inc. (Vactor) is recalling certain model year 2012-2013 HXX-Fan, 2010-2014 HXX-Prodigy, and 2012-2014 HXX-PD and Guzzler Guzzcavator vacuum excavation trucks. In the affected vehicles, the water heater and/or cabinet that is mounted to the subframe chassis may come loose due to incorrect fasteners being used to mount the water heater. If the water heater comes loose and falls off the chassis while the vehicle is being driven, the heater may become a road hazard, increasing the risk of a crash. Vactor will notify owners, and dealers will correct the mounting hardware, free of charge. The recall is expected to begin in May 2014. Owners may contact Vactor at 1-847-622-7069. Vactor's number for this recall is SB-268.

14V-159

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain model year 2014 Land Rover Range Rover vehicles manufactured from May 7, 2013, to October 10, 2013. In the affected vehicles, the turn signal indicator may not flash at a double rate or click at a double-rate to give a notification to the driver of a front turn signal malfunction. Thus, these vehicles fail to conform to the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 108, "Lamps, reflective devices, and associated equipment." Without a warning that a front turn signal is malfunctioning, the driver would continue to use the vehicle, unaware that other drivers on the road are not being notified that the vehicle is turning, increasing the risk of a crash. Land Rover will notify owners, and dealers will update the vehicle software, free of charge. The recall is expected to begin on, or before, May 27, 2014. Land Rover's number for this recall is P042.

14V-163

Jaguar Land Rover North America, LLC (Jaguar) is recalling certain model year 2013 and 2014 XF 2.0L GTDi vehicles manufactured May 2013 through October 2013. The hose clamp for the Charge Air Cooler (CAC) hose may be out of position and loose, allowing the hose to detach. If the CAC hose detaches, the engine may stall, increasing the risk of a crash. Additionally, steering and brake assistance may be lost further increasing the risk. Jaguar will notify owners, and dealers will inspect the CAC hose to make sure its clamp is in the correct position and tight, free of charge. The recall is scheduled to begin in late May 2014. Owners may contact Jaguar at 1-800-452-4827. Jaguar's recall number is J034. Note: This recall is an expansion of recall 13V-341.

14V-181