

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2017**

Published February 10, 2017

CHILD SEATS:

None during January 2017.

EQUIPMENT:

Takata Corporation (Takata) has determined that certain PSPI, PSPI-1.1, PSPI-2, PSPI 6, PSPI-L, and SPI air bag inflators assembled as part of the frontal air bag modules, and used as original equipment or replacement equipment, such as after a vehicle crash necessitating replacement of the original air bags, may rupture due to propellant degradation occurring after long-term exposure to lower absolute humidity, temperature and temperature cycling. This recall addresses model year 2005-2008 vehicles ever registered in the states of Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin, and Wyoming. An inflator rupture may result in metal fragments striking the driver or other occupants resulting in serious injury or death. Takata will be working with vehicle manufacturers to determine into which vehicles the affected inflators were installed either as original or replacement equipment during service. As this work progresses, numerous vehicle recalls will likely be announced by the impacted vehicle manufacturers. NHTSA will supply this information as soon as possible. Note: Model year 2004 and older vehicles were included in recall 16E-044 for these states. Vehicles registered outside of these states may be covered by recalls 17E-002 or 17E-003.

17E-001

Takata Corporation (Takata) has determined that certain PSPI, PSPI-1.1, PSPI-2, PSPI 6, PSPI-L, and SPI air bag inflators assembled as part of the frontal air bag modules, and used as original equipment or replacement equipment, such as after a vehicle crash necessitating replacement of the original air bags, may rupture due to propellant degradation occurring after long-term exposure to high absolute humidity, high temperatures, and high temperature cycling. This recall addresses model year 2012 vehicles ever registered in the states of Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands. An inflator rupture may result in metal fragments striking the driver or other occupants resulting in serious injury or death. Takata will be working with vehicle manufacturers to determine into which vehicles the affected inflators were installed either as original or replacement equipment during service. As this work progresses, numerous vehicle recalls will likely be announced by the impacted vehicle manufacturers. NHTSA will supply this information as soon as possible. Note: Model year 2011 and older vehicles were included in recall 16E-042 for these states. Vehicles registered outside of these states may be covered by recalls 17E-001 or 17E-003.

17E-002

Takata Corporation (Takata) has determined that certain PSPI, PSPI-1.1, PSPI-2, PSPI-6, PSPI-L, and SPI air bag inflators assembled as part of the frontal air bag modules, and used as original equipment or replacement equipment, such as after a vehicle crash necessitating replacement of the original air bags, may rupture due to propellant degradation occurring after long-term exposure to moderate absolute humidity, temperatures, and temperature cycling. This recall addresses model year 2009 vehicles ever registered in the states of Arizona,

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2017**

Published February 10, 2017

Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia. An inflator rupture may result in metal fragments striking the driver or other occupants resulting in serious injury or death. Takata will be working with vehicle manufacturers to determine into which vehicles the affected inflators were installed either as original or replacement equipment during service. As this work progresses, numerous vehicle recalls will likely be announced by the impacted vehicle manufacturers. NHTSA will supply this information as soon as possible. Note: Model year 2008 and older vehicles were included in recall 16E-043 for these states. Vehicles registered outside of these states may be covered by recalls 17E-001 or 17E-002.

17E-003

The New Haven Companies (New Haven) is recalling certain Safe Haven Wheelchair Securement Tiedowns, model number NH56328P028. These tiedowns may not adequately secure a wheelchair in the event of a crash. If the tiedown fails in the event of a crash, the unrestrained wheelchair can increase the risk of injury to the occupant or those nearby. New Haven will notify the purchasers and through a third party, the tiedowns will be replaced, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact New Haven customer service at 1-818-686-7020.

17E-004

IH Parts America Inc. (IH Parts) is recalling certain CPT Crawler Proven Tech Steering tie rod adjusters with Draglink Intersect Holes, model number CPT-Tierod-ADJ, which was sold individually and part of assembly CPT-S80/800-TIEROD-4, CPT-S80/800-TIEROD-8, sold for replacement use on the following makes and models: 1961-65 International Scout 80 and 1966-71 International Scout 800, 800A and 800B. These steering tie rod adjusters may have been manufactured with an incorrect hardness, allowing the tie rod to fracture affecting steering capability. The tie rod fractures, the vehicle's steering and vehicle handling could be affected, increasing the risk of a crash. IH Parts has notified the purchasers, and will provide a replacement steering tie rod adjuster, free of charge. The recall began on January 27, 2017. Owners may contact IH Parts customer service at 1-530-274-1795. IH Parts' number for this recall is 1.

17E-005

Champion Laboratories Inc., a unit of UCI International (UCI) is recalling certain FRAM Model G2 inline fuel filters. The connection hoses supplied with these filters may be oversized, potentially resulting in a fuel leak. A fuel leak in the presence of an ignition source can increase the risk of a fire. UCI will notify the known purchasers and will replace the inline fuel filter, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact UCI customer service at 1-800-882-0890.

17E-006

Porsche Cars North America, Inc. (Porsche) is recalling certain Replacement 2.0L, 2.5L, 3.0L LP, and 3.0L HP Engines, part numbers 9A2100920 X, 9A2100925 X, 9A2100927AX, 9A2100930 X and 9A2100930AX. These engines have screws that fasten the fuel collection pipes that may shear off, resulting in a fuel leak. A fuel leak in the presence of an ignition source increases the risk of a fire. Porsche will notify the engine purchasers and will install improved fastening screws, free of charge. The manufacturer has not yet

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2017**

Published February 10, 2017

provided a notification schedule. Owners may contact Porsche customer service at 1-800-767-7243. Porsche's number for this recall is AH01.

17E-007

Triumph Motorcycles America, LTD (Triumph) is recalling certain Triumph S 4 Alarm Kits and Immobilizers made by Datatool. This alarm was sold for aftermarket use on certain Trophy, Trophy SE, Tiger 1050, Daytona 675, Rocket III, Tiger 800, Tiger 900, Tiger 955, Daytona 600, Daytona 650, Sprint ST 1050, Sprint ST, Sprint RS, America 790, Daytona 955i, Speed Triple 955i, Thunderbird, Street Triple, Bonneville 865cc, Thruxton 865cc, Bonneville T100 865cc, America/Speedmaster, Speed Triple 1050i, Sprint ST 1050, Sprint GT 1050 ABS, Speed Triple, T100, Street Twin, T120, Thruxton/R and Tiger Explorer motorcycles. These alarms have an internal nickel hydride battery that may leak. The battery may leak onto the unprotected circuit board below it, possibly causing the engine to stall, thereby increasing the risk of a crash. Triumph will notify owners, and dealers will replace the affected alarms, free of charge. The recall is expected to begin in February 2017. Owners may contact Triumph customer service at 1-678-854-2010.

17E-008

TIRES:

Continental Tire the Americas, LLC (Continental) is recalling certain General Tire Grabber light truck tires, size 33x12.50R18 LT 118Q, Load Range E, manufactured May 3, 2015, to May 16, 2015 (DOT week codes 1815 and 1915). These replacement tires may have a lack of adhesion within the belt package, causing tread wear, tread bulging, and possible tread separation. Tread separation may increase the risk of a crash. Continental will notify owners, and dealers will replace the affected tires, free of charge. The recall began on February 3, 2017. Owners may contact Continental customer service at 1-888-799-2168.

17T-002

VEHICLES:

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2011-2017 Audi Q5 vehicles. The sunroof drainage system may allow water to soak into the foam surrounding the side head air bag inflator canister resulting in the corrosion of the canister. This corrosion can weaken the canister and, during deployment of the side head air bag, the inflator may fracture and propel fragments into the passenger compartment. An inflator rupture may result in metal fragments striking the driver or other occupants resulting in serious injury or death. Audi will notify owners, and dealers will inspect the inflator and either coat it or replace it, as necessary, after removing the surrounding foam, free of charge. The recall is expected to begin in February 2017. Owners may contact Audi customer service at 1-800-253-2834. Volkswagen's number for this recall is 69P1.

17V-001

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2013-2017 Audi A5, A5 Cabriolet and Q5 vehicles, 2013-2016 Audi Allroad and Audi A4 vehicles and 2012-2015 Audi A6 vehicles. These vehicles, equipped with 2.0l Turbo FSI engines, have an electric coolant pump that can be blocked with debris from the

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2017**

Published February 10, 2017

cooling system, resulting in the pump overheating. If the coolant pump overheats, it can increase the risk of a fire. Audi will notify owners, and dealers will update the software so that the power supply to the coolant pump is deactivated if the pump becomes blocked with debris, free of charge. The recall is expected to begin February 20, 2017. Owners may contact Audi customer service at 1-800-253-2834. Volkswagen's number for this recall is 19M1.

17V-002

REV Recreation Group (REV) is recalling certain 2017 Holiday Rambler Vacationer XE, Admiral XE, Fleetwood Storm and Fleetwood Flair motor homes. The rear sway bar may not have been properly tightened and, as a result, the sway bar may detach from the vehicle. If the sway bar falls from the vehicle, it can increase the risk of a crash. REV will notify owners, and dealers will tighten the rear sway bar bolts, replacing them as necessary, free of charge. The recall is expected to begin January 31, 2017. Owners may contact REV customer service at 1-800-509-3417. REV's number for this recall is 161229REV.

17V-003

Karma Automotive LLC (Karma) is recalling certain 2012 Fisker Karma vehicles originally sold, or ever registered, in the states of Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina and Texas. These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death. Karma will notify owners, and dealers will replace the air bag inflators, free of charge. Remedy parts are not currently available. Karma will send a letter to the affected owners to notify them of the recall and will mail a follow up letter when remedy parts are available. Karma Automotive Client Services Team can be reached at clientservices@karmaautomotive.com or by calling 1-855-288-6109. Karma's number for this recall is 5.84.17.001.01.

17V-004

McLaren Automotive Incorporated (McLaren) is recalling certain 2012 MP4-12C vehicles originally sold, or ever registered, in the states of Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina and Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands. These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death. McLaren will notify owners, and dealers will replace the air bag inflators, free of charge. Remedy parts are not currently available. McLaren will send a letter to the affected owners to notify them of the recall and will mail a follow up letter when remedy parts are available. Owners may contact McLaren customer service at 1-646-429-8916.

17V-005

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain 2012 Toyota 4Runner, Corolla, Corolla

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2017**

Published February 10, 2017

Matrix, Sienna, Yaris, Scion xB, Lexus ES350, GX460, IS-F, IS250, IS350, IS250C, IS350C, and Lexus LFA vehicles originally sold, or ever registered, in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands, or "Zone A."

Additionally, unless included in "Zone A" above, Toyota is recalling certain 2009 Toyota Corolla, Corolla Matrix, Yaris, Yaris HB, Scion xB, Pontiac Vibe, Lexus, ES350, IS250, IS350, and IS-F vehicles originally sold, or ever registered, in Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B."

Additionally, unless included in "Zone A" or "Zone B" above, Toyota is recalling certain 2006-2008 Lexus IS250 and IS350, 2007-2008 Lexus ES350, Toyota Yaris, Yaris HB, and 2008 Lexus IS-F and Scion xB vehicles originally sold, or ever registered in Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin and Wyoming.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death.

17V-006

Kia Motors America (Kia) has recalled one 2016 Optima vehicle. In this vehicle, the end seal for the driver's frontal air bag inflator may not have been properly installed, possibly resulting in reduced inflation of the frontal air bag in the event of a crash. In the event of a crash, an air bag that does not inflate fully increases the risk of injury. The affected vehicle was remedied on January 10, 2017. Owners may contact Kia customer service at 1-800-333-4542. Kia's number for this recall is SC143.

17V-007

Heartland Recreational Vehicles, LLC (Heartland) is recalling certain 2017 Mallard recreational trailers. The certification label on these vehicles may have incorrect tire size and/or tire pressure information. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." If the label has incorrect tire pressure or size information, the operator may improperly inflate the tires or possibly over load the vehicle, increasing the risk of a crash. Heartland has notified owners, and dealers will replace the certification label with a corrected label, free of charge. The recall began on January 25, 2017. Owners may contact Heartland customer service at 1-877-262-8032. Heartland's number for this recall is 99.01.31.

17V-008

Altec Industries Inc. (Altec) is recalling certain 2005-2016 TA37M, TA41M, TA45M telescoping aerial

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2017**

Published February 10, 2017

devices. The winch brake on these vehicles may be improperly oriented, possibly resulting in unexpected winch line movement. If the winch boom line unexpectedly moves, there may be an increased risk of injury. Altec will notify owners, and dealers will reverse the direction of the winch brake and check and adjust the winch brake torque setting, free of charge. The recall is expected to begin March 9, 2017. Owners may contact Altec customer service at 1-205-991-7733. Altec's number for this recall is CSN 643.

17V-009

Mazda North America Operations (Mazda) is recalling certain 2009 RX-8 vehicles originally sold, or ever registered, in Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B."

Additionally, unless included in "Zone B" above, Mazda is recalling certain 2005-2006 MPV and 2005-2008 RX-8 vehicles originally sold, or ever registered in Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin and Wyoming.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death. Mazda will notify owners, and dealers will replace the front passenger side air bag inflator, free of charge. The recall is expected to begin March 7, 2017. Owners may contact Mazda customer service at 1-800-222-5500. Mazda's number for this recall is 0617A.

17V-011

Mazda North America Operations (Mazda) is recalling certain 2012 CX-7, CX-9 and Mazda6 vehicles sold, or ever registered, in the states of Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands, or "Zone A."

Additionally, unless included in "Zone A" above, Mazda is recalling certain 2009 CX-7, CX-9 and Mazda6 vehicles sold, or ever registered in the states of Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B."

Additionally, unless included in "Zone A" or "Zone B" above, Mazda is recalling certain 2007-2008 CX-7 and CX-9 sold, or ever registered in the states of Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin, and Wyoming.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2017**

Published February 10, 2017

modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death. Mazda will notify owners, and dealers will replace the front passenger side air bag inflator, free of charge. The recall is expected to begin March 7, 2017. Owners may contact Mazda customer service at 1-800-222-5500. Mazda's number for this recall is 0717A.

17V-012

Mazda North America Operations (Mazda) is recalling certain 2009 B-Series trucks sold, or ever registered, in the states of Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B."

Additionally, unless included in "Zone B" above, Mazda is recalling certain 2007-2008 B-Series trucks sold, or ever registered, in the states of Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin, and Wyoming.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death. Mazda will notify owners, and dealers will replace the front passenger air bag inflator, free of charge. The recall is expected to begin March 7, 2017. Owners may contact Mazda customer service at 1-800-222-5500. Mazda's number for this recall is 0817A.

17V-013

Subaru of America, Inc. (Subaru) is recalling certain 2005-2006 Subaru Baja, 2006-2011 Impreza (including WRX and STI models), 2006-2012 Tribeca, 2009-2012 Forester, Legacy, Outback, and 2012 WRX vehicles originally sold, or ever registered, in the states of Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules, and used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death. Subaru will notify owners, and dealers will replace the front passenger air bag inflator, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Subaru customer service at 1-800-782-2783. Subaru's number for this recall is TKA-17.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2017**

Published February 10, 2017

17V-014

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain 2012 Land Rover Range Rover vehicles originally sold, or ever registered, in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan) and the U.S. Virgin Islands, or "Zone A."

Additionally, unless included in "Zone A" above, Land Rover is recalling certain 2009 Land Rover Range Rover vehicles, originally sold, or ever registered, in Arizona, Arkansas, Delaware, the District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia and West Virginia, or "Zone B."

Additionally, Land Rover is recalling certain 2007-2008 Land Rover Range Rover vehicles originally sold, or ever registered in Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin and Wyoming.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules, and used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death. Land Rover will notify owners, and dealers will replace the front passenger air bag assemblies, free of charge. The recall is expected to begin March 3, 2017. Owners may contact Land Rover customer service at 1-800-637-6837. Land Rover's number for this recall is P082.

17V-015

Subaru of America, Inc. (Subaru) is recalling certain 2005-2006 Baja, 2006-2008 Impreza (including WRX and STI models), Tribeca, and 2006 Saab 9-2X vehicles, originally sold, or ever registered, in the states of Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin, and Wyoming.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death. Subaru will notify their owners. General Motors will notify Saab owners. Dealers will replace the front passenger air bag inflator, free of charge. The manufacturer has not yet provided a notification schedule. Subaru owners may contact Subaru customer service at 1-800-782-2783. Saab owners may contact the Saab Customer Assistance Center at 1-800-955-9007. Subaru's number for this recall is TKC-17.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2017**

Published February 10, 2017

17V-016

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2012 C300 4Matic, C250, C250 Coupe, C350, C350 Coupe 4Matic, C350 Coupe, C63 AMG, C63 AMG Coupe, E350 Coupe 4Matic, E350 Cabrio, E350 Coupe, E550 Cabrio, E550 Coupe, GLK350 4Matic, GLK350, SLS AMG Cabrio, and SLS AMG Coupe vehicles originally sold, or ever registered, in AL, CA, FL, GA, HI, LA, MS, SC, TX, PR, AS, GU, the MP (Saipan), and the U.S. VI, or "Zone A."

Additionally, unless included in "Zone A" above MBUSA is recalling certain 2009 C300 4Matic, C300, C350 and C63 AMG vehicles originally sold, or ever registered, in AZ, AR, DE, DC, IL, IN, KS, KY, MD, MO, NE, NV, NJ, NM, NC, OH, OK, PA, TN, VA, and WV, or "Zone B."

Additionally, unless included in "Zone A" or "Zone B" above MBUSA is recalling certain 2008 C300 4Matic, C300, and C350 vehicles originally sold, or ever registered, in AK, CO, CT, ID, IA, ME, MA, MI, MN, MT, NH, NY, ND, OR, RI, SD, UT, VT, WA, WI, and WY.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules, and used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death.

MBUSA will notify owners, and dealers will replace the front passenger air bag modules, free of charge. Parts are not currently available. Owners will be sent an interim notification starting in February 2017. A second notice will be mailed when remedy parts are available. Owners may contact MBUSA customer service at 1-877-496-3691.

17V-017

Ferrari North America, Inc. (Ferrari) is recalling certain 2012 California, 458 Italia, 458 Spider, and FF vehicles sold, or ever registered, in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death. Ferrari will notify owners, and dealers will replace the front passenger air bag assembly, free of charge. Ferrari plans to send an interim owner letter to owners beginning March 13, 2017, and a second letter will be sent when parts are available. Owners may contact Ferrari customer service at 1-866-551-2828. Ferrari's number for this recall is 61.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2017**

Published February 10, 2017

17V-018

BMW of North America, LLC (BMW) is recalling certain 2012 X5 xDrive30i, X5 xDrive35i, X5 xDrive48i, X5 xDrive50i, X5 M, X6 xDrive35i, X6 xDrive50i, and X6 M vehicles originally sold, or ever registered, in AL, CA, FL, GA, HI, LA, MS, SC, TX, PR, AS, GU, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands, or "Zone A."

Additionally, unless included in "Zone A" above, BMW is recalling certain 2009 X5 xDrive30i, X5 xDrive35i, X5 xDrive48i, X5 xDrive50i, and X5 M vehicles, 2009 X6 xDrive 35i, X6 xDrive50i, X6 M, and 2009 X5 xDrive35d vehicles originally sold, or ever registered, in AZ, AR, DE, DC, IL, IN, KS, KY, MD, MO, NE, NV, NJ, NM, NC, OH, OK, PA, TN, VA, and WV, or "Zone B."

Additionally, unless included in "Zone A" or "Zone B" above, BMW is recalling certain 2007-2008 X5 xDrive30i, X5 xDrive35i, X5 xDrive48i, X5 xDrive50i and X5 M vehicles, and 2008 X6 xDrive35i, X6 xDrive50i, and X6 M vehicles originally sold, or ever registered in the states of AK, CO, CT, ID, IA, ME, MA, MI, MN, MT, NH, NY, ND, OR, RI, SD, UT, VT, WA, WI, and WY.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to high absolute humidity and temperature cycling.

An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death.

BMW will notify owners, and dealers will replace the front passenger air bag inflator or air bag module, free of charge.

Interim letters informing owners that parts are not yet available are expected to be mailed March 1, 2017. Owners will receive a second notice when remedy parts become available. Owners may contact BMW customer service at 1-800-525-7417.

17V-020

Mitsubishi Motors North America, Inc. (MMNA) is recalling certain 2012 and 2014 i-MiEV vehicles.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death. MMNA will notify owners, and dealers will replace the front passenger air bag inflator, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact MMNA customer service at 1-888-648-7820. MMNA's number for this recall is SR-17-001.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2017**

Published February 10, 2017

17V-022

Tesla Motors, Inc. (Tesla) is recalling certain 2012 Model S vehicles sold, or ever registered in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the frontal air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death. Tesla will notify owners, and dealers will replace the front passenger air bag, free of charge. The recall is expected to begin in February 2017. Owners may contact Tesla customer service at 1-877-798-3752.

17V-023

Ford Motor Company (Ford) is recalling certain 2012 Ford Fusion and Mustang and Lincoln Zephyr and MKZ vehicles originally sold, or ever registered, in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands, or "Zone A."

Additionally, unless included in "Zone A" above, Ford is recalling certain 2009 Ford Ranger, Edge, Fusion and Mustang, Lincoln MKX, MKZ and Zephyr and Mercury Milan vehicles originally sold, or ever registered, in Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia and West Virginia, or "Zone B."

Additionally, unless included in "Zone A" or "Zone B" above, Ford is recalling certain 2007-2008 Ford Ranger, Edge and Lincoln MKX, 2006-2008 Ford Fusion, Mercury Milan, Lincoln Zephyr and MKZ, 2005-2008 Ford Mustang and 2005-2006 Ford GT vehicles originally sold, or ever registered, in the states of Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin and Wyoming.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death.

17V-024

Daimler Vans USA, LLC (DVUSA) is recalling certain 2012 Freightliner 2500 and 3500 Sprinter and Mercedes-Benz 2500 and 3500 Sprinter vehicles originally sold, or ever registered, in Alabama, California,

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2017**

Published February 10, 2017

Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands, or "Zone A."

Additionally, DVUSA is recalling certain 2009 Dodge 2500 and 3500 Sprinter and Freightliner 2500 and 3500 Sprinter vehicles originally sold, or ever registered, in Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B."

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules, and used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death. DVUSA will notify owners, and dealers will replace the front passenger air bag module, free of charge. Interim letters informing owners about the recall and telling them that parts are not yet available are expected to be mailed in February 2017. Owners will receive a second notice when remedy parts become available. Owners may contact DVUSA customer service at 1-877-762-8267.

17V-025

Subaru of America, Inc. (Subaru) is recalling certain 2005-2006 Baja, 2009 Forester, Legacy and Outback and 2006-2009 Impreza (including WRX and STI models) and Tribeca vehicles originally sold, or ever registered, in the states of Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death. Subaru will notify owners, and dealers will replace the passenger front air bag inflator, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Subaru customer service at 1-800-782-2783. Subaru's number for this recall is TKB-17.

17V-026

Jaguar Land Rover North America, LLC (Jaguar) is recalling certain 2012 Jaguar XF vehicles originally sold, or ever registered, in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands, or "Zone A."

Unless included in "Zone A" above, Jaguar is recalling certain 2009 Jaguar XF vehicles, originally sold, or ever registered, in Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania,

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2017**

Published February 10, 2017

Tennessee, Virginia, and West Virginia, or "Zone B."

Vehicles not originally sold or ever registered in either Zones A or B are not subject to this safety recall.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules, and used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death. Jaguar will notify owners, and dealers will replace the passenger frontal air bag assembly, free of charge. The recall is expected to begin March 3, 2017. Owners may contact Jaguar customer service at 1-800-452-4827. Jaguar's number for this recall is J070.

17V-027

Nissan North America, Inc. (Nissan) is recalling certain 2012 Nissan Versa hatchbacks originally sold, or ever registered, in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan) and the U.S. Virgin Islands, or "Zone A".

Additionally, if not included in "Zone A" above, Nissan is recalling certain 2009-2010 Infiniti M35 and M45 and 2009 Nissan Versa sedans and hatchbacks originally sold, or ever registered, in Arizona, Arkansas, Delaware, the District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B".

Additionally, if not included in "Zone A" or "Zone B" above, Nissan is recalling certain 2005-2008 Infiniti FX35 and FX45, 2006-2010 Infiniti M35 and M45, and 2007-2008 Nissan Versa vehicles originally sold, or ever registered, in Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin, and Wyoming.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death. Nissan will notify owners, and dealers will replace the front passenger air bag inflators, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Nissan customer service at 1-800-647-7261.

17V-028

Honda (American Honda Motor Co.) is recalling certain 2005-2006 Acura MDX and Honda CR-V vehicles, 2005-2011 Honda Element vehicles, 2005-2012 Acura RL vehicles, 2006-2012 Honda Ridgeline vehicles, 2007-2008 Honda Fit vehicles and 2005-2008 Honda Pilot vehicles originally sold, or ever registered, in AL,

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2017**

Published February 10, 2017

CA, FL, GA, HI, LA, MS, SC, TX, PR, AS, GU, the MP (Saipan), & the U.S. Virgin Islands, or "Zone A." Additionally, if not included in "Zone A" above, Honda is recalling certain 2005-2006 Acura MDX and Honda CR-V vehicles, 2005-2009 Acura RL and Honda Element vehicles, 2007-2008 Honda Fit vehicles, 2005-2008 Honda Pilot vehicles and 2006-2009 Honda Ridgeline vehicles originally sold, or ever registered, in AZ, AR, DE, DC, IL, IN, KS, KY, MD, MO, NE, NV, NJ, NM, NC, OH, OK, PA, TN, VA, & WV, or "Zone B." Additionally, if not included in "Zone A" or "Zone B" above, Honda is recalling certain 2005-2006 Acura MDX and Honda CR-V vehicles, 2005-2008 Acura RL, Honda Element and Honda Pilot vehicles, 2007-2008 Honda Fit vehicles and 2006-2008 Honda Ridgeline vehicles originally sold, or ever registered in AK, CO, CT, ID, IA, ME, MA, MI, MN, MT, NH, NY, ND, OR, RI, SD, UT, VT, WA, WI, & WY.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death. Honda will notify owners, and dealers will replace the front passenger air bag inflator, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Honda customer service at 1-888-234-2138. Honda's numbers for this recall are KD9 & KE0.

17V-029

Honda (American Honda Motor Co.) is recalling certain 2009-2012 Acura TSX, 2011-2012 Acura TSX Wagon, 2010-2012 Acura ZDX, 2008-2012 Honda Accord, 2010-2012 Honda Accord Crosstour and Honda Insight, 2009-2012 Honda Fit, 2009-2012 Pilot, 2007-2011 Honda CR-V, 2012 Honda FCX Clarity and 2006-2011 Honda Civic, Civic Hybrid, Civic NGV vehicles originally sold, or ever registered, in AL, CA, FL, GA, HI, LA, MS, SC, TX, PR, AS, GU, the Northern Mariana Islands (Saipan), & the U.S. Virgin Islands, or "Zone A."

Additionally, if not included in "Zone A" above, Honda is recalling certain 2009 Acura TSX, Honda Fit and Pilot, 2008-2009 Honda Accord, 2006-2009 Civic, Civic Hybrid and Civic NGV, and 2007-2009 Honda CR-V vehicles originally sold, or ever registered, in AZ, AR, DE, DC, IL, IN, KS, KY, MD, MO, NE, NV, NJ, NM, NC, OH, OK, PA, TN, VA, & WV, or "Zone B."

Additionally, if not included in "Zone B" above, Honda is recalling certain 2008 Honda Accord, 2006-2008 Honda Civic, Civic Hybrid and Civic NGV and 2007-2008 Honda CR-V vehicles originally sold, or ever registered, in AK, CO, CT, ID, IA, ME, MA, MI, MN, MT, NH, NY, ND, OR, RI, SD, UT, VT, WA, WI, & WY.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2017**

Published February 10, 2017

An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death.

Honda will notify owners, and dealers will replace the front passenger side air bag inflator, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Honda customer service at 1-888-234-2138. Honda's numbers for this recall are KE1 and KE2.

17V-030

Honda (American Honda Motor Co.) is recalling certain 2006-2009 and 2012 Honda GL1800 (Goldwing) motorcycles originally sold, or ever registered, in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands, or "Zone A."

Additionally, if not included in "Zone A," Honda is recalling certain 2006-2009 Honda GL1800 (Goldwing) motorcycles originally sold, or ever registered, in Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B."

Additionally, if not included in Zone A or Zone B above, Honda is recalling certain 2006-2008 Honda GL1800 (Goldwing) motorcycles originally sold, or ever registered, in the states of Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin, and Wyoming.

These vehicles are equipped with certain air bag inflators assembled as part of the air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator rupture may result in metal fragments striking the operator resulting in serious injury or death. Honda will notify owners, and dealers will replace the air bag module, free of charge. The recall is expected to begin February, 2017. Owners may contact Honda Motorcycle Customer Support at 1-866-784-1870. Honda's number for this recall is KE5.

17V-031

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2009 Audi A4 Cabriolet, S4 Cabriolet, A6 Avant, A6 Sedan and S6 Sedan vehicles originally sold, or ever registered, in Arizona, Arkansas, Delaware, the District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B."

Additionally, unless included in "Zone B" above, Volkswagen is recalling certain 2005-2008 Audi A4 Avant, A4 Sedan, A6 Sedan, S4 Avant and S4 Sedan vehicles, 2007-2008 A4 Cabriolet, RS4 Sedan, S4 Cabriolet and S6 Sedan vehicles, and 2006-2008 A6 Avant and 2008 RS4 Cabriolet vehicles originally sold, or ever registered, in Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont,

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2017**

Published February 10, 2017

Washington, Wisconsin, and Wyoming.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death. Audi will notify owners, and dealers will replace the passenger frontal air bag inflator, free of charge. The recall is expected to begin in February 2017. Owners may contact Audi customer service at 1-800-253-2834.

17V-032

General Motors LLC (GM) is recalling certain 2016-2017 Chevrolet Suburban HD vehicles. These vehicles were assembled with a convex right-hand outside mirror, instead of with a non-convex (flat) right-hand outside mirror. As such, these vehicles fail to comply with the requirements of Federal Motor Safety Standard (FMVSS) number 111, "Rearview Mirrors." If equipped with the incorrect right-side rear-view mirror, the driver may misjudge the distance of other vehicles, increasing the risk of a crash. GM will notify owners, and dealers will replace the convex mirror with a non-convex mirror and provide a new page for the owner's manual with the customer notification letter, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact GM customer service at 1-800-222-1020. GM's number for this recall is 17017.

17V-033

REV Recreation Group (REV) is recalling certain 2016-2017 Renegade RV Verona, Verona LE and Specialty Sprinter vehicles, 2011-2017 Explorer, Ikon and Core vehicles, 2014-2017 XL, Classic with Garage, Toter Home and Villagio vehicles, 2015-2017 Classic-Equine and Vienna vehicles, and 2011-2016 RSV vehicles. In the affected motor coaches and motorhomes, the seat belt anchorage hardware may pull out of the floor framing in the event of a crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 207, "Seating Systems," and 210, "Seat Belt Assembly Anchorages." In the event of sudden braking or a vehicle crash, the seat belts may detach from the floor framing, increasing the risk of injury. REV will notify owners, and dealers will replace the seat belt mounting hardware and install reinforcement plating, free of charge. The recall is expected to begin March 10, 2017. Owners may contact REV customer service at 1-800-509-3417. REV's number for this recall is 170110REV.

17V-034

Triumph Motorcycles America, LTD (Triumph) is recalling certain 2016-2017 Bonneville T120 and Bonneville T120 Black motorcycles. During use, the heated hand grips may expand and cause the throttle to stick open. If the throttle sticks open, there would be an increased risk of a crash. Triumph will notify owners, and dealers will install a spacer to prevent the throttle from sticking, free of charge. The recall is expected to begin February 20, 2017. Owners may contact Triumph customer service at 1-678-854-2010. Triumph's number for this recall is SB 546.

17V-035

4-Star Trailers, Inc. (4-Star) is recalling certain 2012-2016 Gooseneck Horse trailers. The hydraulic brake line

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2017**

Published February 10, 2017

may rupture where it connects to the brake caliper, resulting in a brake fluid leak and a loss of braking. If the hydraulic brake line ruptures there may be a loss of brake power, increasing the risk of a crash. 4-Star will notify owners, and dealers will change the brake line compression fitting to a banjo fitting, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact 4-Star customer service at 1-800-848-3095.

17V-036

Highland Ridge RV (Highland) is recalling certain 2017 Open Range, Mesa Ridge and Roamer fifth wheels and travel trailers. These vehicles are equipped with an outside range that can be stored with the gas valve left open, allowing gas to enter and buildup within the vehicle. If gas leaks into the cabin, it can increase the risk of an explosion or fire. Highland Ridge will notify owners and dealers will install a larger gas valve handle, inspect that the drawer guide rail is in its proper location, repairing it as required, and place a warning label on the range stating the gas valve must be turned off prior to storing the range in the unit. The recall is expected to begin February 28, 2017. Owners may contact Highland customer service at 1-260-768-7771. Highland's number for this recall is 9904341.

17V-037

Thor Motor Coach (TMC) is recalling certain 2017 Aria motorhomes. The driver's side sofa seatbelts may be too short for passengers to use. In the event of a crash, an occupant not restrained by a seatbelt has an increased risk of injury. TMC will notify owners, and dealers will install longer seatbelts, free of charge. The recall is expected to begin on March 17, 2017. Owners may contact TMC customer service at 1-877-500-1020. TMC's number for this recall is RC000127.

17V-038

Forest River, Inc. (Forest River) is recalling certain 2017 Prime Time Avenger recreational vehicles. The Federal Placards on these vehicles may indicate an incorrect tire and rim combination. The Federal Placard indicates ST225/75R15E tires with 80 PSI and a rim designation of 15X6.0JJ, while the subject vehicles' Federal Placard should indicate ST225/75R15D tires with 65 PSI and a rim designation of 15X5.0JJ. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard(FMVSS) number 110, "Tire Selection and Rims." Incorrect tire information can cause the tires to be over inflated, possibly resulting in a tire blowout and increasing the risk of a crash. Forest River will notify owners, and dealers will install a corrected Federal Placard, free of charge. The recall is expected to begin March 10, 2017. Owners may contact Forest River customer service at 1-574-862-1025. Forest River's number for this recall is 48-01162017-0310.

17V-039

Nissan North America, Inc. (Nissan) is recalling certain 2015-2017 Altima vehicles. The rear door latch/lock cable on the vehicles may have been improperly routed. As a result, lowering a rear window may inadvertently cause that door to unlatch and open. If the rear passenger doors inadvertently open while the vehicle is in motion, it may increase the risk of injury to the rear passengers. Nissan will notify owners, and dealers will correct the rear door latch/lock cable routing, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Nissan customer service at 1-800-647-7261.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2017**

Published February 10, 2017

17V-040

Pratt Industries Inc. (Pratt) is recalling certain 2014 DC432LS9 and DC432LS9HL ISO Tank Chassis equipped with SAF-Holland 5-Inch Tapered Axles. In the affected axles, the wheel end may separate from the axle due to an out of specification material thickness on the spindle. The wheel end may separate, increasing the risk of a crash. Pratt will notify owners, and dealers will inspect the axles and replace any defective spindles, free of charge. The recall is expected to begin during February 2017. Owners may contact Pratt customer service at 1-269-465-4646 extension 110. Pratt's number for this recall is EQ16-003.

17V-041

Daimler Trucks North America LLC (DTNA) is recalling certain 2016-2017 Freightliner Business Class M2, 108SD, and 114SD trucks. The affected trucks have been modified to be equipped with both left hand and right hand instrument clusters. Due to incompatibilities between the displays, the instrument clusters and/or turn signals may become unresponsive. Unresponsive instrument clusters and/or turn signals can increase the risk of a crash. DTNA will notify owners, and dealers will replace the left instrument cluster with a cluster compatible with the right display, free of charge. The recall is expected to begin March 19, 2017. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL731.

17V-043

Airstream, Inc. is recalling certain 2017 Flying Cloud, International, and Sport recreational trailers. The Federal Certification label and Tire Placards on these vehicles have incorrect information. The label was printed for ST225/75R15 Load Range E tires, but the vehicle has ST225/75R15 Load Range D tires. As such, these vehicles fail to comply with Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims" and Part 567, "Certification." The incorrect information on the labels could cause an owner to overinflate the tires, possibly resulting in a tire blowout, increasing the risk of a crash. Airstream will notify owners, and dealers will replace the incorrect label with a corrected label, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Airstream customer service at 1-937-596-6111, extension 7401 or 7411.

17V-044

Maserati North America, Inc. (Maserati) is recalling certain 2014-2015 Quattroporte and Ghibli vehicles. The affected vehicles have fuel lines that may weep or leak fuel. A fuel leak in the presence of an ignition source can increase the risk of a fire. Maserati will notify owners, and dealers will install a new fuel line, free of charge. The recall is expected to begin February 28, 2017. Owners may contact Maserati customer service at 1-201-510-2369. Maserati's number for this recall is 339.

17V-045

Maserati North America, Inc. (Maserati) is recalling certain 2014-2017 Quattroporte, Ghibli, and Levante vehicles. Adjusting the front seats may cause the seat wiring harness to rub, possibly resulting in an electrical short. An electrical short can increase the risk of a fire. Maserati will notify owners, and dealers will inspect the vehicles, replacing the seat wiring harness, as necessary, free of charge. The recall is expected to begin March 21, 2017. Owners may contact Maserati customer service at 1-201-510-2369. Maserati's number for this

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2017**

Published February 10, 2017

recall is 342.

17V-046

BMW of North America, LLC (BMW) is recalling certain 2000-2002 BMW 320i, 323i, 325i, 325xi, 330i, 330xi, 323Ci, 325Ci, 330Ci, M3, 323iT, 325iT and 325xiT vehicles, 2001-2002 525i, 530i, 540i, M5, 525iT and 540iT vehicles, and 2001-2003 X5 3.0i, X5 4.4i, and X5 4.6is vehicles. These vehicles may have had a driver-side air bag module installed as replacement equipment such as after a vehicle crash necessitating replacement of the original air bag, or as a remedy part for a prior recall. These replacement modules contain an air bag inflator that may rupture due to propellant degradation occurring after long-term exposure to lower absolute humidity, temperature and temperature cycling. In the event of a crash necessitating deployment of the driver's frontal air bag, the inflator could rupture with metal fragments striking the driver or other occupants resulting in serious injury or death. BMW will notify owners, and dealers will inspect the driver side air bag module, replacing it as necessary, free of charge. The recall is expected to begin March 15, 2017. Owners may contact BMW customer service at 1-800-525-7417.

17V-047

Walker Stainless Equipment Company LLC (Walker) is recalling certain 2014-2017 Food Grade Tank Trailers. The weld joints that attach the underride guard to the trailer frame may crack. If the welds crack, the underride guard may detach from the trailer frame, becoming a road hazard and increasing the risk of a crash. Walker will notify owners, and dealers will modify the underride guard mounting, free of charge. The recall began on February 8, 2017. Owners may contact Walker customer service at 1-800-356-5734. Walker's number for this recall is W-6225,W-6279.

17V-048

Autocar Industries, LLC (Autocar) is recalling certain 2016-2017 Xspotter vehicles. These vehicles were manufactured without a dimmer switch to adjust the dash illumination brightness. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 101, "Control and Displays." Without a switch to adjust the dash illumination brightness, the dash lights may be too dim or too bright with either condition increasing the risk of a crash. The remedy for this recall is still under development. The recall is expected to begin March 10, 2017. Owners may contact Autocar customer service at 1-765-489-5499. Autocar's number for this recall is ACTT-1701.

17V-049

Autocar, LLC (Autocar) is recalling certain 2013-2016 Xpeditor vehicles equipped with auxiliary axles and 36/36 rear brake chambers. Over-braking can cause excessive vibration and cause the S-cam tube bolts to become loose and allow the brakes to unexpectedly engage. Brakes that engage unexpectedly can increase the risk of a crash. The remedy for this recall is still under development. The recall is expected to begin March 17, 2017. Owners may contact Autocar customer service at 1-765-489-5499. Autocar's number for this recall is ACX-1701.

17V-050

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain 2016-2017 Tundra vehicles equipped

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2017**

Published February 10, 2017

with a resin rear step bumper and resin reinforcement brackets (vehicles with chrome step bumpers are not affected). In the event of an impact to the corner of the bumper, the resin bracket may be damaged but not be noticed. If a person steps on the corner of the bumper that is damaged, a portion of the bumper may break away, increasing the risk of injury. Toyota will notify owners, and dealers will replace the resin rear bumper reinforcement brackets with steel ones, and replace the rear bumper tread, free of charge. Remedy parts are not currently available. Toyota will begin notifying owners of the recall on February 15, 2017. A second notice will be mailed when remedy parts are available. Owners may contact Toyota customer service at 1-800-331-4331. Toyota's number for this recall is HOC.

17V-051

Ford Motor Company (Ford) is recalling certain 2016 Focus and C-Max vehicles. The floor pan may have improperly welded left-hand apron joints. Improperly welded apron joints may reduce the front-end structural integrity of the vehicle, increasing the risk of injury in the event of a crash. Ford will notify owners, and dealers will inspect the apron joints, repairing the vehicle, as necessary, free of charge. The recall is expected to begin March 6, 2017. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 17S03.

17V-052

Ford Motor Company (Ford) is recalling certain 2017 F-150 trucks equipped with an eight-inch productivity screen. In these vehicles, the instrument cluster may lose power after the initial vehicle start-up in cold ambient temperatures. Several gauges, including the transmission gear position indicator, may not illuminate. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicles Safety Standard (FMVSS) number 102, "Transmission shift position sequence, starter interlock, and transmission braking effect." If the transmission gear position indicator fails to illuminate, the driver may be unable to tell the transmission shift position, increasing the risk of a crash or injury from unintended vehicle movement. Ford will notify owners, and dealers will reprogram the instrument cluster, free of charge. The recall is expected to begin February 7, 2017. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 17C01.

17V-053

Porsche Cars North America, Inc. (Porsche) is recalling certain 2017 911 Carrera, 911 Carrera S, 911 Carrera 4, 911 Carrera 4S, 911 Targa 4, 911 Targa 4S + GTS, 911 Carrera Cabriolet, 911 Carrera S Cabriolet, 911 Carrera 4 Cabriolet, 911 Carrera 4S Cabriolet, 718 Boxster, 718 Boxster S, 718 Cayman, and 718 Cayman S vehicles. The screws that fasten the fuel collection pipes in the engine compartment may shear off, resulting in a fuel leak. A fuel leak in the presence of an ignition source increases the risk of a fire. Porsche will notify owners, and dealers will install improved fastening screws, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Porsche customer service at 1-800-767-7243. Porsche's number for this recall is AH01.

17V-054

Advance Engineered Products Ltd. (Advance Engineered) is recalling certain 2014-2015 Dry Bulk Cargo Tank trailers equipped with certain Bendix SR5 spring brake valves. These valves may have been improperly machined which may cause a delay of application of the spring brakes while parking. If there is a delay of the

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2017**

Published February 10, 2017

spring brake application, the trailer may roll away after it has decoupled from the tractor, increasing the risk of a crash or injury. Advance Engineered has notified owners, and will provide remedy kits, complete with instructions, to repair any affected SR-5 trailer relay valves, free of charge. The recall began on June 17, 2016. Owners may contact Advance Engineered customer service at 1-306-721-5678.

17V-055

Jayco, Inc. (Jayco) is recalling certain 2017 Eagle fifth-wheel recreational vehicles equipped with the dry camping option. In the affected vehicles, the LP manifold was mounted to the fifth wheel frame directly above the axle assembly and the suspension U-bolts. Impact from the axle can crack the LP manifold resulting in a propane gas leak. An LP gas leak can increase the risk of a fire. Jayco will notify owners, and dealers will relocate the LP manifold, and inspect and replace the LP lines and fittings, as necessary, free of charge. The recall is expected to begin March 17, 2017. Owners may contact Jayco customer service at 1-800-283-8267. Jayco's number for this recall is 9903342.

17V-056

General Motors LLC (GM) is recalling certain 2016-2017 Chevrolet Cruze vehicles. A bracket used in the driver or front passenger seat-back recliner mechanism may have been incorrectly welded to the seat-back frame, as a result, in the event of a crash, the head-restraints may not function properly. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 202a, "Head Restraints." In a crash, the seat-backs for the front seats may break, increasing the risk of injury to the occupants. GM will notify owners, and dealers will inspect the front passenger seats, replacing any with seat-back frames that are incorrectly welded, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Chevrolet customer service at 1-800-222-1020. GM's number for this recall is 17035.

17V-057

Forest River, Inc. (Forest River) is recalling certain 2017-2018 Berkshire and Charleston recreational vehicles built on Freightliner Custom Chassis Corporation (FCCC) RV chassis. In these vehicles, the power steering hose may be improperly routed causing inadequate clearance between the hose and power stud. As a result, the hose can rub the power stud causing arcing and a power steering fluid leak. Arcing in the presence of power steering fluid leak under high pressure could increase the risk of a fire. Forest River will notify owners, and FCCC dealers will reroute the power steering hose for proper clearance, free of charge. The recall is expected to begin March 21, 2017. Owners may contact Forest River customer service at 1-574-295-2117, or FCCC customer service at 1-800-547-0712. Forest River's number for this recall is 40-01182017-0311.

17V-059

Forest River, Inc. (Forest River) is recalling certain 2017 XLR fifth-wheel recreational vehicles. These vehicles have a Federal Placard that identifies the vehicle as a "Travel Trailer" when the placard should state "Fifth-Wheel." Also, the VIN does not correspond to the type of vehicle. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." With the incorrect information, the operator may attempt to tow the vehicle incorrectly, increasing the risk of a crash. Forest River will notify owners, and will provide a new corrected Federal Placard, free of charge. The recall is expected to begin March 21, 2017. Owners may

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2017**

Published February 10, 2017

contact Forest River customer service at 1-574-642-0432. Forest River's number for this recall is 45-0132016-0312.

17V-060

General Motors LLC (GM) is recalling certain 2006-2010 Pontiac Solstice and 2007-2010 Saturn Sky vehicles. The Passenger Air Bag Suppression System (PPS) sensor may become bent or damaged within the front passenger seat, possibly disabling the front passenger air bag. In the event of a crash, if the front passenger air bag does not deploy as intended, the front passenger has an increased risk of injury. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Pontiac customer service at 1-800-762-2737 or Saturn customer service at 1-800-553-6000. GM's number for this recall is 17036.

17V-061

BMW of North America, LLC (BMW) is recalling certain 2016-2017 X1 xDrive28i and X1 sDrive28i vehicles. The affected vehicles have an instrument panel that may not allow the front passenger air bag to deploy properly in the event of a crash. In the event of a crash, if the front passenger air bag does not deploy properly, it can increase the risk of injury. BMW will notify owners, and dealers will replace the instrument panel, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact BMW customer service at 1-800-525-7417.

17V-062

Hyundai Motor Company (Hyundai) is recalling certain 2017 Elantra vehicles. In the affected vehicles, the brake booster may fail, resulting in a loss of power brake assist. A loss of power brake assist can lengthen the distance needed to stop the vehicle, increasing the risk of a crash. Hyundai has notified owners, and dealers will replace the brake system booster assembly, free of charge. The recall began on February 6, 2017. Owners may contact Hyundai customer service at 1-800-633-5151. Hyundai's number for this recall is 157.

17V-063

Van Hool N.V. (Van Hool) is recalling certain 2010-2014 C2045 and T2145 motorcoaches, 2014-2015 TX40 motorcoaches, 2014-2017 TX45 motorcoaches, 2011-2015 TD925 motorcoaches, 2014-2016 CX45 motorcoaches and 2010-2013 T2140 motorcoaches. When the vehicle is started in low temperatures, the steering wheel may be difficult to turn. Reduced steering ability can increase the risk of a crash. Van Hool will notify owners, and dealers will replace the steering box, free of charge. The recall is expected to begin March 31, 2017. Owners may contact ABC Bus, Inc. at 1-877-427-7278. Van Hool's number for this recall is P826.

17V-064