

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2018**

Published March 2, 2018

CHILD SEATS:

None during January 2018.

EQUIPMENT:

Takata Corporation (Takata) has decided that certain PSPI, PSPI-1.1, PSPI-2, PSPI-6, PSPI-L, and SPI air bag inflators assembled as part of the frontal air bag modules, and used as original equipment or replacement equipment (such as after a vehicle crash necessitating replacement of the original air bags) may explode due to propellant degradation occurring after long-term exposure to high absolute humidity, high temperatures, and high temperature cycling. This recall addresses model year 2013 vehicles ever registered in the states of Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands. An inflator explosion may result in sharp metal fragments striking the driver or other occupants resulting in serious injury or death. Takata will be working with vehicle manufacturers to determine into which vehicles the affected inflators were installed either as original or replacement equipment during service. As this work progresses, numerous vehicle recalls will likely be announced by the impacted vehicle manufacturers. The recall began on January 2, 2018. Vehicles registered outside of these states may be covered by recalls 18E-002 or 18E-003.

18E-001

Takata Corporation (Takata) has decided that certain PSPI, PSPI-1.1, PSPI-2, PSPI-6, and PSPI-L air bag inflators assembled as part of the frontal air bag modules, and used as original equipment or replacement equipment (such as after a vehicle crash necessitating replacement of the original air bags), may explode due to propellant degradation occurring after long-term exposure to moderate absolute humidity, temperatures, and temperature cycling. This recall addresses model year 2010 vehicles ever registered in the states of Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia. An inflator explosion may result in sharp metal fragments striking the driver or other occupants resulting in serious injury or death. Takata will be working with vehicle manufacturers to determine into which vehicles the affected inflators were installed either as original or replacement equipment during service. As this work progresses, numerous vehicle recalls will likely be announced by the impacted vehicle manufacturers. The recall began on January 2, 2018. Vehicles registered outside of these states may be covered by recalls 18E-001 or 18E-003.

18E-002

Takata Corporation (Takata) has decided that certain PSPI, PSPI-1.1, PSPI-2, PSPI 6, PSPI-L, and SPI air bag inflators assembled as part of the frontal air bag modules, and used as original equipment or replacement equipment (such as after a vehicle crash necessitating replacement of the original air bags), may explode due to propellant degradation occurring after long-term exposure to lower absolute humidity, temperature and temperature cycling. This recall addresses model year 2009 vehicles ever registered in the states of Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin, and

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2018**

Published March 2, 2018

Wyoming. An inflator explosion may result in sharp metal fragments striking the driver or other occupants resulting in serious injury or death. Takata will be working with vehicle manufacturers to determine into which vehicles the affected inflators were installed either as original or replacement equipment during service. As this work progresses, numerous vehicle recalls will likely be announced by the impacted vehicle manufacturers. The recall began on January 2, 2018. Vehicles registered outside of these states may be covered by recalls 18E-001 or 18E-002.

18E-003

Dorman Products, Inc. (Dorman) is recalling certain Dorman A/C Bypass Pulley Brackets, part number 34283, and Solutions A/C Bypass Pulley Brackets, part number 660-2001-1. These brackets may crack under certain loading conditions. If the bracket cracks and fails, the vehicle may lose power steering assist, increasing the risk of a crash. The remedy for this recall is still under development. The recall is expected to begin on March 16, 2018. Owners may contact Dorman customer service at 1-800-523-2492.

18E-004

Fuel Helmets (Fuel) is recalling certain SH-HHGL1 helmets, size small. The strap that secures the helmet to the rider's head may fail in low or high temperatures. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 218, "Motorcycle Helmets." If the helmet strap fails to keep the helmet secured in the event of a crash, the rider has an increased risk of injury. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Fuel customer service at 1-855-355-3835.

18E-005

Dainese S.p.A (Dainese) is recalling certain AGV Carbon Modular motorcycle full-face, flip-up helmets, model AGV 580. The glue applied to the screws that secure the chin bar components together may have contacted the chin base polycarbonate material causing it to deteriorate prematurely. The deteriorated polycarbonate material may result in the chin base detaching during an impact, increasing the risk of injury. Dainese will notify owners, and dealers will replace the helmets, free of charge. The recall began February 12, 2018. Owners may contact Dainese customer service at 1-855-327-5639.

18E-006

Lippert Components, Inc. (LCI) is recalling certain Ford F53 chassis reduced from a standard wheelbase of 208" to 190" for use by Forest River in Coachmen and Mirada recreational vehicles. The driveshaft may be misaligned, possibly resulting in excessive vibration at highway speeds. The vibration may cause driveshaft damage, disabling the vehicle and increasing the risk of a crash. LCI will notify owners, and Forest River dealers will replace the two piece driveshaft with a three piece driveshaft, free of charge. The recall is expected to begin March 2018. Owners may contact LCI customer service at 1-574-538-4514. LCI's number for this recall is 2018-001-59.

18E-007

TIRES:

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2018**

Published March 2, 2018

Vogue Tyre & Rubber Co. (Vogue) is recalling certain Signature V tires, sizes 245/40R20, 235/45R17, 225/50R17, 225/45R17, 235/55R17, 245/45R17 and 235/65R18, and Signature V SCT tires, sizes 235/65R18, 285/45R22, 275/55R20. These tires have incomplete Tire Identification number (TIN) codes on the intended outboard sidewalls in that they are missing date codes. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 139, "New Pneumatic Radial Tires for Light Vehicles." Missing TIN information can make it difficult for owner to identify the tire in the event of a recall, potentially increasing the risk of driving with a recalled tire which could result in a crash. Vogue will notify owners, and dealers will replace the affected tires, free of charge. The recall began February 12, 2018. Owners may contact Vogue customer service at 1-800-323-1466.

18T-001

VEHICLES:

Erwin Hymer Group North America, Inc. (Erwin Hymer) is recalling certain 2012-2018 Roadtrek E-trek, CS Adventurous, RS Adventurous, SS Agile, Zion, Zion SRT, Simplicity, Simplicity SRT, Hymer Aktiv, Aktiv 2.0, Sonne, Carado Banff, Axion, and Sunlight Van One vehicles. These motorhomes are equipped with Kidde E10 or EH10 Fire Extinguishers that may become clogged, preventing the extinguisher from discharging as expected or requiring excessive force to activate the extinguisher. If the fire extinguisher does not function properly, it can increase the risk of injury in the event of a fire. Erwin Hymer will notify owners, instructing them to contact Kidde for a replacement fire extinguisher, free of charge. The recall began on January 8, 2018. Owners may contact Erwin Hymer customer service at 1-844-413-8245, or Kidde customer service toll-free at 1-855-262-3540, or online at www.kidde.com and click on "Product Safety Recall" for more information. For additional guidance consumers can contact Erwin Hymer Group North America, Inc., customer service line at 844-496-3735. Erwin Hymer's number for this recall is 17E062000.

18V-001

Forest River, Inc. (Forest River) is recalling certain 2018 Surveyor recreational trailers, models SVT266RLDS, SVT285IKDS, SVT285IKLE, SVT323BHLE, SVT33KRETS, SVT33KRLOK and SVT33KRLTS. These vehicles were built with a circuit breaker that allows more current than the wiring can handle. The incorrect circuit breaker can cause the wiring to melt, increasing the risk of a fire. Forest River will notify owners, and dealers will install a circuit breaker with the correct load rating, free of charge. The recall began on January 24, 2018. Owners may contact Forest River customer service at 1-574-642-3119, extension 205. Forest River's number for this recall is 37-0604.

18V-002

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2010-2011 Audi A6 Avant, A6 Sedan and S6 Sedan vehicles, ever registered in the states of Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B."

Additionally, unless included in "Zone B" above, Volkswagen is recalling certain 2009 Audi A4 Cabriolet and S4

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2018**

Published March 2, 2018

Cabriolet vehicles, and 2009-2011 Audi A6 Avant, A6 Sedan and S6 Sedan vehicles registered in the states of Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin, and Wyoming or "Zone C."

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these inflators may explode due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator explosion may result in sharp metal fragments striking the driver or other occupants resulting in serious injury or death. Audi will notify owners, and dealers will replace the passenger frontal air bag inflator, free of charge. Audi will send an interim owner notification on or before March 03, 2018. When parts to perform the recall repair become available, Audi will notify owners, and dealers will replace the passenger frontal air bag inflator, free of charge. The recall is expected to begin in June 2018. Owners may contact Audi customer service at 1-800-253-2834.

18V-004

Gulf Stream Coach, Inc. (Gulf Stream) is recalling certain 2011-2012 Endura Max fifth wheel, Matrix, Matrix fifth wheel, Yellowstone, Canyon Trail, Aztec, Ridgeline, Mako, Executive Ridgeline, Explorer, Stream-Lite Sport, Stream-Lite Explorer, Gulf Breeze, Gulf Breeze Sport, Visa, Gulf Breeze Explorer, Capri, Northern Express, Champaign Gulf Breeze, Champaign Stream-Lite, Conquest, Innsbrook, Special Edition, Track and Trail, Amerilite, Amerilite Super-Lite, Kingsport Super-Lite, Cavalier, Kingsport, Kingsport Park Model, Serenity Park Model, Trailmaster, Trailmaster Destination, Trailmaster Park Model, and Sky recreational trailers. These trailers are equipped with Kidde Plastic-Handle or Push Button 'Pindicator' Fire Extinguishers that may become clogged, preventing the extinguisher from discharging as expected or requiring excessive force to activate the extinguisher. Additionally, in certain models, the nozzle may detach from the valve assembly with enough force that it could cause injury and also render the product inoperable. For a full list of the affected fire extinguisher models visit: <https://static.nhtsa.gov/odi/rc1/2017/RMISC-17E062-5427.pdf> In the event of a fire, if the fire extinguisher does not function properly, it can increase the risk of injury. Gulf Stream will notify owners, instructing them to contact Kidde for a replacement fire extinguisher, free of charge. The recall began on February 14, 2018. Owners may contact Gulf Stream customer service at 1-800-289-8787, or Kidde customer service toll-free at 1-855-262-3540, or online at www.kidde.com and click on "Product Safety Recall" for more information.

18V-005

Altec Industries Inc. (Altec) is recalling certain 2010-2011 Effer 440 and 470 Knuckle Boom Cranes. The inner race rotation bearing fasteners for the crane turret may fail and the pedestal may crack if the fasteners are not replaced every two years. If the rotation bearing fasteners fail or the pedestal cracks, the crane may not be stable, increasing the risk of injury. Altec will notify owners, and dealers will inspect the pedestal weld for cracks and replace the inner race rotation bearing fasteners, free of charge. The recall began on February 2, 2018. Owners may contact Altec customer service at 1-877-462-5832. Altec's number for this recall is CSN 674.

18V-006

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2018**

Published March 2, 2018

McLaren Automotive Incorporated (McLaren) is recalling certain 2013 MP4-12C vehicles ever registered in the states of Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these inflators may explode due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator explosion may result in sharp metal fragments striking the driver or other occupants resulting in serious injury or death. McLaren will notify owners, and dealers will replace the front passenger air bag inflator, free of charge. Owners may contact McLaren customer service at 1-646-429-8916.

18V-007

Terex South Dakota, Inc. (Terex) is recalling certain 2015-2017 XT Pro 56, and XT Pro 60 aerial devices. The platform control enable system may be adjusted incorrectly. If not assembled and adjusted properly it may allow the rotation to move slowly if the enable is not depressed. If the rotation system moves without the enable being depressed, it can increase the risk of injury. Terex will notify owners, and dealers will inspect the single stick controls, making sure that they are assembled correctly and adjusted properly, free of charge. Owners may contact Terex customer service at 1-800-982-8975. Terex's number for this recall is SN663.

18V-008

Jaguar Land Rover North America, LLC (Jaguar) is recalling certain 2013 Jaguar XF vehicles originally sold, or ever registered, in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands, or "Zone A."

Unless included in "Zone A" above, Jaguar is recalling certain 2010 Jaguar XF vehicles, originally sold, or ever registered, in Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B."

Unless included in Zone A and Zone B above, Jaguar is recalling certain 2009 MY Jaguar XF vehicles, originally sold, or ever registered, in Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin, and Wyoming or "Zone C."

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these inflators may explode due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator explosion may result in sharp metal fragments striking the driver or other occupants resulting in serious injury or death. Jaguar will notify owners, and

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2018**

Published March 2, 2018

dealers will replace the front passenger air bag assemblies, free of charge. Owners may contact Jaguar customer service at 1-800-452-4827. Jaguar's number for this recall is J071.

18V-009

Jaguar Land Rover North America, LLC (Jaguar) is recalling certain 2014-2015 Jaguar XF vehicles originally sold, or ever registered, in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands, or "Zone A."

Unless included in "Zone A" above, Jaguar is also recalling certain 2011-2015 Jaguar XF vehicles, originally sold, or ever registered, in Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B."

Unless included in Zone A and Zone B above, Jaguar is also recalling certain 2010-2015 Jaguar XF vehicles, originally sold, or ever registered in Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin, and Wyoming or "Zone C."

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these inflators may explode due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator explosion may result in sharp metal fragments striking the driver or other occupants resulting in serious injury or death. Jaguar will notify owners, and dealers will replace the front passenger air bag assembly, free of charge. Owners may contact 1-800-452-4827. Jaguar's number for this recall is J072.

18V-010

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain 2010 Land Rover Range Rover vehicles, originally sold, or ever registered, in Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B."

Unless included in "Zone B" above, Land Rover is recalling certain 2009 Land Rover Range Rover vehicles, originally sold, or ever registered, in Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin, and Wyoming or "Zone C."

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these inflators may explode due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator explosion may result in sharp metal

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2018**

Published March 2, 2018

fragments striking the driver or other occupants resulting in serious injury or death. Land Rover will notify owners, and dealers will replace the front passenger air bag assembly, free of charge. Owners may contact Land Rover customer service at 1-800-637-6837. Land Rover's number for this recall is P083.

18V-011

Subaru of America, Inc. (Subaru) is recalling certain 2009-2013 Legacy, Forester, Tribeca, WRX and Outback vehicles, and 2009-2011 Impreza vehicles sold, or ever registered, in the states of Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these inflators may explode due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An explosion of an inflator within the passenger frontal air bag module may result in sharp metal fragments striking the front seat passenger, driver or other occupants resulting in serious injury or death. Subaru will notify owners, and dealers will replace the front passenger air bag inflator, free of charge. The recall began on February 9, 2018. Owners may contact Subaru customer service at 1-800-782-2783. Subaru's number for this recall is TKA-18.

18V-012

Subaru of America, Inc. (Subaru) is recalling certain 2009-2010 Tribeca, Impreza, Forester, WRX, Legacy, and Outback vehicles sold, or ever registered, in the states of Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these inflators may explode due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An explosion of an inflator within the passenger frontal air bag module may result in sharp metal fragments striking the front seat passenger, driver or other occupants resulting in serious injury or death. Subaru will notify owners, and dealers will replace the front passenger air bag inflator, free of charge. The recall began on February 9, 2018. Owners may contact Subaru customer service at 1-800-782-2783. Subaru's number for this recall is TKB-18.

18V-013

Subaru of America, Inc. (Subaru) is recalling certain 2009 Tribeca, Impreza, Forester, WRX, Legacy, and Outback vehicles sold, or ever registered, in the states of Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin, and Wyoming.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2018**

Published March 2, 2018

of the passenger frontal air bag, these inflators may explode due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An explosion of an inflator within the passenger frontal air bag module may result in sharp metal fragments striking the front seat passenger, driver or other occupants resulting in serious injury or death. Subaru will notify owners, and dealers will replace the front passenger air bag inflators, free of charge. The recall began on February 9, 2018. Owners may contact Subaru customer service at 1-800-782-2783. Subaru's number for this recall is TKC-18.

18V-014

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain 2011-2012 Land Rover Range Rover vehicles, originally sold, or ever registered, in Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B."

Unless included in "Zone B" above, Land Rover is recalling certain 2010-2012 Land Rover Range Rover vehicles, originally sold, or ever registered, in Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin, and Wyoming or "Zone C."

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these inflators may explode due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator explosion may result in sharp metal fragments striking the driver or other occupants resulting in serious injury or death. Land Rover will notify owners, and dealers will replace the front passenger air bag assembly, free of charge. Owners may contact Land Rover customer service at 1-800-637-6837. Land Rover's number for this recall is P084.

18V-015

Mazda North American Operations (Mazda) is recalling certain 2009 B-Series trucks ever registered in the states of Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin, and Wyoming.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these inflators may explode due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator explosion may result in sharp metal fragments striking the driver or other occupants resulting in serious injury or death. Mazda will notify owners, and dealers will replace the front passenger air bag inflator with an alternate inflator, free of charge. The recall is expected to begin March 2018. Owners may contact Mazda customer service at 1-800-222-5500. Mazda's number for this recall is 2118A.

18V-016

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2018**

Published March 2, 2018

Mazda North American Operations (Mazda) is recalling 2010 Mazda RX-8 vehicles sold, or ever registered, in the states of Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia or "Zone B."

Additionally, unless covered under "Zone B" Mazda is recalling certain 2009 RX-8 vehicles ever registered in the states of Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin, and Wyoming or "Zone C."

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these inflators may explode due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator explosion may result in sharp metal fragments striking the driver or other occupants resulting in serious injury or death. Mazda will notify owners, and dealers will replace the front passenger air bag inflator with an alternate one, free of charge. The recall is expected to begin March 2018. Owners may contact Mazda customer service at 1-800-222-5500. Mazda's number for this recall is 2018A.

18V-017

Mazda North American Operations (Mazda) is recalling certain 2013 Mazda6 and CX-9 vehicles sold, or ever registered in the states of Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands or "Zone A."

Additionally, unless covered in "Zone A," Mazda is recalling certain 2010 Mazda6, CX-7 and CX-9 vehicles sold, or ever registered in the states of Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia or "Zone B."

Additionally, unless covered in Zone A or Zone B, Mazda is recalling certain 2009 Mazda6, CX-7, and CX-9 vehicles ever registered in the states of Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin, and Wyoming or "Zone C."

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these inflators may explode due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator explosion may result in sharp metal fragments striking the driver or other occupants resulting in serious injury or death. Mazda will notify owners, and dealers will replace the front passenger air bag inflator with an alternate inflator, free of charge. The recall is

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2018**

Published March 2, 2018

expected to begin March 2018. Owners may contact Mazda customer service at 1-800-222-5500. Mazda's number for this recall is 1317F.

18V-018

E-One Incorporated (E-One) is recalling certain 2013-2017 Cyclone II, Typhoon, and Quest II emergency vehicles equipped with a Cummins ISL, L9, ISX15, or X15 engine. The affected engines do not have a diode in the starter solenoid circuit to improve the longevity of the lock-out relay, resulting in accumulated damage over time. The damaged starter lock-out relay may prevent the vehicle from starting, hindering personnel from responding to emergencies. E-One will notify owners, and dealers will install a diode in the starter solenoid circuit and install a new starter lock-out relay, free of charge. The recall began on February 19, 2018. Owners may contact E-One customer service at 1-352-861-3612.

18V-019

New Flyer of America Inc. (New Flyer) is recalling certain 2017 XD40, XDE40, XN40, XT60, and 2016-2017 XDE60 transit buses. The air brake hose connections for the front axle ABS modulator valves may not be properly tightened, possibly resulting in the air brake hose disconnecting. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 121, "Air Brake Systems." If the brake hose disconnects from the ABS modulator valve, there will be no brake force applied to either of the front axle brake assemblies, lengthening the needed braking distance and increasing the risk of a crash. New Flyer will notify owners, and will reconnect the air hose using the proper tightness, free of charge. The recall began on January 11, 2018. Owners may contact New Flyer customer service at 1-204-224-6706. New Flyer's number for this recall is R18-001.

18V-020

Chrysler (FCA US LLC) is recalling certain 2009-2013 Jeep Wrangler, Chrysler 300, Dodge Challenger and Dodge Charger vehicles, and 2009-2011 Dodge Dakota vehicles sold, or ever registered, in the states of Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands or "Zone A."

Additionally, Chrysler is recalling certain 2009-2010 RAM 4500 Cab Chassis, RAM 5500 Cab Chassis, RAM 3500 Cab Chassis, Jeep Wrangler, Chrysler 300, Dodge Dakota, Dodge Challenger, and Dodge Charger vehicles ever registered in the states of Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia or "Zone B."

Chrysler is also recalling certain 2009 RAM 3500, RAM 2500, RAM 4500 Cab Chassis, RAM 5500 Cab Chassis, Dodge Durango, Chrysler Aspen, RAM 3500 Cab Chassis, Jeep Wrangler, Chrysler 300, Dodge Dakota, Dodge Challenger, and Dodge Charger vehicles ever registered in the states of Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin, and Wyoming.

In the event of a crash necessitating deployment of the passenger frontal air bag, these passenger air bag inflator

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2018**

Published March 2, 2018

may explode due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

An inflator explosion may result in sharp metal fragments striking the driver or other occupants resulting in serious injury or death.

18V-021

Ford Motor Company (Ford) is recalling certain 2006 Ford Ranger trucks. Ford is requesting owners NOT TO DRIVE these vehicles until they have been repaired. Upon deployment of the passenger side frontal air bag, excessive internal pressure may cause the inflator to explode.

On January 11, 2018, Ford Motor Company (Ford) notified NHTSA that they are recalling 2,700 model year 2006 Ranger vehicles built with passenger-side air bag inflators. As of February 9, 2018, Ford is expanding the recall to a total of 33,310 model year 2006 Ranger vehicles built with passenger-side air bag inflators.

Upon deployment of the passenger side frontal air bag, excessive internal pressure may cause the inflator to explode.

In the event of a crash necessitating deployment of the passenger's frontal air bag, the inflator could explode with sharp metal fragments striking the vehicle occupants, potentially resulting in serious injury or death. Ford will notify owners instructing them to not drive their vehicles, and dealers will replace the passenger side air bag inflator with an alternate inflator, free of charge. The recall for the original population began on January 16, 2018. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 18S02.

18V-022

Ford Motor Company (Ford) is recalling certain 2006 Ford Ranger trucks. Ford is requesting owners NOT TO DRIVE these vehicles until they have been repaired.

On January 11, 2018, Ford Motor Company (Ford) notified NHTSA that they are recalling 2,700 model year 2006 Ranger vehicles built with driver-side air bag inflators. As of February 9, 2018, Ford is expanding the recall to a total of 33,310 model year 2006 Ranger vehicles.

Upon deployment of the driver side frontal air bag, excessive internal pressure may cause the inflator to explode.

In the event of a crash necessitating deployment of the driver's frontal air bag, the inflator could explode with sharp metal fragments striking the vehicle occupants, potentially resulting in serious injury or death. Ford will notify owners instructing them to not drive their vehicles, and dealers will replace the front driver side air bag inflator with an alternate inflator, free of charge. The recall for the original population began on January 16, 2018. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 18S02.

18V-023

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain 2013 Scion xB, Toyota Corolla, Corolla Matrix, Sienna, 4Runner, Lexus IS250, IS350, IS250C, IS350C, IS-F, and GX460 vehicles sold, ever registered, in the states of AL, CA, FL, GA, HI, LA, MS, SC, TX, PR, AS, GU, the MP (Saipan), and the U.S. VI or "Zone A."

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2018**

Published March 2, 2018

Toyota is also recalling certain 2010 Scion xB, Toyota Corolla, Corolla Matrix, Yaris, 4Runner, Lexus IS250, IS350, IS250C, IS350C, ES350, IS-F, GX460, and Pontiac Vibe vehicles sold, ever registered, in the states of AZ, AR, DE, DC, IL, IN, KS, KY, MD, MO, NE, NV, NJ, NM, NC, OH, OK, PA, TN, VA, and WV or "Zone B."

Toyota is also recalling certain 2009 Scion xB, Toyota Corolla, Corolla Matrix, Yaris, Lexus IS250, IS350, ES350, IS-F, and Pontiac Vibe vehicles ever registered in the states of AK, CO, CT, ID, IA, ME, MA, MI, MN, MT, NH, NY, ND, OR, RI, SD, UT, VT, WA, WI, and WY or "Zone C."

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these inflators may explode due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator explosion may result in sharp metal fragments striking the driver or other occupants resulting in serious injury or death. Toyota will notify the Toyota, Scion and Lexus owners. General Motors will contact the Pontiac owners. Depending on the vehicle model, dealers will replace the front passenger air bag inflator, or replace the air bag assembly. The recall began on January 29, 2018. Owners may contact Toyota customer service at 1-800-331-4331, or Pontiac customer service at 1-800-762-2737. Toyota's numbers for this recall are "Zone A" Toyota: GOP, Lexus: GLG; "Zone B" Toyota: GOR, Lexus GLH; "Zone C" Toyota: HOA, and Lexus: HLA.

18V-024

On January 9, 2018, Toyota Motor Engineering & Manufacturing (Toyota) notified NHTSA that they are recalling 14,585 model year 2010-2012 Yaris vehicles ever registered in the states of Alaska, Arizona, Arkansas, Colorado, Connecticut, Delaware, District of Columbia, Idaho, Illinois, Indiana, Iowa, Kansas, Kentucky, Maine, Maryland, Massachusetts, Michigan, Minnesota, Missouri, Montana, Nebraska, Nevada, New Hampshire, New Jersey, New Mexico, New York, North Carolina, North Dakota, Ohio, Oklahoma, Oregon, Pennsylvania, Rhode Island, South Dakota, Tennessee, Utah, Vermont, Virginia, Washington, West Virginia, Wisconsin, and Wyoming.

As of January 30, 2018, Toyota is additionally recalling 3,347 model year 2010 Pontiac Vibe vehicles located in states listed above. Also included in this recall filing is 98,194 model year 2003-2008 Toyota Corolla Matrix vehicles, located throughout the U.S., that previously received a ¿like-for-like¿ interim air bag inflator replacement.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these inflators may explode due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator explosion may result in sharp metal fragments striking the driver or other occupants resulting in serious injury or death.

Toyota will notify owners, and dealers will replace the passenger frontal air bag assemblies with an alternate

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2018**

Published March 2, 2018

inflator, free of charge. The recall began on January 29, 2018. Owners may contact Toyota customer service at 1-800-331-4331. Toyota's numbers for this recall are G0R (Zone B), and H0A (Zone C), J0A (Matrix Zone A), J0A (Matrix Zone A), J0A (Matrix Zone A).

18V-025

Hyundai Motor America (Hyundai) is recalling certain 2006-2011 Hyundai Azera and 2006 Hyundai Sonata vehicles. Water may enter the Anti-lock Brake (ABS) Module and result in an electrical short. An electrical short within the ABS Module may cause an engine compartment fire, even when the car is turned off, increasing the risk of an injury. Hyundai will notify owners, and dealers will install a relay in the vehicle's main junction box to prevent the risk of an ABS short-circuit while the car is turned off, free of charge. The recall began on February 19, 2018. Owners may call Hyundai at 1-800-633-5151. Hyundai's number for this recall is 172.

18V-026

BMW of North America, LLC (BMW) is recalling certain 2007-2013 X5 xDrive30i, X5 xDrive35i, X5 xDrive48i, X5 xDrive50i, X5 M, 2009-2010 X5 xDrive35d vehicles and 2009-2013 X6 xDrive35i, X6 xDrive50i, and X6 M vehicles ever registered in the states of Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands or "Zone A."

BMW is also recalling certain 2007-2010 X5 xDrive30i, X5 xDrive35i, X5 xDrive48i, X5 xDrive50i, X5 M, X5 xDrive35d, X6 xDrive35i, X6 xDrive50i and X6M vehicles ever registered in the states of Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia or "Zone B."

BMW is also recalling certain 2007-2009 X5 xDrive30i, X5 xdrive35i, X5 xDrive48i, X5 xDrive50i, X5 M, X5 xDrive35d, X6 xDrive35i, X6 xDrive50i and X6M vehicles ever registered in the states of AK, CO, CT, ID, IA, ME, MA, MI, MN, MT, NH, NY, ND, OR, RI, SD, UT, VT, WA, WI, and WY or "Zone C."

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these inflators may explode due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator explosion may result in sharp metal fragments striking the driver or other occupants resulting in serious injury or death. BMW will notify owners, and dealers will replace the passenger front air bag module, free of charge. The recall is expected to begin March 2018. Owners may contact BMW customer service at 1-800-525-7417.

18V-030

Tesla, Inc. (Tesla) is recalling all 2013 Model S vehicles equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these inflators may explode due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2018**

Published March 2, 2018

explosion may result in sharp metal fragments striking the driver or other occupants resulting in serious injury or death. Tesla will notify owners, and Tesla Service Centers will replace the passenger frontal air bag modules, free of charge. The recall is expected to begin in March 2018. Owners may contact Tesla customer service at 1-877-798-3752. Tesla's number for this recall is SB-18-20-001.

18V-031

Daimler Vans USA, LLC (DVUSA) is recalling certain 2013 Freightliner Sprinter 2500 and 3500 and Mercedes-Benz Sprinter 2500 and 3500 vehicles.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these inflators may explode due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator explosion may result in sharp metal fragments striking the driver or other occupants resulting in serious injury or death. DVUSA will notify owners, and dealers will replace the front passenger air bag module, free of charge. The recall is expected to begin in March 2018. Owners may contact DVUSA customer service at 1-877-762-8267.

18V-032

KTM North America, Inc. (KTM) is recalling certain 2015-2016 1290 Super Duke R ABS, 2016 1290 Super Duke R SE ABS and 1290 Super Duke GT ABS and 2017-2018 Super Duke R and 1290 Super Duke GT motorcycles. The piston within the Brembo front brake master cylinder may fail. If the front brake master cylinder piston fails, the loss of front braking ability can increase the risk of a crash. KTM will notify owners, and dealers will replace the piston with an aluminum one, free of charge. The recall began on February 21, 2018. Owner's may contact KTM customer service at 1-888-985-6090.

18V-033

Forest River, Inc. (Forest River) is recalling certain 2017-2018 Forest River Cherokee travel trailers. On the affected trailers, a 14 gauge and a 12 gauge neutral wire for the 110V Air Conditioning were connected to the same lug in the 120V panel neutral bus bar. If both wires were connected to same lug, the smaller wire may overheat and fail due to trying to handle a higher load, thereby increasing the risk of an electrical fire. Forest River will notify owners, and dealers will relocate the subject wire to another 14 gauge terminal, as necessary, free of charge. The recall began on February 14, 2018. Owners may contact Forest River customer service at 1-260-499-2100. Forest River's number for this recall is 17A-0609.

18V-034

Altec Industries Inc. (Altec) is recalling certain 2017 AT Aerial Devices mounted on Ford F-550 chassis. A circuit breaker located under the hood may contact the hood, potentially resulting in an electrical short. An electrical short can increase the risk of a fire. Altec has notified owners, and dealers will update the circuit breaker bracket and install a insulating chafe pad, free of charge. The recall began on January 12, 2018. Owners may contact Altec customer service at 1-205-991-7733. Altec's number for this recall is MAB 675.

18V-035

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2018**

Published March 2, 2018

Altec Industries Inc. (Altec) is recalling certain 2014-2017 Altec AC40-152S Cranes. On the affected cranes, the electronic Load Moment and Area Protection (LMAP) may display incorrect load chart values. Using an incorrect chart value could lead to unit instability or loss of load control increasing the risk of death or serious injury. Altec will notify owners, and dealers will update the LMAP software, as necessary, free of charge. The recall began on February 5, 2018. Owners may contact Altec at 1-205-991-7733. Altec's number for this recall is CSN 673.

18V-036

Van-Con, Inc. (Van-Con) is recalling certain 2016-2018 Van-Con Dual Rear-Wheel school buses, model 33803, built on Chevrolet 3500 chassis and equipped with wheelchair lifts. The lifts in the affected vehicles may not deactivate until they are beyond the acceptable limit for being uneven. As such, these lifts fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 403 "Platform lift systems" and FMVSS number 404 "Platform lift installations." A lift platform that is uneven may cause a fall, increasing the risk of an injury. Van-Con will notify owners, and dealers will inspect the threshold warning system, adjusting it as necessary, free of charge. The recall is expected to begin March 2018. Owners may contact Van-Con customer service at 1-732-356-8484.

18V-037

Mazda is recalling certain 2006 B-series vehicles. Mazda requests owners NOT TO DRIVE these vehicles until they have been remedied. Upon deployment of the driver side frontal air bag, excessive internal pressure may cause the inflator to explode.

On January 11, 2018, Mazda North American Operations (Mazda) notified NHTSA that they are recalling 160 model year 2006 B-Series vehicles built with driver-side air bags. As of February 9, 2018, Mazda is expanding the recall to a total of 2,205 model year 2006 B-Series vehicles built with driver-side air bags.

Upon deployment of the driver side frontal air bag, excessive internal pressure may cause the inflator to explode. In the event of a crash necessitating deployment of the driver's frontal air bag, the inflator could explode with sharp metal fragments striking the vehicle occupants, potentially resulting in serious injury or death. Mazda will notify owners instructing them to not drive their vehicles, and dealers will replace the front driver side air bag inflator with an alternate inflator, free of charge. The recall for the original population began on January 16, 2018. Owners may contact Mazda customer service at 1-800-222-5500. Mazda's number for this recall is 2218A.

18V-038

Mazda North America Operations (Mazda) is recalling certain 2006 B-Series vehicles. Mazda is requesting owners to NOT DRIVE these vehicles until they have been remedied. Upon deployment of the passenger side frontal air bag, excessive internal pressure may cause the inflator to explode.

On January 11, 2018, Mazda North American Operations (Mazda) notified NHTSA that they are recalling 160 model year 2006 B-Series vehicles built with driver-side air bags. As of February 9, 2018, Mazda is expanding

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2018**

Published March 2, 2018

the recall to a total of 2,205 model year 2006 B-Series vehicles built with driver-side air bags.

Upon deployment of the driver side frontal air bag, excessive internal pressure may cause the inflator to explode.

In the event of a crash necessitating deployment of the passenger's frontal air bag, the inflator could explode with sharp metal fragments striking the vehicle occupants, potentially resulting in serious injury or death. Mazda will notify owners instructing them to not drive their vehicles, and dealers will replace the front passenger side air bag inflator with an alternate inflator, free of charge. The recall for the original population began on January 16, 2018. Owners may contact Mazda customer service at 1-800-222-5500. Mazda's number for this recall is 2318A.

18V-039

Ferrari North America, Inc. (Ferrari) is recalling certain 2013 California, 458 Italia, 458 Spider, FF, and F12 Berlinetta vehicles sold, or ever registered in the states of Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands. These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these inflators may explode due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator explosion may result in sharp metal fragments striking the driver or other occupants resulting in serious injury or death. Ferrari will notify owners, and dealers will replace the passenger frontal air bag assembly, free of charge. The recall is expected to begin March 2018. Owners may contact Ferrari customer service at 1-866-551-2828. Ferrari's number for this recall is 63.

18V-040

Honda (American Honda Motor Co.) is recalling certain 2010-2012 Acura RL, 2010 Honda Element, and 2010-2013 Honda Ridgeline vehicles ever registered in the states of Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands or "Zone A."

Additionally, Honda is recalling certain 2010 Acura RL, 2010-2011 Honda Element and Honda Ridgeline vehicles ever registered in the states of Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia or "Zone B."

If not included in zones A or B above, Honda is recalling certain 2009 Acura RL, Honda Element, and Honda Ridgeline vehicles ever registered in the states of Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin, and Wyoming or "Zone C."

These vehicles are equipped with certain air bag inflators assembled as part of the frontal air bag

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2018**

Published March 2, 2018

modules, and used as original equipment or replacement equipment (such as after a vehicle crash necessitating replacement of the original air bags), may explode due to propellant degradation occurring after long-term exposure to higher absolute humidity, temperature and temperature cycling. An inflator explosion may result in sharp metal fragments striking the driver or other occupants resulting in serious injury or death. Honda will notify owners, and dealers will replace the passenger frontal air bag inflator, free of charge. The recall began February 16, 2018. Owners may contact Honda customer service at 1-888-234-2138. Honda's numbers for this recall are UOH, and G0I.

18V-041

Honda (American Honda Motor Co.) is recalling certain 2010-2013 Acura TSX, ZDX, Honda Accord Crosstour, Fit, Insight and Pilot vehicles, 2011-13 Acura TSX Sportswagon, 2010-2012 Honda Accord,, 2010-2011 Honda Civic, Civic NGV, Civic Hybrid and CR-V vehicles and 2013 Honda FCX Clarity and Fit EV vehicles ever registered in the states of Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands or "Zone A."

Additionally, Honda is recalling certain 2010-2012 Acura TSX, Honda Accord, Accord Crosstour, Fit and Pilot, 2010-2011 Honda Civic, Civic NGV, Civic Hybrid and CR-V, and 2010 Acura ZDX and Honda Insight vehicles ever registered in the states of Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia or "Zone B."

Unless included in Zones A or B above, Honda is recalling certain 2009 Acura TSX, Honda Accord, Civic, Civic NGV, Civic Hybrid, CR-V, Fit, and Pilot vehicles ever registered in the states of Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin, and Wyoming or "Zone C."

These vehicles are equipped with certain air bag inflators assembled as part of the frontal air bag modules, and used as original equipment or replacement equipment (such as after a vehicle crash necessitating replacement of the original air bags), may explode due to propellant degradation occurring after long-term exposure to higher absolute humidity, temperature and temperature cycling.

18V-042

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2013 C250, C250 Coupe, C350 Coupe 4Matic, C300 4Matic, C350, C350 Coupe, C63 AMG, C63 Coupe, E350 Cabrio, E350 Coupe, E550 Cabrio, E350 Coupe 4Matic, E550 Coupe, GLK350 4Matic, GLK250 Bluetec 4Matic, GLK350, SLS Coupe, SLS AMG GT Coupe, and SLS Roadster vehicles sold, or ever registered, in the states of Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands or "Zone A."

Additionally, MBUSA is recalling certain 2010 C300, C300 4Matic, C63 AMG, E350 Coupe, E550 Coupe,

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2018**

Published March 2, 2018

GLK350, and GLK350 4Matic vehicles ever registered in the states of Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia or "Zone B."

MBUSA is also recalling certain 2009 C300, C300 4Matic, C63 AMG, and C350 vehicles ever registered in the states of AK, CO, CT, ID, IA, ME, MA, MI, MN, MO, NH, NY, ND, OR, RI, SD, UT, VT, WA, WI and WY or "Zone C."

In the event of a crash necessitating deployment of the passenger frontal air bag, these passenger air bag inflator may explode due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator explosion may result in sharp metal fragments striking the driver or other occupants resulting in serious injury or death. MBUSA will notify owners, and dealers will replace the passenger frontal air bag module, free of charge. Parts are currently not available. Mercedes issued an interim notification to owners on February 23, 2018. A second notice will be mailed when remedy parts are available. Owners may contact MBUSA customer service at 1-877-496-3691.

18V-043

Nissan North America, Inc. (Nissan) is recalling certain 2009-2012 Versa Hatchback, and 2009-2011 Versa Sedan vehicles ever registered in the states of Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands or "Zone A."

Additionally, Nissan is recalling certain 2009-2010 Versa Hatchback, and Versa Sedan vehicles ever registered in the states of Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia or "Zone B."

Nissan is also recalling certain 2009 Versa Hatchback and Versa Sedan vehicles ever registered in the states of Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin, and Wyoming or "Zone C."

In the event of a crash necessitating deployment of the passenger frontal air bag, these passenger air bag inflator may explode due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator explosion may result in sharp metal fragments striking the driver or other occupants resulting in serious injury or death. Nissan will notify owners, and dealers will replace the passenger frontal air bag inflator, free of charge. The recall is expected to begin in March 2018. Owners may contact Nissan customer service at 1-800-647-7261.

18V-044

Honda (American Honda Motor Co.) is recalling certain 2009-2010 and 2012-2016 Honda GL1800 Gold Wing motorcycles. These motorcycles have air bag inflators assembled as part of the air bag module that may

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2018**

Published March 2, 2018

explode due to propellant degradation occurring after long-term exposure to higher absolute humidity, temperature and temperature cycling. An inflator explosion may result in sharp metal fragments striking the rider resulting in serious injury or death. Honda will notify owners, and dealers will replace the air bag module, free of charge. The recall began February 9, 2018. Owners may contact Honda Motorcycle Customer Support at 1-866-784-1870. Honda's number for this recall is KJ1.

18V-045

Ford Motor Company (Ford) is recalling certain 2013 Ford Mustang vehicles sold, or ever registered in the states of Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands or "Zone A."

Additionally, Ford is recalling certain 2010 Ford Edge, Fusion, Mustang and Ranger, Lincoln MKX and Zephyr/MKZ, and Mercury Milan vehicles ever registered in the states of Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia or "Zone B."

Ford is also recalling certain 2009 Ford Edge, Fusion, Mustang and Ranger, Lincoln MKX and Zephyr/MKZ, and Mercury Milan vehicles ever registered in the states of Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin, and Wyoming or "Zone C."

These vehicles are equipped with air bag inflators assembled as part of the passenger frontal air bag modules, used as original equipment or replacement equipment (such as after a vehicle crash necessitating replacement of the original air bags), that may explode due to propellant degradation occurring after long-term exposure to high absolute humidity, temperature and temperature cycling. An inflator explosion may result in sharp metal fragments striking the driver or other occupants resulting in serious injury or death. Ford will notify owners, and dealers will replace the passenger frontal air bag inflator, free of charge. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 18S01.

18V-046

Mitsubishi Fuso Truck of America, Inc. (MFTA) is recalling certain 2004-2017 FE84D, FE85D, FEC52, FEC72, FEC92, FGB72, FK61F and FM657 trucks. These trucks are equipped with Kidde Plastic-Handle or Push Button 'Pindicator' Fire Extinguishers that may become clogged, preventing the extinguisher from discharging as expected or requiring excessive force to activate the extinguisher. Additionally, in certain models, the nozzle may detach from the valve assembly with enough force that it could cause injury and also render the product inoperable. For a full list of the affected fire extinguisher models visit:

<https://static.nhtsa.gov/odi/rc1/2017/RMISC-17E062-5427.pdf> In the event of a fire, if the fire extinguisher does not function properly, it can increase the risk of injury. MFTA will notify owners, instructing them to contact Kidde for a replacement fire extinguisher, free of charge. The recall began on January 11, 2018. Owners may contact MFTA customer service at 1-877-711-0707, or Kidde customer service toll-free at 1-855-262-3540, or online at www.kidde.com and click on "Product Safety Recall" for more information. MFTA's number for this recall is MFV00001.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2018**

Published March 2, 2018

18V-047

Chrysler (FCA US LLC) is recalling certain 2018 Jeep Grand Cherokee Trackhawk vehicles equipped with a 6.2L Supercharged Engine. The fuel line may separate. If the fuel line separates, the engine may stall, increasing the risk of a crash. In addition, a fuel line separation increases the risk of an engine compartment fire and injury. Chrysler will notify owners, and dealers will inspect and, as necessary, replace the fuel line, free of charge. The recall began February 23, 2018. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is U02.

18V-048

Chrysler (FCA US LLC) is recalling certain 2017 Chrysler Pacifica vehicles equipped with a 3.6l engine. The engine control software may become out of sync with the crankshaft position sensor, possibly resulting in an engine stall. An engine stall can increase the risk of a crash. Chrysler will notify owners, and dealers will update the engine control software, free of charge. The recall is expected to begin March 2018. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is U01.

18V-049

Pierce Manufacturing (Pierce) is recalling certain 2015-2016 Arrow XT, Enforcer, Quantum, Saber, Velocity, and Commercial emergency vehicles equipped with Hale pressure relief valves in the water pumps used for fire fighting. Rings securing the valves may corrode over time after exposure to water, causing the ring to fail and the pressure relief valve to open, reducing the water pressure available for fire fighting. A reduction in water pressure may hinder fire fighting efforts, increasing the risk of injury. Pierce has notified owners, and dealers will install a remedy kit, free of charge. The recall began on February 9, 2018. Owners may contact Pierce customer service at 1-888-974-3723 or Hale Products at 1-800-533-3569. Pierce's number for this recall is 74B287.

18V-050

Forest River, Inc. (Forest River) is recalling certain 2018 Rockwood and Flagstaff, and Coachmen Freedom Express recreational trailers and 2017-2018 Palomino and XLR ToyHauler and Coachmen Viking recreational trailers equipped with a Smart-Jack model power tongue jack. The laminated plastic touch pad on the jack may crack or separate allowing water to enter, potentially causing the jack to operate unintentionally. If the tongue jack retracts or extends unexpectedly, there could be an increased risk of a crash or injury. Forest River will notify owners, and a Forest River or a Lippert dealer will replace the power tongue jack, free of charge. The recall began on February 20, 2018. Rockwood and Flagstaff Owners may contact Forest River customer service at 1-574-642-5164; XLR ToyHauler owners can call 1-574-642-0432; Viking owners can call 1-269-467-4600; Freedom Express owners can call 1-574-825-8205; Palomino owners can call 1-269-432-3246. Lippert Customer service can be reached at 1-574-538-4514 or by email at recall@lci1.com. Forest River's number for this recall is 51-0610.

18V-051

Jaguar Land Rover North America, LLC (Jaguar) is recalling certain 2017-2018 F-Pace vehicles. The Instrument Cluster (IC) may intermittently go blank. A blank instrument cluster will not show important information like vehicle speed, increasing the risk of a crash. Jaguar will notify owners, and dealers will update

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2018**

Published March 2, 2018

the vehicle software, free of charge. The recall began on February 16, 2018. Owners may contact Jaguar customer service at 1-800-452-4827. Note: This recall expands the scope of vehicles recalled under 17V-678. Jaguar's number for this recall is H056.

18V-052

Foretravel, Inc. (Foretravel) is recalling certain 2004-2019 U270, U295, U320, Nimbus, Phenix, Realm, and ih-45 motorhomes. These vehicles are equipped with Kidde Plastic-Handle or Push Button 'Pindicator' Fire Extinguishers that may become clogged, preventing the extinguisher from discharging as expected or requiring excessive force to activate the extinguisher. Additionally, in certain models, the nozzle may detach from the valve assembly with enough force that it could cause injury and also render the product inoperable. For a full list of the affected fire extinguisher models visit: <https://static.nhtsa.gov/odi/rc1/2017/RMISC-17E062-5427.pdf> In the event of a fire, if the fire extinguisher does not function properly, it can increase the risk of injury. Foretravel will notify owners, and instruct them to contact Kidde for a replacement fire extinguisher, free of charge. The recall began on February 6, 2018. Owners may contact Foretravel customer service at 1-936-564-8367, or Kidde customer service toll free at 1-855-262-3540, or online at www.kidde.com and click on "Product Safety Recall" for more information.

18V-053

Elgin Sweeper Company Inc. (Elgin) is recalling certain 2017 Crosswind street sweepers. Debris may collect under the cab area and contact the exhaust system. If flammable debris contacts the exhaust system, it can increase the risk of a fire. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Elgin customer service at 1-877-342-5374.

18V-054

Indian Motorcycle Company (Indian) is recalling certain 2015-2017 Roadmaster motorcycles. Water may enter the trunk wiring harness, potentially causing the brake light to remain illuminated even when the brakes are not applied. If the brake light remains illuminated when the brakes are not applied, a vehicle behind the motorcycle may not know when the motorcycle is actually slowing, increasing the risk of a crash. Indian will notify owners, and dealers will replace the trunk wiring harness with an updated harness that contains sealing plugs in the connectors, free of charge. The recall began on January 30, 2018. Owners may contact Indian customer service at 1-877-204-3697. Indian's number for this recall is I-18-01.

18V-055

E-One Incorporated (E-One) is recalling certain 2005-2010 E-One Typhoon, Cyclone II, X-036, Cyclone III, SPGL, SPBE, FLM2, F550, I440, and I740 emergency vehicles, equipped with an IOTA 50 Amp transfer switch. Electrical connections at the transfer switch may loosen and cause excessive heat. The excessive heat can increase the risk of a fire. E-One will notify owners, and dealers will replace the IOTA transfer switch with a Powermax switch, free of charge. The recall began on February 19, 2018. Owners may contact E-One customer service at 1-352-861-3612.

18V-056

E-One Incorporated (E-One) is recalling certain 2001-2002 E-One X-036 and X-113 emergency vehicles.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2018**

Published March 2, 2018

The flat end caps on the fire pump manifold may fatigue over time and fail, allowing water to suddenly discharge or reducing the water pressure available for fighting fires. Sudden discharge of water poses a risk of injury to firefighting personnel in close proximity, and partial or total loss of discharge pressure could place firefighting personnel or the public at an increased risk of injury. E-One will notify owners, and dealers will inspect and replace the flat end cap with a domed end cap kit. Labor compensation will not be covered by E-One. The recall began on February 19, 2018. Owners may contact E-One customer service at 1-352-861-3612.

18V-057

Ford Motor Company (Ford) is recalling certain 2018 Ford Expedition and Lincoln Navigator vehicles. The second row window control modules may intermittently stop the movement of the power window. If something, such as a finger, is pinched by the window glass, the stopped window control module may prevent the window from automatically reversing. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 118, "Power-Operated Window Systems." If the window does not automatically reverse when an obstruction is found, it can increase the risk of injury. Ford will notify owners, and dealers will inspect the second row window electronic control modules, and replace them as necessary based on their build date codes, free of charge. The recall began on February 16, 2018. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 18C01.

18V-058

Liberty Outdoors, LLC (Liberty) is recalling certain 2018 Little Guy Max recreational trailers, equipped with a Smart-Jack model power tongue jack. The laminated plastic touch pad on the jack may crack or separate allowing water to enter, potentially causing the jack to operate unintentionally. If the jack retracts or extends unintentionally, it can increase the risk of injury to those within the trailer or increase the risk of a crash if the jack moves while the trailer is being towed. Liberty will notify owners, and dealers will replace the power tongue jack, free of charge. The recall began on February 27, 2018. Owners may contact Liberty customer service at 1-877-545-4897. Liberty's number for this recall is LOR-001.

18V-059

Wayfarer is recalling certain 2017 24 QW recreational vehicles, equipped with Kidde Plastic-Handle or Push Button 'Pindicator' Fire Extinguishers. These extinguishers may become clogged, preventing the extinguisher from discharging as expected or requiring excessive force to activate the extinguisher. Additionally, in certain models, the nozzle may detach from the valve assembly with enough force that it could cause injury and also render the product inoperable. For a full list of the affected fire extinguisher models visit: <https://static.nhtsa.gov/odi/rc1/2017/RMISC-17E062-5427.pdf> In the event of a fire, if the fire extinguisher does not function properly, it can increase the risk of injury. Wayfarer will notify owners, and instruct them to contact Kidde for a replacement fire extinguisher, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Wayfarer customer service at 1-256-356-8661, or Kidde customer service at 1-855-262-3540 or online at www.kidde.com and click on "Product Safety Recall" for more information.

18V-060

Newmar Corporation (Newmar) is recalling certain 2018 Essex motorhomes built on a Freightliner chassis. The low beam headlights do not also illuminate as intended when the high beam headlights are activated, reducing the

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2018**

Published March 2, 2018

driver's visibility. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." If the driver has reduced visibility, there would be an increased risk of a crash. Newmar will notify owners, and Daimler Trucks North America authorized service facilities will reprogram the Freightliner chassis module, free of charge. The recall began on February 9, 2018. Owners may contact Newmar customer service at 1-800-731-8300.

18V-061

Newmar Corporation (Newmar) is recalling certain 2017-2018 Ventana, Ventana LE and Dutchstar motorhomes built on a Freightliner chassis. The low beam headlights do not also illuminate as intended when the high beam headlights are activated, reducing the driver's visibility. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." If the driver has reduced visibility, there would be an increased risk of a crash. Newmar will notify owners, and Daimler Trucks North America authorized service facilities will reprogram the Freightliner chassis module, free of charge. The recall began on February 9, 2018. Owners may contact Newmar customer service at 1-800-731-8300.

18V-062

KZRV, L.P. (KZRV) is recalling certain 2017-2018 Durango Gold recreational trailers. The rear sofa in these vehicles may limit visibility of the rear exit window label and/or the sofa cushion may restrict access to, and operation of, the exit window handle. If the sofa delays using the exit window in the event of an emergency, the occupants have an increased risk of injury. KZRV will notify owners, and dealers will replace the sofa back with a back that isn't as tall, free of charge. The recall is expected to begin March 16, 2018. Owners may contact KZRV customer service at 1-800-768-4016 extension 154 or 153. KZRV's number for this recall is KZ-2018-01.

18V-063

Suzuki Motor of America, Inc. (Suzuki) is recalling certain 2017-2018 GSX-R1000, GSX-R1000A, GSX-R1000RA, and GSX-R1000RZA motorcycles. When upshifting between first and second gear, if the rider fails to engage second gear, a neutral condition will exist and may cause very high engine RPM. If the rider then shifts into second gear without disengaging the clutch, the motorcycle's chain may stretch or break. If the drive chain breaks, the motorcycle will lose power, increasing the risk of a crash. Suzuki will notify owners, and dealers will replace the Engine Control Module (ECM), and inspect and replace the drive chain and sprockets, as necessary, free of charge. The recall began on January 25, 2018. Owners may contact Suzuki customer service at 1-714-572-1490. Suzuki's numbers for this recall are 2A76 to 2A81.

18V-064

Aston Martin The Americas (Aston Martin) is recalling certain 2017-2018 DB11 V12 Coupe and DB11 V8 Coupe vehicles. The driver's frontal air bag may unexpectedly deploy due to insufficient grounding of the steering components if an electrostatic discharge occurs and the air bag clockspring is broken. If the driver air bag inadvertently deploys, it can increase the risk of injury and a crash. Aston Martin will notify owners, and dealers will add sufficient grounding to the steering components, free of charge. The recall is expected to begin March 2018. Owners may contact Aston Martin customer service at 1-888-923-9988.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2018**

Published March 2, 2018

18V-065

Forest River, Inc. (Forest River) is recalling certain 2018 Cherokee recreational trailers. The amber side marker lights are not located as far to the front as feasible on the vehicle. Additionally, the vehicles may also be missing the intermediate side reflex reflectors located at, or near, the midpoint of the vehicle. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." If the marker lights are in the wrong location or if the reflectors are missing, it can reduce the visibility of the vehicle to other drivers, increasing the risk of a crash. Forest River will notify owners, and dealers will install amber side marker lights as far forward as feasible, and mount side marker reflectors, free of charge. The recall began on February 16, 2018. Owners may contact Forest River customer service at 1-260-499-2100. Forest River's number for this recall is 75-0613.

18V-066

Forest River, Inc. (Forest River) is recalling certain 2018 Palomino PaloMini recreational trailers. The mounting bracket for the single liquid propane (LP) bottle may break allowing the LP bottle to detach from the vehicle. If the LP bottle detaches from the vehicle, there is an increased risk of injury or crash. Forest River will notify owners, and dealers will install a new LP bottle ring, free of charge. The recall is expected to begin March 22, 2018. Owners may contact Forest River customer service at 1-269-432-3246. Forest River's number for this recall is 400-0612.

18V-067

Honda (American Honda Motor Co.) is recalling certain 2017 Clarity Fuel Cell vehicles. The fuel cell control unit (FC-ECU) may misinterpret a small cell voltage drop, causing the vehicle to have reduced, or a complete loss of, power. A loss of power can increase the risk of a crash. Honda will notify owners, and dealers will install a software update, free of charge. Owners may contact Honda customer service at 1-888-234-2138. Honda's number for this recall is R0L.

18V-068

Mitsubishi Motors North America, Inc. (MMNA) is recalling certain 2009-2012 Lancer, 2008-2012 Outlander, 2010-2012 Lancer Sportback, and 2011-2012 Outlander Sport vehicles equipped with either a 4B11 or 4B12 engine. The drive belt automatic tensioner flange may crack, allowing the accessory drive belt to detach. If the drive belt detaches, the battery will discharge and the engine will stall, increasing the risk of a crash. MMNA will notify owners, and dealers will replace the belt tensioner with one that has an improved shape, free of charge. The recall is expected to begin March 27, 2018. Owners may contact MMNA customer service at 1-888-648-7820. MMNA's number for this recall is SR-18-001.

18V-069

Mitsubishi Motors North America, Inc. (MMNA) is recalling certain 2014-2016 Outlander and 2013-2016 Outlander Sport vehicles. Water may enter the rear brake calipers causing the parking brake actuator shafts to corrode and possibly bind. If the parking brake actuator shaft binds, the parking brake may not engage or disengage fully. If the parking brake does not engage properly, the vehicle may move unexpectedly if it is parked on a slope, increasing the risk of a crash. MMNA will notify owners, and dealers will inspect the rear brake

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2018**

Published March 2, 2018

calipers and replace the parking brake boot and lever or the brake caliper body, as necessary. Dealers will also replace the piston assembly of the rear brake caliper. These repairs will be performed free of charge. The recall is expected to begin March 27, 2018. Owners may contact MMNA customer service at 1-888-648-7820. MMNA's number for this recall is SR-18-002.

18V-070

Mitsubishi Motors North America, Inc. (MMNA) is recalling certain 2007-2010 Outlander, 2008-2010 Lancer, 2009-2010 Lancer Evolution, and 2010 Lancer Sportback vehicles equipped with sunroofs. The sunroof glass may detach from the sunroof assembly, becoming a road hazard to other vehicles. If the sunroof glass detaches from the assembly while driving, it can become a road hazard, increasing the risk of a crash. MMNA will notify owners, and dealers will replace the sunroof glass assembly, free of charge. The recall began on February 27, 2018. Owners may contact MMNA customer service at 1-888-648-7820. MMNA's number for this recall is SR-18-003.

18V-071

Jayco, Inc. (Jayco) is recalling certain 2017, 2018 Eagle 333BHOK (EC) travel trailers. The safety chains on these vehicles are rated at 11,700 lbs, however the Gross Vehicle Weight Rating (GVWR) is 12,500lbs. In the event of a trailer detachment, the underrated safety chains may fail. If the safety chains fail in the event of a detachment, the trailer would separate from the tow vehicle, increasing the risk of a crash. Jayco will notify owners, and dealers will install safety chains that have a GVWR of 16,200lbs, free of charge. The recall began on February 8, 2018. Owners may contact Jayco customer service at 1-800-283-8267. Jayco's number for this recall is 9901372.

18V-072

Jayco, Inc. (Jayco) is recalling certain 2018 Eagle EA, EB, ED travel trailers. The Federal Labels and Cargo Carrying Capacity (CCC) label on these vehicles may incorrectly list the Gross Vehicle Weight Rating (GVWR) as 11,750lbs, when the actual GVWR is 11,700lbs. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims." If the GVWR is incorrect it can allow the vehicle to be overloaded, increasing the risk of a crash. Jayco will notify owners and provide them with a corrected label, free of charge. The recall began on February 13, 2018. Owners may contact Jayco customer service at 1-800-283-8267. Jayco's number for this recall is 9901373.

18V-073

Highland Ridge RV (Highland Ridge) is recalling certain 2018 Open Range light travel trailers, model 312BHS. The Federal Label on these vehicles incorrectly lists the Gross Axle Weight Rating (GAWR) as 5100lbs when the correct GAWR is 4400lbs. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims." The incorrect GAWR information may result in the trailer being overloaded which can cause the tires to wear prematurely, increasing the risk of a crash. Highland Ridge will notify owners, and dealers will replace the incorrect Federal Label with a corrected label, free of charge. The recall began on February 7, 2018. Owners may contact Highland Ridge customer service at 1-260-768-7771. Highland's number for this recall is 9904374.

18V-074

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2018**

Published March 2, 2018

Jayco, Inc. (Jayco) is recalling certain 2018 Eagle travel trailers, model 333BHOK. The flame on the Furrion cook top can become inverted or go out when the furnace is turned on, however, liquid propane (LP) gas will continue to flow to the burners. LP gas flow to an unlit stove burner may result in an explosion, increasing the risk of injury. Jayco will notify owners, and dealers will install two wood panels to prevent air from the furnace affecting the stove burners, free of charge. The recall began on February 14, 2018. Owners may contact Jayco customer service at 1-800-283-8267. Jayco's number for this recall is 9901366.

18V-075

Harley-Davidson Motor Company (Harley-Davidson) is recalling all 2008-2011 Touring, CVO Touring and VSRC motorcycles equipped with anti-lock brakes (ABS), including Road King (FLHR), Road King Police (EFI) (FLHP), Road King Police (EFI) (FLHPE), Electra Glide Standard Police (EFI) (FLHTP), Electra Glide Classic (EFI) (FLHTC), Electra Glide Ultra Classic (EFI) (FLHTCU) and Street Glide (EFI) (FLHX), 2008 VROD (VRSCAWA), CVO Road King 4 (FLHRSE4), Night Rod (VRSCDA), CVO Ultra Classic 3 (FLHTCUSE3), Night Rod Special (VRSCDXA), 2008-2010 Road King Classic (EFI) (FLHRC), 2008-2009 Road Glide (EFI) (FLTR) and Electra Glide Standard (EFI) (FLHT), 2009-2010 V-Rod (VRSCAW), 2009 CVO Ultra Classic (FLHTCUSE4) and CVO Road Glide 3 (FLTRSE3), 2009-2011 Night Rod Special (VRSCDX) and V-Rod Muscle (VRSCF), 2010 CVO Ultra Classic 5 (FLHTCUSE5) and CVO Street Glide (FLHXSE), 2010-2011 Electra Glide Ultra Limited (FLHTK) and Road Glide Custom (FLTRX), 2011 Road Glide Ultra 103 (FLTRU103), Street Glide 103 (FLHX103), Road King Classic 103 (FLHRC103), CVO Ultra Classic 6 (FLHTCUSE6), CVO Road Glide Ultra (FLTRUSE), Road Glide Custom 103 (FLTRX103), and CVO Street Glide 2 (FLHXSE2) motorcycles. Deposits may form on components within the brake system if the DOT 4 brake fluid is not replaced for a prolonged period of time beyond the 2-year maintenance schedule specified in the Owner's Manual. These deposits may cause a valve within the ABS Hydraulic Control Unit to stick, reducing braking ability and increasing the risk of a crash. Harley-Davidson will notify owners, and dealers will flush the entire brake system with new Platinum Label DOT 4 brake fluid, free of charge. The recall began on February 14, 2018. Owners may contact Harley-Davidson customer service at 1-800-258-2464. Harley-Davidson's number for this recall is 0171.

18V-076

Entegra Coach (Entegra) is recalling certain 2015-2016 Aspire and 2017-2018 Insignia motorhomes built on a Spartan chassis. The air brake supply reservoir is less than 12x the combined volume of air for all service brake chambers. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 121, "Air Brake Systems." The undersized air brake supply reservoir may provide an insufficient air supply to properly operate the brakes during repetitive brake applications, reducing braking performance and increasing the risk of a crash. Entegra will notify owners, and Spartan service centers will replace the current air supply reservoir with one that has twice the capacity, free of charge. The recall began on February 16, 2018. Owners may contact Spartan Chassis at 1-800-543-4277 or Entegra customer service at 1-800-517-9137.

18V-077

Jayco, Inc. (Jayco) is recalling certain 2017 Precept motorhomes. The brake Hydraulic Electronic Control Units (HECU) on these vehicles may be missing valve block ball plugs, potentially causing a brake fluid leak or air

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2018**

Published March 2, 2018

ingestion during electronic brake distribution and/or ABS activation. A brake fluid leak or air ingestion can lengthen the distance needed to stop the vehicle, increasing the risk of a crash. Jayco will notify owners, and Ford dealers will inspect the hydraulic block and replace the HECU if the ball plugs are present, free of charge. The recall began on February 16, 2018. Owners may contact Jayco customer service at 1-800-517-9137.

18V-078

Eclipse Recreational Vehicles, Inc. (Eclipse) is recalling certain 2019 Attitude recreational trailers. These vehicles were equipped with tires that have the incorrect load range. The incorrect tires may be overloaded, possibly resulting in tire failure and increasing the risk of a crash. Eclipse will notify owners, and dealers will install tires of the correct load rating, free of charge. Owners may contact Eclipse customer service at 1-951-684-6868.

18V-079

Forest River, Inc. (Forest River) is recalling certain 2018 Georgetown recreational vehicles, models GTA36D7 and GTA34P7. These vehicles have 18 gauge wires connected to a 30 amp circuit breaker. 18 gauge wires cannot handle the potential amp draw, possibly resulting in the wires melting and increasing the risk of a fire. Forest River will notify owners, and dealers will connect the 18 gauge wiring to an additional circuit breaker that will be installed, free of charge. The recall began on February 20, 2018. Owners may contact Forest River customer service at 1-574-206-7600. Forest River's number for this recall is 68-0623.

18V-080

Forest River, Inc. (Forest River) is recalling certain 2018 Cardinal recreational trailers, models CAF3045RLLE, CAF304SR, CAF322DS and CAF392RD. These vehicles were manufactured without an emergency exit window in the rear wall of the vehicle. Without a secondary means of escape from the vehicle, a person may be trapped inside the vehicle during an emergency, which could increase the risk of injury. Forest River will notify owners, and dealers will install an emergency exit window, free of charge. The recall began on February 14, 2018. Owners may contact Forest River customer service at 1-574-206-7600. Forest River's number for this recall is 15-0626.

18V-081

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2009-2012 Audi Q5 and 2010-2012 Audi A5 Cabriolet and S5 Cabriolet vehicles. Upon deployment of the driver's frontal air bag, excessive internal pressure may cause the inflator to explode. In the event of a crash necessitating deployment of the driver's frontal air bag, the inflator could explode with metal fragments striking the vehicle occupants potentially resulting in serious injury or death. Audi will notify owners, and dealers will replace the driver's frontal air bag inflator with an alternative inflator, free of charge. The recall began February 23, 2018. Owners may contact Volkswagen customer service at 1-800-253-2834. Volkswagen's number for this recall is 69R6. Note: This recall partially supersedes recall 16V-078.

18V-082

Daimler Trucks North America LLC (DTNA) is recalling certain 2002-2017 Thomas Built Buses Saf-T-Liner C2, Saf-T-Liner HDX, FS65, and Minotour school buses, equipped with Kidde Plastic-Handle or Push Button

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JANUARY 2018**

Published March 2, 2018

'Pindicator' Fire Extinguishers. These extinguishers may become clogged, preventing the extinguisher from discharging as expected or requiring excessive force to activate the extinguisher. Additionally, in certain models, the nozzle may detach from the valve assembly with enough force that it could cause injury and also render the product inoperable. For a full list of the affected fire extinguisher models visit:

<https://static.nhtsa.gov/odi/rcr/2017/RMISC-17E062-5427.pdf> In the event of a fire, if the fire extinguisher does not function properly, it can increase the risk of injury. DTNA will notify owners instructing them to contact Kidde for a replacement fire extinguisher, free of charge. The recall is expected to begin March 30, 2018. Owners may contact DTNA customer service at 1-800-547-0712 or Kidde customer service at 1-855-262-3540 or online at www.kidde.com and click on "Product Safety Recall" for more information. DTNA's number for this recall is FL-759.

18V-083

Triumph Motorcycles America, LTD (Triumph) is recalling certain 2016-2018 Thruxton and Thruxton R motorcycles. The engine may stall if the throttle is open or closed quickly while the clutch lever is pulled in. An engine stall can increase the risk of a crash. Triumph will notify owners, and dealers will update the engine management software, free of charge. Owners may contact Triumph customer service at 1-678-854-2010. Triumph's number for this recall is 33.

18V-084

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain 2016 Toyota Prius and Lexus RX 350, RX 350 F Sport, RX 450h F Sport and RX 450h vehicles and 2015-2016 Lexus NX 200T, NX Turbo and NX 300h vehicles. The air bag pressure sensors and/or the acceleration sensors may fail causing the side/curtain shield air bags and/or the front air bags to not deploy in the event of a crash. If the air bags fail to deploy in a crash, it can increase the risk of injury. Toyota will notify owners, and dealers will replace the sensors as necessary based on their serial numbers, free of charge. The recall is expected to begin March 12, 2018. Owners may contact Toyota customer service at 1-800-331-4331. Toyota's numbers for this recall are JLA, JOF.

18V-085

Nissan North America, Inc. (Nissan) is recalling certain 2015-2017 Nissan Juke Nismo RS vehicles. Due to a problem within the brake master cylinder, brake fluid may leak into the brake booster, reducing brake performance. If brake fluid leaks into the brake booster it can lengthen the distance needed to stop the vehicle, increasing the risk of a crash. Nissan will notify owners, and dealers will replace the brake master cylinder, free of charge. The recall is expected to begin March 19, 2018. Owners may contact Nissan customer service at 1-800-647-7261.

18V-086