

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2017**

Published March 7, 2017

CHILD SEATS:

None during February 2017.

EQUIPMENT:

Hale Products Inc. (Hale) is recalling certain Fire Pump Engagement Pressure Switches, part number 200-2560-00-0. These pressure switches are used to initiate the fire pump gearbox engagement with an interlock module when retrofitted to existing air shift control for the fire pump. These switches may fail during extremely cold temperatures, preventing the truck's water pump from being put into gear. If the interlock switch fails, it can delay water delivery when battling a fire, increasing the risk of injury. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Hale customer service at 1-800-533-3569. Hale's number for this recall is SB-142.

17E-009

Autoliv, Inc. (Autoliv) is recalling certain AI2 Air Bag Initiators manufactured June 16, 2016, to November 4, 2016. The affected initiators could contain an improper generant mix ratio that may prevent the air bags from deploying properly in the event of a crash. In the event of a crash, air bags that fail to deploy properly increase the risk of injury. Autoliv has notified the vehicle manufacturers that used the affected initiators and the automakers will file new recalls as necessary. Owners may contact Autoliv at 1-248-276-0722.

17E-010

Roush CleanTech, LLC (Roush) is recalling certain Propane Conversion Kits, part number 25031 - Jiffy Fitting 1/4, sold for installation on Ford F-250 trucks. Fittings in the kit may wear, resulting in a propane leak. A propane leak in the presence of an ignition source can increase the risk of a fire. The remedy for this recall is still under development. The recall is expected to begin in March 2017. Owners may contact Roush customer service at 1-800-597-6874.

17E-011

LiquidSpring LLC (LiquidSpring) is recalling certain Compressible Liquid Adaptive Suspension Systems (C.L.A.S.S.), part number 11326, model numbers DS100F2, DS129FS3, DS147FS3, and DS147FS3-NY. In the affected suspension systems, the rear brake banjo bolts of the rear brake system may have been improperly tightened at the rear brake caliper. The improperly tightened banjo bolts may result in a partial or complete loss of the rear brakes, increasing the risk of a crash. LiquidSpring has notified the purchasers, and the affected vehicle manufacturers will file recalls to have their dealers remove and replace the banjo bolts and crush washers, free of charge. The recall began on February 23, 2017. Owners may contact LiquidSpring customer service at 1-765-474-7816.

17E-012

Reyco Granning (Reyco) is recalling certain Independent Front Suspensions (IFS) modules, sizes 1000, 1700, 1800, 20 and 24. The ball joints on the IFS modules can loosen and separate leading to a partial loss of steering. A separated ball joint can cause a loss of steering control, increasing the risk of a crash. Reyco will

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2017**

Published March 7, 2017

notify the vehicle manufacturers that purchased the IFS modules and dealers for those manufacturers will inspect, clean and secure the ball joint free of charge. The recall is expected to begin March 10, 2017. Owners may contact Reyco customer service at 1-800-753-0050.

17E-013

TIRES:

Cooper Tire & Rubber Co. (Cooper) is recalling certain Discoverer M+S Sport tires, sizes 235/75R15, 255/65R16, 215/70R16, 225/70R16, 235/70R16, 245/70R16, 265/70R16, 255/60R17, 225/65R17, 235/65R17, 265/65R17, 255/55R18, 235/60R18 and 255/50R19. These tires may be marked with the Alpine Symbol, but do not meet the traction requirements for snow tires. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 139, "New Pneumatic Radial Tires for Light Vehicles." The affected tires may not provide the expected traction or performance in snow conditions, increasing the risk of a crash. Cooper will notify owners, and dealers will replace all the affected tires with tires from a different brand line, free of charge. The recall began on February 20, 2017. Owners may contact Cooper customer service at 1-800-854-6288. Cooper's number for this recall is 166.

17T-003

VEHICLES:

Highland Ridge RV (Highland Ridge) is recalling certain 2016-2017 Open Range fifth-wheel vehicles. The axle hangers on the affected vehicles may puncture the riser tube wall, allowing the axle to shift and become misaligned. If the axle shifts and becomes misaligned the tires may wear irregularly and possibly fail, increasing the risk of a crash. Highland Ridge will notify owners, and dealers will weld on new hangers, free of charge. The recall is expected to begin March 15, 2017. Owners may contact Highland Ridge customer service at 1-260-768-7771. Highland Ridge's number for this recall is 9904343.

17V-065

Jayco, Inc. is recalling certain 2017 Seismic and Seismic Wave fifth-wheel recreational trailers equipped with hydraulic brakes. In the affected vehicles, the break away switch may not be properly wired. If the break away switch does not function correctly due to improper wiring and the trailer disconnects from the tow vehicle during transit, the fifth wheel brakes will not automatically apply, increasing the risk of a crash. Jayco will notify owners, and dealers will correct the wiring, free of charge. The recall is expected to begin March 30, 2017. Owners may contact Jayco customer service at 1-800-283-8267. Jayco's number for this recall is 9901344.

17V-066

BMW of North America, LLC (BMW) is recalling certain 2011-2012 135i Coupe, 1 Series M Coupe and 135i Convertible vehicles, 2011 Z4 sDrive 35i, 335i, 335d, 335i Coupe, 335is Coupe, 335i Convertible, 335is Convertible, 535i, 535i xDrive, 535i Gran Turismo and 550i xDrive Gran Turismo vehicles and 2012 740i and 740Li vehicles. The rear driveshaft constant velocity (CV) joint on the affected vehicles may fatigue and break. If the CV joint breaks, the vehicle may have a loss of propulsion, increasing the risk of a crash. BMW will notify

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2017**

Published March 7, 2017

owners, and dealers will inspect the rear driveshaft CV joint and, based on its production date, will replace it, free of charge. The recall is expected to begin March 27, 2017. Owners may contact BMW customer service at 1-800-525-7417.

17V-067

Nissan North America, Inc. (Nissan) is recalling certain 2002 Pathfinder and Infiniti QX4 vehicles. These vehicles are equipped with Takata air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture. An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death. Nissan will notify owners, and dealers will replace the front passenger air bag assembly, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Nissan customer service at 1-800-647-7261.

17V-068

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2017 Jetta vehicles equipped with a 1.4L engine. These vehicles have an engine that may seize due to an improper casting of the block. If the engine seizes, the wheels may suddenly lock up, causing a loss of vehicle control and increasing the risk of a crash. Volkswagen will either buy back the vehicle or replace the engine block, free of charge. The recall began February 2017. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's number for this recall is 10F4.

17V-070

Midwest Fire Equipment & Repair Company (Midwest) is recalling one 2017 All-Poly Series vehicle. The stop light switch on this vehicle may not illuminate the brake lights when the brakes are applied. As such, this vehicle fails to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." If the brake lights do not illuminate when the brakes are pressed, other drivers may not know that the vehicle is slowing or stopping thereby increasing the risk of a crash. Midwest will notify the owner, and a Peterbilt dealer will inspect and replace the affected brake light switch, free of charge. The recall began on February 10, 2017. Owners may contact Peterbilt customer service at 1-940-591-4000 or Midwest customer service at 1-800-344-2059.

17V-071

REV Recreation Group (REV) is recalling certain 2017 Fleetwood Storm and Holiday Rambler Vacationer XE motorhomes and 2016-2017 Holiday Rambler Vacationer motorhomes. In the affected vehicles, the spring shackle bolt may contact the fuel filler components or the fuel vent tubing causing a hole, potentially resulting in a fuel leak. A fuel leak in the presence of an ignition source can increase the risk of a fire. REV will notify owners, and dealers will inspect the fuel filler tube and fuel vent components and re-route them or install additional components to shield them from contacting the spring shackle bolt, free of charge. The recall is expected to begin March 31, 2017. Owners may contact REV customer service at 1-800-509-3417. REV's number for this recall is 170131REV.

17V-072

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2017**

Published March 7, 2017

Automobili Lamborghini (Lamborghini) is recalling certain 2012-2017 Aventador vehicles. In certain driving conditions while the vehicle has a full gas tank, gasoline may contact the exhaust system. Gasoline contact with an ignition source such as a hot exhaust system can increase the risk of a fire. Lamborghini will notify owners, and dealers will upgrade the fuel tank's evaporative emissions system, free of charge. The recall began February 2017. Owners may contact Lamborghini customer service at 1-866-681-6276.

17V-073

Cruiser RV (Cruiser) is recalling certain 2016-2017 Boss recreational trailers. The affected vehicles have a vertically-mounted furnace installed such that the exhaust ports may be at the top of the furnace instead of at the bottom. If the ports are located in the wrong area it can cause restriction in the chamber, making the furnace operation unsafe, increasing the risk of injury. Cruiser will notify owners, and dealers will reinstall the furnace so that the exhaust port is at the bottom, free of charge. The recall is expected to begin March 20, 2017. Owners may contact Cruiser customer service at 1-866-277-5630. Cruiser's number for this recall is 98.03.12.

17V-074

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2017 Passat vehicles. Brake fluid may leak slowly from the some of the brake line connections, resulting in a low brake fluid level. A low brake fluid level may lengthen the distance needed to stop the vehicle, increasing the risk of a crash. Volkswagen will notify owners, and dealers will replace the affected brake lines, free of charge. The recall is expected to begin in March 2017. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's number for this recall is 47N3.

17V-075

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2017 E300, E300 4Matic, and E43 AMG vehicles. The front passenger occupant detection control unit may have been incorrectly installed. As a result, the front passenger seat occupant may be misclassified. For example, an adult may be misclassified as a child seat, causing the front passenger air bag to be deactivated in the event of a crash. If the passenger front air bag does not deploy as intended in the event of a crash, it can increase the risk of a injury. MBUSA will notify owners, and dealers will inspect the routing of the pressure hose of the seat occupancy detection control unit and replace the pressure hose and seat occupancy detection mat if necessary, free of charge. The recall is expected to begin in early March 2017. Owners may contact MBUSA customer service at 1-800-367-6372.

17V-076

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2017 GLE 400 4Matic, GLE 350 4Matic, GLE 350, GLE 550E 4Matic, GLE 63 AMG, GLE 63S AMG, GLE 43 AMG 4Matic Coupe, GLE 63S AMG 4Matic Coupe, GLS 450 4Matic, GLS 550 4Matic, and GLS 63 AMG 4Matic vehicles. In certain types of crash events, the center console may unlatch, allowing the objects within to fly around the cabin. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 201, "Occupant Protection in Interior Impact." In the event of a crash, if objects are not secured within the center console, they may strike the vehicle occupants, increasing their risk of injury. MBUSA will notify owners, and dealers will modify the center console so that it remains latched in a crash, free of charge. The recall is expected to begin in early March 2017. Owners may contact MBUSA customer service at 1-800-367-6372.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2017**

Published March 7, 2017

17V-077

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2017 E300 and E300 4Matic vehicles. The affected vehicles may have a damaged steering column-mounted shift lever module. If the internal circuit board is damaged, moving the shift lever will not select a transmission gear. If the vehicle does not move forward or backward as selected by the driver with the shift lever, there is an increased risk of a crash. MBUSA will notify owners, and dealers will replace the steering column-mounted shift lever module, free of charge. The recall is expected to begin in March 2017. Owners may contact MBUSA customer service at 1-800-367-6372.

17V-078

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2016 GLE350 4Matic and GLS 450 4Matic vehicles. The windshield bonding may be insufficient and, as a result, the windshield may separate from the vehicle in a crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 208, "Occupant Crash Protection" and number 212, "Windshield Mounting." If the windshield detaches in the event of a crash, the passenger frontal air bag may not be supported properly after it deploys, increasing the risk of injury. MBUSA will notify owners, and dealers will replace the windshield, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact MBUSA customer service at 1-800-367-6372.

17V-079

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2017 CLA250, CLA250 4Matic, E400 Coupe, E400 4Matic Coupe, E550 Coupe, E400 Cabriolet, E550 Cabriolet, E300, E300 4Matic, E400 Wagon, GLA250, and GLA250 4Matic vehicles. The pelvis air bag or the front passenger air bag inflator initiator may fail to ignite in the event of a crash. If the pelvis airbag or the front passenger airbag does not deploy as intended in the event of a crash, the occupants have an increased risk of injury. MBUSA will notify owners, and dealers will replace the affected air bag modules, free of charge. The recall is expected to begin in early March 2017. Owners may contact MBUSA customer service at 1-800-367-6372.

17V-080

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2016 GLE350 4Matic, GLE350, GLE350 4Matic Bluetec, GL450 4Matic, and GLE450 Coupe 4Matic vehicles. In the affected vehicles, the bolt that connects the upper control arm and the axle stub may not have been properly tightened. The loose bolt may cause improper wheel tracking, increasing the risk of a crash. MBUSA will notify owners, and dealers will inspect the tightness of the bolt connecting the upper control arm and the axle stub on the affected vehicles, replacing the upper control arm if necessary, free of charge. The recall is expected to begin in early March 2017. Owners may contact MBUSA customer service at 1-800-367-6372.

17V-081

Mazda North American Operations (Mazda) is recalling certain 2011 Mazda2 and 2010-2011 Mazda3 and Mazdaspeed3 vehicles. In the affected vehicles, the seat height adjustment lifter links may break or detach from the seat frame and the seat angle may incline causing the driver to not be able to maintain an appropriate driving position. If the driver cannot maintain an appropriate driving position, there is an increased risk of a crash.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2017**

Published March 7, 2017

Mazda will notify owners, and dealers will inspect the seat lifter links and install a reinforcement bracket to the lifter links, or replace the entire seat adjuster unit, free of charge. The recall is expected to begin March 31, 2017. Owners may contact Mazda customer service at 1-800-222-5500. Mazda's number for this recall is 0917B.

17V-082

Jaguar Land Rover North America, LLC (Jaguar) is recalling certain 2017 XF vehicles. The affected vehicles may have a cracked left hand inner sill panel. In the event of a crash involving a left hand impact, the cracked sill panel may result in the underfloor fuel lines rupturing and leaking fuel. A fuel leak in the presence of an ignition source can increase the risk of a fire. Jaguar will notify owners, and dealers will inspect the vehicle's left inner sill panel. If cracks are found, Jaguar will repurchase the vehicle and supply the customer with a new vehicle, free of charge. The recall is expected to begin April 7, 2017. Owners may contact Jaguar customer service at 1-800-452-4827. Jaguar's number for this recall is K458.

17V-084

Suzuki Motor of America, Inc. (Suzuki) is recalling certain 2009-2013 Grand Vitara vehicles equipped with a manual transmission. The gear shift rear shaft on these vehicles may break, preventing the gears from being able to be changed. If the transmission cannot be shifted, it can increase the risk of a crash. Suzuki will notify owners, and dealers will replace the gear shift rear shaft, free of charge. The recall is expected to begin during March 2017. Owners may contact Suzuki customer service at 1-800-934-0934. Suzuki's number for this recall is VZ.

17V-085

BMW of North America, LLC (BMW) is recalling certain 2014 X1 sDrive28i, X1 xDrive28i and X1 xDrive35i vehicles. The affected vehicles may have battery positive (B+) cables that develop high resistance in the connections to the fuse box. The high resistance may result in loss of the cable's electrical connection, possibly causing an engine stall and preventing the vehicle from restarting, increasing the risk of a crash. BMW will notify owners, and dealers will replace the B+ cable connector with one that is silver coated and better secure it to the fuse box, free of charge. The recall is expected to begin April 3, 2017. Owners may contact BMW customer service at 1-800-525-7417.

17V-087

BMW of North America, LLC (BMW) is recalling certain 2014-2017 i3 REx hybrid electric vehicles. The fuel tank vent line may rub against the ribbed wire protection sleeve of the battery positive (B+) cable, creating a hole in the vent line and causing a fuel vapor leak. A fuel vapor leak in the presence of an ignition source can increase the risk of a fire. BMW will notify owners, and dealers will inspect the fuel vent line, replacing it as necessary, and install a clip to prevent it from chafing, free of charge. The recall is expected to begin April 3, 2017. Owners may contact BMW customer service at 1-800-525-7417.

17V-088

Airstream, Inc. (Airstream) is recalling certain 2017 Sport, Flying Cloud and International recreational trailers. The Tire Placard on these vehicles may be missing the spare tire information. As such, these vehicles fail to comply with the Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims."

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2017**

Published March 7, 2017

Without the correct tire and load information for the spare tire, the operator may install the incorrect tire or overload it, with either scenario increasing the risk of a crash. Airstream will notify owners, and dealers, will provide a corrected Tire Placard, free of charge. The recall is expected to begin April 3, 2017. Owners may contact Airstream customer service at 1-937-596-6111 extension 7401 or 7411.

17V-089

Heartland Recreational Vehicles, LLC (Heartland) is recalling certain 2017 Cyclone and Road Warrior toy haulers equipped with a Furrion cook top. The liquid propane (LP) hose that is connected to the cook top may be angled incorrectly, causing excessive pressure on the hose fitting and the gas valve, potentially resulting in a propane leak. A propane leak in the presence of an ignition source can increase the risk of a fire. Heartland will notify owners, and dealers will install a flexible gas connector from the cook top to the LP hose, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Heartland customer service at 1-877-262-8032. Heartland's number for this recall is 99.01.33.

17V-090

Heartland Recreational Vehicles, LLC (Heartland) is recalling certain 2017 Sundance recreational trailers. The Federal Certification label on these vehicles may not have the Gross Vehicle Weight Rating (GVWR) listed on the label. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." If the GVWR is not listed, the operator would not know the trailer's weight limit and may overload the vehicle, increasing the risk of a crash. Heartland will notify owners, and will provide them a replacement certification label, free of charge. The recall began on March 1, 2017. Owners may contact Heartland customer service at 1-877-262-8032. Heartland's number for this recall is 99.01.32.

17V-091

Daimler Vans USA, LLC (DVUSA) is recalling certain 2015 Mercedes-Benz Sprinter 2500 and 3500 vehicles. These vehicles were manufactured without a protective plate on the front of the gas tank and a foam ring at the filler neck. As such, these vehicles may not comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 301, "Fuel System Integrity." Without the protective plate and the foam ring installed, impacts may damage the tank resulting in a fuel leak that can increase the risk of a fire. DVUSA will notify owners, and dealers will replace the fuel tank, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact DVUSA customer service at 1-877-762-8267.

17V-092

Daimler Vans USA, LLC (DVUSA) is recalling certain 2013-2016 Mercedes-Benz Sprinter 2500 and 3500 and Freightliner Sprinter 2500 and 3500 vans. These vehicles were manufactured without a reinforcement plate and protective bracket on the air bag control unit. As a result, the air bag control unit may not remain functional after the initial impact, possibly preventing additional air bags from deploying in response to a secondary impact. If additional air bags do not deploy as intended, the occupants are at an increased risk of injury. DVUSA will notify owners, and dealers will install a reinforcement plate and protective bracket around the air bag control unit, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact DVUSA customer service at 1-877-762-8267.

17V-093

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2017**

Published March 7, 2017

Daimler Vans USA, LLC (DVUSA) is recalling certain 2015 Mercedes-Benz Sprinter 2500 and 3500 vehicles. The affected vehicles were manufactured without a driveshaft catch strap, allowing a loose driveshaft to strike the fuel tank. As such, these vehicles fail to comply with Federal Motor Vehicle Safety Standard (FMVSS) number 301, "Fuel System Integrity." A loose driveshaft may strike and puncture the gas tank, resulting in a fuel leak, increasing the risk of a fire. DVUSA will notify owners, and dealers will install a driveshaft catch strap, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact DVUSA customer service at 1-877-762-8267.

17V-094

Forest River, Inc. (Forest River) is recalling certain 2017 Palomino Columbus recreational vehicles equipped with the package to install an optional generator. The liquid propane (LP) supply hose for the generator may be too small, and, as a result, the stove may not have a sufficient supply of propane to keep the burner(s) lit. If the burner(s) cannot stay lit, after the flame extinguishes, propane may continue to flow into the vehicle, increasing the risk of a fire or explosion when the stove range is re-ignited. Forest River will notify owners, and dealers will install the correct propane supply lines, free of charge. The recall is expected to begin April 5, 2017. Owners may contact Forest River customer service at 1-574-825-3161. Forest River's number for this recall is 410-0201207-0317.

17V-095

Thor Motor Coach (TMC) is recalling certain 2014-2015 Tuscany, Tuscany XTE and Palazzo motorhomes. The windshield wiper systems on these vehicles may have been improperly installed or secured, causing the wipers to fail during operation. If the windshield wipers fail, the driver would have decreased visibility, increasing the risk of a crash. TMC will notify owners, and dealers will inspect the wiper system, tightening the wiper nuts to the proper specifications, as necessary, free of charge. The recall is expected to begin April 13, 2017. Owners may contact TMC customer service at 1-877-500-1020. TMC's number for this recall is RC000128.

17V-096

Chrysler (FCA US LLC) is recalling certain 2014-2017 Dodge Charger and Chrysler 300 vehicles equipped with all-wheel drive (AWD). The front driveshaft bolts may loosen and allow the front driveshaft to disconnect, potentially causing a loss of motive power. A loss of motive power can increase the risk of a crash. Chrysler will notify owners, and dealers will replace all eight front driveshaft bolts, free of charge. The recall is expected to begin March 31, 2017. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is T03.

17V-097

Foretravel, Inc. (Foretravel) is recalling certain 2015-2017 Realm motorhomes. The brake pedal movement may be restricted in the pedal box, possibly preventing full brake application. A reduction in braking ability may increase the risk of a crash. Foretravel will notify owners, and dealers will reposition or modify the pedal box to allow the proper brake pedal travel, free of charge. Owners may contact Foretravel customer service at 1-800-955-6226.

17V-098

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2017**

Published March 7, 2017

Gillig, LLC (Gillig) is recalling certain 2016-2017 Low Floor transit buses. These vehicles have front LED turn signals with integrated side reflex reflectors that may not be sufficiently visible to other drivers or pedestrians. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." A bus that has reduced visibility to other drivers or pedestrians has an increased risk of a crash. Gillig will notify owners and will replace the LED turn signal/reflector units, free of charge. The recall is expected to begin March 31, 2017. Owners may contact Gillig customer service at 1-800-735-1500.

17V-099

Blue Bird Body Company (Blue Bird) is recalling certain 2015-2016 Vision school buses equipped with a frame mounted battery box. The support brackets for these battery boxes may crack causing the battery box to separate from the chassis. If the battery box detaches, it can become a road hazard, increasing the risk of a crash. The remedy for this recall is still under development. The recall is expected to begin March 20, 2017. Owners may contact Blue Bird customer service at 1-478-822-2242. Blue Bird's number for this recall is R17YY-SB.

17V-100

Blue Bird Body Company (Blue Bird) is recalling certain 2015-2016 Vision transit buses equipped with frame mounted battery boxes. The support brackets for these battery boxes may crack causing the battery box to separate from the chassis. If the battery box detaches, it can become a road hazard, increasing the risk of a crash. The remedy for this recall is still under development. The recall is expected to begin March 20, 2017. Owners may contact Blue Bird customer service at 1-478-822-2242. Blue Bird's number for this recall is R17YY-NSB.

17V-101

Prevost Cars, Inc. (Prevost) is recalling certain 2017 H3-45 and X3-45 motor coaches. These vehicles have steering arm levers that were incorrectly forged, possibly resulting in the steering arm levers cracking and failing. If the steering arm lever fails, causing a loss of steering, it can increase the risk of a crash. Prevost will notify owners, and dealers will replace the steering arm lever, free of charge. The recall is expected to begin April 14, 2017. Owners may contact Prevost customer service at 1-877-773-8678. Prevost's number for this recall is SR17-05.

17V-102

PACCAR Incorporated (PACCAR) is recalling certain 2015-2018 Kenworth K370, T680, T880 and 2017-2018 Peterbilt 567 and 579 trucks. The plastic fuel tee fittings on these trucks may leak fuel. A fuel leak in the presence of an ignition source can increase the risk of a fire. Kenworth and Peterbilt will notify owners, and dealers will replace the suspect fuel tees, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Kenworth customer service at 1-425-828-5000 and Peterbilt customer service at 1-940-591-4000. PACCAR's numbers for this recall is 17KWA and 217-A.

17V-103

Volvo Car USA LLC (Volvo) is recalling certain 2017 XC90, S90, and V90 Cross Country vehicles. The bolts

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2017**

Published March 7, 2017

that secure the Inflatable Curtain (IC) air bags in place may break, possibly resulting in the IC air bag deploying improperly in the event of a crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 226, "Ejection Mitigation." If the IC air bags do not deploy properly in the event of a crash, the vehicle occupants have an increased risk of injury. Volvo will notify owners, and dealers will inspect and replace the bolts, as necessary, free of charge. The recall is expected to begin April 1, 2017. Owners may contact Volvo customer service at 1-800-458-1552. Volvo's number for this recall is R89714.

17V-104

Isuzu Technical Center of America, Inc. (Isuzu) is recalling certain 2015-2017 NPR HD, NPR XD, NQR and NRR trucks. During manufacturing, the stamping equipment may have created burrs on the frame crossmember that the transmission is mounted to. These burrs may cause the transmission mounting studs to break. If the studs break, the transmission may not be properly supported, preventing it from shifting correctly and increasing the risk of a crash. Isuzu will notify owners, and dealers will inspect the vehicles and install a metal shim to prevent stress on the mounting studs, free of charge. The recall is expected to begin April 2017. Owners may contact Isuzu customer service at 1-866-441-9638.

17V-105

Keystone RV Company (Keystone) is recalling certain 2017 Dutchmen Coleman recreational trailers, model 2515RL. On these vehicles, the Federal Identification Tag indicates incorrect tire and rim size information. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." Incorrect label information may result in the operator using the wrong rim size for the vehicle, increasing the risk of a crash. Keystone will notify owners and will supply a corrected Federal Identification Tag, free of charge. The recall began on February 28, 2017. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 17-277.

17V-106

Altec Industries Inc. (Altec) is recalling certain 2016 DLB Digger Derrick vehicles. The fasteners that secure the outer rotation bearings may fail. If the fasteners that attach the rotation platform to the truck fail, the digger boom may unintentionally move, increasing the risk of injury to the user or those nearby. Altec has notified owners, and dealers will inspect and replace the fasteners, as necessary, free of charge. The recall began on February 24, 2017. Owners may contact Altec customer service at 1-877-462-5832. Altec's number for this recall is MAB 650.

17V-107

Winnebago Industries, Inc. (Winnebago) is recalling certain 2016-2017 Travato recreational vehicles. The liquid propane (LP) hose may contact the emergency brake cable, potentially damaging it and causing it to leak propane. A propane leak can increase the risk of a fire or an explosion. Winnebago will notify owners and dealers will inspect the vehicles, repositioning and securing the LP hose to avoid contact with the brake cable, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Winnebago customer service at 1-800-537-1885.

17V-108

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2017**

Published March 7, 2017

Altec Industries, Inc. (Altec) is recalling certain 2015-2016 AH125, AH150, and HL125 aerial device vehicles. In the affected vehicles, the rotation bearing fasteners may fail. If the fasteners that attach the aerial device to the truck fail, the boom may unintentionally move, increasing the risk of personal injury or death to the aerial device user or those nearby. Altec has notified owners, and dealers will inspect and if necessary replace the fasteners, free of charge. The recall began on February 24, 2017. Owners may contact Altec customer service at 1-877-462-5832. Altec's number for this recall is MAB 651.

17V-109

Aluminum Trailer Company (ATC) is recalling certain 2017 bumper-pull Quest trailers equipped with the Stacker package and either three, 6000lb or two, 7000lb axles. In the affected vehicles, the trailer walls may flex and allow the lift platform to disengage from the safety lock. If this happens when the lifting chains are slack, the lift platform may unexpectedly drop. If the platform unexpectedly drops, it can increase the risk of injury. ATC will notify owners, and dealers will install a flange to prevent the lift from slipping out of the safety lock, free of charge. The recall is expected to begin April 18, 2017. Owners may contact ATC customer service at 1-574-773-2440. ATC's number for this recall is STKR-LIFT.

17V-110

Yamaha Motor Corporation, USA (Yamaha) is recalling certain 2015-2016 Yamaha YZF-R3 motorcycles. In the affected motorcycles, engine vibration can cause the fuel tank mounting bracket to contact the fuel tank, which overtime, may result in the tank leaking fuel. A fuel leak in the presence of a ignition source can increase the risk of a fire. Yamaha will notify owners, and dealers will replace the fuel tank bracket. The fuel tank will be inspected and replaced if necessary. These repairs will be performed free of charge. The recall is expected to begin March 9, 2017. Owners may contact Yamaha customer service at 1-800-962-7926. Yamaha's number for this recall is 990112.

17V-111

Yamaha Motor Corporation, USA (Yamaha) is recalling certain 2015-2016 Yamaha YZF-R3 motorcycles. Water can enter and corrode the ignition switch resulting in an unexpected engine stall. An engine stall increases the risk of a crash. Yamaha will notify owners, and dealers will replace the ignition switch subassembly, free of charge. The recall is expected to begin March 9, 2017. Owners may contact Yamaha customer service at 1-800-962-7926. Yamaha's number for this recall is 990112.

17V-112

Tiffin Motorhomes, Inc. (Tiffin) is recalling certain model year 2017 Allegro Open Road motorhomes. A sticker on the tow hitch may list the incorrect weight capacity for the hitch. The sticker states a capacity of 10,000 lbs, and a maximum tongue weight of 1,000 lbs, when the correct towing capacity is 5,000 lbs, with a maximum tongue weight of 500 lbs. If the hitch is loaded to the weight on sticker, the hitch may fail and the towed vehicle can separate from the motorhome, increasing the risk of a crash. Tiffin will notify owners and will supply a corrected weight capacity sticker, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Tiffin customer service at 1-256-356-8661. Tiffin's number for this recall is TIF-105.

17V-113

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2017**

Published March 7, 2017

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain 2015-2017 C300 4Matic, C300, CLA250, CLA250 4Matic and CLA45 AMG vehicles, 2017 C300 4Matic Cabrio, C300 4Matic Coupe, C300 Cabrio, C300 Coupe, E300, E300 4Matic, E400 4Matic Wagon, E43 AMG 4Matic, GLA250, GLA250 4Matic and GLC300 4Matic Coupe vehicles and 2016 C350e and GLC300 vehicles and 2016-2017 C450 4Matic AMG Sport and GLC300 4Matic vehicles. In the event that the engine or transmission cannot turn over, the starting current limiter may overheat from the repeated attempts of the starter motor attempting to start the vehicle. If the starting current limiter overheats, the surrounding components can melt, increasing the risk of a fire.

MBUSA will notify owners, and dealers will install an additional fuse in the electrical line to the starter, free of charge. Parts to remedy the vehicles are not currently available. Owners will be notified of the recall beginning in late March 2017. Owners will be mailed a follow up notice when remedy parts are available, currently expected to be in July 2017. Owners may contact MBUSA customer service at 1-800-367-6372.

17V-114

BMW of North America, LLC (BMW) is recalling certain 2017 430i, 430i xDrive, 440i, 440i xDrive and M4 vehicles and Rolls-Royce Dawn vehicles. The affected vehicles have seat-mounted side air bag inflator initiators that may fail to ignite during a crash. If the air bag inflator initiator fails to ignite, the seat-mounted air bag will not deploy, increasing the risk of injury. BMW will notify owners, and dealers will replace the air bag modules, free of charge. The recall is expected to begin April 17, 2017. Owners may contact BMW customer service at 1-800-525-7417.

17V-115

General Motors LLC (GM) is recalling certain 2017 Buick LaCrosse vehicles. The electrical connectors for the Electronic Power Steering (EPS) system may not be properly sealed. As a result, water may enter and corrode the connectors possibly resulting in a loss of power steering. A loss of power steering may result in increased manual steering effort, increasing the risk of a crash. GM will notify owners, and dealers will inspect correct the seal seating and secure the EPS connector seals, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Buick customer service at 1-800-521-7300. GM's number for this recall is 17085.

17V-116

Forest River, Inc. (Forest River) is recalling certain 2017 Stealth recreational vehicles, model CSFTFQ2817G-67 and Sandstorm recreational vehicles, model CSCT282GSLR-67. The liquid propane (LP) line under the vehicle may be damaged from contact with the axle, causing it to leak. A propane leak in the presence of an ignition source increases the risk of a fire or explosion. The remedy for this recall is still under development. The recall is expected to begin April 24, 2017. Owners may contact Forest River customer service at 1-909-873-3777. Forest River's number for this recall is 67-02082017-0321.

17V-117

Forest River, Inc. (Forest River) is recalling certain 2017 Wildwood recreational trailers, model WDT197BH and Salem recreational trailers, model SMT197BH. The lower sidewall vent for the refrigerator was improperly installed, allowing propane gas to enter the vehicle. A propane leak into the interior of the vehicle in the presence of an ignition source can increase the risk of a fire or explosion. Forest River will notify owners, and dealers will

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2017**

Published March 7, 2017

install a new vent into the vehicle floor, free of charge. The recall is expected to begin April 24, 2017. Owners may contact Forest River Customer Service at 1-260-593-4001. Forest River's number for the recall is 72-02162017-0329.

17V-118

Halcore Group, Inc. (Halcore) is recalling certain 2017 American Emergency Vehicle (AEV) Traumahawk Type I ambulances built on Ford F-350, F-450, or F-550 chassis equipped with Compressible Liquid Adaptive Suspension Systems (C.L.A.S.S.) made by LiquidSpring. Due to an incorrect torque specification, the rear brake caliper banjo bolts may have been overtightened. The improperly tightened banjo bolts may result in a partial or complete loss of rear brake power, increasing the risk of a crash. Halcore will notify owners, and LiquidSpring dealers will replace the rear brake banjo bolts, free of charge. The recall is expected to begin during March 2017. Owners may contact LiquidSpring customer service at 1-765-474-7816 extension 1 or at service@liquidspring.com or AEV customer service at 1-800-374-9749.

17V-120

Tiffin Motorhomes, Inc. (Tiffin) is recalling certain 2012 Phaeton motorhomes with floor plans QBH, QKH, and QTH, built on PowerGlide chassis. The affected vehicles have an exhaust pipe that is mounted too close to the underside of the floor. Insufficient spacing between the exhaust pipe and the floor may result in the insulation melting and an increased risk of a fire. Tiffin will notify owner, and dealers will reconfigure the exhaust to provide extra clearance, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Tiffin customer service at 1-256-356-8661. Tiffin's number for the recall is TIF-106.

17V-121

Halcore Group, Inc. (Halcore) is recalling certain 2017 Horton ambulances, models 623, 603F, 453, and 457, built on Ford F-350, F-450, or F-550 chassis equipped with Compressible Liquid Adaptive Suspension Systems (C.L.A.S.S.) made by LiquidSpring. Due to an incorrect torque specification, the rear brake caliper banjo bolts may have been overtightened. The improperly tightened banjo bolts may result in a partial or complete loss of rear brake power, increasing the risk of a crash. Horton will notify owners, and LiquidSpring dealers will replace the rear brake banjo bolts, free of charge. The recall is expected to begin during March 2017. Owners may contact LiquidSpring customer service at 1-765-474-7816, extension 1, or at service@liquidspring.com or Horton customer service at 1-614-534-8181.

17V-122

Ford Motor Company (Ford) is recalling certain 2016-2017 Ford Edge and Lincoln MKX vehicles and 2017 Lincoln Continental vehicles. In the event of a crash, the driver's frontal air bag may not fully inflate or the air bag cushion may detach from the air bag module. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 208, "Occupant Crash Protection." During deployment, if the air bag does not fully inflate or the cushion detaches, there is an increased risk of injury in the event of a crash. Ford will notify owners, and dealers will replace the driver frontal air bag module, free of charge. Remedy parts are not currently available. Owners will be notified of the safety recall in March 2017. Owners will receive a second notice when remedy parts are available, currently expected to be in August 2017. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 17C02.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2017**

Published March 7, 2017

17V-123

Daimler Trucks North America LLC (DTNA) is recalling certain 2015-2018 Western Star 4900 trucks. The aluminum air tanks on these vehicles may have improper welds possibly resulting in a rapid loss of air pressure. A rapid loss of air pressure without warning may cause a sudden application of the park brakes, increasing the risk of a crash. DTNA will notify owners, and dealers will replace the aluminum air tanks with steel, triple compartment, air tanks, free of charge. The recall is expected to begin April 27, 2017. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-732.

17V-124

Daimler Trucks North America LLC (DTNA) is recalling certain 2017-2018 Thomas Built Buses Saf-T-Liner HDX school buses. The upper pinch bolt that secures the mechanical connection between the steering wheel and the front wheels may not have been properly tightened. The loose pinch bolt may result in a loss of steering and vehicle control, increasing the risk of a crash. DTNA will notify owners, and dealers will inspect the steering shaft pinch bolt, tightening it as necessary, free of charge. The recall is expected to begin March 15, 2017. Owners may contact DTNA Customer Service 1-800-547-0712. DTNA's number for the recall is FL-733.

17V-125

Daimler Trucks North America LLC (DTNA) is recalling certain 2017-2018 Thomas Built Buses Saf-T-Liner HDX transit buses. The upper pinch bolt that secures the mechanical connection between the steering wheel and the front wheels may not have been properly tightened. The loose pinch bolt may result in a loss of steering and vehicle control, increasing the risk of a crash. DTNA will notify owners, and dealers will inspect the steering shaft pinch bolt, tightening it as necessary, free of charge. The recall is expected to begin March 15, 2017. Owners may contact DTNA Customer Service 1-800-547-0712. DTNA's number for the recall is FL-733.

17V-126