

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2017**

Published May 2, 2017

CHILD SEATS:

None during March 2017.

EQUIPMENT:

H&H Sports Protection (H&H) is recalling certain TORC T-55 V2 low profile half helmets, sizes XS, S, M, L, XL, XXL. These helmets may not adequately protect the wearer in the event of a head impact during a motorcycle crash. Additionally, the helmets may not stay secured to head during a motorcycle crash. As such, these helmets fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 218, "Motorcycle Helmets." A helmet that fails to meet the safety requirements can increase the risk of injury in the event of a crash. H&H will notify owners and will either replace or provide a refund for the helmet, free of charge. The recall began on April 20, 2017. Owner's may contact H&H Sports Protection at 1-626-444-0107.

17E-014

Tegol, Inc. (Tegol) is recalling certain Outlaw V-5 Series helmets, in all sizes. These helmets may not adequately protect the wearer in the event of a head impact during a motorcycle crash. Additionally, the helmets may not stay secured to head during a motorcycle crash. As such, these helmets fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 218, "Motorcycle Helmets." A helmet that fails to meet the safety requirements can increase the risk of injury in the event of a crash. Tegol will notify owners and will refund owners the price of the helmet, free of charge. Owners may contact Tegol customer service at 1-866-371-0281 or by email at tegolrecall@gmail.com.

17E-015

Strategic Sports, Ltd. (Strategic Sports) is recalling certain Zox Nano Helmets sizes XL through XXXXXL. These helmets may not adequately protect the wearer in the event of a secondary head impact during a motorcycle crash. As such, these helmets fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 218, "Motorcycle Helmets." In the event of a crash where the rider hits the helmet twice in the same spot, the helmet may not adequately protect the wearer, increasing the risk of injury. Strategic Sports will notify owners and refund the purchase price of the helmets. Owners may contact Strategic Sports at helmet.recall.info@gmail.com.

17E-016

Roush CleanTech, LLC (Roush) is recalling certain Generation 4 Propane Conversion Kits sold for aftermarket installation. The fuel control valve solenoid may short circuit, shutting off the flow of propane to the engine, causing the engine to shut off. An engine stall while driving increases the risk of a crash. Roush has notified owners and dealers will replace the fuel control valve solenoid, free of charge. The recall began on March 21, 2017. Owners may contact Roush at 1-800-597-6874. Roush's number for the recall is RE.

17E-017

Roush CleanTech, LLC (Roush) is recalling certain Generation 4 Propane Conversion Kits sold to original equipment manufacturers and vehicle alterers for installation on vehicles prior to their first sale. The fuel control

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2017**

Published May 2, 2017

valve solenoid may short circuit, shutting off the flow of propane to the engine, causing the engine to shut off. An engine stall while driving increases the risk of a crash. Roush will notify the original equipment manufacturers and vehicle alterers that installed the affected kits and those companies will conduct recalls to replace the fuel control valve solenoids, free of charge. Owners may contact Roush at 1-800-597-67874. Roush's number for the recall is OE.

17E-018

Hickory Springs Manufacturing Company (HSM) is recalling certain QS11, QSCR11, QSJ11 and Davenport school bus seats that include three-point lap/shoulder seat belts. These seats may have a loose or missing D-ring mounting nut, allowing the shoulder belt D-ring to detach in a crash. A loose shoulder belt D-ring may prevent the seat belt from adequately restraining the seat occupant in the event of a crash, increasing their risk of injury. HSM has notified the bus manufacturer that purchased the affected seats and an HSM field service technician will inspect the school buses that have the subject seats, repairing them as necessary, free of charge. Owners may contact HSM customer service at 1-800-438-5341.

17E-019

TIRES:

None during March 2017.

VEHICLES:

Volvo Car USA LLC (Volvo) is recalling certain 2017 S60, S60CC, V60, V60 Cross Country, and XC60 vehicles. The affected vehicles have driver and front passenger seat side mounted side air bags (SAB) with inflator initiators that may fail to ignite during a crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 208, "Occupant Crash Protection" and number 214, "Side Impact Protection." If the air bag inflator initiator fails to ignite, the air bag will not deploy, increasing the risk of injury. Volvo will notify owners, and dealers will inspect and, if necessary, replace the front seat side air bags, free of charge. The recall began March 31, 2017. Owners may contact Volvo customer service at 1-800-458-1552. Volvo's number for this recall is R89712. Note: This recall is an expansion of recall 16V-918.

17V-127

Forest River, Inc. (Forest River) is recalling certain 2017 Rockwood and Flagstaff recreational trailers. The slide room mounting bracket on these vehicles may contact the driver side front tire, potentially damaging it and causing tire deflation. Tire deflation can increase the risk of a crash. Forest River will notify owners, and dealers will install a rearward offset mounting bracket head to keep the slide room bracket from touching the tire, free of charge. The recall began on April 12, 2017. Owners may contact Forest River customer service at 1-574-642-2640. Forest River's number for this recall is 10-02152017-0328.

17V-129

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2017**

Published May 2, 2017

New Flyer Industries Ltd (New Flyer) is recalling certain 2006 L40LF and DE60LF transit buses, 2006-2007 C35LF, C40LFR, D35LF, D40LFR, D60LFR, DE40LF and DE40LFR transit buses, and 2005-2007 C40LF, D40LF, D60LF, DE60LFA, GE40LF, 2007 D35LFR, and DE60LFR transit buses. These vehicles are equipped with MAN V8-65L axle beams that may have cracks on the upper and/or lower surface, which, over time can cause the axle beam to fail. Failure of the front axle beam can cause a loss of vehicle control, increasing the risk of a crash. New Flyer will notify owners, and dealers will inspect the axle beams and determine a repair, as necessary, free of charge. The recall began on March 10, 2017. Owners may contact New Flyer customer service at 1-204-224-6706. New Flyer's number for this recall is R17-002.

17V-130

REV Ambulance Group Orlando, INC. (REV) is recalling certain 2017 Wheeled Coach Type I, McCoy-Miller Type I, Frontline Type I, Marque Type I, and Road Rescue Type I ambulances, built on Ford F-350, F-450, or F-550 chassis equipped with Compressible Liquid Adaptive Suspension Systems (C.L.A.S.S.) made by LiquidSpring. Due to an incorrect torque specification, the rear brake caliper banjo bolts may have been overtightened. The improperly tightened banjo bolts may result in a partial or complete loss of rear brake power, increasing the risk of a crash. REV will notify owners, and LiquidSpring dealers will replace the rear brake banjo bolts, free of charge. The recall began during April 2017. Owners may contact LiquidSpring customer service at 1-765-474-7816 extension 1 or by email at service@liquidspring.com or REV customer service at 1-800-628-8178.

17V-131

Subaru of America, Inc. (Subaru) is recalling certain 2017 Impreza vehicles. Due to a software problem, the rearview camera display may not work properly. A rearview camera display that does not function as designed can reduce the driver's view of what is behind the car, increasing the risk of a crash. Subaru will notify owners, and dealers will update the infotainment software, free of charge. The recall began on March 27, 2017. Owners may contact Subaru customer service at 1-800-782-2783. Subaru's number for the recall is WTN-74.

17V-132

Porsche Cars North America, Inc. (Porsche) is recalling certain 2015-2016 Macan S and Macan Turbo and 2017 Macan GTS vehicles. The passenger occupant detection sensor mat may fail in the front passenger seat, deactivating the front passenger air bag. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 208, "Occupant Crash Protection." In the event of a crash, if the front passenger air bag does not deploy as intended, the front passenger has an increased risk of injury. Porsche will notify owners, and dealers will replace the sensor mat and seat cushion, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Porsche customer service at 1-800-767-7243. Porsche's number for this recall is AH02.

17V-133

Porsche Cars North America, Inc. (Porsche) is recalling certain 2016 911 GT3 RS and 911 R vehicles and 2017 911 Carrera, 911 Carrera Cabriolet, 911 Carrera 4, 911 Carrera 4S, 911 Carrera 4S Cabriolet, 911 Carrera S, 911 Carrera S Cabriolet, 911 Targa 4, 911 Targa 4S, 911 Turbo S, 911 Turbo S Cabriolet, 718 Boxster, 718 Boxster S, 718 Cayman and 718 Cayman S vehicles. The passenger frontal air bag inflator

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2017**

Published May 2, 2017

initiator may fail to ignite during a crash. If the air bag inflator initiator fails to ignite, the passenger frontal air bag will not deploy, increasing the risk of injury in the event of a crash. Porsche will notify owners, and dealers will replace the affected air bags, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Porsche customer service at 1-800-767-7243. Porsche's number for this recall is AH03.

17V-134

Porsche Cars North America, Inc. (Porsche) is recalling certain 2017 911 Carrera Cabriolet, 911 Carrera 4 Cabriolet, 911 Carrera 4S Cabriolet, 911 Carrera S Cabriolet, 911 Targa S, 911 Targa 4S, 911 Turbo Cabriolet, 718 Boxter and 718 Boxter S vehicles. During manufacturing, the windshield may not have been properly bonded to the vehicle, allowing it to detach in a crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 212, "Windshield Mounting." In the event of a crash, if the windshield separates from the vehicle, it can increase the risk of injury. Porsche will notify owners, and dealers will rebond the windshield, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Porsche customer service at 1-800-767-7243. Porsche's number for the recall is AH04.

17V-135

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2017 Beetle and Jetta GLI vehicles. The affected vehicles have incorrect information on the tire information label, possibly causing the operator to overload the vehicle. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims." Overloading the vehicle may affect vehicle handling or result in tire damage, increasing the risk of a crash. Volkswagen will notify owners, and dealers will install a corrected tire information label, free of charge. The recall began March 30, 2017. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's number for the recall is 01B9.

17V-136

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2017 Jetta vehicles. The affected vehicles have incorrect information on the tire information label, possibly causing the operator to overload the vehicle. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims." Overloading the vehicle may affect vehicle handling or result in tire damage, increasing the risk of a crash. Volkswagen will notify owners, and dealers install a corrected tire information label, free of charge. The recall began March 30, 2017. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's number for the recall is 01B8

17V-137

BMW of North America, LLC, (BMW) is recalling certain 2011-2013 X5 xDrive35i, X5 xDrive50i, X5 M and X5 xDrive35d vehicles, 2011-2014 X6 xDrive35i, X6 xDrive50i and X6M vehicles, and 2011 x6 ActiveHybrid Vehicles. Water and debris may enter the front driveshaft's universal joint, causing excessive wear and possibly resulting in the joint's failure. If the front universal joint fails, the front wheels would not be driven, affecting vehicle traction. Additionally, continued driving of the vehicle with a broken front universal joint may damage other components. Either condition may increase the risk of a crash. BMW will notify owners, and dealers will replace the front driveshaft, free of charge. The recall began on April 18, 2017. Owners may contact BMW

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2017**

Published May 2, 2017

customer service at 1-800-525-7417.

17V-138

REV Recreation Group (REV) is recalling certain 2015-2016 American Coach American Heritage and American Tradition motorhomes, 2015-2017 American Coach American Revolution and American Coach American Eagle motorhomes, 2016 American Coach American Allegiance motorhomes, 2016-2017 American Coach American Dream motorhomes and 2017 Holiday Rambler Diplomat and Holiday Rambler Scepter motorhomes. The support for the interior steps may have been inadequately secured, possibly resulting in the solid-surface step tread being unstable. An unstable step tread can increase the risk of an injury. REV will notify owners, and dealers will install new screws to properly secure the support for the interior steps, free of charge. The recall began on April 21, 2017. Owners may contact REV customer service at 1-800-509-3417. REV's number for the recall is 170228REV.

17V-139

REV Recreation Group (REV) is recalling certain 2015 Fleetwood Bounder Classic motorhomes, 2015-2016 Fleetwood Terra motorhomes, 2016-2017 Fleetwood Storm, Holiday Rambler Admiral XE and Fleetwood Flair motorhomes, and 2017 Holiday Rambler Vacationer XE motorhomes. The affected vehicles, equipped with an Onan 5.5 Kilowatt Generator, have an external fuel pump and in-line fuel filter that may be improperly secured to the chassis. If the fuel pump or filter detach or become loose, a fuel leak may result, which in the presence of an ignition source, can increase the risk of a fire or explosion. REV will notify owners, and dealers will inspect the mounting of the generator's external fuel pump and in-line fuel filter, securing them as necessary, free of charge. The recall is expected to begin April 28, 2017. Owners may contact REV customer service at 1-800-509-3417. REV's number for the recall is 170301REV.

17V-140

Forest River Inc. (Forest River) is recalling certain 2017 Prime Time Manufacturing Crusader recreational trailers, model CSF338RSK. The Federal placard indicates that the trailers have axles that have a capacity of 7,000 lbs when their actual capacity is 6,000 lbs. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." Incorrect axle information on the placard can result in the trailer being overloaded, causing a loss of control and increasing the risk of a crash. Forest River will notify owners and dealers will replace the Federal placard with a corrected placard, free of charge. The recall is expected to begin May 2, 2017. Owners may contact Forest River Customer Service at 1-574-862-1025. Forest River's number for the recall is 49-02242017-0331.

17V-141

Hyundai Motor America (Hyundai) is recalling certain 2017 Santa Fe Sport vehicles. The affected vehicles have a tire pressure monitoring system (TPMS) that may not have been set in the correct mode during vehicle assembly, and therefore will not provide an appropriate warning in the event of an underinflated tire. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 138, "Tire Pressure Monitoring Systems." An underinflated inflated tire can increase the risk of a crash. Hyundai will notify owners, and dealers will replace the TPMS sensors, free of charge. The recall began March 31, 2017. Owners may contact Hyundai customer service at 1-800-633-5151. Hyundai's number for the recall is 159.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2017**

Published May 2, 2017

17V-142

Nissan North America Inc. (Nissan) is recalling certain 2017 Infiniti QX30 vehicles. The affected vehicles have a driver-side curtain air bag inflator initiator that may fail to ignite during a crash, preventing the air bag from deploying. If the air bag fails to deploy in the event of a crash, it can increase the risk of injury. Nissan will notify owners, and dealers will replace the driver-side curtain air bag assembly, free of charge. Owners may contact Infiniti customer Service at 1-800-662-6200.

17V-143

Nissan North America, Inc. (Nissan) is recalling certain 2012 Nissan Versa vehicles. Degradation of the side impact sensor connector pins may cause the curtain and seat-mounted air bags to deploy unexpectedly if the door is slammed. If the curtain and seat-mounted air bags inadvertently deploy, it can increase the risk of injury. Nissan will notify owners, and dealers will install a new jumper harness, and replace the side impact satellite sensors, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Nissan customer service at 1-800-647-7261.

17V-144

Zero Motorcycles Inc. (Zero) is recalling certain 2017 S, DS, and FXS motorcycles. The Anti-Lock Braking System (ABS) Hydraulic Control Unit (HCU) may have the wrong vehicle model information, possibly causing the ABS to function improperly. If the ABS does not function properly in a braking event, there is an increased risk of a crash. Zero will notify owners and dealers will reconfigure the HCU, or replace it as needed, free of charge. The recall began on March 13, 2017. Owners may contact Zero customer service at 1-888-841-8085. Zero's number for the recall is SV-ZMC-017-363.

17V-145

Chrysler (FCA US LLC) is recalling certain 2017 Fiat 500X vehicles. When the vehicle has a tire with low tire pressure, the tire pressure monitoring system (TPMS) warning light may not illuminate. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 138, "Tire Pressure Monitoring Systems." Driving a vehicle with an underinflated tire may result in tire failure and increase the risk of a crash. Fiat will notify owners, and dealers will update the instrument panel software, free of charge. The recall began April 13, 2017. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is T16.

17V-146

Keystone RV Company (Keystone) is recalling certain 2017 Cougar and Laredo recreational trailers. The affected vehicles may have been incorrectly equipped with two carbon monoxide detectors instead of one smoke detector and one carbon monoxide detector. Without a smoke detector, in the event of a fire, the trailer occupants have an increased risk of injury. Keystone will notify owners and dealers will inspect the trailers and install a smoke detector, if necessary, free of charge. The recall began on March 14, 2017. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for the recall is 17-279.

17V-147

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2017**

Published May 2, 2017

Daimler Vans USA LLC (DVUSA) is recalling certain 2016-2017 Mercedes-Benz Metris vehicles. These vans were to be equipped with the Blind Spot Monitoring (BSM) feature, however, the installed instrument cluster and steering wheel does not support the function, and thus, the BSM system does not work on the vehicle. If a vehicle is in the driver's blind spot, but the BSM system does not warn the driver, there would be an increased risk of a crash. DVUSA will notify owners, and dealers will install the correct instrument cluster and steering wheel to enable the BSM function, free of charge. Interim notices informing owners of the safety risk will be mailed during May 2017. Owners will receive a second notice when the remedy becomes available. The manufacturer has not yet provided a notification schedule. Owners may contact DVUSA customer service at 1-877-762-8267.

17V-148

Daimler Vans USA, LLC (DVUSA) is recalling certain 2016 Mercedes-Benz Sprinter 2500 and 3500 vehicles and Freightliner Sprinter 2500 and 3500 vehicles. The bracket for the center support bearing of the drive shaft may not have been properly welded. If the event of a crash, the bracket may detach and the drive shaft may damage the fuel system, increasing the risk of a fire. DVUSA will notify owners and dealers will install three additional rivets to secure the bracket, free of charge. Interim notices informing owners of the safety risk will be mailed during May 2017. Owners will receive a second notice when the remedy becomes available. Owners may contact DVUSA customer service at 1-877-762-8267.

17V-149

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2017 Audi A5 Cabriolet and S5 Cabriolet vehicles. A component within the front, rear, and rear center seat belt retractor pretensioners may detach after the seatbelt retractor pretensioner is deployed in the event of a crash. Although, the seat belt will operate as intended in the event of a crash, the pretensioner component may be a projectile within the vehicle cabin, increasing the risk of injury. Audi will notify owners, and dealers will replace the safety belt retractors/pretensioners, free of charge. The recall is expected to begin in May 2017. Owners may contact Audi customer service at 1-800-253-2834. Volkswagen's number for the recall is 6908.

17V-150

Volkswagen Group of America Inc. (Volkswagen) is recalling certain 2007-2010 Touareg vehicles. The fuel filter flange may crack and allow fuel to leak out. A fuel leak in the presence of an ignition source can increase the risk of a fire. Volkswagen will notify owners, and dealers will inspect and replace the fuel filter flange if cracks are found. A protective cover will be applied to the fuel filter to prevent oxidization cracks from forming. These repairs will be made free of charge. The recall is expected to begin in May 2017. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's number for the recall is 20Z4.

17V-151

Hyundai Motor America (Hyundai) is recalling certain 2011-2014 Sonata and 2011-2015 Sonata Hybrid vehicles. In the affected vehicles, the seat belt linkages for both front seat belts may detach from the seat belt anchor pretensioners. In the event of a crash, if the seat belts detach from the anchor pretensioners, it can increase the risk of injury. Hyundai will notify owners and dealers will inspect the connection between the seat belt linkages and the seat belt anchor pretensioners, repairing them as necessary, free of charge. The recall is

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2017**

Published May 2, 2017

expected to begin April 7, 2017. Owner's may contact Hyundai customer service at 1-855-371-9460. Hyundai's number for the recall is 160.

17V-152

Jaguar Land Rover North America, LLC (Jaguar) is recalling certain 2017 Jaguar F-PACE vehicles equipped with automatic transmissions. These vehicles may have been built with a rear driveshaft that is too short, potentially resulting the driveshaft separating from the vehicle. If the driveshaft detaches, a loss of drive power would result, increasing the risk of a crash. Jaguar will notify owners, and dealers will inspect the driveshafts, replacing any that are incorrect, free of charge. The recall is expected to begin May 1, 2017. Owners may contact Jaguar customer service at 1-800-452-4827. Jaguar's number for this recall is H009.

17V-153

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain 2016 Land Rover Range Rover and Range Rover Sport vehicles. The passenger frontal air bag inflator initiator may fail to ignite during a crash. If the air bag inflator initiator fails to ignite, the passenger frontal air bag will not deploy, increasing the risk of injury in the event of a crash. Land Rover will notify owners, and dealers will replace the front passenger air bag, free of charge. The recall began May 1, 2017. Owners may contact Land Rover customer service at 1-800-637-6837. Land Rover's number for this recall is N026.

17V-154

Airstream Inc. (Airstream) is recalling certain 2017 Base Camp recreational trailers. When the trailer is heavily loaded, the axle travel may allow the tires on these vehicles to contact the plastic liner of the wheel well or fender, possibly resulting in tire failure. Tire failure can increase the risk of a crash. Airstream will notify owners, and dealers will replace the axle to limit the axle travel, free of charge. The recall began on April 13, 2017. Owners may contact Airstream customer service at 1-937-596-6111, extension 7401 or 7411.

17V-155

Gillig LLC (Gillig) is recalling certain 2016-2017 Low Floor transit buses. The affected vehicles have wiper arms that can crack where they mount to the wiper motor causing the wiper arms to bend or detach from the vehicle. A loss of wiper function can reduce the driver's visibility, increasing the risk of a crash. Gillig will notify owners, and dealers will replace the affected wiper arms, free of charge. The recall began on March 31, 2017. Owners may contact Gillig customer service at 1-800-735-1500.

17V-156

Manac Inc. (Manac) is recalling certain 2016-2017 Van Trailers. The aluminum rivets that secure the external rub rails may fail, allowing the rub rails to detach. If the rub rail detaches, it may become a road hazard, increasing the risk of a crash or injury. Manac will notify owners and dealers will replace the aluminum rivets with stainless steel rivets, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Manac customer service at 1-418-228-2018.

17V-157

Polaris Industries, Inc. (Polaris) is recalling certain 2017 Slingshot, Slingshot SL, and Slingshot SLR vehicles.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2017**

Published May 2, 2017

Three of the bolted connections between the steering and the front suspension may have been insufficiently tightened, possibly resulting in a reduction of steering and/or front suspension performance. Reduced steering and/or suspension performance can affect vehicle handling, increasing the risk of a crash. Polaris will notify owners, and dealers will replace the affected nuts and bolts, tightening them correctly, free of charge. The recall began March 23, 2017. Owners may contact Polaris customer service at 1-855-863-2284. Polaris' number for this recall is T-17-01.

17V-158

Kia Motors America (Kia) is recalling certain 2017 Niro vehicles. The Motor Driven Power Steering (MDPS) may have been damaged during assembly, resulting in improper connection to the electronic control unit (ECU). This will cause the Power Steering warning light to illuminate, and can result in loss of power steering. If there is a loss of power steering, causes the operator to use more effort to steer the vehicle, increasing the risk of a crash. Kia will notify owners, and dealers will replace the MDPS motor, free of charge. The recall is expected to begin April 7, 2017. Owners may contact Kia customer service at 1-800-333-4542. Kia's number for this recall is SC145.

17V-159

Spartan Motors USA (Spartan) is recalling certain 2011-2017 Gladiator, 2016-2017 MetroStar, 2012-2018 K2, 2011-2018 K3, 2017-2018 K4, and 2011-2017 MM vehicles. The ball joints on the independent front suspension (IFS) modules can loosen and separate, leading to a partial loss of steering. A separated ball joint can cause a loss of steering control, increasing the risk of a crash. Spartan will notify owners, and dealers will remove, clean, apply thread locker, and reinstall the properly torqued ball joint, free of charge. The recall began on March 24, 2017. Owners may contact Spartan customer service at 1-800-543-4277. Spartan's number for this recall is 17004.

17V-160

Maserati North America, Inc. (Maserati) is recalling certain 2017 Levante vehicles. Due to an engine software problem, at slow speeds such as stop-and-go traffic, the transmission may unexpectedly shift into neutral or the engine may shut off. If the transmission shifts into neutral unexpectedly or if the engine shuts down without warning, it can increase the risk of a crash. Maserati will notify owners, and dealers will update the engine control module software, free of charge. The recall began March 31, 2017. Owners may contact Maserati customer service at 1-201-510-2369.

17V-161

Thor Motor Coach (TMC) is recalling certain 2014-2015 ACE, Hurricane, Challenger, Daybreak, Miramar, Outlaw, and Windsport motorhomes. These vehicles have windshield wiper systems that may have been improperly installed and secured, possibly causing the wipers to fail during use. Failure of the windshield wipers may impair the driver's visibility, increasing the risk of a crash. TMC will notify owners, and dealers will inspect and correct the wiper system as necessary, free of charge. The recall is expected to begin May 13, 2017. Owners may contact TMC customer service at 1-877-855-2867.

17V-162

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2017**

Published May 2, 2017

Thor Motor Coach (TMC) is recalling certain 2017 Aria 3601 motorhomes. The seat belts on the passenger side sofa may be too short to fasten around passengers seated there. If the seat belt cannot adequately restrain passengers, it can increase the risk of injury in the event of a crash. TMC will notify owners, and dealers will replace the incorrect seat belt with a longer one, free of charge. The recall is expected to begin May 7, 2017. Owners may contact TMC customer service at 1-877-855-2867. TMC's number for this recall is RC000129.

17V-163

Ride The Ducks International LLC (RTDI) is recalling certain 1999-2002 Stretch Amphibious passenger vehicles. The headlights may have been mounted 56" above the ground instead of being mounted between 22" and 54" above the ground as is required to prevent the headlights from blinding oncoming traffic. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." If the headlights are not installed within the required limits, it can cause a decrease in visibility, increasing the risk of a crash. RTDI will notify owners, and dealers will relocate the headlights to the proper height requirements, free of charge. The recall began on April 20, 2017. Owners may contact RTDI customer service at 1-417-266-7600.

17V-164

Ride The Ducks International LLC (RTDI) is recalling certain 1996-2014 Stretch Amphibious Passenger and Truck Amphibious Passenger vehicles. The instrument cluster does not illuminate the associated symbol when the vehicles' turn signals or high beam lights are in use, instead only a solid color is lit. Additionally, the indicator for the windshield wiping system is not illuminated when the vehicle's headlights are activated. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 101, "Control and Displays." If the instrument panel does not illuminate correct telltale displays for the turn signals or high beam headlights, the vehicle operator may not recognize that the systems are been activated, potentially increasing the risk of a crash. RTDI will notify owners, and dealers will replace the instrument panel telltales and controls, free of charge. The recall began on April 20, 2017. Owners may contact RTDI customer service at 1-417-266-7600.

17V-165

Thor Motor Coach (TMC) is recalling certain 2017 Chateau, Freedom Elite, and Four Winds Motorhomes. The sofa may not have a seat belt for the middle seating position. Without a seat belt, the occupant sitting in the middle position of the sofa will not be properly restrained in the event of a crash, increasing the risk of an injury. Thor Motor Coach will notify owners, and dealers will install a middle seat belt, free of charge. The recall is expected to begin May 7, 2017. Owners may contact TMC customer service 1-877-855-2867. TMC's number for the recall is RC000130.

17V-166

Jayco Inc. (Jayco) is recalling certain 2017 Designer fifth wheel recreational trailers equipped with the disk brake option. The steel rim of the spare tire may rub against the brake caliper. The interference may generate enough heat to cause the tire to fail, increasing the risk of a crash. Jayco will notify owners, and dealers will replace the spare wheel with an aluminum rim with a new spare, free of charge. The recall began on March 27, 2017. Owners may contact Jayco customer service at 1-800-283-8267. Jayco's number for the recall is 9901347.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2017**

Published May 2, 2017

17V-167

Ford Motor Company (Ford) is recalling certain 2017 Ford Mustang vehicles. The return spring for the driver side interior door handle may come loose, allowing the driver's door to unlatch in a side impact crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 206, "Door Locks and Door Retention Components." If the door unlatches in a crash it can increase the risk of injury. Ford will notify owners, and dealers will inspect the driver-side interior door handle and repair the return spring, as necessary, free of charge. The recall began April 14, 2017. Owners may contact Ford at 1-866-436-7332. Ford's number for the recall is 17C04.

17V-168

Forest River, Inc. (Forest River) is recalling certain 2017 Puma recreational trailers, models PT23FBC and PT25RSC. The Federal Placard has incorrect tire and rim size information, indicating ST205/75R15C tires with a 50 psi and rim size of 14X5, when the correct information is ST205/75R14C tires with a 50 psi, and rim size of 14X5.5JJ. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims." The incorrect tire information can cause the operator to install the wrong size of replacement tires, increasing the risk of a crash. Forest River will notify owners, and dealers will provide a corrected Federal Placard, free of charge. The recall is expected to begin May 8, 2017. Owners may contact Forest River customer service at 1-574-642-0588. Forest River's number for this recall is 420-03072017-0338.

17V-169

Roush CleanTech, LLC (Roush) is recalling certain 2015-2017 Roush-modified Ford E-450, F59, F-650 and F-750 vehicles equipped with certain Generation 4 Propane Conversion Kits. The fuel control valve solenoid may short circuit, shutting off the flow of propane to the engine, causing the engine to shut off. An engine stall while driving increases the risk of a crash. Roush has notified owners, and dealers will replace the fuel control valve solenoid, free of charge. The recall began on March 22, 2017. Owners may contact Roush customer service at 1-800-597-6874. Roush's number for this recall is VR.

17V-170

Forest River, Inc. (Forest River) is recalling certain 2017 Cherokee recreational trailers, model ORCKT244JR-64. The Federal Placard has incorrect tire and rim size information, indicating ST205/75R15C tires with 50 PSI and a rim size of 15X5.5JJ, when the actual combination is ST205/75R14C tires with 50 PSI and a rim size of 14X5.5JJ. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims." The incorrect tire information can cause the operator to install the wrong size of replacement tires, increasing the risk of a crash. Forest River will notify owners, and dealers will install a corrected Federal Placard, free of charge. The recall is expected to begin May 8, 2017. Owners may contact Forest River customer service at 1-541-995-3447. Forest River's number for this recall is 64-03082017-0339.

17V-171

Forest River, Inc. (Forest River) is recalling certain 2017 Flagstaff and Rockwood recreational trailers. The

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2017**

Published May 2, 2017

Federal Placard on these vehicles indicates a capacity of 5,000 lbs for each axle, however, each axle actually has a capacity of 4,000 lbs. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." The incorrect information can cause the vehicle to be overloaded or result in axle failure, increasing the risk of a crash. Forest River will notify owners, and dealers will replace the Federal Placard with a corrected one, free of charge. The recall is expected to begin May 8, 2017. Owners may contact Forest River customer service at 1-574-642-2640. Forest River's number for this recall is 10C-03082017-0341.

17V-172

Volvo Bus Corporation (Volvo Bus) is recalling certain 2016-2017 Volvo 9700 transit buses equipped with the I-Start feature. These vehicles have a ground cable that may have been improperly installed, resulting in inadequate electrical contact. The poor contact may cause the power feed relay to fail and the engine to stall. An unexpected engine shutdown increases the risk of a crash. Volvo Bus will notify owners, and dealers will inspect the vehicles and correct the ground wire installation, as necessary, free of charge. The recall is expected to begin during May 2017. Owners may contact Volvo Bus customer service 1-877-773-8678. Volvo Bus' number for this recall is SR17-80. Note: The affected vehicles were previously remedied for a similar issue under recall 16V836, however, this recall requires additional repairs to ensure that the power feed relay will not fail.

17V-173

Navistar Inc. (Navistar) is recalling certain 2016-2018 International LT, 2016-2017 International ProStar, 2017 International LoneStar, and 2017-2018 International RH heavy diesel trucks. The air dryer mounting bracket may fracture, causing air system leaks or a loss of air pressure to the brake system. A loss of brake air pressure could lengthen the distance needed to stop the vehicle, increasing the risk of a crash. Navistar will notify owners, and dealers will replace the air dryer mounting bracket, free of charge. The recall is expected to begin May 12, 2017. Owners may contact Navistar customer service at 1-800-448-7825. Navistar's number for the recall is 17502.

17V-174

Altec Industries Inc. (Altec) is recalling certain 2015-2016 Aerial devices and Service Body Trucks equipped with certain JEMS 4A or JEMS 4E4 Idle Mitigation Systems (IMS). A cable within the IMS may have been improperly installed, possibly causing the cable to rub against an electrical component and short circuit. A short circuit increases the risk of fire. Altec will notify owners, and dealers will replace and reroute the contactor cable within the IMS, free of charge. The recall began on April 13, 2017. Owners may contact Altec customer service at 1-205-991-7733. Altec's number for the recall is CSN 646.

17V-175

Mercedes-Benz USA LLC, (MBUSA) is recalling certain 2017 E300 and E300 4Matic vehicles. The front passenger air bag may not deploy properly if a front seat passenger is sitting on the edge of the seat or is laying in the seat with the seat reclined. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 208, "Occupant Crash Protection." In the event of a crash that necessitates air bag deployment, if the air bag does not deploy as intended, there would be an increased risk of occupant injury. MBUSA will notify owners, and dealers will update the air bag control module software, free of charge. The recall began April 13, 2017. Owner's can contact MBUSA customer service at 1-800-367-6372.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2017**

Published May 2, 2017

17V-176

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2016 AMG GT-S, GLC300, CLA250 and GLE300d 4Matic vehicles, 2013 C250, E350 BlueTec and G63 AMG vehicles, 2008-2014 C300 vehicles, 2013-2014 C300 4Matic and ML350 4Matic vehicles, 2009 C350 vehicles, 2014 CLS550, E350 4Matic, E350 Coupe 4Matic, E350 Wagon 4Matic, GLK350 and SL550 vehicles, 2012 CLS550 4Matic vehicles, 2012-2016 E350 vehicles, 2016-2017 GL450 4Matic vehicles, 2012-2014 ML350 4Matic BlueTec vehicles, 2015 S550, S550 4Matic and C300 4Matic Sedan vehicles, 2015-2016 C300 Sedan vehicles, and 2017 SL63 AMG vehicles. Various control units on these vehicles may have been updated with incorrect software, potentially affecting the correct deployment of the air bags in the event of a crash. If the air bags do not deploy as intended in the event of a crash, there would be an increased risk of injury in the event of a crash. MBUSA will notify owners, and dealers will update software in the affected control units, free of charge. The recall began April 21, 2017. Owners may contact MBUSA customer service at 1-800-367-6372.

17V-177

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2016 G550 4MATIC and G63 AMG vehicles. In the affected vehicles, the cable that unlatches the door when the inner door handle is pulled may break if the door is difficult to release, such as could occur after a crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 206, "Door Locks and Door Retention Components." If the cable breaks and the door cannot be opened from inside the vehicle after a crash, the occupant is at an increased risk of an injury. MBUSA will notify owners and dealers will replace the cable that connects the inner door handle and the door lock on all four doors, free of charge. The recall began on April 28, 2017. Owners can contact Mercedes-Benz customer service at 1-800-367-6372.

17V-178

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2016 Smart Fortwo vehicles. The horizontal headlight adjustment mechanism on these vehicles may not have been properly sealed off to prevent future adjustment. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." If the headlight can be adjusted horizontally, the headlight may be adjusted outside of the designed specifications, reducing the driver's visibility and potentially blinding oncoming traffic, increasing the risk of a crash. MBUSA will notify owners, and dealers will install the correct sealing caps to prevent the headlights from being adjusted horizontally, free of charge. The manufacturer has not yet provided a notification date. Owners may contact MBUSA customer service at 1-800-367-6372.

17V-179

Ride The Ducks International LLC (RTDI) is recalling certain 1996-2014 Stretch Amphibious and Truck Amphibious passenger vehicles. These vehicles are equipped with 'Captain's Chair'-style driver's seats and non-retractable lap belt seat belt assemblies. The seats, seat belt assemblies and seat belt anchorage systems may not adequately secure the driver in the event of a crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 207, "Seating Systems", 208, "Occupant Crash Protection", 209, "Seat Belt Assemblies", and 210, "Seat Belt Assembly Anchorages." If the driver seat, seat

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2017**

Published May 2, 2017

belt assemblies, or seat belt anchorages fail to restrain the driver in the event of a crash, it can increase the risk of injury. RTDI will notify owners, and dealers will replace the driver's seats and seat belt assembly, free of charge. The recall began on April 20, 2017. Owners may contact RTDI customer service at 1-417-266-7600.

17V-182

VanLeigh RV (VanLeigh) is recalling certain 2016-2017 Vilano fifth-wheel recreational trailers, models 325RL and 365RL. These vehicles have a Federal Placard that indicates incorrect tire and load range information, possibly resulting in the vehicle being overloaded. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." If the vehicle is overloaded it can increase the risk of a crash. VanLeigh will notify owners and will send them a corrected Federal Placard label, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact VanLeigh customer service at 1-662-612-4040.

17V-183

Nissan North America (Nissan) is recalling certain 2013-2014 Murano and Murano Cross Cabriolet vehicles. The power steering hose clamp may not adequately secure the hose, allowing the hose to detach and leak power steering fluid. If the power steering fluid leaks onto a heat source such as hot engine or exhaust components, there could be an increased risk of a fire. Nissan will notify owners, and dealers will install a power steering high pressure hose kit, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Nissan customer service at 1-800-647-7261.

17V-184

Trail King Industries, Inc. (Trail King) is recalling certain 2016-2017 ACS and AACS drop deck fifth wheel trailers. The fifth wheel coupler plate on these vehicles may crack, potentially allowing the trailer to detach from the tractor. If the trailer to detaches from the tractor, it can increase the risk of a crash. Trail King will notify owners, and dealers will replace the coupler plate, free of charge. Owners may contact Trail King customer service at 1-800-843-3324.

17V-186

Entegra Coach (Entegra) is recalling certain 2012-2013 and 2015-2018 Anthem; 2013 and 2017-2018 Aspire; and 2012-2018 Cornerstone motorhomes built on a Spartan Motors chassis. The ball joints on the independent front suspension (IFS) modules can loosen and separate, leading to a partial loss of steering. A separated ball joint can cause a loss of steering control, increasing the risk of a crash. Entegra will notify owners, and Spartan service centers will remove, clean, apply thread locker, and reinstall the properly torqued ball joint, free of charge. The recall began on April 25, 2017. Owners may contact call Spartan customer service at 1-800-543-4277 or Entegra customer service at 1-800-945-4787.

17V-187

Triple E Recreational Vehicles (Tirple E) is recalling certain 2017 Wonder motorhomes, model W24MB. These vehicles are missing the 'Exit' decal that should have been installed on the driver side cab door. If the 'Exit' decal is missing, in the event of an emergency, occupants may not remember that the driver side cab door is an exit, increasing their risk of a injury. Triple E has notified owners and sent them an 'Exit' decal to install, free of charge. The recall began on March 27, 2017. Owners may contact Triple E customer service at 1-877-992-9906.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2017**

Published May 2, 2017

Triple E's number for this recall is CA #8593-1.

17V-188

BMW of North America, Inc. (BMW) is recalling certain 2017 X5 sDrive35i, X5 xDrive35i, X5 xDrive50i, X5 xDrive35d, and X5 xDrive40e vehicles. These vehicles are equipped with passenger frontal air bag modules using certain air bag inflators that may not vent properly in the event of a crash necessitating deployment of the passenger frontal air bag. If the inflator cannot vent properly, the inflator may rupture, resulting in metal fragments striking the vehicle occupants and causing serious injury or death. BMW has notified owners, and dealers will replace the air bag modules, free of charge. The recall began on March 20, 2017. Owners may contact BMW customer service at 1-800-525-7417.

17V-189

Kia Motors America (Kia) is recalling certain 2017 Cadenza vehicles. The brake vacuum hose on the affected vehicles may kink, reducing braking performance. Reduced braking performance can lengthen the distance needed to stop the vehicle, increasing the risk of a crash. Kia will notify owners, and dealers will inspect the brake vacuum hose, replacing it as necessary, free charge. The recall began on April 17, 2017. Owners may contact Kia customer service at 1-800-333-4542. Kia's number for this recall is SC146.

17V-190

Isuzu Technical Center of America, Inc. (Isuzu) is recalling certain 2011-2016 NPR, 2011-2017 NPR-HD, NQR, NRR, 2015-2017 NPR-XD, 2012-2016 Reach, NPR Gas and NPR-HD Gas incomplete trucks. The left rear wheel bearing hub locking bolts may not have been properly tightened during assembly. The loose bolts can allow the wheel assembly to move outward from the axle housing, affecting the control of the vehicle and reducing braking performance, thereby increasing a risk of a crash. Isuzu will notify owners, and dealers will inspect the left rear wheel bearing hub locking bolts, tightening them as necessary, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Isuzu customer service at 1-866-441-9638.

17V-191

Chrysler (FCA US LLC) is recalling certain 2014 Fiat 500L vehicles. The Powertrain Control Module (PCM) software calibration maybe incorrect, limiting the engine to idle speed and torque even when accelerator pedal is fully pressed. If the vehicle does not accelerate as expected, there may be an increased risk of a crash. Chrysler will notify owners, and dealers will update the PCM software, free of charge. The recall began April 13, 2017. Owners may the Fiat Information Center at 1-888-242-6342. Chrysler's number for this recall is T19.

17V-192

KTM North America, Inc. (KTM) is recalling certain 2016-2017 KTM 1290 Super Duke GT motorcycles. The preformed fuel hose can develop small holes or cracks, potentially causing a fuel leak. A fuel leak in the presence of a ignition source can increase the risk of a fire. KTM will notify owners, and dealers will replace the defective fuel hose, free of charge. The manufacturer has not yet provided a notification schedule. Customers may contact KTM customer service at 1-888-985-6090.

17V-194

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2017**

Published May 2, 2017

Newmar Corporation (Newmar) is recalling certain 2017-2018 Dutch Star, 2016-2018 Mountain Aire and London Aire, and 2012-2018 Essex and King Aire motorhomes built on a Spartan Motors chassis. The ball joints on the independent front suspension (IFS) modules can loosen and separate, leading to a partial loss of steering. A separated ball joint can cause a loss of steering control, increasing the risk of a crash. Newmar will notify owners, and Spartan service centers will remove, clean, apply thread locker, reinstall and torqued the ball joints, as necessary, free of charge. The recall is expected to begin May 21, 2017. Owners may contact Spartan at 1-800-543-4277 to locate a qualified service center or contact Newmar customer service at 1-574-773-7791. Newmar's number for this recall is 17004.

17V-195

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2017 Audi A3 and S3 Sedan vehicles. In a lower-speed crash situation, the air bag control unit software may deploy the passenger frontal air bag improperly if the front seat passenger is sitting on the edge of the seat or is laying in the seat with the seat reclined. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 208, "Occupant Crash Protection." If the air bag deploys with more force than intended, it can increase the risk of injury. Audi will notify owners, and dealers will update the air bag control module software, free of charge. The recall began April 20, 2017. Owners may contact Audi customer service at 1-800-253-2834. Volkswagen's number for this recall is 69Q3.

17V-196

REV Recreation Group (REV) is recalling certain 2017 Fleetwood Bounder and Holiday Rambler Vacationer vehicles. These vehicles are equipped with Federal Placards that incorrectly list a tire size of 235/80R 22.5 G when the actual tire size is 255/80R 22.5 G. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." If the operator were to replace the tires according to the information on the Federal Placard, it could increase the risk of a crash. REV will notify owners, and dealers will install a corrected label, free of charge. The recall began on April 12, 2017. Owners may contact REV customer service at 1-800-509-3417. REV's number for this recall is 170317REV.

17V-197

Chrysler (FCA US LLC) is recalling certain 2016-2017 Ram 1500 trucks. The differential pin retaining screw may come loose while driving, potentially causing the differential to break or lock up. A broken or locked up differential may result in a loss of motive power and possibly a loss of vehicle control. Either scenario increases the risk of a crash. Chrysler will notify owners, and dealers will inspect and replace the differential retaining pin, free of charge. The recall began April 24, 2017. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is T20.

17V-198

McNeilus Truck & Manufacturing, Inc. (McNeilus) is recalling certain 2013-2015 HD REL-11, REL TG TAG-12, MA-42, M-44, ZR-48, AR-49, and Pacific LoPro FEL-88 Refuse Trucks, equipped with compressed natural gas (CNG) fuel systems by Agility Fuel Systems. The affected CNG systems have flexible stainless steel, sleeved, high pressure hoses that may corrode from exposure to environmental conditions such as water mixed with road salt. Corrosion of the fuel hose may result in a CNG leak, which in the presence of an ignition source,

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2017**

Published May 2, 2017

may increase the risk of a fire. McNeilus will notify owners instructing them to contact Agility to have the defective hose assemblies replaced free of charge. The recall is expected to begin May 5, 2017. Owners may contact Agility customer service at 1-949-267-7745 or contact McNeilus customer service at 1-888-686-7278. McNeilus' number for this recall is Agility 16E-092.

17V-199

Tiffin Motorhomes, Inc. (Tiffin) is recalling certain 2011-2016 Allegro Open Road motorhomes. The tow hitch on these vehicles may can detach from the coach under heavy loading or hard braking conditions. If the hitch detaches, the tow vehicle would not be connected to the motorhome, increasing the risk of a crash. Tiffin will notify owners, and dealers will install frame rail extension liner brackets, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Tiffin Motorhomes customer service at 1-256-356-8661.

17V-200

Hino Motor Sales U.S.A., Inc. (Hino) is recalling certain 2013-2017 XFC710L, XFC720L, XFC730L, and XFC740L vehicles. The clutch drum spline of the front module of the Hybrid Vehicle (HV) motor may wear out. If the clutch drum spline wears out, the vehicle will lose the ability to move under its own power, increasing the risk of a crash. Hino will notify owners, and dealers will replace the clutch drum spline with one that has increased wear resistance, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Hino customer service at 1-248-699-9300.

17V-201

Blue Bird Body Company (Blue Bird) is recalling certain 2016 Vision and All American school buses, equipped with certain QS11, QSCR11, QSJ11, and Davenport school bus seats that include three-point lap/shoulder seat belts. These seats may have a loose or missing D-ring mounting nut, allowing the shoulder belt D-ring to detach in a crash. A loose or missing shoulder belt D-ring may prevent the seat belt from adequately restraining the seat occupant in the event of a crash, increasing their risk of injury. Blue Bird will notify owners, and personnel from the school bus seat manufacturer will inspect and repair the affected seats, free of charge. The recall began on April 12, 2017. Owners may contact Blue Bird Campaigns Administration at 1-478-822-2242. Blue Bird's number for this recall is R17YZ (SB).

17V-202

Blue Bird Body Company (Blue Bird) is recalling certain 2017-2018 Vision school buses, designed to run on propane. The fuel control valve solenoid may short circuit, shutting off the flow of propane to the engine, causing the engine to shut off. An engine stall while driving increases the risk of a crash. Blue Bird will notify owners, and dealers for Roush CleanTech, the supplier of the propane fuel kit, will replace the defective fuel control valve solenoids, free of charge. The recall began on April 21, 2017. Owners may contact Blue Bird at 1-478-822-2242. Blue Bird's number for recall is R17ZA (SB).

17V-203

Blue Bird Body Company (Blue Bird) is recalling certain 2017-2018 Vision transit buses, designed to run on propane. The fuel control valve solenoid may short circuit, shutting off the flow of propane to the engine, causing

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2017**

Published May 2, 2017

the engine to shut off. An engine stall while driving increases the risk of a crash. Blue Bird will notify owners, and dealers for Roush CleanTech, the supplier of the propane fuel kit, will replace the defective fuel control valve solenoids, free of charge. The recall began on April 21, 2017. Owners may contact Blue Bird at 1-478-822-2242. Blue Bird's number for recall is R17ZA (NSB).

17V-204

Ford Motor Company (Ford) is recalling certain 2017 Edge vehicles equipped with the optional Panoramic Vista Roof. These vehicles may have an improperly welded windshield header, reducing the vehicle's lateral structural integrity. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 214, "Side Impact Protection." If the vehicle has reduced lateral structural integrity, the occupants are at an increased risk of injury in the event of a side-impact crash. Ford will notify owners, and dealers will repair the windshield header, free of charge. The recall is expected to begin May 15, 2017. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for the recall is 17C05

17V-205

Keystone RV Company (Keystone) is recalling certain 2017 Cougar recreational trailers, models 326RDS, 327RKL, 333MKS, 336BHS and 359MBI. These vehicles were built with with a manual-resetting 12 volt circuit breaker, which cannot be used in close proximity to the liquid propane storage. If the breaker sparks when it is being manually reset, it can increase the risk of a fire. Keystone will notify owners, and dealers will inspect the trailers and replace the breaker with one that automatically resets, as necessary, free of charge. The recall began on March 29, 2017. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 17-282.

17V-206

Motor Coach Industries (MCI) is recalling certain 2014 -2016 J4500 vehicles. The front sway bar on these vehicles may crack at the bushing/clamp locations. If the sway bar cracks, it can detach from the vehicle, affecting vehicle handling and increasing the risk of a crash. Motor Coach Industries (MCI) will notify owners and dealers will replace the sway bar assembly, free of charge. The recall is expected to begin May 15, 2017. Owners may contact Motor Industries at 1-800-241-2947. MCI's number for this recall is Service Bulletin 452.

17V-207

Iowa Mold Tooling Co., Inc. (IMT) is recalling one model year 2013 Refuse-Container Delivery vehicle, equipped with a compressed natural gas (CNG) fuel system by Agility Fuel Systems. The affected CNG system has flexible stainless steel, sleeved, high pressure hoses that may corrode from exposure to environmental conditions such as water mixed with road salt. Corrosion of the fuel hose may result in a CNG leak, which in the presence of an ignition source, may increase the risk of a fire. IMT will notify the owner and instruct them to contact Agility to have the defective hose assembly replaced free of charge. A notification schedule has not yet been provided. Owners may contact IMT customer service at 1-800-247-5958, or Agility customer service at 1-888-686-7278. IMT's number for this recall is 16E-092.

17V-208

Ford Motor Company (Ford) is recalling certain 2014 Escape, 2014-2015 Fiesta ST, 2013-2014 Fusion and

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2017**

Published May 2, 2017

2013-2015 Transit Connect vehicles equipped with 1.6L GTDI engines. If the vehicle is started and driven with an insufficient level of coolant within the engine cooling system, the engine cylinder head may overheat, crack and leak oil. If the cylinder head cracks and leaks oil, the oil may contact a hot engine or exhaust component, increasing the risk of a fire. Ford will notify owners, and dealers will install a coolant level sensor and the supporting hardware and software, free of charge. Remedy parts are currently unavailable. Interim notices informing owners of the safety risk were mailed April 21, 2017. Owners will receive a second notice when remedy parts become available, currently expected to be in late-2017. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 17S09.

17V-209

Ford Motor Company (Ford) is recalling certain 2014 Ford Fiesta, 2013-2014 Ford Fusion and 2013-2014 Lincoln MKZ vehicles. A component within the door latches may break making the doors difficult to latch and/or leading the driver or a passenger to believe a door is securely closed when, in fact, it is not. A door that is not securely latched could open while the vehicle is in motion, increasing the risk of injury to a vehicle occupant. Ford will notify owners, and dealers will replace all four door latches, free of charge. The recall is expected to begin May 1, 2017. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 15S16.

17V-210

Great Dane Trailers (Great Dane) is recalling certain 2018 Everest SS refrigerated trailers. A plug for the front brake chamber service port may not have been properly tightened, possibly reducing the service brake pressure. A reduction of service brake pressure can lengthen the distance needed to stop the vehicle, increasing the risk of a crash. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Great Dane customer service at 1-912-232-4471.

17V-211

Ford Motor Company (Ford) is recalling certain 2017 Ford F-450 and F-550 Superduty vehicles. Operating the vehicle at highway speeds may cause the driveline to vibrate and fracture the driveline components or the transmission. If the driveline or transmission fractures, the vehicle may lose motive power, increasing the risk of a crash. Ford will notify owners, and dealers will replace the driveshaft and two center bearing brackets, free of charge. Remedy parts are currently unavailable. Interim notices informing owners of the safety risk were mailed on April 6, 2017. Owners will receive a second notice when remedy parts become available. Owners may contact Ford customer service at 1-866-436-7332. Ford recall number 17S08.

17V-212

Hyundai Motor America (Hyundai) is recalling certain 2017 Elantra vehicles. The Electronic Power Steering (EPS) connector may have been damaged during assembly, this can prevent connection to the electronic control unit, causing loss of power steering assist. If the EPS assist fails reverting to manual steering, it will require greater driver effort, which can increase the risk of a crash. Hyundai will notify owners, and dealer will replace the EPS motor, free of charge. The recall expected to begin April 28, 2017. Owners may contact Hyundai customer service at 1-800-633-5151. Hyundai number for this recall 161.

17V-213

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2017**

Published May 2, 2017

Schwarze Industries, Inc. (Schwarze) is recalling certain 2013-2017 A7 Tornado, A8 Twister, A9 Monsoon, and M6 Avalanche street sweepers. The air brake systems on these vehicles may have been manufactured with the wrong fittings, causing the brake lines to leak air, possibly resulting in the vehicle stopping unexpectedly. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 121, "Air Brake Systems." If the brakes apply and the vehicle stops unexpectedly, it can increase the risk of a crash. Schwarze will notify owners, and dealers will replace the incompatible air brake line fittings, free of charge. The recall began on April 13, 2017. Owners may contact Schwarze customer service at 1-800-879-7934.

17V-214

Daimler Trucks North America LLC (DTNA) is recalling certain 2015-2016 FCCC S2G trucks equipped with an 8.0L propane engine and an Allison transmission. The transmission grade brake on these trucks may not deactivate when the disable switch is depressed, which can cause a loss of traction in certain icy, or other slippery conditions, due to aggressive downshifting. If the transmission grade brake stays engaged, unknowingly to the operator, in low-traction conditions, it can increase the risk of a crash. DTNA will notify owners, and dealers will update the vehicle's programming, free of charge. The recall is expected to begin May 27, 2017. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-734.

17V-215

Subaru of America, Inc. (Subaru) is recalling certain 2017 Impreza vehicles. Winter fuels may vaporize prematurely in the fuel line, resulting in a reduction in fuel pressure, possibly causing the engine to stall. An engine stall can increase the risk of a crash. Subaru will notify owners, and dealers will reprogram the engine control unit to turn the radiator cooling fan on at a lower temperature, free of charge. The recall began on April 20, 2017. Owners may contact Subaru customer service at 1-800-782-2738. Subaru's number for this recall is WTP-75.

17V-216

Daimler Trucks North America LLC (DTNA) is recalling one model year 2016 Thomas Built Buses Saf-T-Liner C2 school bus equipped with an 8.0L propane engine and an Allison transmission. The transmission grade brake on this bus may not deactivate when the disable switch is depressed, which can cause a loss of traction in certain icy, or other slippery conditions, due to aggressive downshifting. If the transmission grade brake stays engaged, unknowingly to the operator, in low-traction conditions, it can increase the risk of a crash. DTNA will notify the owner, and a dealer will update the bus' programming, free of charge. The recall is expected to begin May 27, 2017. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-734.

17V-217

Forest River, Inc. (Forest River) is recalling certain 2017 Salem and Wildwood recreational vehicles. The Federal Placard on these vehicles incorrectly lists the Gross Axle Weight Rating capacity (GAWR) being 5,080 lbs, when the axles actually have a capacity of 4,400 lbs. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." The incorrect GAWR may result in the vehicle being overloaded, causing a loss of control and increasing the risk of a crash. Forest River will notify owners, and dealers will provide a new Federal Placard with the correct GAWR, free of charge. The recall is expected to

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2017**

Published May 2, 2017

begin May 29, 2017. Owners may contact Forest River customer service at 1-574-534-4058. Forest River's number for this recall is 27-03292017-0362.

17V-218

Honda (American Honda Motor Co.) is recalling certain 2016 Honda Pilot 2WD and AWD vehicles. The affected vehicles have fuel tanks that may leak. A fuel leak in the presence of an ignition source can increase the risk of a fire. Honda will notify owners, and dealers will replace the fuel tank, free of charge. Owners may contact Honda customer service at 1-888-234-2138. Honda's number for this recall is KE8.

17V-219

Honda (American Honda Motor Co.) is recalling certain 2003 Honda Accord Coupe vehicles, equipped with a four-cylinder engine. If the passenger frontal air bag module has been replaced, such as after a crash necessitating frontal air bag deployment, the replacement air bag module may include a Takata air bag inflator. These inflators may rupture due to propellant degradation occurring after long-term exposure to lower absolute humidity, temperature and temperature cycling. An inflator rupture may result in metal fragments striking the driver or other occupants resulting in serious injury or death. Honda will notify owners, and dealers will inspect the vehicle and replace any Takata inflator used in the passenger frontal air bag module, free of charge. The recall is expected to begin May 1, 2017. Owners may contact Honda customer service at 1-888-234-2138. Honda's number for this recall is KF0.

17V-220

Yamaha Motor Corporation, USA (Yamaha) is recalling certain 2015-2017 FJ-09, FZ-09, and XSR900 motorcycles. The lower handlebar holder may loosen due to a painting issue and the inadequate application of the thread-locking agent. If the handlebars are not properly secured to the motorcycle, a loss of vehicle control may result, increasing the risk of a crash. Yamaha will notify owners, and dealers will replace the lower handlebar holder, free of charge. The recall began April 13, 2017. Owners may contact Yamaha customer service at 1-800-962-7926. Yamaha's number for this recall is 990114.

17V-221

BMW of North America, LLC (BMW) is recalling certain 2016-2017 MINI Cooper Clubman, Cooper S Clubman and JCW Clubman vehicles. When the affected vehicles are braking and the turn signals are on, the inner, bumper-mounted, brake light will go out. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." If the brake light does not illuminate when a turn signal is activated, other drivers may be confused, increasing the risk of a crash. MINI will notify owners, and dealers will reprogram the vehicle to correct the brake lighting, free of charge. The recall is expected to begin May 22, 2017. Owners may contact MINI customer service at 1-866-825-1525.

17V-222

Kovatch Mobile Equipment Corp. (KME) is recalling certain 2013-2014 Predator SS Aerial, 2013-2016 Predator SS Pumper, 2014 Predator Aerial, Predator Pumper, and Predator Pumper TDA trucks. The ball joints on the independent front suspension (IFS) modules can loosen and separate, leading to a partial loss of

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2017**

Published May 2, 2017

steering. A separated ball joint can cause a loss of steering control, increasing the risk of a crash. KME will notify owners, and dealers will inspect, clean and secure the ball joint free of charge. The recall is expected to begin May 8, 2017. Owners may contact KME customer service at 1-570-669-5577.

17V-223

Kia Motor Company (Kia) is recalling certain 2011-2014 Optima, 2012-2014 Sorento and 2011-2013 Sportage vehicles. Machining errors during the engine manufacturing process may cause premature bearing wear within the engine. Bearing wear may result in the engine seizing, increasing the risk of a crash. Kia will notify owners, and dealers will inspect the engine assembly, replacing it necessary, free of charge. The recall is expected to begin May 25, 2017. Owners may contact Kia customer service at 1-800-333-4542. Kia's number for this recall is SC147.

17V-224

Ford Motor Company (Ford) is recalling certain 2017 Ford F-250 Super Duty trucks equipped with 6.2L engines and six-speed automatic transmissions. These transmissions may have a damaged park rod actuating plate that can result in unexpected vehicle movement even though the transmission has been shifted to 'Park.' As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 102, "Transmission Shift Lever Sequence/Starter Interlock/Transmission Braking Effect", and number 114, "Theft Protection." Unexpected vehicle movement such as a vehicle rollaway can increase the risk of a crash. Ford will notify owners, and dealers will inspect the park rod actuating plate and replace it, if necessary, free of charge. Remedy parts are currently unavailable. Interim notices informing owners of the safety risk were mailed on April 18, 2017. Owners will receive a second notice when remedy parts become available. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 17C06.

17V-225

Hyundai Motor America (Hyundai) is recalling certain 2013-2014 Sonata and Santa Fe Sport vehicles. Machining errors during the engine manufacturing process may cause premature bearing wear within the engine. Bearing wear may result in the engine seizing, increasing the risk of a crash. Hyundai will notify owners, and dealers will inspect the engine, replacing the engine short block, as necessary, free of charge. The recall is expected to begin May 19, 2017. Owners may contact Hyundai customer service at 1-800-633-5151. Hyundai's number for this recall is 162.

17V-226