

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2018**

Published April 27, 2018

CHILD SEATS:

None during March 2018.

EQUIPMENT:

RockyMounts, Inc. (RockyMounts) is recalling certain Split Rail 1.25" bicycle racks, part number 11300, MonoRail 2" bicycle racks, part number 10004, SplitRail 2" bicycle racks, part number 11400, and MonoRail 1.25" bicycle racks, part number 10003. The weld that attaches the hitch tube to the pivot bracket may crack and fail allowing the upper portion of the rack with the bicycles attached to separate from the vehicle. If a portion of the rack and the attached bicycles separate from the vehicle, they can become a road hazard, increasing the risk of a crash. RockyMounts will notify owners and will provide a new rack base, free of charge. The recall began on March 8, 2018. Owners may contact RockyMounts customer service at 1-303-402-0190.

18E-011

S&B Filters, Inc. (S&B Filters) is recalling certain Cold Air Intake Kits, part numbers 75-5085 and 75-5085D, sold for aftermarket installation on Ford Super Duty Powerstroke 6.7L diesel trucks. The battery tray, part number AL1298T-00, may not have the necessary hole to reattach the secondary battery ground wire if the truck is equipped with one. If the secondary battery grounding wire cannot be properly attached after installing the Cold Air Intake Kit, the fuse box may melt, increasing the risk of a fire. S&B Filters has notified owners and will replace the battery tray with a battery tray that can accommodate two ground wires, free of charge. The recall began on March 13, 2018. Owners may contact S&B Filters customer service at 1-909-947-0015, option 3.

18E-012

Norcold Inc. (Norcold) is recalling certain Norcold refrigerators, models N305, N305.3, N306 and N306.3, part number 635690. These refrigerators have gas valve port screws that may be missing or loose allowing propane to leak inside the passenger compartment when the refrigerator is used in gas mode. A propane leak in the presence of an ignition source can increase the risk of a fire. Norcold will notify the recreational vehicle manufacturers that purchased the affected refrigerators, and dealers for those manufacturers will inspect the gas valves, tightening them if necessary, free of charge. The recall began on March 29, 2018. Owners may contact Norcold customer service at 1-800-767-9101.

18E-013

American Technology Components, Inc. (ATC) is recalling certain 7-Way Wiring Harnesses used for the aftermarket installation of truck caps. The harnesses being recalled are Leer model numbers 201055, 138359, 202060 and 142672, and Tag model numbers 201056, 140259, 202061 and 142673. The wiring may overheat. If the wiring overheats, there is an increased risk of a fire. ATC will notify owners, and will replace the wiring harness, free of charge. The recall began on April 13, 2018. Owners may contact ATC customer service at 1-574-266-3172.

18E-014

Syntec Seating Solutions, LLC (Syntec) is recalling certain S3B Non-Restraint Wall Mounted Seats. The wall

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2018**

Published April 27, 2018

mounting bracket may crack, causing the seat to not remain secured in place in the event of a crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 222, "School Bus Passenger Seating and Crash Protection." In the event of a crash, if the seat does not remain secured to the wall, the occupant has an increased risk of an injury. Syntec will notify owners, and dealers will install an additional wall mounting bracket, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Syntec customer service at 1-336-862-7509. Syntec's number for this recall is NRB100.

18E-015

BMW of North America, LLC (BMW) is recalling certain Accessory Windscreens, sold for installation on various motorcycles. Specifically being recalled is Windscreen model number 8531917, sold for use on model year 2012-2018 F700GS motorcycles, Windscreen model number 8544629, sold for use on model year 2015-2018 R1200R motorcycles, Windscreen model number 8546224, sold for use on model year 2014-2018 S1000R motorcycles, Windscreen model number 8551929, sold for use on model year 2015-2018 S1000XR motorcycles, Windscreen model number 8554726, sold for use on model year 2013-2018 R1200GS motorcycles, Windscreen model number 8554727 sold for use on model year 2014-2018 R1200GS Adventure motorcycles, Windscreen model number 8556927, sold for use on model year 2015-2018 R1200RS motorcycles, Windscreen model number 8559548, sold for use on model year 2017-2018 R1200GS motorcycles and Windscreen model number 8561755, sold for use on model year 2012-2018 F800GS motorcycles. These windscreens have extra tinting on them that may reduce the rider's visibility. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 205, "Glazing Materials." The darker windscreen can inhibit the driver's visibility, increasing the risk of a crash. BMW will notify owners, and dealers will replace the windscreen, free of charge. The recall is expected to begin May 10, 2018. Owners may contact BMW customer service at 1-800-525-7417.

18E-016

Timoney Technology (Timoney) is recalling certain Mark 1 and Gen 2 Independent Front Suspensions (IFS). Inconsistent machining may result in fatigue cracks developing over time in the front axle spindles, causing failure of the spindle and the possible separation of a front wheel from the vehicle. If a wheel separates from the vehicle, it can increase the risk of a crash. Timoney will notify the vehicle manufacturers that purchased the affected suspensions, and those manufacturers will conduct recalls of their own with their dealers replacing the front axle spindle, free of charge. The recall is expected to begin April 2018.

18E-017

TIRES:

Les Schwab is recalling certain steel-belted radial truck tires that Les Schwab retreaded for their customers. The vulcanizing compound used during the retreading may not have been completely cured, resulting in incomplete adhesion of the tread to tire casing. The potentially affected retreaded tires were manufactured at Les Schwab's three retread facilities during calendar weeks 42 through 50 of 2017 and have the DOTR numbers: RDNJ4217RS - RDNJ5017RS, RNVK4417RS - RNVK5017RS and RCEE4217RS - RCEE5017RS. The

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2018**

Published April 27, 2018

incompletely cured vulcanizing compound can result in the tire tread separating from the tire casing, increasing the risk of a crash. Les Schwab will notify the customers that had their tires retreaded, and will exchange the affected tires for properly retreaded ones, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Les Schwab at 1-541-447-4136.

18T-002

VEHICLES:

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain 2018 Range Rover Velar vehicles. The air inlet door linkages for the ventilation system may detach, preventing the system from clearing fog or condensation from the windshield and windows. If condensation or fog cannot be cleared, the driver's visibility may be affected, increasing the risk of a crash. Land Rover will notify owners, and dealers will update the vehicle software to control the length of movement of the ventilation actuator arm, free of charge. The recall began on April 16, 2018. Owners may contact Land Rover customer service at 1-800-637-6837. Land Rover's number for this recall is N143.

18V-139

Jaguar Land Rover North America, LLC (Jaguar) is recalling certain 2018 Jaguar E-Pace vehicles. The brackets that secure the front brake hoses may not have been installed properly, allowing the front brake hoses to contact the tires, possibly resulting in a brake fluid leak. A brake fluid leak can lengthen the distance needed to stop the vehicle, increasing the risk of a crash. Jaguar will notify owners, and dealers will inspect the front brake hose brackets, replacing any that do not provide sufficient clearance, free of charge. The recall began on April 16, 2018. Owners may contact Jaguar customer service at 1-800-452-4827. Jaguar's number for this recall is H074.

18V-140

Ford Motor Company (Ford) is recalling certain 2017-2018 Ford Taurus vehicles equipped with mechanical key ignition systems. The keys for these vehicles may be able to be removed from the ignition when transmission is not in the PARK position. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 114, "Theft Protection." If the key is removed from the ignition while the vehicle is not in the PARK position and the parking brake is not applied, the vehicle may roll away, increasing the risk of a crash. Ford will notify owners, and dealers will replace the shifter assembly, free of charge. Ford issued interim notifications to owners on March 23, 2018. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 18C02.

18V-141

Coach House, Inc. (Coach House) is recalling certain 2003-2018 Platinum, 2008-2018 Platinum II, and 2010-2018 Arriva recreational vehicles, equipped with Kidde Plastic-Handle or Push Button 'Pindicator' Fire Extinguishers. These extinguishers may become clogged, preventing the extinguisher from discharging as expected or requiring excessive force to activate the extinguisher. Additionally, in certain models, the nozzle may detach from the valve assembly with enough force that it could cause injury and also render the product inoperable. For a full list of the affected fire extinguisher models visit:

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2018**

Published April 27, 2018

<https://static.nhtsa.gov/odi/rc1/2017/RMISC-17E062-5427.pdf> In the event of a fire, if the fire extinguisher does not function properly, it can increase the risk of injury. Coach House will notify owners instructing them to contact Kidde for a replacement fire extinguisher, free of charge. The recall began on April 11, 2018. Owners may contact Coach House customer service at 1-800-235-0984 or Kidde customer service at 1-855-262-3540 or online at www.kidde.com and click on "Product Safety Recall" for more information.

18V-142

Keystone RV Company (Keystone) is recalling certain 2018 Keystone Passport, Summerland and Hideout, Dutchmen Aspen Trail and Coleman, and Crossroads Zinger recreational trailers. These vehicles are equipped with Norcold N306 mini refrigerators that may have a loose or missing propane gas valve test port screw. The loose or missing propane gas port screw can allow propane gas to leak when the refrigerator is used in 'gas' mode, increasing the risk of a fire. Keystone will notify owners, and dealers will install and tighten the gas valve port screw, as necessary, free of charge. The recall began on April 23, 2018. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 18-315.

18V-143

Newmar Corporation (Newmar) is recalling certain 2018 Essex motorhomes. The taillights on these vehicles may loosen and detach from the vehicle while driving. If the taillights detach, the driver will not be able to communicate his driving intentions, increasing the risk of a crash. Newmar will notify owners, and dealers will secure the taillights with new hardware, free of charge. The recall began on March 23, 2018. Owners may contact Newmar customer service at 1-800-731-8300.

18V-144

Morgan Truck Bodies LLC (Morgan) is recalling all 2013-2018 Morgan Truck Bodies built on Isuzu, Kenworth, Mercedes, Chevrolet, GM, Freightliner, Mitsubishi and Peterbilt chassis. Water may enter part of the wiring harness and affect the turn signal operation. Incorrect turn signal operation may increase the risk of a crash. Morgan will notify owners, and dealers will replace or modify the affected wiring harness, free of charge. The recall began on March 21, 2018. Owners may contact Morgan customer service at 1-800-666-7426. Morgan's numbers for this recall are FRWI-517 and FRWI-518.

18V-145

Triple E Recreational Vehicles (Triple E) is recalling certain 2017-2018 Unity, Wonder, and Serenity motorhomes. The Occupant & Cargo Carrying Capacity (OCCC) and Tire labels may have been incorrectly calculated, resulting in an indicated a higher cargo capacity than actual. The incorrect label can result in the vehicle being overloaded, increasing the risk of a crash. Triple E will notify owners, and dealers will install new OCCC and Tire labels, free of charge. The recall began on March 22, 2018. Owners may contact Triple E customer service at 1-877-992-9906. Triple E's number for this recall is CA#8930-1.

18V-146

Chrysler (FCA US LLC) is recalling certain 2018 Alfa Romeo Stelvio vehicles. The software for the wiper motor may incorrectly interpret the wiper motor as overheating, limiting the windshield wipers to operating only at the low-speed setting. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2018**

Published April 27, 2018

Safety Standard (FMVSS) number 104, "Windshield Wiping and Washing Systems." Limited wiper function can reduce the driver's visibility, increasing the risk of a crash. Chrysler will notify owners, and dealers will replace the wiper motor, free of charge. The recall began on April 25, 2018. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is U24.

18V-147

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2009-2014 Volkswagen CC, 2010-2014 Golf, 2010-2011 Eos, 2007-2010 Passat Sedan, and 2007-2010 Passat Wagon vehicles. Upon deployment of the driver's frontal air bag, excessive internal pressure may cause the inflator to explode. In the event of a crash necessitating deployment of the driver's frontal air bag, the inflator could explode with metal fragments striking the vehicle occupants potentially resulting in serious injury or death. Volkswagen will notify owners, and dealers will replace the driver's frontal air bag inflator with an alternative inflator, free of charge. The recall began March 16, 2018. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's number for this recall is 69Q9. Note: This recall partially supersedes recall 16V-078.

18V-148

Chrysler (FCA US LLC) is recalling certain 2018 RAM ProMaster City vehicles. The gears within the hydraulic rack and pinion steering system may have a casting defect that can cause a crack and a loss of hydraulic steering fluid. A hydraulic steering fluid leak may require additional sudden steering effort, increasing the risk of a crash. Chrysler will notify owners, and dealers will inspect the steering gear housing, replacing any affected rack-and-pinion assembly, free of charge. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is U23.

18V-149

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain 2018 Mercedes Benz C43 AMG, C63S AMG, E63 S AMG Sedan, and E63S AMG Stationwagon vehicles fitted with AMG performance seats. The backrest rail and backrest fitting may not be properly welded on the driver and front passenger seats. The incorrect welding may result in the seats failing in the event of a crash, increasing the risk of injury. MBUSA will notify owners, and dealers will inspect the welds of the backrest frames, replacing the backrests as necessary, free of charge. The recall is expected to begin May 4, 2018. Owners may contact MBUSA customer service at 1-800-367-6372.

18V-150

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain 2017 E300 4Matic, E300, and E43 AMG vehicles fitted with LED headlights. These vehicles may have misadjusted headlights, possibly resulting in the low beam headlights insufficiently illuminating the roadway. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." An insufficiently illuminated roadway may increase the risk of a crash. MBUSA will notify owners, and dealers will inspect the headlamp adjustment, adjusting it as necessary, free of charge. The recall began on April 3, 2018. Owners may contact MBUSA customer service at 1-800-367-6372.

18V-151

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2018**

Published April 27, 2018

Mack Trucks, Inc. (Mack) is recalling certain 2018 Anthem (AN), Granite (GU), and Pinnacle (CXU, PI) trucks. An electrical overload condition may cause the light control module (LCM) to fail, resulting in the loss of the exterior lighting, interior dashboard lighting, and the windshield wipers. Loss of lighting or windshield wiper function can increase the risk of a crash. Mack will notify owners, and dealers will replace and reprogram the LCM, free of charge. The recall began on March 23, 2018. Owners may contact Mack customer service at 1-800-866-1177. Mack's number for this recall is SC0409.

18V-152

Nissan North America, Inc. (Nissan) is recalling certain 2018 Nissan 370Z vehicles. The driver's side curtain air bag may have been installed incorrectly during production, possibly affecting its deployment. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 214, "Side Impact Protection," and 226, "Ejection Mitigation." The incorrect curtain air bag installation can prevent the air bag from deploying correctly in the event of a crash, increasing the risk of injury. Nissan will notify owners, and dealers will inspect the curtain air bag, correcting its installation as necessary, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Nissan customer service at 1-800-867-7669.

18V-153

BMW of North America, LLC (BMW) is recalling certain 2018 BMW X3 xDrive30i and X3 M40i vehicles. The rear spoiler may not have been properly attached during assembly, or may be missing screws, possibly causing the spoiler to detach while driving. If the spoiler detaches while driving, it can become a road hazard, increasing the risk of a crash. BMW will notify owners, and dealers will inspect the spoiler, correcting its attachment as necessary, free of charge. The recall is expected to begin May 1, 2018. Owners may contact BMW customer service at 1-800-525-7417.

18V-154

New Flyer of America Inc. (New Flyer) is recalling certain 2016-2018 XDE40 and XDE60 and 2017 XDE35 Heavy Duty Urban Transit buses. The plastic end-caps of the drive shaft slip yoke may crack and fail. Failure of the drive shaft end-caps would result in a loss of drive power, increasing the risk of a crash. New Flyer will notify owners, and dealers will inspect the drive shaft slip yoke, replacing any drive shaft that has plastic end-caps on the slip yoke, free of charge. The recall began on March 22, 2018. Owners may contact New Flyer customer service at 1-204-224-6706. New Flyer's number for this recall is R18-002.

18V-155

Nissan North America, Inc. (Nissan) is recalling certain 2011-2012 Nissan Juke vehicles previously remedied under recall 12V-069. During that recall remedy, the fuel pressure sensor may not have been properly tightened, potentially causing the sensor to loosen and leak fuel. A fuel leak in the presence of an ignition source can increase the risk of a fire. Nissan will notify owners, and dealers will tighten the fuel pressure sensor to the proper torque, free of charge. The recall began on April 24, 2018. Owners may contact Nissan customer service at 1-800-867-7669.

18V-156

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2018**

Published April 27, 2018

Daimler Trucks North America LLC (DTNA) is recalling certain 2007-2018 Thomas Built Buses Minotour school buses built on GM chassis and equipped with wheelchair lifts. The wheelchair lift may be operated while the vehicle is in Neutral or Drive. If the wheelchair lift can be operated when the vehicle is not in Park, there is increased risk of injury to the lift user. DTNA will notify owners, and dealers will inspect the wheelchair lift, correcting the electrical connections as necessary, free of charge. The recall is expected to begin May 2018. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-761.

18V-157

Daimler Trucks North America LLC (DTNA) is recalling certain 2007-2018 Thomas Built Buses Minotour transit buses built on GM chassis and equipped with wheelchair lifts. The wheelchair lift may be operated while the vehicle is in Neutral or Drive. If the wheelchair lift can be operated when the vehicle is not in Park, there is increased risk of injury to the lift user. DTNA will notify owners, and dealers will inspect the wheelchair lift, correcting the electrical connections as necessary, free of charge. The recall is expected to begin May 2018. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-761.

18V-158

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2018 Tiguan long wheel base (LWB) vehicles. The engine support bolts on these vehicles may not have been properly tightened. If the engine support bolts were not properly tightened, an unexpected engine breakdown or loss of engine power may occur, increasing the risk of a crash. Volkswagen will notify owners, and dealers will replace engine support bolts, free of charge. The recall began March 26, 2018. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's number for this recall is 10F7.

18V-159

Chrysler (FCA US LLC) is recalling certain 2009-2012 Dodge Ram 1500 trucks currently, or ever registered, in Connecticut, Delaware, Illinois, Indiana, Iowa, Maine, Maryland, Massachusetts, Michigan, Minnesota, Missouri, New Hampshire, New Jersey, New York, Ohio, Pennsylvania, Rhode Island, Vermont, West Virginia, Wisconsin and the District of Columbia. Exposure to environmental conditions such as water mixed with road salt may cause the front fuel tank strap frame "T-Slot" bracket to corrode, possibly causing the fuel tank to drop and make contact with the ground. If the fuel tank were to drop and contact the ground, a fuel leak may result. Additionally, in the event of a crash, the fuel tank may not remain secured to the vehicle, possibly causing a fuel leak. A fuel leak in the presence in an ignition source, can increase the risk of a fire. Chrysler will notify owners and dealers will bolt a bracket reinforcement to the frame, free of charge. Interim notices informing owners of the safety risk were mailed beginning April 16, 2018. Owners will receive a second notice when remedy parts become available. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is U04.

18V-160

Kia Motors America (Kia) is recalling certain 2017-2018 Kia Optima hybrid vehicles. These vehicles are equipped with a Voltage Protection Device (VPD), designed to protect the high voltage battery module, that may

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2018**

Published April 27, 2018

activate inadvertently. If the VPD activates while the vehicle is being operated in Electric Vehicle (EV) mode, there may be a loss of power, increasing the risk of a crash. Kia will notify owners, and dealers will remove the VPD switch and install two newly designed Battery Management Systems (BMS) that contain Overvoltage Protection Devices (OPDs), free of charge. The recall is expected to begin May 2018. Owners may contact Kia customer service at 1-800-333-4542. Kia's number for this recall is SC162.

18V-161

Forest River, Inc. (Forest River) is recalling certain 2018 Stealth Evo recreational trailers, model SJT2850-CA. The Federal Placard on these vehicles indicate a tire size of ST205/75R15 Load Range E, when the tires installed on the vehicle are ST225/75R15 Load Range E. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims," and the vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." If the placard indicates the wrong tire information, the owner could install incorrect replacement tires, resulting in premature tire wear or failure, increasing the risk of a crash. Forest River has notified owners, and dealers will install a corrected federal placard with correct tire and rim information, free of charge. The recall began on March 15, 2018. Owners may contact Forest River customer service at 1-909-873-3777. Forest River's number for this recall is 19-0661.

18V-162

Daimler Trucks North America, LLC (DTNA) is recalling certain model year 2011-2017 Freightliner Custom Chassis Corporation (FCCC) XBR, XCL, XCM, and XCR recreational vehicle chassis, equipped with Cummins ISL engines. The power steering hose on the affected vehicles may be routed incorrectly, and, as a result, the hose may rub against the power stud on the starter motor, possibly causing electrical arcing and a power steering fluid leak. Electrical arcing in the presence of leaking power steering fluid can increase the risk of a fire. DTNA will notify owners, and dealers will reroute the power steering hose to provide proper clearance, free of charge. The recall is expected to begin on May 2018. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-762. Note: This recall is an expansion of 16V-809.

18V-163

Ferrari North America, Inc. (Ferrari) is recalling certain 2016 488 GTB and 488 Spider vehicles. Due to a software error, the driver may not be warned that the brake discs are critically worn. If the driver is not warned about the critical disc wear, brake disc damage may result, increasing the risk of a crash. Ferrari will notify owners, and dealers will update the instrument panel node software, free of charge. Owners may contact Ferrari customer service at 1-201-816-2668. Ferrari's number for this recall is 64.

18V-164

Autocar, LLC (Autocar) is recalling certain 2014-2018 Xpeditor vehicles equipped with a factory installed methane detection system. The circuit protection for the methane detector may be inadequate, and the harness may be improperly routed. In the event that the wiring harness carries excessive current, the harness may overheat, increasing the risk of a fire. Autocar will notify owners, and dealers will replace the ten amp fuse with a three amp fuse, free of charge. The recall began on April 13, 2018. Owners may contact Autocar customer service at 1-888-218-3611 or 1-877-973-3486. Autocar's number for this recall is ACX-1801.

18V-165

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2018**

Published April 27, 2018

Hyundai Motor America (Hyundai) is recalling certain 2016-2018 Hyundai Sonata Plug-In Hybrid vehicles. These vehicles are equipped with a Voltage Protection Device (VPD), designed to protect the high voltage battery module, that may activate inadvertently. If the VPD activates while the vehicle is being operated in Electric Vehicle (EV) mode, there may be a loss of power, increasing the risk of a crash. Hyundai will notify owners, and dealers will remove the VPD switch and install a new Battery Management System (BMS) that contains an Overvoltage Protection Device (OPD). The recall is expected to begin May 2018. Owners may contact Hyundai customer service at 1-855-371-9460. Hyundai's number for this recall is 175.

18V-166

Ford Motor Company (Ford) is recalling certain 2014-2018 Lincoln MKZ and Ford Fusion vehicles. The steering wheel retaining bolt may loosen allowing the steering wheel to detach while driving. A steering wheel detachment can cause a loss of steering control, increasing the risk of a crash. Ford will notify owners, and dealers will replace the steering wheel bolt with a longer bolt, free of charge. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 18S08.

18V-167

Supreme Corporation (Supreme) is recalling certain 2003-2018 Supreme Signature Van, Iner-City, Kold King, and Service Body trucks, equipped with Kidde Plastic-Handle or Push Button 'Pindicator' Fire Extinguishers. These extinguishers may become clogged, preventing the extinguisher from discharging as expected or requiring excessive force to activate the extinguisher. Additionally, in certain models, the nozzle may detach from the valve assembly with enough force that it could cause injury and also render the product inoperable. For a full list of the affected fire extinguisher models visit: <https://static.nhtsa.gov/odi/rcl/2017/RMISC-17E062-5427.pdf> In the event of a fire, if the fire extinguisher does not function properly, it can increase the risk of injury. Supreme will notify owners, instructing them to contact Kidde to get a replacement fire extinguisher, free of charge. Owners may contact Supreme customer service at 1-800-352-4921 or Kidde customer service at 1-855-262-3540 or they may also visit www.kidde.com and click on "Product Safety Recall" for more information.

18V-168

Ford Motor Company (Ford) is recalling certain 2013-2014 Ford Fusion vehicles equipped with a 1.6L GTDI engine and 6-speed manual transmission and 2015-2016 Ford Focus vehicles equipped with a 1.0L GTDI engine and 6-speed manual transmission. Also included are four 2017 Ford Focus vehicles that had clutch replacements with potentially affected parts. The clutch may fracture, resulting in damage to the transmission assembly and possibly a transmission fluid leak. A transmission fluid leak in the presence of an ignition source such as hot engine or exhaust components can increase the risk of a fire. Ford will notify owners, and dealers will update the Focus vehicles with software that detects and prevents prolonged clutch slip, and will replace the clutch, as necessary, free of charge. Owners of Fusion vehicles will have their clutch assembly replaced free of charge. Parts are not currently available. Owners will be notified of the recall with an interim notification beginning March 26, 2018. A second letter will be mailed when the remedy is available, currently expected to be in the second quarter of 2018. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 18S07.

18V-169

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2018**

Published April 27, 2018

Honda (American Honda Motor Co.) is recalling certain 2014-2016 Honda Odyssey vehicles. The second row outboard seats have a lever to fold the seatback and slide the seat forward to access the third row seats. Due to a manufacturing error, if the walk-in release lever is used to fold a fully reclined left outboard seatback forward, the seatback may stay in the unlocked position (free-folding) or unexpectedly unlock without engaging the walk-in or recliner lever. An unlocked second row left outboard seatback increases the risk of injury to the seat occupant during a crash. Honda will notify owners, and dealers will confirm proper operation of the second row left outboard seatback, and install a support bracket to the seat recliner. If the seatback cannot lock, dealers will replace the seatback frame assembly. These repairs will be performed free of charge. Owners may contact Honda customer service at 1-888-234-2138. Honda's number for this recall is XOR.

18V-170

E-One Incorporated (E-One) is recalling certain 2008-2015 E-One Typhoon, Cyclone II, and Quest II vehicles, equipped with Timoney Independent Front Suspensions. Inconsistent machining may result in fatigue cracks developing over time in the front axle spindles, causing failure of the spindle and the possible separation of a front wheel from the vehicle. A wheel separation from the vehicle can increase the risk of a crash. E-One will notify owners, and dealers will replace the front axle spindle, free of charge. The recall began on April 24, 2018. Owners may contact E-One customer service at 1-352-861-3612.

18V-171

Kovatch Mobile Equipment Corp. (KME) is recalling certain 2007-2012 KME Predator Pumper, 2013 Predator SS Aerial, 2007 Predator Aerial, 2008-2011 Predator Rescue, and 2007 Predator Tanker vehicles, equipped with Timoney Independent Front Suspensions. Inconsistent machining may result in fatigue cracks developing over time in the front axle spindles, causing failure of the spindle and the possible separation of a front wheel from the vehicle. A wheel separation from the vehicle can increase the risk of a crash. KME will notify owners, and dealers will replace the front axle spindle, free of charge. Owners may contact KME customer service at 1-800-235-3928.

18V-172

Maserati North America, Inc. (Maserati) is recalling certain 2017 Quattroporte vehicles equipped with V6 engines and Maserati Ghibli vehicles. Due to an engine software problem, at slow speeds such as stop-and-go traffic, the transmission may unexpectedly shift into neutral or park, or the engine may shut off. If the transmission shifts into neutral or park unexpectedly, or if the engine shuts down without warning, it can increase the risk of a crash. Maserati will notify owners, and dealers will re-flash the software for the engine control module, free of charge. The recall is expected to begin May 2018. Owners may contact Maserati customer service at 1-877-696-2737. Maserati's number for this recall is 365.

18V-173

Ferrara Fire Apparatus, Inc. (Ferrara) is recalling certain 2004-2012 Inferno and Igniter emergency vehicles, equipped with Timoney Independent Front Suspensions. Inconsistent machining may result in fatigue cracks developing over time in the front axle spindles, causing failure of the spindle and the possible separation of a front wheel from the vehicle. A wheel separation from the vehicle can increase the risk of a crash. Ferrara will notify owners, and dealers will replace the front axle spindle, free of charge. Owners may contact Ferrara customer

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2018**

Published April 27, 2018

service at 1-800-443-9006.

18V-174

Pagani Automobili SpA (Pagani) is recalling all 2017 Huayra Coupe BC and Huayra Roadster vehicles. The battery management software may prevent the battery from providing enough power to start the car or keep the car running at idle. An engine stall can increase the risk of a crash. Pagani will notify owners, and dealers will replace the battery with a new one that has new battery management software, free of charge. The recall began on April 5, 2018. Owners may contact Pagani customer service at 1-415-350-7220.

18V-175

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain 2018 Toyota Prius C vehicles sold in Puerto Rico. The front passenger air bag and recommended child occupant seating positions label may not have been attached during assembly. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 208, "Occupant Crash Protection." If the label is missing, occupants may not follow the proper restraint usage guidelines, increasing the risk of injury in the event of a crash. Toyota will notify owners and will mail the removable labels to all known owners of the subject vehicles, free of charge. The recall began on April 11, 2018. Owners may contact Toyota customer service at 1-888-270-9371. Toyota's number for this recall is JOL.

18V-176

Mercedes Benz USA LLC (MBUSA) is recalling certain 2017-2018 GLC43 AMG, 2016-2018 GLC300 4Matic, 2016-2018 GLC300, 2018 GLC63 AMG 4Matic, and 2018 GLC350e 4Matic vehicles. The seat belt latch plates (the parts that insert into the buckles) for the outboard rear seats may retract into the interior paneling, preventing the occupants from being able to use the seat belts. If the rear seat passengers cannot fasten their seat belts, they have an increased risk of injury in the event of a crash. MBUSA will notify owners, and dealers will install a buffer to the c-pillar paneling, free of charge. The recall is expected to begin May 14, 2018. Owners may contact MBUSA customer service at 1-800-367-6372.

18V-177

Hino Motor Sales U.S.A., Inc. (Hino) is recalling certain 2018-2019 NE8J, NJ8J, and NV8J trucks. The engine valve train adjustment screw lock nuts may not have been properly tightened manufacturing, possibly resulting in them coming loose within the engine and damaging it. The damage to the engine may result in it shutting off and increasing the risk of a crash. Hino will notify owners, and dealers will inspect the torque on the valve train adjustment screw lock nuts. If a nut is found missing, the engine will be replaced, free of charge. Owners may contact Hino customer service at 1-248-699-9390. Hino's number for this recall is AA9Q0.

18V-178

Forest River, Inc. (Forest River) is recalling certain 2016-2017 Forest River Berkshire, 2012-2017 Forest River Charleston, 2013-2015 Coachmen Cross Country and Pathfinder, and 2014-2015 Glaval Synergy motorhomes built on Freightliner Custom Chassis Corporation (FCCC) chassis. The power steering hose on the affected vehicles may be routed incorrectly, and, as a result, the hose may rub against the power stud on the starter motor, possibly causing electrical arcing and a power steering fluid leak. Electrical arcing in the presence of

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2018**

Published April 27, 2018

leaking power steering fluid can increase the risk of a fire. Forest River will notify owners, and Freightliner dealers will reroute the power steering hose to provide proper clearance, free of charge. The recall began on April 13, 2018. Owners may contact DTNA customer service at 1-800-547-0712, Forest River customer service at 1-574-295-2117, Coachmen customer service at 1-574-825-8212, or Glaval customer service at 1-574-343-5167. Forest River's number for this recall is 51-0665.

18V-179

Forest River, Inc. (Forest River) is recalling certain 2018 No Boundaries recreational trailers, models NBT10.5 and NBT10.6. The spare tire mount may not be strong enough and the spare tire may detach from the trailer. If the spare tire detaches from the vehicle, it may become a road hazard, increasing the risk of a crash. Forest River will notify owners, and dealers will replace the spare tire mount, free of charge. The recall is expected to begin May 15, 2018. Owners may contact Forest River customer service at 1-574-642-1612. Forest River's number for this recall is 77-0662.

18V-180

Entegra Coach (Entegra) is recalling certain 2011-2012 and 2015-2016 Aspire built on Freightliner Custom Chassis Corporation (FCCC) chassis. The power steering hose on the affected vehicles may be routed incorrectly, and, as a result, the hose may rub against the power stud on the starter motor, possibly causing electrical arcing and a power steering fluid leak. Electrical arcing in the presence of leaking power steering fluid can increase the risk of a fire. Entegra will notify owners, and Freightliner dealers will reroute the power steering hose to provide proper clearance, free of charge. The recall is expected to begin May 7, 2018. Owners may contact Entegra customer service at 1-800-517-9137.

18V-181

Conel, LLC dba McElrath Trailers (McElrath Trailers) is recalling certain 2013-2018 818I, 2017-2018 VX50-800, VX30-800, VX50-800LT, and VX30-800LT trailers. A weld on the trailer neck may fail. Failure of this weld in the neck portion of the trailer could result in instability of the trailer causing a loss of control, increasing the risk of a crash. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact McElrath Trailers customer service at 1-864-814-2220.

18V-182

REV Recreation Group (REV) is recalling certain 2018 American Coach American Dream and American Revolution motorhomes, Fleetwood Discovery, Discovery LXE, Pace Arrow and Pace Arrow LXE motorhomes, Holiday Rambler Endeavor, Endeavor XE, Navigator and Navigator XE motorhomes and Monaco Marquis and Signature motorhomes equipped with an Aurora heating, ventilation and air conditioning (HVAC) system. The wires for the HVAC system potentiometer may become disconnected from the quick connect terminals. If the potentiometer wires detach and are reconnected incorrectly, there is an increased risk of a fire. REV will notify owners, and dealers will inspect the potentiometer and solder the wires or replace the control panel, if necessary, free of charge. The recall is expected to begin May 14, 2018. Owners may contact REV customer service at 1-800-509-3417. REV's number for this recall is 180315REV.

18V-183

SAFETY DEFECT/NONCOMPLIANCE NOTICES RECEIVED DURING MARCH 2018

Published April 27, 2018

Maxx Trailers Mfg, Inc. (MaxxD) is recalling certain 2017-2018 A3X, A5X, and A6X trailers. The suspension arms on these vehicles may crack if they were installed without additional supporting welds around the suspension arm. If the suspension arm cracks, the trailer will not be able to handle the load, making the trailer inoperable. Additionally, the axle may come loose during travel, increasing the risk of a crash. MaxxD will notify owners, and dealers will inspect the suspension arm and either add additional welds, or replace the suspension arm, free of charge. Owners may contact MaxxD customer service at 1-903-784-8059.

18V-184

Forest River, Inc. (Forest River) is recalling certain 2018 Surveyor recreational trailers, models SVT248BHLE and SVT248BHLE-OR. The refrigerator in the slideroom may have been installed without an air cycling fan to cool the refrigerator parts, which can cause the refrigerator cooling tubes to fail. If the refrigerator overheats, the cooling tubes may fail, increasing the risk of a fire. Forest River will notify owners, and dealers will install a fan assembly, free of charge. The recall began on April 9, 2018. Owners may contact Forest River customer service at 1-573-642-3119. Forest River's number for this recall is 3747-0667.

18V-185

Forest River, Inc. (Forest River) is recalling certain 2017-2018 Forest River Cherokee recreational trailers, models CCKT16BF, CCKT16BHS, CCKT16FQ, CCKT16GR, CCKT16GRH, CCKT17RP and CCKT18TO. These vehicles are equipped with Norcold N306 mini refrigerators that may have a loose or missing propane gas valve test port screw, allowing propane to leak out when the refrigerator is used in 'gas' mode. A propane leak increases the risk of a fire. Forest River will notify owners, and Norcold dealers will install and tighten the gas valve port screw, as necessary, free of charge. The recall began on April 19, 2018. Owners may contact Forest River customer service at 1-260-499-2100, or Norcold customer service at 1-800-543-1219. Forest River's number for this recall is 51-0687.

18V-186

Keystone RV Company (Keystone) is recalling certain 2018 Passport recreational trailers, models 153ML, 171EXP, 175BH, 195RB, 199ML, 217EXP and 239ML. The spare tire carrier may not have been mounted properly to the back wall of the trailer, and, as a result, the spare tire and carrier may detach from the trailer. If the spare tire and carrier detaches from the trailer while it is being towed, it can increase the risk of a crash. Keystone will notify owners, and dealers will inspect the spare tire carrier mounting and install reinforcing backers if necessary, free of charge. The recall is expected to begin May 22, 2018. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 18-311.

18V-187

Ferrari North America, Inc. (Ferrari) is recalling certain 2009-2011 Ferrari California, and 2010-2011 Ferrari 458 Italia vehicles that have not had their passenger frontal air bag replaced. These passenger frontal air bag modules have air bag inflators that may explode in the event of a crash due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator explosion may result in metal fragments striking the vehicle occupants resulting in serious injury or death. Ferrari will notify owners, and dealers will replace the passenger frontal air bag assembly with one that uses an alternate inflator, free of charge. Owners may contact Ferrari customer service at 1-201-816-2668. Ferrari's number for this recall is 60A.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2018**

Published April 27, 2018

Note: This recall supersedes recall 16V-341.

18V-188

Columbia Northwest, Inc. (Columbia Northwest) is recalling certain 2013-2018 Somerset E3 recreational trailers. The Certification Labels on these vehicles may be missing the Gross Axle Weight Rating (GAWR) information. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selections and Rims," and the vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." If the GAWR information is missing, the users may unknowingly overload the trailer, increasing the risk of a crash. Columbia Northwest will notify owners and send them a corrected certification label, free of charge. The recall is expected to begin May 2018. Owners may contact Columbia Northwest customer service at 1-724-237-5227.

18V-189

Daimler Trucks North America LLC (DTNA) is recalling certain 2014-2019 Thomas Built Buses Saf-T-Liner C2 school buses equipped with propane engines. The propane fuel line may contact the j-hook body support bracket that could cause chafing resulting in a propane leak. A propane leak in the presence of an ignition source can increase the risk of a fire. DTNA will notify owners, and dealers will inspect the propane line clearance and reroute the line if needed. Any damaged lines will be replaced. These repairs will be performed free of charge. The recall is expected to begin May 21, 2018. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-765.

18V-190

Daimler Trucks North America LLC (DTNA) is recalling certain 2017-2019 Western Star 4700, 4900, 5700, and 6900 trucks. The affected trucks have a power stud that passes through the bulkhead. In certain circumstances the power stud may contact the bulkhead and result in an electrical arc. An electrical arc can increase the risk of a fire. DTNA will notify owners, and dealers will inspect the power stud for the proper clearance to the bulkhead, and replace it if necessary, free of charge. The recall is expected to begin May 21, 2018. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-766.

18V-191

Daimler Trucks North America LLC (DTNA) is recalling certain 2014-2018 Thomas Built Buses Saf-T-Liner C2, Saf-T-Liner HDX, Saf-T-Liner EFX, and Minotour school buses, equipped with certain Syntec-brand S3B, Non-Restraint, Wall Mounted Seats. The wall mounting bracket may crack, causing the seat to not remain secured in place in the event of a crash. In the event of a crash, if the seat does not remain secured to the wall, the occupant has an increased risk of an injury. DTNA will notify owners, and dealers will install an additional wall mounting bracket, free of charge. The recall is expected to begin May 21, 2018. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-763.

18V-192

Daimler Trucks North America LLC (DTNA) is recalling certain 2014-2018 Thomas Built Buses Saf-T-Liner C2, Saf-T-Liner HDX, Saf-T-Liner EFX, and Minotour transit buses, equipped with certain Syntec-brand S3B,

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2018**

Published April 27, 2018

Non-Restraint, Wall Mounted Seats. The

wall mounting bracket may crack, which may cause the seat to not remain secured in place in the event of a crash. In the event of a crash, if the seat does not remain secured to the wall, the occupant has an increased risk of an injury. DTNA will notify owners, and dealers will install an additional wall mounting bracket, free of charge. The recall is expected to begin May 21, 2018. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-763.

18V-193

Daimler Trucks North America LLC (DTNA) is recalling certain 2018-2019 Freightliner Custom Chassis (FCCC) XCS motorhome chassis equipped with wheels that have Freightliner-logo shaped holes. These wheels have a valve stem stabilizer that may dislodge and damage the valve stem. Valve stem damage can result in loss of air pressure in the inner tire, causing an overload of the outer tire and increasing the risk of a crash. DTNA will notify owners, and dealers will inspect the inner wheel valve stem stabilizer and replace it if necessary, free of charge. The recall is expected to begin May 21, 2018. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-764.

18V-194

Polaris Industries, Inc. (Polaris) is recalling all 2015-2018 Polaris Slingshot motorcycles. The driver-seat and passenger-seat seat belt and seat back anchoring bracket may have been improperly welded. Additionally, differences in the seat assembly may prevent proper latching of the seat slider, allowing the driver's seat to move unexpectedly. If the seat belt buckle or seat back detach from the seat base, there would be an increased risk of injury in the event of a crash. If the driver's seat unexpectedly moves, it can cause the driver to lose control of the motorcycle, increasing the risk of a crash. Polaris will notify owners, and dealers will inspect the seat belt bracket and seat back welds, and the seat slider latching function. If the weld is missing or incomplete, or if the slider doesn't latch properly, the seat bases will be replaced, free of charge. The recall began on April 16, 2018. Owners may contact Polaris customer service at 1-855-863-2284. Polaris' number for this recall is T-18-01.

18V-195

Winnebago Industries, Inc (Winnebago) is recalling certain 2018-2019 Winnebago Intent motorhomes. The top mounting screws for the exterior rearview mirrors may not be installed correctly, possibly resulting in the mirrors falling off while driving. If the mirrors fall off while driving, it can increase the risk of a crash. Winnebago will notify owners, and dealers will check the location of the mirror and remove and reinstall it to the correct location, as necessary, free of charge. Owners may contact Winnebago customer service at 1-641-585-6939 or 1-800-537-1885. Winnebago's number for this recall is 149.

18V-196

Lazy Daze, Inc. (Lazy Daze) is recalling certain 2012-2017 24' Twin King (24TK), 24' Front Lounge (24FL), 24' Front Dinette (24FD), 27' Mid-Bath (27MB), 27' Rear Bath (27RB), 27' Rear Kitchen (27RK), 31' Island Bed (31IB), and 31' Twin Bed (31TB) motorhomes equipped with certain Plastic-Handle Fire Extinguishers or Push Button 'Pindicator' Fire Extinguishers. These extinguishers may become clogged, preventing the extinguisher from discharging as expected or requiring excessive force to activate the extinguisher. Additionally, in certain models, the nozzle may detach from the valve assembly with enough force that it could cause injury and

SAFETY DEFECT/NONCOMPLIANCE NOTICES RECEIVED DURING MARCH 2018

Published April 27, 2018

also render the product inoperable. For a full list of the affected fire extinguisher models visit: <https://static.nhtsa.gov/odi/rc1/2017/RMISC-17E062-5427.pdf> In the event of a fire, if the fire extinguisher does not function properly, it can increase the risk of injury. Lazy Daze will notify owners, instructing them to contact Kidde to get a replacement fire extinguisher, free of charge. Owners may contact Lazy Daze customer service at 1-909-627-1103 or Kidde customer service at 1-855-271-0773 or they may also visit www.kidde.com and click on "Product Safety Recall" for more information.

18V-197

Newmar Corporation (Newmar) is recalling certain 2014-2017 Newmar Ventana, 2011-2017 Newmar Dutch Star, and 2011-2014 Newmar Mountain Aire vehicles, built on Freightliner XBR chassis and equipped with Cummins ISL engines. The power steering hose on the affected vehicles may be routed incorrectly, and, as a result, the hose may rub against the power stud on the starter motor, possibly causing electrical arcing and a power steering fluid leak. If the power steering hose contacts the power stud causing a power steering fluid leak, additional steering effort may be needed increasing the risk of a crash or an electrical arc may occur, increasing the risk of a fire. Newmar will notify owners, and Freightliner dealers will reroute the power steering hose, free of charge. The recall is expected to begin May 25, 2018. Owners may contact Newmar customer service at 1-800-731-8300. Newmar's number for this recall is FL-762.

18V-198

Navistar, Inc. (Navistar) is recalling certain 2018-2019 International LT trucks. When the hood is in the closed position, the fender splash panel may rub on the inlet fuel line fitting to the fuel/water separator, causing abrasion damage to the fitting and possibly resulting in a fuel leak. A fuel leak in the presence of an ignition source can increase the risk of a fire. Additionally, fuel leaking onto the roadway may increase the risk of a crash. Navistar will notify owners, and dealers will trim the splash panel, and replace the fuel/water inlet line if it is damaged, free of charge. The recall is expected to begin May 25, 2018. Owners may contact Navistar customer service at 1-800-448-7825. Navistar's number for this recall is 18503.

18V-199

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain 2018 Toyota Camry vehicles equipped with a 2.5L, four-cylinder engine. The pistons on these vehicles may be larger than specified, possibly causing the engine to stall. An engine stall can increase the risk of a crash. Toyota will notify owners, and dealers will inspect the production date codes of the pistons and, if an engine contains a piston from the affected production period, the engine assembly will be replaced, free of charge. The recall is expected to begin May 25, 2018. Owners may contact Toyota customer service at 1-888-270-9371. Toyota's number for this recall is J1M/J0M.

18V-200

LGS Industries Inc (LGS) is recalling certain 2018 Look, Pace, and Cargo Express cargo trailers. The spindle weld on the axle may fail, causing separation of the spindle and pipe. If the spindle weld fails causing separation of the spindle and pipe, it can lead to loss of vehicle control, increasing the risk of a crash. LGS will notify owners, and dealers will replace the axle assemblies, free of charge. The recall began on April 13, 2018. Owners may contact LGS customer service at 1-877-475-5665.

18V-201

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2018**

Published April 27, 2018

REV Recreation Group (REV) is recalling certain 2018 Fleetwood Axon and Pulse, Holiday Rambler Reno and Prodigy, Monaco Marquis and American Coach American Dream motorhomes, 2017-2018 Fleetwood Bounder, Discovery, Discovery LXE, Flair, Jamboree, Southwind, Pace Arrow, Pace Arrow LXE and Storm motorhomes, Holiday Rambler Admiral XE, Endeavor, Endeavor XE, Navigator XE, Navigator, Vacationer, Vacationer XE and Vesta and American Coach American Eagle motorhomes and 2017 Holiday Rambler Scepter, Monaco Diplomat, and American Coach American Revolution motorhomes. The mounting screws for the satellite dish may not have been fastened through the sheet steel reinforcement, possibly allowing the satellite dish to detach from the roof while driving. If the satellite dish detaches from the roof while driving, it can increase the risk of a crash or injury. REV will notify owners, and dealers will resecure the satellite dish to the roof with a metal reinforcement, free of charge. The recall is expected to begin May 25, 2018. Owners may contact REV customer service at 1-800-509-3417. REV's number for this recall is 180322REV. Note: This recall supersedes recall 17V-802. Any vehicle repaired under that campaign is not included in this one as the remedy for both recalls is the same.

18V-202

Chrysler (FCA US LLC) is recalling certain 2018 Alfa Romeo Stelvio vehicles. Water may Leak into the wiring connectors for the rear liftgate and the liftgate-opening switch, causing corrosion. Corrosion at the connectors may cause the liftgate to unintentionally open while moving at speeds of less than 3 miles per hour, allowing cargo to fall out of the vehicle, creating a road hazard and increasing the risk of a crash. Chrysler will notify owners, and dealers will install additional protection against water leaking into the liftgate wiring connectors and switch, free of charge. The recall is expected to begin May 18, 2018. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is U34.

18V-203

Tesla, Inc. (Tesla) is recalling certain 2012-2016 Tesla Model S vehicles equipped with Bosch steering racks. The aluminum bolts that attach the power steering gear assist motor to the gear housing may corrode and fracture causing a reduction or complete loss of power steering assist. Loss of power steering assist would require a higher steering effort, especially at lower speeds, which may increase the risk of a crash. Tesla will notify owners, and Tesla Service Centers will replace the steering gear mounting bolts and add a corrosion-preventative sealer, free of charge. Owners may contact Tesla customer service at 1-877-798-3752. Tesla's number for this recall is SB-18-32-002.

18V-204

Chrysler (FCA US LLC) is recalling certain 2018 Alfa Romeo Stelvio vehicles. Water may leak into the body control module and its connectors, causing corrosion. This corrosion can cause illumination of one or more malfunction indicator lamps, a loss of windshield wiper function, a loss of exterior lighting, a loss of horn function and/or unintended turn signal activation. Electrical malfunctions such as windshield wipers that may not work in the rain and lights that may not work at night increase the risk of a crash. Chrysler will notify owners, and dealers will install additional sealing protection to prevent water from entering the body control module and its connectors. The recall began on April 25, 2018. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is U36.

18V-205

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2018**

Published April 27, 2018

Spartan Motors USA (Spartan) is recalling certain 2004-2007 Spartan Emergency Response Gladiator vehicles equipped with Timoney Independent Front Suspensions. Inconsistent machining may result in fatigue cracks developing over time in the front axle spindles, causing failure of the spindle and the possible separation of a front wheel from the vehicle. A wheel separation from the vehicle can increase the risk of a crash. Spartan will notify owners, and dealers will replace the front axle spindle, free of charge. Owners may contact Spartan customer service at 1-800-543-5008. Spartan's number for this recall is 18012.

18V-206

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2017-2018 C43 AMG 4Matic Coupe, C300 Coupe, C300 4Matic Coupe, C300 4Matic Cabriolet, C300 Cabriolet, C43 AMG 4Matic Cabriolet and C63S AMG Cabriolet, 2017 C63 AMG Cabriolet, C63S AMG Coupe and C63 AMG Coupe, 2018 E400 Coupe and E400 4Matic Coupe vehicles. The seatbacks of the front seats may not properly lock on the right side of the seat. If the seatback does not properly lock, in the event of a crash, the seatbacks may fold forward, increasing the risk of injury. MBUSA will notify owners, and dealers will inspect the locking of the seatbacks, replacing the seatbacks lock, as necessary, free of charge. The recall is expected to begin May 25, 2018. Owners may contact MBUSA customer service at 1-800-367-6372.

18V-207

Mercedes-Benz USA LLC (MBUSA) is recalling certain 2018 AMG GT, AMG GT C, GLC43 AMG 4Matic, GLC300, GLC300 4Matic and GLC350e 4Matic vehicles. The housing for the driver side air bag inflator may have been made with defective steel. In the event of an air bag deployment, the defective steel may cause the inflator to improperly inflate the driver-side air bag and potentially rupture. In the event of a crash involving driver air bag deployment, an improperly inflated air bag and/or an inflator rupture with sharp metal fragments might result in serious injury or death to the driver or to occupants. MBUSA will notify owners, and dealers will replace the front driver air bag module, free of charge. The recall is expected to begin May 29, 2018. Owners may contact MBUSA customer service at 1-800-367-6372.

18V-208

Van Hool N.V. (Van Hool) is recalling certain 2015-2018 CX45, TD925, TDX25, TX40, TX45, and 2016-2018 CX35 motorcoaches. The passenger seat belt buckles outer casing may fail leaving the seat belt buckles exposed. The exposed seat belt buckles may reduce the seat occupants likelihood of using the seat belt, increasing the risk of injury in the event of a crash. Van Hool will notify owners and dealers will replace the defective seatbelt buckles on the aisle side with flexible seatbelt buckles. The recall is expected to begin in May 2018. Owners may contact Van Hool customer service at 1-877-427-7278 or 1-407-656-7977.

18V-209

Futura Trailers Ltd (Futura) is recalling certain 2016-2018 Low Loader trailers. The left and right drawbars may disconnect from the front rail of the trailer chassis allowing the draw bars to swing and sever the trailer brake and light wires. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment," and number 135, "Light Vehicle Brake Systems." Severed brake and/or light wiring can cause the brakes or brake lights to fail, increasing the risk of a crash. Futura will notify owners, and dealers will install an additional aluminum angle

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2018**

Published April 27, 2018

bracket to the junction of the left and right draw-bar, free of charge. The recall is expected to begin April 10, 2018. Owners may contact Futura customer service at 1-855-744-3877.

18V-210