

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2019**

Published May 10, 2019

CHILD SEATS:

None during March 2019.

EQUIPMENT:

DiamondBack Automotive Accessories, Inc (Diamondback) is recalling certain DiamondBack HD and SE three-panel hard tonneau truck bed covers produced between March 28, 2018 and March 1, 2019. If the front panel section is not properly secured and locked, the front portion of the cover assembly could lift and separate from the truck bed while the vehicle is being driven. If the cover separates from the truck bed, it could be a road hazard, increasing the risk of a crash. DiamondBack will notify owners and will send owners a kit including cab-panel tether and a redesigned safety catch that secures the cover to the frame, free of Charge. The recall began March 28, 2019.

19E-018

Ivolution Sports, Inc. (Ivolution) is recalling certain IV2 HY808 helmets, part number Hy808, in sizes S, M, L, XL, and XXL. These helmets may not adequately protect the wearer in the event of a head impact during a motorcycle crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 218, "Motorcycle Helmets." A helmet that does not adequately protect the wearer from an impact can increase the risk of injury in the event of a crash. Ivolution will notify owners and provide a full refund for the helmets. Owners may contact Ivolution's customer service at 1-951-852-6327. Ivolution's number for this recall is HY808.

19E-019

Cummins Inc. (Cummins) is recalling certain B6.7 medium duty diesel engines, part number D313029BX03, used in school buses, trucks and emergency vehicles, equipped with fuel module option number FS90301 or FS90453. The electric fuel heater within the fuel module may overheat and cause plastic in the fuel heater to melt and potentially catch fire. It may also lead to engine stalling. A fire increases the risk of injury. An engine stall can increase the risk of a crash. Cummins will notify the owners that have the affected engines in their vehicles. Cummins is still developing a final remedy. In the interim, owners will be mailed a letter advising them to remove the fuse supplying electrical power to the subject fuel heater and to inspect the heater for fuel leakage or damage and, if found, to contact Cummins to arrange for a repair (remove the damaged or leaking heater and replace it with a plug). Cummins issued owners an interim notification on May 2, 2019. Owners may contact Cummins customer service at 1-800-286-6467.

19E-020

Dexter Axle Company (Dexter Axle) is recalling certain #13, #13D, #13G, #13T, #14, and #14T axles. The axles may lack the proper amount of grease on the inner and outer bearings in the hubs. The ungreased axle bearings may result in a wheel locking up, affecting the vehicle handling and increasing the risk of crash. Dexter has notify the trailer manufacturers that purchased the axles, and dealers will properly grease and reinstall the components or replace the components as necessary, free of charge. The recall began March 22, 2019. Owners may contact Dexter Axle customer service at 1-574-295-7888.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2019**

Published May 10, 2019

19E-023

Natural Gas Fuel Systems, Inc. (NGFS) is recalling certain Momentum 90 DGE SM, 115 DGE TM, 113 DGE TM, 75 DGE TM, 93 DGE TM, 80 DGE SM, 75 DGE BOC, 45 DGE SM, and 115 DGE BOC compressed natural gas (CNG) fuel systems equipped with certain 26-inch diameter fuel cylinders, sold for installation on heavy and medium-duty vehicles. The CNG tanks may unexpectedly rupture. An cylinder rupture may in serious injury or death or fire. NGFS will notify the purchasers, and Momentum dealers will replace the cylinders in the fuel systems with a cylinder from an alternate cylinder manufacturer, free of charge. The recall began April 24, 2019. Owners may contact Natural Gas Fuel Systems customer service at 1-830-302-5200.

19E-024

TIRES:

Trans Texas Tire (TTT) is recalling certain Contender 5.70-8 tires sold exclusively through Discount Tire stores. The tire sidewalls are incorrectly labeled, in that each side of the tire may state different PLY and PSI markings. As such, these vehicles fail to comply with the requirements of 49 CFR Part 574, "Tire Identification & Recordkeeping." The incorrect PLY and PSI markings may result in underinflating or overloading the tires, increasing the risk of crash. TTT will notify owners, and dealers will replace the tires with tires that have the correct sidewall markings, free of charge. Owners may contact Trans Texas Tire customer service at 1-903-572-0267.

19T-003

VEHICLES:

FCA US LLC (Alfa Romeo) is recalling certain 2018-2019 Alfa Romeo Stelvio and 2017-2019 Giulia vehicles. The Brake System Module (BSM) software may prevent the driver from disabling the Adaptive Cruise Control (ACC) after the traction control system detects a specific wheel slip. The driver's inability to deactivate the ACC can increase the risk of crash. Alfa Romeo has notified owners, and dealers will update the BSM software, free of charge. The recall began March 25, 2019. Owners may contact Alfa Romeo customer service 1-800-853-1403. The Alfa Romeo number for this recall is V27.

19V-148

Forest River, Inc. (Forest River) is recalling certain 2016-2019 Elkhart ECE3 and ECE4 buses, equipped with Freedman GO-ES Foldaway Seats. When the back seat cushion is rotated from the stowed position to the upright position, the seat cushion may not remain locked into place when under load, such as in a crash or a sudden stop. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 207, "Seating Systems," and 210, "Seat Belt Assembly Anchorages." In the event of a crash, if the seat back moves, the seat occupant has an increased risk of injury. Forest River has notified owners, and Freedman will repair the foldaway seat, free of charge. The recall begin March 8, 2019. Owners may contact Forest River Customer Service at 1-(574) 327-2700 or Freedman customer service at 1-800-443-4540. Forest River's number for this recall is 42-0975.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2019**

Published May 10, 2019

19V-150

Forest River, Inc. (Forest River) is recalling certain 2019 Forest River Sabre trailers. The Federal Placard may incorrectly state that the trailer has 6,000 lb. capacity axles when the trailer actually has 5,200 lb. capacity axles. The incorrect label can cause the operator to overload the vehicle, which may lead to a loss of control, increasing the risk of crash. Forest River has notified owners, and dealers will provide replacement placards that indicate the correct axle weight rating, free of charge. The recall began March 8, 2019. Owners may contact Forest River customer service at 1-574-672-2100. The Forest River number for this recall is 62-0972.

19V-151

Terex Advance Mixer, Inc is recalling certain 2018-2019 Front Discharge Concrete Mixer Trucks equipped with Meritor EX225 disc brake calipers. The drive pins, a component with the axle sub-assembly, may have been cracked during assembly, possibly resulting in the pins fully fracturing. If the drive pin becomes fully fractured, the vehicle may pull to one side while braking, causing a loss of vehicle control and increasing the risk of crash. Terex will notify owners and Meritor dealers will inspect and replace the brake calipers, free of charge. The recall began April 23, 2019. Owners may contact Terex Advance customer service at 1-605-882-4000.

19V-152

Eldorado National- Kansas (Eldorado National-Kansas) is recalling certain 2015-2016 Goshen Impulse shuttle buses equipped with Freedman GO-ES Foldaway Seats. When the back seat cushion is rotated from the stowed position to the upright position, the seat cushion may not remain locked into place when under load, such as in a crash or a sudden stop. In the event of a crash, if the seat back moves, the seat occupant has an increased risk of injury. Eldorado National-Kansas will notify owners, and Freedman will repair the foldaway seat, free of charge. The recall began April 3, 2019. Owners may contact Eldorado National-Kansas customer service at 1-800-955-4236 or Freedman customer service at 1-800-443-4540.

19V-153

Charles Machine Works, Inc (Charles) is recalling certain 2019 Ditch Witch VT24 trailers. The axle bearings may not have been greased. The ungreased axle bearings could result in a wheel locking up, affecting vehicle handling and increasing the risk of crash. Charles will notify owners, and dealers will inspect the axles for the affected batch number and rework the hubs with new seals and bearings, as necessary, free of charge. Owners may contact Charles customer service at 1-800-654-6481. Charles' number for this recall is ID0555609.

19V-154

Maintainer Corporation of Iowa, Inc. (Maintainer) is recalling certain 2017-2018 MCB Custom Bodies Responders/Rescue Walkaround vehicles equipped with Whelen brake lights. Depending on the specific wiring of the vehicle, these brake lights may illuminate when the brake pedal has not been pressed. If the brake lights incorrectly illuminate, it can confuse other drivers, possibly increasing the risk of a crash. Maintainer will notify owners instructing them how to obtain replacement brake lights, free of charge. The recall began September 12, 2018. Owners may contact Maintainer customer service at 1-800-831-8588 or Whelen customer service at 1-860-718-2331.

19V-155

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2019**

Published May 10, 2019

Indian Motorcycle Company (Indian) is recalling certain 2019 Indian Scout, Scout Bobber, and Scout Sixty motorcycles equipped with Anti-Lock Brake Systems (ABS). After the manufacturing process, air may remain trapped within the brake system, possibly reducing brake performance. Reduced brake performance can increase the risk of a crash. Indian has notified owners, and dealers will perform a brake fluid bleed of the front and rear ABS to evacuate the air, free of charge. The recall began March 7, 2019. Owners may contact Indian customer service at 1-877-204-3697. Indian's number for this recall is I-18-07.

19V-156

BMW of North America, LLC (BMW) is recalling certain 2013-2018 BMW C600 Sport and C650 Sport and 2013-2019 C650 GT scooters. Repeated turning of the handlebars to the left most position may cause the front brake hose to crack and leak over time. A brake fluid leak can reduce braking ability, increasing the risk of a crash. BMW will notify owners, and dealers will replace the brake hose, adding an additional protective sleeve that will cover the hose connection fitting, free of charge. An interim owner notification letter was mailed on April 29, 2019. A second notice will be sent when the remedy is available. Owners may contact BMW customer service at 1-800-525-7417. Note: This recall includes scooters previously recalled under 15V-738.

19V-157

Ameritrans Bus, Inc. (Ameritrans) is recalling one 2016 E225 vehicle equipped with a Ricon Wheelchair lift. The wheelchair lift positioning input cam may fail while the lift is in use, allowing the platform to travel higher than the vehicle's floor height. As such, this vehicle fails to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 403, "Platform Lift Systems." If the wheelchair lift platform stops above the vehicle floor, the wheelchair user can tip inwards towards the vehicle when exiting the lift, increasing the risk of injury. Ameritrans will notify the owner and a Ricon dealer will replace the lift positioning input cam, free of charge. The recall began April 26, 2019. Owners may contact Ricon customer service at 1-800-322-2884.

19V-158

Marion Body Works Inc. (Marion) is recalling certain 2017-2018 Fire and Emergency Apparatus vehicles equipped with Whelen brake lights. Depending on the specific wiring of the vehicle, these brake lights may illuminate when the brake pedal is not being pressed. As such, these vehicles fail to comply with Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective devices, and Associated Equipment." If the brake lights incorrectly illuminate, it can confuse other drivers, increasing the risk of a crash. Marion will notify owners, and Whelen will replace the brake lights, free of charge. The recall began March 3, 2019. Owners may contact Whelen customer service at 1-860-526-4078.

19V-159

Supreme Corporation (Supreme) is recalling certain 2014-2016 Classic American Trolley vehicles equipped with Ricon K-series or S-Series Ricon Wheelchair lifts. The wheelchair lift positioning input cam may fail while the lift is in use, allowing the platform to travel higher than the vehicle's floor height. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 403, "Platform Lift Systems." If the wheelchair lift platform stops above the vehicle floor, the wheelchair user can tip inwards towards the vehicle when exiting the lift, increasing the risk of injury. Supreme will notify owners, and Ricon dealers will replace the lift positioning input cam, free of charge. Owners may contact Ricon customer service at

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2019**

Published May 10, 2019

1-800-322-2884.

19V-160

SVI Trucks (SVI) is recalling certain 2018 Light Rescue, Heavy Rescue, Fire Engine, Haz-Mat and Wildland emergency vehicles equipped with Whelen brake lights. Depending on the specific wiring of the vehicle, these brake lights may illuminate when the brake pedal has not been pressed. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." If the brake lights incorrectly illuminate, it can confuse other drivers, possibly increasing the risk of a crash. SVI Trucks has notified owners and Whelen will replace the brake lights, free of charge. The recall began March 22, 2019. Owners may contact Whelen customer service at 1-860-718-2331.

19V-161

W.S. Darley & Co. (Darley) is recalling certain 2017-2019 WASP fire trucks built on a Ford F-550 or Spartan Metro Star chassis equipped with Whelen brake lights. Depending on the specific wiring of the vehicle, these brake lights may illuminate when the brake pedal is not being pressed. As such, these vehicles fail to comply with Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective devices, and Assoc. Equipment." If the brake lights incorrectly illuminate, it may confuse other drivers, increasing the risk of a crash. Darley has notified owners and will provide replacement brake lights, free of charge. The recall began March 18, 2019. Owners may contact Darley customer service at 1-800-634-7812.

19V-162

LDV, Inc., (LDV) is recalling certain 2017-2018 Command Center and Emergency Response support vehicles. Depending on the specific wiring of the vehicle, these brake lights may illuminate when the brake pedal has not been pressed. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." If the brake lights incorrectly illuminate, it can confuse other drivers, possibly increasing the risk of a crash. LDV has notified owners and Whelen dealers will replace the brake lights, free of charge. The recall began on April 9, 2019. Owners may contact Whelen customer service at 1-860-718-2331.

19V-163

KZRV, L.P. (KZRV) is recalling certain 2019 RV Sonic Lite, Sportsmen Classic and Escape recreational trailers equipped with a Capital liquid propane (LP) Gas Drop-in 2 Burner cooktop. The cooktop's flame may become inverted when the furnace is running. If the flame becomes inverted, excessive heat buildup may occur, increasing the risk of a burn injury. KZRV will notify owners, and dealers will replace the existing cooktop with a cooktop by another manufacturer, free of charge. The recall began April 24, 2019. Owners may contact KZRV customer service at 1-800-768-4016 extension 154 or 153. KZRV's number for this recall is KZ-2019-01.

19V-165

Jayco, Inc. (Jayco) is recalling certain 2019 North Point Fifth Wheel recreational trailers equipped with cargo trays. The rivets that secure the stop bracket to the cargo tray may shear allowing the cargo tray to detach. If the

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2019**

Published May 10, 2019

cargo tray detaches, the tray may hit someone, increasing the risk of injury. Jayco has notified owners, and dealers will replace the hollow rivets with structural rivets, free of charge. The recall began March 15, 2019. Owners may contact Jayco's customer service at 1-800-517-9137. Jayco's number for this recall is 9901431.

19V-166

Triumph Motorcycles America, LTD (Triumph) is recalling certain 2019 Speed Twin motorcycles. Improper routing of the coolant hose may cause it to contact the exhaust header pipe, damaging the hose and resulting in a coolant leak near the rear tire. Loss of coolant near the rear tire may cause a loss of traction, increasing the risk of crash. Triumph will notify owners, and dealers will inspect the coolant hose routing, rerouting the hose and replacing it if necessary, free of charge. The recall began April 15, 2019. Owners may contact Triumph customer service at 1-678-854-2010. Triumph's number for this recall is SRAN563.

19V-167

Highland Ridge RV (Highland) is recalling certain 2019 Mesa Ridge Lite 2804RK and Open Range Ultra Lite 2804RK travel trailers. The Gross Vehicle Weight Rating (GVWR), shown on the label as 7,675lbs, exceeds the safety chain rating of 7,600lbs. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims." The incorrect GVWR on the label may allow the vehicle to be overloaded causing loss of vehicle control, increasing the risk of a crash. Highland has notified owners and provide corrected labels, free of charge. The recall began March 18, 2019. Owners may contact Highland RV's customer service at 1-260-768-7771. Highland's number for this recall is 9904427.

19V-168

Jayco, Inc. (Jayco) is recalling certain 2016-2019 Seismic fifth wheel trailers equipped with optional hydraulic brakes. The brake lines may have been incorrectly routed between the frame and axle, possibly resulting in the brake lines being pinched or cut. Damaged brake lines may reduce the trailer's braking ability, increasing the risk of crash. Jayco will notify owners, and dealers will inspect the brake lines, correcting and replacing them as necessary, free of charge. The recall began April 15, 2019. Owners may contact Jayco customer service at 1-800-517-9137. Jayco's number for this recall is 9901426.

19V-169

Daimler Trucks North America LLC (DTNA) is recalling certain 2003-2019 Thomas Built Buses Minotour school buses built on a Ford chassis equipped with a specific wheelchair lift option. The wheelchair lift can be operated without the parking brake being engaged after they key is turned off. When the vehicle is in neutral with the ignition and the parking brake off, the vehicle may move. Using the wheelchair lift during this time can increase the risk of injury. DTNA has notified owners, and dealers will modify the wheelchair lift wiring harness, free of charge. DTNA issued owners an interim notification on April 10, 2019. A second letter will be mailed when the remedy is available. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-811.

19V-170

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2019**

Published May 10, 2019

Daimler Trucks North America LLC (DTNA) is recalling certain 2019 Western Star 4700 and 4900 trucks. The vehicles are accumulating distance in kilometers, but the odometer display is labeled as being miles. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 101, "Control and Displays." The odometer failing to register the correct distance travelled could cause driver confusion, as well as possible incorrect assumptions about driver speed. An incorrect speed assumption may increase the risk of crash. DTNA will notify owners, and dealers will replace the speedometer, free of charge. The recall began April 29, 2019. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-812.

19V-171

Jayco, Inc. (Jayco) is recalling certain 2018 Jayco Talon and Seismic fifth wheel trailers. Incorrect hardware may have been used to secure the fuel tank that is used for refilling vehicles. The incorrect hardware may fail to properly secure the fuel tank, possibly resulting in the fuel tank detaching from trailer, increasing the risk of a fire. Jayco has notified owners, and dealers will install the correct fuel tank mounting hardware, as necessary, free of charge. The recall began on March 29, 2019. Owners may contact Jayco customer service at 1-800-517-9137. Jayco's number for this recall is 9901430.

19V-172

Jayco, Inc. (Jayco) is recalling certain 2019 Jayco North Point and Pinnacle fifth wheel trailers equipped with Carefree Altitude Series awnings. The awning circuit incorrectly has a 15amp fuse instead of a 5amp one. In the event of a short circuit, the incorrect fuse can increase the risk of a fire. Jayco has notified owners, and dealers will replace the 15amp fuse with a 5amp fuse, free of charge. The recall began on March 22, 2019. Owners may contact Jayco customer service at 1-800-517-9137. Jayco's number for this recall is 9901428.

19V-173

Jayco, Inc. (Jayco) is recalling certain 2019 Jayco Greyhawk and Redhawk motorhomes. The parking brake cable ends may be too small, allowing the cable to disconnect, preventing the emergency brake from engaging. Without the parking brake being engaged, the vehicle may unintentionally move, especially when parked on an incline, increasing the risk of a crash. Jayco has notified owners, and dealers will replace the parking brake cable, free of charge. The recall began March 15, 2019. Owners may contact Jayco's customer service at 1-800-517-9137. Jayco's number for this recall is 9803428.

19V-174

Entegra Coach (Entegra) is recalling certain 2019 Esteem motorhomes. The parking brake cable ends may be too small, allowing the cable to disconnect, preventing the emergency brake from engaging. Without the parking brake being engaged, the vehicle may unintentionally move, especially when parked on an incline, increasing the risk of a crash. Entegra has notified owners, and dealers will replace the parking brake cable, free of charge. The recall began March 15, 2019. Owners may contact Entegra customer service at 1-800-517-9137. Entegra's number for this recall is 9903428.

19V-175

PACCAR Incorporated (PACCAR) is recalling certain 2020 Kenworth T680, T800, T880, W900 and W990

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2019**

Published May 10, 2019

trucks. The rear axles may not contain oil. Without lubricating oil, the bearings, hub and axle shafts may wear, resulting in the separation of a wheel end from the axle, increasing the risk of a crash. Paccar will notify owners, and Kenworth dealers will inspect all of the rear axles for the presence of oil. If no oil is present, the wheels ends will be removed and the bearings, hub and axle shaft will be inspected for damage. If excessive wear or heat damage is evident, the components will be replaced, as necessary. Oil will then be added per the axle specifications. These repairs will be performed free of charge. The recall began April 16, 2019. Owners may contact Paccar customer service at 1-918-259-3258. Paccar's number for this recall is 19KWA.

19V-176

Jayco, Inc. (Jayco) is recalling certain 2019-2020 Jayco Embark motorhomes. While the motorhome was being delivered, the hitch may have been damaged, compromising the motorhome's ability to safely tow vehicles. The damaged hitch may result in the towed vehicle separating from the motorhome, increasing the risk of a crash. Jayco has notified owners, and dealers will replace the hitch, free of charge. The recall began March 15, 2019. Owners may contact Jayco customer service at 1-800-517-9137. Jayco's number for this recall is 9903429.

19V-177

Entegra Coach (Entegra) is recalling certain 2019-2020 Entegra Reatta motorhomes. While the motorhome was being delivered, the tow hitch may have been damaged, compromising the motorhome's ability to safely tow vehicles. The damaged hitch may result in the towed vehicle separating from the motorhome, increasing the risk of a crash. Entegra has notified owners, and dealers will replace the hitch, free of charge. The recall began March 15, 2019. Owners may contact Entegra's customer service at 1-800-517-9137. Entegra's number for this recall is 9903429.

19V-178

Porsche Cars North America, Inc. (Porsche) is recalling certain 2018 718 Boxster, Boxster S and Boxster GTS, 718 Cayman, Cayman S and Cayman GTS, 911 Carrera, Carrera T, Targa 4 GTS, Carrera 4, Carrera S, Carrera 4S, Carrera GTS, Carrera 4 GTS, Carrera Cabriolet, Carrera S Cabriolet, Carrera 4S Cabriolet, Carrera GTS Cabriolet, Carrera 4 GTS Cabriolet, Targa 4, Targa 4S, Turbo, Turbo S, Turbo S Exclusive Series, Turbo Cabriolet, Turbo S Cabriolet and GT3 vehicles. The side air bag impact sensors may not have been properly tightened to the vehicle. In the event of a crash, the air bags may not deploy, increasing the risk of injury. Porsche will notify owners, and dealers will tighten the air bag sensors, as necessary, free of charge. Owners may contact Porsche customer service at 1-800-767-7243. Porsche's number for this recall is AKA4.

19V-179

Porsche Cars North America, Inc is recalling certain 2018 Panamera, Panamera 4, Panamera 4 E-Hybrid, Panamera 4 E-Hybrid Executive, Panamera 4 E- Hybrid Sport Turismo, Panamera 4S, Panamera Turbo, Panamera Turbo Executive, Panamera 4 Sport Turismo, Panamera Turbo S E-Hybrid Sport Turismo, vehicles. Incorrect soldering of a control unit may result in the intermittent failure of various systems, possible affecting vehicle driveability. Impaired vehicle driveability can increase the risk of a crash. Porsche Cars North America will notify owners, and dealers will replace the affected control units, free of charge. Owners may contact Porsche's customer service at 1-800-767-7243. Porsche's number for this recall is AKA5.

19V-180

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2019**

Published May 10, 2019

Karma Automotive (Karma) is recalling certain 2012 Fisker Karma vehicles ever registered in the states of Alaska, Arizona, Arkansas, Colorado, Connecticut, Delaware, Idaho, Illinois, Indiana, Iowa, Kansas, Kentucky, Maine, Maryland, Massachusetts, Michigan, Minnesota, Missouri, Montana, Nebraska, Nevada, New Hampshire, New Jersey, New Mexico, New York, North Carolina, North Dakota, Ohio, Oklahoma, Oregon, Pennsylvania, Rhode Island, South Dakota, Tennessee, Utah, Vermont, Virginia, Washington, West Virginia, Wisconsin, Wyoming and the District of Columbia.

These vehicles are equipped with air bag inflators assembled as part of the passenger frontal air bag modules, used as original equipment or replacement equipment, that may explode due to propellant degradation occurring after long-term exposure to high absolute humidity, temperature and temperature cycling. An inflator explosion may result in sharp metal fragments striking the driver or other occupants resulting in serious injury or death. Karma has notified owners, and dealers will replace the passenger frontal air bag inflators, free of charge. The recall began March 25, 2019. Owners may contact Karma customer service at 1-855-288-6109. Karma's number for this recall is 5.84.17.001.01.

19V-181

Honda (American Honda Motor Co.) is recalling specific 2003 Acura 3.2CL, 2013-2016 ILX, 2013-2014 ILX Hybrid, 2003-2006 MDX, 2007-2016 RDX, 2002-2003 3.2TL, 2004-2006, and 2009-2014 TL, 2010-2013 ZDX and 2001-2007 and 2009 Honda Accord, 2001-2005 Civic, 2003-2005 Civic Hybrid, 2001-2005 Civic GX NGV, 2002-2007 and 2010-2011 CR-V, 2003-2011 Element, 2007 Fit, 2002-2004 Odyssey, 2003-2008 Pilot, and 2006-2014 Ridgeline vehicles. The affected vehicles received a replacement driver air bag inflator as part of a previous Takata inflator recall remedy or a replacement driver air bag module containing the same inflator type as a service part. Due to a manufacturing error, in the event of a crash necessitating deployment of the driver frontal air bag, these inflators may explode. An explosion of an inflator within the driver frontal air bag module may result in sharp metal fragments striking the driver, front seat passenger or other occupants resulting in serious injury or death. Honda will notify owners, and dealers will replace the driver's air bag inflator with an alternate inflator, free of charge. The recall began April 10, 2019. Honda owners may contact customer service at 1-888-234-2138. Honda's number for this recall is O41. Acura owners may contact customer service at 1-888-234-2138. Acura's number for this recall is U40.

19V-182

Fenton Mobility Products, Inc. (Fenton) is recalling certain 2015-2017 Ford Transit passenger vans modified to be equipped with Ricon S & K Titanium Wheelchair Lifts. The wheelchair lift positioning input cam may fail while the lift is in use, allowing the platform to travel higher than the vehicle's floor height. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 403, "Platform Lift Systems." If the wheelchair lift platform stops above the vehicle floor, the wheelchair user can tip inwards toward the vehicle when exiting the lift, increasing their risk of injury. Fenton will notify owners, and a service technician will install Ricon Recall Parts Kit RI61396, free of charge. Owners may contact Fenton Mobility customer service at 1-716-484-7014. Fenton's number for this recall is RI61396.

19V-183

General Motors LLC (GM) is recalling certain Chevrolet Equinox and GMC Terrain vehicles. The rear-right

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2019**

Published May 10, 2019

seat may have insufficient welds on the head-restraint bracket. In the event of a crash, the insufficient welds may result in an increased risk of injury for an occupant seated in the rear-right position. GM will notify owners, and dealers will replace the rear-right seatback frame, free of charge. The recall began April 15, 2019. Owners may contact Chevrolet customer service at 1-800-222-1020 or GMC customer service at 1-800-462-8782. GM's number for this recall is N192209550.

19V-184

Polaris Industries, Inc. (Polaris) is recalling certain 2018-2019 Slingshot motorcycles. The driver-seat and passenger-seat seat belt and seat back anchoring bracket may have been improperly welded. Additionally, differences in the seat assembly may prevent proper latching of the seat slider, allowing the driver's seat to move unexpectedly. If the seat belt buckle or seat back detach from the seat base, there would be an increased risk of injury in the event of a crash. If the driver's seat unexpectedly moves, it can cause the driver to lose control of the motorcycle, increasing the risk of a crash. Polaris will notify owners, and dealers will inspect the seat belt bracket and seat back welds, and the seat slider latching function. If the weld is missing or incomplete, or if the slider doesn't latch properly, the seat bases will be replaced, free of charge. The recall began on March 25, 2019. Owners may contact Polaris customer service at 1-855-863-2284. Polaris' number for this recall is T-18-01. Note: this recall is an expansion of recall 18V-195.

19V-185

M H EBY is recalling certain 2019-2020 EBY Gooseneck Livestock Trailers equipped with Dexter Axle 8,000 and 10,000 pound axles. The inner wheel bearings of the axles may not have been properly greased. If the inner bearings were not properly greased, the wheel hub may overheat and smoke, increasing the risk of a fire or the bearing may fail, affecting handling and increasing the risk of a crash. M H EBY will notify owners and instruct them to contact a Dexter Axle dealer to have the axle bearings properly lubricated, as necessary, free of charge. The recall began April 12, 2019. Owners may contact M H EBY at 1-717-354-1458.

19V-186

Suzuki Motor of America, Inc. (Suzuki) is recalling certain 2010-2013 Kizashi and 2006-2013 Grand Vitara vehicles. The front passenger leather seat may shrink due to high humidity and high temperature. As a result, the occupant classification system (OCS) sensor mat may not accurately detect if an adult or child is occupying the seat. In the event of a crash necessitating airbag deployment, an incorrect classification may result in the passenger frontal air bag deploying even if there is a child in the front passenger seat, increasing their risk of injury. Suzuki will notify owners, and dealers will replace the seat bottom cushion, free of charge. Interim owner notification letters were mailed on May 3, 2019. A second notification will be mailed when the remedy is available. Owners may contact Suzuki customer service at 1-800-934-0934. Suzuki's numbers for this recall are 4011 and 4012.

19V-187

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2017-2019 Golf Sportwagen, 2019 Jetta, 2015-2019 Golf, and 2018-2019 Tiguan vehicles. The rear coil springs may prematurely fracture. If a coil spring fractures while driving, it may damage a rear tire causing a loss of vehicle control, increasing the risk of a crash. Volkswagen will notify owners, and dealers will replace the rear axle coil springs, free of charge. The

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2019**

Published May 10, 2019

recall began April 12, 2019. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's number for this recall is 42J5.

19V-188

Kovatch Mobile Equipment Corp. (KME) is recalling certain 2018 Predator Tractor-Drawn Aerial (TDA) vehicles. A weld may fail on the waterway pipes, possibly resulting in a pipe detaching from the vehicle. Failure of the weld while the waterway has water in it increases the risk of injury to those nearby. KME will notify owners, and dealers will replace the affected sections of the lower waterways, free of charge. The recall began April 18, 2019. Owners may contact KME customer service at 1-800-235-3928.

19V-189

Erwin Hymer Group North America, Inc. dba American Fastbacks (American Fastbacks) is recalling certain 2017-2018 Badlands, Force Recon, Stryker, and Defcon models of modified-Jeep Wrangler vehicles. These vehicles may be between 400 and 600 pounds above the allowable Gross Vehicle Weight Rating (GVWR) due to the replacement parts that were installed on the vehicle which increased the overall weight. The excessive weight can negatively impact the vehicle stability, increasing the risk of crash. The remedy for this recall is still under development. Owners were notified by mail beginning April 18, 2019. Owners may contact Erwin Hymer customer service at 1-844-533-7997 extension 301.

19V-190

Forest River, Inc (Forest River) is recalling certain 2018-2019 Forest River Surveyor recreational trailers, models SVT201RBLE, SVT201RBLE-47 and SVT201RBS-47. The Federal Placard indicates that the vehicles have 3,500 lb. capacity axles, whereas the vehicles actually have 2,500 lb. capacity axles. The incorrect label may cause the trailer to be overloaded, possibly resulting in a loss of control and increasing the risk of a crash. Forest River has notified owners and provided replacement placards that contain the accurate axle weight capacity information, free of charge. The recall began on March 18, 2019. Owners may contact Forest River's customer service at 1-574-642-3119. Forest River's numbers for this recall are 37-0979 and 47-0979.

19V-191

Forest River, Inc. (Forest River) is recalling certain 2019 Georgetown motorhomes. The front overhead bunk latch board may be insufficiently secured and may fall while the vehicle is in motion. If the bunk latch board falls while the vehicle is being driven, it can increase the risk of injury and crash. Forest River has notified owners, and dealers will additionally secure the bunk latch board, free of charge. The recall began March 18, 2019. Owners may contact Forest River customer service at 1-574-206-7600. Forest River's number for this recall is 68-0978.

19V-192

Gillig LLC (Gillig) is recalling certain 2014-2019 Low Floor buses. Uncovered electrical terminals in the headlight power circuit may short circuit to ground, causing a loss of headlights. A loss of headlights can reduce the driver's ability to see, increasing the risk of a crash. Gillig has notified owners, and dealers will install new back covers on the headlight buckets, free of charge. The recall began April 1, 2019. Owners may contact Gillig customer service at 1-510-264-5073 or 1-800-735-1500.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2019**

Published May 10, 2019

19V-193

SVO Group Inc. (SVO Group) is recalling certain 2018 Embassy shuttle buses. The U-bolts that hold the leaf spring to the rear axle may have been insufficiently tightened. The loose U-bolts may further loosen or break allowing the axle to separate and cause a loss of vehicle control, increasing the risk of a crash. SVO Group has notified owners and instructed them to contact MORryde International, Inc. for the repairs. Owners may contact SVO Group customer service at 1-574-295-9359.

19V-194

Mertz Manufacturing, LLC is recalling certain 2008-2018 custom trailers. Plastic junction connections may have been installed in the air brake circuits. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 121, "Air Brake Systems." If a plastic connector fails, a loss of service brakes will occur or the emergency brakes will activate unexpectedly. Either condition may increase the risk of a crash. Mertz has notified owners and will provide metal brake line connections to replace the plastic connections. The recall began March, 29, 2019. Owners may contact Mertz customer service at 1-580-767-8404. Mertz's number for this recall is M18-098.

19V-195

Newmar Corporation (Newmar) is recalling certain 2017-2019 Ventana motorhomes built on a Daimler Trucks North America (DTNA) chassis equipped with Detroit Axle axles. The affected vehicles may have loose steering and tie rod arm bolts. Loose tie rod arm bolts may lead to separation of the tie rod, resulting in a loss of vehicle control, increasing the risk of a crash. Newmar will notify owners, and DTNA dealers will inspect the steering arm and tie rod arm bolts to make sure that they are properly tightened, installing new fasteners, as necessary, free of charge. The recall began April 18, 2019. Owners may contact Daimler Trucks North America at 1-800-547-0712 to locate a Qualified Service Center or can contact Newmar customer service at 1-800-731-8300. Newmar's number for this recall is 18V-913.

19V-197

Transportation Collaborative, Inc. (TCI) is recalling certain 2015 and 2017 Transtech Buses equipped with Ricon S-Series and K-Series wheel chair lifts. The wheelchair lift positioning input cam may fail while the lift is in use, allowing the platform to travel higher than the vehicle's floor height. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 403, "Platform Lift Systems." If the wheelchair lift platform stops above the vehicle floor, the wheelchair user can tip inwards toward the vehicle when exiting the lift, increasing their risk of injury. TCI will notify owners and Ricon dealers will replace the lift positioning input cam, free of charge. Owners may contact TCI customer service at 1-845-988-0419. Transportation Collaborative's number for this recall is 18E-044.

19V-198

Thor Motor Coach (TMC) is recalling certain 2018-2019 Aria, and 2019 Palazzo motorhomes built on a Daimler Trucks North America (DTNA) chassis equipped with Detroit Axle axles. The affected vehicles may have loose steering and tie rod arm bolts. Loose steering and tie rod arm bolts can cause separation of the tie rod arm from the front wheels, increasing the risk of a crash. TMC has notified owners, and DTNA dealers will

SAFETY DEFECT/NONCOMPLIANCE NOTICES RECEIVED DURING MARCH 2019

Published May 10, 2019

inspect the steering arm and tie rod arm bolts for to make sure that they are properly tightened, installing new fasteners as necessary, free of charge. The recall began on March 15, 2019. Owners may contact Daimler Trucks North America at 1-800-547-0712 to locate a Qualified Service Center or may contact TMC customer service at 1-877-855-2867. TMC's number for this recall is RC000166.

19V-200

Chrysler (FCA US LLC) is recalling certain 2019 Jeep Wrangler and 2019 Ram 1500 vehicles. These vehicles have improperly machined steering column stub shafts that may break, possibly causing the steering wheel to detach from the steering column. If the steering wheel detaches from the steering column, the driver may lose control of the vehicle, increasing the risk of crash. Chrysler will notify owners, and dealers will inspect the steering column, replacing it, as necessary, free of charge. The recall began April 5, 2019. Owners may contact FCA US customer service at 1-800-853-1403. Chrysler's number for this recall is V29.

19V-201

Forest River, Inc. (Forest River) is recalling certain 2018-2019 Orion Class C, Freelanders Class C, and Leprechaun Class C motorhomes, Rockport work trucks, and Berkshire Ultra Coach, Starcraft, and Battisti shuttle buses, equipped with ASA Electronics back up mirror-monitors, model number VOM74MM. The affected displays may revert back to the factory default settings, causing the camera image to be reversed. If the monitor displays the image in reverse, the driver may unintentionally turn the opposite direction, increasing the risk of crash. Forest River has notified owners, and dealers will install a harness/relay/capacitor module, free of charge. The recall began April 8, 2019. Orion, Freelanders, and Leprechaun owners may contact Forest River customer service at 1-574-825-8602. Rockport owners should call 1-574-522-7599 and Berkshire, Starcraft and Battisti Customs owners should call 1-574-642-3112. ASA Customer service can be reached at 1-800-384-4400. Forest River's number for this recall is 51-0980.

19V-202

Chrysler (FCA US LLC) is recalling certain 2019 Dodge Challenger and Charger and Chrysler 300 vehicles. The instrument cluster may not properly illuminate driver warnings. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 101, "Control and Displays." Failure of the instrument cluster to properly illuminate may prevent the driver from receiving warnings about the vehicle's systems, increasing the risk of crash. Chrysler has notified owners, and dealers will update the instrument cluster software, free of charge. The recall began April 8, 2019. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is V32.

19V-203

Hyundai Motor America (Hyundai) is recalling certain 2013 Veloster vehicles that are equipped with 1.6 liter turbo engines. The engine management software may cause premature ignition (pre-ignition) of the air/fuel mixture in the engine. The resulting excessive cylinder pressure may damage the engine. Engine damage can increase the risk of a fire or cause an engine stall, increasing the risk of a crash. Hyundai will notify owners, and dealers will update the engine management software, free of charge. Owners may contact Hyundai customer service at 1-855-371-9460. Hyundai's number for this recall is 182.

19V-204

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2019**

Published May 10, 2019

Quality Van Sales, Inc. (Quality Van) is recalling certain 2015-2018 Ford Transit and E-350 vehicles modified to be equipped with Freedman GO-ES Foldaway Seat back cushions. The seat cushion may not remain locked into place when under load, such as in a crash or a sudden stop. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 207, "Seating Systems." In the event of a crash, if the seat back moves, the seat occupant has an increased risk of injury. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Quality Van customer service at 1-800-408-8550.

19V-205

Keystone RV Company (Keystone) is recalling certain 2019 Dutchmen Aspen Trail and Coleman recreational trailers, equipped with a Capital cooktop inside the unit as the main cooking appliance. When the furnace is on, the cooktop flames may become inverted, which may lead to an excessive heat build up and a potential burn hazard. An excessive heat build up can increase the risk of injury. Keystone has notified owners, and dealers will replace the Capital cooktop with an alternate cooktop, free of charge. The recall began April 5, 2019. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 19-348.

19V-206

Kia Motors America (Kia) is recalling certain 2019 Sedona vehicles equipped with an 8-passenger seat arrangement. The seat belt buckle for the second-row middle seat may have been improperly installed on the wrong side of the seat, preventing the proper use of the 3-point seat belt. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 208, "Occupant Crash Protection." A seat belt that cannot be properly used increases the risk of injury in the event of a crash. Kia has notified owners, and dealers will inspect the seat belt installation, and reinstall the seat belt buckle to the correct side if necessary, free of charge. The recall began April 8, 2019. Owners may contact Kia customer service at 1-800-333-4542. Kia's number for this recall is SC177.

19V-207

Volvo Trucks North America (Volvo Trucks) is recalling certain 2018-2020 VNL and VNX vehicles configured as 740 and 760 sleeper models. The sleeper bunk window may detach and fall from the vehicle. If a window detaches from the vehicle, it may strike another vehicle or pedestrian, increasing the risk of a crash or injury. Volvo Trucks has notified owners, and dealers will replace the window hinge, free of charge. Owners were notified of the recall on April 8, 2019 and will be sent a second notice when the remedy parts are available. Owners may contact Volvo Trucks customer service at 1-800-528-6586. Volvo Trucks' number for this recall is RVXX1902.

19V-208

Mack Trucks, Inc. (Mack) is recalling certain 2020 Anthem and Pinnacle trucks. The conspicuity reflectors at the back of the cab may be blocked by the exhaust system. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Assoc. Equipment." If the reflectors are blocked, the vehicle's visibility to other drivers may be reduced, increasing the risk of crash. Mack has notified owners, and dealers will install additional reflectors on the back of

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2019**

Published May 10, 2019

the cab, free of charge. The recall began April 10, 2019. Owners may contact Mack customer service at 1-800-866-1177. Mack's number for this recall is SC0418.

19V-209

Electra Meccanica Vehicles Corp. (Electra Meccanica) is recalling certain 2018 Solo vehicles. The Federal Certification labels may be missing the tire and rear wheel information and the maximum allowable cargo information. Also, the maximum combined occupant and cargo weight may be incorrectly stated higher than the actual maximum weight allows. The missing and incorrect information may result in the incorrect tires being installed, or the vehicle being overloaded, both of which can increase the risk of a crash. Electra Meccanica will notify owners, and dealers will replace the Federal Certification label, free of charge. The recall began April 8, 2019. Owners may contact Electra Meccanica customer service at 1-674-872-4747. Electra Meccanica's number for this recall is 19SC01.

19V-210

Collins Bus Corporation (Collins Bus) is recalling certain 2015-2019 Midbus DH500, DH516, DH400, DE416, DE500, DE516, TH400, SH416, and SH400 school buses equipped with HSM 39-INCH FB11 restraining barriers. In a hard braking situation or vehicle crash event, the barrier may not properly restrain an unbelted seat occupant. As a result, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 222, "School Bus Passenger Seating and Crash Protection." Failure to properly restrain an unbelted seat occupant can increase the risk of injury. Collins will notify owners, and HSM dealers will reinforce the barrier frame, free of charge. Owners may contact Collins customer service at 1-800-533-1850, extension 424. Collins' number for this recall is 19E-010.

19V-211

Alexis Fire Equipment Company (Alexis) is recalling certain 2018 Custom Fire Apparatus vehicles equipped with Whelen brake lights. Depending on the specific wiring of the vehicle, these brake lights may illuminate when the brake pedal has not been pressed. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." If the brake lights incorrectly illuminate, it can confuse other drivers, possibly increasing the risk of a crash. Alexis will notify owners, and dealers will install replacement lights, free of charge. Owners may contact Alexis customer service at 1-800-322-2284. Alexis' number for this recall is 18E-063.

19V-212

Braun Corporation (Braun) is recalling certain 2018-2019 Honda Odyssey vehicles modified to be equipped with an in-floor wheelchair ramp conversion. The rear wheel speed sensor harnesses may have been routed to the incorrect rear wheels, resulting in the possibility that the anti-lock brake system will not recognize each rear wheel speed properly. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 135, "Light Vehicle Brake System" and 404, "Electronic Stability Control Systems." If the rear wheel speeds cannot be correctly monitored, the anti-lock brake system may not engage properly to prevent the wheels from locking up, increasing the risk of crash. Braun has notified owners, and dealers will inspect and correct the rear wheel speed sensor harnesses, if necessary, free of charge. The recall began on April 4, 2019. Owners may contact Braun customer service at 1-800-488-0359.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2019**

Published May 10, 2019

19V-213

Fouts Bros (Fouts) is recalling certain 2017-2018 Fire Apparatus F-3000, F-Rescue and F-Pumper vehicles equipped with Whelen brake lights. Depending on the specific wiring of the vehicle, these brake lights may illuminate when the brake pedal is not being pressed. As such, these vehicles fail to comply with Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." If the brake lights incorrectly illuminate, it may confuse other drivers, increasing the risk of a crash. Fouts has notified owners, and Fouts service centers will replace the brake lights, free of charge. The recall began on March 25, 2019. Owners may contact Fouts customer service at 1-800-948-5045.

19V-214

Thor Motor Coach (TMC) is recalling certain 2018-2019 Quantum RW28 motorhomes. The vehicles may be missing the mid-ship marker lights. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." Without mid-ship marker lights, other drivers may underestimate the length of the vehicle, increasing the risk of crash. TMC will notify owners, and dealers will inspect and install mid-ship marker lights, as needed, free of charge. The recall began on April 25, 2019. Owners may contact TMC customer service at 1-877-855-2867. TMC's number for this recall is RC000167.

19V-215

Navistar, Inc. (Navistar) is recalling certain 2017-2020 International DuraStar and WorkStar, 2018-2020 IC Bus CECB, International HV and MV, 2018-2019 IC Bus 1300 FBC and HCCB, and 2019-2020 IC Bus TCCB vehicles equipped with Cummins B6.7 diesel engines with fuel module option number FS90301 or FS90453. The electric fuel heater within the fuel module may overheat and cause plastic in the fuel heater to melt and potentially catch fire. It may also lead to engine stalling. A fire increases the risk of injury. If the engine stall, the driver may lose control of the vehicle, increasing the risk of crash. Cummins will notify the affected Navistar owners. A temporary field action will involve removing the fuse for the fuel heater and replacing any fuel heater found with signs of damage or fuel leakage with a temporary cavity plug. Customers will be renotified once Cummins determines a final remedy. The recall began May 2, 2019. Owners may contact Cummins customer service at 1-800-286-6467 or Navistar customer service at 1-800-448-7825.

19V-216

Navistar, Inc. (Navistar) is recalling certain 2017-2020 IC Bus CESB school buses equipped with Cummins B6.7 diesel engines with fuel module option number FS90301 or FS90453. The electrical wiring within the fuel heater may overheat and may cause plastic in the fuel heater to melt and potentially catch fire. It may also lead to engine stalling. A fire increases the risk of injury. An engine stall can increase the risk of crash. Cummins will notify the affected Navistar owners. A temporary field action will involve removing the fuse for the fuel heater and replacing any fuel heater found with signs of damage or fuel leakage with a temporary cavity plug. Customers will be renotified once Cummins determines a final remedy. The recall began May 2, 2019. Owners may contact Cummins customer service at 1-800-286-6467 or Navistar customer service at 1-800-448-7825.

19V-217

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2019**

Published May 10, 2019

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2019 Atlas and 2020 Passat vehicles. An incorrect driver and/or front passenger side impact air bag may have been installed. In an event of a side impact crash, an incorrect side airbag may not deploy as intended, increasing the risk of injury. Volkswagen has inspected and replaced the side air bags, free of charge. The recall was completed in April 2019. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's number for this recall is 69Y8.

19V-218

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain 2019 CLA250 and CLA250 4MATIC vehicles. The right side door locks may not have been properly manufactured. As a result, the right-side doors may not be able to be opened from outside of the vehicle. In the event of a crash, if the right side doors cannot be opened from the outside, it could increase the risk of injury. MBUSA will notify owners, and dealers will replace the door locks, free of charge. The recall began May 3, 2019. Owners may contact MBUSA customer service at 1-800-367-6372. MBUSA's number for this recall is 2019030020.

19V-219

Volvo Car USA LLC (Volvo) is recalling certain 2018-2019 XC60 and S90 vehicles. The driver and passenger front seat rail rear flange nuts may not have been installed during assembly. If the nuts are missing, in the event of a crash, the front seat structure and position may be affected, increasing the risk of injury. Volvo will notify owners, and dealers will inspect the front seat rails for missing flange nuts, installing them as necessary, free of charge. The recall began May 7, 2019. Owners may contact Volvo customer service at 1-800-458-1552. Volvo's number for this recall is R19931.

19V-220

Osage Industries, Inc. (Osage) is recalling certain 2015-2019 Osage Brave, Warrior and Super Warrior Type I and Type III ambulances equipped with Whelen brake lights. Depending on the specific wiring of the vehicle, these brake lights may illuminate when the brake pedal is not being pressed. If the brake lights incorrectly illuminate, it may confuse other drivers, increasing the risk of a crash. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Osage Industries customer service at 1-573-897-3113.

19V-221

Daimler Vans USA, LLC (DVUSA) is recalling certain 2018-2019 Mercedes-Benz Sprinter and Metris vehicles. The affected vehicles left the reassembly plant without the final quality inspection of safety-relevant parts or bolt connections, resulting in possible unknown safety risks. Failure to identify loose safety related parts can increase the risk of crash and injury. DVUSA will notify owners, and dealers will complete the final quality inspection, free of charge. The recall began May 27, 2019. Owners may contact DVUSA customer service at 1-877-762-8267. DVUSA's number for this recall is VSX566ZP25.

19V-222

VT Hackney, Inc. (VT Hackney) is recalling certain 2017-2018 emergency vehicles equipped with Whelen brake lights. Depending on the specific wiring of the vehicle, these brake lights may illuminate when the brake pedal has not been pressed. As such, these vehicles fail to comply with the requirements of Federal Motor

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2019**

Published May 10, 2019

Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." If the brake lights incorrectly illuminate, it can confuse other drivers, possibly increasing the risk of a crash. VT Hackney will notify owners, and dealers will replace the lights. The recall began April 25, 2019. Owners may contact VT Hackney customer service at 1-800-763-0700, extension 2016.

19V-223

REV Recreation Group (REV) is recalling certain 2019 Fleetwood Flair and Holiday Rambler Admiral motorhomes. The metal battery hold down straps or their mounting brackets may contact the terminals for the auxiliary batteries, possibly resulting in a short circuit. A battery short circuit may increase the risk of a fire. REV will notify owners, and dealers will rework the motorhomes to prevent the auxiliary batteries from shorting against the battery hold down straps and strap mounting brackets, free of charge. The recall began May 8, 2019. Owners may contact REV customer service at 1-800-509-3417. REV's number for this recall is 190318REV.

19V-224

ITI Trailers and Truck Bodies, Inc. is recalling one 3000 Gallon Tanker truck built on a 2018 Peterbilt chassis, equipped with Whelen brake lights. Depending on the specific wiring of the vehicle, these brake lights may illuminate when the brake pedal has not been pressed. As such, the vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." If the brake lights incorrectly illuminate, it can confuse other drivers, possibly increasing the risk of a crash. ITI Trailers and Truck Bodies has notified the owners and replaced the lights, free of charge. The recall began January 15, 2019. Customers may contact ITI Trailers and Truck Bodies at 1-814-634-008.

19V-225

Watts Manufacturing, LLC (Watts Manufacturing) is recalling certain 2019 First responder vehicles built on Ford F-550 chassis and equipped with Whelen brake lights. Depending on the specific wiring of the vehicle, these brake lights may illuminate when the brake pedal has not been pressed. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." If the brake lights incorrectly illuminate, it can confuse other drivers, possibly increasing the risk of a crash. Watts Manufacturing will notify owners and Whelen dealers will replace the brake lights, free of charge. The recall began March 19, 2019. Owners may contact Watts Manufacturing customer service at 1-785-404-6003.

19V-226

Autocar, LLC (Autocar) is recalling certain 2019-2020 Xpeditor vehicles. The brake chamber clevis pin retainer may not have been installed, possibly increasing the distance needed to stop the vehicle. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 121, "Air Brake Systems." Additional distance needed to stop the vehicle may increase the risk of crash. Autocar will notify owners, and dealers will install any missing brake chamber clevis pin retainers, free of charge. The recall is expected to begin on May 20, 2019. Owners may contact Autocar customer service at 1-888-218-3611 or 1-877-973-3486. Autocar's number for this recall is ACX-1904.

19V-227

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2019**

Published May 10, 2019

Tiffin Motorhomes, Inc. (Tiffin) is recalling certain 2018-2019 Phaeton, Allegro Bus, and Zephyr motorhomes. The alternating current electrical wires may have been improperly secured in the Energy Management Module, causing increased electrical resistance. The additional resistance can cause the wires to overheat, increasing the risk of a fire. Tiffin will notify owners, and dealers will inspect the Alternating Current Relay Board and make sure the wires are properly secured, free of charge. The recall is expected to begin in May 2019. Owners may contact Tiffin customer service at 1-256-356-8661. Tiffin's number for this recall is TIFF-111.

19V-228

TransitWorks is recalling certain 2015-2018 Ford Transit, 2018 Ford Transit Connect, and 2016 Dodge Ram ProMaster vehicles modified to be equipped with Freedman Seating GO-ES seats. When the back seat cushion is rotated from the stowed position to the upright position, the seat cushion may not remain locked into place when under load, such as in a crash or a sudden stop. In the event of a crash, if the seat back moves, the seat occupant has an increased risk of injury. TransitWorks has notified owners and instructed them to contact Freedman seats for a repair kit. The recall began December 19, 2019. Owners may contact Freedman Seating customer service at 1-800-443-4540 or TransitWorks customer service at 1-855-337-9543

19V-229

Kovatch Mobile Equipment Corp. (KME) is recalling certain 2017 KME commercial rescue and 2019 KME commercial tanker vehicles equipped with an ASA Electronics backup camera display. The display may revert back to the factory default settings, which may cause the camera image to be reversed. The driver may inadvertently turn the wrong direction to avoid an object behind the vehicle, increasing the risk of a crash. KME will notify owners, and dealers will install a harness/relay/capacitor module to prevent the image from reversing. The recall is expected to begin on May 13, 2019. Owners may contact KME customer service at 1-800-235-3928.

19V-230

Keystone RV Company (Keystone) is recalling certain 2018-2019 Dutchmen Kodiak recreational trailers, models 255BHSL and 283BHSL, equipped with 15-inch tires. The tire clearance to the floor may be insufficient, allowing the tire to contact the underside of the floor, possibly resulting in tire failure. Tire failure can cause a loss of vehicle control, increasing the risk of crash. Keystone has notified owners, and dealers will install a suspension lift kit, free of charge. The recall began on April 12, 2019. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 19-349.

19V-231

North American Repower LLC (North American Repower) is recalling one 2005 Navistar International 1652 4x2 Compressed Natural Gas vehicle equipped with CNG tanks that have Luxfer One-Turn valves recalled under 18E-111. If the knob is turned more than one turn, the valve's snap ring may fail and the valve stem may forcibly eject from the valve body. The forcible ejection of the stem may increase the risk of injury to those nearby. Additionally, the unintended release of CNG can increase the risk of a fire. North American Repower has notified the owner, and provided an upgrade kit, free of charge. The recall began March 27, 2019. Owners may contact North American Repower customer service at 1-949-667-2673.

19V-233

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2019**

Published May 10, 2019

Daimler Trucks North America LLC (DTNA) is recalling certain 2019-2020 Thomas Built C2 Saf-T-Liner school buses built on an FCCC chassis. The clamp for the steering gear return hose may have been improperly installed, allowing the hose to separate from the steering gear. If the hose separates from the steering gear, steering assist would be lost, possibly making steering the vehicle difficult and increasing the risk of crash. If the school bus is occupied when the steering assist is lost, the occupants would need to exit the vehicle and be transferred to another vehicle, increasing the risk of injury. DTNA will notify owners, and dealers will inspect and install power steering hose clamps as needed, free of charge. The recall is expected to begin May 23, 2019. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-813.

Daimler Trucks North America LLC (DTNA) is recalling certain 2019-2020 Thomas Built C2 Saf-T-Liner school buses built on an FCCC chassis. The clamp for the steering gear return hose may have been improperly installed, allowing the hose to separate from the steering gear. If the hose separates from the steering gear, there may be a loss of steering assist which could result in a potentially disabled school bus. If the school bus is occupied when the steering assist is lost, the occupants would need to exit the vehicle and be transferred to another vehicle, increasing the risk of injury. DTNA will notify owners, and dealers will inspect and install power steering hose clamps as needed, free of charge. The recall is expected to begin May 23, 2019. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-813.

19V-234

Nissan North America, Inc. (Nissan) is recalling certain 2019 Nissan Altima vehicles. The brake switch bracket may be in the incorrect location, which may cause the brake switch to remain on. If the brake switch remains in the ON position, the brake lights will remain illuminated when the brakes are not being pressed, which may confuse other drivers. Additionally, the transmission shift lever may be moved out of the Park position without the brake pedal being pressed, allowing the vehicle to roll unexpectedly. Either condition increases the risk of a crash. Nissan will notify owners, and dealers will inspect and install a new brake pedal as needed, free of charge. The recall is expected to begin in May 2019. Owners may contact Nissan customer service at 1-800-867-7669.

19V-235

Excellance, Inc. (Excellance) is recalling certain 2018 Ambulances and Emergency Vehicles built on Ford E-350, E-450, F-650, F-550 4x4, Chevrolet G4500, G4500 Diesel, C3500, G3500, Freightliner M2, International 4300, and Dodge 4500 chassis and equipped with Whelen brake lights. Depending on the specific wiring of the vehicle, these brake lights may illuminate when the brake pedal has not been pressed. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." If the brake lights incorrectly illuminate, it can confuse other drivers, possibly increasing the risk of a crash. Excellance has notified owners, instructing them to contact Whelen to have the brake lights replaced, free of charge. The recall began on March 26, 2019. Owners may contact Whelen customer service at 1-860-718-2331 or Excellance at 1-256-772-9321.

19V-236

Curbtender, Inc. (Curbtender) is recalling certain 2018 Ford F-650 and QT06 vehicles with curbtenders equipped with Whelen brake lights. Depending on the specific wiring of the vehicle, these brake lights may

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2019**

Published May 10, 2019

illuminate when the brake pedal has not been pressed. If the brake lights incorrectly illuminate, it can confuse other drivers, possibly increasing the risk of a crash. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Curbtender customer service at 1-319-266-1721.

19V-237

Vantage Mobility International, LLC (Vantage) is recalling certain 2015-2018 Ford Transit Van, Mercedes-Benz Sprinter, and 2007 Ford F-250-based shuttle vehicles equipped with Freedman GO-3S foldaway seats. When the back seat cushion is rotated from the stowed position to the upright position, the seat cushion may not remain locked into place when under load, such as in a crash or a sudden stop. In the event of a crash, if the seat back moves, the seat occupant has an increased risk of injury. Vantage has notified owners, instructing them to contact Freedman for a repair kit, free of charge. The recall began March 25, 2019. Owners may contact Freedman customer service at 1-800-443-4540.

19V-238

Custom Fab & Body LLC (Custom Fab & Body) is recalling certain 2018 Ford F-650 XLT Crew Cab, 2017-2018 International 7500 4x4, and 2018 International 7500 4x2, Freightliner M2-112 and M2-106, and Kenworth T-370-based emergency vehicles equipped with Whelen brake lights. Depending on the specific wiring of the vehicle, these brake lights may illuminate when the brake pedal has not been pressed. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." If the brake lights incorrectly illuminate, it can confuse other drivers, possibly increasing the risk of a crash. Custom Fab & Body has notified owners, instructing them to contact Whelen for replacement lights, free of charge. The recall began April 11, 2019. Owners may contact Whelen customer service at 1-860-526-9504.

19V-239

Thor Motor Coach (TMC) is recalling certain 2018-2019 Thor Chateau and Four Winds motorhomes and 2019-2020 Magnitude and Omni motorhomes. The backup camera displays may revert back to the factory default settings which may cause the camera image to be reversed. If the monitor displays the image in reverse, the driver may unintentionally turn in the wrong direction, increasing the risk of crash. TMC will notify owners, and dealers will install a harness to install that will prevent the image from inverting, free of charge. The recall began April 30, 2019. Owners may contact TMC customer service at 1-877-855-2867. TMC's number for this recall is RC000168.

19V-240

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2019 Tiguan LWB vehicles. The tire information label contains inaccurate tire dimension and inflation pressure specifications. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims." The incorrect specifications can result in improper tire inflations or to installing a tire of the wrong size on the vehicle. Either of these situations can increase the risk of a vehicle crash. Volkswagen has notified owners, and dealers will install a corrected tire information label, free of charge. The recall began April 16, 2019. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's number for

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2019**

Published May 10, 2019

this recall is 01D2.

19V-241

Osco Tank & Truck Sales, Inc. (Osco Tank & Truck Sales) recalling certain emergency vehicles built on 2018 Peterbilt 348 and 2012 Kenworth T440 chassis and equipped with Whelen brake lights. Depending on the specific wiring of the vehicle, these brake lights may illuminate when the brake pedal has not been pressed. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." If the brake lights incorrectly illuminate, it can confuse other drivers, possibly increasing the risk of a crash. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Osco Tank & Truck Sales customer service at 1-309-526-3636.

19V-243

Gulf States Toyota (GST) is recalling certain 2019 C-HR, 4Runner, Avalon, Avalon Hybrid, Camry, Camry Hybrid, Highlander, Land Cruiser, Prius, RAV4, Sequoia, Tacoma, Sienna, Tundra and Yaris vehicles. The text on the load capacity label may become illegible. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims." If the driver cannot read the label, they may unknowingly overload the vehicle, increasing the risk of a crash. GST will notify owners, and dealers will provide corrected load carrying capacity modification labels, free of charge. The recall is expected to begin on May 2019. Owners may contact GST customer service at 1-800-444-1074. GST's number for this recall is 19R1.

19V-244

Chrysler (FCA US LLC) is recalling certain 2019 Dodge Charger vehicles. The driver and passenger sun visors may lack the required air bag warning information. As such, these vehicles fail to comply with Federal Motor Vehicle Safety Standard (FMVSS) number 208, "Occupant Crash Protection." Failure to provide the air bag warning information increases the risk of injury. Chrysler has notified owners, and dealers will replace the driver and passenger sun visors, free of charge. The recall began April 17, 2019. Owners may contact FCA US customer service at 1-800-853-1403. Chrysler's number for this recall is V35.

19V-246

Cabot Coach Builders, Inc. DBA Royale Limousine (Royal) is recalling certain 2015-2018 Ford Transit-based mini-coaches equipped with Freedman GO-ES foldaway seats recalled under 18E-076. When the back seat cushion is rotated from the stowed position to the upright position, the seat cushion may not remain locked into place when under load, such as in a crash or a sudden stop. In the event of a crash, if the seat back moves, the seat occupant has an increased risk of injury. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Royale customer service at 1-800-544-5587.

19V-247

Chrysler (FCA US LLC) is recalling certain 2019 Jeep Cherokee vehicles. The front passenger seat mounting bolts may be loose. In the event of a crash, the seat may move, increasing the risk of injury. Chrysler has notified

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2019**

Published May 10, 2019

owners, and dealers will tighten the mounting bolts, free of charge. The recall began April 11, 2019. Owners may contact FCA US customer service at 1-800-853-1403. Chrysler's number for this recall is V31.

19V-248

Cabot Coach Builders, Inc DBA Royale (Royale Limousine) is recalling certain 2015-2017 Mercedes Sprinter-based mini coaches equipped with Freedman GO-ES Foldaway Seats, part numbers 437052OLHIFOLD and 43705PFOLDSS. When the back seat cushion is rotated from the stowed position to the upright position, the seat cushion may not remain locked into place when under load, such as in a crash or a sudden stop. In the event of a crash, if the seat back moves, the seat occupant has an increased risk of injury. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Royale Limousine customer service at 1-800-544-5587.

19V-249

REV Ambulance Group Orlando, Inc. (REV) is recalling certain 2018-2019 Road Rescue Ultramedic emergency vehicles equipped with ASA Electronics backup camera displays recalled under 19E-009. The displays may revert to the factory default settings which may cause the camera image to be reversed. The driver may inadvertently turn the wrong direction to avoid an object behind the vehicle, increasing the risk of a crash. Rev has notified owners, and dealers will install a harness relay capacitor module to prevent the image from reversing, free of charge. The recall began April 17, 2019. Owners may contact REV customer service at 1-855-661-9232.

19V-250

Fire Equipment Sales & Service (FES) is recalling one Super C Brush emergency vehicle and one Tanker emergency vehicle equipped with Whelen brake lights recalled under 18E-063. Depending on the specific wiring of the vehicle, these brake lights may illuminate when the brake pedal has not been pressed. If the brake lights incorrectly illuminate, it can confuse other drivers, possibly increasing the risk of a crash. FES has already notified owners, and replaced the brake lights, free of charge. Owners may contact FES customer service at 1-803-494-6000 or Whelen customer service at 1-860-718-2331.

19V-251

Waldoch Crafts, Inc. (Waldoch) is recalling certain 2018 Ford Transit shuttle vans modified to be equipped with Freedman GO-ES Foldaway Seats, part number 43705. When the back seat cushion is rotated from the stowed position to the upright position, the seat cushion may not remain locked into place when under load, such as in a crash or a sudden stop. In the event of a crash, if the seat back moves, the seat occupant has an increased risk of injury. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Waldoch customer service at 1-651-464-3215.

19V-252

Genie Industries, Inc. (Genie) is recalling certain 2019 TZ-34 and TZ-50 trailer-mounted aerial devices. The battery cable ends at the quick disconnect may have been improperly crimped, resulting in possible excessive heat build-up of the conductor. The excessive heat build-up can result in a fire, increasing the risk of injury at the work area. Genie will notify owners and provide a replacement quick disconnect battery cable. The recall is

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2019**

Published May 10, 2019

expected to begin in May 2019. Owners may contact Genie customer service at 1-800-536-1800. Genie's number for this recall is 190009.

19V-253

Blanchat Mfg., Inc. (Blanchat) is recalling one 2018 B-27 Minuteman vehicle built on a Ford F-550 chassis and equipped with Whelen brake lights. Depending on the specific wiring of the vehicle, these brake lights may illuminate when the brake pedal has not been pressed. If the brake lights incorrectly illuminate, it can confuse other drivers, possibly increasing the risk of a crash. Blanchat has notified the owner, and will replace the brake lights, free of charge. The recall began on March 19, 2019. Owners may contact Blanchat customer service at 1-620-896-7145.

19V-254

Blanchat Mfg., Inc. (Blanchat) is recalling one 2018 B-27 Minuteman vehicle built on a RAM 5500 chassis and equipped with Whelen brake lights recalled under 18E-063. Depending on the specific wiring of the vehicle, these brake lights may illuminate when the brake pedal has not been pressed. If the brake lights incorrectly illuminate, it can confuse other drivers, possibly increasing the risk of a crash. Blanchat has notified the owner, and will replace the brake lights, free of charge. Owners may contact Blanchat customer service at 1-620-896-7145.

19V-255

Honda (American Honda Motor Co.) is recalling certain 2014-2019 Acura MDX and 2017-2019 Acura MDX Sport Hybrid vehicles. Moisture may enter the tailgate lid lights, possibly causing a loss of the tailgate lid lights and the taillights. Loss of the taillights reduces the vehicle's visibility, increasing the risk of crash. Acura will notify owners, and dealers will modify the tailgate lid lights and install updated gaskets and a wiring sub-harness or will replace both tailgate lid lights. The repairs will be performed free of charge. The recall began May 7, 2019. Owners may contact Acura customer service at 1-888-234-2138. Acura's number for this recall is M49.

19V-256

Newmar Corporation (Newmar) is recalling certain 2018-2019 Bay Star, Essex, New Aire, 2018 Bay Start Sport, Canyon Star, Dutch Star, King Aire, Mountain Aire, Ventana LE, Ventana, and London Aire motorhomes. The power supply for the WiFi Ranger may overheat. An overheated power supply can increase the risk of a fire. Newmar has notified owners, and dealers will replace the power supply, free of charge. The recall began April 18, 2019. Owners may contact Newmar customer service at 1-800-731-8300.

19V-257

Forest River, Inc. (Forest River) is recalling certain 2017-2019 Rockport work trucks. The inline fuse that protects the cargo and compartment lights circuit may not have been installed during production. Without inline fuse protection, excess current cause the wiring to melt, increasing the risk of a fire. Forest River has notified owners, and dealers will install an inline fuse, free of charge. The recall began April 8, 2019. Owners may contact Forest River customer service at 1-574-522-7599. Forest River's number for this recall is 29-0987.

19V-258

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2019**

Published May 10, 2019

Supreme Corporation (Supreme) is recalling certain 2014-2018 Service Body vehicles built on a Ford Transit chassis. The vehicles may lack the required padded trim that protects occupants from head impact. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 201, "Occupant Protection in Interior Impact." In the event of a crash, there is an increased risk of injury, due to the missing padding. Supreme will notify owners, and dealers will install padded trim, free of charge. The recall is expected to begin May 15, 2019. Owners may contact Supreme customer service at 1-844-352-4921.

19V-259

Prime-Time Specialty Vehicles (Prime-Time) is recalling certain 2016-2018 Ram ProMaster and Ford Transit vehicles modified to be equipped with Freedman GO-ES Foldaway Seats. When the seat back cushion is rotated from the stowed position to the upright position, the seat cushion may not remain locked into place when under load, such as in a crash or a sudden stop. In the event of a crash, if the seat back moves, the seat occupant has an increased risk of injury. Prime-Time Specialty Vehicles has notified owners, and Freedman dealers have inspected and repaired the foldaway seats, free of charge. The recall began November 16, 2018. Owners may contact Freedman customer service at 1-800-443-4540 or Prime-Time Specialty Vehicles at 1-574-293-9191.

19V-332