

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2017**

Published May 12, 2017

CHILD SEATS:

None during April 2017.

EQUIPMENT:

FiveCubits, Inc. (FiveCubits) is recalling certain TREQ-VMx mobile data tablets sold for use by commercial truck operators in the construction materials industry. The tablets contain lithium ion polymer batteries that may overheat. If the lithium ion polymer battery in the tablet overheats, there would be an increased risk of a fire. FiveCubits will notify owners and will push an over-the-air software update to keep the batteries at a low state of charge, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact FiveCubits customer service at 1-888-473-5832.

17E-020

Cummins, Inc. (Cummins) is recalling certain ISV5.0 light duty diesel engines installed exclusively in Tiffin Breeze motorhomes. The fan support bearing may fail, possibly resulting in the loss of fuel pump function, causing the engine to stall. An engine stall increases the risk of a crash. Cummins will notify owners, and dealers will replace the fan support and fan adapter, free of charge. The recall is expected to begin May 30, 2017. Owners may contact Cummins customer service at 1-800-286-6467. Cummins' number for this recall is C1885.

17E-021

TIRES:

None during April 2017.

VEHICLES:

Forest River, Inc. (Forest River) is recalling certain 2016-2017 XLR Toyhauler recreational vehicles. The fasteners for the side patio deck bar lock in these vehicles may not be strong enough, allowing the patio door to unlatch and the deck to drop unexpectedly. If the patio deck drops while the vehicle is in use, there would be an increased risk of a crash. Forest River will notify owners, and dealers will replace the fasteners with stronger ones, free of charge. The recall is expected to begin May 31, 2017. Owners may contact Forest River customer service at 1-574-642-0432. Forest River's number for this recall is 45-03242017-0360.

17V-227

McNeilus Truck & Manufacturing, Inc. (McNeilus) is recalling certain 2014-2016 Standard (REL-10), Heavy Duty (REL-11), Extra Compaction (XC/REL-13), 3.5 yd Tag Axle (TG/REL-16), Atlantic Front Loader (FEL-29), Zero Radius (ZR/ASL-48), AutoReach (AR/ASL-49), Pacific Ultra Front Loader (FEL-76) and Pacific Full Eject Front Loader (FEL-87) refuse trucks, and Bridgemaster(BMV) and Standard (STD) concrete mixers, equipped with Cummins ISX12G compressed natural gas (CNG) engines. These vehicles may have been built with an incorrect fitting to connect the low pressure CNG hose to the CNG fuel filter. The incorrect fitting may

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2017**

Published May 12, 2017

result in a CNG leak, which in the presence of an ignition source, may increase the risk of a fire. Additionally, the hose may disconnect from the filter and result in an engine stall, increasing the risk of a crash. McNeilus will notify owners, and pay for the owner's service technicians to install the correct fitting. The recall began on April 28, 2017. Owners may contact McNeilus customer service at 1-888-686-7278. McNeilus' number for this recall is VSR-TSB-017.

17V-228

Newmar Corporation (Newmar) is recalling certain 2017 King Aire motorhomes. The seals on the headlight harness connectors may not be properly seated, allowing water to enter the connector. As a result, the glass dash display may switch to the turn signal camera mode causing the dash to show the turn signal side camera view over the speedometer and RPM displays. If the driver cannot see the speedometer and RPM displays, there would be an increased risk of a crash. Newmar will notify owners, and dealers will inspect and reseal the seals as needed, free of charge. The recall began on April 21, 2017. Owners may contact Newmar customer service at 1-800-731-8300.

17V-229

Gulf Stream Coach, Inc. (Gulf Stream) is recalling certain 2011-2017 Amerilite trailers, model 14RBC. The Federal Placard on these vehicles may have incorrect Gross Vehicle Weight Rating (GVWR) information. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." Incorrect GVWR information may result in the trailer being overloaded, affecting the tires or the vehicle's handling, increasing the risk of a crash. Gulf Stream will notify owners and will provide a corrected Federal Placard, free of charge. The recall began on April 28, 2017. Owners may contact Gulf Stream customer service at 1-800-289-8787. Gulf Stream's number for this recall is GS040417.

17V-230

E-One Incorporated (E-One) is recalling certain 2013-2016 Typhoon and Cyclone II and 2014-2016 Quest emergency vehicles. The ball joints on the independent front suspension (IFS) modules can loosen and separate, leading to a partial loss of steering. A separated ball joint can cause a loss of steering control, increasing the risk of a crash. E-One will notify owners, and dealers will inspect, clean and secure the ball joint, free of charge. The recall is expected to begin May 22, 2017. Owners may contact E-One customer service at 1-800-627-5050.

17V-231

Tiffin Motorhomes, Inc. (Tiffin) is recalling certain 2017 Allegro Breeze motorhomes. The ball joints on the independent front suspension (IFS) modules can loosen and separate, leading to a partial loss of steering. A separated ball joint can cause a loss of steering control, increasing the risk of a crash. Tiffin will notify owners, and dealers will inspect, clean and secure the ball joint free of charge. The recall began on April 24, 2017. Owners may contact Tiffin customer service at 1-256-356-8661. Tiffin's number for this recall is TIF-108.

17V-232

Mitsubishi Motors North America, Inc. (MMNA) is recalling certain 2016 Outlander and Outlander Sport vehicles. The inside door latch mechanisms may not latch securely in high temperatures, allowing the doors to open while vehicle is in motion. If a door opens while the vehicle is being driven, it can increase the risk of injury.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2017**

Published May 12, 2017

MMNA will notify owners, and dealers will replace the door latches, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact MMNA customer service at 1-888-648-7820. MMNA's number for this recall is SR-17-002.

17V-233

Corp. Micro Bird Inc. (Micro Bird) is recalling certain 2016-2017 G5 school buses, equipped with certain Generation 4 Propane Conversion Kits. The fuel control valve solenoid may short circuit, shutting off the flow of propane to the engine, causing the engine to shut off. An engine stall while driving increases the risk of a crash. Micro Bird will notify owners, and Roush CleanTech dealers will replace the defective fuel control valve solenoid coils, free of charge. The recall began on April 25, 2017. Owners may contact Micro Bird customer service 1-819-477-2012, or Roush CleanTech at 1-800-597-6874. Micro Bird's number for this recall is 17-069-CUS.

17V-234

Forest River, Inc. (Forest River) is recalling certain 2017 Rockwood and Flagstaff recreational vehicles. The Federal Placard may indicate an incorrect Gross Axle Weight Rating (GAWR) of 2,200 lbs when the correct GAWR actually is 3,000 lbs. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." Inaccurate GAWR information on the Federal placard can increase the risk of a crash. Forest River will notify owner's, and dealers will install a corrected Federal Placard, free of charge. The recall began on April 21, 2017. Owner's may contact Forest River customer service at 1-574-642-2640. Forest River's number for this recall is 10-04042017-0366.

17V-235

Altec Industries Inc. (Altec) is recalling certain 2004-2005 AM547, AM650, 855, 862 Aerial Devices and AM650 and 855 Elevators. The fiberglass upper boom on these vehicles may fail without warning. If the upper boom were to fail during operation, it would increase the risk of serious injury or death. Altec has notified owners, and dealers will inspect the fiberglass upper boom, free charge. The recall began on April 7, 2017. Owners may contact Altec customer service at 1-877-462-5832. Altec's number for this recall is CSN 654.

17V-236

Forest River Inc. (Forest River) is recalling certain 2007-2011 Cherokee recreational trailers. The Federal Placards on these vehicles incorrectly state a Gross Axle Weight Rating (GAWR) of 3,970 lbs., when the actual capacity is 3,500 lbs. The Gross Vehicle Weight Rating (GVWR) is also incorrect. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." The incorrect information may result in a user unintentionally overloading the vehicle, increasing the risk of the crash. Forest River will notify owners, and dealers will replace the Federal Placard with corrected one, free of charge. The recall is expected to begin June 5, 2017. Owners may contact Forest River at 1-260-593-4001 extension 17119. Forest River's number for this recall is 17-04042017-0367.

17V-237

Thor Motor Coach (TMC) is recalling certain 2017 Palazzo 36.1 and 36.3 motorhomes. The Federal certification label on these vehicles indicates an incorrect front tire rim size. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." If the front rim is replaced based on the incorrect

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2017**

Published May 12, 2017

label information, it can cause an unsafe driving condition, increasing the risk of a crash. TMC will notify owners and will provide corrected replacement labels, free of charge. The recall expected to begin June 5, 2017. Owners may contact TMC customer service at 1-877-500-1020. TMC's number for this recall is RC000133.

17V-238

Thor Motor Coach (TMC) is recalling certain 2017 Ace, Hurricane, and Windsport motorhomes. The weight rating labels for the tow hitches on these vehicles indicate a 10,000lb weight capacity when the actual hitch capacity is 8,000lbs. If the hitch is loaded to the capacity on the label, the hitch may damage the motorhome or the hitch may disconnect from the tow vehicle, increasing the risk of the crash. TMC will notify owners and provide them corrected labels, free of charge. The recall is expected to begin June 7, 2017. Owner's may contact TMC customer service at 1-877-500-1020.

17V-239

BMW of North America, LLC (BMW) is recalling certain 2017-2018 M760Li xDrive vehicles. The affected vehicles have engine oil cooler lines that may loosen causing an oil leak in the engine compartment. The leaking engine oil may get onto the front brake disks, lengthening the distance needed to stop the vehicle and increasing the risk of a crash. BMW will notify owners, and dealers will inspect the engine oil cooler lines, replacing them as necessary, free of charge. The recall is expected to begin June 1, 2017. Owners may contact BMW customer service at 1-800-525-7417.

17V-240

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain 2016 GLE300d 4Matic, E400 4Matic Coupe, GL63 AMG, GLE350, GLE350 4Matic, GLE350d 4Matic, GLE400 4Matic, GLE43 AMG Coupe 4Matic, GLE550e 4Matic, GLE63 AMG 4Matic, GLE63S AMG 4Matic and GLE63S AMG Coupe 4Matic vehicles, 2017 E300 4Matic and GLS63 AMG 4Matic vehicles, and 2016-2017 GL350 4Matic BlueTec, GL450 4Matic, and GL550 4Matic vehicles. The affected vehicles have an electric power steering connector that may be insufficiently sealed, allowing water to enter the control unit. If water enters the power steering control unit, the power steering assist may be deactivated, increasing the risk of a crash. MBUSA will notify owners, and dealers will replace the connector and inspect the electric power steering rack, replacing the rack as necessary. These repairs will be performed free of charge. The recall is expected to begin in May 2017. Owners may contact MBUSA customer service at 1-800-367-6372.

17V-241

Duruxx LLC (Duruxx) is recalling certain 2015-2016 DRX2 Low-Speed vehicles. The affected vehicles can exceed the 40 km/h speed allowed under the "Low Speed Vehicle" classification. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 500, "Low Speed Vehicles." If the vehicles can exceed the allowed speed, it can increase the risk of a crash. Duruxx will notify owners, and dealers will adjust the throttle body to limit the maximum speed, free of charge. The recall is expected to begin May 15, 2017.

17V-242

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain 2016-2017 C300 vehicles. The electrical contacts

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2017**

Published May 12, 2017

for the power steering electric motor may not have been properly welded, possibly resulting in a loss of electrical contact. A loss of electrical contact will cause the electric power steering assist to deactivate, increasing the risk of a crash. MBUSA will notify owners, and dealers will replace the electric power steering rack, free of charge. The recall is expected to begin in June 2017. Owners may contact MBUSA customer service at 1-800-367-6372.

17V-243

Daimler Vans USA, LLC (DVUSA) is recalling certain 2016 Mercedes-Benz Metris vehicles. The affected vehicles have front seat seatbelt pretensioners that may not function properly in the event of a crash. If the front seat seatbelt pretensioners do not function properly, the seat occupants may not be adequately restrained in the event of a crash, increasing the risk of injury. DVUSA will notify owners, and dealers will replace the front seat belts, free of charge. The recall is expected to begin in June 2017. Owners may contact DVUSA customer service at 1-877-762-8267.

17V-244

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain 2017 E300 and E300 4MATIC vehicles. The software for the widescreen instrument cluster may cause the instrument cluster to not display anything on vehicle on startup, or the display may reset while driving. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 101, "Control and Displays." Without the instrument cluster displaying important information such as the vehicle's speed, there would be an increased risk of a crash. MBUSA will notify owners, and dealers will update the instrument cluster display software, free of charge. The recall is expected to begin in late May 2017. Owners may contact MBUSA customer service at 1-800-367-6372.

17V-245

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain 2016-2017 E300 and 2017 E300 4MATIC vehicles. The affected vehicles have a roof mounted spoiler that may not be properly attached and thus may detach while driving. If the roof-mounted spoiler detaches while driving, it can become a road hazard, increasing a risk of a crash. MBUSA will notify owners, and dealers will inspect the roof spoilers, replacing them as necessary, free of charge. The recall is expected to begin in early June 2017. Owners may contact MBUSA customer service at 1-800-367-6372.

17V-246

Mercedes-Benz USA, LLC. (MBUSA) is recalling one 2013 R320 4MATIC CDI vehicle equipped with a six-cylinder diesel engine. In the event of a crash where the primary communication pathway between the air bag control unit and the engine control unit is damaged, the supplementary communication pathway may not shut off the engine or fuel pump. If the engine and fuel pump after not shut off after a crash, there would be an increased risk of a fire. MBUSA will notify the owner, and a dealer will update the engine control unit with new software, free of charge. The recall is expected to begin by early June 2017. Owners may contact MBUSA customer service at 1-800-367-6372.

17V-247

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2017**

Published May 12, 2017

PROLine Products LLC (PROLine) is recalling certain 2016-2017 Cargo trailers equipped with 3500lb-capacity galvanized Dexter Torflex axles. Due to the acorn wheel nuts that secure the wheels to the hub being too short, the wheels may detach during use. If the trailer wheels loosen or detach, it can increase the risk of a crash. PROLine will notify owners, and dealers will replace the acorn wheel nuts, free of charge. The recall began on April 21, 2017. Owners may contact PROLine customer service at 1-800-994-0960.

17V-248

Foretravel, Inc. (Foretravel) is recalling certain 2012-2018 ih-45, Phenix and Nimbus motorhomes. The ball joints on the independent front suspension (IFS) modules can loosen and separate, leading to a partial loss of steering. A separated ball joint can cause a loss of steering control, increasing the risk of a crash. Foretravel will notify owners, and dealers will inspect clean, and secure the ball joint, free of charge. The recall began on April 26, 2017. Owners may contact Foretravel customer service at 1-800-955-6226, option 3.

17V-249

Mercedes-Benz USA, LLC.(MBUSA) is recalling certain 2013-2016 G550 and G63 AMG vehicles and 2016 G65 AMG vehicles. The steering coupling may have been insufficiently tightened, resulting in the steering connection wearing. The steering coupling wear may cause a loss of steering, increasing the risk of a crash. MBUSA will notify owners, and dealers will replace the steering coupling, free of charge. The recall is expected to begin in May 2017. Owners may contact MBUSA customer service at 1-800-367-6372.

17V-250

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2017 C300, C300 4Matic, C300 Coupe, C300 Coupe 4Matic, C43 AMG, C43 AMG Coupe, C43 AMG Cabrio, C63 AMG, C63 AMG Coupe, C63S AMG, C63S AMG Coupe, C63S Cabrio, GLC300, GLC300 4Matic, GLC43 AMG, S550, S550 4Matic, S550e, S600, S63 AMG 4Matic, S65, Mercedes-Maybach S550 4Matic, and Mercedes-Maybach S600 vehicles. The affected vehicles have front seat seatbelt pretensioners that may not function properly in the event of a crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 208, "Occupant Crash Protection," and 209, "Seat Belt Assemblies." If the front seat seatbelt pretensioners do not function properly, the seat occupants may not be adequately restrained in the event of a crash, increasing the risk of injury. MBUSA will notify owners, and dealers will replace the front seat belts, free of charge. Remedy parts are not currently available. Owners will be notified of the recall in May 2017 and will be sent a second notification when remedy parts become available. Owners may contact MBUSA customer service at 1-800-367-6372.

17V-251

Mercedes-Benz USA LLC. (MBUSA) is recalling certain 2013-2014 C250, C300 4MATIC, GLK250 4MATIC BLUETEC and GLK350 vehicles, 2013 C250 Coupe, C350, C350 4MATIC Coupe, C350 Coupe and C63 AMG Coupe vehicles, and 2013-2015 GLK350 4MATIC vehicles. The steering coupling connecting bolt may have been insufficiently tightened, possibly resulting in a loss of steering. A loss of steering can increase the risk of a crash. MBUSA will notify owners, and dealers will inspect the steering coupling connecting bolt, tightening it as necessary, free of charge. The recall is expected to begin in May 2017. Owners may contact MBUSA customer service at 1-800-367-6372.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2017**

Published May 12, 2017

17V-252

Nissan North America, Inc. (Nissan) is recalling certain 2015-2017 LEAF and 2014, 2016 and 2017 Sentra vehicles. Due to a manufacturing error within the air bag inflators, the passenger frontal air bag may not properly deploy in the event of a crash. In the event of a crash, if the front passenger air bag doesn't deploy properly, it can increase the risk of injury to passengers. Nissan will notify owners, and dealers will replace the front passenger air bag inflator, free of charge. The recall is expected to begin June 11, 2017. Owners may contact Nissan customer service at 1-800-647-7261.

17V-253

Rosenbauer Motors (Rosenbauer) is recalling certain 2012-2017 Commander vehicles. The ball joints on the independent front suspension (IFS) modules can loosen and separate, leading to a partial loss of steering. A separated ball joint can cause a loss of steering control, increasing the risk of a crash. Rosenbauer will notify owners, and dealers will inspect, clean and secure the ball joint free of charge. The recall is expected to begin May 22, 2017. Owners may contact Rosenbauer customer service at 1-651-462-1000.

17V-254

Corp. Micro Bird Inc. (Micro Bird) is recalling certain 2012-2017 MB II school buses. In the event of a rollover, the roof strength may be insufficient to prevent the roof from crushing. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 220, "School Bus Rollover Protection." In the event of a rollover, if the school bus roof crushes, the occupants have an increased risk of injury. Micro Bird will notify owners, and dealers will modify the buses to prevent the roof from crushing, free of charge. The recall is expected to begin May 12, 2017. Owners may contact Micro Bird customer service at 1-819-477-2012. Micro Bird's number for this recall is 17-070-SUS. Note: This recall supersedes recall 15V-683.

17V-255

Honda (American Honda Motor Co.) is recalling certain 2017 CR-V and Acura RDX vehicles. A printer ribbon was incorrectly installed into the Certification Label Printer, which can allow the information to be wiped away with an alcohol solvent. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." If the label information can be wiped away, it can allow the operator to not know proper loading information, which can increase the risk of a crash. Honda will notify owners, and dealers replace the Certification Label, free of charge. The recall is planned to begin May 2017. Owners may contact Honda customer service at 1-888-234-2138.

17V-256

Navistar, Inc. (Navistar) is recalling certain 2016-2018 IC Bus CE school buses equipped with a plastic booster pump, 17k Webasto heater and a Webasto Smart Temp timer. The power circuit for the heater booster pump may be unfused. Without circuit protection, if the vehicle has a heater booster pump electrical failure, it can increase the risk of a fire. Navistar will notify owners, and dealers will relocate the circuit to a fused section of the power distribution center, free of charge. The recall is expected to begin June 16, 2017. Owners may contact Navistar customer service at 1-331-332-1590. Navistar's number for this recall is 17503.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2017**

Published May 12, 2017

17V-257

Volvo Trucks North America (Volvo) is recalling certain 2015-2017 VHD trucks. The Gross Axle Weight Rating (GAWR) for the pusher or tag axle may be incorrect on the certification label. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." If the GAWR information is incorrect, the operator may overload the vehicle, increasing the risk of a crash. Volvo will notify owners, and dealers will a corrected label, free of charge. The recall is expected to begin June 16, 2017. Owners may contact Volvo customer service at 1-800-528-6586. Volvo's number for this recall is RVXX1701.

17V-258

Stoughton Trailers, LLC (Stoughton) is recalling certain 2017-2018 DAVW and DVW 285S dry van single-axle trailers. The outside welds that attach the front suspension hangers to the subframe may crack, allowing the front hanger to detach. If the hangers detach, the axle assemblies will break loose from the trailer causing a loss of vehicle control and increasing the risk of a crash. Stoughton will notify owners, and dealers will inspect the front hanger for cracks, repairing them as necessary. Dealers will also install gussets inside the subframe, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Stoughton customer service at 1-608-873-2500.

17V-259

Tesla, Inc. (Tesla) is recalling certain 2016 Model S and Model X vehicles. The electric parking brake calipers have an internal gear that may be improperly manufactured, possibly resulting in the gear fracturing during parking brake application or release. If the gear breaks during parking brake release, the vehicle will not be able to be moved. If the gear breaks during parking brake application, the parking brake may not adequately hold the vehicle, potentially resulting in the vehicle rolling, increasing the risk of a crash. Tesla will notify owners, and service centers will replace the electric parking brake calipers, free of charge. Owners may contact Tesla customer service at 1-877-798-3752. Tesla's number for this recall is SB-17-33-002.

17V-260

Mack Trucks, Inc. (Mack) is recalling certain 2015-2018 LR and 2011-2018 TerraPro (LEU and MRU) trucks. The alternator cable may be insufficiently thick to handle the current, and, as a result, may overheat. If the alternator cable overheats, it would increase the risk of a fire. Mack will notify owners, and dealers will replace the alternator cable, free of charge. The recall is expected to begin June 16, 2017. Owners may contact Mack customer service at 1-800-866-1177. Mack's number for this recall is SC0407.

17V-261

Winnebago Industries, Inc (Winnebago) is recalling certain 2014-2017 Winnebago View, VIA, ERA, and Itasca Navion motorhomes. The affected vehicles have an Axxess radio volume control module that may interfere with the chassis electrical system. The Axxess radio volume control module can affect electrical system functions, possibly causing an engine shutdown, power loss, illumination of malfunction indicator warning lights, and interfere with the restraint system. These scenarios can increase the risk of crash or increase the risk of injury in the event of a crash. Winnebago will notify owners, and dealers will remove the Axxess radio volume control module, free of charge. The manufacturer has not provided a recall notification schedule. Owners may contact

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2017**

Published May 12, 2017

Winnebago customer service at 1-800-537-1885.

17V-262

Gillig LLC (Gillig) is recalling certain 2015-2016 Low Floor transit buses equipped with Norgren-brand suspension kneeling modules. The suspension kneeling modules on these vehicles have snap rings on the solenoid valve pistons which may not have been fully inserted and seated during assembly, potentially affecting the suspension air bag pressure and the vehicle's suspension height. An unexpected loss of suspension air bag pressure while driving would result in an abrupt reduction in suspension height, potentially increasing the risk of a crash. A loss of suspension air bag pressure could also occur during vehicle servicing, increasing the risk of injury to maintenance personnel. Gillig will notify owners and pay fleets to inspect the front and rear kneeling modules. A snap ring reset tool will be provided free of charge to permanently seat the snap ring in the intended groove. The recall is expected to begin May 19, 2017. Owners may contact Gillig customer service at 1-800-735-1500.

17V-263

Thor Motor Coach (TMC) is recalling certain 2017 Quantum KM24 motorhomes. The power supply wire for the steps was incorrectly attached to a 50 amp circuit breaker instead of being connected to a 20 amp circuit breaker. Should the step circuit be overloaded, the breaker may not trip as intended, increasing the risk of a fire. TMC will notify owners, and dealers will relocate the power wire for the steps to the correct breaker, free of charge. The recall is expected to begin June 07, 2017. Owners may contact TMC customer service at 1-877-500-1020. TMC's number for this recall is RC000135.

17V-264

General Motors LLC (GM) is recalling certain 2014-2016 Chevrolet Caprice Police Pursuit vehicles (PPV), previously remedied under recall 16V-160. The connector between the electric power steering module and the torque sensor may fail, possibly resulting in a loss of electric power steering assist. A greater steering effort would be needed to control the vehicle if power steering assist is lost, especially at lower speeds, increasing the risk of a crash. GM will notify owners, and dealers will inspect the steering gear assembly, replacing it as necessary, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Chevrolet customer service at 1-800-222-1020.

17V-265

Forest River, Inc. (Forest River) is recalling certain 2017-2018 Prime Time Avenger motorhomes, model AVT31DBS. The Federal Placard on these vehicles only indicates that the rear tire size is ST225/75R15E tires with 80 PSI, when the placard should state that the front, rear, and spare tires are ST225/75R15E tires with 80 PSI. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims," and 567, "Certification." The incomplete Federal placard information could cause the user to install an incorrect tire, resulting in a possible overloading of the vehicle, increasing the risk of a crash. Forest River will notify owners and will provide a corrected Federal placard, free of charge. The recall is expected to begin June 19, 2017. Owners may contact Forest River customer service at 1-574-862-1025. Forest River's number for this recall is 50-04182017-0392.

17V-266

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2017**

Published May 12, 2017

General Motors LLC (C) is recalling certain 2017 Buick LaCrosse vehicles. The rear suspension toe-links may have been incorrectly installed, and, as a result, they may loosen and disconnect from the rear suspension system. If a rear-suspension toe-link disconnects, it may cause a loss of vehicle control, increasing the risk of a crash. GM will notify owners, and dealers will inspect the left and right rear suspension toe-link assemblies, correcting their installation as necessary, free of charge. The recall is expected to begin June 20, 2017. Owners may contact Buick's customer service at 1-800-521-7300. GM's number for this recall is 17168.

17V-267

National Fleet Services of Ohio (National Fleet) is recalling certain 2016 Ford E-450 vehicles equipped with Roush, Generation 4, Propane Conversion Kits. The fuel control valve solenoid may short circuit, shutting off the flow of propane to the engine, causing the engine to shut off. An engine stall while driving increases the risk of a crash. National Fleet will notify owners, and Roush dealers will replace the defective fuel control valve solenoid, free of charge. The recall is expected to begin in May 2017. Owners may contact National Fleet customer service at 1-440-903-5177, or Roush customer service at 1-800-597-6874. National Fleet's number for this recall is VR.

17V-269

Riverside RV (Riverside) is recalling certain 2017-2018 Whitewater and Mt. McKinley travel trailers. These trailers were manufactured without rear-facing reflectors and have non-reflective tail lights. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." Without rear-facing reflectors or reflective tail lights, the vehicle may have reduced visibility from behind, increasing the risk of a crash. Riverside will notify owners, and dealers will install reflective tape on the rear bumper below the tail lights, free of charge. The recall began on May 11, 2017. Owners may contact Riverside customer service at 1-260-499-4578.

17V-270

Grand Design RV, LLC (Grand Design) is recalling certain 2017-2018 Imagine travel trailers. The screws that secure the slide room mechanism columns may shear, allowing the slide room to extend while the trailer is being towed. If the slide room opens during transit there would be an increased risk of a crash. Grand Design will notify owners, and dealers will replace the slide mechanism column securing screws, free of charge. The recall is expected to begin May 22, 2017. Owners may contact Grand Design customer service at 1-574-825-9679. Grand Design's number for this recall is 910009.

17V-271

Daimler Vans USA, LLC (DVUSA) is recalling certain 2013-2014 Freightliner Sprinter and 2016 Mercedes-Benz Metris vehicles. During vehicle servicing, the affected vehicles received software updates that may conflict with some of the vehicle's computers. The improper software may cause problems with the electronic stability control system, the air bag control unit or the engine management software. These problems can result in an increased risk of a crash or an increased risk of injury in the event of a crash. DVUSA will notify owners, and Mercedes-Benz and Freightliner dealers will update the affected control units on the vehicles, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact DVUSA customer service at 1-877-762-8267.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2017**

Published May 12, 2017

17V-272

Chrysler (FCA US LLC) is recalling certain 2014-2017 Ram ProMaster vehicles. The sun visor, dashboard labels, and owner's manuals incorrectly state that the vehicles are equipped with frontal driver and passenger advanced air bags when they are not. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 208, "Occupant Crash Protection." The incorrect information may change how close the occupants position themselves to the air bags, increasing the risk of injury in the event of a crash. Chrysler will notify owners, and dealers will correct the sun visor labels, the dashboard (hangtag) label, and the owner's manual and user guide information, free of charge. The recall is expected to begin June 9, 2017. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is T24.

17V-273

Ducati North America (Ducati) is recalling certain 2016-2017 Multistrada 1200 Enduro motorcycles. The motorcycles rear shock absorber lower shock-end eyelet can crack and possibly cause the swingarm to detach. If the rear shock absorber lower shock-end eyelet cracks resulting in the swing arm to possibly detach, causing loss of control, increasing the risk of a crash. Ducati will notify owners, and dealers will be replacing the rear shock absorber assembly, free of charge. The recall is expected to begin May 22, 2017. Owners may contact Ducati customer service at 1-408-253-0499. Ducati's number for this recall is SRV-RCL-17-002.

17V-274

Nissan North America, Inc. (Nissan) is recalling certain 2017 Versa, and Versa Note vehicles. The ring plate that secures the air bag cushion to the passenger frontal air bag assembly may fail, possibly causing the air bag to deploy improperly in the event of a crash. In the event of a crash, if the passenger frontal air bag does not deploy as intended, it can increase the risk of injury. Nissan will notify owners, and dealers will replace the passenger frontal air bag module, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Nissan customer service at 1-800-647-7261.

17V-275

Livin' Lite Recreational Vehicles (Livin' Lite) is recalling certain 2018 Quicksilver recreational trailers, model TH 7X20. The frame structures that support the trailer floor may fail. If enough of the support structures fail, the trailer may have structural instability, increasing the risk of a crash. Livin' Lite will notify owners, and dealers will reinforce the outrigger frame structures and add additional outriggers as needed. These repairs will be performed free of charge. The recall is expected to begin June 19, 2017. Owners may contact Livin' Lite customer service at 1-866-272-5578.

17V-276

Elgin Sweeper Company Inc. (Elgin) is recalling certain 2016-2017 Eagle-F, Broom Bear-H, and Road Wizard street sweepers. The main broom flap support end cap may detach from the sweeper. If the main broom flap support end cap detaches from the sweeper, it may be a road hazard, increasing the risk of a crash. Elgin will notify owners, and dealers will replace the main broom flap support end cap with a newly designed part, free of charge. The recall began on May 11, 2017. Owners may contact Elgin customer service at 1-877-342-5374.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2017**

Published May 12, 2017

Elgin's number for this recall is SB-0201.

17V-278

Polaris Industries, Inc. (Polaris) is recalling certain 2016-2017 GEM E2, E4, E6, and ELXD electric vehicles, equipped with steel wheels. The lug nuts on the front wheels may loosen, potentially resulting in a front wheel detaching from the vehicle. If a wheel separates from the vehicle, it can increase the risk of a crash. GEM will notify owners. The manufacturer has not yet finalized a remedy plan, nor provided a notification schedule. Owners may contact GEM Consumer Service Department at 1-855-743-3436. Polaris' number for this recall is L-17-01.

17V-279

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2015 Audi A3 1.8T FWD S tronic and 2.0T Quattro S tronic vehicles. The safety certification label has an incorrect vehicle production date. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." In the event of a vehicle safety recall, an incorrect production date may prevent owners from determining if the recall affects them, increasing their risk of injury or a crash. Audi will notify owners, and dealers will install an overlay label containing the correct vehicle production date, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Audi customer service at 1-800-253-2834. Volkswagen's number for this recall is 51F5.

17V-280

Keystone RV Company (Keystone) is recalling certain 2017 CrossRoads Volante trailers, model 310BH. The rear upper bunk may not be properly supported. Without the proper supports, the bunk may fall when it is occupied, increasing the risk of injury. Keystone will notify owners, and dealers will add screws through the bunk supports into the wall studs, free of charge. The recall began on May 10, 2017. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 17-284.

17V-281

Forest River, Inc. (Forest River) is recalling certain 2017-2018 Salem, Wildwood, XLR, Sanibel, Wildcat, Vengeance, Chaparral Lite and Columbus recreational trailers. The Federal Placard may inaccurately list the tire and rim combinations that are installed on the trailers. Additionally, the Gross Axle Weight Rating (GAWR) and the Gross Vehicle Weight Rating (GVWR) information may be incorrect. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims," and 49 CFR part 567, "Certification." The incorrect information may cause the operator to install an incorrect replacement rim or tire, overinflate the tire, or overload the vehicle, all scenarios that may increase the risk of a crash. Forest River will notify owners and will provide a corrected Federal Placard, free of charge. The recall is expected to begin June 22, 2017. Owners may contact Forest River customer service at 1-800-348-7440. Forest River's number for this recall is 51-04242017-0393.

17V-282

Thor Motor Coach (Thor) is recalling certain 2016-2017 Venetian and Tuscany motorhomes equipped with Cummins ISL engines. These vehicles, built on a Freightliner chassis, have a power steering hose that may be

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2017**

Published May 12, 2017

routed incorrectly, and, as a result, the hose may rub against the power stud on the starter motor, possibly causing electrical arcing and a power steering fluid leak. Electrical arcing in the presence of leaking power steering fluid can increase the risk of a fire. Daimler Trucks (DTNA), the manufacturer of the Freightliner chassis has notified the motorhome owners, and DTNA dealers will reroute the high pressure power steering hose to provide adequate clearance from the starter stud, free of charge. The recall began on December 27, 2016. Owners may contact DTNA customer service at 1-800-547-0712 or Thor customer service at 1-877-500-1020. Thor's number for this recall is FL727A.

17V-283

Thor Motor Coach (Thor) is recalling certain 2015 Tuscany motorhomes built on a Freightliner Custom Chassis Corporation (FCCC) XCM, XCR, or XCL motorhome chassis manufactured by Daimler Trucks North America (DTNA). In these vehicles with a heavier, adjustable, straight foot pedal, the brake activation signal to certain towed devices may not deactivate when the motorhome service brakes are released. If the brake activation signal to a towed device remains active when the motorhome chassis service brakes are released, the brakes on a towed device may remain engaged depending on brake configuration of the trailer. As a result, the brakes would drag and possibly overheat potentially resulting in a fire. Additionally, following drivers may be confused by the motorhome's actions, increasing the risk of a crash. DTNA has notified owners, and Freightliner dealers will modify the affected pedal assemblies, free of charge. The recall began on November 7, 2016. Owners may contact DTNA customer service at 1-800-547-0712 or Thor customer service at 1-877-500-1020. Thor's number for this recall is FL723AB.

17V-284

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain 2016-2017 Tacoma vehicles. Oil may leak from the area where the rear differential carrier is assembled to rear axle housing. If the vehicle is operated with an insufficient amount of oil in the rear differential, the differential may seize and cause a loss of control, increasing the risk of a crash. Toyota will notify owners, and dealers will inspect the rear differential for oil leakage. Based on the inspection, dealers will either tightening the fastening nuts or replace the fastening nuts and gasket. If the rear differential components are damaged, the rear differential carrier assembly will be replaced. The repairs will be performed free of charge. The recall is expected to begin June 12, 2017. Owners may contact Toyota customer service at 1-800-331-4331. Toyota's number for this recall is H0G.

17V-285

Jaguar Land Rover North America, LLC (Jaguar) is recalling certain 2017 XE vehicles equipped with a 2.0L diesel engine. The vehicles have a fuel return hose that may leak. A diesel fuel leak onto the road surface may cause a skid hazard, increasing the risk of a crash. If the fuel leak contacts a hot engine or exhaust component, there would be an increased risk of a fire. Jaguar will notify owners, and dealers will replace the fuel return hose, free of charge. The recall is expected to begin June 19, 2017. Owners may contact Jaguar customer service at 1-800-452-4827. Jaguar's number for this recall is H016.

17V-286

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2016-2017 CC vehicles. Incorrect front seat head restraints (rests) may have been installed, possibly resulting in the seat occupant's head being

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2017**

Published May 12, 2017

inadequately restrained in the event of a crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 202a, "Head Restraints." If the seat occupant's head is inadequately restrained in the event of a crash, they have an increased risk of injury. Volkswagen will notify owners, and dealers will replace the front seat head restraints, free of charge. The recall is expected to begin in June 2017. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's number for this recall is 72G5.

17V-287