

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING APRIL 2018**

*Published May 31, 2018*

**CHILD SEATS:**

Harmony Juvenile Products (Harmony) is recalling certain Harmony Big Boost Deluxe booster seats. In the event of a crash, the seat belt may cause excessive force to be applied to the restrained child's chest. As such, these booster seats fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 213, "Child Restraint Systems." Excessive chest force can increase the risk of injury. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Harmony customer service at 1-877-306-1001.

**18C-001**

**EQUIPMENT:**

Brembo S.p.A. (Brembo) is recalling certain motorcycle front brake master cylinders, part numbers 10.4623.62 and 10.4623.63. The piston within the front brake master cylinder may crack and fail. If the front brake master cylinder piston fails, the loss of front braking ability can increase the risk of a crash. Brembo has notified the motorcycle manufacturers that built motorcycles with the affected master cylinders, and they are conducting recalls to have their dealers replace the pistons with aluminum ones, free of charge. The recall began December 13, 2017.

**18E-018**

Badass Helmet Company (Badass Helmet) is recalling certain Rogue helmets. These helmets may not adequately protect the wearer in the event of a head impact during a motorcycle crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 218, "Motorcycle Helmets." A helmet that fails to meet the safety requirements can increase the risk of injury in the event of a crash. Badass Helmet will notify owners, and issue a full refund. The manufacturer has not yet provided a notification schedule. Owners may contact Badass Helmet customer service at 1-866-334-3563.

**18E-019**

Badass Helmet Company (Badass Helmet) is recalling certain Metalhead 2.5 helmets. These helmets may not adequately protect the wearer in the event of a head impact during a motorcycle crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 218, "Motorcycle Helmets." A helmet that fails to meet the safety requirements can increase the risk of injury in the event of a crash. Badass Helmet will notify owners, and issue a full refund. The manufacturer has not yet provided a notification schedule. Owners may contact Badass Helmet customer service at 1-866-334-3563.

**18E-020**

Reading Truck Body, LLC. (Reading) is recalling certain 108 inch and 132 inch Standard Production Panel Bodies. The bottom flange of the rear cross member may crack where the truck body sits on the chassis frame, potentially damaging the turn signal wiring. Damaged turn signal wiring can cause the turn signals to function improperly, increasing the risk of a crash. Reading will notify owners, and dealers will inspect the panel body for cracks, and either install reinforcement brackets, or replace the truck body, free of charge. The recall is expected to begin June 2018. Owners may contact Reading customer service at 1-800-458-2226.

**18E-021**

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING APRIL 2018**

*Published May 31, 2018*

Keystone Automotive Operations, Inc. (Keystone) is recalling certain Husky Towing Products, fifth wheel trailer hitches, part numbers 31569/14-1706, and 31570/14-1707. The fasteners in the fifth wheel trailer hitch may loosen, potentially causing the jaws to unexpectedly open or preventing the jaws from being able to be unlocked. If the jaws unexpectedly open, the fifth wheel trailer will not be secured to the tow vehicle, increasing the risk of a crash. Keystone will notify owners, and dealers will replace the affected hardware using thread locker, free of charge. Owners may contact Keystone customer service at 1-800-432-8063.

**18E-022**

SynTec Seating Solutions, LLC (SynTec) is recalling certain S3B Restraint Wall Mounted Seats. The wall mounting bracket may crack, causing the seat to not remain secured in place in the event of a crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 210, "Seat Belt Assembly Anchorages," 222, "School Bus Passenger Seating and Crash Protection." In the event of a crash, if the seat does not remain secured to the wall, the occupant has an increased risk of an injury. Syntec will notify the bus manufacturers that purchased the seats, and dealers for those companies will install an additional wall mounting bracket, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Syntec customer service at 1-336-862-7509. Syntec's number for this recall is RESB100.

**18E-023**

Robert Bosch Automotive Steering (Bosch) has submitted a Defect Information Report based upon decisions by Ford Motor Company and Tesla, Inc. to conduct recalls (No. 15V250 and No. 18V204, respectively) to replace the aluminum mounting bolts in Bosch-supplied Electric Power Steering (EPS) systems that can corrode after exposure to certain driving environments such as road salt. If the aluminum bolts corrode, they may fracture, allowing the steering gear motor to detach and cause a reduction or loss of power steering assist, increasing the risk of a crash. Bosch is working with the affected vehicle manufacturers. Dealers for those manufacturers will replace the steering gear mounting bolts and add a corrosion-preventative sealer, free of charge. Ford owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 15S14. Tesla owners may contact Tesla customer service at 1-877-798-3752. Tesla's number for this recall is SB-18-32-002.

**18E-024**

ZF North America, Inc. (ZF) is recalling certain Axles equipped with radial air disk brakes. Surface roughness of a guide pin in the radial brake calipers may cause the brake carriage guide pin support bolt to break. Breakage of the guide pin can cause loss of braking ability or loss of tire pressure, increasing the risk of a crash. ZF has notified the vehicle manufacturers that purchased the affected axles. The remedy for this recall is still under development. Owners may contact ZF customer service at 1-734-416-6200.

**18E-025**

MORryde International, Inc. (MORryde) is recalling certain Rotational Rubber Pin Boxes, part number RTPB83-1622-03. The spindle placement may be incorrect, causing the bearing to be loose. A loose bearing can cause the spindle to fail, possible resulting in a loss of control of the fifth wheel trailer, increasing the risk of a crash. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact MORryde customer service at 1-574-293-1581.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING APRIL 2018**

*Published May 31, 2018*

**18E-026**

Advance Stores Company, Incorporated (Advance Stores) is recalling certain ToolWorks TW1489 Fuse Kits sold through Advance Auto Parts and Carquest stores. The fuses in the kits may fail to protect the circuit from excessive current. If the circuit is overloaded and the fuse fails to perform as intended, the vehicle wiring and electrical components could be damaged, increasing the risk of a fire. Advance Stores will notify the known purchasers, and replace the fuse kits with those of another brand, and also provide a full refund, free of charge. Owners may contact Advance Stores customer service at 1-877-238-2623, select option 3.

**18E-027**

**TIRES:**

Kumho Tire U.S.A., Inc. (Kumho) is recalling certain Solus KH16 tires, size P225/65R17. The tire belts may separate under severe conditions. A tire belt separation can increase the risk of a crash. Kumho will notify owners, and dealers will replace all affected tires, free of charge. The recall began May 17, 2018. Owners may contact Kumho customer service at 1-800-445-8646.

**18T-004**

**VEHICLES:**

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain 2018 Toyota Camry and Highlander vehicles, 2017 Toyota Sienna and Tacoma vehicles and 2017 Lexus RX350 vehicles. During the manufacturing process, the oil galley in the rotor for the brake booster vacuum pump assembly may have been improperly machined possibly resulting in a sudden loss of brake assist. A sudden loss of braking assist can increase the risk of a crash. Toyota will notify owners, and dealers will replace the brake booster vacuum pump, free of charge. The recall began on May 9, 2018. Owners may contact Toyota customer service at 1-888-270-9371, or Lexus customer service at 1-800-255-3987. Toyota's numbers for this recall are J0K/JLD.

**18V-211**

KZRV, L.P. (KZRV) is recalling certain 2018 KZRV Sportsmen Classic recreational trailers, models 130RB and 150RBT. These vehicles are equipped with Norcold N306 mini refrigerators that may have a loose or missing propane gas valve test port screw. The loose or missing propane gas port screw can allow propane gas to leak when the refrigerator is used in 'gas' mode, increasing the risk of a fire. KZRV will notify owners, and dealers will install and tighten the gas valve port screw, as necessary, free of charge. The recall began on April 16, 2018. Owners may contact KZRV customer service at 1-800-768-4016 extension 154 or 153. KZRV's number for this recall is KZ-2018-02.

**18V-212**

Ford Motor Company (Ford) is recalling certain 2017-2018 Ford F-150 and 2018 Ford Expedition and

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING APRIL 2018**

*Published May 31, 2018*

Mustang and Lincoln Navigator vehicles equipped with 10-speed automatic transmissions. A roll pin may not have been installed in the transmission, potentially causing a loss of the "Park" function. Despite the transmission shift lever being placed in 'Park' and the instrument panel display indicating 'Park,' the vehicle may roll away after it has been exited if the parking brake has not been applied, increasing the risk of injury or a crash. Ford will notify owners, and dealers will inspect the transmission to make sure it has the roll pin, installing one if it is missing, free of charge. The recall began on April 13, 2018. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 18S09.

**18V-213**

Ford Motor Company (Ford) is recalling certain 2018 F-650 and F-750 vehicles equipped with 6-speed automatic transmissions and 2018 Ford F-150 and Expedition vehicles equipped with 10-speed automatic transmissions (excluding Expedition vehicles with a Rotary Gear Shift Dial on the console). The gear shift cable clip may not be properly seated, allowing the transmission to be in a different gear than indicated by the gear shift lever position. If the gear shift cable clip becomes unseated or dislodged, the gear shift lever position may indicate that the transmission is in 'Park' when it may be in a different gear. Additionally, despite selecting 'Park', if the parking brake is not applied before the vehicle is exited, the vehicle may roll. Either scenario increases the risk of a crash. Ford will notify owners, and dealers will inspect the shift cable locking clip and properly seat it, if necessary, free of charge. The recall began on April 13, 2018. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for the recall is 18S10.

**18V-214**

Zero Motorcycles (Zero) is recalling all 2012 Zero S, Zero DS, and Zero DSP (Police) motorcycles. Cell pouches in the battery packs may wear from contact with the holders, allowing humidity to enter the pouch and cause an electrical short within the battery. An electrical short can increase the risk of a fire. Zero Motorcycles will notify owners and offer them a choice of either the repurchase of their motorcycle or a financial trade-assist towards a newer model year Zero Motorcycles motorcycle. The recall began on April 30, 2018. Owners may contact Zero customer service at 1-888-841-8085. Zero's number for this recall is SV-ZMC-018-383. Note: Since owners are advised to no longer ride or charge the affected motorcycles, Zero Motorcycles dealers will arrange for the collection of the affected motorcycle at no charge to the owners.

**18V-215**

Keystone RV Company (Keystone) is recalling certain 2018 Crossroads Cruiser and Volante recreational trailers. The brake wire may have been improperly attached to the spring assembly on the axles, allowing the wire to be damaged and short circuit. Damage to the wire can cause a loss of trailer braking, lengthening the distance needed to stop the vehicle, increasing the risk of a crash. An electrical short of the brake wire can increase the risk of a fire. Keystone will notify owners, and dealers will relocate the brake wiring as needed, free of charge. The recall began on April 18, 2018. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 18-316

**18V-217**

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING APRIL 2018**

*Published May 31, 2018*

Doepker Industries Ltd. (Doepker) is recalling certain 2015-2016 53' Tridem Galvanized Highboy Flatdeck Semi trailers. The lower rail main beam flanges may crack, possibly causing the load to shift and spill onto the road. If the load shifts and spills onto the roadway, there is an increased risk of a crash. Doepker will notify owners, and dealers will provide rental trailers, and replace the frames, free of charge. The recall began on May 1, 2018. Owners may contact Doepker customer service at 1-306-598-2171. Doepker's number for this recall is HG201801.

**18V-218**

Newmar Corporation (Newmar) is recalling certain 2018-2019 Newmar New Aire motorhomes built on Daimler Trucks FCCC XCS chassis equipped with wheels that have Freightliner-logo shaped holes. These wheels have a valve stem stabilizer that may dislodge and damage the valve stem. Valve stem damage can result in loss of air pressure in the inner tire, causing an overload of the outer tire and increasing the risk of a crash. Newmar will notify owners, and Daimler Trucks dealers will inspect and replace the inner wheel valve stem stabilizer, as necessary, free of charge. The recall began on May 31, 2018. Owners may contact Newmar customer service at 1-800-731-8300. Newmar's number for this recall is 18V-194.

**18V-219**

Mitsubishi Motors North America, Inc. (MMNA) is recalling certain 2004-2006 Mitsubishi Lancer vehicles that previously received a like-for-like passenger side frontal air bag inflator under recall 15V321 as interim remedy. Also recalled are 2004-2006 Lancer vehicles located in Guam or Saipan that previously received or never received a new inflator under 15V321 or 17V569. These passenger side frontal air bag inflators may be susceptible to moisture intrusion which, over time, could cause the inflator to explode in the event of an air bag deployment. In the event of a crash necessitating deployment of the passenger's frontal air bag, the inflator could explode with metal fragments striking the vehicle occupants potentially resulting in serious injury or death. MMNA will notify owners, and dealers will install a final replacement passenger side frontal air bag inflator, free of charge. The recall began on April 26, 2018. Owners may contact MMNA customer service at 1-888-648-7820. MMNA's number for this recall is SR-18-005.

**18V-220**

Honda (American Honda Motor Co.) is recalling certain 2018 Honda Pilot and Ridgeline vehicles and 2018 Acura MDX vehicles. The front driver and passenger powered seats in the Honda vehicles and the driver powered seats in the Acura vehicles may have been assembled with improperly manufactured rivets. In the event of a crash, the rivets can break causing the seats not to be secured to the floor. As such, these vehicles may fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 207, "Seating Systems," and 210, "Seat Belt Assembly Anchorages." In the event of a crash, if the seat does not remain secured to the floor, the seat occupant has an increased risk of injury. Honda will notify owners, and dealers will replace the driver seat frame assembly in Acura MDX vehicles, and replace the driver and front passenger seat slide rail frames in Honda Pilot and Ridgeline vehicles, free of charge. Owners may contact Honda customer service at 1-888-234-2138. Honda's numbers for this recall is D0S, and T0T.

**18V-221**

Forest River, Inc. (Forest River) is recalling certain 2018 Forest River Surveyor recreational trailers, model

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING APRIL 2018**

*Published May 31, 2018*

ORSVT247BHDS. The Federal Placard on these vehicles incorrectly indicate a tire size of ST225/75R15D needing 65 PSI and a rim designation of 15X6.0JJ, however, the vehicle is actually equipped with ST205/75R14C tires needing 50 PSI and a rim designation of 14X5.5JJ. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims." As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." If the operator goes by the incorrect information on the Federal Placard they can over inflate the tires and cause premature tire wear, increasing the risk of a crash. Forest River has notified owners and provided a corrected Federal Placard, free of charge. The recall began on April 11, 2018. Owners may contact Forest River customer service at 1-574-642-3119 extension 205. Forest River's number for this recall is 47-0698.

**18V-222**

Motor Coach Industries (MCI) is recalling certain 2018 J4500 vehicles. The left rear taillight harness branch of the engine compartment wiring may contact the engine coolant tank causing a loss of power to the left taillight. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." If the left taillight does not work, the coach would have reduced visibility to other drivers, increasing the risk of a crash. MCI will notify owners, and dealers will inspect the left taillight wiring harness, re-routing and repairing it as necessary, free of charge. The recall began on April 23, 2018. Owners may contact MCI customer service at 1-800-241-2947. MCI's number for this recall is SB 461.

**18V-223**

Autocar, LLC (Autocar) is recalling certain 2018-2019 Autocar Xpeditor vehicles. The pinch bolt on the clamp for the adjustable length drag link may not have been properly tightened. If the pinch bolt loosens, there may be a loss of steering control, increasing the risk of a crash. Autocar will notify owners, and dealers will inspect the drag link pinch bolt, tightening it as necessary, free of charge. The recall began on May 25, 2018. Owners may contact Autocar customer service at 1-888-218-3611 or 1-877-973-3486. Autocar's number for this recall is ACX-1802.

**18V-224**

Motor Coach Industries (MCI) is recalling certain 2018 MCI J4500 motor coaches. The rear left hand window may separate from the vehicle. If the left rear window separates from the vehicle while it is moving, it can become a road hazard, increasing the risk of crash or injury. MCI will notify owners, and dealers will check the rear left hand window to make sure that it is securely installed, correcting it as necessary, free of charge. Owners may contact MCI customer service at 1-800-241-2947. MCI's number for this recall is SB 463.

**18V-225**

Keystone RV Company (Keystone) is recalling certain 2018 Keystone Carbon and Raptor recreational fifth-wheel trailers. These vehicles were manufactured without a protective barrier in the fuel station to prevent fuel absorption in the main floor. Fuel absorption into the main floor can increase the risk of a fire in the presence of an ignition source. Keystone will notify owners, and dealers will inspect the trailers and install a protective barrier is present, if necessary, free of charge. The recall began on April 24, 2018. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 18-317.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING APRIL 2018**

*Published May 31, 2018*

**18V-226**

Indian Motorcycle Company (Indian) is recalling certain 2018 Indian Chief, Chief Classic, Chief Dark Horse, Chief Vintage, Chieftain, Chieftain Classic, Chieftain Dark Horse, Chieftain Elite, Chieftain Limited, Springfield, Springfield Dark Horse, Roadmaster, Roadmaster Elite, Roadmaster Icon, and Roadmaster Classic motorcycles. Corrosion may develop within the right combination switch, potentially resulting in the motorcycle starting without the user's intent if the key fob is near the motorcycle and the required safety interlock conditions are met. If the motorcycle starts unintentionally and is parked in an enclosed space, exposure to carbon monoxide may increase the risk of injury. Indian will notify owners, and dealers will replace the right hand combination switch, free of charge. Owners may contact Indian customer service at 1-877-204-3697. Indian's number for this recall is I-18-04.

**18V-228**

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2013-2017 Audi A5 Cabriolet, A5 Sedan and Audi Q5 vehicles, 2012-2015 Audi A6 vehicles and 2013-2016 Audi A4 Sedan and A4 allroad vehicles. These vehicles, equipped with 2.0l Turbo FSI engines, have an electric coolant pump that can either become blocked with debris from the cooling system causing it to overheat or can short-circuit from moisture within the pump. A blocked pump or a short-circuited pump can increase the risk of a fire. Audi will notify owners, and dealers will replace the pumps, free of charge. Parts are not currently available. Owners will be sent an initial notification beginning on June 11, 2018. A second notice will be mailed once remedy parts become available. Owners may contact Audi customer service at 1-800-253-2834. Audi's number's for this recall is 19N3/19N4. Note: This recall is in addition to the coolant pump software update applied as a remedy under recall 17V002.

**18V-229**

General Motors LLC (GM) is recalling certain 2018 Buick Regal vehicles. During the manufacturing process, the rear seat belts may have been improperly routed around the bolster bracket on the rear outboard seats, which can cause inadequate restraint of the passengers. If the seat belt fails to adequately restrain the passengers in a crash, it can increase the risk of injury. GM will notify owners, and dealers will inspect the rear outboard seat belts, correcting the routing of the seat belts as necessary, free of charge. The recall began May 14, 2018. Owners may contact Buick customer service at 1-800-521-7300. GM's number for this recall is 18117.

**18V-230**

Chrysler (FCA US LLC) is recalling certain 2018 Jeep Wrangler vehicles. The rear under body ladder rail may corrode, possibly reducing the strength of the rear floor pan and causing the left rear seat mount to become loose. If the floor pan strength is reduced and/or the rear seat mount becomes loose, the rear seat may detach in a crash, increasing the risk of injury. Chrysler will notify owners, and dealers will inspect and, as necessary, coat the interior and exterior of the driver's side rear underbody ladder rail with three-part rust protection. The recall is expected to begin June 2018. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is U27.

**18V-231**

Forest River, Inc. (Forest River) is recalling certain 2018 Forest River Salem recreational trailers, model

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING APRIL 2018**

*Published May 31, 2018*

SMT282QBXL-OR. The Federal Placards on these vehicles may incorrectly state the tire pressure as 54 PSI, however, the correct tire pressure is 65 PSI. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims." These vehicles also fail to comply with the requirements of 49 CFR Part 567, "Certification." Incorrect tire pressure information can cause the operator to under inflate the tires, increasing the risk of a crash. Forest River has notified owners and provided a tire placard with the correct tire pressure information, free of charge. The recall began April 13, 2018. Owners may contact Forest River customer service at 1-503-831-5413. Forest River's number for this recall is 22-0693.

**18V-232**

Forest River, Inc. (Forest River) is recalling certain 2017-2019 Coachment Crossfit vehicles. The Federal Placards on these vehicles incorrectly list a rear axle Gross Axle Weight Rating (GAWR) that exceeds the GAWR assigned by the chassis manufacturer. The incorrect GAWR may cause the operator to overload the vehicle, increasing the risk of a crash. Forest River has notified owners and provided a corrected Federal Placard, free of charge. The recall began April 25, 2018. Owners may contact Forest River customer service at 1-574-825-8590. Forest River's number for this recall is 225-0699.

**18V-233**

Forest River, Inc. (Forest River) is recalling certain 2018-2019 Forest River FR3 and Georgetown recreational vehicles. The entry door latch may not engage fully, allowing the door to open unexpectedly while moving. If the entry door opens unexpectedly, it can increase the risk of injury. The remedy for this recall is still under development. The recall began on May 9, 2018. Owners may contact Forest River customer service at 1-574-206-7600. Forest River's number for this recall is 68-0700.

**18V-234**

Isuzu Technical Center of America, Inc. (Isuzu) is recalling certain 2018 Isuzu NPR and 2019 Isuzu NPR-HD and NPR-XD vehicles. These vehicles have a brake switch and nylon retainer that may not have been properly secured into the steel brake pedal assembly bracket. If the brake switch and nylon retainer are not properly secured, the switch can detach from the bracket causing the brake lights to illuminate whether or not brake pedal is depressed, the shift interlock will not operate and the accelerator pedal input will be disabled resulting in the inability to accelerate. These conditions can increase the risk of a crash. Isuzu has notified owners, and dealers will inspect the seating of the retainer, and re-seat the retainer clip or replace the retainer clip, if necessary, free of charge. The recall began on April 24, 2018. Owners may contact Isuzu customer service at 1-866-441-9638. Isuzu's number for this recall is V1801.

**18V-235**

Newmar Corporation (Newmar) is recalling certain 2018 Newmar Bay Star, Bay Star Sport, Canyon Star, Ventana LE, Ventana, Dutch Star, New Aire, Mountain Aire, London Aire, Essex, and King Aire motorhomes. The electrical connections in the breaker box may not be properly tightened, possibly causing the connections to overheat. Overheating of the electrical connections can increase the risk of a fire. Newmar will notify owners, and dealers will tighten the loose electrical connections, as necessary, free of charge. The recall began on May 17, 2018. Owners may contact Newmar customer service at 1-800-731-8300.



**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING APRIL 2018**

*Published May 31, 2018*

**18V-236**

Kovatch Mobile Equipment Corp. (KME) is recalling certain 2012-2016 KME Predator SS Pumper and Predator Pumper, and 2015-2016 Predator Aerial vehicles equipped with Cummins ISX12 engines. The braided cab lift hydraulic hoses, wire braided air lines and/or wire braided fuel cooler lines may be improperly routed and secured contacting the starter power stud, causing a leak and a possible short-circuit. A fluid leak combined with arcing between the power stud and the exposed wire can increase the risk of a fire. KME will notify owners, and dealers will inspect the area around the starter and make sure that the hoses have sufficient clearance, replacing any damaged cab lift hydraulic hoses, and adding hose chafe guards, free of charge. The recall began on May 22, 2018. Owners may contact KME customer service at 1-800-235-3928.

**18V-237**

Ducati North America (Ducati) is recalling certain 2018 Ducati Panigale V4, Panigale V4 S, and Panigale V4 Speciale motorcycles. Fuel may spray out of the gas tank when the tank cap is opened. If fuel spills out of the tank when it is opened, it can increase the risk of a fire in the presence of an ignition source. Ducati will notify owners, and dealers will rework the fuel tank cap to improve the fuel tank's breathing capacity, free of charge. The recall began on May 21, 2018. Owners may contact Ducati customer service at 1-888-391-5446.

**18V-238**

Ducati North America (Ducati) is recalling certain 2018 Ducati Panigale V4, Panigale V4 S, and Panigale V4 Speciale motorcycles. Fuel may leak from the gas tank's internal breathing system valve plug. A fuel leak in the presence of an ignition source can increase the risk of a fire. Ducati will notify owners, and dealers will replace the plug and the O-ring, free of charge. The recall began on May 21, 2018. Owners may contact Ducati customer service at 1-888-391-5446.

**18V-239**

Nissan North America, Inc. (Nissan) is recalling certain 2016-2018 Nissan Titan, 2016 and 2018 Nissan Titan XD vehicles. Accessories installed on these vehicles reduced the load carrying capacity, however, a Load Carrying Capacity modification label was not installed, possibly allowing the vehicle to be overloaded. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims." An overloaded vehicle can increase the risk of a crash. Nissan will notify owners and provide a new modification label, with installation instructions, free of charge. The recall is expected to begin on June 16, 2018. Owners may contact Nissan customer service at 1-800-867-7669.

**18V-240**

KZRV, L.P. (KZRV) is recalling certain 2019 KZRV Connect recreational trailers, model C241RLK. These vehicles were incorrectly equipped with a 15/20 amp circuit breaker instead of a 15/15 amp breaker. The incorrect circuit breaker may increase the risk of a fire. KZRV will notify owners, and dealers will replace the 15/20 amp circuit breaker with a 15/15 amp circuit breaker, free of charge. The recall began on April 20, 2018. Owners may contact KZRV customer service at 1-800-768-4016 extension 154 or 153. KZRV's number for this recall is KZ-2018-03.

**18V-241**

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING APRIL 2018**

*Published May 31, 2018*

KZRV, L.P. (KZRV) is recalling certain 2018-2019 KZRV Durango, Spree, Spree Escape, Connect, Sportsmen, Sidewinder, and Venom recreational trailers. The Solera Smart Arm awning may deploy while moving. If the awning deploys while moving, there would be an increased risk of a crash. The remedy for this recall is still under development. The recall is expected to begin on June 15, 2018. Owners may contact KZRV customer service at 1-800-768-4016, extension 154 or 153. KZRV's number for this recall is KZ-2018-04.

**18V-242**

Gulf Stream Coach, Inc. (Gulf Stream) is recalling certain 2016-2018 Gulf Stream Conquest and B Touring Cruiser motorhomes, models 6314, 6316, 6317, 6320, 63111, 5291 and 5316. These vehicles do not have intermediate side marker lights and have front and rear side marker lights that are spaced more than thirty feet apart. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." Without intermediate side marker lights, the motorhome would have decreased visibility to other drivers, increasing the risk of a crash. Gulf Stream will notify owners, and dealers will install intermediate side marker lights, free of charge. The recall began on May 18, 2018. Owners may contact Gulf Stream customer service at 1-800-289-8787. Gulf Stream's number for this recall is 04172018.

**18V-243**

Automobili Lamborghini (Lamborghini) is recalling certain 2017 Lamborghini Centenario Coupe and Centenario Roadster vehicles. The certification label on these vehicles may have an incorrect weight limit, which can cause the vehicle to be overloaded. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." An overloaded vehicle may increase the risk of suspension or tire failure, increasing the risk of a crash. Lamborghini will notify owners, and dealers will install a corrected certification label, free of charge. Owners may contact Lamborghini customer service at 1-866-681-6276. Lamborghini's number for this recall is L73XR0118.

**18V-244**

Newmar Corporation (Newmar) is recalling certain 2016-2017 Newmar Ventana, 2015-2016 Newmar London Aire, and 2013-2017 Newmar Dutch Star motorhomes. When switching from using the low beam headlights to the high beam headlights, the low beam headlights go out when the intention was to have both beams illuminate. Without the low beams also illuminated when the high beams are on, the driver may have reduced visibility, increasing the risk of a crash. Newmar will notify owners, and dealers will correct the vehicles so that the low beam stays illuminated when the high beam is switched on, free of charge. The recall began on May 18, 2018. Owners may contact Newmar customer service at 1-800-731-8300.

**18V-245**

Riverside RV (Riverside) is recalling various 2015-2017 White Water, Water Fall, and Mt. McKinley motorhomes equipped with certain Plastic-Handle Fire Extinguishers or Push Button 'Pindicator' Fire Extinguishers. These extinguishers may become clogged, preventing the extinguisher from discharging as expected or requiring excessive force to activate the extinguisher. Additionally, in certain models, the nozzle may detach from the valve assembly with enough force that it could cause injury and also render the product inoperable. For a full list of the affected fire extinguisher models visit:

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING APRIL 2018**

*Published May 31, 2018*

<https://static.nhtsa.gov/odi/rcr/2017/RMISC-17E062-5427.pdf> In the event of a fire, if the fire extinguisher does not function properly, it can increase the risk of injury. Riverside will notify owners, instructing them to contact Kidde to get a replacement fire extinguisher, free of charge. Owners may contact Riverside customer service at 1-260-499-4511.

**18V-246**

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2006-2007 Volkswagen Passat sedan and wagon vehicles. Upon deployment of the driver's frontal air bag, excessive internal pressure may cause the inflator to explode. In the event of a crash necessitating deployment of the driver's frontal air bag, the inflator could explode with metal fragments striking the driver or other occupants resulting in serious injury or death. Volkswagen will notify owners, and dealers will replace the front driver air bag inflator with an alternate inflator, free of charge. The recall began on April 30, 2018. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's number for this recall is 69Q8. Note: This recall partially supersedes recall 16V-079.

**18V-247**

BMW of North America, LLC (BMW) is recalling certain 2011-2012 BMW 550i, 550i xDrive, 550i Gran Turismo, 550i Gran Turismo xDrive, 750i, 750Li, 750i xDrive, 750Li xDrive, 760Li, X5 xDrive50i, X5 M, X6 xDrive50i, X6 M, ActiveHybrid7, MINI Cooper S Convertible, John Cooper Works (JCW) Convertible, Cooper S Countryman, Cooper S Countryman ALL4, Cooper S, JCW, Cooper S Clubman, JCW Clubman, Cooper S Roadster, JCW Roadster, Cooper S Coupe, JCW Coupe and Rolls-Royce Ghost, 2011 BMW X6 Hybrid and 2012 BMW 650i Coupe, 650i xDrive Coupe, 650i Convertible and 650i xDrive Convertible vehicles. The electric auxiliary water pump may fail and cause the circuit board to overheat. If the circuit board were to overheat, it can increase the risk of a fire. BMW will notify owners, and dealers will replace the electric auxiliary water pump, free of charge. Depending on the model, there are currently limited parts available, however not all parts are available at this time. Owners will be notified of the recall beginning June 11, 2018, and will receive a second notification when remedy parts become available. Owners may contact BMW customer service at BMW 1-800-525-7417, MINI at 1-866-825-1525, or Rolls-Royce at 1-877-877-3735. Note: BMW recommends that owners park their vehicle outdoors until the recall remedy has been performed.

**18V-248**

Forest River, Inc. (Forest River) is recalling certain 2018-2019 Coachmen Spirit recreational trailers, models SBT2963BH and SBT2342BH. The outdoor cooktop may have been installed without an liquid propane (LP) quick disconnect. If the cooktop does not have an LP hose quick disconnect feature and the cooktop is placed into the vehicle while still connected to the LP supply and with the LP hose in the ON position, users may be exposed to Carbon Monoxide. Additionally, the escaping propane gas may increase the risk of a fire. Forest River will notify owners, and dealers will disconnect the LP supply line and relocate it with a quick disconnect LP fitting, free of charge. The recall is expected to begin June 15, 2018. Owners may contact Forest River customer service at 1-574-825-8205. Forest River's number for this recall is 220-0691.

**18V-249**

Daimler Trucks North America LLC (DTNA) is recalling certain 2018-2019 Thomas Built Buses Saf-T-Liner

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING APRIL 2018**

*Published May 31, 2018*

C2 transit buses equipped with 2 8D batteries. The battery power cable may have inadequate clearance between the cable and the battery hold down bracket when the battery tray is pulled out for service, causing the cable to rub against the bracket. The battery cable rubbing may cause the cable to short circuit, increasing the risk of a fire. DTNA will notify owners, and dealers will inspect the battery cables and reroute them for proper clearance, as required, free of charge. The recall is expected to begin June 15, 2018. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL768.

**18V-250**

Daimler Trucks North America LLC (DTNA) is recalling certain 2016-2019 Freightliner Business Class M2 trucks built with air disk brakes and spring suspension. The rear disk brake calipers may have been mounted in an incorrect orientation allowing the caliper to contact the suspension, reducing brake effectiveness. Reduced braking effectiveness can increase the risk of a crash. DTNA will notify owners, and dealers will correct the orientation the rear brake calipers, free of charge. The recall is expected to begin June 15, 2018. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-767.

**18V-251**

General Motors LLC (GM) is recalling certain 2018 Chevrolet Equinox vehicles. The driver and front passenger door window glass may not be properly tempered. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 205, "Glazing Materials." If the glass is not tempered properly, and the window is broken, the glass can break into large pieces, increasing the risk of injury. GM will notify owners, and dealers will replace the glass in the front doors, free of charge. The recall began May 15, 2018. Owners may contact Chevrolet customer service at 1-800-222-1020. GM's number for this recall is 18136.

**18V-252**

Daimler Trucks North America LLC (DTNA) is recalling certain 2014-2018 Thomas Built Buses Saf-T-Liner C2, Saf-T-Liner HDX, Saf-T-Liner EFX, and Minotour school buses equipped with S3B Restraint Wall Mounted Seats. The wall mounting bracket may crack, causing the seat to not remain secured in place in the event of a crash. In the event of a crash, if the seat does not remain secured to the wall, the occupant has an increased risk of an injury. DTNA will notify owners, and dealers will install an additional wall mounting bracket, free of charge. The recall is expected to begin June 15, 2018. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-769.

**18V-253**

Daimler Trucks North America LLC (DTNA) is recalling certain 2014-2018 Thomas Built Buses Saf-T-Liner C2, Saf-T-Liner EFX, Saf-T-Liner HDX, and Minotour transit buses, equipped with certain S3B Restraint Wall Mounted Seats. The wall mounting bracket may crack, causing the seat to not remain secured in place in the event of a crash. In the event of a crash, if the seat does not remain secured to the wall, the occupant has an increased risk of an injury. DTNA will notify owners, and dealers will install an additional wall mounting bracket, free of charge. The recall is expected to begin June 15, 2018. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-769.

**18V-254**

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING APRIL 2018**

*Published May 31, 2018*

Altec Industries Inc. (Altec) is recalling certain 1992-2006 Digger Derrick trucks that have a specific boom pivot pin which may fail and cause the boom to move unexpectedly. Unexpected boom movement can increase the risk of injury or death. Altec will notify owners and instruct them to inspect the vehicle for defective pivot pins and replace any that are found, free of charge. The recall is expected to begin June 5, 2018. Owners may contact Altec customer service at 1-877-462-5832.

**18V-255**

Supreme Corporation (Supreme) is recalling certain 2013-2017 Supreme Kold King vehicles. The floor frame rail may detach from the cross members due to insufficient weld penetration. If the floor frame rail detaches from the cross members, the body may separate from the chassis, increasing the risk of injury. Supreme will notify owners, and dealers will install reinforcement gussets to the floor frame, free of charge. The recall is expected to begin June 15, 2018. Owners may contact Supreme customer service at 1-844-352-4921.

**18V-256**

Kia Motors America (Kia) is recalling certain 2017 Kia Niro vehicles. The Hydraulic Clutch Actuator (HCA) inner oil seal may leak, allowing oil to accumulate in the cap area, possibly resulting in an electrical short. An electrical short can increase the risk of a fire. Kia will notify owners, and dealers will inspect the HCA caps for leaked oil and replace the HCA assembly if needed, or replace the HCA cap with additional sealant. These repairs will be performed free of charge. The recall is expected to begin June 15, 2018. Owners may contact Kia customer service at 1-800-333-4542. Kia's number for this recall is SC163.

**18V-257**

Blue Bird Body Company (Blue Bird) is recalling certain 2017-2018 Blue Bird Vision transit buses equipped with Gen4 Ford engines with an optional brake and throttle interlock. The brake and throttle interlock is supposed to apply the service brakes and prevent accelerator pedal input when activated, however the throttle input is not being blocked. If throttle input is allowed, the bus may be able to overpower the applied brake, causing the bus to move unexpectedly, increasing the risk of a crash or an injury. Blue Bird will notify owners, and dealers will update the Smart Relay Module software, free of charge. Owners may contact Blue Bird customer service at 1-478-822-2242. Blue Bird's number for this recall is R18ZF - NSB.

**18V-258**

Blue Bird Body Company (Blue Bird) is recalling certain 2017-2018 Blue Bird Vision school buses equipped with Gen4 Ford engines with an optional brake and throttle interlock. The brake and throttle interlock is supposed to apply the service brakes and prevent accelerator pedal input when activated, however the throttle input is not being blocked. If throttle input is allowed, the bus may be able to overpower the applied brake, causing the bus to move unexpectedly, increasing the risk of a crash or an injury. Blue Bird will notify owners, and dealers will update the Smart Relay Module software. The recall is expected to begin in May 2018. Owners may contact Blue Bird customer service at 1-478-822-2242. Blue Bird's number for this recall is R18ZF - SB.

**18V-259**

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING APRIL 2018**

*Published May 31, 2018*

Hyundai Motor America (Hyundai) is recalling certain 2017 Hyundai Ioniq Hybrid vehicles. The Hydraulic Clutch Actuator (HCA) inner oil seal may leak, allowing oil to accumulate in the cap area, possibly resulting in an electrical short. An electrical short can increase the risk of a fire. Hyundai will notify owners, and dealers will inspect the HCA caps for leaked oil and replace the HCA assembly if needed, free of charge. The recall is expected to begin June 20, 2018. Owners may contact Hyundai customer service at 1-855-371-9460. Hyundai's number for this recall is 176.

**18V-260**

Lakota Corporation (Lakota) is recalling certain 2018-2019 Bighorn, Charger, and Colt trailers. The bolts that secure the ramps on these trailers may come loose or break during use or while moving. If the ramp loosens or detaches during use or while moving, it can increase the risk of injury or a crash. Lakota will notify owners, and dealers will replace the bolts with a different bolt, free of charge. Owners may contact Lakota Recall Help Desk IPO Lakota Customer Service at 1-574-848-1636.

**18V-261**

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2018 Volkswagen Tiguan long wheelbase (LWB) vehicles. A lower loop of a rear shock absorber may separate from its base due to an incorrect welding process. If the lower loop of the rear shock absorber detaches, there may be a loss of vehicle control, increasing the risk of a crash. Volkswagen will notify owners, and dealers will inspect the rear shock absorbers, replacing them as necessary, free of charge. The recall is expected to begin June 25, 2018. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's number for this recall is 42i7.

**18V-262**

Blue Bird Body Company (Blue Bird) is recalling certain 2018-2019 Blue Bird All American and Vision school buses. The primary and secondary air brake gauges on the instrument cluster may intermittently indicate "0 PSI" instead of the correct air pressure in the tanks. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 121, "Air Brake Systems." If the gauges do not correctly display the air pressure that is in the tanks, the operator will not be able to know when the air pressure is actually dropping, increasing the risk of a crash. Blue Bird will notify owners, and dealers will update the display software, free of charge. Owners may contact Blue Bird customer service at 1-478-822-2242. Blue Bird's number for this recall is R18ZE-SB.

**18V-263**

Blue Bird Body Company (Blue Bird) is recalling certain 2018-2019 Blue Bird All American and Vision transit buses. The primary and secondary air brake gauges on the instrument cluster may intermittently indicate "0 PSI" instead of the correct air pressure in the tanks. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 121, "Air Brake Systems." If the gauges do not correctly display the air pressure that is in the tanks, the operator will not be able to know when the air pressure is actually dropping, increasing the risk of a crash. Blue Bird will notify owners, and dealers will update the display software, free of charge. Owners may contact Blue Bird customer service at 1-478-822-2242. Blue Bird's number for this recall is R18ZE-NSB.

**18V-264**

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING APRIL 2018**

*Published May 31, 2018*

Lakota Corporation (Lakota) is recalling certain 2018-2019 Bighorn, Charger and Colt horse and livestock trailers equipped with a rear ramp option. These trailers may be missing the nuts and bolts through the ramp channel that go into the rear of trailer C channel, allowing the rear ramp to detach while moving. If the ramp comes loose while moving, it can increase the risk of a crash. Lakota has notified owners, and dealers will drill holes, and install the bolts and lock nuts to secure the ramp, free of charge. The recall began on May 9, 2018. Owners may contact Lakota helpdesk at 1-574-848-1636.

**18V-265**

Honda (American Honda Motor Co.) is recalling certain 2017 Honda Civic Hatchback and Civic Type R vehicles. Driver and front passenger seatback pads sold as replacement service parts were made without slit openings for the seat-mounted side air bags. In the event of a crash necessitating air bag deployment, the seatback pad would interfere and adversely affect air bag performance. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 214, "Side Impact Protection." If the seat-mounted air bags cannot not deploy correctly in the event of a crash, there would be an increased risk of injury. Honda will notify owners, and dealers will replace the front seatback pads, free of charge. The recall is expected to begin June 2018. Owners may contact Honda customer service at 1-888-234-2138. Honda's number for this recall is E1D, U1B, and X1C.

**18V-266**

General Motors LLC (GM) is recalling certain 2009-2014 Chevrolet Silverado HD and GMC Sierra HD, 2009 GMC Topkick 5000, 6000, 7000 and 8000 Series and Isuzu F Series, and 2009-2018 Chevrolet Express, and GMC Savana vehicles, equipped with certain Plastic-Handle Fire Extinguishers or Push Button 'Pindicator' Fire Extinguishers. These extinguishers may become clogged, preventing the extinguisher from discharging as expected or requiring excessive force to activate the extinguisher. Additionally, in certain models, the nozzle may detach from the valve assembly with enough force that it could cause injury and also render the product inoperable. For a full list of the affected fire extinguisher models visit:

<https://static.nhtsa.gov/odi/rcl/2017/RMISC-17E062-5427.pdf> In the event of a fire, if the fire extinguisher does not function properly, it can increase the risk of injury. GM will notify owners, instructing them to contact Kidde to get a replacement fire extinguisher, free of charge. Owners may contact Chevrolet customer service at 1-800-222-1020, GMC customer service at 1-800-462-8782, and Isuzu customer service at 1-866-441-9638. GM's number for this recall is 18146.

**18V-267**

Honda (American Honda Motor Co.) is recalling certain 2003-2012 Honda Accord and Pilot, 2010 Accord Crosstour, 2001-2011 Civic, 2002-2011 CR-V, 2003-2004, 2006-2008 and 2011 Element, 2007 and 2009-2013 Fit, 2010-2012 Insight, 2002-2004 Odyssey, and 2012 Ridgeline vehicles. The front passenger air bag may have been installed incorrectly during replacement. An incorrectly installed air bag may deploy improperly in the event of a crash, increasing the risk of injury. Honda will notify owners, and dealers will inspect and, if necessary, replace the passenger frontal air bag module assembly, free of charge. The recall is expected to begin June 2018. Owners may contact Honda customer service at 1-888-234-2138. Honda's numbers for this recall are K1P, and M1O.

**18V-268**

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING APRIL 2018**

*Published May 31, 2018*

Forest River, Inc. (Forest River) is recalling certain 2018 Glaval Bus Concorde II and Starcraft Bus XLT transit buses. The gear shift cable clip may not be properly seated, allowing the transmission to be in a different gear than indicated by the gear shift lever position. If the gear shift cable clip becomes unseated or dislodged, the gear shift lever position may indicate that the transmission is in 'Park' when it may be in a different gear. Additionally, despite selecting 'Park', if the parking brake is not applied before the vehicle is exited, the vehicle may roll. Either scenario increases the risk of a crash. Forest River has notified owners, and Ford dealers will inspect the shift cable locking clip and properly seat it, if necessary, free of charge. The recall began June 4, 2018. Owners may contact Glaval customer service at 1-800-445-2825, Starcraft customer service at 1-800-348-7440, or Ford customer service at 1-866-906-9811. Forest River's number for this recall is 3505-0713.

**18V-269**

Forest River, Inc. (Forest River) is recalling certain 2018 Forest River Prime Time recreational trailers, model WCF35MB. The Federal Placard states an incorrect Gross Vehicle Weight Rating (GVWR) which incorrectly calculated an incorrect Cargo Carrying Capacity (CCC) to indicate a negative CCC in pounds. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." The incorrect information may cause the operator to exceed the CCC and GVWR of the vehicle, potentially increasing the risk of a crash. Forest River has notified owners and provided Federal Placards with corrected information, free of charge. The recall began on May 3, 2018. Owners may contact Forest River customer service at 1-574-862-2589. Forest River's number for this recall is 61-0704.

**18V-270**

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain 2017 Mercedes-Benz E300 4Matic, E300, E43 AMG, and E400 vehicles. The headlight horizontal adjustment screws on these vehicles may not be properly sealed behind a non-removable sealing cap to keep headlights from being readjusted. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." If the headlight's horizontal aim is altered, a misaimed headlight may lead to an insufficiently illuminated roadway, which may increase the risk of a crash. MBUSA will notify owners, and dealers will retrofit the sealing caps for the headlights, free of charge. The recall is expected to begin in June 2018. Owners may contact MBUSA customer service at 1-800-367-6372.

**18V-271**

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain 2012-2014 ML350 Bluetec 4Matic and ML550 4Matic, 2012-2015 ML63 AMG 4Matic and ML350 4Matic, 2013-2016 GL350 Bluetec 4Matic, GL550 4Matic and GL63 AMG 4Matic, 2017 GLS350d 4Matic, GLS450 4Matic, GLS550 4Matic and GLS63 AMG 4Matic, 2015 ML400 4Matic, 2016 GLE400 4Matic, GLE350 4Matic, GLE63 AMG 4Matic, GLE63S AMG 4Matic, GLE450 4Matic Coupe and GLE63S AMG 4Matic Coupe, 2015-2016 GL450 4Matic and 2013-2014 GL450 4Matic vehicles equipped with the Active Curve System (ACS). In certain driving conditions, if the oil level in the ACS reservoir is below the minimum level, the oil may foam and leak out of the vent holes in the reservoir cap. The leaking oil in the presence of an ignition source can increase the risk of a fire. MBUSA will notify owners, and dealers will correct the oil level as necessary and replace the reservoir sealing cap to prevent oil foam from leaking out, free of charge. Owners will be notified of the recall with an interim notification in June 2018. A second letter will be mailed when the remedy is available, currently expected to be



**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING APRIL 2018**

*Published May 31, 2018*

in August 2018. Owners may contact MBUSA customer service at 1-800-367-6372.

**18V-272**

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain 2008-2009 smart fortwo cabrio and fortwo coupe vehicles. The rear insulation mat in the engine compartment may deform, deteriorate, and loosen over time, allowing the mat to contact hot exhaust system components. If the mat contacts hot exhaust system components, it can increase the risk of a fire. MBUSA will notify owners, and dealers will replace the rear insulation mat with an improved one, free of charge. The recall is expected to begin in July 2018. Owners may contact MBUSA customer service at 1-800-367-6372.

**18V-273**

Ford Motor Company (Ford) is recalling certain 2015-2017 Ford Transit vehicles, equipped with a trailer tow module. Water can enter the tow modules and corrode the wiring causing issues such as rapidly flashing turn signals, loss of instrument panel display, an electrical short and possibly the deployment of seatbelt pretensioner. An electrical short can increase the risk of a fire. Turn signal, instrument cluster or seatbelt pretensioner problems can increase the risk of a crash. Ford will notify owners, and dealers will add a drainage hole in the driver's door stepwell and incorporate a fuse into the vehicle's wiring harness, free of charge. Owners may contact Ford customer service at 1-866-436-7332. Note: This is an expansion of recall 17V-668 (Ford recall 17S34). Ford's number for this recall expansion is 17S34-S1.

**18V-275**

Altec Industries Inc. (Altec) is recalling certain 2017-2018 Altec EC175, EC225, and EC655 Feller Grappler Boom-Mounted Saw vehicles. The grappler load holding valve may not be properly adjusted, which can allow the tree trunk to slip or fall unexpectedly. If the tree trunk slips or falls, there would be an increased risk of injury. Altec will notify owners, and dealers will properly adjust the grappler load holding valve, free of charge. The recall is expected to begin June 5, 2018. Owners may contact Altec customer service at 1-877-462-5832. Altec's number for this recall is CSN 679.

**18V-276**

Gulf Stream Coach, Inc. (Gulf Stream) is recalling certain 2017-2018 Conquest motorhomes, model 6280. The Federal Placards on these vehicles may incorrectly state the Gross Vehicle Weight Rating (GVWR) as 14,500 lbs. when the correct GVWR is 12,500 lbs. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." If the operator loads vehicle according to incorrect GVWR on the label, the vehicle may be overloaded, increasing the risk of a crash. Gulf Stream will notify owners and will provide a corrected Federal Placard, free of charge. Owners may contact Gulf Stream customer service at 1-800-289-8787. Gulf Stream's number for this recall is 04052018.

**18V-283**