

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2019**

Published June 4, 2019

CHILD SEATS:

None during April 2019.

EQUIPMENT:

Strategic Sports, Ltd. (Strategic Sports) is recalling certain Motovan Zox Sierra helmets, part number ST-560, in sizes XS, S, M, and L. The helmet shell may allow an object to penetrate through to the users head. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 218, "Motorcycle Helmets." In an event of the crash, the helmet may not protect the occupant, increasing the risk of injury. Strategic Sports has notified the distributors and known owners, and will provide refunds for all consumers returning their helmet. Owners may contact Moto customer service at helmet.recall.info@gmail.com or 1-888-449-7773.

19E-027

Cush Corp is recalling certain suspension systems that use AXN Heavy Duty Trailer Axles, model numbers TA250T67E7658034 and TA250T67E7658035. The wheel end nut locking device on these trailers may not have been properly installed, allowing the wheel end to separate from the axle. If the wheel end separates from the axle, it can increase the risk of a crash. Cush Corp will notify owners, and AXN dealers will inspect the locking clip to ensure its proper installation, correcting it as necessary, free of charge. The recall began September 20, 2018. Owners may contact AXN customer service at 1-502-882-9122 or Cush Corp at 1-417-724-1239.

19E-028

Triumph Motorcycles America, LTD (Triumph) is recalling certain accessory fairing kits, part numbers A9708301, A9708412, A9938255, A9938257, A9938265, A9938267, A9938323, and A9938325 sold for accessory installation on 2016-2018 Thruxton 1200, Thruxton 1200R, Thruxton 1200 Dual Seat and Thruxton 1200R Dual Seat motorcycles. Insufficient clearance for the wiring may result in damage to the harnesses causing a loss of headlights, turn signals or possibly a stall. An engine stall or a loss of the headlight or turn signals can increase the risk of a crash. Triumph will notify owners, and dealers will replace the wire covering (conduits) free of charge. The recall began May 24, 2019. Owners may contact Triumph customer service at 1-678-854-2010. Triumph's number for this recall is SRAN566.

19E-029

Bendix Commercial Vehicle Systems LLC (Bendix) is recalling certain ADB22X Air Disc Brake Calipers sold for use on school buses. The driver side rear brakes may drag. The dragging brakes may lead to high temperatures at the wheel end, increasing the risk of fire. Bendix will notify the school bus manufacturers that purchased the brake calipers. Dealers for those manufacturers will install a new caliper with an updated clearance adjustment mechanism, free of charge. The recall began May 21, 2019. Owners may contact Bendix customer service at 1-877-345-9526.

19E-030

General Motors LLC (GM) is recalling certain Rugger Liner hard, tri-fold tonneau covers sold as accessories for

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2019**

Published June 4, 2019

2019 Chevrolet Silverado and GMC Sierra 1500 series trucks and 2020 model year 2500 and 3500 series trucks. The attachment system may not properly secure the cover to the pickup bed. If the cover separates from the truck bed, it could be a road hazard, increasing the risk of a crash. GM will notify owners, and dealers will install improved attachments, free of charge. Owners may contact GM customer service at 1-586-596-1733. GM's number for this recall is N192217500.

19E-031

Strategic Sports, Ltd. (Strategic Sports) is recalling certain Zox Sierra ST-560 helmets, sizes XS, S, M, and L. These helmets may not adequately protect the wearer in the event of a head impact during a motorcycle crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 218, "Motorcycle Helmets." Objects may penetrate the helmet during a crash, increasing the risk of injury. Strategic Sports has notified owners, and instructed them to return the helmet, for a full refund. The recall began April 30, 2019. Owners may contact Strategic Sports customer service at helmet.recall.info@gmail.com or 1-619-861-8110. Strategic Sports' number for this recall is OA-218-170423.

19E-032

TIRES:

Toyo Tire Holdings Of Americas Inc. (Toyo) is recalling certain Proxes A27 tires, size P185/60R16 86H, produced from September 21, 2018 through September 25, 2018 (DOT dates codes 3718 and 3818). Prototype rubber compound was mixed with production compound, which may result in sections of the tire tread detaching. Sections of tread detaching can cause the tire to lose pressure, increasing the risk of crash. Toyo will notify owners, and dealers will replace the tires, free of charge. The recall began May 24, 2019. Owners may contact Toyo customer service at 1-800-442-8696.

19T-004

VEHICLES:

Labrie Enviroquip Group (Labrie Enviroquip) is recalling certain 2017-2018 Automizer and Expert compressed natural gas (CNG) -powered refuse trucks. The CNG tanks are equipped with Luxfer valves recalled under 18E-111. If the valve knob is turned more than one turn, the valve's snap ring may fail and the valve stem may forcibly eject from the valve body. The forcible ejection of the stem may increase the risk of injury to those nearby. Additionally, the unintended release of CNG can increase the risk of a fire. Labrie Enviroquip will notify owners, and Luxfer will provide an upgrade kit for the valves which doubles the snap ring strength, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Labrie Enviroquip customer service at 1-418-813-8250 or Luxfer at 1-403-720-0262.

19V-260

Eldorado National- Kansas (Eldorado) is recalling certain 2017-2018 Aerotech shuttle buses built on a Ford chassis equipped with ASA Electronics back-up camera display recalled under 19E-009. The displays may revert back to the factory default settings, possibly causing the camera image to be reversed. If the display

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2019**

Published June 4, 2019

displays the image in reverse, the driver may unintentionally turn the opposite direction, increasing the risk of crash. Eldorado will notify owners and dealers will install a repair module to the wiring to prevent the image from reversing. The recall began May 15, 2019. Owners may contact Eldorado National-Kansas customer service at 1-800-955-4236.

19V-261

Lotus Cars USA, Inc. (Lotus) is recalling certain 2017-2018 Evora vehicles. The toe board in the passenger footwell lacks stiffness, allowing the knee of an unbelted occupant to contact the rigid structure of the vehicle, in the event of a crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 208, "Occupant Crash Protection." In the event of a crash, if the occupant's knee contacts the rigid structure, there may be an increased risk of injury. Lotus will notify owners, and dealers will replace the toe board with a new design to provide the appropriate stiffness, free of charge. Owners may contact Lotus customer service at 1-800-245-6887. Lotus' number for this recall is 2019/01R.

19V-263

VT Hackney, Inc. (VT Hackney) is recalling certain 2018-2019 Beverage Body vehicles equipped with ASA Electronics back-up camera displays recalled under 19E-009. The displays may revert back to the factory default settings which may cause the camera image to be reversed. The driver may inadvertently turn the wrong direction to avoid an object behind the vehicle, increasing the risk of a crash. VT Hackney has notified owners, and provide repair kits that prevent the image from reversing, free of charge. The recall began May 6, 2019. Owners may contact VT Hackney customer service at 1-800-763-0700, extension 2016.

19V-264

Entegra Coach (Entegra) is recalling certain 2019 Entegra Vision and Emblem motorhomes built on a Ford F53 chassis. The blower motor electrical circuit may be missing the 25amp fuse, possibly resulting in overheating of the wiring. If the wiring in the circuit overheats, it can increase the risk of fire. Entegra has notified owners, and dealers will install a 25amp fuse, free of charge. The recall began April 16, 2019. Owners may contact Entegra customer service at 1-800-517-9137. Entegra's number for this recall is 9903432.

19V-265

Wilson Trailer Company (Wilson) is recalling certain 2019-2020 Punch Side Gooseneck Livestock trailers. The axles may lack the proper amount of grease on the inner and outer bearings on the hubs, which may lead to bearing failure. The ungreased axle bearings could result in a wheel locking up, possibly affecting vehicle handling and increasing the risk of crash. Wilson will notify owners, and dealers will properly grease or replace the axles, as needed, free of charge. Owners may contact Wilson customer service at 1-800-798-2002. Wilson's number for this recall is 028P.

19V-266

Kovatch Mobile Equipment Corp. (KME) is recalling certain 2017 Commercial Rescue, 2014-2019 Predator Panther Pumper, Commercial Pumper and Predator SS Pumper, 2012-2019 Predator Pumper, 2015-2019 Commercial Wildland, 2018 Predator Rescue and 2016 Predator SS Wildland vehicles. The lock for the gas springs that support the sliding, lift-up cover may be unintentionally disabled, preventing the lock from engaging.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2019**

Published June 4, 2019

If the lock is not engaged, the sliding, lift-up cover may fall unexpectedly, increasing the risk of injury to personnel working under the cover. KME will notify owners, and dealers will replace the gas springs on the sliding, lift-up cover with new gas springs with an alternative locking mechanism or new gas springs without a locking mechanism and a separate stay arm, free of charge. The recall began May 23, 2019. Owners may contact KME customer service at 1-800-235-3928.

19V-267

Precision Industries (Precision) is recalling certain 2017-2018 Emergency Vehicles built on Spartan Metrostar chassis and equipped with Whelen brake lights recalled under 18E-063. Depending on the specific wiring of the vehicle, these brake lights may illuminate when the brake pedal has not been pressed. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." If the brake lights incorrectly illuminate, it can confuse other drivers, possibly increasing the risk of a crash. Precision will notify owners, and dealers will replace the lights, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Precision Industries customer service at 1-573-346-8387.

19V-268

Weis Fire & Safety is recalling one 2018 Emergency vehicle built on a Ford F-550 4x4 Crew Cab chassis and equipped with Whelen brake lights recalled under 18E-063. Depending on the specific wiring of the vehicle, these brake lights may illuminate when the brake pedal has not been pressed. If the brake lights incorrectly illuminate, it can confuse other drivers, possibly increasing the risk of a crash. Weis Fire & Safety has already notified the owner, and replaced the brake lights, free of charge. The recall began October 1, 2018. Owners may contact Weis Fire & Safety customer service at 1-785-825-9526.

19V-269

Jayco, Inc. (Jayco) is recalling certain 2014-2019 Precept, 2016-2019 Alante and 2019 Precept Prestige motorhomes built on a Ford F53 chassis. The blower motor electrical circuit may be missing the 25amp fuse, possibly resulting in overheating of the wiring. If the wiring in the circuit overheats, it can increase the risk of fire. Jayco has notified owners, and dealers will install a 25amp fuse, free of charge. The recall began April 16, 2019. Owners may contact Jayco customer service at 1-800-517-9137. Jayco's number for this recall is 9903432.

19V-270

Mobility Specialists, Inc. (Mobility Specialists) is recalling certain 2014-2017 Ford E-150 and Transit vans modified to be equipped with Ricon S-Series and K-Series wheel chair lifts. The wheelchair lift positioning input cam may fail while the lift is in use, allowing the platform to travel higher than the vehicle's floor height. If the wheelchair lift platform stops above the vehicle floor, the wheelchair user can tip inwards toward the vehicle when exiting the lift, increasing their risk of injury. Mobility Specialists, working with Ricon, has notified the owners. Ricon will provide instructions and materials for replacing defective parts. Owners may contact Ricon customer service at 1-800-322-2884.

19V-271

Mazda North American Operations (Mazda) is recalling certain 2016-2018 Mazda3 vehicles. A defective

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2019**

Published June 4, 2019

windshield wiper relay may cause the windshield wipers to become inoperative, reducing the driver's visibility. Reduced visibility while driving can increase the risk of crash. Mazda will notify owners, and dealers will replace the front body control module with a new module which uses an improved wiper relay design, free of charge. The recall began May 7, 2019. Owners may contact Mazda customer service at 1-800-222-5500, option 4. Mazda's number for this recall is 3219D.

19V-272

BMW of North America, LLC (BMW) is recalling certain 2006 525i, 525xi, 530i, 530xi, 530xi Sports Wagon, 325i, 325xi, 325xi Sports Wagon, 330i, 330xi, Z4 3.0i and Z4 3.0si vehicles. The heater for the positive crankcase ventilation (PCV) valve may short circuit. An electrical short can cause the parts within the PCV valve to melt, increasing the risk of a fire, even when the vehicle is not in use. BMW will notify owners, and dealers will replace the PCV valve heater, free of charge. The recall began May 30, 2019. Owners may contact BMW customer service at 1-800-525-7417. Note: This recall is an expansion to recall 17V-683.

19V-273

Nova Bus (Nova) is recalling certain 2011-2019 LFS city buses. The engine door fan electrical connector may not be able to handle the required current and may overheat, possibly resulting in a fire. A vehicle fire increases the risk of injury. Nova will notify owners, and dealers will replace the connector, free of charge. The recall began May 21, 2019. Owners may contact Nova customer service at 1-800-350-6682. Nova's number for this recall is CR4595.

19V-274

PACCAR Incorporated (PACCAR) is recalling certain 2018-2020 T680 and T880 tandem axle vehicles equipped with a parking brake on a single axle and certain models of automated manual transmissions. During cold temperatures, the signal from the park brake pressure switch to the transmission controller may be delayed possibly resulting in the vehicle moving unexpectedly. Unexpected vehicle movement may increase the risk of a crash or injury. The remedy for this recall is still under development. The recall is expected to begin June 3, 2019. Owners may contact PACCAR customer service at 1-918-259-3258. PACCAR's number for this recall is 19KWB.

19V-275

Halcore Group, Inc. (Halcore) is recalling certain 2016-2019 American Emergency Vehicles (AEV) TraumaHawk ambulances equipped with ASA Electronics back-up camera displays. The affected displays may revert back to the factory default settings which may cause the camera image to be reversed. The driver may inadvertently turn the wrong direction to avoid an object behind the vehicle, increasing the risk of a crash. AEV will notify owners and dealers will add a harness relay capacitor module to prevent the image from reversing, free of charge. Owners may contact ASA customer service at 1-800-384-4400 or Halcore at 1-800-447-0343.

19V-276

Volkswagen Group of America, Inc. (Audi) is recalling certain 2018-2019 Audi Q5 and SQ5 vehicles. The brake master cylinder casting may be too short. A short casting can cause a sudden loss of brakes, increasing the risk of crash. The electronic parking brake and its emergency brake function are not affected and will still

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2019**

Published June 4, 2019

function. Audi has notified owners, and dealers will inspect the brake master cylinder, replacing it as necessary, free of charge. The recall began May 3, 2019. Owners may contact Audi customer service at 1-800-253-2834. Audi's number for this recall is 47O9.

19V-277

Ford Motor Company (Ford) is recalling certain 2015-2019 Ford F-150 and 2017-2019 Ford F-250 Super Duty, F-350 Super Duty, F-450 Super Duty, and F-550 Super Duty pick-up trucks equipped with an engine block heater and previously remedied under recall 18V894. During the previous repair, the block heater cable's splice connector may have been damaged. A damaged cable could cause a resistive short, increasing the risk of overheated or melted wiring, increasing the risk of a fire. Ford will notify owners, and dealers will disable the engine block heater from being used. When replacement cables become available, a second notice will be mailed and dealers will replace the engine block heater cord, free of charge. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 19S11.

19V-278

Load Trail LLC (Load Trail) is recalling certain 2018-2019 83"x14' and 83"x 16' Tandem Axle, and 83"x16' Triple Axle Dump trailers with the 621-scissor hoist option. Under heavy loads, the bolts that attach the hydraulic cylinder clevis to the scissor hoist can break. If the bolts break, the hydraulic cylinder may disengage from the scissor hoist, causing the dump box to lower back down onto the trailer frame at a rapid rate, increasing the risk of injury. Load Trail will notify owners, and dealers will add bracing and replace the clevis bolts with bolts that can support heavy loads, replacing any damaged parts as necessary, free of charge. The recall is expected to begin June 7, 2019. Owners may contact Load Trail customer service at 1-903-783-3900.

19V-279

Pierce Manufacturing (Pierce) is 2018-2019 Frontline C-35X, C-25, C-45X-3 and Encore Rescue vehicles equipped with Whelen brake lights. Depending on the specific wiring of the vehicle, these brake lights may illuminate when the brake pedal has not been pressed. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." If the brake lights incorrectly illuminate, it can confuse other drivers, possibly increasing the risk of a crash. Pierce has notified owners, and dealers will inspect and replace brake lights, if necessary, free of charge. The recall began April 23, 2019. Owners may contact Whelen customer service at 1-860-718-2331 or Pierce at 1-888-974-3723. Pierce's number for this recall is FLCWBL0419.

19V-280

Halcore Group, Inc. (Halcore) is recalling certain 2016-2019 Horton Type I and Type III ambulances equipped with ASA Electronics back-up camera displays. The displays may revert back to the factory default settings which may cause the camera image to be reversed. The driver may inadvertently turn the wrong direction to avoid an object behind the vehicle, increasing the risk of a crash. Horton will notify owners and dealers will add a harness relay capacitor module to prevent the image from reversing, free of charge. Owners may contact ASA customer service at 1-800-384-4400 or Halcore at 1-800-447-0343.

19V-281

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2019**

Published June 4, 2019

PACCAR Incorporated (PACCAR) is recalling certain 2017-2020 Peterbilt 520 vehicles. Due to undersized wires, the connector between the cab power harness and the power distribution center (PDC) harness may overheat and melt, possibly resulting in an engine shutdown. An unexpected engine shut down can increase the risk of a crash. PACCAR will notify owners, and dealers will replace the main power wire to the PDC with a wire of the correct size, free of charge. The recall is expected to begin June 3, 2019. Owners may contact PACCAR customer service at 1-918-259-3258. PACCAR's number for this recall is 19PBB.

19V-282

Proterra, Inc. (Proterra) is recalling certain 2015-2018 Catalyst 40 buses equipped with an optional tow fitting and airline that allows a tow truck to operate the rear brakes on the vehicle. The mesh cap covering the airline for the tow fitting can be clogged with road debris in inclement weather, possibly resulting in a build up of air pressure in the rear brake system. A build up of air pressure can cause the brakes to drag and possibly overheat, increasing the risk of fire. Proterra will notify owners, and dealers will install an additional shield to the tow fitting that protects the mesh cap, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Proterra customer service at 1-864-438-0000.

19V-283

Daimler Vans USA, LLC (DVUSA) is recalling certain 2019 Freightliner Sprinter and Mercedes-Benz Sprinter vehicles equipped with LED high performance headlights. The sensor for the headlamp range adjustment may not have been mounted or calibrated, possibly causing unexpected changes in the headlamp lighting angle. Unexpected changes in the headlamp lighting angle may affect the drivers visibility, increasing the risk of crash. DVUSA will notify owners, and dealers will inspect and retrofit the sensor and correctly calibrate the rotation angle sensor, free of charge. The recall is expected to begin June 4, 2019. Owners may contact DVUSA customer service at 1-877-762-8267. DVUSA's number for this recall is VS3LEDSSENS.

19V-284

North Central Emergency Vehicles (North Central) is recalling certain 2016-2018 Ambulances remounted on Ford E-350 and E-450 and Chevrolet G4500 chassis equipped with Whelen brake lights. Depending on the specific wiring of the vehicle, these brake lights may illuminate when the brake pedal has not been pressed. If the brake lights incorrectly illuminate, it can confuse other drivers, possibly increasing the risk of a crash. North Central will notify owners and dealers will replace the brake lights, free of charge. The recall began May 20, 2019. Owners may contact North Central Emergency Vehicles customer service at 1-320-395-2529.

19V-285

Spartan Motors USA (Spartan) is recalling certain 2012-2018 Fleet Services/Utilimaster Reach vehicles. Due to improper electrical grounding, the windshield wiper motor may stall and cause the windshield wipers to become inoperative, reducing the driver's visibility. A loss of windshield wiper becomes function can reduce visibility, increasing the risk of a crash. Spartan will notify owners, and dealers will install a ground wire between the wiper motor and an appropriate spot on the vehicle to stop the motor from stalling, free of charge. Owners may contact Spartan customer service at 1-800-543-5008. Spartan's number for this recall is 19008.

19V-286

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2019**

Published June 4, 2019

Chrysler (FCA US LLC) is recalling certain 2019 Jeep Renegade and Fiat 500X vehicles. Incorrect software may cause the occupant restraint controller (ORC) module to disable certain passive safety features. Deactivated passive safety features can increase the risk of injury in the event of a crash. Chrysler will notify owners, and dealers will update the ORC module software, free of charge. The recall began May 2, 2019. Owners may contact Chrysler's customer service at 1-800-853-1403. Chrysler's number for this recall is V42.

19V-287

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain 2019 Lexus ES vehicles. These vehicles are equipped with a driver knee air bag assembly mounted to the lower instrument panel (IP) that may have been improperly installed, possibly affecting the deployment of the knee air bag in the event of a crash. In the event of a crash, there is an increased risk of injury if the knee air bag does not deploy properly. Toyota will notify owners, and dealers will inspect and replace the driver knee air bag assembly, if necessary, free of charge. The recall began May 8, 2019. Owners may contact Toyota customer service at 1-800-255-3987. Toyota's numbers for this recall are KLD and KLE.

19V-288

Daimler Vans USA, LLC (DVUSA) is recalling certain 2016-2017 Metris vehicles sold, or ever registered in Connecticut, Delaware, Illinois, Indiana, Iowa, Kentucky, Maine, Maryland, Massachusetts, Michigan, Minnesota, Missouri, New Hampshire, New Jersey, New York, Ohio, Pennsylvania, Rhode Island, Vermont, Virginia, Washington DC, West Virginia and Wisconsin. The aluminum bolts that attach the power steering gear assist motor to the gear housing may corrode and fracture causing a reduction or complete loss of power steering assist. Loss of power steering assist would require a higher steering effort, especially at lower speeds, which may increase the risk of a crash. DVUSA will notify owners, and dealers will replace the aluminum bolts with steel bolts, free of charge. Owners may contact DVUSA customer service at 1-877-762-8267. DVUSA's number for this recall is VS2SCHRALU.

19V-290

BMW of North America, LLC (BMW) is recalling certain 2019 X3 sDrive30i, X3 xDrive30i, X3 M40i, and X4 M40i vehicles. The instrument panel assembly may have been improperly manufactured, possibly affecting the deployment of the passenger's frontal air bag. If the front passenger air bag does not deploy properly in the event of a crash, the occupant has an increased risk of injury. BMW will notify owners, and dealers will replace the instrument panel assembly, free of charge. The recall is expected to begin June 3, 2019. Owners may contact BMW customer service at 1-800-525-7417.

19V-291

Chrysler (FCA US LLC) is recalling certain 2013-2016 Dodge Dart vehicles equipped with 6-speed automatic transmissions. The shifter cable bushing may fail allowing the shift cable to detach from the transmission. If the shifter cable detaches from the transmission, the vehicle may not perform the shifts performed by the driver. Additionally, despite selecting PARK with the shifter, the vehicle may roll away. These scenarios may increase the risk of a crash. Chrysler will notify owners, and dealers will replace the transmission side shifter cable bushing, free of charge. Interim letters explaining the safety risk were mailed to owners May 22, 2019. Owners will receive a second letter when the remedy becomes available. Owners may contact Chrysler customer service

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2019**

Published June 4, 2019

at 1-800-853-1403. Chrysler's number for this recall is V34.

19V-293

Forest River, Inc. (Forest River) is recalling certain 2019 Dynamax Isata motorhomes built on a RAM cab chassis. The primary and secondary brake hoses located between the brake master cylinder and the hydraulic control unit may have been manufactured without anti-corrosion plating on the ferrules. If the ferrules corrode, the brake fluid may leak and cause a loss of braking, increasing the risk of a crash. Forest River will notify owners, and FCA US dealers will inspect the brake hoses and replace them if necessary, free of charge. The recall began on May 6, 2019. Owners may contact FCA US customer service at 1-800-853-1403 or Forest River at 1-574-262-3274. Forest River's number for this recall is 55-0992.

19V-294

Forest River, Inc. (Forest River) is recalling certain 2018 Dynamax Isata vehicles built on a RAM chassis and equipped with a column shifter. Pushing the brake pedal for prolonged periods when the vehicle is running and in PARK may cause the Brake Transmission Shift Interlock (BTSI) pin to stick in the open position. With the pin in the open position, the transmission can be shifted out of PARK into any gear without pushing the brake pedal or having the key in the ignition. Being able to shift the transmission without pushing the brake pedal and/or without a key in the ignition can increase the risk of an unintended vehicle rollaway that may result in personal injury or a crash. Forest River will notify owners, and Chrysler dealers will update the vehicle software, inspect the BTSI, and, as necessary, replace it, free of charge. The recall began on May 6, 2019. Owners may contact Chrysler customer service at 1-800-853-1403 or Forest River at 1-574-262-3474. Forest River's number for this recall is 55-0993.

19V-295

Karma Automotive (Karma) is recalling certain 2018 Karma Revero vehicles. In the event of a roll over crash, the side curtain/head protection air bags may not deploy as intended due to a rollover sensor system that is not enabled. The system also lacks an instrument cluster warning light and a description of the system in the owner's manual. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 226, "Ejection Mitigation." If the side air bags do not deploy as intended in a roll over crash, it can increase the risk of injury. Karma will notify owners, and dealers will replace the existing Airbag Control Unit (ACU) with a rollover enabled ACU and the owners manual will be updated with the description of the system, free of charge. Owners may contact Karma customer service at 1-855-288-6109. Karma's number for this recall is RC-19-84-01.

19V-296

Subaru of America, Inc. (Subaru) is recalling certain 2009-2013 Forester vehicles, 2008-2011 Impreza vehicles, 2008-2014 WRX vehicles, 2005-2014 Legacy vehicles, 2005-2014 Outback vehicles and 2006-2008 Tribeca vehicles equipped with a mechanical key ignition switch installed as a replacement part. The ball spring inside the switch may break, reducing the strength of the ignition switch. If this occurs, the weight on the key ring and certain road conditions could cause the ignition switch to move out of the run position to the accessory position, turning off the engine. The engine turning off unexpectedly can increase the risk of a crash. If a crash occurs under this condition, the air bag may not deploy, increasing the risk of injury. Subaru will notify owners, and

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2019**

Published June 4, 2019

dealers will inspect the ignition switch, replacing the ignition switch, if necessary, free of charge. The recall began May 10, 2019. Owners may contact Subaru customer service at 1-844-373-6614. Subaru's number for this recall is WUF-91.

19V-297

Honda (American Honda Motor Co.) is recalling certain 2018-2019 Acura MDX and Honda Pilot vehicles and 2019 Acura RLX, RLX Sport Hybrid, TLX and Honda Odyssey and Ridgeline vehicles. The timing belt teeth may separate from the belt. Teeth separation from the timing belt may result in an engine stall, increasing the risk of crash. Honda will notify owners, and dealers will inspect the vehicle and replace any affected timing belt free of charge. Vehicles receiving a replacement timing belt will also have the engine inspected and any damaged components will be replaced for free. Honda owners may contact customer service at 1-888-234-2138. Honda's number for this recall is L4M. Acura owners may contact customer service at 1-888-234-2138. Acura's number for this recall is Z4L.

19V-298

Honda (American Honda Motor Co.) is recalling certain 2018-2019 Odyssey vehicles. Loose battery terminal connections or a degraded battery may cause the Transmission Control Unit (TCU) to unexpectedly reboot. Upon rebooting, the TCU may shift the transmission to the "Park" position, possibly damaging the parking rod. A damaged parking rod can allow the vehicle to roll when parked, increasing the risk of a crash or injury. Honda will notify owners, and dealers will ensure the battery terminal connections are secure and will update the TCU software, free of charge. Additionally, the parking rod effectiveness will be checked. The recall began May 31, 2019. Owners may contact Honda customer service at 1-888-234-2138. Honda's numbers for this recall are Z4J, Y4K.

19V-299

SMC Trailers (SMC) is recalling certain 2019 Laramie horse trailers. The living quarter entry steps may break when being stepped onto due to poor welds and missing rivets. The steps could break while in use, increasing the risk of injury. SMC has notified owners, and dealers will inspect the trailers, correcting the welds and installing rivets as necessary, free of charge. The recall began April 23, 2019. Owners may contact SMC Trailers at 1-574-966-5598.

19V-300

Fontaine Trailer Company (Fontaine Trailer) is recalling certain 2017-2019 Traverse HT (hydraulic tail) trailers. The hydraulic cylinder retaining pin for the main tail may disconnect from the trailer unexpectedly. If the hydraulic cylinder retaining pin becomes disconnected it may become a road hazard. Additionally, the hydraulic cylinder may drop free and impact the road, and cause a loss of vehicle control. Either condition increases the risk of a crash. Fontaine Trailer will notify owners and dealers will replace the hydraulic cylinder retaining pin snap rings for cotter pins, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Fontaine Trailer customer service at 1-877-345-9526.

19V-302

Altec Industries Inc. (Altec) is recalling certain 2017-2018 Altec LR7, TA50, TA55, TA60, and TA45M-T50

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2019**

Published June 4, 2019

Aerial Devices. The fasteners that are used to secure the turntable to the pedestal may fail. If multiple fasteners fail, the pedestal and turntable may separate, increasing the risk of death or injury. Altec has notified owners and dealers will inspect and replace the defective fasteners, free of charge. The recall began April 18, 2019. Owners may contact Altec customer service 1-877-462-5832. Altec's number for this recall is MAB 716.

19V-303

Spartan Motors USA (Spartan) is recalling certain 2019 Fleet Services/Utilimaster Truck Body vehicles built on a Peterbilt chassis. Due to undersized wires, the connector between the cab power harness and the power distribution center (PDC) harness may overheat and melt, possibly resulting in an engine shutdown. An unexpected engine shut down can increase the risk of a crash. Spartan will notify owners, directing them to contact a Peterbilt dealer to have the main power wire to the PDC replaced with a wire of the correct gauge, free of charge. The recall is expected to begin June 3, 2019. Owners may contact Spartan customer service at 1-800-543-5008. Spartan's number for this recall is 19009.

19V-304

Spencer Manufacturing, Inc. is recalling certain 2017 TM-3000 (1426), TM-1000 (1427) and TM-1000 (1428) Fire Trucks, 2018 WS-3900 (1429), SM-2000 (1430), WS-2000 (1431), Rescue (1440), Grass Rig (1443) and SM-1000 (1444) Fire Trucks, and 2019 TM-1000 (1434), TM-1000 (1433), and TM-1000 (1432) Fire Trucks, equipped with Whelen accessory brake lights. Depending on the specific wiring of the vehicle, these brake lights may illuminate when the brake pedal has not been pressed. If the brake lights incorrectly illuminate, it can confuse other drivers, possibly increasing the risk of a crash. Spencer will notify owners, and Whelen will replace the brake lights, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Whelen customer service at 1-860-718-2331 or Spencer Manufacturing at 1-269-637-9459.

19V-305

REV Recreation Group (REV) is recalling certain 2019 Fleetwood Flair Model 32 S and Holiday Rambler Admiral Model 32 S motorhomes. The generator exhaust pipe placement exits the motorhome within the vehicle's departure angle. If motorhome is driven on an incline, the generator exhaust pipe may get damaged, possibly resulting in carbon monoxide entering the vehicle when the generator is running, increasing the risk of injury or death. REV has notified owners, and dealers will inspect and reroute the generator exhaust pipe, as necessary, free of charge. The recall began May 21, 2019. Owners may contact REV customer service at 1-800-509-3417. REV's number for this recall is 190412REV.

19V-306

Livin' Lite Recreational Vehicles (Livin' Lite) is recalling certain 2013-2017 Camplite and 2014-2017 Bearcat recreational trailers. One of the exit windows may be blocked by a manual awning arm. In the event of an emergency, occupants may try to escape through the blocked window, but would not be able to, increasing their risk of injury. Livin' Lite will notify owners, and dealers will remove the exit label and alter the window levers, free of charge. The recall is expected to begin June 15, 2019. Owners may contact Livin' Lite customer service at 1-800-768-4016 extension 154 or 153. Livin' Lite's number for this recall is LL-2019-01.

19V-307

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2019**

Published June 4, 2019

Volvo Cars of N.A., LLC (Volvo Cars) is recalling certain 2016 XC90 vehicles. Exposure to heat and humidity may cause the engine coolant bleeder hose to crack, resulting in a coolant leak. If the coolant leak goes unnoticed, coolant may accumulate in the catalytic converter heat shield insulation and catch fire when the vehicle is stationary, increasing the risk of injury. Volvo Cars will notify owners, and dealers will replace the engine side coolant bleeder hose, free of charge. The recall is expected to begin June 14, 2019. Owners may contact Volvo customer service at 1-800-458-1552. Volvo's number for this recall is R29936.

19V-308

Daimler Vans USA, LLC (DVUSA) is recalling certain 2019 Mercedes-Benz Sprinter (Platform 907) vehicles equipped with high-beam assist. A software error in the control unit may prevent the driver from being able to switch off the high beams when intended. Being unable to turn off the high beams may result in oncoming traffic being blinded by the vehicle's lights, increasing the risk of crash. DVUSA will notify owners, and Mercedes-Benz or Freightliner Sprinter dealers will update the control unit software, free of charge. The recall is expected to begin June 7, 2019. Owners may contact DVUSA customer service at 1-877-762-8267. DVUSA's number for this recall is VS3FERNLI.

19V-309

BMW of North America, LLC (BMW) is recalling certain 2018 i3 BEV and i3 REx hybrid electric vehicles. A circuit board problem within the Electric Motor Electronics (EME) module may shutdown the supply of high voltage electrical power. A shut down of high-voltage electrical power would result in a loss of propulsion, increasing the risk of a crash. BMW will notify owners, and dealers will replace the EME module, free of charge. The recall is expected to begin June 7, 2019. Owners may contact BMW customer service at 1-800-525-7417.

19V-310

Hyundai Motor America (Hyundai) is recalling certain 2019 Veloster vehicles. In certain side impact crashes, the driver's door latch housing and locking cable can become damaged, allowing the driver's side door to open. The door opening could result in occupant ejection or increase the risk of injury in the event of a crash. Hyundai will notify owners, and dealers will replace the driver's side door latch assembly and lower channel, free of charge. The recall is expected to begin June 14, 2019. Owners may contact Hyundai customer service at 1-855-371-9460. Hyundai's number for this recall is 183.

19V-311

General Motors LLC (GM) is recalling certain 2017-2019 Chevrolet Trax vehicles. A joint in one or both of the front lower-control arms may have been improperly welded. An improperly welded joint may break, resulting in the partial separation of the lower-control arm from the vehicle. A partial separation of the lower-control arm from the vehicle could cause the attached front wheel to toe outward, impacting the vehicle's handling and steering and increasing the risk of crash. GM will notify owners, and dealers will inspect the left and right front lower-control arms, replacing them as necessary, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact GM customer service at 1-800-222-1020. GM's number for this recall is A182202370.

19V-312

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2019**

Published June 4, 2019

Mobility Transportation Services (MobilityTrans) is recalling certain 2014-2018 Ford Transit and Ram Promaster vehicles and 2014-2015 Ford Econoline vehicles modified to be equipped with Freedman GO-ES Foldaway Seats, part numbers 43705, 45467, 48923, and 75719. When the back seat cushion is rotated from the stowed position to the upright position, the seat cushion may not remain locked into place when under load, such as in a crash or a sudden stop. In the event of a crash, if the seat back moves, the seat occupant has an increased risk of injury. MobilityTrans will notify owners and Freedman Seating dealers will inspect and repair the foldaway seat, free of charge. Owners may contact Mobility Transportation Services customer service at 1-734-453-6452.

19V-313

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain 2019 A220 and A220 4MATIC vehicles. Due to improper welding, the pedal plate may bend, impairing the operation of the brake pedal. Impaired operation of the brake pedal may increase the risk of crash. MBUSA will notify owners, and dealers will inspect the welding of the brake pedal, replacing it as necessary, free of charge. The recall began May 31, 2019. Owners may contact MBUSA customer service at 1-800-367-6372. MBUSA's number for this recall is 2019050002.

19V-314

Honda (American Honda Motor Co.) is recalling certain 2017-2018 Clarity Fuel Cell vehicles. Internal components may corrode and cause the water pump to fail. A failure of the water pump can cause the vehicle to stall, increasing the risk of crash. Honda will notify owners, and dealers will replace the water pump, free of charge. The recall is expected to begin June 10, 2019. Owners may contact Honda customer service at 1-888-234-2138. Honda's number for this recall is L4N.

19V-315

Nissan North America, Inc. (Nissan) is recalling certain 2019 Altima vehicles equipped with front wheel drive (FWD) and 2.5 liter engines. The fuel pump lock ring may not be fully engaged, possibly causing fuel to leak. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 301, "Fuel System Integrity." A fuel leak in the presence of an ignition source increases the risk of a fire. Nissan will notify owners, and dealers will inspect the fuel tank assembly. If the lock ring is disengaged, dealers will tighten the ring to specification. If the lock ring is detached, dealers will replace the fuel pump. Both remedies will be completed free of charge. The recall is expected to begin June 2019. Owners may contact Nissan customer service at 1-800-867-7669.

19V-316

Forest River, Inc. (Forest River) is recalling certain 2019 Rockwood and Flagstaff recreational trailers. The wiring for the front bedroom air conditioning may have been improperly installed and may come in contact with the heat strip in the air conditioner. If the wiring harness contacts the heat strip, the sheathing may melt, increasing the risk of fire. Forest River will notify owners, and dealers will secure the air conditioner wiring harness away from the heat strip, free of charge. The recall began on May 6, 2019. Owners may contact Forest River customer service at 1-574-642-8943. Forest River's number for this recall is 10C-1001.

19V-317

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2019**

Published June 4, 2019

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain 2019 Sienna vehicles. The passenger front door may have incorrect welds inside, possibly affecting the air bag sensor readings for the passenger side front seat and curtain shield air bags. The incorrect air bag sensor readings could cause the affected air bags to unintentionally deploy or to not deploy when intended, increasing the risk of a crash and/or injury. Toyota will notify owners, and dealers will replace the passenger side front door sub assembly with a new one, free of charge. The recall is expected to begin June 10, 2019. Owners may contact Toyota customer service at 1-888-270-9371. Toyota's number for this recall is K1G /K0G.

19V-318

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain 2015-2017 Yaris vehicles. The wire harnesses for the side air bag sensors located within the front doors may crack and corrode, possibly causing the non-deployment or improper deployment of the front seat side air bags and the curtain shield air bags. In the event of a crash, front seat side air bags and curtain shield air bags that do not deploy as intended can increase the risk of injury. Toyota will notify owners, and dealers will replace the wire harness assembly in the front doors, as necessary, free of charge. The recall is expected to begin June 10, 2019. Owners may contact Toyota customer service at 1-888-270-9371. Toyota's number for this recall is K1F/K0F.

19V-319

Erwin Hymer Group USA LP dba American Fastbacks (EHGUSA-AF) is recalling certain 2018 Jeep Wrangler vehicles sold with a roof top tent installed. The top cover of the roof top tent may crack or break, possibly resulting in the cover detaching from the vehicle while moving. If the roof top tent cover detaches from the vehicle while moving, it can create a road hazard, increasing the risk of a crash. The remedy for this recall is still under development. The recall began May 9, 2019. Owners may contact American Fastbacks customer service at 1-844-533-7997 extension 301. Note: Vehicles in this recall are also included in recall 19V-190.

19V-320

LDJ Manufacturing, Inc. (LDJ) is recalling certain 2017-2018 R250 Container trailers. The axles may have been installed backwards. Additionally, some of the axle spring seats may have not been welded to the axle. If the axle was installed backwards, the brakes may not operate properly, increasing the risk of a crash. LDJ has notified owners and dealers will inspect and correct the axle installations and weld the axle spring seat to the axle, as necessary, free of charge. The recall began May 22, 2019. Owners may contact LDJ customer service at 1-641-620-4034.

19V-321

Porsche Cars North America, Inc. (Porsche) is recalling certain 2010-2016 Panamera 4S and Panamera S, 2011-2016 Panamera, Panamera 4 and Panamera Turbo, 2012-2016 Panamera Turbo S and Panamera S E-Hybrid, 2013-2016 Panamera GTS, 2013 Panamera Platinum Edition and Panamera 4 Platinum Edition, 2014-2016 Panamera 4S Executive, Panamera Turbo Executive and Panamera Turbo S Executive, 2015 Panamera Diesel and 2016 Panamera 4 Edition, Panamera Edition and Panamera Turbo S Exclusive Series vehicles. Water may enter the A/C blower control unit, causing an electrical short circuit. An electrical short increases the risk of fire. Porsche will notify owners, and dealers will add a relay harness to the A/C blower control unit and reseal it to prevent water from leaking in, free of charge. The recall is expected to begin June 23, 2019. Owners

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2019**

Published June 4, 2019

may contact Porsche customer service at 1-800-767-7243. Porsche's number for this recall is AKA7. Note: Porsche recommends that owners park their vehicle outdoors until the recall remedy has been performed.

19V-322

Mazda North American Operations (Mazda) is recalling certain 2011-2013 Mazda6 vehicles sold, or ever registered in Connecticut, Delaware, the District of Columbia, Illinois, Indiana, Iowa, Kentucky, Maine, Maryland, Massachusetts, Michigan, Minnesota, Missouri, New Hampshire, New Jersey, New York, Ohio, Pennsylvania, Rhode Island, Vermont, Virginia, West Virginia, and Wisconsin. The front cross member may corrode after exposure to road salt. Corrosion may weaken the mounting point for the passenger side lower control arm, unexpectedly changing the steering alignment and increasing the risk of a crash. Mazda will notify owners, and dealers will inspect the cross member and either install a side member and drain hose and apply wax to protect from rust, or install a drain hose and an improved front cross member, free of charge. The recall is expected to begin June 24, 2019. Owners may contact Mazda customer service at 1-800-222-5500 Option 4. Mazda's number for this recall is 2818I. Note: This recall is an expansion of Recall 18V-631.

19V-323

Chrysler (FCA US LLC) is recalling certain 2018-2019 Ram 1500 pickup trucks. The rear driveshaft may have an incomplete weld fusion between the tube and tube yoke, which may lead to weld cracking or the driveshaft fracturing. A fractured rear driveshaft could detach from the vehicle and become a road hazard, or it may result in a loss of drive power, both of which can increase the risk of a crash. FCA US will notify owners, and dealers will replace the rear driveshaft, free of charge. The recall is expected to begin June 15, 2019. Owners may contact FCA US customer service at 1-800-853-1403. The FCA US recall number is V48.

19V-324

Jaguar Land Rover North America, LLC (Jaguar Land Rover) is recalling certain 2014-2015 Jaguar F-TYPE vehicles previously remedied under Recall 14V-714. The seatbelt harness connector which connects the Seatbelt Tension Sensor (STS) to the Occupant Classification Sensor Control Module (OCSCM) may not have been correctly wired. As a result, the Restraint Control Module (RCM) may not accurately detect if an adult or child is occupying the seat. In the event of a crash necessitating air bag deployment, an incorrect classification may result in the passenger frontal air bag deploying even if there is a child in the front passenger seat, increasing their risk of injury. Jaguar will notify owners, and dealers will inspect the seat belt assembly and repair the seatbelt tension sensor harness as necessary, free of charge. The recall is expected to begin June 21, 2019. Owners may contact Jaguar customer service at 1-800-452-4827. Jaguar's number for this recall is H208.

19V-326

Volvo Car USA LLC (Volvo) is recalling certain 2019 S60 vehicles. The rear suspension toe link flange lock nuts may not have been properly tightened, possibly resulting in a sudden change in vehicle handling. A sudden change in vehicle handling can increase the risk of a crash. Volvo will notify owners, and dealers will inspect the rear toe link flange bolts and lock nuts, replacing them if necessary, free of charge. The recall is expected to begin June 21, 2019. Owner's my contact Volvo Customer Service at 1-800-458-1552. Volvo's number for this recall is R19938.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2019**

Published June 4, 2019

19V-327

General Motors LLC (GM) is recalling certain 2019 Chevrolet Silverado 4500, 5500 and 6500 vehicles and 2017-2019 Chevrolet Silverado 2500 and 3500 vehicles and GMC Sierra 2500 and 3500 vehicles equipped with Duramax 6.6 liter diesel engines and an optional engine-block heater. The engine block heater cord or the terminals that connect the heater cord to the block heater may short circuit and fail. A short-circuit may damage the engine components and increase the risk of fire. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact GM customer service at 1-586-596-1733. GM's number for this recall is N182206310.

19V-328

Fenton Mobility Products, Inc. (Fenton Mobility) is recalling certain 2015-2018 Ford Transit vehicles modified to be equipped with Freedman GO-ES Foldaway Seats, part numbers 43705, 45467, 48923, and 75719. When the back seat cushion is rotated from the stowed position to the upright position, the seat cushion may not remain locked into place when under load, such as in a crash or a sudden stop. In the event of a crash, if the seat back moves, the seat occupant has an increased risk of injury. Fenton Mobility will notify owners, and a Fenton Mobility technician will repair the foldaway seats, free of charge. The recall is expected to begin in June 2019. Owners may contact Fenton Mobility customer service at 1-716-484-7014.

19V-329

Mitsubishi Motors North America, Inc. (MMNA) is recalling certain 2017-2018 Mirage G4 vehicles. The internal acceleration sensor in the Supplemental Restraint System (SRS) Electronic Control Unit (ECU) can misinterpret vibrations, such as from poor road conditions or a flat tire, as a malfunction and disable all the vehicle's air bags. Air bags that do not deploy increase the risk of injury in a crash. MMNA notified owners, and dealers will reprogram the SRS-ECU software, free of charge. The recall began May 24, 2019. Owners may contact MMNA customer service at 1-888-648-7820. MMNA's number for this recall is SR-19-001.

19V-330

Southeast Apparatus is recalling certain 2017-2018 Tankers, Pumpers, and Rescue vehicles equipped with Whelen brake lights. Depending on the specific wiring of the vehicle, these brake lights may illuminate when the brake pedal has not been pressed. If the brake lights incorrectly illuminate, it can confuse other drivers, increasing the risk of a crash. Southeast Apparatus will notify owners and Whelen will replace the brake lights, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Southeast Apparatus customer service at 1-888-996-6277.

19V-331

New England Wheels (New England) is recalling certain 2014-2018 Ford Transit and 2014-2019 Ram Promaster 2500 and 3500 vehicles modified to be equipped with Freedman Go-ES Foldaway seats. When the back seat cushion is rotated from the stowed position to the upright position, the seat cushion may not remain locked into place when under load, such as in a crash or a sudden stop. In the event of a crash, if the seat back moves, the seat occupant has an increased risk of injury. New England has notified owners, directing them to contact Freedman for repairs to the foldaway seats, free of charge. The recall began May 27, 2019. Owners

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2019**

Published June 4, 2019

may contact Freedman customer service at 1-800-443-4540 or New England at 1-800-886-9247.

19V-333

Airstream, Inc. (Airstream) is recalling certain 2018-2020 International, Sport, Flying Cloud, Classic, Tommy Bahama, Globetrotter, and Nest travel trailers. The forward end of the spare tire carrier may contact the ground while the trailer is moving possibly resulting in the carrier and spare tire separating from the vehicle. If the spare tire and tire carrier become detached it can become a road hazard, increasing the risk of crash. Airstream will notify owners, and dealers will install corrected spare tire carrier brackets, free of charge. The recall is expected to begin June 28, 2019. Owners may contact Airstream customer service at 1-877-596-6505 or 1-937-596-6111, extension 7401 or 7411.

19V-334

Jayco, Inc. (Jayco) is recalling certain 2019 Jay Flight TF travel trailers, model 32RLOK. The supports for the fresh water tank may be too thin, resulting in the brackets breaking and the tanks detaching from the trailer. A detached water tank would be a road hazard, increasing the risk of crash. Jayco has notified owners, and dealers will install a threaded rod in the center of the water tank support apparatus to provide additional support, free of charge. The recall began May 9, 2019. Owners may contact Jayco customer service at 1-800-517-9137. Jayco's number for this recall is 9901433.

19V-335

Forest River, Inc. (Forest River) is recalling certain 2019-2020 Coachmen Beyond, Crossfit and Galleria motorhomes equipped with ProAir air conditioning systems powered by a LI3 lithium ion battery system. The wiring for ProAir system may be undersized for the potential load. Additionally, the circuit was not fuse or breaker protected. The undersized wiring on the unprotected circuit may be overloaded and melt, increasing the risk of a fire. Forest River has notified owners, and dealers will replace the wiring and install a circuit breaker, free of charge. The recall began May 20, 2019. Owners may contact Forest River customer service at 1-574-825-8590. Forest River's number for this recall is 225-1003.

19V-336

Smeal Holding LLC (Smeal) is recalling certain 2017-2019 Aerial Fire Apparatus vehicles. The tube steel used in the base rail of the aerial device may be missing joint welds, which may cause the aerial device to become unsteady and possibly collapse. The aerial device may collapse increasing the risk of injury. Smeal has notified owners, and dealers will inspect the aerial devices, replacing any sections with missing welds, free of charge. The recall began May 2, 2019. Owners may contact Smeal customer service at 1-800-867-6478. Smeal's number for this recall is 1911.

19V-337

Spartan Motors USA (Spartan) is recalling certain 2004-2016 Emergency Response Gladiator Tractor Drawn Aerial vehicles. Cracks may develop and extend into the vertical portions of the tiller frame, resulting in instability of the aerial device. If the aerial device becomes unstable, the device may fall, increasing the risk of an injury. Spartan will notify owners, and dealers will inspect and correct any cracking, and add reinforcements to prevent

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2019**

Published June 4, 2019

any possible future cracking, free of charge. The recall is expected to begin May 23, 2019. Owners may contact Spartan customer service at 1-800-543-5008. Spartan's number for this recall is 19007.

19V-338