

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2020**

Published May 8, 2020

CHILD SEATS:

None during April 2020.

EQUIPMENT:

Agility Fuel Systems (Agility) is recalling certain CNG Pressure Relief Devices and CNG Fuel Systems that include an EMER pressure relief device. The thermally activated pressure relief devices (PRDs) installed on CNG fuel systems may not vent the system when exposed to heat, potentially resulting in the system rupturing. If the fuel system ruptures from being exposed to heat, there would be an increased the risk of injury. Agility will work with OEM's and distributors to notify customers, and replace the PRDs, free of charge. The recall began on April 28, 2020. Owners may contact Agility customer service at 1-949-267-7745.

20E-019

Chrysler (FCA US LLC) is recalling certain Mopar Rear Bed Step Kits, part numbers 82215842AD and 82215842AC, sold as accessory equipment for Ram heavy duty trucks. In certain side loading conditions, the bed step may unexpectedly fail while in use. A bed step that unexpectedly fails while in use increases the risk of injury. Chrysler will notify owners, and dealers will replace the bed step support brace, free of charge. The recall is expected to begin May 29, 2020. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is W26.

20E-020

Winkelmann Flowform Technology LP (WFT) is recalling certain 327 liter compressed natural gas cylinders, part number CNG-327L-2560N. The font size of the cylinder labels may be too small and may be missing the type 3 designation, which will prevent the cylinders from passing inspection. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 304, "Compressed Natural Gas Fuel Container Integrity." If the cylinders cannot be inspected or pass inspection, the cylinders can fail and increase the risk of a fire or injury. WFT will notify owners, and provide replacement cylinder labels, free of charge. The recall began on April 20, 2020. Owners may contact WFT customer service at 1-334-758-6400.

20E-021

Honda and Nissan are recalling vehicles manufactured with Takata Corporation (Takata) PSDI-5D driver air bag inflators. Due to a manufacturing error, the air bag inflator may not function properly or the inflator may explode in the event of a crash that necessitates driver air bag deployment. An explosion of an inflator within the driver frontal air bag module may result in sharp metal fragments striking the driver, front seat passenger or other occupants resulting in serious injury or death. Takata will work with affected OEM's who will be replacing the driver frontal air bag module, free of charge. The recall began March 30, 2020. Owners may contact Takata customer service at 1-248-373-8040.

20E-022

General Motors LLC (GM) is recalling certain Rugger Liner hard, tri-fold tonneau covers sold as accessories for 2019-2020 Chevrolet Silverado and GMC Sierra 1500 series trucks. The attachment system may not properly

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2020**

Published May 8, 2020

secure the cover to the pickup bed. If the cover separates from the truck bed, it could be a road hazard, increasing the risk of a crash. GM will notify owners, and dealers will replace the tonneau rails and install improved attachments, free of charge. The recall is expected to begin June 1, 2020. Owners may contact GM customer service at 1-586-596-1733. GM's number for this recall is N192285070. Note: All tonneau covers previously recalled under 19E031 are also included in this new recall.

20E-024

Ford Motor Company (Ford) is recalling certain Replacement Headlamps, part number DP5Z-13008-T and DP5Z-13008-V, sold for use with 2013-2016 Lincoln MKZ vehicles. The headlamps may have an improper beam pattern and incorrect horizontal adjustment, the side markers may not illuminate and DOT markings may be missing. As such, these headlamps fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." The incorrect headlamps may reduce the driver's visibility or make the vehicle less visible, increasing the risk of a crash. Ford will notify vehicle manufacturers, and dealers will inspect the headlamps, and replace the headlamps, as necessary, free of charge. Additionally, Ford will instruct dealers to return all improper headlamps and not to install them on any vehicles. The recall is expected to begin May 25, 2020. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 20C10.

20E-025

Denso International America Inc. (Denso) is recalling certain fuel pumps. An impeller within the low pressure fuel pump may crack and deform, potentially causing the fuel pump to fail. If the fuel pump fails, the engine can stall while driving, increasing the risk of a crash. Denso has notified the affected vehicle and aftermarket equipment manufacturers who will conduct recalls as necessary to replace the fuel pumps. The recall schedule will be decided by vehicle manufacturers. For DENSO-related questions, please contact DENSO NA Corporate Communications at corp_communications@denso-diam.com or 1-248-372-8261.

20E-026

TIRES:

None during April 2020.

VEHICLES:

Daimler Coaches North America (Daimler Coaches) is recalling certain 2017-2020 Setra S417TC coaches. The front entrance door support frame may not be the correct size, and, as a result, the door may open and may detach from the vehicle while the coach is moving. A detached door can increase the risk of injury to the coach occupants or the detached door could be a road hazard, increasing the risk of a crash. Daimler Coaches will notify owners, and dealers will replace the front entrance door support frame and holders at the base of the support frame, free of charge. The recall is expected to begin May 29, 2020. Owners may contact Daimler Coaches customer service at 1-416-624-3558. Daimler Coach's number for this recall is 72.00M20089A.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2020**

Published May 8, 2020

20V-190

Chrysler (FCA US LLC) is recalling certain 2020 Jeep Gladiator and Jeep Cherokee, 2019-2020 Ram 1500 Pickup, Ram 2500 Pickup, Ram 3500 Pickup, Chrysler Pacifica, Dodge Durango, Jeep Grand Cherokee, Jeep Wrangler, and Jeep Renegade and 2019 Dodge Challenger vehicles equipped with 8.4" or 12" radio displays. A software error can cause the rearview camera image to remain displayed after the vehicle has been shifted out of reverse. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 111, "Rearview Mirrors." The lingering rearview image can distract the driver, increasing the risk of a crash. Chrysler will notify owners, and dealers will update the radio display software, free of charge. The recall is expected to begin May 22, 2020. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is W30-W37.

20V-191

Kovatch Mobile Equipment Corp. (KME) is recalling certain 2016-2020 Predator Custom, Predator Panther, Predator Severe Service, and 2016-2019 Commercial Cab/Chassis vehicles. An electrical short circuit can occur due to a build-up of corrosion between the positive battery jumper stud and the retaining ring for the stud. An electrical short circuit may drain the battery, preventing the emergency vehicle from being able to operate, thereby increasing the risk of injury in the event of an emergency. KME will notify owners, and dealers will clean the jumper studs, connection surfaces, and connections. Additionally, the connection surfaces and wire terminals will then be sealed with a silicone electrical sealant. All services will be performed free of charge. Owners may contact KME customer service at 1-800-235-3928.

20V-192

Isuzu Technical Center of America, Inc. (Isuzu) is recalling certain 2019 NPR GAS, 2019 NPRHD GAS and 2019 Chevrolet 4500 vehicles. The brake line clips for the rear driver side brake line may have been incorrectly installed, potentially allowing the brake line to contact a grounding bolt, potentially causing a loss of the rear driver side brakes. If the rear driver side brake fails, the vehicle may experience reduced braking, increasing the risk of a crash. Isuzu will notify owners, and dealers inspect and replace brake line assembly or reposition the brake line into the proper position, as necessary, free of charge. The recall is expected to begin May 2020. Owners may contact Isuzu customer service at 1-866-441-9638. Isuzu's number for this recall is V2002.

20V-193

Keystone RV Company (Keystone) is recalling certain 2018-2020 Crossroads Hampton 371FKL recreational trailers. The Federal identification Tag may incorrectly indicate the tire pressure as 6 PSI when the correct tire pressure is actually 80 PSI. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." An incorrect label may lead to unintentionally underinflating the tires, increasing the risk of a crash. Keystone will notify owners and will replace the Federal Identification Tag, free of charge. The recall is expected to begin June 1, 2020. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 20-376.

20V-194

Isuzu Technical Center of America, Inc. (Isuzu) is recalling certain 2018-2020 FTR and Chevrolet 6500XD

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2020**

Published May 8, 2020

vehicles. The chassis wire harness outside the relay box may have been improperly routed, potentially allowing the harness to contact the suspension's leaf spring hanger bracket, allowing the harness to get chafed. Depending on which wires get damaged, the vehicle can experience stalling and/or reduced functionality of the ABS, increasing the risk of a crash. Isuzu will notify owners, and dealers will repair or replace the existing wire harness, as necessary, and install additional clamps to ensure the wire harness is secured away from the hanger bracket, free of charge. The recall is expected to begin May 2020. Owners may contact Isuzu customer service at 1-866-441-9638. Isuzu's number for this recall is V2003.

20V-195

Trans Tech Bus (Trans Tech) is recalling certain 2020 Roadstar, ST Aero and SST buses built on 2019 Chevrolet Express cutaway chassis. The specific models are AC139SSSA409, AC139SSSP500, CC139DMSA409, CC139DMSA500, CC139DMSP500, CC159DMSA509, C159DMSA600, EC139DBSP400, SC139DSFP500, SC139DSSA409, SC139DSSA500, SC139DSSP500, SC159DSFP600, SC159DSSA509, SC159DSSA600, SC159DSSA603, SC159DSSP600, and SC177DSSA603.

The seatbelt-unfastened warning light will not illuminate for approximately five seconds after the ignition is moved to the "on" or "start" position. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 208, "Occupant Crash Protection." Without the seatbelt warning reminder, the driver may forget to fasten the seatbelt, increasing the risk of injury in the event of a crash. Trans Tech will notify owners, and dealers will reprogram the instrument panel cluster, free of charge. The recall began May 6, 2020. Owners may contact Trans Tech customer service at 1-845-988-2333.

20V-196

Ford Motor Company (Ford) is recalling certain 2020 Ranger and F-150 vehicles equipped with 10-speed automatic transmissions and certain 2020 Expedition vehicles equipped with a "police" package. The transmission shift cable lock clip may not be fully seated, allowing the transmission to actually be in a different gear than the gear shift position selected by the driver. If the transmission selection does not match the indicated gear selection, and the parking brake is not applied, unintended vehicle movement can occur, increasing the risk of injury or crash. Ford will notify owners, and dealers will inspect and correct the shift cable locking clip installation, as necessary, free of charge. The recall began April 27, 2020. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 20S18.

20V-197

KTM North America, Inc. (KTM) is recalling certain 2019-2020 790 Adventure and 790 Adventure R motorcycles. The rear brake hose may overheat, causing the rear brake system to fail. If the rear brake system fails, there would be reduced braking ability, increasing the risk of a crash or injury. KTM will notify owners, and dealers will install a new rear brake line, free of charge. The recall is expected to begin June 1, 2020. Owners may contact KTM customer service at 1-888-985-6090. KTM's number for this recall is TB2011.

20V-198

PACCAR Incorporated (PACCAR) is recalling certain 2008-2019 Peterbilt 330, 335, 337, 340, 348, 365,

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2020**

Published May 8, 2020

367, 384, 386, 387, 388, 389, 567, 579 and 587 vehicles and 2008-2020 Kenworth T170, T270, T370, T660, T680, T800, T880, and W900 vehicles equipped with NAMUX Software. In the event that the Anti-lock Brake System (ABS) loses battery and/or ignition power to the controller, the dash warning light for the ABS may not illuminate to warn the driver of the loss of ABS. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 121, "Air Brake Systems," and 136, "Electronic Stability Control System on Heavy Vehicles." If the driver unknowingly operates the vehicle without the ABS functioning, there would be an increased risk of a crash. PACCAR will notify owners, and dealers will update the NAMUX software within the cab control module, free of charge. The recall is expected to begin June 15, 2020. Owners may contact Kenworth customer service at 1-425-828-5888 or Peterbilt customer service at 1-940-591-4220. PACCAR's number for this recall is 20pbc AND 20KWB.

20V-199

Terex South Dakota, Inc. (Terex) is recalling certain 2018-2019 C4045, C4047, C5050, and C7066 Digger Derrick vehicles. Due to an engine computer program error, if the hood switch fails or opens, the remote engine start/stop function becomes disabled. A disabled remote engine start/stop prevents the digger derrick operator from shutting the engine off during hydraulic issues on the digger, increasing the risk of injury. Terex will notify owners, and dealers will reprogram the engine computer program, free of charge. The recall began April 16, 2020. Owners may contact Terex customer service at 1-605-882-4000. Terex's number for this recall is SN682.

20V-200

Vac-Tron Equipment, LLC. (Vac-Tron) is recalling certain 2012-2020 MC555SDT, MC533SDT and MC573SDT Vacuum Excavator trailers. The trailer's front clearance lamps are positioned improperly, the jetter blocks visibility to the passenger side front clearance lamp, and an insufficient amount of conspicuity tape may have been applied on the sides and rear. The trailers may also lack side or rear reflex reflectors. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." Due to the improper position of lamps, insufficient reflective tape, and lack of reflectors, the trailer may not be visible at night, increasing the risk of crash. Vac-Tron will notify owners, and Vermeer dealers will install remedy kits provided by Vac-Tron, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Vac-Tron customer service at 1-888-822-8766.

20V-201

Great Dane Trailers (Great Dane) is recalling certain 2020-2021 Everest Refrigerated Vans. The axle nut retaining clips may have been improperly installed, potentially resulting in loose wheels and loss of vehicle control. Loss of vehicle control increases the risk of a crash. Great Dane will notify owners, and dealers will inspect and properly install the axle retaining clips, as necessary, free of charge. The recall began April 28, 2020. Owners may contact Great Dane customer service at 1-912-232-4471.

20V-202

Marion Body Works Inc. (Marion Body Works) is recalling certain 2019-2020 Spartan Gladiator and MetroStar Emergency Response chassis vehicles modified by Marion Body Works. The park brake control line

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2020**

Published May 8, 2020

may loosen and possibly come out the fitting while the vehicle is in motion. If the air line comes out of the fitting while the vehicle is in motion, the park brake can inadvertently be applied and the vehicle could suddenly decelerate, increasing the risk of a crash. Marion Body Works dealers will inspect and properly tighten the park brake control line, free of charge. All of the vehicles will be repaired before being delivered to customers, free of charge. Owners may contact Marion Body Works customer service at 1-715-754-5261.

20V-203

Vac-Tron Equipment, LLC. (Vac-Tron) is recalling certain 2012-2020 MC833SDT, MC835SDT, MC855SDT, and MC873SDT Vacuum Excavator trailers. The trailer exterior lighting may be incorrect, including the front clearance lamps are positioned improperly, the jetter blocks visibility to the passenger side front clearance lamp, and an insufficient amount of conspicuity tape may have been applied on the sides and rear. The trailers may also may also lack side or rear reflex reflectors. Due to the improper position of the lamps, insufficient reflective tape, and lack of reflectors, the trailer may not be visible at night, increasing the risk of crash. Vac-Tron will notify owners, and Vermeer dealers will install remedy kits provided by Vac-Tron, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Vac-Tron customer service at 1-888-822-8766. Vac-Tron's number for this recall is VVK0006.

20V-204

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain 2020 Corolla Hatchback vehicles. A rear hatch wire harness connector may have been damaged during assembly, which may cause the back-up lights to fail. If the back-up lights fail, there can be an increased risk of a crash while the vehicle is reversing. Toyota will notify owners, and dealers will replace the rear hatch wire harness, free of charge. The recall is expected to begin May 25, 2020. Owners may contact Toyota customer service at 1-888-270-9371. Toyota's numbers for this recall are 20TB07 and 20TA07.

20V-205

Vac-Tron Equipment, LLC. (Vac-Tron) is recalling certain 2012-2020 MC833SDT, MC835SDT, MC855SDT, and MC873SDT Vacuum Excavator Trailers. The trailers may not have an extended lower chassis, reducing rear impact protection. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 224, "Rear Impact Protection." In the event of a rear impact crash, the other vehicle can travel under the rear of the vacuum excavator, increasing the risk of serious injury or death to someone in the other vehicle. Vac-Tron will notify owners, and Vermeer dealers will install remedy kits provided by Vac-Tron, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Vac-Tron customer service at 1-888-822-8766. Vac-Tron's number for this recall is VVK0006.

20V-206

Chrysler (FCA US LLC) is recalling certain 2019-2020 Ram 2500 and Ram 3500 Pick-up trucks equipped with an accessory bed step. In certain side loading conditions, the bed step may unexpectedly fail while in use. A bed step that unexpectedly fails while in use increases the risk of injury to the user. Chrysler will notify owners, and dealers will replace the bed step support brace, free of charge. The recall is expected to begin May 29, 2020. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's numbers for this recall are W24 and W44.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2020**

Published May 8, 2020

20V-207

Chrysler (FCA US LLC) is recalling certain 2019-2020 Ram 1500, 1500 Classic and Jeep Compass vehicles. The windshield wiper arm or arms may loosen, possibly causing the wipers to not operate properly and reduce the driver's visibility in certain weather conditions. Reduced visibility increases the risk of a crash. Chrysler will notify owners, and dealers will tighten the wiper nuts, free of charge. The recall is expected to begin May 29, 2020. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is W25.

20V-208

Forest River, Inc. (Forest River) is recalling certain 2021 Starcraft Bus AllStar ST93109 transit buses built on a Ford chassis. The wire harness may contact the vehicle frame, resulting in chaffing of the wiring for the fuel pump and the anti-lock braking system (ABS). Damage to the fuel pump circuit in the wiring harness could result in an unexpected engine stall. Damage to the ABS wiring can lead to reduction of ABS functionality and a loss of roll stability control (RSC) functionality. These scenarios increase the risk of a crash. Forest River will notify owners and Ford dealers will inspect the wire harness for damage. If no damage is found, dealers will apply anti-abrasion tape over the area and ensure clearance to surrounding components. If damage is found, dealers will splice in new wire and apply anti-abrasion tape over the area and ensure clearance to surrounding components. All services will be performed free of charge. The remedy for this recall is still under development. Forest River sent owners an interim notice on April 28, 2020. A final notification will be sent once a remedy is finalized. Owners may contact Forest River customer service at 1-800-348-7440. Owners may contact Ford customer service at 1-866-436-7332. Forest River's number for this recall is 55-1154.

20V-209

Forest River, Inc. (Forest River) is recalling certain 2022 StarCraft Starquest ST93079 school buses. The wire harness may contact the vehicle frame, resulting in chaffing of the wiring for the fuel pump and the anti-lock braking system (ABS). Damage to the fuel pump circuit in the wiring harness could result in an unexpected engine stall. Damage to the ABS wiring can lead to reduction of ABS functionality and a loss of roll stability control (RSC) functionality. These scenarios increase the risk of a crash. Forest River will notify owners and Ford dealers will inspect the wire harness for damage. If no damage is found, dealers will apply anti-abrasion tape over the area and ensure clearance to surrounding components. If damage is found, dealers will splice in new wire and apply anti-abrasion tape over the area and ensure clearance to surrounding components. All services will be performed free of charge. The remedy for this recall is still under development. Forest River sent owners an interim notice on April 28, 2020. A final notification will be sent once a remedy is finalized. Owners may contact Forest River customer service at 1-800-348-7440. Forest River's number for this recall is 51-1156.

20V-210

Daimler Trucks North America LLC (DTNA) is recalling certain 2020 Freightliner 108SD and 2020-2021 Freightliner Coronado, 114SD, and Western Star 4700 and 4900 vehicles. The Gross Axle Weight Rating (GAWR) on the certification label may be incorrect, possibly resulting in the vehicle being overloaded. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 120, "Wheels and Rims - Other Than Passenger Cars." An overloaded vehicle can increase the risk of a crash.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2020**

Published May 8, 2020

DTNA will notify owners, and dealers will update the GAWR labels, free of charge. The recall is expected to begin June 7, 2020. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL847.

20V-211

Yamaha Motor Corporation, USA (Yamaha) is recalling certain XV250 motorcycles. An oil passageway in the engine side cover may not be properly manufactured, possibly blocking lubricating oil to the engine. Improper lubrication of internal engine components can result in the engine stalling, increasing the risk of a crash. Yamaha will notify owners, and dealers will inspect and replace of the engine side cover, free of charge. The recall began April 17, 2020. Owners may contact Yamaha customer service at 1-800-962-7926. Yamaha's number for this recall is 990136.

20V-212

Hyundai Motor America (Hyundai) is recalling certain 2020 Nexo and Sonata vehicles. The Remote Smart Parking Assist (RSPA) software may fail to prevent vehicle movement upon detection of an RSPA system malfunction. Unintended vehicle movement increases the risk of a crash. Hyundai will notify owners, and dealers will reprogram the RSPA software, free of charge. The recall is expected to begin June 4, 2020. Owners may contact Hyundai customer service at 1-855-371-9460. Hyundai's number for this recall is 191.

20V-213

Daimler Trucks North America LLC (DTNA) is recalling certain 2006-2020 Freightliner Columbia, 2006-2021 Freightliner Business Class M2, 2007-2020 Freightliner Coronado, 2014-2021 Freightliner 122 SD, 2007 Sterling A 9500, 2006 Freightliner Argosy, 2006-2007 Sterling AT9500, 2008-2021 Freightliner Cascadia, 2006-2008 Freightliner Classic, 2006-2011 Freightliner Century Class, 2006-2010 Freightliner FLD, and 2017 Western Star 5700 vehicles. The rear reflective tape may be partially covered by the mudflap hanger bracket, which may reduce the vehicle's visibility to other drivers on the road. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." The vehicle's rearward visibility may be reduced, increasing the risk of a crash. DTNA will notify owners, and dealers will inspect and reposition the reflective tape to ensure that it is completely visible, as necessary, free of charge. The recall is expected to begin June 12, 2020. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL848.

20V-214

Spartan Motors, Inc. (Spartan) is recalling certain 2020-2021 FLT Utilimaster Truck Body vehicles. The license plate lamp may be installed in the incorrect position and at an incorrect angle, causing the plate to not be properly illuminated. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." The incorrectly positioned license plate lamp may cause confusion to other drivers on the road, increasing the risk of a crash. Spartan will notify owners, and will replace the license plate lamp, free of charge. Owners may contact Spartan customer service at 1-800-543-5008. Spartan's number for this recall is 20-05.

20V-216

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2020**

Published May 8, 2020

Ford Motor Company (Ford) is recalling certain 2020 Expedition vehicles. The front passenger seatbelt buckle's Belt Tension Sensor (BTS) may malfunction and may result in the seat occupant being misclassified. In the event of a crash, the restraint system may not provide the intended level of protection, increasing the risk of injury. Ford will notify owners, and dealers will replace the front passenger seatbelt buckle, free of charge. The recall is expected to begin May 2020. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 20S17.

20V-217

Subaru of America, Inc. (Subaru) is recalling certain 2019 Impreza, Outback, Legacy, and Ascent vehicles. The low pressure fuel pump may become inoperative. If the low pressure fuel pump fails, the engine may stall without the ability to restart the vehicle, increasing the risk of a crash. Subaru will notify owners, and dealers will replace the low pressure fuel pump, free of charge. The recall is expected to begin June 5, 2020. Owners may contact Subaru customer service at 1-844-373-6614. Subaru's number for this recall is WRD-20.

20V-218

Navistar, Inc. (Navistar) is recalling certain 2017-2020 International WorkStar and International DuraStar, 2018-2019 IC 1300 FBC Commercial and IC HC Commercial, 2018-2021 IC CE Commercial, International MV and International HV, and 2019-2021 IC TC Commercial buses with Cummins B6.7 diesel engines with a fuel module option number FS90301 or FS90453. The electric fuel heater within the fuel module may overheat and cause plastic in the fuel heater to melt and potentially catch fire. It may also lead to engine stalling. A fire increases the risk of injury. An engine stall can increase the risk of a crash. Cummins will notify the affected Navistar customers and dealers will disable the fuel heater by either installing a plug in place of the heater or otherwise rendering the fuel heater inoperative and removing the fuse supplying electrical power to the fuel heater and installing a cover over the wire harness connector, free of charge. Owners may contact Cummins customer service at 1-800-286-6467.

20V-219

Navistar, Inc. (Navistar) is recalling certain 2017-2021 IC CE School Buses equipped with Cummins B6.7 diesel engines with fuel module option number FS90301 or FS90453. The electric fuel heater within the fuel module may overheat and cause plastic in the fuel heater to melt and potentially catch fire. It may also lead to engine stalling. A fire increases the risk of injury. An engine stall can increase the risk of a crash. Cummins will notify the affected Navistar customers and dealers will disable the fuel heater by either installing a plug in place of the heater or otherwise rendering the fuel heater non-operable and remove the fuse supplying electrical power to the fuel heater and install a cover over the wire harness connector, free of charge. Owners may contact Cummins customer service at 1-800-286-6467.

20V-220

Forest River, Inc. (Forest River) is recalling certain 2016 Rockwood RLT2604WS, WRLT2604WS, Flagstaff FLT26RLWS and WFLT26RLWS recreational trailers. Due to insufficient clearance between the front tire and slide out actuator, the tire may contact the slide out bracket and become damaged. If the front tire becomes damaged, it may fail and cause a loss control of the vehicle, increasing the risk of a crash. Forest River will notify owners, and dealers will install a lift kit that will provide the proper clearance between the tire and the slide out

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2020**

Published May 8, 2020

bracket. Damaged tires will be replaced. These repairs will be performed free of charge. The recall is expected to begin May 27, 2020. Owners may contact Forest River customer service at 1-574-642-8943. Forest River's number for this recall is 10D-1159.

20V-221

TransitWorks is recalling certain Drivege vehicles based on 2019-2020 Ford Transit vans equipped with Freedman Seating Company (FSC) PT Foldaway and GO-ES 3-point Foldaway seats. The seat belt retractor block out zone may have not been set correctly, potentially resulting in a seat belt that may not properly secure the occupant. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 209, "Seat Belt Assemblies." An unsecured occupant has an increased risk of injury in the event of a crash. TransitWorks will notify owners, and dealers will replace the retractors, free of charge. The manufacturer has not yet provided a notification schedule. Dealers can contact Freedman Seating Company for parts and reimbursement information at 1-800-443-4540.

20V-222

Eldorado National-California, Inc. (Eldorado National-California) is recalling certain 2018-2020 EZ Rider, XHF, and Axess vehicles powered by compressed natural gas (CNG). The thermally activated pressure relief device (PRDs) installed on the CNG fuel system may not vent the system when exposed to heat, potentially resulting in the system rupturing. If the fuel system ruptures from being exposed to heat, there would be an increased risk of injury. Eldorado National-California will work with Agility to notify customers, and replace the PRDs, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Agility customer service at 1-949-267-7745 or Eldorado National-California customer service at 1-909-591-9557.

20V-223

LDJ Manufacturing, Inc. (LDJ) is recalling certain 2018-2019 Thunder Creek Multi-Tank Upfit vehicles. The adhesive that secures the rubber filler in the place between the chassis and the upfit could fail, potentially causing the rubber to come out of place and cause movement of the upfit and load. The movement of the chassis and load could cause bolts securing the tank to the chassis to shear, increasing the risk of a crash. LDJ will notify owners, and dealers will install aluminum brackets around the rubber filler between the chassis and the upfit to secure the rubber filler in place. Additionally, dealers will install nuts with locking washers on the upfitted load in order to further secure the load to the upfit. All services will be performed free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact LDJ customer service at 1-641-620-9412.

20V-224

Altec Industries Inc. (Altec) is recalling certain 2017-2020 ST Spray Trucks. The battery fuse holder may have been improperly mounted, potentially causing an electrical short circuit. An electrical short circuit can increase the risk of a fire. Altec will notify owners, and dealers will install a new battery fuse holder, free of charge. The recall is expected to begin June 16, 2020. Owners may contact Altec customer service at 1-877-462-5832. Altec's number for this recall is CSN 758.

20V-225

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2020**

Published May 8, 2020

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain 2020 GLE 350 and GLE 450 vehicles equipped with an electrically adjustable second-row seat. The wiring harness under the seat may become pinched during seat adjustment, possibly causing damage to the wires. Damaged wires may cause the rear side air bags to not deploy as intended. Additionally, the driver may not be warned if the second row right seat is not locked into place correctly after using the "Easy Entry" function. Either of these scenarios can increase the risk of injury in the event of a crash. MBUSA will notify owners, and dealers will inspect and reroute the wiring harness as necessary, and repair any wire damage, free of charge. The recall is expected to begin June 20, 2020. Owners may contact MBUSA customer service at 1-800-367-6372.

20V-226

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain 2020 AMG GT vehicles. The emergency call system (eCall) communication module may be missing the wiring harness ground line, which may cause the system to relay an inaccurate vehicle location, and restrict the ability to communicate verbally with the call center. An inaccurate vehicle location or the inability to communicate with the call center may delay emergency responders, increasing the risk of injury in the event of an emergency. MBUSA will notify owners, and dealers will repair the wiring harness of the communication module, free of charge. The recall is expected to begin June 20, 2020. Owners may contact MBUSA customer service at 1-800-367-6372.

20V-227

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain 2020 E450 Coupe vehicles. The front left seatbelt may be improperly installed, potentially allowing the seatbelt to contact sharp metal components and damage the seatbelt webbing. A damaged seatbelt may not properly restrain an occupant, increasing the risk of injury in the event of a crash. MBUSA will notify owners, and dealers will inspect and reroute the front left seatbelt as necessary, or replace it if the webbing is damaged, free of charge. The recall is expected to begin June 20, 2020. Owners may contact MBUSA customer service at 1-800-367-6372.

20V-228

Navistar, Inc. (Navistar) is recalling certain 2019 International WorkStar and International HV vehicles equipped with Meritor MX-14-120 EVO steer axles. The axles may have insufficient lubrication, which may result in damage to the wheel end bearings. If the bearings are damaged, the wheel may separate and cause a sudden loss of vehicle control, increasing the risk of crash. Navistar will notify owners, and dealers will inspect the steer axle wheel hubs for proper fluid level and repair any damaged wheel end components and spindles, as necessary, free of charge. The recall began May 1, 2020. Owners may contact Navistar customer service at 1-800-448-7825. Navistar's number for this recall is 20503.

20V-229

Lode-King Industries LTD. (Lode-King) is recalling certain 2015-2021 Prestige SDG53-2 step-deck semi-trailers. The cargo securing winches may not be properly mounted to the trailer. As a result, the cargo winch mount could fail and allow cargo to come loose. If the mount fails, the cargo or load can fall off the trailer and become a road hazard, increasing the risk of a crash. Lode-King will notify owners, and dealers will replace the cargo winches with an updated version, free of charge. Owners may contact Lode-King customer service at 1-204-325-4345.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2020**

Published May 8, 2020

20V-230

McLaren Automotive Incorporated (McLaren) is recalling certain 2016-2020 720S, 2019 Senna, 2020 GT, and 2017-2019 570GT vehicles. The Noise, Vibration, and Harshness (NVH) foam pad underneath the fuel tank may retain moisture and corrode the fuel tank, potentially causing a fuel leak. A fuel leak in the presence of an ignition source increases the risk of a fire. McLaren will notify owners, and dealers will remove the NVH foam pad from the vehicle and inspect the fuel tank. If the fuel tank is found to have corrosion, it will be replaced. Repairs will be performed free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact McLaren's Client Services department at 855-202-8815, Monday to Friday between 9am and 6pm EST or customerservice.na@mclaren.com.

20V-231

Ducati North America (Ducati) is recalling certain 2017 Superleggera motorcycles. The front brake pads may corrode, potentially causing the front brake pads friction material to detach from the backing plate. If the front brake pads friction material detaches from the backing plate occurs, the motorcycle may experience increased stopping distance, increasing the risk of a crash. Ducati will notify owners, and dealers will replace the front brake pads, free of charge. The recall is expected to begin June 20, 2020. Owners may contact Ducati customer service at 1-888-391-5446. Ducati's number for this recall is SRV-RCL-20-001.

20V-232

Motor Coach Industries (MCI) is recalling certain model year 2014-2019 J4500 and 2018-2019 J3500 motor coaches. The brake hoses may crack or otherwise fail resulting in an air leak. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 121, "Air Brake Systems." A leaking brake hose could cause a delay in the actuation time of the front brake, which would increase vehicle's stopping distance and increase the risk of a crash. MCI will notify owners to inspect the brake hoses and replace any hoses that are leaking or otherwise damaged. MCI will reimburse owners for the cost of the inspection, and will provide replacement parts as necessary, free of charge. The recall is expected to begin May 2020. Owners may contact MCI customer service at 1-800-241-2947. MCI's number for this recall is SB 481.

20V-233

Blue Bird Body Company (Blue Bird) is recalling certain 2006-2021 Vision and 2007-2013 All American school buses. The floor-mounted parking brake may fail to hold the vehicle stationary on an incline when the vehicle is loaded to its maximum weight, due to an insufficient application force. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 105, "Hydraulic and Electric Brake Systems." A parking brake system that is set to an insufficient application force may result in an increased possibility of unintended vehicle movement, which increases the risk of a crash. Blue Bird will notify owners, and dealers will inspect the floor mounted park brake application force hand lever assembly and correct the application force, as necessary, free of charge. The recall is expected to begin June 24, 2020. Owners may contact Blue Bird customer service at 478-822-2242. Blue Bird's number for this recall is R20AO-SB.

20V-234

SAFETY DEFECT/NONCOMPLIANCE NOTICES

RECEIVED DURING APRIL 2020

Published May 8, 2020

Blue Bird Body Company (Blue Bird) is recalling certain 2009-2019 Vision transit buses. The floor-mounted parking brake may fail to hold the vehicle stationary on an incline when the vehicle is loaded to its maximum weight, due to an insufficient application force. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 105 "Hydraulic and Electric Brake Systems." A parking brake system that is set to an insufficient application force may result in an increased possibility of unintended vehicle movement, which increases the risk of injury to bystanders. Blue Bird will notify owners, and dealers will inspect the floor mounted park brake application force hand lever assembly and adjust the application force, as necessary, free of charge. The recall is expected to begin June 24, 2020. Owners may contact Blue Bird customer service at 478-822-2242. Blue Bird's number for this recall is R20AO-SB.

20V-235

Triumph Motorcycles America, LTD (Triumph) is recalling certain 2018-2020 Street Triple RS, Tiger 1200 XCx and Tiger 1200 XCA, 2019-2020 Speed Triple S and Speed Triple RS, 2018-2019 Tiger 1200 XRT, Tiger 1200 XR, Tiger 1200 XRx and Tiger 1200 XRx LRH and 2020 Tiger 1200 Alpine Edition and Tiger 1200 Desert Edition motorcycles. The front brake pads may corrode, potentially causing the front brake pad friction material to detach from the backing plate. If the brake pad friction material detaches from the backing plate, it may lengthen the distance needed to stop the motorcycle, increasing the risk of a crash. Triumph will notify owners, and dealers will replace the front brake pads, free of charge. The recall is expected to begin June 24, 2020. Owners may contact Triumph customer service at 1-678-854-2010. Triumph's number for this recall is SRAN 579.

20V-236

Forest River, Inc. (Forest River) is recalling certain 2020 StarTrans P/S2 ST93036 transit buses equipped with Freedman GO-ES foldaway seats. The seat belt retractor block out zone may have not been set correctly, potentially resulting in a seat belt that may not properly secure the occupant. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 209, "Seat Belt Assemblies." An unsecured occupant has an increased risk of injury in the event of a crash. Forest River will notify the vehicle owners, and dealers will inspect and replace the retractors, free of charge. The recall is expected to begin June 7, 2020. Owners may contact Forest River customer service at 1-800-348-7440 or Freedman Seating customer service at 1-800-443-4540. Forest River's number for this recall is 05-1158.

20V-237

Jayco, Inc. (Jayco) is recalling certain 2020 Jay Flight SLX Travel Trailers manufactured in the Idaho facility. The propane supply hose connection to the refrigerator may be improperly tightened, possibly resulting in a propane leak. A propane leak can increase the risk of an explosion or fire. Jayco will notify owners, and dealers will conduct a leak test at the refrigerator connections, repairing them as necessary, free of charge. The recall is expected to begin May 29, 2020. Owners may contact Jayco customer service at 1-800-283-8267. Jayco's number for this recall is 9901509.

20V-238

Gillig LLC (Gillig) is recalling certain 2018-2020 Low Floor transit buses powered by compressed natural gas (CNG). The thermally activated pressure relief device (PRD) installed on the CNG fuel system may not vent the

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2020**

Published May 8, 2020

system when exposed to heat, potentially resulting in the system rupturing. If the fuel system ruptures from exposure to heat, there may be an increased risk of injury. Gillig will work with Agility to notify customers and replace the PRDs, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Agility customer service at 1-949-267-7745 or Gillig customer service at 1-800-735-1500.

20V-239

Terex South Dakota, Inc. (Terex) is recalling certain 2019-2020 TL80 and TL80/112 aerial devices. The installed slope indicator and decals incorrectly state that the chassis can be 5 degrees out of level for aerial device use. If the aerial device is used with the chassis out of level it may result in an unstable condition which may cause the unit to tip, increasing the risk of injury to the operator and any bystanders. Terex will notify owners, and dealers will replace the incorrect slope indicator and decals, free of charge. The recall is expected to begin on May 2020. Owners may contact Terex customer service at 1-605-882-4000. Terex's number for this recall is SN685.

20V-240

Volvo Trucks North America (Volvo Trucks) is recalling certain 2020-2021 VNL and VNR trucks. The steering gear fasteners may have not been properly tightened. The loose fasteners may result in a loss of vehicle control, increasing the risk of a crash. Volvo Trucks will notify owners, and dealers will tighten the steering gear fasteners to specification, free of charge. The recall is expected to begin May 29, 2020. Owners may contact Volvo Trucks customer service at 800-528-6586. Volvo Trucks' number for this recall is RVXX2001.

20V-241

Motor Coach Industries (MCI) is recalling certain 2015-2016 D4000, 2015-2020 D4500 and D4505, 2016-2020 J4500, 2018 J3500, and 2017 D4005 buses. The seat belts may not extend from the retracted position, rendering the seat belt unusable. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standards (FMVSS) number 208, "Occupant Crash Protection," and number 209, "Seat Belt Assemblies." Inability to use the seat belt may increase the risk of injury in the event of a crash. MCI will notify the affected owners, and dealers will inspect and replace the seat belts, as necessary, free of charge. The recall is expected to begin May 29, 2020. Owners may contact MCI customer service at 1-800-241-2947. MCI's number for this recall is SB 482.

20V-242

BMW of North America, LLC (BMW) is recalling certain 2017 530i, 530i xDrive, 540i and 540i xDrive and 2017-2018 530e xDrive vehicles. Prior exposure to excessive levels of humidity within the driver and passenger head air bag inflators may affect the proper deployment of the head air bags. In the event of a crash of sufficient severity, deployment of the head air bag may be impaired and/or the igniter could separate from the inflator, increasing the risk of injury. BMW will notify owners, and dealers will replace the left or right head air bag, free of charge. The recall is expected to begin June 22, 2020. Owners may contact BMW customer service at 1-800-525-7417.

20V-243

Hino Motors Sales U.S.A., Inc. (Hino) is recalling certain 2020-2021 NV8J, NJ8J, NE8J, NJ8A, NV8A,

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2020**

Published May 8, 2020

NE8A, NE8G, NJ8C, NE8C, and NV8G trucks. The ground cable that connects the negative battery terminal to the frame may be too short and may break as a result. If the ground cable breaks, the engine cannot be re-started to move the vehicle to a safe area, increasing the risk of a crash. Hino will notify owners, and dealers will install an extension bracket to the negative battery terminal and inspect the ground cable terminal for damage, replacing the cable if damage is found, free of charge. Owners will be notified of the safety risk with an interim letter Mid-June 2020. A second letter will be sent once the remedy is available. Owners may contact Hino customer service at 1-248-699-9390. Hino's number for this recall is AAHT0.

20V-244