

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2017**

Published June 27, 2017

CHILD SEATS:

Graco Children's Products Inc. (Graco) is recalling certain Graco My Ride 65 convertible child restraints, models 1871689, 1908152, 1813074, 1872691, 1853478, 1877535, 1813015, and 1794334. In the event of a crash, the child seat webbing may not adequately restrain the child. As such, these car seats fail to conform to Federal Motor Vehicle Safety Standard (FMVSS) number 213, "Child Restraint Systems." A child that is not adequately restrained in a crash has an increased risk of an injury. Graco will notify owners, and dealers will provide consumers with a replacement harness, free of charge. The recall is expected to begin July 17, 2017. Owners may contact Graco customer service at 1-800-345-4109.

17C-001

EQUIPMENT:

Akron Brass Company (ABC) is recalling certain Ultrajet firefighting nozzles, style 1820. Components within the nozzles may bind, limiting the water output. Reduced water flow may hinder the firefighting efforts, increasing the risk of injury. ABC will notify owners and will rebuild the affected nozzles to prevent them from binding, free of charge. The recall began on May 23, 2017. Owners may contact Akron Brass Company customer service at 1-800-228-1161 or by email at akrontech@idexcorp.com.

17E-022

TRW Automotive Inc (TRW) is recalling certain aftermarket replacement Left Hand and Right Hand Lower Ball Joints, sold for use on Toyota 4Runner, Sequoia and Tundra vehicles. These ball joints were built incorrectly with a vented dust shield on the ball joint stud, possibly causing wear and looseness. The ball stud wear may result in the ball stud separating from the steering knuckle, causing a loss of steering, and increasing the risk of a crash. TRW will notify owners and will replace the affected ball joints, free of charge. The recall began on June 19, 2017. Owners may contact TRW customer service at 1-734-855-2600.

17E-023

Norgren Inc. (Norgren) is recalling one Kneeling Module, part number K990073. The air valve pistons have retaining snap rings in the manifold that may be improperly seated. An unexpected loss of suspension air bag pressure while driving would result in an abrupt reduction in suspension height, potentially increasing the risk of a crash. A loss of suspension air bag pressure could also occur during vehicle servicing, increasing the risk of injury to maintenance personnel. Norgren has notified the purchaser and provided them with a snap ring reset tool, free of charge. Owners may contact Norgren customer service at 1-303-794-2611.

17E-024

Sprague Devices (Sprague) is recalling certain Heavy-Duty Bus Pantograph Wiper Arms. The mounting casting that attaches the wiper arms to the wiper motor may crack, possibly causing the arms to bend or detach. A loss of wiper function can reduce the driver's visibility, increasing the risk of a crash. Sprague will notify the purchasers, and the affected vehicle manufacturers will replace the wiper arms with an improved design, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Sprague at 1-219-872-7295. Sprague's number for the recall is 17V-156, SR17-09 .

17E-025

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2017**

Published June 27, 2017

Hickory Springs Manufacturing Company (HSM) is recalling certain Summit-brand driver and front passenger seat accessory seat covers sold for use in RAM ProMaster, Ford Transit and Mercedes Sprinter vehicles. The outside edge seam of the seat cover may not open up as designed, possibly affecting the deployment of the seat-mounted air bags in the event of a crash. In the event of a crash, if the seat-mounted air bags cannot deploy as intended, the occupants have an increased risk of injury. The manufacturer has not yet provided a remedy for this recall nor a notification schedule. Owners may contact HSM customer service at 1-800-438-5341.

17E-026

Daytona Helmets International (Daytona) is recalling certain Skull Cap D1, D3 and D6 Helmets in sizes 3XS through 4XL manufactured during May 2015. These helmets may not adequately protect the wearer in the event of a head impact during a motorcycle crash. As such, these helmets fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 218, "Motorcycle Helmets." In the event of a crash, the helmet may not adequately protect the wearer, increasing their risk of injury. Daytona will notify owners, and dealers will replace the helmets, free of charge. The recall began on June 14, 2017. Owners may contact Daytona customer service at 1-800-452-5745.

17E-027

TIRES:

American Kenda Rubber Industrial (Kenda) is recalling certain Kenda Kenetica tires, size P235/75R15 105S KR17. The tires may have a void between the top steel belt and the tire undertread located at the overlapped steel belt splice. The void can grow under normal use, possibly resulting in a tread separation or a sudden loss of air in the tire, increasing the risk of a vehicle crash. Kenda will notify owners, and dealers will inspect and replace the affected tires with tires that do not contain a void, free of charge. The recall began on June 8, 2017. Owners may contact Kenda customer service at 1-866-536-3287. Kenda's number for this recall is K3D5ANA5116-5216.

17T-010

Sumitomo Rubber USA, LLC (Sumitomo) is recalling certain models of Dunlop Sportmax Q3+ motorcycle tires, size 120/70ZR17 58W. The affected tires may have porosity (air pockets) in the shoulder region of the tire. As such, these tires fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 119, "New Pneumatic Tires-Other Than Passenger Cars." The tire defect may affect the handling and/or steering characteristics of the motorcycle. Continued use can result in tread chunking. These conditions may increase the risk of a crash. Dunlop will notify the retailers and customers and will offer replacement tires, free of charge. The recall began on June 2, 2017. Owners may contact Dunlop Motorcycle Tires at 1-800-845-8378.

17T-011

VEHICLES:

Highland Ridge RV (Highland Ridge) is recalling certain 2017 Open Range, Highlander, Light and Roamer and Mesa Ridge fifth wheels and Mesa Ridge, Light, Roamer and Ultra Lite travel trailers. The LED ceiling lights

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2017**

Published June 27, 2017

may produce excessive heat. The excessive heat from the LED ceiling lights may increase the risk of a fire. Highland Ridge will notify owners, and dealers will replace the affected LED ceiling lights with a different light, free of charge. The recall began on May 23, 2017. Owners may contact Highland Ridge customer service at 1-260-768-7771. Highland Ridge's number for this recall is 9904350.

17V-288

Porsche Cars North America, Inc. (Porsche) is recalling certain 2015-2017 Macan S and Macan Turbo vehicles, and 2017 Macan, Macan Turbo with the Performance Package, and Macan GTS vehicles. The fuel pump flange on the affected vehicles may crack, allowing fuel to leak. A fuel leak in the presence of an ignition source increases the risk of a fire. Porsche will notify owners, and dealers will inspect the flanges, replacing any that are cracked. Flanges that aren't cracked will have a protective film applied. These repairs will be performed free of charge. The recall is expected to begin in July 2017. Owners may contact Porsche customer service at 1-800-767-7243. Porsche's number for this recall is AH06.

17V-289

Jayco Inc. (Jayco) is recalling certain 2017 Jay Flight Bungalow, Hummingbird, White Hawk, Jay Flight SLX, Jay Feather 7, Jay Feather and Jay Flight fifth wheel recreational trailers. The LED ceiling lights may produce excessive heat. The excessive heat from the LED ceiling lights may increase the risk of a fire. Jayco will notify owners, and dealers will replace the affected LED ceiling lights with a different light, free of charge. The recall began on May 24, 2017. Owners may contact Jayco customer service at 1-800-283-8267. Jayco's number for the recall is 9901349.

17V-290

Gulf States Toyota, Inc (Gulf States) is recalling certain 2016-2017 4Runner vehicles equipped with the TFORCE accessory package. The fasteners for the aftermarket roof rack may have been improperly tightened. If the roof rack fasteners loosen, the roof rack may detach from the vehicle, increasing the risk of a crash. Gulf States will notify owners, and dealers will inspect and, as necessary, tighten the roof rack fasteners, free of charge. The recall began June 15, 2017. Owners may contact Gulf States customer service at 1-800-444-1074. Gulf States' number for this recall is 17R1.

17V-291

Forest River, Inc. (Forest River) is recalling certain 2014 XLR Hyperlite toyhaulers. These vehicles have an axle equalizer knurled bolt (axle shackle locating bolt) that may not be properly seated in the chassis axle hanger. If the equalizer knurled bolt is not installed properly, the bolt may not properly secure the axle, allowing it to shift and result in a loss of vehicle control, increasing the risk of a crash. Forest River will notify owners, and dealers will replace any equalizer knurled bolts and nuts that were improperly installed, free of charge. The recall began on June 7, 2017. Owners may contact Forest River customer service at 1-574-642-0431. Forest River's number for this recall is 45-03202017-0355.

17V-292

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2015-2017 Audi A7 vehicles. The affected vehicles have head curtain air bags that may not deploy properly in the event of a crash. As such, these

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2017**

Published June 27, 2017

vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 226, "Ejection Mitigation." If the head curtain airbag does not deploy properly in the event of a crash, an unbelted passenger has an increased risk of injury. Audi will notify owners, and dealers will replace the affected head curtain air bags, free of charge. The recall is expected to begin June 29, 2017. Owners may contact Audi customer service at 1-800-253-2834. Volkswagen's number for the recall is 69R2.

17V-293

Spartan Motors USA (Spartan) is recalling certain 2008-2017 Gladiator and MetroStar emergency response vehicles equipped with a supplemental park brake system (SPBS). The directions to activate the SPBS incorrectly state to "Pull" the actuation knob, when it should say "Push." If the operator follows the incorrect directions and believes that the supplemental front park brake is applied when it is not, the vehicle may unexpectedly roll, increasing the risk of a crash. Spartan will notify owners and supply a new actuator control knob with the correct directions, free of charge. The recall began on May 22, 2017. Owners may contact Spartan customer service at 1-517-543-6400. Spartan's number for this recall is 17009.

17V-294

Gulf States Toyota, Inc. (Gulf States) is recalling certain 2017 4Runner, 86, Avalon, Camry, Camry Hybrid, Corolla, Corolla iM, Highlander, Highlander Hybrid, Prius, Prius C, RAV4, RAV4 Hybrid, Sienna and Yaris vehicles. The spare tire air pressure was not adjusted to the proper pressure as stated on the Tire Pressure Label. A spare tire that is not inflated to the proper value may not perform as intended, increasing the risk of a crash. Gulf States will notify owners, and dealers will inspect the spare tires, adjusting their pressure as necessary, free of charge. The recall began June 15, 2017. Owners may contact Gulf States customer service at 1-800-444-1074. Toyota's number for this recall is 17R2.

17V-295

Prevost Cars, Inc. (Prevost) is recalling certain 2016-2017 H3-45 motor coaches. The affected vehicles have wiper arms that can crack where they mount to the wiper motor causing the wiper arms to bend or detach from the vehicle. A loss of wiper function can reduce the driver's visibility, increasing the risk of a crash. Prevost will notify owners, and dealers will inspect the vehicles and replace the windshield wiper mounts, as necessary, free of charge. The recall began on May 22, 2017. Owners may contact Prevost customer service at 1-866-870-2046. Prevost's number for this recall is SR17-09.

17V-296

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2017 Audi Q5 vehicles. Due to a manufacturing defect within the gearbox, despite selecting the Park position, the vehicle may still unexpectedly roll. Despite selecting 'Park', if the parking brake is not applied, the vehicle may rollaway, increasing the risk of a crash. Audi will notify owners, and dealers will replace the gearbox in the affected vehicles, free of charge. The recall began May 15, 2017. Owners may contact Audi customer service at 1-800-253-2834. Volkswagen's number for this recall is 37K6.

17V-297

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain model year 2013-2017 Audi Q5 and

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2017**

Published June 27, 2017

2013-2017 Audi Q7 vehicles. These gasoline-powered vehicles have a fuel pump flange that may crack, allowing fuel to leak. A fuel leak in the presence of an ignition source increases the risk of a fire. Audi will notify owners, and dealers will replace the fuel pump flange if cracks are present. Flanges that do not have cracks will have a protective film applied. These repairs will be performed free of charge. The recall is expected to begin July 2, 2017. Owners may contact Audi customer service at 1-800-253-2834. Volkswagen's number for this recall is 20Z8. Note: This recall is an expansion of recall 16V-660.

17V-298

Prevost Cars, Inc. (Prevost) is recalling certain 2014-2017 H3-45, H3-45 VIP, X3-45, X3-45 VIP, and X3-45 VIP Entertainer motor coaches equipped with 10,000lb-capacity trailer hitch receivers. The trailer hitch mounting fasteners may loosen. If the fasteners loosen, the trailer hitch may deform or detach from the vehicle, increasing the risk of a crash. Prevost will notify owners, and dealers will replace the trailer hitch mounting hardware, free of charge. The recall is expected to begin on July 1, 2017. Owners may contact Prevost customer service at 1-866-870-2046. Prevost's number for this recall is SR17-11.

17V-299

Prevost Cars, Inc. (Prevost) is recalling certain 2016-2017 Prevost X3-45 vehicles. The vehicles were manufactured without the front amber reflex reflectors. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." The missing reflex reflectors may reduce the side visibility of the vehicle in certain conditions, increasing the risk of a crash. Prevost will notify owners, and dealers will install the missing front amber reflex reflectors, free of charge. The recall is expected to begin on July 1, 2017. Owners may contact Prevost customer service at 1-866-870-2046. Prevost's number for this recall is SR17-15.

17V-300

Chrysler (FCA US LLC) is recalling certain 2017 Jeep Compass vehicles equipped with a 6-speed transmission. The left front halfshaft may not be properly seated, and, as a result, it may disengage from the transmission and/or break. If the left front halfshaft disengages or breaks, the vehicle will have a loss of drive. Additionally, if the vehicle is parked without using the parking brake, the vehicle may roll, despite being in 'Park.' Either condition may increase the risk of a crash. Chrysler will notify owners, dealers will inspect the left front halfshaft for engagement and replace any that are not properly engaged in the transmission, free of charge. The recall began on June 12, 2017. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is T26.

17V-301

Chrysler (FCA US LLC) is recalling certain model year 2013-2016 Ram 1500, Ram 2500, and 2014-2016 Ram 3500 vehicles. Certain driving conditions, such as driving off-road or debris striking the vehicle may cause the roll rate sensor to trigger a fault within the Occupant Restraint Controller (ORC). If this fault occurs, the rollover side curtain air bag and the seat belt pretensioner will be disabled from deploying. If the rollover side curtain air bags and seat belt pretensioners are disabled, there is an increased risk of injury to the vehicle occupants in the event of a crash that necessitates activation of these safety systems. Chrysler will notify owners, and dealers will update the ORC software, free of charge. The recall is expected to begin during June 2017.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2017**

Published June 27, 2017

Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is T25.

17V-302

KZRV, L.P. (KZRV) is recalling certain 2018 Sport Trek and Durango travel trailers equipped with the outside kitchen option. The affected travel trailers may not have had the proper sealing tape installed on the propane gas line. Additionally, the gas line may not have been tested during production. Due to either being untested, or improperly sealed, the propane line may leak, increasing the risk of a fire or explosion. KZRV will notify owners, and dealers will seal the propane line and test the system for leaks, free of charge. The recall is expected to begin on June 30, 2017. Owners may contact KZRV customer service at 1-800-768-4016 extension 153 or 154.

17V-303

Jim Reed's Truck Sales, Inc. (JRTS) is recalling certain 2014-2016 Hino 338 trucks modified by JRTS. The affected trucks have Certification labels that do not identify JRTS as the final stage manufacturer. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." Incorrect final stage manufacturer information on the certification label may hinder owner awareness of safety recalls, increasing the risk of a fire or a crash. JRTS will notify owners and send them a new certification label with the correct final stage manufacturer information, free of charge. The recall began on June 13, 2017. Owners may contact Jim Reed's Truck Sales' customer service at 1-914-737-3990.

17V-304

Honda (American Honda Motor Co.) is recalling certain 2015-2016 Honda CR-V vehicles that recently received a replacement engine. The replacement engine may have been built with the wrong pistons, potentially affecting the engine's performance. The reduced performance may result in an engine stall, increasing the risk of a crash. Honda will notify owners, and dealers will inspect the engines and replace the incorrect components, as necessary, free of charge. The recall began June 20, 2017. Owners may contact Honda customer service at 1-888-234-2138. Honda's number for this recall is KF6.

17V-305

Forest River, Inc. (Forest River) is recalling certain 2017 XLR ToyHauler trailers, model XLT26HFS. The Federal Placard incorrectly states that the rear tire pressure should be 50psi, when the tires should actually be inflated to 80psi. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims." The incorrect information may cause the operator to underinflate the tire, potentially causing tire failure, increasing the risk of a crash. Forest River will notify owners, and dealers will install a corrected Federal Placard, free of charge. The recall began on May 31, 2017. Owners may contact Forest River customer service at 1-574-642-0432. Forest River's number for this recall is 45-05032017-0398.

17V-306

General Motors LLC (GM) is recalling certain 2016-2017 Chevrolet Spark vehicles. In the event of a crash, if a young child is seated improperly and not wearing a seat belt while in the front passenger seat, deployment of the front passenger air bag may injure the occupant's neck. As such, these vehicles fail to comply with the

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2017**

Published June 27, 2017

requirements of Federal Motor Safety Standard (FMVSS) number 208, "Occupant Crash Protection." In the event of a crash with a frontal air bag deployment, an unbelted child in the front passenger seat has an increased risk of injury. GM will notify owners, and dealers will replace the passenger air bag module, free of charge. The recall is expected to begin July 5, 2017. Owners may contact GM customer service at 1-800-222-1020. GM's number for this recall is 17199.

17V-307

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2015 SLK 250, 2016 SLK 350, 2016-2017 SLC 300, and 2017 SLC 43 AMG vehicles. In these vehicles, the electronic stability control (ESC) system software may incorrectly keep the brakes slightly applied. If brake pads are constantly applied over long periods of driving, the brake components may heat up, affecting braking performance and increasing the risk of a crash. Additionally, the dragging brakes may overheat, increasing the risk of a fire. MBUSA will notify owners, and dealers will update the software for the ESC system, free of charge. The recall began June 9, 2017. Owners may contact MBUSA customer service at 1-800-367-6372.

17V-308

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2012-2014 Passat vehicles, equipped with diesel engines and Direct-Shift Transmissions (DSG). The vehicle's underbody heat shield may not be long enough to protect the right half-shaft grease boot from heat, potentially resulting in a grease leak. If the leaking grease contacts a heated surface, such as the exhaust system and/or the diesel particulate filter (DPF), it could increase the risk of fire. Volkswagen will notify owners, and dealers will replace the driveshaft heat shield, free of charge. The recall is expected to begin in July 2017. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's number for this recall is 23W5.

17V-309

Temsa Global Sanayi Ve Ticaret A.S. (Temsa) is recalling certain model year 2014-2017 TEMSA TS 45 motorcoaches. Improper fasteners were used to attach the leveling valve linkage mechanism. As a result, the components may loosen and detach. The loose parts may damage the tires, increasing the risk of a crash. Temsa will notify owners, and dealers will install new brackets and fasteners, free of charge. The recall began on June 2, 2017. Owners may contact CH Bus Sales at 1-407-271-8935.

17V-310

Southeast Toyota Distributors, LLC (SET) is recalling certain model year 2013-2017 Toyota Tundra and Sequoia vehicles accessorized with Southeast Toyota accessory 20-inch Rockstar wheels installed by Southeast Toyota or a Southeast Toyota dealer. The Rockstar wheels were installed with lugnuts that may crack and detach. Lugnuts that crack and detach may cause the wheels to separate from the vehicle, increasing the risk of a crash. SET will notify owners, and dealers will install new replacement lugnuts, free of charge. The recall is expected to begin June 23, 2017. Owners may contact SET customer service at 1-866-405-4226. SET's number for this recall is SET17A.

17V-311

Daimler Trucks North America LLC (DTNA) is recalling certain 2016-2018 Thomas Built Buses Minotour

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2017**

Published June 27, 2017

DRW school buses. The occupant seats may have been installed without reinforcement brackets being used underneath the seat rail as intended. Without reinforcement brackets, in the event of a crash, the seats may come loose, increasing the risk of injury. DTNA will notify owners, and dealers will inspect the seats and install reinforcement brackets as necessary, free of charge. An interim notice will be mailed to owners during June or early July 2017. Owners may contact DTNA Customer Service 1-800-547-0712. DTNA's number for the recall is FL-735.

17V-312

Daimler Trucks North America LLC (DTNA) is recalling certain 2014-2018 Thomas Built Buses Saf-T-Liner EFX and Saf-T-Liner HDX school buses. The occupant seats may have been installed without under-rail washers, reducing their anchorage strength. Without under-rail washers, in the event of a crash, the seats may come loose, increasing the risk of injury. DTNA will notify owners, and dealers will inspect the seats and replace the mounting hardware, as necessary, free of charge. The recall is expected to begin on July 9, 2017. Owners may contact DTNA Customer Service 1-800-547-0712. DTNA's number for the recall is FL-737.

17V-313

Daimler Trucks North America LLC (DTNA) is recalling certain 2013-2018 Thomas Built Saf-T-Liner HDX transit buses. The occupant seat lap belts may have been anchored to the seat instead of the bus structure. A seat lap belt anchored to the seat instead of the bus structure may not properly restrain the seat occupant in the event of a crash, increasing the risk of injury. DTNA will notify owners, and dealers will inspect the seats and modify the seat belt anchorage if necessary, free of charge. The recall is expected to begin on July 9, 2017. Owners may contact DTNA Customer Service 1-800-547-0712. DTNA's number for the recall is FL-736.

17V-314

Daimler Trucks North America LLC (DTNA) is recalling certain 2017 Freightliner Cascadia and Western Star 5700 trucks built with NFD tandem rear axles. During the hardening process, the axle assembly output shaft may have been made brittle, possibly resulting in the output shaft fracturing while the vehicle is in use. If output shaft fractures while descending a grade, the compression braking will be ineffective. Additionally, large debris may land in the road. Both scenarios increase the risk of a crash. DTNA will notify the owners, and Detroit Axle dealers will replace the output shaft, free of charge. The recall is expected to begin on July 9, 2017. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-738.

17V-315

Keystone RV Company (Keystone) is recalling certain 2017-2018 Raptor fifth-wheel recreational trailers, model 428SP. The affected trailers have tires that may contact the outriggers. Tire contact with the outriggers may result in tire damage, possibly causing a loss of control, increasing the risk of a crash. Keystone has notified owners, and dealers will cut a notch in the bottom side of the outriggers located above the tires on the door side of the unit, free of charge. The recall began on May 18, 2017. Owners may contact Keystone Customer Service at 1-866-425-4369. Keystone's number for this recall is 17-287.

17V-316

Daimler Trucks North America LLC (DTNA) is recalling certain 2013-2018 Thomas Built Saf-T-Liner HDX

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2017**

Published June 27, 2017

school buses. The occupant seat lap belts may have been anchored to the seat instead of the bus structure. A seat lap belt anchored to the seat instead of the bus structure may not properly restrain the seat occupant in the event of a crash, increasing the risk of injury. DTNA will notify owners, and dealers will inspect the seats and modify the anchorage if necessary, free of charge. The recall is expected to begin on July 9, 2017. Owners may contact DTNA Customer Service 1-800-547-0712. DTNA's number for the recall is FL-736.

17V-317

Bombardier Recreational Products Inc. (BRP) is recalling certain 2017 Can Am Spyder RT motorcycles. Due to a manufacturing error within the headlight assembly, the headlight may shine too high when on the low beam setting. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and associated Equipment." If the headlight beam is too high, oncoming traffic may be blinded by the glare, increasing the risk of a crash. BRP will notify owners, and dealers will replace the defective headlights, free of charge. The recall began June 8, 2017. Owners may contact BRP customer service at 1-888-272-9222.

17V-318

Forest River, Inc. (Forest River) is recalling certain 2018 Palomino recreational trailers, model PAT251RBSS. The Federal Placard does not list the correct tire size, tire pressure, and rim size information of ST205/75R14C tires requiring 50 PSI and a rim size of 14X5.5JJ. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims." The incorrect information may cause the operator to install an incorrect replacement rim or tire or overinflate the tire, all scenarios that may increase the risk of a crash. Forest River will notify owners and will provide a corrected Federal placard, free of charge. The recall began on May 31, 2017. Owners may contact Forest River customer service at 1-269-432-3271. Forest River's number for this recall is 400-05102017-0407.

17V-319

Terex South Dakota (TSD) is recalling certain 2007-2016 vehicles equipped with Terex C4000, FC, HR, HRX, SCM, TC, TCX, TL, TPL, and XT aerial devices and digger derricks used for utility line work. In the event of a short circuit of a tool plugged into the onboard electrical socket, the circuit breaker may not trip before the user receives a shock. Without protection against electrical shock, the user has a greater risk of injury. TSD will notify owners, and dealers will replace the breakers with GFCI breakers that will trip at a lower current, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact TSD Customer Service Department at 1-800-982-8975. TSD's number for this recall is SN658.

17V-320

Terex South Dakota (TSD) is recalling certain 2012-2017 Digger Derricks and Aerial Devices, models C4000, C5000, C6000, C7000, General, HR, OM, RM, RMX, SC, SCM, TC, TCX, TL, TM, and XT, built on Freightliner chassis with SmartPlex engine controls. The vehicles have a switch to monitor whether the hood is open or not. If the switch thinks that the hood is open, the vehicle software may disable the Aerial or Digger Derrick remote engine control functions. If the hood switch prevents the remote engine controls from shutting the vehicle engine down in the event of a hydraulic issue on the Aerial or Digger Derrick, it may increase the risk of an injury. TSD will notify owners, and dealers will reprogram the vehicles to only disable the engine start function

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2017**

Published June 27, 2017

if the switch indicates that the hood is open, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact TSD Customer Service Department at 1-800-982-8975. TSD's number for this recall is SN659.

17V-321

PACCAR Incorporated (PACCAR) is recalling certain 2012-2018 Kenworth T800 and T880 vehicles equipped with Neway ADZ tridem rear suspensions. The brake control airline may be the incorrect size, resulting in an imbalance in the service brake application timing. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 121, "Air brake systems." An incorrectly sized airline may lengthen the distance needed to stop the vehicle, increasing the risk of a crash. Kenworth will notify owners, and dealers will modify the air brake system with updated brake piping, free of charge. The recall is expected to begin July 10, 2017. Owners may contact Kenworth customer service at 1-425-828-5000. PACCAR's number for this recall is 17KWB.

17V-322

Nova Bus (Nova) is recalling certain 2016 Nova LFS Artic transit buses. In the event of a loss of communication within the bus' multiplex network, the computer may command full throttle application, without input from the driver. Unintentional, full throttle application may increase the risk of a crash. Nova has notified owners, and dealers have reprogrammed the buses, free of charge. The recall began on April 28, 2017. Owners may contact Nova customer service at 1-450-472-6410. Nova's recall number for this campaign is CR4041.

17V-323

Isuzu Technical Center of America, Inc. (Isuzu) is recalling certain model year 2008-2009 and 2012-2013 Isuzu NPR and NPR HD vehicles and 2008-2009 GMC W3500 and GMC W4500 vehicles. The affected vehicles, equipped with a gasoline-powered engine, have a throttle pedal that may get stuck under the steel stopper bolt, causing the pedal to remain in the full throttle position. A stuck open accelerator pedal may result in very high vehicle speeds and make it difficult to stop the vehicle, which could cause a crash, serious injury or death. Isuzu will notify owners, and dealers will remove and replace the stopper bolt with a flanged plate, to prevent lateral movement of the throttle, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Isuzu customer service at 1-866-441-9638.

17V-324

Bison Coach, LLC (Bison) is recalling certain model year 2016-2018 Bison Horse Trailers, models Laredo, Premiere, Ranger, Silverado, Trail Boss and Trail Hand. These trailers contain incorrect Gross Axle Weight Rating (GAWR) information on the Certification label. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." If a trailer does not have the correct label, the users may overload the trailer, increasing the risk of a crash. Bison will notify owners and provide them with a corrected label, free of charge. The recall began on June 12, 2017. Owners may contact Bison customer service at 1-574-658-4161. Bison's number for this recall is 9011.

17V-325

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2017**

Published June 27, 2017

Ferrara Fire Apparatus, Inc. (Ferrara) is recalling certain 2000-2016 Fire Apparatus 100' Rear Mount Platform emergency vehicles. The affected vehicles are equipped with a movable ladder access guardrail that may bend or break under heavy loads. A guardrail that bends or breaks under load can increase the risk of injury. Ferrara will notify owners, and service personnel or service centers will install a brace for the mansaver guardrail bar to support the required loads, free of charge. The recall is expected to begin in June 2017. Owners may contact Ferrara customer service at 1-800-443-9006.

17V-326

BMW North America, LLC (BMW) is recalling certain 2017 BMW X5 M and BMW X6 M vehicles. The vehicles are equipped with 21-inch tires, however the Tire Information Label states that the vehicles are equipped with 20-inch tires. As such, these vehicles fail to conform to Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims." The incorrect tire size on the label does not comply with FMVSS number 110. BMW has notified the affected owners and is providing them with a corrected tire information placard, free of charge. The recall began June 15, 2017. Owners may contact BMW customer service at 1-800-525-7417.

17V-327

BMW of North America, LLC (BMW) is recalling certain 2005-2008 745i, 745Li, 750i, 750Li, 760i, 760Li, and B7 Alpina vehicles equipped with both the Comfort Access and Soft Close Automatic options. In these vehicles, the doors may appear to be closed and latched, but, in fact, may inadvertently open. The door may unexpectedly open due to road or driving conditions or occupant contact with the door. The sudden opening may result in occupant ejection or increase the risk of injury in the event of a crash. The manufacturer has not yet provided a remedy for this recall. Owners may contact BMW at 1-800-525-7417 or email BMW at CustomerRelations@bmwusa.com.

17V-328

Setra of North America (Setra) is recalling certain 2017 Setra S407CC motor coaches. The vehicle's exterior covers which are bonded to powder coated frames may detach from the vehicle because the powder coating may peel off of the frame. Any panels that detach can become a road hazard, increasing the risk of a crash. The affected vehicles have not been sold to customers and are still in inventory. They will be repaired by the US importer, prior to being put into service. Therefore, an owner notification letter will not be issued. Owners may contact Setra customer service at 1-800-241-2947. Setra's number for this recall is 98.10M10519A.

17V-329

Columbia Northwest, Inc. (Columbia Northwest) is recalling certain 2017-2018 Aliner Ascape trailers. The trailers have liquid propane (LP) gas bottle trays that come loose from the frames due to the wrong rivets being used to attach the LP tray to the frame. The LP gas bottles may fall from the trailer during travel, increasing the risk of a crash or a fire. Columbia Northwest will notify owners, and dealers will secure the trays with the correct hardware, free of charge. The recall is expected to begin during June 2017. Owners may contact Columbia Northwest customer service at 1-724-237-5227.

17V-330

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2017**

Published June 27, 2017

Ford Motor Company (Ford) is recalling certain 2017 Ford Explorer, F-150, F-250, F-350, F-450 and F-550 vehicles equipped with a manual driver's seat back recliner mechanism. In the event of a crash, the seat back frame may not restrain the occupant due to having inadequate welds. As such, these vehicles may not meet the requirements of Federal Motor Vehicle Safety Standard (FMVSS) numbers 202a, "Head Restraints" and 207, "Seating Systems." If the occupant is not adequately restrained in the event of a crash, they have an increased risk of injury. Ford will notify owners, and dealers will inspect and, if necessary, replace the seat back frame, free of charge. The recall began on June 7, 2017. Owners may contact Ford at 1-866-436-7332. Ford's number for this recall is 17C08.

17V-332

Harley-Davidson Motor Company (Harley-Davidson) is recalling certain 2017 Electric Glide Ultra Classic (FLHTCU), Police Electra Glide (FLHTP), Police Road King (FLHP), Road King (FLHR), Road King Special (FLHRXS), Street Glide (FLHX), Street Glide Special (FLHXS), Road Glide (FLTRX), and Road Glide Special (FLTRXS) motorcycles. In the affected motorcycles, a clamp used to secure an engine oil cooler line may have been improperly installed. The incorrectly installed clamp may result in the engine oil cooler line detaching, causing a sudden loss of oil, potentially into the path of the rear tire, increasing the risk of a crash. Harley-Davidson will notify owners, and dealers will inspect and correct the oil cooler line clamps, as necessary, free of charge. The recall began on June 6, 2017. Owners may contact Harley-Davidson customer service at 1-800-258-2464. Harley-Davidson's number for this recall is 0170.

17V-333

REV Ambulance Group Orlando, Inc. (REV) is recalling certain model year 2012-2013 Road Rescue Type I, 2013-2016 Road Rescue Type III, and 2014-2017 Road Rescue Type IX emergency vehicles equipped with a 2" subfloor. The bolts used to install the cot securing system to the floor may be too short. In the event of a crash, the cot may not remain secured, possibly causing injury to the vehicle occupants. REV will notify owners, and dealers will provide the correct replacement hardware for the affected units, free of charge. The recall is expected to begin June 30, 2017. Owners may contact REV customer service at 1-800-628-8178.

17V-334

Keystone RV Company (Keystone) is recalling certain 2017-2018 Dutchmen Voltage trailers equipped with the Onan 5.5 generator option. The fuel line may have been clamped incorrectly to the generator. The incorrectly clamped fuel line may disconnect, possibly causing a fuel leak and increasing the risk of fire. Keystone will notify owners, and dealers will properly clamp the fuel line to the generator, free of charge. The recall began on May 31, 2017. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 17-285.

17V-335

Forest River, Inc. (Forest River) is recalling certain 2016-2018 Cardinal recreational trailers, model CAF3250RL. The Federal Placard on these vehicles overstates the Gross Axle Weight Rating capacity (GAWR) by 840lbs. for each axle. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." The incorrect GAWR makes the Cargo Carrying Capacity (CCC) label incorrect and may result in the vehicle being overloaded, affecting the vehicle control and increasing the risk of a crash. Forest

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2017**

Published June 27, 2017

River will notify owners, and dealers will provide a new Federal Placard with the correct GAWR and a new CCC label, free of charge. The recall began on June 6, 2017. Owners may contact Forest River customer service at 1-574-206-7600. Forest River's number for this recall is 15-05192017-0412.

17V-336

Motor Coach Industries (MCI) is recalling certain 2011-2012 MCI D4000, D4005, D4500 and D4505 coaches equipped with Cummins ISX 12 liter engines. The vehicles may have an incorrectly installed exhaust bellow pipe, resulting in a bend in the pipe which can cause its premature failure. If the pipe fails and a diesel regeneration cycle occurs, the hot exhaust gases will increase the risk of a fire. MCI will notify owners and dealers will inspect and replace any deformed or failed bellow pipes if necessary, free of charge. The recall began on June 15, 2017. Owners may contact Motor Industries at 1-800-241-2947. MCI's number for this recall is SB 397B.

17V-337

Daimler Trucks North America LLC (DTNA) is recalling certain 2013-2018 Freightliner Custom Chassis S2G Chassis trucks. The vehicles have an airline hose and the engine block coolant heater wire that may not have been properly routed and secured during production. The affected airline and wire may contact the exhaust pipe, possibly resulting in melting and shorting, increasing the risk of a fire. DTNA will notify the owners, and dealers will inspect and correct the airline and heater cord routing and secure them, if needed, free of charge. The recall is expected to begin on July 22, 2017. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-739.

17V-338

Keystone RV Company (Keystone) is recalling certain 2012-2018 Springdale recreational vehicles, model 303BH. The Federal Identification Tag on these vehicles overstate the Gross Axle Weight Rating capacity (GAWR) by 800lbs for each axle. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." The incorrect GAWR makes the Cargo Carrying Capacity (CCC) label incorrect and may result in the vehicle being overloaded, affecting the vehicle control and increasing the risk of a crash. Keystone will notify owners, and dealers will provide a new Federal Placard with the correct GAWR and a new CCC label, free of charge. The recall began on June 20, 2017. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 17-289.

17V-339

EIDorado Mobility (EIDorado Mobility) is recalling certain 2017 Amerivan 10" lowered-floor vehicles. The vehicles have left and right trailing arm mounts that may break. If the trailing arm mounts break, a loss of steering control may result, increasing the risk of a crash. EIDorado Mobility will notify owners, and dealers will install reinforced trailing arm mounts, free of charge. The recall is expected to begin July 5, 2017. Owners may contact EIDorado Mobility customer service at 1-866-392-6300.

17V-340

Jaguar Land Rover North America, LLC (Jaguar) is recalling certain 2018 Jaguar F-TYPE vehicles equipped with Highline headlamps. If a front turn signal indicator stops working, the visual and audible turn signal

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2017**

Published June 27, 2017

reminders do not flash or chime faster as required. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, reflective devices, and associated equipment." Without the change to the flash and chime rate, the driver may not know that a turn signal is not working. If the turn signal is not working, other drivers will not be aware that the vehicle is turning, increasing the risk of a crash. Jaguar will notify owners, and dealers will update the vehicle's software, free of charge. The recall is expected to begin on July 17, 2017. Owners may contact Jaguar customer service at 1-800-452-4827. Jaguar's number for this recall is H026.

17V-341

Vantage Mobility International, LLC (Vantage Mobility) is recalling certain 2017 Chrysler Pacifica lowered floor vans modified by Vantage Mobility for wheelchair accessibility. The affected vans have rear brake lines that might have been crossed during the modification. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 135, "Light Vehicle Brake Systems." The crossed rear brake lines will cause the rear anti-lock brake system to be ineffective, increasing the risk of a crash. Vantage Mobility will notify owners, and dealers will correct the rear brake line attachments, free of charge. The recall is expected to begin July 7, 2017. Owners may contact Vantage Mobility customer service at 1-800-488-9082. Vantage Mobility's number for this recall is Pac-20170525.

17V-342

Gulf Stream Coach, Inc. (Gulf Stream) is recalling certain 2018 Vintage Cruiser travel trailers, model VN23BHS. The Federal Certification Label overstates the capacity of each axle by 700lbs. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." The incorrect information can cause the vehicle to be overloaded or result in axle failure, increasing the risk of a crash. Gulf Stream will notify owners and will mail them a corrected Federal Certification Label, free of charge. The recall is expected to begin during June 2017. Owners may contact Gulf Stream customer service at 1-800-289-8787. Gulf Stream's number for this recall is GS2500517.

17V-343

Gulf Stream Coach, Inc. (Gulf Stream) is recalling certain 2015-2017 Vista Cruisers and 2016-2018 Vintage Cruiser travel trailers. The Tire Identification Label incorrectly states that the trailers are equipped with ST215/75R 14 Load Range C rated tires when actually they have ST205/65R 14 Load Range D rated tires. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 567, "Certification." The incorrect information may cause the user to install the wrong replacement tire, affecting the vehicle's handling, thereby increasing the risk of a crash. Gulf Stream will notify owners and will provide them a corrected Tire Identification Label, free of charge. The recall is expected to begin in June 2017. Owners may contact Gulf Stream customer service at 1-800-289-8787. Gulf Stream's number for this recall is GS250517.

17V-344

VanLeigh RV (VanLeigh) is recalling certain 2015-2018 Vilano fifth-wheel recreational trailers. Because the winch that supports the spare tire may not be properly fastened to the trailer, the trailer's spare tire could fall off while unit is in motion. If the spare tire falls off while the unit is in motion, it may increase the risk of a crash.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2017**

Published June 27, 2017

VanLeigh will notify owners, and dealers will secure the spare tire winch with the correct fasteners, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact VanLeigh customer service at 1-662-612-4040. VanLeigh's number for this recall is VL-101.

17V-345

Forest River, Inc. (Forest River) is recalling certain 2016-2017 Vibe recreational trailers, model ORVBT236RBS-64. The Federal Placard has incorrect rear tire information, indicating ST205/75R15C tires inflated to 50psi, when the actual tires are size ST225/75R15D inflated to 65psi. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims." The incorrect tire information can cause the operator to install the wrong size and load range of replacement tires, or underinflate the existing tires. Either condition increases the risk of a crash. Forest River will notify owners will provide them a corrected Federal Placard, free of charge. The recall is expected to begin July 24, 2017. Owners may contact Forest River customer service at 1-541-644-8063. Forest River's number for this recall is 64-05232017-0413.

17V-346

KZRV, L.P. (KZRV) is recalling certain 2016-2018 Venom fifth-wheel travel trailers, models 4040DQ and 4011QK, equipped with the outside kitchen option. The affected vehicles do not have a 12" copper pipe between the rubber gas supply hose and the cooktop pilot light. Without the copper pipe, the rubber gas line may be too close to the pilot light and get too hot and melt, increasing the risk of a fire. KZRV will notify owners, and dealers will install a 12" copper extension between the pilot light and the rubber gas line, free of charge. The recall began on June 5, 2017. Owners may contact KZRV customer service at 1-800-768-4016, extension 153 or 154.

17V-347

Pierce Manufacturing (Pierce) is recalling certain 1999-2013 Arrow XT, Dash, Enforcer, Quantum and Velocity fire trucks equipped with the electric All-steer rear steering option. The affected vehicles have rear steer axle shafts that were not properly heat treated. Axle shafts that are not properly heat treated may break and potentially disable the vehicle, increasing the risk of a crash. Pierce will notify owners, and dealers will replace the rear steer axle shafts, free of charge. An interim notice will be mailed to owners during June 2017. A second notice will be mailed when parts become available. Owners may contact Pierce customer service at 1-888-974-3723.

17V-348

Pierce Manufacturing (Pierce) is recalling certain 2012-2017 Arrow XT, Dash, Enforcer, Quantum, and Velocity fire trucks equipped with the T3 rear steer option. The affected vehicles have a rear sway bar that may detach from the vehicle. If the sway bar detaches, the vehicle may sway more during steering maneuvers, increasing the risk of a crash. Pierce will notify owners, and dealers will replace and properly torque the sway bar fasteners, free of charge. The recall is expected to begin during June 2017. Owners may contact Pierce customer service at 1-888-974-3723.

17V-349

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2017**

Published June 27, 2017

Jayco, Inc. (Jayco) is recalling certain 2018 Eagle TT 330RSTS (EA) recreational trailers. The Federal Placard on these vehicles incorrectly lists the Gross Axle Weight Rating capacity (GAWR) as 5,800lbs, when the axles actually have a capacity of 5,660lbs. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims." The incorrect GAWR may result in the vehicle being overloaded, causing a loss of control and increasing the risk of a crash. Jayco will notify owners, and dealers will provide a new Federal ID labels with the correct GAWR, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Jayco customer service at 1-800-283-8267.

17V-350

Spartan Motors USA (Spartan) is recalling certain 2010-2014 K2 and K3 motor home chassis and Gladiator emergency response chassis cabs. A component within the starter motor may break, potentially resulting in the starter motor overheating or drawing excessive current. A starter motor that overheats may increase the risk of a fire. Spartan will notify the purchasers of the chassis and dealers will replace the starters, free of charge. The recall is expected to begin during June 2017. Owners may contact Spartan customer service at 1-800-543-4277. Spartan's number for this recall is 17012.

17V-351

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2017 Jetta vehicles. The affected vehicles have Vehicle Identification Number (VIN) markings on the body that do not match the VIN plate near the windshield. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." The mismatched VINs make the vehicle noncompliant with regulatory requirements. Volkswagen has notified owners and has replaced the vehicles, free of charge. The recall began on June 2, 2017. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's number for this recall is 06A8.

17V-352

Terex Advance Mixer, Inc. (Terex) is recalling certain 2017 Front Discharge Mixers, equipped with certain 250 gallon water tanks. The welds that attach the filler neck onto the 250 gallon pressurized water tank may fail. If the weld fails, the filler neck may separate from the pressurized tank, increasing the risk of injury. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Terex customer service at 1-800-678-5961.

17V-353