

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2018**

Published August 24, 2018

CHILD SEATS:

None during May 2018.

EQUIPMENT:

Chrysler (FCA US LLC) is recalling certain accessory Mopar Gooseneck Ball Kits, part numbers 82213631 and 82213632. The retention ball may not fully seat in the receiver plate. Despite the shuttle being in the locked position, the gooseneck ball may detach from the truck mounting hardware. If the gooseneck ball does not remain secured, it can cause loss of vehicle control, increasing the risk of a crash. The remedy for this recall is still under development. Interim notices informing owners of the safety risk were mailed June 21, 2018. Owners will receive a second notice when the remedy becomes available. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is U40.

18E-028

Fuel Injection Technology, Inc. (FiTech) is recalling certain Summit Racing Max 500-EFI 240500 fuel injection systems. The fuel injector O-ring seals may leak fuel. A fuel leak in the presence of an ignition source can increase the risk of a fire. FiTech will notify the purchasers and will replace the fuel rails, O-rings and any related parts, free of charge. The recall began on May 15, 2018. Owners may contact FiTech customer service at 1-951-340-2624. FiTech's number for this recall is 18-01.

18E-029

Ivolution Sports Inc. (Ivolution) is recalling certain IV2 HY-811 helmets, in all sizes. These helmets may block a portion of the rider's peripheral vision. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 218, "Motorcycle Helmets." If the rider's peripheral vision is reduced, there may be an increased risk of a crash. Ivolution will notify owners, and owners will be sent a prepaid return shipping label to return the helmet for a full refund. Owners may contact Ivolution customer service at 1-951-852-6327.

18E-030

Strehl, LLC (Strehl) is recalling certain TrailerBlade Fleet trailer skirts, part number 404000. The mounting brackets may separate from the skirt panels. If multiple brackets separate, the trailer skirt could detach from the trailer, increasing the risk of a crash. Strehl will notify owners, and dealers will inspect the brackets and install a supplemental safety cable on each bracket. If cracks are detected, the brackets will be replaced. These repairs will be performed free of charge. The recall began on June 19, 2018. Owners may contact Strehl customer service at 1-844-462-5233.

18E-031

LuK GmbH & Co. KG (LuK) has submitted a Defect Information Report based upon decisions made by Kia Motors America and Hyundai Motor America to conduct recalls (numbers 18V257 and 18V260 respectively) to inspect and replace the Hydraulic Clutch Actuator (HCA) caps and assembly that can allow oil to accumulate in the cap area, possibly resulting in an electrical short. An electrical short can increase the risk of a fire. LuK is working with the affected vehicle manufacturers. Dealers for those manufacturers will inspect the HCA caps for

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2018**

Published August 24, 2018

leaked oil, and replace the HCA assembly if necessary, free of charge. Kia owners may contact Kia customer service at 1-800-333-4542. Kia's number for this recall is SC163. Hyundai owners may contact Hyundai customer service at 1-855-371-9460. Hyundai's number for this recall is 176.

18E-033

Roush Performance Products, Inc. (Roush) is recalling certain aftermarket supercharger kits, part number R1318-6006P1-AA, sold for installation on 2018 Ford Mustangs. The hose barb fittings on the supercharger kits may be manufactured incorrectly, possibly causing damage to the fuel lines and resulting in a fuel leak. A fuel leak can increase the risk of a fire. Roush will notify the known owners and replace the defective fuel rail subassemblies, free of charge. Owners may contact Roush customer service at 1-800-597-6874. Roush's number for this recall is REMay2018.

18E-035

Dorman Products, Inc. (Dorman) is recalling certain Dorman control arms, part numbers 521-898, 521-897, CA14583 and CA14584. These control arms may have a ball stud that can pull through the steering knuckle causing a partial loss of steering. Loss of steering ability can increase the risk of a crash. Dorman will notify owners, and dealers will replace the ball stud with a new ball stud nut, free of charge. The recall began August 15, 2018. Owners may contact Dorman customer service at 1-800-523-2492. Dorman's number for this recall is CA0518XXXX.

18E-037

Yakima Products, Inc. (Yakima) is recalling certain HoldUp Evo hitch-mounted bike racks, part number 802479-2482. The rear tire tray may separate from the bike rack while the vehicle is moving. If the rear wheel tray separates from the bike rack while a bicycle is attached to it, the rear bicycle wheel may drag on the road while the vehicle is moving, increasing the risk of a crash. Yakima has notified owners, and will provide owners with a repair kit that will secure the rear bicycle wheel rear tray, free of charge. The recall began on June 6, 2018. Owners may contact Yakima customer service at 1-888-266-3085. Yakima's number for this recall is HU2018.

18E-038

TIRES:

Continental Tire the Americas, LLC. (Continental Tire) is recalling certain Conti Hybrid HS3 tires, size 11R22.5 Load Range G, with tire identification numbers (TIN) A33TKWUX and DOT date codes of 0918 through 1118. Cords may be visible through the innerliner. Tires with visible cords through the innerliner may have a sudden loss of air, increasing the risk of a crash. Continental Tire will notify owners, and dealers will replace the tires, free of charge. The recall began August 2, 2018. Owners may contact Continental Tire customer service at 1-888-799-2168.

18T-006

VEHICLES:

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2018**

Published August 24, 2018

Winnebago Industries, Inc (Winnebago) is recalling certain 2018 Winnebago Travato and 2018-2019 Winnebago Era, and Revel recreational vehicles. The roof rack may not have been installed with the correct fasteners, possibly resulting in the roof rack detaching from the vehicle while moving. If the roof rack detaches while moving, it could become a road hazard, increasing the risk of a crash. Winnebago will notify owners, and dealers will add a screw adjacent to each rivet, free of charge. The recall began on May 29, 2018. Owners may contact Winnebago customer service at 1-641-585-6939 or 1-800-537-1885. Winnebago's number for this recall is 150.

18V-274

Chrysler (FCA US LLC) is recalling certain 2018 RAM 4500 and 5500 cab chassis trucks. The primary and secondary brake hoses located between the brake master cylinder and the hydraulic control unit may have been manufactured without anti-corrosion plating on the ferrules, which can allow the ferrules to corrode. If the ferrules corrode, the brake fluid may leak and cause a loss of braking, increasing the risk of a crash. Chrysler will notify owners, and dealers will inspect the brake hoses and replace them if necessary, free of charge. The recall began June 19, 2018. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is U41.

18V-277

Chrysler (FCA US LLC) is recalling certain 2004-2007 Jeep Liberty vehicles. The rear suspension lower control arms can fracture due to excessive corrosion, causing a loss of vehicle control. A fractured control arm can cause a loss of vehicle control, increasing the risk of a crash. Chrysler will notify owners, and dealers will replace the rear lower control arms, free of charge. The recall began June 26, 2018. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is U38. Note: This recall is an expansion of recall 12V-085. Vehicles included in that campaign are not included in this recall.

18V-278

Chrysler (FCA US LLC) is recalling certain 2018 Jeep Compass vehicles. The front lower control arms may be incorrectly welded, potentially resulting in a control arm separation. If the lower control arm separates, it can cause a loss of vehicle control, increasing the risk of a crash. Chrysler will notify owners, and dealers will inspect and, if necessary, replace the front lower control arms, free of charge. The recall began May 31, 2018. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is U42.

18V-279

Chrysler (FCA US LLC) is recalling certain 2018 Dodge Charger, Durango and Challenger, Jeep Grand Cherokee and Wrangler, Chrysler 300, and RAM 1500 vehicles. An incorrect transmission park lock rod may have been installed in the transmission. If the incorrect park lock rod is installed, the transmission may not shift into 'PARK' and keep the vehicle from moving, increasing the risk of unintended vehicle movement and the risk of a crash. Chrysler will notify owners, and dealers will install the correct park lock rod, free of charge. The recall began June 28, 2018. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is U43.

18V-280

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2018**

Published August 24, 2018

Chrysler (FCA US LLC) is recalling certain 2015-2018 Dodge Charger pursuit police vehicles equipped with all-wheel drive and V8 engines. The front driveshaft universal joint may seize or fracture causing the shaft to detach from the vehicle. If the front driveshaft detaches from the vehicle it may become a road hazard, increasing the risk of a crash. Chrysler will notify owners, and dealers will replace the front driveshaft, free of charge. The recall began June 27, 2018. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is U37.

18V-281

Chrysler (FCA US LLC) is recalling certain 2018 Jeep Cherokee vehicles equipped with a 2.4L engine. These vehicles may have been manufactured with a fuel tube that may leak fuel into the engine compartment. A fuel leak in the presence of the ignition source can increase the risk of a fire. Chrysler will notify owners, and dealers will inspect the fuel tube, replacing it as necessary, free of charge. The recall began May 24, 2018. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is U39.

18V-282

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain Volkswagen Atlas vehicles. The fuel tank on these vehicles may leak fuel due to a manufacturing error. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 301, "Fuel System Integrity." A fuel leak in the presence of an ignition source can increase the risk of a fire. Volkswagen will notify owners, and dealers will replace the fuel tank, free of charge. The recall began June 22, 2018. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's number for this recall is 20AW. Note: This recall is an expansion of recall 17V-766.

18V-284

Thor Motor Coach (TMC) is recalling certain 2011-2017 Thor Tuscany and Venetian motorhomes, built on Freightliner Custom Chassis Corporation (FCCC) chassis. The power steering hose on the affected vehicles may be routed incorrectly, and, as a result, the hose may rub against the power stud on the starter motor, possibly causing electrical arcing and a power steering fluid leak. Electrical arcing in the presence of leaking power steering fluid can increase the risk of a fire. FCCC has notified owners, and FCCC dealers will reroute the power steering hose to provide proper clearance, free of charge. The recall began on May 1, 2018. Owners may contact TMC customer service at 1-877-855-2867 or FCCC customer service at 1-800-547-0712. TMC's number for this recall is RC000153.

18V-285

Jayco, Inc. (Jayco) is recalling certain 2018 Jayco Eagle HT fifth wheel trailers equipped with certain 16K rotational rubber pin boxes. The spindle placement in the pin box may be incorrect, causing the bearing to be loose. If the bearings become loose, the spindle may fail, increasing the risk of a crash. Jayco will notify owners, and dealers will add a spacer to correct the spacing error, free of charge. The recall began on June 28, 2018. Owners may contact Jayco customer service at 1-800-517-9137. Jayco's number for this recall is 9901377.

18V-286

Porsche Cars North America, Inc. (Porsche) is recalling certain 2015 Porsche 918 Spyder vehicles. The

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2018**

Published August 24, 2018

connecting shafts of the longitudinal and transverse control arms may fail due to stress corrosion cracking, impacting vehicle handling. If the control arm connecting shafts crack, affecting vehicle handling, it can increase the risk of a crash. Porsche will notify owners, and dealers will replace the longitudinal and transverse control arms, free of charge. Porsche issued owners an interim notification on June 25, 2018. Owners may contact Porsche customer service at 1-800-767-7243. Porsche's number for this recall is AJ04.

18V-287

Daimler Vans USA, LLC (DVUSA) is recalling certain 2017 Mercedes-Benz and Freightliner Sprinter 2500 and 3500 vehicles. These vehicles may be missing spot welds on the front side wall, connecting the door portal to the hinge reinforcements in the A-pillar area, possibly affecting vehicle strength in a crash. If the missing welds affect body strength, there may be an increased risk of injury in the event of a crash. DVUSA will notify owners, and dealers will inspect the vehicles and add any missing spot welds, free of charge. The recall began on July 2, 2018. Owners may contact DVUSA customer service at 1-877-762-8267.

18V-288

Navistar, Inc. (Navistar) is recalling certain 2017-2019 International HX severe service diesel trucks equipped with feature code 04091 (dual air brake system) and 04AZY (Antilock Brake System (ABS) with 6 channel Electronic Stability Protection (ESP)). The air supply line to the SR7 roll stability valve may have been improperly routed to the ATR6 brake control valve steer axle delivery port, when it should be connected to the ATR6 brake control valve control port. During a stability control oversteer event when there are slippery road conditions, the parking brakes may be modulated unintentionally, potentially causing a loss of control and increasing the risk of a crash. Navistar will notify owners, and dealers will reroute the SR7 roll stability valve supply line to the ATR6 brake control valve control port, free of charge. The recall began on June 12, 2018. Owners may contact Navistar customer service at 1-800-448-7825. Navistar's number for this recall is 18504.

18V-289

Navistar, Inc. (Navistar) is recalling certain 2019 IC Bus CE school buses equipped with feature code 04091 (dual air brake system) and 04AZS (Antilock Brake System (ABS) with 4 channel Electronic Stability Protection (ESP)). The air supply line to the SR7 roll stability valve may have been improperly routed to the ATR6 brake control valve steer axle delivery port, when it should be connected to the ATR6 brake control valve control port. During a stability control oversteer event when there are slippery road conditions, the parking brakes may be modulated unintentionally, potentially causing a loss of control and increasing the risk of a crash. Navistar will notify owners, and dealers will reroute the SR7 roll stability valve supply line to the ATR6 brake control valve control port, free of charge. The recall began on June 12, 2018. Owners may contact Navistar customer service at 1-800-448-7825. Navistar's number for this recall is 18506.

18V-290

General Motors LLC (GM) is recalling certain 2015-2016 Chevrolet Silverado 1500 and Tahoe Police Pursuit and Special-Service vehicles. The flexible steel cable connecting the driver's seat belt to the outboard side of the seat may be repeatedly bent over the seat side shield as the driver enters and exits the vehicle causing the cable to fatigue and separate. If the pretensioner cable becomes fatigued or breaks, the driver may not be properly

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2018**

Published August 24, 2018

restrained in the event of a crash, increasing their risk of injury. GM will notify owners, and dealers will replace the pretensioner cable and seat side-shield, free of charge. The recall began June 19, 2018. Owners may contact Chevrolet customer service at 1-800-222-1020. GM's number for this recall is 18156.

18V-291

Jayco, Inc. (Jayco) is recalling certain 2011 and 2013 Jay Series BB, BC and BD camping trailers equipped with a Lippert Power Roof Lift Mechanism. The manual over-ride feature on these power lifts may be misused, potentially resulting in torque from the drive motor damaging the lift mechanism. Damage to the lift mechanism may cause the roof to fall unexpectedly, increasing the risk of injury. Jayco will notify owners and will provide a warning label to instruct owners of the proper use of the manual over-ride feature, free of charge. The recall began on June 26, 2018. Owners may contact Jayco customer service at 1-800-517-9137. Jayco's number for this recall is 9901379.

18V-292

Navistar, Inc. (Navistar) is recalling certain 2018-2019 International WorkStar, DuraStar, LoneStar, LT, ProStar, RH and IC Bus HC, 2018 International TranStar, 2019 International HV and MV trucks and transit buses. The front driver and passenger seat belt anchor D-ring bolt may break in the event of a crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 210, "Seat Belt Assembly Anchorages." If the D-ring bolt breaks during a crash, the seat occupant may not be properly restrained, increasing their risk of injury. Navistar has notified owners, and dealers will replace the D-ring bolt depending on the information found on the seat belt label, free of charge. The recall began May 23, 2018. Owners may contact Navistar customer service at 1-800-448-7825. Navistar's number for this recall is 18505.

18V-293

Starcraft RV (Starcraft) is recalling certain 2011 Starcraft BC and BD and 2013 Comet BA, BB and BC camping trailers equipped with a Lippert Power Roof Lift Mechanism. The manual over-ride feature on these power lifts may be misused, potentially resulting in torque from the drive motor damaging the lift mechanism. Damage to the lift mechanism may cause the roof to fall unexpectedly, increasing the risk of injury. Starcraft will notify owners and will provide a warning label to instruct owners of the proper use of the manual over-ride feature, free of charge. The recall began on June 26, 2018. Owners may contact Starcraft customer service at 1-800-945-4787. Starcraft's number for this recall is 9902379.

18V-294

General Motors LLC (GM) is recalling certain 2014-2017 Chevrolet Express and GMC Savana vehicles equipped with power windows. Liquid may leak into the driver's power window switch and cause corrosion, resulting in high electrical resistance. High electrical resistance can increase the risk of a fire. GM will notify owners, and dealers will replace the driver side window switch, free of charge. The recall began August 10, 2018. Owners may contact Chevrolet customer service at 1-800-222-1020 or GMC customer service at 1-800-462-8782. GM's number for this recall is 18155.

18V-295

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2018**

Published August 24, 2018

Forest River, Inc. (Forest River) is recalling certain 2018 Forest River Surveyor recreational trailers, model SVT241RBLE. The refrigerator in the slide room may not have an air cycling fan to cool the refrigerator parts, which can cause the refrigerator to overheat. If the refrigerator overheats, the cooling tubes may fail, increasing the risk of a fire. Forest River has notified owners, and dealers will install a cooling fan assembly, free of charge. The recall began on May 9, 2018. Owners may contact Forest River customer service at 1-574-642-3119. Forest River's number for this recall is 37-0719.

18V-296

Jayco, Inc. (Jayco) is recalling certain 2018 Jayco Alante and 2018-2019 Jayco Precept vehicles. The windshield wiper system motor on these vehicles may fail when being operated in heavy snow or ice situations, thereby reducing driver visibility. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 104, "Windshield Wiping and Washing Systems." Failure of the windshield wiper system can decrease the driver's visibility, increasing the risk of a crash. Jayco will notify owners, and dealers will replace the wiper module with a new relay pack, free of charge. The recall began on June 29, 2018. Owners may contact Jayco customer service at 1-800-517-9137. Jayco's number for this recall is 9903378.

18V-297

Entegra Coach (Entegra) is recalling certain 2019 Vision and Emblem motorhomes. The windshield wiper system motor on these vehicles may fail when being operated in heavy snow or ice situations, thereby reducing driver visibility. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 104, "Windshield Wiping and Washing Systems." Failure of the windshield wiper system can decrease the driver's visibility, increasing the risk of a crash. Entegra will notify owners, and dealers will replace the wiper module with a new relay pack, free of charge. The recall began on June 29, 2018. Owners may contact Entegra customer service at 1-800-517-9137. Entegra's number for this recall is 9903378.

18V-298

Nova Bus (Nova) is recalling certain 2015-2017 Nova LFS and LFS Artic transit buses, equipped with axles with radial air disk brakes. Surface roughness of a guide pin in the radial brake calipers may cause the brake carriage guide pin support bolt to break. Breakage of the guide pin can cause loss of braking ability or loss of tire pressure, increasing the risk of a crash. Nova will notify owners and dealers will install new guide pins at each wheel end on suspect axles, free of charge. Owners may contact Nova customer service at 1-800-350-6682. Nova's number for this recall is CR4079.

18V-299

Daimler Trucks North America LLC (DTNA) is recalling certain 2018-2019 Freightliner Cascadia vehicles. The fasteners that secure the driver's air bag module within the steering wheel may not have been installed to specification, possibly affecting the frontal air bag deployment in the event of a crash. An incorrectly installed air bag may not function correctly in a crash, increasing the risk of injury. DTNA will notify owners, and dealers will inspect the frontal air bag fasteners, tightening them to the proper specification, free of charge. The recall began on July 9, 2018. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2018**

Published August 24, 2018

recall is FL-771.

18V-300

Daimler Trucks North America LLC (DTNA) is recalling certain 2002-2018 Thomas Built Buses Minotour school buses built on a Ford chassis and equipped with an optional wheelchair lift. The wheelchair lift may be allowed to operate when the vehicle is in neutral or drive, due to missing relay in the interlock wiring harness. If the vehicle can be moved while the wheelchair lift is being used, there is an increased the risk of injury. DTNA will notify owners, and dealers will inspect the wheelchair lift wiring, correcting it as necessary, free of charge. Daimler issued an interim notification to owners on June 19, 2018. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-770.

18V-301

Triumph Motorcycles America, LTD (Triumph) is recalling certain 2018 Street Triple R, Street Triple R - Low Seat and Street Triple RS motorcycles. Water may get into the left-hand combination switch on the handlebar and cause the turn signal switch and the headlight switch to malfunction. If the turn signal and headlight switches do not function properly, there would be an increased risk of a crash. Triumph will notify owners, and dealers will replace the handlebar left-hand combination switch, free of charge. The recall began June 22, 2018. Owners may contact Triumph customer service at 1-678-854-2010.

18V-302

Keystone RV Company (Keystone) is recalling certain 2016-2017 Crossroads Redwood travel trailers. The ladder on the back of the vehicle may be blocking the secondary emergency exit window. If there is a ladder blocking a window that is labeled as being an emergency exit, there is an increased risk of injury. Keystone has notified owners instructing them to remove the emergency exit sticker from that window if it is blocked by a ladder, free of charge. The recall began on May 23, 2018. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 18-319.

18V-303

General Motors LLC (GM) is recalling certain 2016-2018 Chevrolet Cruze LS vehicles, equipped with a gasoline engine and a tire inflator kit instead of a spare tire. The vehicles may leak gasoline following a rear-impact crash and a rollover. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 301, "Fuel System Integrity." A fuel leak, in the presence of an ignition source, increases the risk of a fire. GM will notify owners, and dealers will install a lock-ring on the fuel tank that will shield the fuel tank vapor pressure sensor from damage in a rear-impact crash, free of charge. The recall began June 7, 2018. Owners may contact Chevrolet customer service at 1-800-222-1020. GM's number for this recall is 18159.

18V-304

Hyundai Motor America (Hyundai) is recalling certain 2018 Hyundai Genesis G80 and Genesis G90 vehicles. The windshield and rear window on these vehicles may have been installed with incorrect primer, potentially reducing the glass bonding strength. If the glass bonding strength is reduced over time, the windshield and rear window may detach while driving, increasing the risk of a crash. Hyundai will notify owners, and dealers will

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2018**

Published August 24, 2018

replace the front and rear glass, free of charge. The recall began on July 6, 2018. Owners may contact Hyundai customer service at 1-855-371-9460. Hyundai's number for this recall is 001G.

18V-305

Navistar, Inc. (Navistar) is recalling certain 2019 International LT heavy diesel trucks equipped with feature codes 29WAY, 504312, and 504455. The lightweight brake drums with slack adjusters may drag against the brakes causing the drums to overheat which can result in the brake drum cracking, separating from the vehicle or the brakes becoming inoperative. If the brake drum separates or if the brakes become inoperative, it can increase the risk of a crash. Navistar has notified owners, and dealers will replace the brake drums and slack adjusters and replace the brake linings, free of charge. The recall began on May 23, 2018. Owners may contact Navistar customer service at 1-800-448-7825. Navistar's number for this recall is 18507.

18V-306

Newmar Corporation (Newmar) is recalling certain 2016-2018 Newmar Mountain Aire motorhomes. The Diesel Exhaust Fluid (DEF) tank bracket may contact the tag axle tire, possibly causing tire damage. If the bracket damages the tire, it can cause tire failure, increasing the risk of a crash. Newmar will notify owners, and Spartan Motors dealers will move the DEF bracket away from the tire, free of charge. The recall began on June 21, 2018. Owners may contact Newmar customer service at 1-800-731-8300.

18V-307

PACCAR Incorporated (PACCAR) is recalling certain 2018 Kenworth T270 trucks. The outer spindle nut of the front wheel hub assembly may have been incorrectly installed possibly causing bearing failure. Front wheel bearing failure can lead to front wheel separation, increasing the risk of a crash. PACCAR has notified owners, and dealers have inspected the hub assembly and corrected the installations, free of charge. The recall began April 26, 2018. Owners may contact Kenworth customer service at 1-425-828-5000. PACCAR's number for this recall is 18KWB.

18V-308

Motor Coach Industries (MCI) is recalling certain 2011-2016 D4500, D4505, D4000, D4005, and D4000 ISTV motor coaches equipped with ISX engines. Due to vibrations, the exhaust bellow pipes develop a hole. If the pipe develops a hole, during a regeneration cycle, hot exhaust gases may leak out, increasing the risk of a fire. MCI will notify owners, and dealers will replace the bellows pipe assembly with an improved part, free of charge. The recall began July 10, 2018. Owners may contact MCI customer service at 1-800-241-2947.

18V-309

Trail Boss Conversions, Inc. (Trail Boss) is recalling one 2017 Twister Horse Trailer equipped with a Norcold N306 mini refrigerator that may have a loose or missing propane gas valve test port screw. The loose or missing propane gas port screw can allow propane gas to leak when the refrigerator is used in 'gas' mode, increasing the risk of a fire. Trail Boss has notified the dealer that is in possession of the one affected vehicle and the dealer will install and tighten the gas valve port screw, as necessary, free of charge. The recall began on May 25, 2018. Owners may contact Trail Boss customer service at 1-877-546-9074.

18V-310

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2018**

Published August 24, 2018

Altec Industries Inc. (Altec) is recalling certain 2014-2017 Altec Flatbed Bodies with stake rails. The stake rails may not be properly retained, allowing them to become dislodged. If the stake rails become dislodged while the vehicle is moving, it can increase the risk of an injury or a crash. Altec will notify owners and provide stake rail retention kits, free of charge. The recall began on June 21, 2018. Owners may contact Altec customer service at 1-877-462-5832. Altec's number for this recall is CSN 680.

18V-311

Ford Motor Company (Ford) is recalling certain 2018 Ford Ecosport vehicles sold in the United States Federal Territories. These vehicles were shipped with the European brake reservoir pictogram cap label and the European English language owner's manual kits. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 135, "Light Vehicle Brake Systems." Owners could be confused by the incorrect label on the brake fluid cap, potentially causing them to replace the brake fluid with an incorrect fluid which could affect brake performance, increasing the risk of a crash. Ford will notify owners, and dealers will replace the brake fluid cap and owner's manual kit, free of charge. The recall began on June 21, 2018. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 18C04.

18V-312

Keystone RV Company (Keystone) is recalling certain 2018 Keystone Montana fifth-wheel trailers. The switch for the slide-out room may not have circuit-protection. Without circuit protection, if the slide-out switch wiring shorts to ground, there would be an increased risk of a fire. Keystone will notify owners, and dealers will install a inline fuse for that circuit, free of charge. The recall began on June 5, 2018. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 18-320.

18V-313

BMW of North America, LLC (BMW) is recalling certain 2010-2011 BMW 335d vehicles with diesel engines. The connection of the positive battery cable at the fuse box terminal may degrade over time, possibly resulting in an intermittent loss of electrical power. A loss of electrical power to the vehicle can cause the vehicle to unexpectedly stall, increasing the risk of a crash. BMW will notify owners, and dealers will replace the positive battery cable connector and secure it with an improved method, free of charge. The recall began on June 29, 2018. Owners may contact BMW customer service at 1-800-525-7417.

18V-314

Navistar, Inc. (Navistar) is recalling certain 2018-2019 IC Bus CE and 2019 IC Bus RE school buses. The release mechanism on the emergency windows may be difficult to open in an emergency situation. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 217, "Bus Emergency Exits and Window Retention and Release." If extra force is needed to pull the release handle, exit of the vehicle may be hindered, increasing the risk of injury in the event of an emergency. Navistar will notify owners, and dealers will apply dry lubricant to the latch assembly, free of charge. The recall began on June 13, 2018. Owners may contact Navistar customer service at 1-800-448-7825. Navistar's number for this recall is 18508.

18V-315

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2018**

Published August 24, 2018

Navistar, Inc. (Navistar) is recalling certain 2018 IC Bus CE transit buses. The release mechanism on the emergency windows may be difficult to open in an emergency situation. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 217, "Bus Emergency Exits and Window Retention and Release." If extra force is needed to pull the release handle, exit of the vehicle may be hindered, increasing the risk of injury in the event of an emergency. Navistar will notify owners, and dealers will apply dry lubricant to the latch assembly, free of charge. The recall began on June 13, 2018. Owners may contact Navistar customer service at 1-800-448-7825. Navistar's number for this recall is 18509.

18V-316

American Custom Golf Cars (ACG) is recalling certain 2016-2017 ACG Moke low speed vehicles. These vehicles may be missing the rear side red reflectors, reducing the vehicle's visibility to other drivers. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 500, "Low Speed Vehicles." If the rear side red reflectors are missing, the vehicle may have reduced visibility to drivers, increasing the risk of a crash. ACG will notify owners, and dealers will install a different reflector, free of charge. The recall began on June 15, 2018. Owners may contact ACG customer service at 1-909-597-2885. ACG's number for this recall is ACG-RC2018-02.

18V-317

Porsche Cars North America, Inc. (Porsche) is recalling certain 2018 Porsche Macan S and Macan vehicles. These vehicles have a control unit that may fail and prevent safety-related functions such as driver display alerts and possibly impair drivability and post-crash functions. Failure of the control unit may increase the risk of a crash. Porsche will notify owners, and dealers will replace the affected control unit, free of charge. Owners may contact Porsche customer service at 1-800-767-7243. Porsche's number for this recall is AJ05.

18V-318

Ford Motor Company (Ford) is recalling certain 2018 Ford F-650 and F-750 vehicles equipped with hydraulic brakes. The parking brake cable may not have been adjusted properly, which may result in unexpected vehicle movement. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 105, "Hydraulic and Electric Brake Systems." For vehicles equipped with a transmission that does not have a 'Park' position or a transmission that has a 'Park' position but the transmission lever is not placed in 'Park', an improperly adjusted park brake cable could result in unintended movement of the vehicle, increasing the risk of a crash or injury. Ford will notify owners, and dealers will correct the parking brake cable adjustment, free of charge. The recall began on May 25, 2018. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 18C05.

18V-319

Keystone RV Company (Keystone) is recalling certain 2019 Keystone Cougar fifth-wheel trailers, models 28SGS and 27RLS. The propane compartment may not have been sealed properly during manufacturing, which if there were a propane leak, could allow the propane gas to seep into the living quarters. A propane leak into the living area can increase the risk of injury or fire. Keystone will notify owners, and dealers will seal the inside of the LP compartment along the floor line and side wall, free of charge. The recall began on June 14, 2018. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 18-

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2018**

Published August 24, 2018

321.

18V-320

Polaris Industries, Inc. (Polaris) is recalling certain 2017-2018 Polaris Slingshot, Slingshot SL, Slingshot SLR, Slingshot SL Icon, and Slingshot GT LE motorcycles. The brake pedals may have been incorrectly installed, allowing the brake pedal to separate from the brake master cylinder. If the brake pedal separates from the brake master cylinder, it would cause a loss of braking ability, increasing the risk of a crash. Polaris will notify owners, and dealers will inspect the engagement of the brake pedal retaining clip and reassemble it if necessary, free of charge. The recall began on June 5, 2018. Owners may contact Polaris customer service at 1-855-863-2284. Polaris' number for this recall is T-18-02.

18V-321

McNeilus Truck & Manufacturing, Inc. (McNeilus) is recalling certain 2008-2018 Bridgemaster V concrete mixers equipped with an optional composite material hydraulic tank. The filler neck check valve may seal the tank too tightly, causing the tank to overpressurize and possibly rupture. If the tank ruptures it may cause hydraulic fluid to spill. The ruptured tank can cause injuries from plastic debris. The spilled hydraulic fluid could be hot which could cause burn injuries. If the vehicle is on the road when the tank ruptures, the tank pieces or spilled hydraulic fluid may cause a road hazard which could increase the risk of a crash. McNeilus has notified owners, and dealers will replace the filler neck, free of charge. The recall began on June 4, 2018. Owners may contact McNeilus customer service at 1-888-686-7278. McNeilus' number for the recall is VSR-TSB-018.

18V-322

BMW of North America, LLC (BMW) is recalling certain 2018 BMW M5 vehicles. In certain driving conditions, the engine control unit software may cause the fuel pump to stop. If the fuel pump stops, the vehicle will stall, increasing the risk of a crash. BMW will notify owners, and dealers will update the engine control unit software, free of charge. The recall began on June 25, 2018. Owners may contact BMW customer service at 1-800-525-7417.

18V-323

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2018 Volkswagen Tiguan and Tiguan long wheel base (LWB) vehicles. The nut that holds the lower ball joint of the front wheel on each side of the vehicle may be loose or improperly tightened. A loose or improperly tightened ball joint nut can result in the separation of the lower ball joint causing steering, traction or other stability issues, increasing the risk of a crash. Volkswagen has notified owners, and dealers will replace the nut on the lower ball joint and, as necessary, clean the thread in the ball joint, free of charge. The recall began May 30, 2018. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's number for this recall is 40N4. Note: owners are advised not to drive their vehicle until the recall repair has been performed.

18V-324

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain Audi S5 Cabriolet vehicles equipped with Super Sport seats. The seat-mounted head/thorax air bag in the front passenger seat may have been folded incorrectly during installation. If the air bag was not folded correctly during installation, the seat-mounted air bag

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2018**

Published August 24, 2018

may deploy improperly in the event of a crash, increasing the risk of injury. Audi will notify owners, and dealers will replace the front passenger seat-mounted head/thorax air bag, free of charge. The recall began July 13, 2018. Owners may contact Audi customer service at 1-800-253-2834. Volkswagen's number for this recall is 69W6.

18V-325

Rebel West Powersports LLC (Rebel West) is recalling one 2018 Rebel R4 LSV vehicle. The vehicle did not have rear side reflex reflectors. As such, this vehicle fails to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." If the reflex reflectors are missing, it will reduce the vehicle's visibility to other drivers, increasing the risk of a crash. Rebel West notified the owner, and rear reflex reflectors were installed, free of charge. No owner notification letter will be mailed. Owners may contact Rebel West customer service at 1-602-842-5100. Rebel West's number for this recall is recall1.

18V-326

Setra of North America (Setra) is recalling certain 2017-2018 Setra S417 TC and S407 CC motorcoaches. The steering drop arm nut may loosen, possibly causing a loss of steering control. A loss of steering control can increase the risk of a crash. Setra will notify owners, and dealers will replace the steering drop arm and nut, free of charge. The recall began on July 9, 2018. Owners may contact Setra customer service at 1-800-241-2947. Setra's number for this recall is 46.40U10716A.

18V-327

Tiffin Motorhomes, Inc. (Tiffin) is recalling certain 2013-2018 Allegro Open Road motorhomes. Insufficient strength of the frame rail may allow the tow hitch to detach from the motorhome. If the hitch detaches, the tow vehicle would not be connected to the motorhome, increasing the risk of a crash. Tiffin will notify owners, and dealers will install an insert plate to strengthen the frame rail, free of charge. Tiffin issued owners an interim notification on May 31, 2018. The recall began on July 24, 2018. Owners may contact Tiffin customer service at 1-256-356-8661. Tiffin's number for this recall is TIF-109. Note: Some vehicles already remedied as part of recall 17V200 will need the additional repairs covered by this recall.

18V-328

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2012-2016 Eos, 2012 Passat, 2012-2016 CC, 2015 e-Golf, 2011-2015 Touareg, 2012-2015 Tiguan, and 2011-2016 Golf and 2011-2013 GTI vehicles. Modifications made while the vehicles were in an internal evaluation period may cause the affected vehicles to not comply with all of the applicable regulatory requirements. If the vehicles do not meet all regulatory requirements, there could be an increased risk of a crash, fire, or injury. Volkswagen will notify owners, and dealers will repair the vehicles to make them fully compliant or Volkswagen will repurchase them if necessary, free of charge. Interim notices informing owners of the safety risk were mailed July 13, 2018. Owners will receive a second notice when the remedy becomes available. Owners may contact Volkswagen customer service at 1-800-893-5298.

18V-329

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2018**

Published August 24, 2018

Daimler Trucks North America LLC (DTNA) is recalling certain 2003-2006 Thomas Built Buses Minotour transit buses built on a Ford chassis and equipped with an optional wheelchair lift. The wheelchair lift may be allowed to operate when the vehicle is in neutral or drive, due to missing relay in the interlock wiring harness. If the vehicle can be moved while the wheelchair lift is being used, there is an increased the risk of injury. DTNA will notify owners, and dealers will inspect the wheelchair lift wiring, correcting it as necessary, free of charge. Daimler issued an interim notification to owners on June 19, 2018. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-770.

18V-330

Suzuki Motor of America, Inc. (Suzuki) is recalling certain 2013 Suzuki Kizashi and SX4 vehicles equipped with a Continuously Variable Transmission (CVT). The Transmission Control Module (TCM) may fail causing a reduction in speed or reduced vehicle acceleration. A reduction in vehicle speed or reduced acceleration can increase the risk of a crash. Suzuki will notify owners, and dealers will replace the TCM, free of charge. The recall began on June 11, 2018. Owners may contact Suzuki customer service at 1-800-934-0934. Suzuki's number for this recall is 4005 to 4008.

18V-331

Chrysler (FCA US LLC) is recalling certain 2014-2018 Dodge Journey, Charger and Durango, RAM 2500, 3500, 3500 Cab Chassis (more than 10,000lb), 4500 Cab Chassis and 5500 Cab Chassis, Jeep Cherokee and Grand Cherokee and Chrysler 300, 2014-2019 RAM 1500, 2015-2018 Dodge Challenger, 2015-2017 Chrysler 200, 2016-2018 RAM 3500 Cab Chassis (less than 10,000 lb), 2017-2018 Chrysler Pacifica and 2018 Jeep Wrangler vehicles. These vehicles are being recalled to address a defect that could prevent the cruise control system from disengaging. If, when using cruise control, there is a short circuit within the vehicle's wiring, the driver may not be able to shut off the cruise control either by depressing the brake pedal or manually turning the system off once it has been engaged, resulting in either the vehicle maintaining its current speed or possibly accelerating. If the vehicle maintains its speed or accelerates despite attempts to deactivate the cruise control, there would be an increased risk of a crash. Chrysler will notify owners, and dealers will inspect the software, and perform a software flash on the engine or powertrain control module, free of charge. The recall began June 4, 2018. Owners may contact Chrysler customer service at 1-800-853-1403. Note: Owners are advised to stop using cruise control until the software update has been performed. In the event that cruise control cannot be disengaged while driving, owners should firmly and steadily apply the brakes and shift the transmission to neutral, placing the vehicle in park once it has stopped.

18V-332

Forest River, Inc. (Forest River) is recalling certain 2017-2019 Forest River Vengeance Rouge recreational trailers, models VGT25V-73 and VGT25V-73-W. These vehicles may be missing side marker lights in the middle of each side, reducing the visibility of the trailers to other drivers. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." The reduced visibility can increase the risk of a crash. Forest River has notified owners, and dealers will install the missing amber side marker lights, free of charge. The recall began June 7, 2018. Owners may contact Forest River customer service at 1-260-499-2100. Forest River's number for this recall is 73-0727.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2018**

Published August 24, 2018

18V-333

Forest River, Inc. (Forest River) is recalling certain 2019 Coachmen Viking recreational trailers, models T17BHS and T17FQS. The Federal Placard states that the tires have an inflation pressure of 65 PSI, when the tires actually require 75 PSI. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims." The incorrect Placard could cause the operator to underinflate the tires, possibly causing tire failure, increasing the risk of a crash. Forest River has notified owners and provided a corrected Federal Placard, free of charge. The recall began May 31, 2018. Owners may contact Forest River customer service at 1-269-467-8281. Forest River's number for this recall is 121-0734.

18V-334

Daimler Vans USA, LLC (DVUSA) is recalling certain 2015-2017 Mercedes-Benz Metris vehicles. The transmission support may not have been properly tightened to the vehicle body, potentially resulting in damage to the driveshaft. Damage to the driveshaft could cause a loss of power to the wheels, increasing the risk of a crash. DVUSA will notify owners, and dealers will inspect the transmission support mounting bolts, replacing and tightening them as necessary, free of charge. The recall began July 11, 2018. Owners may contact DVUSA customer service at 1-877-762-8267.

18V-335

BMW of North America, LLC (BMW) is recalling certain 2009-2013 X5 xDrive 35d diesel vehicles. The engine idler pulley bolt may loosen over time and break. If the idler pulley bolt breaks, the vehicle may unexpectedly lose power-assisted steering, increasing the risk of a crash. The remedy for this recall is still under development. BMW issued owners an interim notification on July 17, 2018. Owners may contact BMW customer service at 1-800-525-7417.

18V-336

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain 2017 Land Rover Range Rover, Range Rover Sport, and Discovery vehicles. The fuel gauge on these vehicles may indicate that the fuel level is low and illuminate the warning lamp, when the fuel tank actually has more fuel. The engine management software may also cut off the engine when the vehicle has traveled approximately 17 more miles. If the engine were to shut off, it can cause loss of power brake assistance. An engine stall would cause a loss of drive power. Both scenarios can increase the risk of a crash. Land Rover will notify owners, and dealers will install a software update to correct the fuel level reading, free of charge. The recall began on June 22, 2018. Owners may Land Rover customer service at 1-800-637-6837. Land Rover's number for this recall is N206.

18V-337

Kia Motors America (Kia) is recalling certain 2015-2018 Kia Sedona vehicles equipped with a power sliding door (PSD). The PSD may not auto-reverse when its closing is obstructed. If the door closes on an occupant, there is an increased risk of an injury. Kia will notify owners, and dealers will reprogram the PSD module software, free of charge. The recall began on June 18, 2018. Owners may contact Kia customer service at 1-800-333-4542. Kia's number for this recall is SC164.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2018**

Published August 24, 2018

18V-338

Columbia Northwest, Inc. (Columbia Northwest) is recalling certain 2016-2017 Somerset Chesapeake and Somerset Newport recreational trailers. A weld on the front A-frame bars may fail, possibly allowing the front of the trailer to drop while being towed. If the front of the trailer drops while being towed, it may contact the road, causing a loss of control and increasing the risk of a crash. Columbia Northwest will notify owners and dealers will install steel supports welded to the joints identified on the front of the frame, free of charge. The recall began June 18, 2018. Owners may contact Columbia Northwest customer service at 1-724-237-5227.

18V-339

General Motors LLC (GM) is recalling certain 2018 GMC Terrain vehicles. The sensing diagnostic module (SDM) that senses a crash and deploys the necessary air bags may not power down correctly when the vehicle is shut off, causing it to be inoperative when the vehicle is restarted. If the SDM becomes inoperative, it will not detect a crash or command the necessary air bag deployment, increasing the risk of injury in the event of a crash. GM will notify owners, and dealers will reprogram the SDM with updated software, free of charge. The recall began June 29, 2018. Owners may contact GMC customer service at 1-800-462-8782. GM's number for this recall is 18179.

18V-340

Tiffin Motorhomes, Inc. (Tiffin) is recalling certain 2018-2019 Tiffin Allegro RED, Allegro Open Road, Breeze, Bus, Phaeton, and Zephyr motorhomes. The entry door on these vehicles may have been improperly assembled, allowing the door to open while the vehicle is moving. If the door comes open while the motorhome is moving, there is an increased risk of injury to the motorhome occupants. Tiffin will notify owners, and dealers will adjust the door lock mechanism, free of charge. The recall began on June 18, 2018. Owners may contact Tiffin customer service at 1-256-356-8661. Tiffin's number for this recall is TIF-110.

18V-341

General Motors LLC (GM) is recalling certain 2018 Chevrolet Sonic vehicles. A joint in the driver's seat-back frame may not be properly welded, reducing the strength of the seat-back frame. In the event of a rear-impact crash, the seat-back may fail, increasing the risk of injury. GM will notify owners, and dealers will replace the driver's seat-back, free of charge. The recall began June 28, 2018. Owners may contact Chevrolet customer service at 1-800-222-1020. GM's number for this recall is 18178.

18V-342

Chrysler (FCA US LLC) is recalling certain 2018 Jeep Wrangler vehicles. The intermediate steering shaft may not have been properly welded causing a split where the external spline is formed. If the weld seam splits, the steering wheel may lose center positioning causing a loss of steering responsiveness and increasing the risk of a crash. Chrysler will notify owners, and dealers will inspect and, as necessary, replace the intermediate steering shaft, free of charge. The recall began June 21, 2018. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is U48.

18V-343

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2018**

Published August 24, 2018

Chrysler (FCA US LLC) is recalling certain 2019 Jeep Cherokee vehicles equipped with 2.0L engines. The engines in these vehicles may be missing valve stem keepers, which can allow the valve to drop into the engine cylinder causing engine damage. These engines may also have a reversed camshaft cap that can damage the camshaft bearing causing camshaft failure. Cylinder damage or camshaft failure can cause the engine to stall, increasing the risk of a crash. Chrysler will notify owners, and dealers will inspect and repair or replace the affected engine components, as necessary, free of charge. The recall began August 9, 2018. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is U52.

18V-344

Altec Industries Inc. (Altec) is recalling certain 2017 Altec TA48S aerial devices. The travel height of these vehicles may be greater than the indicated height on the decal that is located on the chassis dashboard. If the travel height is higher than what is indicated on the decal, the vehicle may unexpectedly strike an overhead obstruction, increasing the risk of a crash. Altec will notify owners, and dealers will measure the vehicle's travel height, and if height is different than what is on the decals, the decals will be replaced, free of charge. The recall began on July 18, 2018. Owners may contact Altec customer service at 1-877-462-5832. Altec's number for this recall is CSN 682.

18V-345

Altec Industries Inc. (Altec) is recalling certain 2016-2017 Digger Derrick DM, D2000, D3000, D4000 Series vehicles built on Freightliner M2106/V chassis. The starter cable may be improperly secured, allowing the cable to chafe which could result in an electrical short. An electrical short can increase the risk of a fire. Altec will notify owners, and dealers will inspect and better secure the starter cable as needed, free of charge. The recall began July 20, 2018. Owners may contact Altec customer service at 1-877-462-5832. Altec's number for this recall is CSN 683.

18V-346

Maserati North America, Inc. (Maserati) is recalling certain 2018 Maserati Quattroporte, Ghibli, and Levante vehicles. The welds on the front sub frame may be incomplete, which can result in the welds breaking. If the welds fracture, it can cause a loss of vehicle control, increasing the risk of a crash. Maserati will notify owners, and dealers will inspect the sub frame for incomplete welds, replacing the sub frame, as necessary, free of charge. The recall began on June 29, 2018. Owners may contact Maserati customer service at 1-877-696-2737. Maserati's number for this recall is 369.

18V-347

Altec Industries Inc. (Altec) is recalling certain 2012-2018 Altec LS63 and LS87 aerial devices equipped with a pintle hook mounted into the Class 3 receiver tube. This towing combination was shipped without a placard that provides the maximum allowable towing limit, possibly resulting in the receiver tube being overloaded. An overloaded receiver tube could detach, increasing the risk of a crash. Altec will notify owners, and provide them with a placard that states the limit of the receiver tube assembly as 600lbs vertical load, and 6,000lbs towing capacity, free of charge. The recall began on July 25, 2018. Owners may contact Altec customer service at 1-877-462-5832. Altec's number for this recall is CSN 684.

18V-348

SAFETY DEFECT/NONCOMPLIANCE NOTICES

RECEIVED DURING MAY 2018

Published August 24, 2018

Foretravel, Inc. (Foretravel) is recalling certain 2017-2018 Foretravel iH45 and Realm motorcoaches. The passenger seat base assembly may not be adequately secured. In the event of a crash, the passenger seat base may move, increasing the risk of occupant injury. Foretravel will notify owners, and dealers will install any missing bolts, free of charge. The recall began June 15, 2018. Owners may contact Foretravel customer service at 1-800-955-6226.

18V-349

Spartan Motors USA (Spartan) is recalling certain 2001-2018 Spartan Gladiator, Diamond, MetroStar, and Advantage emergency response vehicles. The affected vehicles may not be equipped with a pressure protection valve installed between the air reservoir and the lubrication control module. If the air line were to become disconnected between the lubrication control module and the air reservoir, a loss of air to the air brake system could occur. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 121, "Air Brake Systems." A loss of air to the air brake system could increase the risk of a crash. Spartan will notify owners, and dealers will inspect the vehicles and install a pressure protection valve, as necessary, free of charge. The recall began on June 26, 2018. Owners may contact Spartan customer service at 1-800-543-5008. Spartan's number for this recall is 18017.

18V-350

Daimler Trucks North America LLC (DTNA) is recalling certain 2012-2019 Western Star 4900 trucks built with Lowmax hoods and disc brakes. There may be insufficient clearance between the front brake hose and the hood resulting in the brake hose being chafed. Front brake hose chafing may causing air loss, possibly reducing braking effectiveness and increasing the risk of a crash. DTNA will notify owners, and dealers will replace the front axle brake hose, free of charge. DTNA issued owners an interim notification on July 27, 2018. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-773.

18V-351

Daimler Trucks North America LLC (DTNA) is recalling certain 2017-2019 Thomas Built Buses Saf-T-Liner C2, Saf-T-Liner EFX and Saf-T-Liner HDX school buses equipped with air disc brakes. The brake caliper mounting bolts on these vehicles may be insufficiently tightened, allowing the bolts to loosen. If the brake caliper mounting bolts come loose, braking performance may be reduced, increasing the risk of a crash. DTNA will notify owners, and dealers will inspect the brake caliper mounting bolts and tighten them as necessary, free of charge. DTNA issued owners an interim notification on July 25, 2018. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-772.

18V-352

Daimler Trucks North America LLC (DTNA) is recalling certain 2017-2019 Freightliner M2 Business Class, 108SD, 114SD and Cascadia trucks, Western Star 4700, 4900, and 5700 trucks, FCCC S2C 106 Cab, S2G Cab, XBR, XBS, XCL, XCM, XCP, XCR, and XCS chassis equipped with air disc brakes. The brake caliper mounting bolts on these vehicles may be insufficiently tightened, allowing the bolts to loosen. If the brake caliper mounting bolts loosen, braking performance may be reduced, increasing the risk of a crash. DTNA will notify owners, and dealers will inspect the brake caliper mounting bolts and tighten them as necessary, free of charge. DTNA issued owners an interim notification on July 25, 2018. Owners may contact DTNA customer service at

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2018**

Published August 24, 2018

1-800-547-0712. DTNA's number for this recall is FL-772.

18V-353

Forest River, Inc. (Forest River) is recalling certain 2019 Coachmen Chaparral, Chaparral Lite and Brookstone, and Shasta Phoenix recreational trailers. The liquid propane (LP) gas bottle ring on these trailers may not have a deep enough pierce punch to bind the metal strap, possibly resulting in the LP bottle detaching. If the LP bottle detaches while moving, it can increase the risk of a crash. Forest River will notify owners, and dealers will install new LP bottle rings, free of charge. The recall began on June 28, 2018. Owners may contact Forest River customer service at 1-574-825-8360. Forest River's number for this recall is 110-0738.

18V-354

Nissan North America, Inc. (Nissan) is recalling certain 2018 Infiniti QX30 vehicles. The bolt securing the right-hand side lower seat belt anchorage may have been incorrectly installed during production. This can result in the lower seat belt anchorage detaching in a crash. As such, these vehicles fail to comply with certain requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 210, "Seat Belt Assembly Anchorages", number 209, "Seat Belt Assemblies, and number 208, "Occupant Crash Protection." If the lower seat belt anchorage detaches in a crash, it can increase the risk of injury. Nissan will notify owners, and dealers will weld in a new retaining plate and secure the seat belt anchorage with a new anchor bolt, free of charge. All vehicles were repaired July 17, 2018. Owners may contact Infiniti customer service at 1-800-662-6200.

18V-355

General Motors LLC (GM) is recalling certain 2018 Buick LaCrosse, Cadillac ATS, Chevrolet Equinox, Malibu and Colorado and GMC Terrain, Acadia and Canyon vehicles. The high pressure fuel pump may detach from its mounting flange, possibly resulting in the pump damaging the high pressure fuel line. A damaged fuel line can create a fuel leak, increasing the risk of a fire. GM will notify owners, and dealers will replace the high pressure fuel pump, and high pressure fuel pipe, free of charge. The recall began July 2, 2018. Owners may contact Buick customer service at 1-800-521-7300, Cadillac customer service at 1-800-458-8006, Chevrolet customer service at 1-800-222-1020, or GMC customer service at 1-800-462-8782. GM's number for this recall is 18188.

18V-358

PACCAR Incorporated (PACCAR) is recalling certain 2019 Kenworth T270 and T370 vehicles. The rear hub axle nut on these vehicles may have been over tightened, possibly causing bearing failure or a fire. Bearing failure can cause wheel separation, increasing the risk of crash. PACCAR will notify owners, and dealers will disassemble the rear hub assembly, and install new bearings and re-assemble the hub, free of charge. Owners may contact PACCAR customer service at 1-918-259-3258. PACCAR's number for this recall is 18KWC.

18V-359

General Motors LLC (GM) is recalling certain 2019 Chevrolet Corvette ZR1 vehicles. Hard braking or acceleration may cause the sensing diagnostic module (SDM) to enter a fault state. As a result, the SDM will not provide crash sensing or deploy the necessary air bags in the event of a crash. In the event of a crash, if the air bags do not deploy as designed, the occupants have an increased risk of injury. GM will notify owners, and

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2018**

Published August 24, 2018

dealers will reprogram the SDM with updated software, free of charge. The recall began on June 29, 2018. Owners may contact Chevrolet customer service at 1-800-222-1020. GM's number for this recall is 18195.

18V-360

Van-Con, Inc. (Van-Con) is recalling one 2016 33803 Dual Rear Wheel school bus. The roof panel seams were not correctly bonded and thus may separate in the event of a crash. As such, this vehicle fails to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 221, "School Bus Body Joint Strength." If the roof panels separate in a crash, the occupants have an increased risk of injury. The purchaser of the affected bus is aware of the issue, therefore an owner notification letter will not be mailed. Owners may contact Van-Con customer service at 1-732-356-8484.

18V-365