

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2019**

*Published June 28, 2019*

**CHILD SEATS:**

None during May 2019.

**EQUIPMENT:**

Aero Industries, Inc. (Aero Industries) is recalling certain Easy Cover tarping systems. The spring return pin within the pawl assembly may have not been tack welded, allowing the pawl assembly to separate from the hub on the manual crank assembly. Separation of the pawl assembly and hub may cause the swing arms on the Easy Cover tarping system to unexpectedly swing to the back of the dump body, increasing the risk of crash. Aero Industries will notify owners and provide new pawl assemblies to the affected customers, free of charge. Owners may contact Aero Industries customer service at 1-800-535-7563. Aero Industries number for this recall is CAR #33852.

**19E-033**

Linora Corporation (Linora) is recalling certain WiFiRanger DC Step-Up power converters. These power supplies may overheat. The overheating can increase the risk of a fire. Linora has notified the manufacturers and distributors that purchased the product, and dealers for the affected vehicle manufacturers will replace the converter with a new unit, free of charge. The recall began May 20, 2019. Owners may contact Linora Corporation customer service at 1-208-321-5544. Linora's Corporation number for this recall is TSB 04-2019-24VDC.

**19E-034**

Transfer Flow Inc - Chico, CA (Transfer Flow) is recalling certain rear brake lines used for mobility van conversions. The brake lines may have incorrect tube nut fittings installed, which may cause a pressure drop within the braking system. The reduction in the braking system pressure may cause a loss of braking power in the rear braking system, increasing the risk of crash. Transfer Flow has notified the affected vehicle manufacturer, and dealers for that manufacturer will install an adaptor to correct the issue, free of charge.

**19E-035**

Meritor, Inc. (Meritor) is recalling certain MX10-120EVO, MX12-120EVO, and MX14-120EVO steer axles. The axles may have insufficient lubrication, which may result in damage to the wheel end bearings. If the bearings are damaged, the wheel may separate and cause a sudden loss of vehicle control, increasing the risk of crash. Meritor has notified the vehicle manufacturers that purchased the axles and dealers for those manufacturers will inspect and replace the wheel end components, as necessary, free of charge. The recall began June 14, 2019. Owners may contact Meritor customer service at 1-866-668-7221.

**19E-036**

Seats Incorporated is recalling certain ABTS 6-way, seats, part number 314313. Due to poor weld penetration, the motor mount for the front vertical adjustment may separate and the riser may come out of position, causing the seat to unexpectedly move. As such, these seats fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 207, "Seating Systems." In the event of a forward impact crash, the front vertical adjustment may inadvertently adjust, increasing the risk of injury. The remedy for this recall is still

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2019**

*Published June 28, 2019*

under development. The manufacturer has not yet provided a notification schedule. Owners may contact Seats Incorporated customer service at 1-800-767-3287.

**19E-037**

**TIRES:**

None during May 2019.

**VEHICLES:**

Indian Motorcycle Company (Indian) is recalling certain 2014 Chief and Chieftain motorcycles. Due to a problem within the Vehicle Control Module (VCM), all of the front lights, including the headlight, may go out while riding. The loss of lighting can reduce visibility, increasing the risk of crash. The remedy for this recall is still under development. Owners will be informed of the safety risk beginning in June 2019. Owners will receive a second notice when the remedy becomes available. Owners may contact Indian customer service at 1-877-204-3697. Indian's number for this recall is I-19-02.

**19V-339**

PACCAR Incorporated (PACCAR) is recalling certain 2020 Peterbilt 520 and 579 vehicles and Kenworth T680, T880 and W990 vehicles. The mirror glass may detach from the mirror carrier plate due to inadequate adhesion. If the mirror glass detaches, the driver may have reduced visibility and the mirror glass will become a road hazard that may strike another vehicle or pedestrian, increasing the risk of a crash or injury. PACCAR has notified owners, and dealers will inspect the upper mirror glass/mirror carrier, replacing it as necessary, free of charge. The recall began May 31, 2019. Kenworth owners may contact PACCAR customer service at 1-425-828-5888 and Peterbilt owners may call 1-940-591-4220. PACCAR's numbers for this recall is 19KWC and 19PBC.

**19V-340**

Yamaha Motor Corporation, USA (Yamaha) is recalling certain 2019 YZFR3 motorcycles. Porosities in the front brake lever may cause it to break if it is gripped with a strong force. A broken front brake lever can affect front braking ability, increasing the risk of crash. Yamaha will notify owners, and dealers will inspect and replace the front brake lever, as necessary, free of charge. The recall began May 15, 2019. Owners may contact Yamaha customer service at 1-800-962-7926. Yamaha's number for this recall is 990128.

**19V-341**

Taylor Made Ambulances is recalling certain 2017-2018 Ford E-350, F-450, E-450, F-550, and GMC G3500-based ambulances equipped with Whelen brake lights. Depending on the specific wiring of the vehicle, these brake lights may illuminate when the brake pedal has not been pressed. If the brake lights incorrectly illuminate, it can confuse other drivers, possibly increasing the risk of a crash. Taylor Made will notify owners and Whelen will replace the brake lights, free of charge. Owners may contact Taylor Made Ambulances customer

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2019**

*Published June 28, 2019*

service at 1-800-468-1310.

**19V-342**

Suzuki Motor of America, Inc. (Suzuki) is recalling 2010-2013 Kizashi vehicles. The front passenger seat Occupant Classification System (OCS) may misclassify an adult occupant as child and deactivate the front air bag. The deactivated front air bag will not deploy in the event of a crash, increasing the risk of injury. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Suzuki customer service at 1-800-934-0934. Suzuki's number for this recall is C5.

**19V-343**

Motor Coach Industries (MCI) is recalling certain 2019 J3500 and D4505 buses, and 2018-2019 J4500 buses equipped with Transpec T287x Series glass roof hatches. Temperature and vibration stresses may cause the tempered glass roof hatch to shatter. If the tempered glass roof hatch shatters, glass fragments may fall onto passengers, increasing the risk of an injury. MCI will notify owners, instructing them to contact the hatch manufacturer for a replacement roof hatch, free of charge. The recall began June 20, 2019. Owners may contact MCI customer service at 1-800-241-2947. MCI's number for this recall is SB 471.

**19V-344**

Supreme Corporation (Supreme) is recalling certain 2018-2019 Platform vehicles. The rear clearance lamp may be located in the incorrect position, blocking part of the required 90-degree light spread. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective devices, and Assoc. Equipment." Lack of visibility of the rear clearance lamps may increase the risk of crash. The remedy for this recall is still under development. Owners may contact Supreme customer service at 1-844-352-4921.

**19V-345**

Hercules Enterprises is recalling certain 2018 Hercules CH40GN 18047 trailers. The wheel end nut locking device on these trailers may not be properly installed, allowing the wheel end to separate from the axle. A wheel detachment increases the risk of crash. According to Hercules Enterprises, all of the affected axles have been repaired. Owners may contact Hercules Enterprises customer service at 1-908-369-0000.

**19V-346**

Chrysler (FCA US LLC) is recalling certain 2015-2017 Ram 1500, 2500 and 3500 pickup trucks equipped with an 8 foot truck bed and a power locking tailgate. Chrysler is also recalling all 2018 Ram 1500, 2500 and 3500 pickup trucks built before April 1, 2018 that are equipped with a power locking tailgate. The tailgate actuator limiter tab may fracture and cause the tailgate to unlatch and open while driving. If the tailgate opens while the vehicle is being driven, cargo may fall out the vehicle and create a road hazard, increasing the risk of crash. Chrysler will notify owners, and dealers will repair the tailgate latch, free of charge. The recall began May 23, 2019. Owners may contact FCA US customer service at 1-800-853-1403. FCA US's number for this recall is V44. Note: 2015-2017 MY Ram 1500 pickup trucks with truck beds other than 8 foot, are currently covered under NHTSA recall 18V-486 for this issue.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2019**

*Published June 28, 2019*

**19V-347**

Chrysler (FCA US LLC) is recalling certain 2017-2019 Pacifica vehicles equipped with engine stop/start systems. A loose battery ground connection may result in an intermittent loss of power steering assist and/or a stall. A loss of power steering assist or a stall can increase the risk of crash. Chrysler will notify owners, and dealers will inspect the battery ground surfaces, clean the contact surfaces as needed, and properly reassemble the ground connection, free of charge. The recall began May 24, 2019. Owners may contact Chrysler customer service at 1-800-853-1403. FCA US' number for this recall is V53.

**19V-348**

BMW of North America, LLC (BMW) is recalling certain 2016-2019 X1 sDrive28i and X1 xDrive28i vehicles. In the event of a crash where the occupants head contacts the B-pillar, the pillar may not absorb an adequate amount of the impact. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 201, "Occupant Protection in Interior Impact." In the event of a crash, the insufficient impact absorption can increase the risk of injury. The remedy for this recall is still under development. The recall is expected to begin July 2019. Owners may contact BMW customer service at 1-800-525-7417.

**19V-349**

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain 2016-2017 Range Rover and Range Rover Sport vehicles. The driver's seat belt Emergency Locking Retractor (ELR) may not lock as designed. As such, these vehicles fail to comply with the requirements of the Federal Motor Vehicle Safety Standard (FMVSS) number 209, "Seat Belt Assemblies." If the driver brakes prior to a crash, the ELR will not lock at the correct g-force level, increasing the risk of injury. Land Rover will notify owners, and dealers will replace the driver's seat belt assembly, free of charge. Interim notices informing owners of the safety risk were mailed on June 24, 2019. Owners will receive a second notice when the remedy becomes available. Owners may contact Land Rover customer service at 1-800-637-6837. Land Rover's number for this recall is N333.

**19V-350**

Jaguar Land Rover North America, LLC (Jaguar) is recalling certain 2019-2020 I-PACE vehicles. If the electrical regenerative brake system fails, there will be an increased delay between when the driver brakes and when the vehicle decelerates. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 135, "Light Vehicle Brake Systems." A delay in deceleration, increases the distance needed to stop and the risk of a crash. Jaguar will notify owners, and dealers will update the software to reduce the delay, free of charge. The recall began June 12, 2019. Owners may contact Jaguar customer service at 1-800-637-6837. Jaguar's number for this recall is H213.

**19V-351**

BMW of North America, LLC (BMW) is recalling certain 2019-2020 230i, 230i xDrive, M240i, M240i xDrive, M2 Competition Coupe, 430i, 430i xDrive, 440i, 440i xDrive, M4, and 2019 330i xDrive Sportswagon vehicles. The driver and passenger knee air bag assemblies may have been improperly folded and assembled. An improperly folded and assembled air bag may not deploy as intended, increasing risk of injury. BMW will notify owners, and dealers will replace the knee air bag modules, free of charge. The recall is expected to begin

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2019**

*Published June 28, 2019*

July 2019. Owners may contact BMW customer service at 1-800-525-7417.

**19V-352**

Stainless & Repair, Inc. (Stainless & Repair) is recalling certain 2016-2017 Freightliner M2-112 and 1994-1995 Ford L9000 vehicles equipped with Whelen brake lights. Depending on the specific wiring of the vehicle, these brake lights may illuminate when the brake pedal has not been pressed. If the brake lights incorrectly illuminate, it can confuse other drivers, possibly increasing the risk of a crash. Stainless & Repair will notify owners, and Whelen dealers will replace the brake lights, free of charge. Owners may contact Whelen customer service at 1-860-718-2331 or Stainless & Repair at 1-715-591-4933.

**19V-353**

Autocar, LLC (Autocar) is recalling certain 2019-2020 Xpeditor vehicles. The rear axle brake may have a delayed release. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 121, "Air Brake Systems." A delayed brake release may increase the risk of crash. Autocar will notify owners, and dealers will re-work the air brake systems, free of charge. The recall is expected to begin July 8, 2019. Owners may contact Autocar customer service at 1-888-218-3611 or 1-877-973-3486. Autocar's number for this recall is ACX-1905.

**19V-354**

Forest River, Inc. (Forest River) is recalling certain 2018-2019 Cherokee ACKT39CL and ACKT39RL travel trailers. The Federal Placard may have incorrect axle rating, cargo carrying capacity, and tire/wheel combination information. Due to the incorrect Federal Placard, an operator may overload the vehicle, which may decrease vehicle stability and increase the risk of crash. Forest River will notify owners, and dealers will provide replacement placards that contain the accurate information, free of charge. The recall began May 28, 2019. Owners may contact Forest River customer service at 1-260-499-2100. Forest River's number for this recall is 17A-1012.

**19V-355**

Forest River, Inc. (Forest River) is recalling certain 2019-2020 R. Pod travel trailers. The wire for the refrigerator's spark igniter may have been connected to a breaker that permits a current higher than the wire can handle. Without the proper circuit breaker protection, the wire can melt, increasing the risk of fire. Forest River will notify owners, and dealers will move the wire from the 30 AMP circuit to the designated 15 AMP circuit, free of charge. The recall began May 28, 2019. Owners may contact Forest River customer service at 1-574-642-3119. Forest River's number for this recall is 80-1011.

**19V-356**

Lance Camper Manufacturing. Corp. (Lance Camper) is recalling certain 2019-2020 855S and 1172 Truck Campers. There may be a large gap between the fold down bunk bed, while it is in the sleeping position, and the window near the sleeping area. An occupant may fall and get stuck in the gap, increasing the risk of injury. The remedy for this recall is still under development. Owners may contact Lance Camper customer service at 1-661-949-3322.

**19V-357**

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2019**

*Published June 28, 2019*

Unruh Fire, Inc. (Unruh Fire) is recalling certain 2017-2018 Ford F-550-based fire trucks equipped with Whelen brake lights. Depending on the specific wiring of the vehicle, these brake lights may illuminate when the brake pedal has not been pressed. If the brake lights incorrectly illuminate, it can confuse other drivers, possibly increasing the risk of a crash. Unruh Fire has notified owners and will replace the brake lights, free of charge. The recall began in March 2019. Owners may contact Unruh Fire customer service at 1-800-856-7080.

**19V-358**

Unruh Fire, Inc. (Unruh Fire) is recalling one 2018 Dodge 5500-based fire truck equipped with Whelen brake lights. Depending on the specific wiring of the vehicle, these brake lights may illuminate when the brake pedal has not been pressed. If the brake lights incorrectly illuminate, it can confuse other drivers, possibly increasing the risk of a crash. Unruh Fire has notified the owner and will provide replacement brake lights, free of charge. The recall began in March 2019. Owners may contact Unruh Fire customer service at 1-800-856-7080.

**19V-359**

Spartan Motors USA (Spartan) is recalling certain 2018-2019 Gladiator, MetroStar, K2, K3, and K4 emergency response chassis cabs and motor home chassis. The brake relay valve may have an air flow restriction, which may result in an extended stopping distance. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 121, "Air Brake Systems." An increase in stopping distance increases the risk of crash. Spartan will notify the vehicle manufacturers that purchased the affected chassis, and Spartan dealers will inspect and replace the valves, as necessary, free of charge. The recall began June 19, 2019. Owners may contact Spartan customer service at 1-800-543-5008. Spartan's number for this recall is 19012.

**19V-360**

Trail King Industries, Inc. (Trail King) is recalling certain 2016-2019 custom TKT50 trailers. The air control line to the front Anti-lock Braking System (ABS) electronic control unit for the trailer brakes may be missing. If all of the air control lines are not installed, the service brakes may not apply on one or two of the three of axles, thus increasing the risk of a crash. Trail King will notify owners and will add a front control line, free of charge. The recall began June 24, 2019. Owners may contact Trail King customer service at 1-800-843-3324. Trail King's number for this recall is TK201902.

**19V-361**

Ford Motor Company (Ford) is recalling certain 2013-2016 Fusion vehicles equipped with 2.5 liter engines. The bushing that attaches the transmission shifter cable to the transmission may degrade over time and cause the bushing to detach from the transmission. The condition could allow the driver to move the shift lever to Park and remove the ignition key, while the transmission may not be in Park, with no warning message or audible chime. If the vehicle is exited without the transmission being in Park and without the parking brake being applied, the vehicle may unexpectedly move, increasing the risk of a crash. The remedy for this recall is still under development. An interim owner notification letter was mailed May 30, 2019. A second letter will be sent once the remedy is available. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 19S16. Note: Owners are directed to use the parking brake until the recall remedy repairs can be made. This recall is an expansion of 18V471.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2019**

*Published June 28, 2019*

**19V-362**

Mazda North American Operations (Mazda) is recalling certain 2019 Mazda3 vehicles. Due to incorrect programming, the passenger air bag deactivation indicator light may erroneously turn off although the passenger air bag is deactivated. In addition, the seat belt status indicators for both the front passenger seat and/or rear seats may erroneously turn off although the front passenger and/or rear seat belts are unfastened. Incorrect indicator warning lights may lead the driver and/or passengers to be unaware of deactivated air bags or unfastened seat belts, increasing the risk of injury. Mazda will notify owners, and dealers will replace the passenger air bag/seat belt status indicator assembly, free of charge. The recall is expected to begin July 13, 2019. Owners may contact Mazda customer service at 1-800-222-5500, Option 4. Mazda's number for this recall is 3319E.

**19V-363**

LDJ Manufacturing, Inc. (LDJ Manufacturing) is recalling certain 2019 Thundercreek SLT 460, SLT 660, SLT 880, MTT 690, MTT 920, FST 750, FST 990, and EV 990 trailers. The wheel lugs nuts may loosen, possibly resulting in a wheel separating from the trailer. A wheel separation can increase the risk of a crash. LDJ Manufacturing has notified owners and dealers will ensure that the lug nuts are torqued to the correct specifications, free of charge. The recall began May 21, 2019. Owners may contact LDJ customer service at 1-641-620-4034.

**19V-364**

Altec Industries Inc. (Altec) is recalling certain 2009-2019 DL/DM, DL/DMB, DH, D/2/3/4, and DC Digger Derrick vehicles. The slope indicator placard card may falsely indicate that the unit could be used without leveling on a 5 degree slope. An operator may improperly set up the unit, making the unit unstable, thus increasing the risk of injury. Altec will notify owners, and issue CSN 719 to owners, instructing them to remove the incorrect placards, free of charge. The recall is expected to begin July 3, 2019. Owners may contact Altec customer service at 1-877-462-5832. Altec's number for this recall is CSN 719.

**19V-365**

Ford Motor Company (Ford) is recalling certain 2019 Ranger vehicles. The fasteners that attach the transmission shifter cable bracket to the transmission may loosen allowing the transmission to be in a different gear than indicated by the gear shift lever position. If the gear shift lever position does not match the actual transmission gear, the vehicle may move in an unexpected direction. Additionally, despite selecting 'Park', if the parking brake is not applied before the vehicle is exited, the vehicle may roll. Either scenario increases the risk of crash or injury. Ford will notify owners, and dealers will inspect and tighten the transmission shift cable bracket fasteners as necessary, and verify the proper transmission shift operation, free of charge. The recall is expected to begin July 1, 2019. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 19S15.

**19V-366**

Daimler Trucks North America LLC (DTNA) is recalling certain 2019 Freightliner 108SD, 114SD, Business Class M2, Cascadia, Western Star 5700, and FCCC XC Chassis vehicles equipped with air disc brakes. The brake caliper mounting bolts may have been insufficiently tightened. Loose brake caliper mounting bolts may

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2019**

*Published June 28, 2019*

reduce the brake effectiveness, increasing the risk of crash. DTNA will notify the owners and affected vehicle manufacturers, and DTNA dealers will inspect and repair the vehicles, free of charge. The recall is expected to begin July 12, 2019. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-816.

**19V-367**

Daimler Trucks North America LLC (DTNA) is recalling certain 2019 Thomas Built Buses Saf-T-Liner C2 equipped with air disc brakes. The brake caliper mounting bolts may have been insufficiently tightened. Loose brake caliper mounting bolts may reduce the brake effectiveness, increasing the risk of crash. DTNA will notify owners, and dealers will inspect and repair the vehicles, free of charge. The recall is expected to begin July 12, 2019. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-816.

**19V-368**

Daimler Trucks North America LLC (DTNA) is recalling certain 2004-2019 Freightliner 108SD, 114SD, 122SD, Cascadia, Columbia, Classic, FL80, FLD 120SD, Business Class M2, Western Star 4700, 4900, 6900, Sterling Acterra, L7500, LT7500, L8500, LT8500, L9500, and LT9500 vehicles. The vehicles may have an insufficient service brake air reservoir capacity. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 121, "Air Brake Systems." An insufficient air reservoir volume may reduce brake effectiveness, increasing the risk of crash. DTNA will notify owners, and dealers will add air reservoir capacity to the affected vehicles. The recall is expected to begin July 12, 2019. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-815.

**19V-370**

Daimler Trucks North America LLC (DTNA) is recalling certain 2012-2019 Freightliner Custom Chassis MT55 and MT45 vehicles. The brake pedal clevis pin clip may rub or bend on the throttle pedal and possibly detach. If the clip is detaches and clevis pin slides out of position, the brake lights may fail. Loss of brake lights may mislead other drivers if they are unaware the vehicle is stopping or slowing down, which increases the risk of crash. If the pin continues to slide out further, the pedal may detach, increasing the risk of crash. DTNA will notify the vehicle manufacturers that purchased these chassis, and DTNA dealers will inspect the clevis pin clearance and correct it as necessary, free of charge. The recall is expected to begin July 12, 2019. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-814.

**19V-371**

Navistar, Inc. (Navistar) is recalling certain 2019 International CV vehicles equipped with Duramax 6.6 liter diesel engines and an optional engine-block heater (feature code 12XBL). The engine block heater cord or the terminals that connect the heater cord to the block heater may short circuit and fail. A short-circuit may damage the engine components and increase the risk of fire. The remedy for this recall is still under development. Navistar issued owners an interim notification on May 31, 2019. A second letter will be mailed when the remedy becomes available. Owners may contact Navistar customer service at 1-800-448-7825. Navistar's number for this recall is 19508.



**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2019**

*Published June 28, 2019*

**19V-372**

Navistar, Inc. (Navistar) is recalling certain 2016-2020 IC CE and 2019 IC RE school buses equipped with Bendix ADB 22X brake calipers. The driver side rear brakes may drag. A dragging brake may cause damage to the brake components, which may activate the ABS warning light. The warning light may cause the driver to immediately stop the vehicle and transfer occupants. Additionally, the high temperatures at the wheel end can increase the risk of a fire. Either condition increases the risk of injury. Navistar will notify owners, and dealers will replace the left rear caliper with a redesigned adjuster mechanism, free of charge. The recall is expected to begin July 14, 2019. Owners may contact Navistar customer service at 1-800-448-7825. Navistar's number for this recall is 19506.

**19V-373**

Navistar, Inc. (Navistar) is recalling certain 2017 IC CE transit buses equipped with Bendix ADB 22X brake calipers. The driver side rear brakes may drag. A dragging brake may cause damage to the brake components, which may activate the ABS warning light. The warning light may cause the driver to immediately stop the vehicle and transfer occupants. Additionally, the high temperatures at the wheel end can increase the risk of a fire. Either condition increases the risk of injury. Navistar will notify owners, and dealers will replace the left rear caliper with a redesigned adjuster mechanism, free of charge. The recall is expected to begin July 14, 2019. Owners may contact Navistar customer service at 1-800-448-7825. Navistar's number for this recall is 19507.

**19V-374**

Corp. Micro Bird Inc. (Micro Bird) is recalling certain 2018-2019 GT and T-Series school buses. The heavy duty solenoid may overheat nearby components, possibly causing them to malfunction. If the nearby components malfunction, the vehicle may unexpectedly stop, increasing the risk of crash. If the nearby components or wiring overheat, there is an increased risk of fire. Micro Bird Corporation will notify owners, and provide field modification instructions and a replacement solenoid, free of charge. The recall is expected to begin July 8, 2019. Owners may contact Micro Bird customer service at 1-819-477-2012. Micro Bird's number for this recall is 19-081-SUS.

**19V-376**

Suzuki Motor of America, Inc. (Suzuki) is recalling certain 2018-2019 Burgman 200/UH200 scooters. The rivet connections may fail and allow the movable drive plate to fall off the Continuously Variable Transmission (CVT). Without the movable driven face, the scooters will stall, increasing the risk of a crash. Suzuki will notify owners, and dealers will replace the movable drive plate, free of charge. The recall began June 5, 2019. Owners may contact Suzuki customer service at 1-714-572-1490. Suzuki's number for this recall is 2A89.

**19V-377**

Honda (American Honda Motor Co.) is recalling certain 2009-2014 Acura TSX, 2011-2013 TSX Sport Wagon, and 2010-2012 ZDX and 2008-2012 Honda Accord, 2010-2011 Accord Crosstour, 2006-2011 Civic, Civic Hybrid and Civic NGV, 2012-2014 Crosstour, 2007-2011 CR-V, 2009-2013 Fit, 2010-2013 Insight, and 2009-2015 Pilot vehicles. The front passenger air bag inflator may have been installed incorrectly during replacement. An incorrectly installed air bag inflator may not properly deploy the passenger frontal air bag

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2019**

*Published June 28, 2019*

in the event of a crash, increasing the risk of injury. Honda will notify owners, and dealers will inspect the inflator installation and, if necessary, replace the passenger frontal air bag module assembly, free of charge. Owners may contact Honda customer service at 1-888-234-2138. Honda's numbers for this recall are M4O, P4R, T4Q, and W4P.

**19V-378**

Newell Coach Corp. (Newell) is recalling certain 2017-2020 P50 motorcoaches. The passenger side wiper arm linkage may be too short, possibly causing the wiper to malfunction and rotate in a downward position. If the wiper rotates in a downward position, visibility through the right side of the windshield may be reduced, increasing the risk of crash. Newell will notify owners, and dealer will inspect and replace the wiper linkage with one that has been properly aligned, if necessary, free of charge. Owners may contact Newell customer service at 1-888-363-9355.

**19V-379**

Entrans International LLC (Entrans) is recalling certain 2017-2020 Heil AJB9-1040 Hybrid trailers. Cracks may develop in the front and rear areas of the frame. A cracking frame may affect vehicle handling, increasing the risk of a crash. Entrans will notify owners, and dealers will add reinforcement to the frames, free of charge. Owners may contact Entrans International customer service at 1-800-400-6913, extension 2978.

**19V-380**

Newmar Corporation (Newmar) is recalling certain 2019 Essex, King Aire, London Aire, Mountain Aire, and 2020 Dutch Star motorhomes. The brake relay valve may have an air flow restriction due to a partially blocked orifice, which may lead to extended stopping distance. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 121, "Air Brake Systems." An increase in stopping distance without warning increases the risk of crash. Newmar will notify owners, and Spartan dealers will inspect and replace the brake relay valve, if necessary, free of charge. The recall began June 20, 2019. Owners may contact Newmar customer service at 1-800-731-8300 or Spartan customer service at 1-800-543-5008. Newmar's number for this recall is 19012.

**19V-381**

Ducati North America (Ducati) is recalling certain 2018-2019 Panigale V4, Panigale V4 S, Panigale Speciale, and 2019 Panigale R motorcycles. Excessive pressure in the fuel tank may cause fuel to spray when opening the fuel cap. Fuel spray can increase the risk of injury and a fuel leak in the presence of an ignition source can increase the risk of a fire. Ducati will notify owners, and dealers will update the fuel cap venting system, provide an updated page for the owner's manual, and affix a warning label decal to the fuel tank, free of charge. The recall is expected to begin July 13, 2019. Owners may contact Ducati customer service at 1-888-391-5446. Ducati's number for this recall is SRV-RCL-19-001. Note: This recall includes motorcycles that may have been previously remedied under recall 18V-238 for a similar issue.

**19V-382**

Honda (American Honda Motor Co.) is recalling certain 2019 CR-V vehicles. The metal core of the steering wheel may have burrs which can damage the harnesses routed within, potentially disabling the driver's air bag or

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2019**

*Published June 28, 2019*

causing it to deploy without warning. In the event of a crash, a disabled air bag would increase the risk of injury. An uncommanded deployment of the driver's air bag also increases the risk of injury and a crash. Honda will notify owners, and dealers will install a protective cover on the steering wheel core and replace clockspring and the harnesses within, free of charge. The recall is expected to begin July 8, 2019. Owners may contact Honda customer service at 1-888-234-2138. Honda's number for this recall is R4S.

**19V-383**

Newmar Corporation (Newmar) is recalling certain 2019 Mountain Aire and Essex motorhomes built on Freightliner XC chassis equipped with air disc brakes. The brake caliper mounting bolts may have been insufficiently tightened. Loose brake caliper mounting bolts may reduce the brake effectiveness, increasing the risk of crash. Newmar will notify owners, and Freightliner dealers will inspect and repair the vehicles, free of charge. The recall began June 20, 2019. Owners may contact Newmar customer service at 1-800-731-8300. Newmar's numbers for this recall are FL-816 and 19V-367.

**19V-384**

Volkswagen Group of America, Inc. (Audi) is recalling certain 2016-2018 Audi Q3 vehicles equipped with LED headlights. An inoperable front turn signal may not illuminate an indicator, failing to alert the driver to the issue. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." Without an indicator informing the driver of an inoperable turn signal, the driver may turn or change lanes without a signal, increasing the risk of crash. Audi will notify owners, and dealers will update the body control module (BCM), free of charge. The recall began June 21, 2019. Owners may contact Audi customer service at 1-800-253-2834. Audi's number for this recall is 97DK.

**19V-385**

BMW of North America, LLC (BMW) is recalling certain 2019 X7 xDrive40i and X7 xDrive50i vehicles. The driver and passenger head air bags may not have been properly aligned with the trim during installation. The head air bags may be impaired during deployment, increasing the risk of injury. BMW will notify owners, and dealers will inspect and, as necessary, reinstall the head air bags, free of charge. The recall is expected to begin July 15, 2019. Owners may contact BMW customer service at 1-800-525-7417.

**19V-386**

General Motors LLC (GM) is recalling certain 2016-2019 Chevrolet Express and GMC Savana vehicles. One or both of the rear-quarter windows may be tempered glass instead of laminated glass. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 226, "Ejection Mitigation." Tempered glass increases the risk of injury in the event of a side impact or rollover crash. GM will notify owners, and dealers will replace the tempered glass windows with laminated glass windows, as necessary, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact GM customer service at 1-586-596-1733. GM's number for this recall is N192218960.

**19V-387**

Keystone RV Company (Keystone) is recalling certain 2018-2020 Fuzion 429 recreational trailers. The wiring

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2019**

*Published June 28, 2019*

harness to the power center may have been pinched between the floor framing and chassis beam, potentially damaging the wiring harness. The damaged wiring harness may short circuit, increasing the risk of a fire. Keystone will notify owners, and dealers will inspect and repair the wiring as needed, free of charge. The recall is expected to begin July 19, 2019. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 19-351.

**19V-388**

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain 2016 Range Rover and Range Rover Sport vehicles. A spring in the Keyless Vehicle Latching System (KV Latch) may get stuck, causing the left hand door to remain unlatched when the door is closed. The unlatched door may open while the vehicle is in motion, increasing the risk of injury or a crash. Land Rover will notify owners, and dealers will replace the left hand side door latch assembly, free of charge. Interim notices informing owners of the safety risk will be mailed July 19, 2019. Owners will receive a second notice when the remedy becomes available. Owners may contact Land Rover customer service at 1-800-637-6837. Land Rover's number for this recall is N336.

**19V-390**

Blue Bird Body Company (Blue Bird) is recalling certain 2015-2020 Vision and All American school buses equipped with Bendix ADB22X air brakes. The driver side rear brakes may drag. A dragging brake may cause damage to the brake components, which may activate the ABS warning light. The warning light may cause the driver to immediately stop the vehicle and transfer occupants. Additionally, the high temperatures at the wheel end can increase the risk of a fire. Either condition increases the risk of injury. Blue Bird will notify owners, and dealers will install a new caliper with an updated clearance adjustment mechanism, free of charge. The recall is expected to begin July 18, 2019. Owners may contact Blue Bird customer service at 1-478-822-2242. Blue Bird's number for this recall is R19AA - SB.

**19V-391**

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain 2013-2016 Ranger Rover and 2014-2016 Range Rover Sport vehicles. Due to a problem with the Keyless Vehicle Latching System (KV Latch), the doors may appear to be closed but may be unlatched. The unlatched door may open while the vehicle is in motion, increasing the risk of a crash. Land Rover will notify owners, and dealers will inspect for any issues with the KV system, disabling the KV mechanisms if necessary, and update the KV Latch software, free of charge. The recall is expected to begin July 19, 2019. Owners may contact Land Rover customer service at 1-800-637-6837. Land Rover's number for this recall is N335. Note: Vehicles in this recall were previously recalled under recall number 15V-385 and need to be remedied again.

**19V-392**

Blue Bird Body Company (Blue Bird) is recalling certain 2016-2020 Vision and 2015-2020 All American non-school buses equipped with ADB22X disc brakes. The driver side rear brakes may drag. A dragging brake may cause damage to the brake components, which may activate the ABS warning light. The warning light may cause the driver to immediately stop the vehicle and transfer occupants. Additionally, the high temperatures at the wheel end can increase the risk of a fire. Either condition increases the risk of injury. Blue Bird will notify owners, and dealers will install a new caliper with an updated clearance adjustment mechanism, free of charge.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2019**

*Published June 28, 2019*

The recall is expected to begin July 18, 2019. Owners may contact Blue Bird customer service at 1-478-822-2242. Blue Bird's number for this recall is R19AA - NSB.

**19V-393**

Forest River, Inc. (Forest River) is recalling certain 2017-2019 Shasta Revere SHT32FE recreational trailers. The liquid propane (LP) gas line may have been improperly installed through the wheel-well, allowing the gas line to be damaged by road debris kicked up by the tires. A damaged LP gas line may leak, increasing the risk of a fire. Forest River will notify owners, and dealers will re-reroute the LP gas line so that road debris cannot damage it, free of charge. The recall began June 19, 2019. Owners may contact Forest River customer service at 1-574-825-8717. Forest River's number for this recall is 53-0995.

**19V-394**

Forest River, Inc. (Forest River) is recalling certain 2018-2019 Starcraft All Star XL vehicles equipped with diesel engines with fuel module option number FS90301 or FS90453. The electric fuel heater within the fuel module may overheat and cause plastic in the fuel heater to melt and potentially catch fire. It may also lead to engine stalling. A fire increases the risk of injury. An engine stall can increase the risk of a crash. The remedy for this recall is still under development. The recall is expected to begin June 17, 2019. Owners may contact Forest River customer service at 1-800-348-7440 or Cummins customer service at 1-800-286-6467. Forest River's number for this recall is 05-1021.

**19V-395**

Keystone RV Company (Keystone) is recalling certain 2019-2020 Dutchmen Voltage trailers, model 4185. An 18,000 lb.-capacity fifth wheel pin box may have been installed instead of the specified 21,000 lb-capacity pin box hitch. If the vehicle is loaded to a weight greater than 18,000 lbs, the pin box may fail, increasing the risk of crash. Keystone will notify owners, and dealers will replace the pin box inner with a pin box inner rated for 21,000 lbs, free of charge. The recall began June 18, 2019. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 19-354.

**19V-396**

Airstream, Inc. (Airstream) is recalling certain 2017-2020 Basecamp trailers. The Tire Placard is lacking the trailer's spare tire information. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selections and Rims." The lack of information on the Tire Placard may lead an owner to unintentionally install the wrong size spare tire, affecting the vehicle control and handling, increasing the risk of crash. Airstream will notify owners, and will provide corrected labels, free of charge. The recall is expected to begin July 23, 2019. Owners may contact Airstream customer service at 1-877-596-6505 or 1-937-596-6111 extension 7401 or 7411.

**19V-397**

LGE Coachworks, Inc. (LGE Coachworks) is recalling certain 2018-2019 Ford E-450, F-550, and Freightliner M2-based vehicles equipped with ASA Electronics Voyager back-up camera displays. The displays may unexpectedly revert back to the factory default settings which may cause the camera image to be reversed. The driver may inadvertently turn the wrong direction to avoid an object behind the vehicle, increasing the risk of a

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2019**

*Published June 28, 2019*

crash. ASA will notify LGE Coachworks owners, and dealers will replace the displays, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact ASA customer service at 1-800-384-4400 or LGE Coachworks at 1-800-209-3985.

**19V-398**

ITI Trailers And Truck Bodies, Inc. (ITI) is recalling certain 2018-2019 HINO 268 and 338-based vehicles equipped with ASA Electronics Voyager back-up camera displays. The displays may unexpectedly revert back to the factory default settings which may cause the camera image to be reversed. The driver may inadvertently turn the wrong direction to avoid an object behind the vehicle, increasing the risk of a crash. ITI will work with ASA to notify the affected owners and will provide a harness relay capacitor module to correct the issue, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact ASA Electronics customer service at 1-800-384-4400 or ITI Trailers And Truck Bodies at 1-814-634-0080.

**19V-399**

PL Custom Emergency Vehicles Co. (PL Custom Emergency Vehicles) is recalling certain 2017-2019 Titan Type I and Type III ambulances equipped with ASA Electronics Voyager monitors used to display the back-up camera image. The monitors may unexpectedly revert back to the factory default settings which may cause the camera image to be reversed. The driver may inadvertently turn the wrong direction to avoid an object behind the vehicle, increasing the risk of a crash. PL Custom Emergency Vehicles will work with ASA to notify the affected owners and remedy the displays, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact ASA Electronics customer service at 1-800-384-4400 or PL Custom Emergency Vehicles at 1-732-233-1411.

**19V-400**

VCI Emergency Vehicle Specialists (VCI) is recalling certain 2017-2018 Ford F-550, 2014 E-350 and E-450, 2015 F-250 and F-450, 2016 E-450, 2017 E-350, F-450 and E-450, 2018 F-350, 2010 E-450, 2005-2006 E-450, 2009 E-450 and Chevrolet C4500-based Type I and Type III ambulances equipped with ASA Electronics Voyager monitors used to display the back-up camera image. The monitors may unexpectedly revert back to the factory default settings which may cause the camera image to be reversed. The driver may inadvertently turn the wrong direction to avoid an object behind the vehicle, increasing the risk of a crash. VCI Emergency Vehicle Specialists will work with ASA to notify the owners, and remedy the displays, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact ASA Electronics at 1-800-384-4400.

**19V-401**

Mazda North American Operations (Mazda) is recalling certain 2018 CX-9 vehicles. The wiring harness may disrupt electrical communications and disable the passenger frontal air bag, turn signals, and/or engine starting system. The passenger frontal air bag may not deploy, increasing the risk of injury. Inoperable turn signals prevent the driver from signaling to other drivers, increasing the risk of crash. Mazda will notify owners, and dealers will repair the wiring harnesses, free of charge. The recall is expected to begin on or before July 29, 2019. Owners may contact Mazda customer service at 1-800-222-5500, Option 4. Mazda's number for this recall is 3419E.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2019**

*Published June 28, 2019*

**19V-403**

Subaru of America, Inc. (Subaru) is recalling certain 2019 Crosstrek vehicles. The driver's side rear-door window glass may be improperly tempered. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 205, "Glazing Materials." Improperly tempered glass can shatter into large pieces, increasing the risk of injury. Subaru will notify owners, and dealers will replace the driver's side rear-door window glass, free of charge. The recall began June 11, 2019. Owners may contact Subaru customer service at 1-844-373-6614. Subaru's number for this recall is WUG-92.

**19V-404**

Jayco, Inc. (Jayco) is recalling certain 2020 Greyhawk motorhomes. The brake relay valve may have an air flow restriction due to a partially blocked orifice, which may cause to extended stopping distance. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 121, "Air Brake Systems." An increase in stopping distance without warning increases the risk of crash. Spartan will notify Jayco owners, and Spartan dealers will inspect and replace the brake relay valve, if necessary, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Spartan customer service at 1-800-543-5008 or Jayco at 1-800-517-9137.

**19V-406**

Chrysler (FCA US LLC) is recalling certain 2019-2020 Ram 1500 vehicles. The flash memory of the Occupant Restraint Controller (ORC) may become corrupted, disabling the vehicle's air bags and seat belt pretensioners. Disabled air bags and seat belt pretensioners increase the risk of injury in the event of a crash. Chrysler will notify owners, and dealers will reprogram the ORC or replace it as necessary, free of charge. The recall began June 20, 2019. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's numbers for this recall are V61 and V71.

**19V-407**

Karma Automotive (Karma) is recalling certain 2018 Karma Revero vehicles. The upper intrusion bar within the front left door may be split. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 214, "Side Impact Protection." The split metal may compromise the vehicle's strength reducing the side-impact protection and increasing the risk of injury. Karma will notify owners, and dealers will inspect all of the front doors and replace them as necessary, free of charge. The recall is expected to begin July 12, 2019. Owners may contact Karma customer service at 1-855-288-6109. Karma's number for this recall is RC-19-70-01.

**19V-408**