

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2017**

Published August 11, 2017

CHILD SEATS:

Britax Child Safety, Inc. (Britax) is recalling certain B-Safe 35, B-Safe 35 Travel Systems, B-Safe 35 Elite, B-Safe 35 Elite Travel Systems and BOB B-Safe rear-facing infant child safety seats, model numbers E1A183F, E1A185M, E1A185P, E1A186R, E1A203F, E1A205M, E1A205P, E1A206X, E1A206Z, E1A207E, E9LU65V, E9LU66X, E9LU66Z, E9LU67D, E9LU67E, EXA185M, S02063600, S02063700, S03803400, S03803500, S03803700, S03803800, S03803900, S04144400, S04144500, S04144600, S04145000, S04402800, S04884200, S04884300, S04975600, S04978900, S05260200, S06020300, S06020400, S06020500, S06020600, S06020700, S06020800, S06020900, S06147100, S921800, E1A215T, E1A215U, E1A216P, E1A221Q, E1A225C, E1A225U, E1A226L, E9LS51Q, E9LS56C, E9LS56L, E9LS57F, E9LS57G, E9LS57H, EXA216L, S01298600, S02063800, S02063900, S02064000, S04281200, S04281300, S04628500, S06018800, S06020000, S06020200, S923700, E9LT34A, E9LT34C, E9LT35X and EXLT34A. The affected child safety seats have a center tab on the chest clip marked "ABS" that may break. The broken tab may present a choking hazard to an infant in the car seat, increasing the risk of injury. Britax will notify owners and will provide a replacement chest clip marked "PC", free of charge. The recall began on June 21, 2017. Owners may contact Britax at 1-833-474-7016 or visit www.bsaf35clip.com.

17C-002

EQUIPMENT:

Cummins, Inc. (Cummins) is recalling certain X15 heavy duty diesel engines used in trucks, fire trucks and recreational vehicles. The affected engines have a fuel pump whose drive gear may slip on its drive shaft, resulting in a loss of fuel pump function. Failure of the fuel pump will result in an engine stall, increasing the risk of a crash. Cummins will notify the vehicle manufacturers that purchased engines that used the affected fuel pumps. Cummins will send notices to the owners of the affected engines and Cummins dealers will replace the fuel pumps, free of charge. The recall is expected to begin August 18, 2017. Owners may contact Cummins customer service at 1-800-286-6467. Cummins' number for this recall is C1909.

17E-029

Wilwood Engineering (Wilwood) is recalling certain 7/8" Tandem Master Cylinder brakes, part numbers 260-9439, 260-12900, 261-13271 (with proportioning valve) and 261-13272 (with proportioning valve). The brake master cylinder seal in the front brake circuit may deform, resulting in a loss of braking in the front circuit. An unexpected loss of front brake pressure may increase the risk of a crash. Wilwood will notify owners and will replace the piston and piston seal assemblies or exchange the master cylinders for rebuilt ones, free of charge. The recall began on July 7, 2017. Owners may contact Wilwood at 1-805-384-2270 or customercare@wilwood.com. Wilwood's number for the recall is R17-01MC.

17E-030

Continental Automotive Systems, Inc. (Continental) is recalling certain fuel pump flanges sold for use in Volkswagen, Audi and Porsche vehicles. The flange may crack allowing fuel to leak. Fuel leakage in the presence of an ignition source, may increase the risk of a fire. Continental will notify the vehicle and tank component manufacturers that purchased similar fuel pump flanges. Volkswagen, Audi and Porsche are already

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2017**

Published August 11, 2017

conducting recall campaigns to address the affected cracking fuel pump flanges. Owners may contact Continental at 1-248-393-5300.

17E-031

TIRES:

GITI Tire (USA) Ltd. (GITI) is recalling certain Primewell Valera Touring II replacement passenger car tires, sizes 185/65R14 86H, 195/60R15 88H, 205/55R16 91H, 205/60R16 92V, 215/60R17 96H, and 235/60R17 102T. The affected tires may develop cracks in the lower sidewall, potentially resulting in a loss of air. A loss of air pressure may result in sudden tire failure, increasing the risk of a crash. GITI will notify owners, and dealers will replace the affected tires, free of charge. The recall began on July 31, 2017. Owners may contact GITI customer service at 1-866-488-4737.

17T-013

VEHICLES:

Mazda North America Operations (Mazda) is recalling certain model year 2004-2008 RX-8 vehicles. Heat from the engine and the exhaust may cause the main fuel pump pipe to crack. If the fuel pump pipe cracks, fuel may leak, increasing the risk of a fire. Mazda will notify owners, and dealers will replace the fuel pump filter kit, free of charge. Owners may contact Mazda customer service at 1-800-222-5500. Mazda's number for this recall is 1017E.

17V-354

Mazda North American Operations (Mazda) is recalling certain 2004 Mazda RX-8 vehicles. The ball joint socket on the front suspension lower control arm may crack and the ball joint may separate from the socket. If the ball joint separates, steering control may be lost, increasing the risk of a crash. Mazda will notify owners, and dealers will replace the front lower control arms, free of charge. Owners may contact Mazda customer service at 1-800-222-5500. Mazda's number for this recall is 1117E.

17V-355

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain 2016-2017 Tacoma vehicles equipped with a six-cylinder engine. The affected vehicles have a crank position sensor that may malfunction, potentially resulting in an engine stall. An engine stall may increase the risk of a crash. Toyota will notify owners, and dealers will replace the crank position sensor with an improved design, free of charge. The recall began July 26, 2017. Owners may contact Toyota customer service at 1-800-331-4331. Toyota's number for this recall is H0H.

17V-356

Polaris Industries, Inc. (Polaris) is recalling certain 2015-2017 Slingshot vehicles. The affected vehicles previously had their rear swingarms replaced during the remedy of NHTSA recall number 16V-255. The replacement swingarms may have been installed without the sealing grommets installed, potentially resulting in road debris contaminating the rear wheel speed sensor. Contamination of the rear speed sensor will disable the

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2017**

Published August 11, 2017

ABS and Traction/Stability Control, increasing the risk of a crash. Polaris will notify owners, and dealers will inspect the swingarms for missing grommets, installing them as necessary, free of charge. The recall began June 13, 2017. Owners may contact Polaris customer service at 1-888-704-5290. Polaris' number for this recall is T-17-04.

17V-357

Hyundai Motor America (Hyundai) is recalling certain 2013-2017 Santa Fe and Santa Fe Sport vehicles. In the affected vehicles, the secondary hood latch actuating cable may corrode and bind, causing the secondary hood latch to remain in the unlatched position when the hood is closed. If the hood is not securely closed or the primary latch is inadvertently released and the secondary latch is not engaged, the hood could unexpectedly open while driving, increasing the risk of a vehicle crash. Hyundai will notify owners, and dealers will replace the secondary latch cable, free of charge. Owner's may contact Hyundai customer service at 1-855-671-3059. Hyundai's number for the recall is 163.

17V-358

Hyundai Motor America (Hyundai) is recalling certain 2015-2016 Sonata and Genesis vehicles. In the affected vehicles, the warning light to indicate that the parking brake is applied may intermittently not illuminate in the dash due to corrosion in the switch. If the parking brake indicator is not illuminated when the parking brake is applied, the driver may operate the vehicle with the parking brake partially engaged, increasing the risk of a crash. Hyundai will notify owners, and dealers will replace the parking brake switch, free of charge. Owners may contact Hyundai customer service at 1-855-671-3059. Hyundai's number for this recall is 164.

17V-359

Motor Coach Industries (MCI) is recalling certain 2014-2017 J4500 motor coaches equipped with ZF front axles. In the affected vehicles, the front brake hose routing clamps may have been over-tightened, possibly damaging the brake hose wall reinforcement. If the brake hose wall reinforcement is damaged, the brake hose may leak. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 121, "Air Brake Systems." If the front brake hoses leak, the distance needed to stop the vehicle may be lengthened, increasing the risk of a crash. MCI will notify owners, and dealers will inspect the clamp tightness, replacing any damaged brake hoses, as necessary, free of charge. The recall began on July 14, 2017. Owners may contact MCI customer service at 1-800-241-2947. MCI's number for this recall is SB 454.

17V-360

McNeilus Truck & Manufacturing, Inc. (McNeilus) is recalling certain 2016-2017 Bridgmaster V concrete mixers, equipped with both FLEX Controls and an optional broadband backup alarm. The backup camera display may shut off and the alarm may stop sounding if the truck is in reverse for an extended period of time. If the backup alarm stops emitting the alarm sound when the truck is still reversing, others may not be alerted that the truck is backing up, increasing the risk of personal injury. McNeilus has notified owners, and dealers will add a relay into the electrical circuit for the backup alarm system, free of charge. Owners may contact McNeilus customer service at 1-507-374-6321.

17V-361

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2017**

Published August 11, 2017

Thor Motor Coach (Thor) is recalling certain 2017 Challenger 37YT motorhomes. The exhaust pipe from the onboard gasoline generator may be mislocated or missing completely on the subject vehicles. Without a correctly installed generator exhaust pipe, there may be a buildup of carbon monoxide within the interior of the vehicle, increasing the risk of personal injury or death. TMC will notify owners, and dealers will inspect the motorhomes for proper generator exhaust installation and routing, replacing or reinstalling the exhaust, as necessary, free of charge. The recall began on August 3, 2017. Owner's may contact TMC customer service at 1-877-500-1020. TMC's number for this recall is RC000138.

17V-362

EIDorado Mobility is recalling certain 2010-2017 Amerivan 10" vehicles equipped with air suspension. The rear suspension air bags may fail unexpectedly. A loss of rear suspension from air bag failure can adversely affect the control of the vehicle, increasing the risk of a crash. EIDorado Mobility will inspect and repair the rear suspension air bags, free of charge. The recall will begin in August 2017. Owners may contact EIDorado Mobility customer service at 1-866-392-6300.

17V-363

Daimler Vans USA, LLC (DVUSA) is recalling certain 2016 Mercedes-Benz Sprinter 2500 and 3500 vehicles equipped with reinforced front axles. The affected vehicles have tire labels on the B-pillar that list a tire pressure that is too low. Operating the vehicle with low front tire pressures may result in tire damage, increasing the risk of a crash. DVUSA will notify owners, Freightliner Sprinter and Mercedes-Benz dealers will check and replace the tire label, as necessary, free of charge. The recall began on August 5, 2017. Owners may contact DVUSA customer service at 1-877-762-8267.

17V-364

Hyundai Motor America (Hyundai) is recalling certain 2017 Santa Fe Sport vehicles. In the affected vehicles, the bolt for the driver's seat belt anchor might not have been sufficiently tightened during assembly. If the bolt was not sufficiently tightened, driver's seat belt may come unanchored in a collision, increasing the risk of injury to the occupant. Hyundai will notify owners and dealers will verify that the driver's seatbelt anchor is properly secured, free of charge. The recall began July 7, 2017. Owner's may contact Hyundai customer service at 1-800-633-5151. Hyundai's number for the recall is 165.

17V-365

Forest River, Inc. (Forest River) is recalling certain 2016-2017 XLR ToyHauler recreational trailers, models XLT23KW and WZXLT23KW. These vehicles were built with axle equalizers that are too long. An equalizer that is too short in length may cause a failure of the equalizer and/or axle springs, resulting in a possible loss of vehicle control and increasing the risk of a crash. Forest River will notify owners, and dealers will install the correct equalizers, free of charge. The recall began on June 28, 2017. Owners may contact Forest River customer service at 1-574-642-0432. Forest River's number for this recall is 45-05312017-0415.

17V-366

Vactor Manufacturing (Vactor) is recalling certain 2015-2017 Vactor Jetter vehicles. In certain conditions, the idle may unexpected rise, allowing the affected vehicles to over power the parking brake. If the parking brake

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2017**

Published August 11, 2017

cannot keep the vehicle stationary, there would be an increased risk of a crash. Vactor has notified the affected owners, and dealers will install diodes to keep the idle from rising, free of charge. The recall began on August 8, 2017. Owners may contact Vactor customer service at 1-847-622-7069.

17V-367

Porsche Cars North America, Inc. (Porsche) is recalling certain 2010-2012 Panamera S, Panamera 4S and Panamera Turbo vehicles, 2011-2012 Panamera and Panamera 4 vehicles, and 2011 Cayenne S and Cayenne Turbo vehicles. The affected vehicles have camshaft controllers that may come loose inside the engine, potentially resulting in an engine stall. An engine stall can increase the risk of a crash. Porsche will notify owners, and dealers will replace the fastening screws for the camshaft adjusters, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Porsche customer service at 1-800-767-7243. Porsche's number for this recall is AH08.

17V-368

Supreme Corporation (Supreme) is recalling certain 2007-2017 Signature Van and Kold King vehicles equipped with oval taillights installed in the rear corner posts. The affected vehicles have rear reflex reflectors that may have been mounted more than 60 inches above the road surface. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." A reflector that is mounted too high may not be effectively illuminated by headlights at night, increasing the risk of a crash. Supreme will notify owners, and will provide new rear reflex reflectors for any vehicle whose existing reflector height exceeds 60 inches, free of charge. Owners may contact Supreme customer service at 1-800-642-4889.

17V-369

Volvo Car USA LLC (Volvo) is recalling certain 2017 XC90 vehicles. The Micro Gas Generator (MGG), a subcomponent part used within the right hand side seat belt retractor for the third row seats, may detach after the seatbelt retractor pretensioner is deployed. Although, the seat belt will operate as intended in the event of a crash, if the MGG detaches, it may be a projectile within the vehicle cabin, increasing the risk of injury. Volvo will notify owners, and dealers will replace the third row passenger's side seatbelt retractor, free of charge. Owners may contact Volvo customer service at 1-800-458-1552. Volvo's number for this recall is R89716.

17V-370

Chrysler (FCA US LLC) is recalling certain 2017 Pacifica Plug-in Hybrid Electric vehicles (PHEV). The affected vehicles have diodes in the Power Inverter Module ("PIM") that may fail due to an overvoltage condition. If the diodes fail, the vehicle will not move under its own power. A vehicle that suddenly cannot be driven, increases the risk of a crash. Chrysler has not yet finalized its remedy plans for this recall. The recall began on July 28, 2017. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is T34.

17V-371

Chrysler (FCA US LLC) is recalling certain 2017 Pacifica Plug-in Hybrid Electric vehicles (PHEV). The tire placard on the affected vehicles incorrectly lists the seating capacity as 6 occupants rather than 7 occupants, with

SAFETY DEFECT/NONCOMPLIANCE NOTICES

RECEIVED DURING JUNE 2017

Published August 11, 2017

a combined weight of 950lbs rather than 1,100lbs. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims." The incorrect tire label may cause customer confusion, potentially resulting in vehicle overloading, increasing the risk of a crash. Chrysler will notify owners, and dealers will replace tire placard label, free of charge. The recall began July 6, 2017. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is T37.

17V-375

Chrysler (FCA US LLC) is recalling certain 2011-2012 Dodge Grand Caravan vehicles. In the affected vehicles, the driver's frontal air bag may unexpectedly deploy if the air bag wiring harness gets chafed within the steering wheel and short circuits. Unexpected deployment of the driver's frontal air bag increases the risk of a crash or driver injury. Chrysler will notify owners, and dealers will inspect the air bag wiring within the steering wheel, replacing it if necessary. A protective cover will also be installed. These repairs will be made free of charge. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is T33.

17V-376

BMW of North America, LLC (BMW) is recalling certain 2017-2018 M760Li xDrive vehicles. The affected vehicles may have had incorrect engine oil cooler line installed, causing an oil leak in the engine compartment. If oil leaks onto the front brake discs, a greater distance may be needed to stop the vehicle, increasing the risk of a crash. BMW will notify owners, and dealers will replace the engine oil cooler line, free of charge. Owners may contact BMW customer service at 1-800-525-7417. Note: This recall supersedes recall 17V-240.

17V-377

Newmar Corporation (Newmar) is recalling certain 2012-2015 King Aire and Essex motorhomes built on a Spartan Motors chassis. A component within the starter motor may break, potentially resulting in the starter motor overheating or drawing excessive current. A starter motor that overheats may increase the risk of a fire. Newmar will notify owners, and Spartan Motors dealers will replace the starter, free of charge. The recall began on July 28, 2017. Owners may contact Spartan Motors at 1-800-543-4277 or Newmar customer service at 1-800-731-8300. Newmar's number for this recall is 17012.

17V-378

BMW of North America, LLC (BMW) is recalling certain 2013-2015 740i, 740Li, 740Lxi, 750i, 750xi, 750Li and 750Lxi and 2014 ActiveHybrid 7 vehicles. The affected vehicles may have received incorrect replacement left rear taillight assemblies. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." Vehicles with the incorrect left rear lamp assemblies may be less conspicuous to other drivers, possibly increasing the risk of a crash. BMW will notify owners, and dealers will inspect the vehicles and replace any incorrect left rear taillight assemblies, free of charge. Owners may contact BMW customer service at 1-800-525-7417.

17V-379

Piaggio Group Americas, Inc. (Piaggio) is recalling certain 2017 Moto Guzzi V7 III Racer 750, V7 III Stone

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2017**

Published August 11, 2017

750, V7 III Special 750, and 2016-2017 V9 Bobber, V9 Roamer motorcycles. The front ABS brake hose may rub against the engine's secondary air system connection, possibly resulting in a brake fluid leak. A loss of brake fluid can lengthen the distance needed to stop the motorcycle, increasing the risk of a crash. Piaggio will notify owners, and dealers will secure the front ABS brake hose to prevent it from rubbing. Any hose that has already been damaged, will be replaced. The repairs will be made free of charge. The recall began June 22, 2017. Owners may contact Piaggio customer service at 1-212-380-4433.

17V-380

Thor Motor Coach (Thor) is recalling certain 2018 Outlaw 29H motorhomes. The affected vehicles were built incorrectly with a 15 amp fuse for the awning light instead of a 2 amp fuse. If the awning light circuit short circuits, the incorrect fuse may increase the risk of a fire. TMC will notify owners, and dealers will replace the 15 amp fuse with a 2 amp fuse, free of charge. The recall began on August 9, 2017. Owner's may contact TMC customer service at 1-877-500-1020. TMC's number for this recall is RC000143.

17V-381

General Motors LLC (GM) is recalling certain 2014-2016 Chevrolet SS vehicles. Corrosion of the connector between the electric power steering module and the torque sensor connector may cause a loss of electric power steering assist. A greater steering effort would be needed to control the vehicle if power steering is lost, increasing the risk of a crash. GM will notify owners, and dealers will inspect the steering gear assembly, replacing it as necessary, free of charge. The recall began August 2, 2017. Owners may contact Chevrolet customer service at 1-800-222-1020. GM's number for this recall is 17248.

17V-382

Triple E Recreational Vehicles (Triple E) is recalling certain 2016-2017 Wonder motorhomes, model W24MB. The frame extension adapter may be missing some supplemental attaching bolts. Without the supplemental bolts, if the trailer towing capacity is reached or exceeded, there maybe a distortion in the vehicle frame and/or frame extension structure, affecting the vehicle control and increasing the risk if a crash. Triple E will notify owners, and dealers will install the 4 (four) supplemental M12 X 90MM grade 10.9 bolts, free of charge. The recall began on July 4, 2017. Owners may contact Triple E customer service at 1-877-992-9906. Triple E's number for this recall is CA #8645-1.

17V-383

Entegra Coach (Entegra) is recalling certain 2012-2015 Cornerstone motorhomes built on a Spartan Motors chassis. A component within the starter motor may break, potentially resulting in the starter motor overheating or drawing excessive current. A starter motor that overheats may increase the risk of a fire. Entegra will notify owners, and Spartan Motors service centers will replace the starter, free of charge. The recall began on July 24, 2017. Owners may contact Spartan customer service at 1-800-543-4277 or Entegra customer service at 1-800-517-9137.

17V-384

Starcraft RV (Starcraft) is recalling certain Launch Outfitter 24RLS (UT) travel trailers equipped with the sleeper/tri-fold sofa or theater seating. The electrical outlet between the sleeper/tri-fold sofa seating does not

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2017**

Published August 11, 2017

have Ground Fault Circuit Interrupter protection. An outlet that is not GFCI protected near a sink may increase the risk of an electrical shock. Starcraft will notify owners, and dealers will replace the outlet with a GFCI protected outlet, free of charge. The recall began on June 29, 2017. Owners may contact Starcraft customer service at 1-800-945-4787. Starcraft's number for this recall is 9902356.

17V-385

BYD Coach & Bus (BYD) is recalling certain 2015-2016 K7 M buses. The affected vehicles have wiper arms that can crack where they mount to the wiper motor causing the wiper arms to bend or detach from the vehicle. A loss of wiper function can reduce the driver's visibility, increasing the risk of a crash. BYD has notified the owners, and dealers will inspect the vehicles and replace the windshield wiper mounts, as necessary, free of charge. The recall began on June 19, 2017. Owners may contact BYD customer service at 1-661-940-3250.

17V-386

KZRV, L.P. (KZRV) is recalling certain 2018 Sportsmen Classic, Spree, Connect, Durango, SportTrek, Spree Escape, Venom, and Sportsmen Sportster recreational trailers. The Federal Certification label on these vehicles does not contain the manufacturing date. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." In the event of a vehicle safety recall, the missing production date may prevent owners from determining if the recall affects them, increasing their risk of injury or a crash. KZRV will notify owners and provide a corrected Federal Certification label, free of charge. The recall began June 27, 2017. Owners may contact KZRV customer service at 1-800-768-4016 extension 154 or 153. KZRV's number for this recall is KZ-2017-03.

17V-387

KTM North America, Inc. (KTM) is recalling certain 2016-2017 KTM 690 Duke motorcycles. The affected motorcycles may leak fuel from filler cap area of the fuel tank. A fuel leak increases the risk of fire or injury to the rider. A remedy plan has not yet been determined nor has the manufacturer provided a notification schedule. Customers may contact KTM customer service at 1-888-985-6090.

17V-388

Aston Martin The Americas (Aston Martin) is recalling certain 2011-2012 V8 Vantage vehicles. The affected vehicles received updated transmission and engine control software which may conflict with the pre-existing clutch settings and may cause the transmission to shift to neutral, or enable clutch protection mode which give abrupt gear shifts. If the transmission shifts into neutral or does not operate as intended, there is an increased the risk of a crash. Aston Martin will notify owners, and dealers will reinstall clutch system software, free of charge. Owners may contact Aston Martin customer service at 1-949-379-3100. Aston Martin's number for this recall is RA-07-0022.

17V-389

Aston Martin The Americas (Aston Martin) is recalling certain 2012 V8 Vantage vehicles equipped with 6-speed Auto-Shift Manual (ASM) transmissions. A connector for the transmission fluid lines may break resulting in a hydraulic fluid leak. The loss of hydraulic fluid may prevent the vehicle from shifting out of the gear that it is in. Additionally, if the vehicle is being driven when the fluid level significantly drops, the transmission may shift to

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2017**

Published August 11, 2017

an emergency neutral as the vehicle comes to a stop. If the driver ignores the dash warning message and exits the vehicle without applying the parking brake, the vehicle may roll away. Either condition increases the risk of a crash. Aston Martin will notify owners, and dealers will replace the clutch pipe, connector assembly, and related brackets, free of charge. Owners may contact Aston Martin customer service at 1-949-379-3100. Aston Martin's number for this recall is RA-07-0023.

17V-390

Aston Martin the Americas (Aston Martin) is recalling certain 2011-2014 V8 Vantage vehicles equipped with 7-speed Auto-Shift Manual (ASM) "SportShift II" transmissions. A connector for the clutch fluid line may break, resulting in a hydraulic fluid leak. The loss of hydraulic fluid may prevent the vehicle from shifting out of the gear that it is in. Additionally, if the vehicle is being driven when the fluid level significantly drops, the transmission may shift to an emergency neutral as the vehicle comes to a stop. If the driver ignores the dash warning message and exits the vehicle without applying the parking brake, the vehicle may roll away. Either condition increases the risk of a crash. Aston Martin will notify owners, and dealers will install a support bracket to hold pipe securely in position, free of charge. Owners may contact Aston Martin customer service at 1-949-379-3100. Aston Martin's number for this recall is RA-07-0024.

17V-391

Pleasure Way Industries Ltd (Pleasure Way) is recalling certain 2017 Lexor TS motorhomes. The affected vehicles have a mirror attached to the back of the closet door that may detach unexpectedly. The falling mirror may increase the risk of injury. Pleasure Way will notify owners, and dealers will attach the mirror with clips instead of just adhesive, free of charge. The recall began on June 29, 2017. Owners may contact Pleasure Way customer service at 1-800-364-0189.

17V-392

Mazda North American Operations (Mazda) is recalling certain 2014-2015 Mazda6 and 2014-2016 Mazda3 vehicles. Water could possibly enter the brake caliper causing the parking brake actuator shaft to corrode and possibly bind. If the parking brake actuator shaft binds, the parking brake may not engage or disengage fully. If the parking brake does not engage properly, the vehicle may move unexpectedly if it is parked on a slope, increasing the risk of a crash. Mazda will notify owners, and dealers will check the parking brake actuator shafts, replacing any that are corroded, free of charge. The recall is expected to begin August 21, 2017. Owners may contact Mazda customer service at 1-800-222-5500. Mazda's number for this recall is 1217F.

17V-393

Jaguar Land Rover North America, LLC (Jaguar) is recalling certain 2010-2011 XJ vehicles. If, while servicing the vehicle, the vehicle does not successfully receive an update to the Restraint Control Module (RCM) software, the default air bag calibration settings may be incorrect. In the event of a crash, the incorrect calibration may not activate the air bag deployment as intended, increasing the risk of injury. Jaguar will notify owners, and dealers will update the RCM with the latest software, free of charge. The recall is expected to begin on August 18, 2017. Owners may contact Jaguar customer service at 1-800-452-4827. Jaguar's number for this recall is H034.

17V-394

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2017**

Published August 11, 2017

Forest River, Inc. (Forest River) is recalling certain 2014-2015 Coachmen RV Encounter recreational vehicles, and 2014-2018 Coachmen RV Mirada and Mirada Select recreational vehicles equipped with the residential refrigerator option instead of the standard refrigerator. The unused, but powered, wiring for the standard refrigerator was left with exposed wire ends. If the energized positive wire and negative wire make contact, the wires may short circuit and possibly melt, increasing the risk of a fire. Forest River will notify owners, and dealers will disconnect the positive and negative wires from the battery, free of charge. The recall began on August 3, 2017. Owners may contact Forest River customer service at 1-574-825-8212. Forest River's number for this recall is 310-06212017-0455.

17V-396

Honda (American Honda Motor Co.) is recalling certain 2018 Honda Odyssey vehicles. The seat belt tongue for the third row center seating position may not be compatible with the latch, preventing the seat belt from latching securely. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 208, "Occupant Crash Protection." If in the event of a crash, the seat belt cannot restrain the occupant they have an increased risk of being injured. Honda will notify owners, and dealers will inspect the third row center seat belt to make sure that it has the correct tongue, replacing the seat belt, if necessary, free of charge. The recall began July 31, 2017. Owners may contact Honda customer service at 1-888-234-2138. Honda's number for this recall is KF7.

17V-397

Ford Motor Company (Ford) is recalling certain 2016 Ford Escape vehicles. The driver's knee airbag modules installed in these vehicles were produced without the inflator gas generant material, and, as a result, the air bags may not inflate properly in the event of a crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 208, "Occupant Crash Protection." In the event of a crash, if the driver's knee air bag does not inflate as intended, the driver has an increased risk of injury. Ford will notify owners, and dealers will replace driver's knee air bag, free of charge. The recall is expected to begin August 18, 2017. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 17C11.

17V-398

Transportation Collaborative, Inc. (Transportation Collaborative) is recalling certain 2012-2017 Transtech Bus ST Aero, SST, CST, Horizon, and RoadStar transit buses equipped with Bus-Air air conditioning systems. These air conditioning systems use a 30AMP in-line fuse that may short against the screw that secures the fuse holder. If the fuse short circuits, the holder may overheat and melt, increasing the risk of a fire. Transportation Collaborative will notify owners, and dealers will install an in-line mini fuse holder, free of charge. The recall is scheduled to begin during August 2017. Owners may contact Transportation Collaborative customer service at 1-845-988-0419.

17V-399

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2016-2017 Audi Q3 vehicles. If the parking brake is used during emergency braking, the brake lights on the vehicle will not activate. As such, these vehicles fail to comply with Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective

SAFETY DEFECT/NONCOMPLIANCE NOTICES

RECEIVED DURING JUNE 2017

Published August 11, 2017

Devices, and Associated Equipment." A vehicle approaching from behind may not have any warning that the vehicle is stopping, increasing the risk of a crash. Audi will notify owners, and dealers will update the vehicle software, free of charge. The recall began July 31, 2017. Owners may contact Audi customer service at 1-800-253-2834. Volkswagen's number for this recall is 45G6.

17V-400

Ford Motor Company (Ford) is recalling certain 2017 Ford Explorer Police Interceptor vehicles. The affected vehicles may be missing the two front inboard attachments for the second row seats. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 207, "Seating systems", and (FMVSS) number 210, "Seat belt assembly anchorages." Seats with missing inboard attachments may not adequately restrain an occupant in a crash, increasing the risk of injury. Ford will notify owners, and dealers will inspect the vehicles to verify that they have the second row seat attachment studs, installing them if not, free of charge. The recall is expected to begin by August 18, 2017. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 17C10.

17V-401

Daimler Trucks North America (DTNA) is recalling certain 2015-2017 Freightliner M2 Business Class, 108SD, and 114SD vehicles. The affected vehicles might not have a required check valve installed in one of the ports of the spring brake modulation valve. Without the valve, the primary air system is not isolated from the secondary air system. A rapid loss of air pressure in the secondary system could cause a similar rapid loss of pressure in the primary system, which may lead to a sudden application of the parking brakes. This could increase the risk of a crash. DTNA will notify owners, and dealers will inspect the vehicles, installing a check valve, as necessary, free of charge. The recall is expected to begin on August 24, 2017. Owners may contact DTNA customer service at 1-800-745-8000. DTNA's number for this recall is FL-740.

17V-402

Spartan Motors USA (Spartan) is recalling certain 2017-2018 K3 and K4 motor home chassis and Gladiator emergency response chassis cabs equipped with Cummins ISX 15L engines. These engines have a fuel pump whose drive gear could possibly slip on its drive shaft, causing a fuel pump function loss, resulting in an engine stall. An engine stall can increase the risk of a crash. Spartan will notify the final stage manufacturers that used these chassis or the vehicle purchaser, and Cummins dealers will replace the fuel pumps, free of charge. The recall began on July 12, 2017. Owners may contact Cummins customer service at 1-800-286-6467 or Spartan customer service at 1-800-543-5008. Spartan's number for this recall is 17015.

17V-403

General Motors LLC (GM) is recalling certain 2016-2017 Buick Envision vehicles. An accessory NSV Universal Tablet Holder may have been installed incorrectly onto the front seat head restraints, preventing the head restraint posts from fully engaging in the seat back. If so, the head restraints would fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 202a, "Head Restraints." If the head restraint posts are not fully engaging in the seat back, the head restraint may loosen or dislodge, increasing the risk of injury in a crash. GM will notify owners, and dealers will inspect the head restraints and tablet holders for the correct installation, reinstalling them as necessary, free of charge. The recall began July 27, 2017. Owners

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2017**

Published August 11, 2017

may contact Buick customer service at 1-800-521-7300. GM's number for this recall is 17239/17258.

17V-404

Triple E Recreational Vehicles (Triple E) is recalling certain 2017 Wonder motorhomes, model W24MB. When open, the door for the Truma water heater can block the furnace air intake and exhaust. If the door is left open while the furnace is on, the water heater door may melt, increasing the risk of a fire. Triple E will notify owners, and dealers will provide a decal with instructions to be installed on the water heater door, free of charge. Owners may contact Triple E customer service at 1-877-992-9906. Triple E's number for this recall is CA #8690-1.

17V-405

Lance Camper Manufacturing Corp. (Lance Camper) is recalling certain 2018 Lance Travel Trailers equipped with adjustable utility receivers sold as optional or aftermarket equipment. The receivers may have insufficient welds and, as a result, things connected to the receiver such as a bicycle rack may not be properly positioned. If components such as a bicycle rack are not properly supported, they may contact the road, possibly resulting in road debris, increasing the risk of a crash. Lance Camper has notified owners, and the owners will be refunded for their purchase once the receiver is returned. As an option, customers may instead get a bike rack that goes on the front of the travel trailer, free of charge. The recall began on May 26, 2017. Owners may contact Lance Camper customer service at 1-661-949-3322.

17V-407

Ford Motor Company (Ford) is recalling all 2015-2017 Transit vehicles except 156" and 178" wheelbase Chassis Cab and Cut-Away bodies. In the affected vehicles, the flexible coupling connecting the transmission to the driveshaft may prematurely fail. If the coupling fails, the vehicle will not be able to move under its own power and the disconnected driveshaft may impact and damage the brake and fuel lines. Additionally, the separated driveshaft may allow the vehicle to roll if the vehicle is exited when the transmission is in 'Park' but the parking brake is not applied. These scenarios may increase the risk of a crash. Ford will notify owners, and as an interim repair, dealers will replace the flexible coupling on any vehicle with more than 30,000 miles. A final remedy repair of a redesigned flexible coupling or a revised driveshaft equipped with a universal joint is being developed and is expected in early 2018. These repairs will be made free of charge. Interim notifications informing owners of the safety risk were mailed July 21, 2017. Owners will receive a second notice when remedy parts become available. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 17S15.

17V-408

Kovatch Mobile Equipment Corp. (KME) is recalling one 2017 Predator Tanker truck equipped with a Cummins ISX 15L engine. The affected engine has a fuel pump whose drive gear may slip on its drive shaft, causing a fuel pump function loss, resulting in an engine stall. An engine stall can increase the risk of a crash. Cummins will send a notice to the owner of the vehicle with the affected engine and a Cummins dealer will replace the fuel pump, free of charge. The recall began on August 7, 2017. Owners may contact Cummins customer service at 1-800-286-6467 or KME customer service at 1-800-235-3926.

17V-409

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2017**

Published August 11, 2017

Lakota Corporation (Lakota) is recalling certain 2018 Colt trailers. The furnace flue may not have been installed properly and, as a result, the furnace combustion system may not vent to the outside of the trailer living quarters. If the furnace does not vent properly, a build up of carbon monoxide may occur within the trailer, increasing the risk of injury or death. Lakota will notify owners, and dealers will inspect the trailers and confirm that the furnace flue is installed properly, free of charge. The recall began on July 27, 2017. Owners may contact Lakota customer service at 1-574- 848-1636 or service@lakotatrailers.com.

17V-410

Aston Martin the Americas (Aston Martin) is recalling certain 2017 DB11 vehicles. The affected vehicles have a tire pressure monitoring system (TPMS) that may be incorrectly calibrated, resulting in the low tire pressure warning tell-tale not illuminating at the required minimum activation pressure. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 138, "Tire Pressure Monitoring Systems." If the driver is not warned that a tire is under-inflated, continued use may result in tire failure, increasing the risk of a crash. Aston Martin will notify owners, and dealers will update the TPMS software, free of charge. Owners may contact Aston Martin customer service at 1-888-923-9988. Aston Martin's number for this recall is RA-13-0025.

17V-411

General Motors LLC (GM) is recalling certain 2016-2017 Buick Envision vehicles. The affected vehicles received a replacement headliner as part of a repair. These service parts might not have had impact energy-absorbing foam blocks attached. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 201, "Occupant protection in interior impact." If the service parts do not have energy-absorbing foam blocks, there may be an increased risk of occupant injury in the event of a crash. GM will notify owners, and dealers will replace the headliner assembly, free of charge. The recall began on July 28, 2017. Owners may contact Buick customer service at 1-800-521-7300. GM's number for this recall is 17275.

17V-412

Newmar Corporation (Newmar) is recalling certain 2018 London Aire, King Aire, and Essex motorhomes built on Spartan Motors chassis and equipped with Cummins ISX 15L engines. These engines have a fuel pump whose drive gear could possibly slip on its drive shaft, causing a fuel pump function loss, resulting in an engine stall. Failure of the fuel pump will result in an engine stall, increasing the risk of a crash. Spartan will notify the vehicle owners, and Cummins dealers will replace the fuel pumps, free of charge. The recall began on July 28, 2017. Owners may contact Cummins customer service at 1-800-286-6467, Spartan customer service at 1-800-543-5008 or Newmar customer service at 1-800-731-8300. Newmar's number for this recall is 17015.

17V-413

General Motors LLC (GM) is recalling certain 2014 Chevrolet Silverado 1500 and GMC Sierra 1500 vehicles. The vehicles may have a temporary loss of electric power steering (EPS) assist, especially during low-speed turning maneuvers. If EPS assist is lost and then returns, the driver might lose temporary control of the steering wheel, increasing the risk of a crash. GM will notify owners, and dealers will update the EPS module software, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Chevrolet

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2017**

Published August 11, 2017

customer service at 1-800-222-1020 or GMC customer service at 1-800-432-8782. GM's number for this recall is 17276.

17V-414

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain 2017 Lexus ES350 vehicles. The right-hand side tie rod lock nut may loosen over time. If the lock nut loosens, the tie rod may separate causing a loss of steering and increasing the risk of a crash. Toyota will notify owners, and dealers will inspect the lock nut and, if it is found loose, replace the lock nut, steering gear assembly, and tie rod assembly, free of charge. The recall began on July 26, 2017. Owners may contact Toyota customer service at 1-800-331-4331. Toyota's number for this recall is HLC.

17V-415

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain 2016 Tundra vehicles. The affected vehicles have a passenger knee air bag module that was attached to the instrument panel mounting brackets with incorrect bolts. The incorrect bolts may cause the air bag module to loosen over time, affecting the performance of the knee airbag, increasing the risk of injury during a crash. All of the affected vehicles have been inspected and any incorrect knee air bag mounting bolts have been replaced, free of charge. Owners may contact Toyota customer service at 1-800-331-4331. Toyota's number for this recall is H0K.

17V-416

Honda (American Honda Motor Co.) is recalling certain 2007-2011 Honda CR-V vehicles which have had the passenger frontal air bag replaced. The air bag inflator repair kit may have been assembled by the supplier with an incorrect wire harness. If an inflator with an incorrect wire harness is installed, the air bag may not deploy as intended, increasing the risk of injury in the event of a crash. Honda will notify owners, and dealers will inspect and, if necessary, replace the passenger frontal air bag inflator, free of charge. Owners may contact Honda customer service at 1-888-234-2138. Honda's number for this recall is KF9.

17V-417

Honda (American Honda Motor Co.) is recalling certain 2013-2016 Honda Accord vehicles. The case for the battery sensor, part of the battery management system, may allow water to get in, potentially causing an electrical short. An electrical short increases the risk of a fire. Honda will notify owners, and dealers will replace the sensor, free of charge. Remedy parts are currently unavailable. Dealers will perform an interim remedy of applying adhesive to the case to prevent water intrusion. On August 3, 2017, Honda began mailing interim notices to owners. Owners will need to have the permanent remedy completed once they receive a second notice. Owners may contact American Honda Customer Support Center at 1-888-234-2138. Honda's number for this recall is KG0.

17V-418

KZRV, L.P. (KZRV) is recalling certain 2018 Sportsmen LE recreational trailers. The affected trailers were supplied with the improper spare tires, with both the size and load capacity being incorrect. If the spare tire is used while the trailer is fully loaded, the tire may fail, increasing the risk of a crash. KZRV will notify owners and dealers will replace the spare tire with the proper one, free of charge. The recall began on July 24, 2017.

SAFETY DEFECT/NONCOMPLIANCE NOTICES

RECEIVED DURING JUNE 2017

Published August 11, 2017

Owners may contact KZRV customer service at 1-800-768-4016 extension 154 or 153. KZRV's number for this recall is KZ-2017-04.

17V-419

Newmar Corporation (Newmar) is recalling certain 2014-2018 Newmar Dutch Star and 2015-2017 Newmar Ventana motorhomes. In the affected motorhomes, the driver side and passenger side powered night shades can be lowered by using the remote when the ignition is in the ON position. If the vehicle is being driven and the button on the remote is pushed, the night shades may lower, blocking the driver's view, possibly increasing the risk of a crash. Newmar will notify owners and dealers will install a relay to disable the operation of the driver and passenger night shade by the remote when the ignition is in the ON position. The recall began on July 28, 2017. Owners may contact Newmar customer service at 1-800-731-8300.

17V-420

Keystone RV Company (Keystone) is recalling certain model year 2018 Dutchmen Coleman recreational trailers, models 1705RB, 1755FD, 3015BH, 2605RL, 2305QB, 2515RL, 3025RE, and 2855BH. The affected trailers may have been built with incorrect wiring connectors at the air conditioner junction box. The incorrect connectors may result in the wires coming loose and shorting together, increasing the risk of a fire. Keystone will notify owners, and dealers will replace the incorrect crimp style connector with a twist-on style connector, free of charge. The recall began on July 11, 2017. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 17-291.

17V-421

Jayco, Inc. (Jayco) is recalling certain 2017 Hummingbird travel trailers, models H13C0567-0603, 0608-0636, 0638-0662, and H13E0052-0110. The labels on the affected vehicles incorrectly state that the vehicle is equipped with 14" load range D tires requiring 65 PSI, when the vehicle is actually equipped with 14" load range C tires requiring 50 PSI. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims." The incorrect information on the label may result in the tires being over inflated, which could lead to their failure, increasing the risk of a crash. Jayco will notify owners, and will provide corrected labels, free of charge. The recall began on July 13, 2017. Owners may contact Jayco customer service at 1-800-283-8267. Jayco's number for this recall is 9901357.

17V-422

Yamaha Motor Corporation, USA (Yamaha) is recalling certain 2017 Yamaha YZFR3 motorcycles. The affected motorcycles, intended for the US market, may have been manufactured with a Canadian Motor Vehicle Certification Label. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." If the stamped vehicle identification number (VIN) does not match the VIN on the Vehicle Certification Label, owners may be unable to tell if their vehicle is under an important safety recall. Yamaha will notify owners, and dealers will replace the Vehicle Certification Label, free of charge. The recall began July 21, 2017. Owners may contact Yamaha customer service at 1-800-962-7926. Yamaha's number for this recall is 990115.

17V-423

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2017**

Published August 11, 2017

Honda (American Honda Motor Co.) is recalling certain 2017 Acura MDX Sport Hybrid vehicles. The affected vehicles have an engine fuel feed hose and a fuel purge hose that may have been misrouted during vehicle assembly. The misrouting can cause the hoses to be damaged from contact with other components, potentially resulting in a fuel leak. A fuel leak in the presence of an ignition source may increase the risk of a fire. Acura will notify owners, and dealers will inspect the routing of the fuel feed hose and the fuel purge hose. If misrouted, the hoses will be replaced and installed correctly, free of charge. Owners may contact Acura Client Relations at 1-888-234-2138. Honda's number for this recall is KF8.

17V-424

Mazda North America Operations (Mazda) is recalling certain 2009-2011 Mazda6, and 2007-2011 CX-7 and CX-9 vehicles. These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules, and used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death. Mazda will notify owners, and dealers will replace the passenger frontal air bag inflator with an alternate inflator, free of charge. Owners may contact Mazda customer service at 1-800-222-5500. Mazda's number for this recall is 1317F. Note: This recall supersedes recall 16V356 and all vehicles that were not remedied under that campaign are now covered by this one.

17V-429