

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2018**

Published September 6, 2018

CHILD SEATS:

None during June 2018.

EQUIPMENT:

Darsan Trading Co. (Darsan) is recalling certain HCI Gloss Black Open Face helmets, model number 15, in size large. These helmets may not adequately protect the wearer in the event of a head impact during a motorcycle crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 218, "Motorcycle Helmets." A helmet that does not adequately protect the wearer from an impact can increase the risk of injury in the event of a crash. Darsan has notified owners, and will provide replacement helmets or give the consumer a credit for a replacement helmet, free of charge. The recall began on June 1, 2018. Owners may contact Helmet City customer service at 1-888-550-3731.

18E-039

Dexter Ventline and Door is recalling certain Ventline liquid propane gas (LP) Bottle Straps, part numbers C0538-19, C0538-12, and C0538-16. The LP bottle strap crimping may be insufficient, potentially causing the strap buckle to detach after the LP gas bottle has been removed. If the strap buckle detaches from the strap, preventing the LP tank from being properly retained after the tank is replaced, the unrestrained tank can fall from the trailer, potentially being a road hazard and increase the risk of a crash. Dexter Ventline and Door has notified the affected vehicle manufacturers and those companies are conducting recalls and notifying owners. Dealers for the companies will replace the LP bottle straps, free of charge. Owners may contact Dexter Ventline and Door customer service at 1-800-400-2164. Dexter Ventline and Door's numbers for this recall are 9902385, and 9901385.

18E-040

Simard Suspensions Inc (Simard) is recalling certain front suspensions. These axles have plastic insulators installed between the wheel hub and the wheel or the brake drum and the wheel to prevent corrosion between the two components. Heat generated by the brakes may melt these insulators. If the insulators melt, it can cause the wheel to loosen and detach from the vehicle, increasing the risk of a crash. Simard will notify owners, and dealers will remove or replace the insulators, free of charge. Owners may contact Simard customer service at 1-877-898-8317 or email: service@simardsuspensions.com.

18E-041

Robert Bosch LLC (Bosch) has submitted a Defect Information Report based upon decisions made by Ford Motor Company and General Motors to conduct recalls (numbers 18V392 and 18V358 respectively) to inspect and replace certain Robert Bosch HDP5 High Pressure Fuel Pump Assemblies, part numbers 0261520518 and 0261520515. Welds between the pump housing and the mounting flange may fracture, possibly causing a fuel leak. A fuel leak in the presence of an ignition source can increase the risk of a fire. Bosch is working with the affected vehicle manufacturers. Ford and GM will notify owners and dealers will replace the high pressure fuel pump assembly, free of charge. Owners may contact Ford customer service at 1-866-436-7332, Buick customer service 1-800-521-7300, Cadillac customer service 1-800-458-8006, Chevrolet customer service 1-800-222-1020, and GMC customer service at 1-800-462-8782.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2018**

Published September 6, 2018

18E-042

TRW Automotive Inc (TRW) has submitted a Defect Information Report based upon decisions made by Hyundai Motor America and Kia Motors America to conduct recalls (numbers 18V137 and 18V363 respectively). In the event of a crash, certain ZF Air Bag Control Units (ACU) may be damaged from electrical overstress, preventing the frontal air bags and seat belt pretensioners from deploying. If the frontal air bags and seat belt pretensioners are disabled, there is an increased risk of injury to the vehicle occupants in the event of a vehicle crash that necessitates deployment of these safety systems. TRW is working with the vehicle manufacturers. Hyundai and Kia are finalizing the remedy plans for this recall. Hyundai owners may contact Hyundai customer service at 1-855-371-9460. Kia owners may contact Kia customer service at 1-800-333-4542.

18E-043

Ricon Corporation (Ricon) is recalling certain S-Series and K-Series Titanium Wheelchair Lifts Part Numbers K200, K201, K550, K551, S200, S2201, S550 and S551. The wheelchair lift positioning input cam may fail while the lift is in use, allowing the platform to travel higher than the vehicle floor height. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 403, "Platform Lift Systems." If the wheelchair lift platform stops above the vehicle floor, the wheelchair user can tip inwards toward the vehicle when exiting the lift, increasing their risk of injury. Owners may contact Ricon customer service at 1-800-322-2884.

18E-044

Syncro Corporation (Syncro) is recalling certain Hayes Sway Master aftermarket sway control products, part number 81775. These units may conflict with the tow vehicle's factory-installed integrated brake controllers thereby disabling the tow vehicle's ability to apply the trailer brakes. If the trailer brakes cannot be applied, it can cause a loss of control, increasing the risk of a crash. Syncro will notify owners, instructing them to return the unit for repair, free of charge. The recall began on August 16, 2018. Owners may contact Hayes Customer Service at phone number 1-800-882-1204.

18E-045

Turn5, Inc. (Turn5) is recalling certain Mammoth-brand General Matte Black Wheels, part number J104367, size 17" x 9". These wheels may develop cracks between the center mounting pad and outer bead. Cracks in the wheel could lead to wheel failure and/or a loss of vehicle control, increasing the risk of a crash. Mammoth will notify owners, and refund or exchange the wheels. The manufacturer has not yet provided a notification schedule. Owners may contact Turn5 customer service at 1-866-727-1266.

18E-046

Kovatch Mobile Equipment Corp. (KME) is recalling certain KME Tip Mounted Lifting Devices, part numbers 95347115 and 95347118. The lifting devices do not meet the specified load rating or safety factor. Using the device to lift the rated load may cause the device to deform, increasing the risk of injury. KME has notified owners, and dealers will replace the tip mounted lifting device, free of charge. The recall began July 26, 2018. Owners may contact KME customer service at 1-800-235-3928.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2018**

Published September 6, 2018

18E-047

TRW Automotive Inc (TRW) is recalling certain aftermarket replacement Ball Joints, part number JBJ343. These ball joints have attachments nuts that are the incorrect size, possibly causing a loss of steering control. A loss of steering control can increase the risk of a crash. TRW will notify the known purchasers and owners, and reimburse them for the returned ball joints, free of charge. The recall began on August 24, 2018. Owners may contact TRW customer service at 1-248-863-2437.

18E-048

Federal-Mogul Motorparts LLC (Federal-Mogul) is recalling certain Tie Rod Ends, NAPA part number 269-6121, AC Delco part number 45A3098, McQuay-Norris part number ES4686E, Raybestos part number 410-1099, and Moog part numbers DS300044, DS800980A, and DS800981A. The crimped portion of the right hand outer tie rod replacement part may loosen allowing the inner and outer portions of the assembly to separate. If the inner and outer portions separate, it can cause a loss of steering ability, increasing the risk of a crash. Federal-Mogul will notify its distributors, and provide cards for the distributors to notify the customers that purchased the parts. The right hand outer tie rods subject to this recall installed on vehicles will be replaced at no cost to the vehicle owners. The recall began August 23, 2018. Owners may contact Federal-Mogul customer service at 1-877-489-6659.

18E-049

TIRES:

Continental Tire the Americas, LLC. (Continental) is recalling certain Conti Coach HA3 tires, size 315/80R22.5 157/154 L, with DOT codes A372KWUU 3517 through A372KWUU 1618. These tires may have cords visible through the innerliner. Tires that have cords visible through the innerliner can have sudden air loss, causing a loss of vehicle control, increasing the risk of a crash. Continental will notify owners, and dealers will install equivalent tires, free of charge. The recall began August 16, 2018. Owners may contact Continental customer service at 1-800-726-7113.

18T-008

Achieva Rubber Corp. (Achieva) is recalling certain Innova Ultra Runner tires sizes 5.30-12 in 6 ply and 4.80-12 in 4ply with the date code range of 0114 through 3917. The tires fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 119, "New Pneumatic Tires - Other Than Passenger Cars." If the tires fail to meet the strength test requirements, the tire may fail, increasing the risk of a crash. Achieva will notify owners, and dealers will replace the affected tires with new tires, free of charge. The recall began on August 7, 2018. Owners may contact Achieva customer service at 1-310-328-8868.

18T-009

VEHICLES:

Forest River, Inc. (Forest River) is recalling certain 2019 Forest River Forester and Sunseeker and Coachmen

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2018**

Published September 6, 2018

Leprechaun and Freelanders motorhomes. The U-Bolts that secure the rear differential may not have been properly tightened, causing them to loosen over time and allowing the rear axles to shift. Loose rear axle assemblies can cause a loss of control, increasing the risk of a crash. Forest River has notified owners, and dealers will inspect the U-Bolts and properly tighten or replace the U-Bolts, as necessary, free of charge. The recall began on June 6, 2018. Owners may contact Forest River customer service for Sunseeker and Forester vehicles at 1-574-206-7600, or Coachmen customer service for Freelanders and Leprechaun vehicles at 1-574-825-8602. Forest River's number for this recall is 105-0749.

18V-357

Forest River, Inc. (Forest River) is recalling certain 2019 Forest River Wildcat recreational trailers. These trailers were equipped with Load Range D tires instead of Load Range E tires. Using the trailer with underrated tires could result in tire failure, increasing the risk of a crash. Forest River will notify owners, and dealers will replace the five tires and rims, free of charge. The recall began on June 27, 2018. Owners may contact Forest River customer service at 1-503-831-5410. Forest River's number for this recall is 22-0750.

18V-361

Starcraft RV (Starcraft) is recalling certain 2019 Starcraft Telluride fifth-wheel recreational trailers. The strap that secures the liquid propane (LP) gas bottle may separate from its buckle and no longer secure the propane tank. An unsecured propane tank could detach from the trailer and increase the risk of a crash or leak propane and increase the risk of a fire. Starcraft will notify owners, and dealers will replace the propane tank securing strap with a new strap that has the correct crimping, free of charge. The recall began on July 27, 2018. Owners may contact Starcraft customer service at 1-800-945-4787. Starcraft's number for this recall is 9902385.

18V-362

Kia Motors America (Kia) is recalling certain 2010-2013 Kia Forte, Forte Koup, 2011-2013 Kia Optima and 2011-2012 Kia Optima Hybrid and Sedona vehicles. In the event of a crash, the air bag control unit (ACU) may short circuit, preventing the frontal air bags and seat belt pretensioners from deploying. If the frontal air bags and seat belt pretensioners are disabled, there is an increased risk of injury to the vehicle occupants in the event of a vehicle crash that necessitates deployment of these safety systems. The remedy for this recall is still under development. Owners may contact Kia customer service at 1-800-333-4542. Kia's number for this recall is SC165.

18V-363

Jayco, Inc. (Jayco) is recalling certain 2018-2019 Eagle, Eagle HT, NorthPoint, Pinnacle, Talon and Seismic fifth-wheel recreational trailers. The strap that secures the liquid propane (LP) gas bottle may separate from its buckle and no longer secure the propane tank. An unsecured propane tank could detach from the trailer and increase the risk of a crash or leak propane and increase the risk of a fire. Jayco will notify owners, and dealers will replace the propane tank securing strap with a new strap that has the correct crimping, free of charge. The recall began on July 27, 2018. Owners may contact Jayco customer service at 1-800-517-9137. Jayco's number for this recall is 9901385.

18V-364

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2018**

Published September 6, 2018

Forest River, Inc. (Forest River) is recalling certain 2018 Forest River Rockport, Elkhart Coach ECE4 and Glaval Bus Commute, and 2018-2019 Starcraft Bus Allstar, Allstar MVP, Senator II and Senator II MVP transit buses. The U-bolts on the rear axle that hold the leaf spring and rear axle together may have been insufficiently tightened. The loose U-bolts may further loosen or break allowing the axle to separate and cause a loss of control, increasing the risk of a crash. Forest River has notified owners, and dealers will inspect the tightness of the U-bolt, replacing or tightening the U-bolt as necessary, free of charge. The recall began June 27, 2018. Owners may contact Rockport customer service at 1-888-711-1600, Glaval customer service at 1-800-445-2825, Starcraft customer service at 1-800-348-7440, and Elkhart customer service at 1-866-478-7652. Forest River's number for this recall is 51-0752.

18V-366

MORryde International, Inc. (MORryde) is recalling certain 2018 Ford E-450 chassis modified for transit bus use. The U-bolts on the rear axle that hold the leaf spring and rear axle together may have been insufficiently tightened. The loose U-bolts may further loosen or break allowing the axle to separate and cause a loss of control, increasing the risk of a crash. MORryde will notify the chassis purchasers, and dealers for those companies will inspect the tightness of the U-bolts, replacing or tightening the U-bolts as necessary, free of charge. The recall began on June 28, 2018. Owners may contact MORryde customer service at 1-574-293-1581.

18V-367

PACCAR Incorporated (PACCAR) is recalling certain 2017-2018 Peterbilt 567 and 579 trucks and 2015-2018 Kenworth T660, T680, T800, T880 and W900 trucks. In the event that the Anti-lock Brake System (ABS) loses battery and/or ignition power to the controller, the dash warning light for the ABS may not illuminate to warn the driver of the loss of ABS. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 121, "Air Brake Systems," and 136, "Electronic Stability Control System on Heavy Vehicles." If the driver unknowingly operates the vehicle without the ABS functioning, there would be an increased risk of a crash. PACCAR will notify owners, and dealers will update the NAMUX software within the cab control module, free of charge. PACCAR issued owners an interim notification on July 30, 2018. Owners may contact Peterbilt customer service at 1-918-259-3258 or Kenworth customer service at 1-425-828-5000.

18V-368

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2018 Volkswagen Atlas, Passat, Beetle, Beetle Convertible, Golf, Golf SportWagen and GTI and Audi Q5 and SQ5 vehicles. The brake caliper pistons on these vehicles may have insufficient coating, potentially reducing the brake performance. A reduction of braking performance can increase the risk of a crash. Volkswagen and Audi will notify their owners. Audi dealers will bleed the rear brakes. Volkswagen dealers will bleed the front and rear brake calipers. Note: Owners are advised not to drive their vehicles until the brake system has been checked. The recall began June 29, 2018. Owners may contact Volkswagen customer service at 1-800-893-5298 and Audi customer service at 1-800-253-2834. Volkswagen's numbers for this recall are 47N8, 47N9, and 47N6.

18V-369

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2018**

Published September 6, 2018

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2013-2018 Audi S6 and S7, 2012-2018 A7 and A6 Sedan, and 2014-2018 RS7 vehicles equipped with basic seats (with or without heating). Stress or wear of the body-sensing mat within the front passenger seat may cause the Passenger Occupant Detection System (PODS) control module to malfunction. If the PODS module malfunctions, the front passenger air bag may not deploy properly in the event of a crash, increasing the risk of injury. Volkswagen will notify owners, and dealers will install a PODS system repair kit, free of charge. Interim notices informing owners of the safety risk were mailed July 31, 2018. Owners will be sent a second notice when the remedy becomes available. Owners may contact Audi customer service at 1-800-253-2834. Volkswagen's number for this recall is 74D5.

18V-370

Ducati North America (Ducati) is recalling certain 2017-2018 Ducati Supersport, and Supersport S motorcycles. The Airbox blow-by and fuel tank overflow hoses may be routed too close to the exhaust manifold, which may cause the hoses to melt. If the hoses melt, it can cause a fuel leak, increasing the risk of a fire. Ducati will notify owners, and dealers will inspect the hose routing and correct as necessary, free of charge. The recall began on July 6, 2018. Owners may contact Ducati customer service at 1-888-391-5446.

18V-371

Manac Inc. (Manac) is recalling certain 2013-2018 Steel Dropdeck, 2017 Extendable Steel Dropdeck, and 2018 Steel Flatbed trailers equipped with steel side rails and lashing chains. The lashing chains may break which can allow the cargo to slide or tip during transit. Broken lashing chains can allow the cargo to slide or tip, increasing the risk of injury or crash. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Manac customer service at 1-800-361-7900.

18V-372

Northwood Manufacturing, Inc. (Northwood) is recalling certain 2019 Northwood Nash 24M and Nash 29S travel trailers. The tires may rub against the shocks and cause damage to the tires. Tire damage can result in tire failure and increase the risk of a crash. Northwood will notify owners, and dealers will re-mount the shocks to provide clearance between the shocks and tires, free of charge. The recall began July 9, 2018. Owners may contact Northwood customer service at 1-800-766-6274. Northwood's number for this recall is 2018-001.

18V-373

BMW of North America, LLC (BMW) is recalling certain 2018-2019 BMW X3 xDrive30i, X3 sDrive30i, and X3 M40i vehicles equipped with the "Active Lane Keeping Assistant" option. The steering wheel may be incompatible with the lane keeping assistant function and may not detect if the driver's hands are off the wheel. If the sensors do not properly detect the driver's hands are off the wheel, the driver may not be alerted by one or more warning signals, increasing the risk of a crash. BMW will notify owners, and dealers will inspect the steering wheel, replacing it if necessary, free of charge. The recall began on July 19, 2018. Owners may contact BMW customer service at 1-800-525-7417.

18V-374

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2018 Volkswagen Atlas and Tiguan vehicles. In the event of a crash, the passenger frontal air bag may tear or not properly unfold during

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2018**

Published September 6, 2018

deployment. If the air bag were to tear or unfold incorrectly during deployment, it can increase the risk of injury. Volkswagen will notify owners, and dealers will replace the passenger frontal air bag, free of charge. The recall began July 19, 2018. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's numbers for this recall are 69W8, and 69W9.

18V-375

Forest River, Inc. (Forest River) is recalling certain 2017-2018 Glaval Apollo, Commute, Concorde II, Entourage, Legacy, Primetime, Titan II, Titan II Low Floor, and Universal transit buses. A washer used in mounting the driver's seat belt assembly may break, allowing the seat-belt to separate from the vehicle. If the seat belt end does not remain secured to the vehicle, the occupant will not be restrained in the event of a crash, increasing their risk of injury. Forest River has notified owners, and dealers will replace the seat belt mounting washers, free of charge. The recall began on July 2, 2018. Owners may contact Forest River customer service at 1-574-343-5167. Forest River's number for this recall is 35-0751.

18V-376

Spartan Motors USA (Spartan) is recalling certain 1991-2018 Utilimaster Aeromaster and Walk-In Vans. These vehicles were manufactured with front seat belts that do not have an emergency locking seat belt retractor or automatic locking seat belt retractor. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 208, "Occupant Crash Protection." Without retractors, the seat belts may not accommodate different size occupants, therefore the occupants may not be properly restrained in the event of a crash, increasing the risk of injury. Spartan will notify owners and will install seat belts with retractors, free of charge. The recall began on August 6, 2018. Owners may contact Spartan customer service at 1-800-582-3454. Spartan's number for this recall is 18019.

18V-377

Altec Industries Inc. (Altec) is recalling certain 2016-2017 Altec Aerial Devices and Digger Derrick vehicles. The high voltage grounding system may be equipped with improperly sized cable connection receptacles causing the high voltage grounding system to fail. If the grounding system fails, the user has an increased risk of injury. Altec will notify owners, and dealers will inspect the high voltage grounding system cable ring terminal connectors and replace any that are improperly sized, free of charge. The recall began on August 6, 2018. Owners may contact Altec customer service at 1-877-462-5832. Altec's number for this recall is CSN 686.

18V-379

Volkswagen Group of America, Inc. (Volkswaen) is recalling certain 2018 Volkswagen Atlas vehicles. The owner's manuals provided with the affected vehicles do not inform the customers about the child restraint size limitation/restrictions for the second row center seating position. As a result, the center and adjacent outboard seat belt buckles on the second row can become damaged if a child seat base is installed that is wider than 12.6 inches. A damaged seat belt buckle can release unexpectedly, increasing the risk of injury in a crash.

Volkswagen will notify owners, and dealers will inspect the center and left outboard seat belt buckles, and replace them if necessary, free of charge. Volkswagen will also provide an owner's manual supplement addressing child safety and child restraints. The recall began June 29, 2018. Owners may contact Volkswagen

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2018**

Published September 6, 2018

customer service at 1-800-893-5298. Volkswagen's number for this recall is 69X1.

18V-380

Ferrari North America, Inc. (Ferrari) is recalling certain 2012 Ferrari California, 458 Italia, 458 Spider, and FF vehicles that have not already had their passenger frontal air bag replaced. These passenger frontal air bag modules have air bag inflators that may explode in the event of a crash due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator explosion may result in metal fragments striking the vehicle occupants resulting in serious injury or death. Ferrari will notify owners, and dealers will replace the passenger frontal air bag assembly with one that uses an alternate inflator, free of charge. The recall began on July 19, 2018. Owners may contact Ferrari customer service at 1-201-816-2668. Ferrari's number for this recall is 61. Note: This recall supersedes recall 17V-018.

18V-381

Mobility Ventures LLC (Mobility Ventures) is recalling certain 2015-2016 Mobility Ventures MV-1 vehicles. If a rear turn signal stops working properly, the vehicle will not adjust the turn signal flash rate frequency to warn the driver that a turn signal is not working correctly. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." If the driver is unaware that his turn signals are not working properly, the driver may continue to use the vehicle with turn signals that may not communicate the driver's intentions, increasing the risk of a crash. The remedy for this recall is still under development. Mobility Ventures issued owners an interim notification on July 30, 2018. Owners may contact Mobility Ventures customer service at 1-877-681-3678.

18V-382

Keystone RV Company (Keystone) is recalling certain 2018-2019 Keystone Cougar recreational trailers equipped with an outdoor propane grill. The outdoor propane grill is installed in a wooden assembly that may not have enough clearance from the heated area. If the wooden assembly is exposed to high temperatures, there would be an increased risk of a fire. Keystone will notify owners, and dealers will replace the wooden assembly with a metal assembly, free of charge. The recall began on July 26, 2018. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 18-322.

18V-383

Spartan Motors USA (Spartan) is recalling certain 2016-2019 Spartan Specialty Vehicles K2 and K3 motorhome chassis. The tag axle tire may become damaged due to contact with the Diesel Exhaust Fluid (DEF) fill mounting bracket. The damaged tag axle tire may fail, increasing the risk of a crash. Spartan has notified owners, and dealers will modify the DEF fill mounting bracket to give adequate clearance to the tag axle tire, free of charge. The recall began on June 25, 2018. Owners may contact Spartan customer service at 1-800-543-5008. Spartan's number for this recall is 1806.

18V-384

Thor Motor Coach (TMC) is recalling certain 2019 Thor Four Winds, Chateau, Freedom Elite, Majestic, Outlaw, Quantum and Vegas motorhomes built on modified Ford E-450 chassis. The U-bolts on the rear axle that hold the leaf spring and rear axle together may have been insufficiently tightened. The loose U-bolts may

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2018**

Published September 6, 2018

further loosen or break allowing the axle to separate and cause a loss of control, increasing the risk of a crash. TMC has notified owners, and dealers will tighten U-bolts to the proper torque, free of charge. The recall began on June 22, 2018. Owners may contact TMC customer service at 1-877-855-2867. TMC's number for this recall is RC000156.

18V-385

Forest River, Inc. (Forest River) is recalling certain 2019 Forest River Salem and Wildwood recreational trailers. These vehicles are equipped with an axle equalizer that can allow the axle to contact the chassis. If the axle contacts the chassis, it could result in axle failure, increasing the risk of a crash. Forest River has notified owners, and dealers will replace the axle equalizer kit with a taller equalizer kit, free of charge. The recall began on June 27, 2018. Owners may contact Forest River customer service at 1-574-534-4058. Forest River's number for this recall is 72-0753.

18V-386

Newmar Corporation (Newmar) is recalling certain 2018-2019 Newmar Mountain Aire, London Aire, Essex, and King Aire motorhomes. These vehicles are equipped with windshield wipers that may have an incorrect bend, possibly preventing the wiper arms from properly contacting the windshield. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 104, "Windshield Wiping and Washing Systems." If the windshield wipers do not properly contact the windshield, the driver's visibility may be reduced, increasing the risk of a crash. Newmar will notify owners, and dealers will replace the wiper arms, free of charge. The recall began August 3, 2018. Owners may contact Newmar customer service at 1-800-731-8300.

18V-387

Porsche Cars North America, Inc. (Porsche) is recalling certain 2017-2018 Panamera 4S, Panamera Turbo and Panamera Turbo Executive and 2018 Panamera Turbo S E-Hybrid, Panamera Turbo S E-Hybrid Executive, Panamera 4S Sport Turismo, Panamera Turbo Sport Turismo, Panamera Turbo S E-Hybrid Sport Turismo, and Panamera 4S Executive vehicles. The connecting links may detach from the rear-axle anti-roll bar potentially damaging the surrounding suspension parts and affecting the vehicle's handling. An unexpected change to the vehicle's handling can increase the risk of a crash. Porsche will notify owners, and dealers will replace the connecting links for the anti-roll bar, free of charge. Porsche issued owners an interim notification on July 31, 2018. Owners may contact Porsche customer service at 1-800-767-7243. Porsche's number for this recall is AJ06.

18V-388

Ford Motor Company (Ford) is recalling certain 2018 Ford F-650 and F-750 trucks. The brake circuit hose assemblies located between the master cylinder and the hydraulic control unit, may have been manufactured without anti-corrosion plating on the coupling fittings, or "ferrules," of the hoses. This can lead to premature corrosion, and result in a brake fluid leak. A brake fluid leak can reduce brake effectiveness, increasing the risk of a crash. Ford will notify owners, and dealers will replace the brake hose assemblies, free of charge. The recall began on July 17, 2018. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 18S19.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2018**

Published September 6, 2018

18V-389

Ford Motor Company (Ford) is recalling certain 2017-2018 Ford Edge and 2017 Lincoln MKZ vehicles. On vehicles with 2.0L gas engines and six-speed automatic transmissions, the torque converter weld studs may have been inadequately welded. If the torque converter weld studs fail, the torque converter will not be connected to the engine flexplate and the vehicle will lose the ability to move, increasing the risk of a crash. Ford will notify owners, and dealers will replace the torque converters, free of charge. The recall began on May 17, 2018. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 17S16 (S2). Note: This recall is an expansion of recall 17V-427.

18V-390

Automobili Lamborghini (Lamborghini) is recalling certain 2012-2018 Lamborghini Aventador Coupe and Roadster vehicles. The engine may stall unexpectedly during certain driving conditions such as when the accelerator pedal is released below 2000 rpms while the transmission is automatically down shifting to a lower gear. An engine stall can increase the risk of a crash. Lamborghini will notify owners, and dealers will install updated engine software, free of charge. The recall began August 3, 2018. Owners may contact Lamborghini customer service at 1-866-681-6276. Lamborghini's number for this recall is L73X-R.02.18.

18V-391

Ford Motor Company (Ford) is recalling certain 2018 Ford Expedition, F-150, and Lincoln Navigator vehicles equipped with 3.5L GTDI V6 engines. These vehicles have high pressure fuel pump assemblies with welds that can fracture, which may cause an oil or fuel leak. A fuel leak in the presence of an ignition source may increase the risk of a fire. Ford will notify owners, and dealers will replace the high pressure fuel pump and associated components, free of charge. The recall began July 17, 2018. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 18S17.

18V-392

Kovatch Mobile Equipment Corp. (KME) is recalling certain 2015-2017 KME Predator SS Aerial, and 2015-2018 KME Predator Aerial emergency vehicles equipped with an aerial platform and optional modular platform tether control. If the tether control gets unplugged while it is operating the aerial, the last command will be continued to be carried out. If the aerial continues moving when the tether is unplugged, it can increase the risk of an injury. KME will notify owners, and dealers will install updated software to stop the aerial's movement, free of charge. The recall began July 13, 2018. Owners may contact KME customer service at 1-800-235-3928.

18V-393

New Flyer of America, Inc. (New Flyer) is recalling certain 2014-2016 New Flyer XT60, 2014-2017 New Flyer XN60 and XD60, and 2015-2017 New Flyer XDE60 urban transit buses equipped with ZF Axles that have radial air disk brakes. Surface roughness of a guide pin in the radial brake calipers may cause the brake carriage guide pin support bolt to break. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 121, "Air Brake Systems." Breakage of the guide pin can cause a reduction of braking ability and an increase in stopping distances, or a loss of tire pressure, increasing the risk of a crash. New Flyer will notify owners, and dealers will install a bushing kit and reinstall the brake calipers,

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2018**

Published September 6, 2018

free of charge. The recall began June 29, 2018. Owners may contact New Flyer customer service at 1-204-224-6706. New Flyer's number for this recall is R18-010.

18V-394

Chrysler (FCA US LLC) is recalling certain 2017-2018 Chrysler Pacifica vehicles. The Manual Park Release (MPR) plug may be removed without a tool. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 114, "Theft Protection." If the MPR is engaged unintentionally, the vehicle could roll away striking and injuring a bystander or cause a crash. Chrysler will notify owners, and dealers will replace the MPR plug, free of charge. The recall began July 9, 2018. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is U50.

18V-395

Chrysler (FCA US LLC) is recalling certain 2018 Dodge Journey vehicles. When reverse gear has been selected, the rear camera view may not be fully visible within two seconds. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 111, "Rearview Mirrors." If the full camera view is delayed and the driver does not check their surroundings before backing up, there may be an increased risk of a crash. Chrysler will notify owners, and dealers will replace the rearview mirror, free of charge. The recall began August 2, 2018. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is U58.

18V-396

General Motors LLC (GM) is recalling certain 2013 Chevrolet Volt vehicles. An update to the Hybrid Powertrain Control Module 2 (HPCM2) may have disabled the cell balancing function causing a low-voltage condition. If the voltage drops, the vehicle may lose propulsion, increasing the risk of crash. GM will notify owners, and dealers will reprogram the HPCM2, free of charge. The recall began July 24, 2018. Owners may contact Chevrolet customer service at 1-800-222-1020. GM's number for this recall is 18215.

18V-397

Chrysler (FCA US LLC) is recalling certain 2018 Dodge Journey and RAM 1500, 2500, and 3500 vehicles. The backup camera may experience a loss of image display while backing up. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 111, "Rearview Mirrors." A loss of image in the rearview camera while backing up can increase the risk of a crash. Chrysler will notify owners, and dealers will replace the rearview mirror, free of charge. The recall began August 2, 2018. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is U56.

18V-398

Grand Design RV, LLC (Grand Design) is recalling certain 2018-2019 Grand Design Solitude fifth-wheel trailers. The liquid propane (LP) gas line on the optional pull-out outside kitchen may contact the underside of the hot grill. Contact with the hot grill may result in a propane leak, increasing the risk of a fire. Grand Design will notify owners, and dealers will re-route the LP gas line to prevent it from contacting the bottom of the grill, free of charge. The recall began July 10, 2018. Owners may contact Grand Design RV customer service at 1-574-825-9679. Grand Design's number for this recall is 900013.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2018**

Published September 6, 2018

18V-399

General Motors LLC (GM) is recalling certain 2016-2018 Chevrolet Malibu vehicles. During servicing, a Passenger Presence System (PPS) may have been installed that was not correctly calibrated to the vehicle's seat type. As a result, the PPS may not properly identify an adult passenger from a child passenger in the front passenger seat, potentially causing the air bag to not deploy when it should, or causing the air bag to deploy when it shouldn't. In the event of a crash, improper air bag deployment can increase the risk of injury. GM will notify owners, and dealers will replace the front passenger PPS seat service kit, free of charge. The recall began August 7, 2018. Owners may contact Chevrolet customer service at 1-800-222-1020. GM's number for this recall is 18208.

18V-400

Nissan North America, Inc. (Nissan) is recalling certain 2011 Nissan Versa sedan vehicles and 2011-2012 Nissan Versa hatchback vehicles ever registered in the states of Arizona, Arkansas, Delaware, the District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia. Nissan is also recalling 2010-2011 Nissan Versa sedan vehicles and 2010-2012 Nissan Versa hatchback vehicles ever registered in the states of ever registered in the states of Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin, and Wyoming.

In the event of a crash necessitating deployment of the passenger frontal air bag, these passenger air bag inflator may explode due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator explosion may result in sharp metal fragments striking the driver or other occupants resulting in serious injury or death. Nissan will notify owners, and dealers will replace the front passenger air bag inflator with an alternate inflator, free of charge. The recall began July 5, 2018. Owners may contact Nissan customer service at 1-800-867-7669.

18V-401

Mazda North America Operations (Mazda) is recalling certain 2003-2008 Mazda6, 2006-2007 Mazdaspeed6 and 2004 MPV vehicles nationwide. Mazda is also recalling 2005-2006 MPV vehicles in Alabama, Arizona, Arkansas, California, Delaware, the District of Columbia, Florida, Georgia, Hawaii, Illinois, Indiana, Kansas, Kentucky, Louisiana, Maryland, Mississippi, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, South Carolina, Tennessee, Texas, Virginia, West Virginia, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands. These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules, and used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these passenger air bag inflators may explode due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator explosion may result in sharp metal fragments striking the driver or other occupants resulting in serious injury or death. Mazda will notify owners, and dealers will replace the front passenger air bag inflator with an alternate inflator, free of charge. The recall began July 6, 2018. Owners may contact Mazda customer service at 1-800-222-5500

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2018**

Published September 6, 2018

,Option 4. Mazda's number for this recall is 2618F. Note: This recall partially supersedes recall 16V354.

18V-402

Mazda North America Operations (Mazda) is recalling certain 2005-2006 Mazda MPV vehicles sold, or ever registered, in the states of Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin, and Wyoming.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these inflators may explode due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator explosion may result in metal fragments striking the vehicle occupants resulting in serious injury or death. Mazda will notify owners, and dealers will replace the front passenger air bag inflator with an alternate inflator, free of charge. The recall began July 6, 2018. Owners may contact Mazda customer service at 1-800-222-5500, Option 4. Mazda's number for this recall is 2618F. Note: This recall partially supersedes recall 17V011.

18V-404

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2018 Mercedes-Benz GLA250 and GLA250 4Matic vehicles. The child seat top tether anchorage point on the center position of the rear seat may not have been installed. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 225, "Child Restraint Anchorage Systems." If the top tether anchorage point is missing, a child seat will not be able to be properly installed in the center rear seat position, increasing the risk of injury. MBUSA will notify owners, and dealers will replace the rear seat backrest, free of charge. The recall began August 15, 2018. Owners may contact MBUSA customer service at 1-800-367-6372.

18V-405

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2003 Volkswagen Passat sedan, Jetta, Jetta wagon, Golf, EuroVan, EuroVan Camper Van and EuroVan Chassis vehicles. Upon deployment of the driver's frontal air bag, excessive internal pressure may cause the inflator to explode. In the event of a crash necessitating deployment of the driver's frontal air bag, the inflator could explode with metal fragments striking the driver or other occupants resulting in serious injury or death. Volkswagen will notify owners, and dealers will replace the driver's frontal air bag inflator, free of charge. Interim notices informing owners of the safety risk were mailed August 10, 2018. Owners will receive a second notice when the remedy becomes available. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's number for this recall is 69X3.

18V-406

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain 2018 Mercedes-Maybach S560 and S560 4Matic and Mercedes S450 4Matic, S450, S560, S560 4Matic, and S560 Coupe 4Matic vehicles. The electrical power bars inside the pre-fuse box in the trunk may not have been secured properly. If the power bars are not properly secured, it can cause higher electrical resistance increasing the risk of a fire. Additionally, an intermittent

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2018**

Published September 6, 2018

contact between the power bars could lead to a loss of vehicle functions. The engine operation, the seat belt functions and the instrument cluster could be impaired, increasing the risk of a crash and injuries. MBUSA will notify owners, and dealers will inspect the pre-fuse box, replacing it as necessary, free of charge. The recall began August 30, 2018. Owners may contact MBUSA customer service at 1-800-367-6372.

18V-407

BMW of North America, LLC (BMW) is recalling certain 2017-2018 BMW G310R and 2018 BMW G310GS motorcycles. Over time, repeated use and loading of the side stand could cause damage to the side stand and the motorcycle's frame. Damage to the side stand and/or frame may result in the motorcycle unexpectedly falling over while it is stationary, increasing the risk of injury. BMW will notify owners, and dealers will inspect the frame, installing a reinforcement plate and new side stand, or the frame will be replaced if necessary, free of charge. BMW issued owners an interim notification on August 9, 2018. Owners may contact BMW customer service at 1-800-525-7417.

18V-408

Daimler Trucks North America LLC (DTNA) is recalling certain 2017-2018 Thomas Built Buses Saf-T-Liner EFX school buses. The check valve for the air brake system may not be plumbed correctly which can cause the primary air system to not be isolated from the secondary air system. In the event of a rapid loss of air pressure in the secondary system, the incorrectly plumbed check valve can cause rapid air loss in both secondary and primary system, causing the parking brakes to activate suddenly. This will increase the risk of a crash. DTNA will notify owners, and dealers will inspect and repair the check valve as needed, free of charge. The recall began on August 12, 2018. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-774.

18V-409

Daimler Trucks North America LLC (DTNA) is recalling certain 2017-2018 Thomas Built Buses Saf-T-Liner EFX transit buses. The check valve for the air brake system may not be plumbed correctly which can cause the primary air system to not be isolated from the secondary air system. In the event of a rapid loss of air pressure in the secondary system, the incorrectly plumbed check valve can cause rapid air loss in both secondary and primary system, causing the parking brakes to activate suddenly. This will increase the risk of a crash. DTNA will notify owners, and dealers will inspect and repair the check valve as needed, free of charge. The recall began on August 12, 2018. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-774.

18V-410

Daimler Trucks North America LLC (DTNA) is recalling certain 2018-2019 Freightliner Cascadia vehicles. The brake caliper mounting bolts on these vehicles may not been properly tightened, potentially resulting in the caliper detaching. If the calipers detach, there would be reduced braking performance, increasing the risk of a crash. DTNA will notify owners, and dealers will inspect the brake caliper mounting bolts, tightening them as necessary, free of charge. The recall began on August 13, 2018. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-775.

18V-411

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2018**

Published September 6, 2018

Navistar, Inc. (Navistar) is recalling certain 2018-2019 International HX and LT trucks equipped with a Cummins ISX engine and a Wabco 37.4 air compressor. The air compressor discharge line may contact the fuel filter inlet and outlet lines (fuel lines) and the heat generated from the air compressor discharge line may cause heat damage to the fuel lines. Continued heat damage to the fuel lines could cause the fuel lines to rupture, resulting in a fuel leak and increasing the risk of a fire. Navistar will notify owners, and dealers will replace the straight fitting on the air compressor discharge line and the discharge line with a 45-degree fitting and a redesigned discharge line, free of charge. The recall began on July 20, 2018. Owners may contact Navistar customer service at 1-800-448-7825. Navistar's number for this recall is 18511.

18V-412

Forest River, Inc. (Forest River) is recalling certain 2019 Forest River Prime Time recreational trailers. The stove is not isolated from the furnace return air, which potentially causes an inverted flame on the cooktop. The inverted stove top flame can cause the propane supply line to fail, increasing the risk of injury. Forest River will notify owners, and dealers will install a panel to separate the stove top from the furnace return air feed, free of charge. The recall began July 18, 2018. Owners may contact Forest River customer service at 1-574-862-3001. Forest River's number for this recall is 48-0755.

18V-413

Forest River, Inc. (Forest River) is recalling certain 2016-2018 Forest River Prime Time recreational trailers. The Federal Placard incorrectly states that the tire pressure should be 65PSI when the correct tire pressure is 80PSI. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims." The incorrect tire information may cause the operator to underinflate the tire, leading to premature tire wear and increasing the risk of a crash. Forest River will notify owners and will provide a corrected Federal Placard, free of charge. The recall began on July 24, 2018. Owners may contact Forest River customer service at 1-574-862-1025. Forest River's number for this recall is 48-0756.

18V-414

Thor Motor Coach (TMC) is recalling certain 2016-2018 Thor Gemini and Compass recreational vehicles built on a Ford chassis and equipped with a trailer tow module. Water can enter the tow modules and corrode the wiring causing issues such as rapidly flashing turn signals, loss of instrument panel display, an electrical short and possibly the deployment of seatbelt pretensioner. An electrical short can increase the risk of a fire. Turn signal, instrument cluster or seatbelt pretensioner problems can increase the risk of a crash. Ford has notified owners, and Ford dealers will add a drainage hole in the driver's door stepwell and incorporate a fuse into the vehicle's wiring harness, free of charge. The recall began on June 19, 2018. Owners may contact TMC customer service at 1-877-855-2867. TMC's number for this recall is RC000154.

18V-415

Indian Motorcycle Company (Indian) is recalling certain 2017-2018 Indian Scout, Scout Sixty, and Scout Bobber motorcycles. The Anti-Lock Brake System (ABS) may have air left in the system after the assembly process. Air in the brake system can reduce brake effectiveness, increasing the risk of a crash. Indian will notify owners, and dealers will bleed the front and rear anti-lock brake system, free of charge. The recall began July

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2018**

Published September 6, 2018

16, 2018. Owners may contact Indian customer service at 1-877-204-3697. Indian's number for this recall is I-18-07.

18V-416

Gillig LLC (Gillig) is recalling certain 2001-2018 Gillig Low Floor transit buses. The turn signals may flash slowly, reducing their visibility to other drivers. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." The reduced visibility of the turn signals can increase the risk of a crash. Gillig will notify owners, and dealers will update the software that controls the turn flash rate, free of charge. The recall began on August 2, 2018. Owners may contact Gillig customer service at 1-510-264-5073 or 1-800-735-1500.

18V-418

Bugatti is recalling certain 2018 Chiron vehicles. The heat shield for the gas generator for the side air bags may have been incorrectly installed during the air bag manufacturing process, potentially reducing the performance of the air bag. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 214, "Side Impact Protection." If the air bag deployment performance is reduced, it can increase the risk of injury. Bugatti will notify owners, and dealers will remove the affected seats to repair or replace them, free of charge. The recall began July 26, 2018. Owners may contact Bugatti customer service at 1-805-557-1050.

18V-420

Honda (American Honda Motor Co.) is recalling certain 2018 Honda Civic vehicles. The manufacturing date area of the certification labels may have random characters which can affect the owner's ability to determine if a safety recall includes their vehicle. If the owner is not able to verify if their vehicle is involved in safety recall, it can increase the risk of injury or crash. Honda will notify owners, and dealers will replace the certification label, free of charge. The recall began August 7, 2018. Owners may contact Honda customer service at 1-888-234-2138. Honda's number for this recall is U23.

18V-421

Triple E Recreational Vehicles (Triple E) is recalling certain 2017-2018 Wonder recreational vehicles equipped with a trailer tow module. Water can enter the tow modules and corrode the wiring causing issues such as rapidly flashing turn signals, loss of instrument panel display, an electrical short and possibly the deployment of seatbelt pretensioner. An electrical short can increase the risk of a fire. Turn signal, instrument cluster or seatbelt pretensioner problems can increase the risk of a crash. Triple E has notified owners, and dealers will add a drainage hole in the driver's door stepwell and incorporate a fuse into the vehicle's wiring harness, free of charge. The recall began on June 27, 2018. Owners may contact Triple E customer service at 1-877-992-9906 or Ford customer service at 1-866-436-7332. Triple E's number for this recall is CA#9030-1.

18V-422

E-One Incorporated (E-One) is recalling certain 2016-2017 E-One Cyclone II SP-10 emergency vehicles equipped with a 100 foot steel rear mount platform aerial device. Over time, movement of the bucket on the aerial ladder may cause stress fractures in the ladder tubing, compromising the integrity of the aerial device.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2018**

Published September 6, 2018

Stress fractures in the aerial device may result in the ladder failing, increasing the risk of injury of the bucket occupant. E-One has notified owners, and dealers will either repair or replace the affected ladder sections, free of charge. The recall began on July 10, 2018. Owners may contact E-One customer service at 1-352-861-1122.

18V-423

Spartan Motors USA (Spartan) is recalling certain 2009-2018 Gladiator and MetroStar emergency vehicles. The fire water pump solenoid may corrode internally, causing a loss of power to the pump control module. A loss of power to the pump control module can cause a loss of water pressure for fighting fires, thereby increasing the risk of injury. Spartan will notify owners, and dealers will replace the solenoids, free of charge. The recall began on August 7, 2018. Owners may contact Spartan customer service at 1-800-543-5008. Spartan's number for this recall is 18019.

18V-424

REV Recreation Group (REV) is recalling certain 2019 Fleetwood Flair and Holiday Rambler Admiral, model 28A, Class A motorhomes. These vehicles were manufactured with a non flexible Romex wire routed from a 120-Volt nightstand receptacle, through the traveling and stationary bed platform sections, instead of flexible sheathed SJO cable. As a result, the Romex wire may become damaged from the movement of the bedroom slide-out. The damaged wiring could cause an electrical short, increasing the risk of a fire. REV has repaired all of the affected Class A motorhomes while they were in dealer inventory by re-routing the wire harness to ensure that the flexible-sheathed SJO cable is routed through the traveling and stationary bed platform sections in the slide-out area, free of charge. All vehicles were repaired as of July 3, 2018. Owners may contact REV customer service at 1-800-509-3417. REV's number for this recall is 180618REV.

18V-425

Mazda North American Operations (Mazda) is recalling certain 2018 Mazda CX-5 vehicles. In the event of a side impact or rollover crash, the side curtain air bags may not properly unfold during deployment. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 226, "Ejection Mitigation." If the air bags do not deploy properly in a crash, it can increase the risk of injury. Mazda will notify owners, and dealers will replace the curtain air bags, free of charge. The recall began July 31, 2018. Owners may contact Mazda customer service at 1-800-222-5500, Option 4. Mazda's number for this recall is 2718F.

18V-426

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2005-2008 Audi A4 Sedan, A4 Avant, S4 Avant and S4 Sedan, 2007-2008 RS4 Sedan, 2004 RS4 Cabriolet, 2007-2009 A4 Cabriolet and S4 Cabriolet, 2005-2011 A6 Sedan, 2006-2011 A6 Avant, and 2007-2011 S6 Sedan vehicles. These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these inflators may explode due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator explosion may result in sharp metal fragments striking the driver or other occupants resulting in serious injury or death. Audi has notified owners, and dealers will replace

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2018**

Published September 6, 2018

the passenger frontal air bag with an alternate remedy part, free of charge. The recall began June 29, 2018. Owners may contact Audi customer service at 1-800-253-2834. Volkswagen's number for this recall is 69R7. Note: This recall supersedes recalls 16V382, 17V032 and 18V004 and includes vehicles that may have had their air bag previously replaced under one of those campaigns.

18V-427

Forest River, Inc. (Forest River) is recalling certain 2019 Forest River Wildwood and Salem recreational trailers. The break-away safety switch may have been improperly wired such that it is not connected to a constant power source, thereby possibly preventing the trailer brakes from automatically applying if the trailer were to separate from the tow vehicle. If the trailer does not brake when it becomes detached from the tow vehicle, it can increase the risk of a crash. Forest River will notify owners, and dealers will install a new wiring harness, free of charge. The recall began on July 25, 2018. Owners may contact Forest River customer service at 1-574-534-4058. Forest River's number for this recall is 69-0764.

18V-428

Keystone RV Company (Keystone) is recalling certain 2019 Keystone Summerland recreational trailers, model 2020QB. The Federal Identification Label on these vehicles may indicate an incorrect tire rim size of 15X6, when the correct rim size is 15X5. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification" and can create a safety risk. The incorrect rim designation on the label, can cause the operator to replace the rim with an incorrect rim size, increasing the risk of a crash. Keystone has notified owners, and dealers will replace the incorrect Federal label with a corrected label, free of charge. The recall began on July 11, 2018. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 18-324.

18V-429

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2013-2015 Audi S8 and A8 vehicles. The fuel supply line for the high pressure fuel pump may become porous over time, resulting in a fuel leak. A fuel leak in the presence of an ignition source can increase the risk of a fire. Audi will notify owners, and dealers will replace the fuel line, free of charge. The recall began July 20, 2018. Owners may contact Audi customer service at 1-800-253-2834. Volkswagen's number for this recall is 20AV.

18V-430

BMW of North America, LLC (BMW) is recalling certain 2018 BMW X3 xDrive30i and X3 M40i vehicles. The rear turn signals on the outboard side panel will illuminate red, while the inboard turn signals simultaneously illuminate amber. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." Turn signals that flash multiple colors may confuse other drivers, increasing the risk of a crash. BMW will notify owners, and dealers will inspect the rear turn signal lights, and replace if necessary, free of charge. The recall began August 20, 2018. Owners may contact BMW customer service at 1-800-525-7417.

18V-431

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain 2007-2011 Lexus GS350 and

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2018**

Published September 6, 2018

GS450h, 2006-2013 Lexus IS350 and 2010-2014 Lexus IS350C vehicles, equipped with 3.5L V6 2GR-FSE gasoline engines. The diaphragms in the fuel pulsation dampers may harden over time and develop cracks, possibly causing a fuel leak. A fuel leak in the presence of an ignition source can increase the risk of a fire. Toyota will notify owners, and dealers will replace the fuel delivery pipe with a new pipe that has improved pulsation dampers, free of charge. The recall began August 23, 2018. Owners may contact Lexus customer service at 1-800-255-3987. Toyota's number for this recall is JLF.

18V-432

Kovatch Mobile Equipment Corp. (KME) is recalling certain 2017 KME Predator TDA, 2016-2018 KME Predator SS TDA, and 2018 KME Predator SS Aerial emergency vehicles equipped with an aerial ladder and optional tip mounted lifting device. The lifting devices do not meet the specified load rating or safety factor. Using the device to lift the rated load may cause the device to deform, increasing the risk of injury. KME has notified owners, and dealers will replace the tip lifting device, free of charge. The recall began July 26, 2018. Owners may contact KME customer service at 1-800-235-3928.

18V-433

Altec Industries Inc. (Altec) is recalling certain 2016-2017 Altec Aerial Devices and Service Body vehicles, built on Ram 5500 Diesel chassis. The positive stud on the lead acid battery disconnect bracket may contact the hood and cause an electrical short. An electrical short can increase the risk of a fire. Altec will notify owners, and dealers will replace the lead acid battery disconnect, free of charge. The recall began August 23, 2018. Owners may contact Altec customer service at 1-877-462-5832. Altec's number for this recall is CSN 688.

18V-434

Altec Industries Inc. (Altec) is recalling certain 2017 Altec AT40M/S, TA41-48M/S, and L42A aerial devices. The high strength pedestal and turntable fasteners may experience corrosion cracking, causing them to fail. If enough of the fasteners fail, the pedestal and turntable may separate from the vehicle, increasing the risk of injury. Altec will notify owners, and dealers will inspect the vehicles and replace any of the fasteners with a head marking of 3036, free of charge. The recall began August 23, 2018. Altec's number for this recall is CSN 687.

18V-435

Forest River, Inc. (Forest River) is recalling certain 2016-2018 Forest River Wildwood, and 2016-2019 Forest River Salem recreational trailers. The outside auxiliary shower faucet cover may cover the water heater exhaust panel when opened. The covered water heater exhaust panel could increase the risk of injury. Forest River has notified owners, and dealers will install a replacement outside shower, free of charge. The recall began on July 24, 2018. Owners may contact Forest River customer service at 1-574-534-3167. Forest River's number for this recall is 44-0762.

18V-436

General Motors LLC (GM) is recalling certain 2016-2018 Cadillac CT6 vehicles. The inboard child seat anchorage bars may have had excess structural adhesive applied during assembly, which can interfere with the installation of a child seat. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 225, "Child Restraint Anchorage Systems." If the child seat cannot be

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2018**

Published September 6, 2018

attached correctly to the anchorage bar, there is an increased the risk of injury. GM will notify owners, and dealers will inspect, remove any excess adhesive, and apply anti-corrosion primer to the inboard child seat anchorage bars, free of charge. The recall began August 3, 2018. Owners may contact Cadillac customer service at 1-800-458-8006. GM's number for this recall is 18228.

18V-437

Newmar Corporation (Newmar) is recalling certain 2018 Newmar Bay Star, King Aire, London Aire, Mountain Aire, Bay Star Sport, Canyon Star, Dutch Star, Essex, New Aire, Ventana LE, and Ventana motorhomes. When the ignition key is in the off/accessory position and the battery disconnect is on, the slide-out rooms on these vehicles may move in or out unexpectedly. If the slide-out room moves unexpectedly, it can increase the risk of injury. Newmar will notify owners, and dealers will replace the slide-out room controller, free of charge. The recall began August 24, 2018. Owners may contact Newmar customer service at 1-800-731-8300.

18V-438

BMW of North America, LLC (BMW) is recalling certain 2018 BMW X5 xDrive35i, X5 xDrive50i, X5 xDrive35d, and X6 sDrive35i vehicles. The pivot bolt on the front lower-left control arm may not have been properly hardened, which may cause the control arm to break. If the lower control arm breaks, vehicle handling and control can be affected, increasing the risk of a crash. BMW will notify owners, and dealers will inspect the lower-left control arms and replace if necessary, free of charge. The recall began July 11, 2018. Owners may contact BMW customer service at 1-800-525-7417.

18V-439

Spartan Motors USA (Spartan) is recalling certain 2010-2019 Spartan Emergency Response Gladiator vehicles. The protective sleeve for the cable that connects the battery positive terminal to the alternator can become brittle and allow the cable to chafe and arc. If the battery positive cable arcs, it can increase the risk of a fire. Spartan will notify owners, and dealers will install brackets to move the cable away from any chafe points, and replace any damaged battery positive cables, free of charge. The recall began on August 27, 2018. Owners may contact Spartan customer service at 1-800-543-5008. Spartan's number for this recall is 18020.

18V-440

Suzuki Motor of America, Inc. (Suzuki) is recalling certain 2018 Suzuki DR-Z400S and DR-Z400SM motorcycles. During assembly the resin that fills the rear brake stop lamp switch may have adhered to the internal contacts, which can prevent the brake lamp from illuminating. If the brake lights do not illuminate, it can increase the risk of a crash. Suzuki will notify owners, and dealers will install a new stop lamp switch assembly, free of charge. The recall began on July 16, 2018. Owners may contact Suzuki customer service at 1-800-934-0934. Suzuki's number for this recall is 2A84.

18V-441

Daimler Trucks North America LLC (DTNA) is recalling certain 2015-2018 Freightliner Custom Chassis Corporation (FCCC) XCL Chassis equipped with V-Ride suspension. The suspension mounting bolts may have been insufficiently tightened, which can result in the bolts loosening. If the mounting bolts loosen, the track bars that maintain the positioning of the rear axle may detach, affecting the vehicle's handling and stability and

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2018**

Published September 6, 2018

increasing the risk of a crash. DTNA will notify owners, and DTNA authorized service facilities will inspect and correct the tightness of the mounting bolts, if necessary, free of charge. The recall began August 24, 2018. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-776.

18V-442