

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2019**

Published July 23, 2019

CHILD SEATS:

None during June 2019.

EQUIPMENT:

Ivolution Sports, Inc. (Ivolution) is recalling certain IV2 HY-901 helmets, in sizes S, M, L, XL and XXL. These helmets may not adequately protect the wearer in the event of a head impact during a motorcycle crash. In the event of a crash, the helmet may not protect the occupant, increasing the risk of injury. Ivolution will notify customers, and provide full refund. The manufacturer has not yet provided a notification schedule. Owners may contact Ivolution at 1-951-852-6327.

19E-039

Cummins Inc. (Cummins) is recalling certain Vehicle Control Units (VCU) for PowerDrive 7000 EV, part number 300114 Revision A, sold for use in school buses. The VCU may unexpectedly shut down the high voltage contactors, resulting in loss of all systems powered by high voltage, including the traction drive system and power steering. An unexpected loss of drive and power steering may increase the risk of a crash. Cummins has notified the only vehicle manufacturer affected, and Cummins will work with the vehicle owners to update the VCU software with a revised version, free of charge. The recall began June 19, 2019. Owners may contact Cummins customer service at 1-800-286-6467.

19E-040

Gillig LLC (Gillig) is recalling certain Transpec T287X Series glass roof hatches sold as aftermarket parts. Temperature and vibration stresses may cause the tempered glass roof hatch to shatter. If the tempered glass roof hatch shatters, glass fragments may fall onto passengers, increasing the risk of an injury. Gillig will notify owners, and the glass hatch manufacturer will provide replacement hatch lids. Owners may contact Specialty customer service at 1-800-951-7867 or Gillig at 1-510-264-5073 or 1-800-735-1500.

19E-041

Specialty Manufacturing Co. (Specialty) is recalling certain Prolo 24"x 24" roof hatches. Due to a manufacturing issue, the roof hatch external handle may unexpectedly break under reasonable use. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 217, "Bus Emergency Exits and Window Retention and Release." If the roof hatch external handle breaks, in the event of an emergency, the hatch cannot be easily opened from outside the vehicle, increasing the risk of injury. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Specialty customer service at 1-800-951-7867.

19E-042

TRW Automotive Inc. (TRW) is recalling certain air bag electronic control units (ECU). These ECUs may malfunction, possibly disabling the deployment of the air bags and/or seat belt pretensioners or causing them to unexpectedly deploy. In the event of a crash, air bags and/or seat belt pretensioners that do not deploy as intended may increase the risk of injury. TRW is working with the affected vehicle manufacturers who are conducting campaigns to replace the ECU's, free of charge.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2019**

Published July 23, 2019

19E-043

TIRES:

Cooper Tire & Rubber Co. (Cooper Tire) is recalling certain size 235/65R18 Cooper Discoverer SRX, Evolution H/T, Discoverer HTP, Adventurer H/T CUV, Big O Big Foot A/S, Les Schwab Back Country QS3 Touring HT, and Mastercraft Courser HSX Tour tires. The tires may have been improperly manufactured with a ply cord distortion. For a full list of the Tire Identification Numbers (TIN) visit: <https://static.nhtsa.gov/odi/rc1/2019/RCLRPT-19T005-5639.pdf> The distortion may cause parting of the lower sidewall compounds extending to the cord material, increasing the risk of tire failure and a crash. Cooper Tire has notified owners, and dealers will replace the tires, free of charge. The recall began June 14, 2019. Owners may contact Cooper Tire customer service at 1-800-854-6288. Cooper Tire's number for this recall is 172.

19T-005

VEHICLES:

Altec Industries Inc. (Altec) is recalling certain 2016-2019 LR7 Series Aerial Devices. The aerial device can be operated without the rear outriggers being deployed, which may cause the unit to be unstable. An unstable aerial device may suddenly collapse, increasing the risk of injury. Altec will notify owners, and dealers will inspect the vehicles and correct them to require the proper outrigger operation, as necessary, free of charge. The recall is expected to begin July 30, 2019. Owners may contact Altec customer service at 1-877-462-5832. Altec's number for this recall is CSN 720.

19V-409

Braun Corporation (Braun) is recalling certain 2014-2019 Toyota Sienna mobility van conversions. The brake lines may have incorrect tube nut fittings installed, which may cause a pressure drop within the braking system. The reduction in the braking system pressure may cause a loss of braking power in the rear braking system, increasing the risk of crash. Braun has notified owners, and dealers will install an adaptor to correct the issue, free of charge. The recall began June 25, 2019. Owners may contact Braun customer service at 1-800-488-0359.

19V-410

Ferrari North America, Inc. (Ferrari) is recalling certain 2018 488 Spider, 488 Pista, 2015 458 Speciale A, 2016-2018 488 GTB, 2015-2017 F12 Berlinetta, 2016 F12 tdf, and 2016-2018 California T vehicles. The air bag Electronic Control Unit (ECU) may malfunction, possibly causing the non-deployment or improper deployment of the air bags and/or seat belt pretensioners. In the event of a crash, air bags and/or seat belt pretensioners that do not deploy as intended can increase the risk of injury. Ferrari will notify owners, and dealers will replace the air bag ECU, free of charge. The recall is expected to begin August 7, 2019. Owners may contact Ferrari customer service at 1-201-816-2668. Ferrari's number for this recall is 70.

19V-411

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2019**

Published July 23, 2019

Honda (American Honda Motor Co.) is recalling certain 2019 CB300R, 2018 CBR300R, 2018 CRF250L, 2018 CRF250L Rally, and 2018-2019 CMX300 motorcycles. The circlip, on the transmission's main shaft, may detach allowing for gear misalignment. A misaligned gear can shift the transmission from neutral into gear during engine start, potentially resulting in unexpected motorcycle movement or seize the transmission and rear wheel while the motorcycle is in motion. Both conditions increase the risk of crash or injury. Honda will notify owners, and dealers will replace the transmission main shaft, free of charge. The recall began July 8, 2019. Owners may contact Honda customer service at 1-866-784-1870. Honda's number for this recall is KK3.

19V-412

Life Line Emergency Vehicles (Life Line) is recalling certain 2017-2018 Ford chassis-based Type I ambulances equipped with ASA Electronics Voyager monitors used to display the back-up camera image. These displays may unexpectedly revert back to the factory default settings which may cause the camera image to be reversed. The driver may inadvertently turn the wrong direction to avoid an object behind the vehicle, increasing the risk of a crash. Life Line will work with ASA to notify owners and provide a remedy, free of charge. The recall began March 29, 2019. Owners may contact ASA Electronics customer service at 1-800-384-4400 or Life Line Emergency Vehicles at 1-563-578-3317.

19V-413

Farber Specialty Vehicles (Farber) is recalling certain 2018 Ford F-550 vehicles equipped with ASA Electronics Voyager monitors used to display the back-up camera image. The affected monitors may revert back to the factory default settings which can cause the camera image to be reversed. The driver may inadvertently turn the wrong direction to avoid an object behind the vehicle, increasing the risk of a crash. Farber will notify owners, and dealers will add a harness relay capacitor module, free of charge. The recall is expected to begin in July 2019. Owners may contact Farber customer service at 1-800-331-3188 or ASA customer service at 1-800-384-4400.

19V-414

Volkswagen Group of America, Inc. (Audi) is recalling certain 2019 Audi A8 vehicles equipped with rear relaxation seats. The front passenger seat track rivet may fail and cause the spindle bracket to separate. A failure of the seat track rivet increases the risk of injury during a crash. Audi will notify owners, and dealers will replace the passenger seat tracks, free of charge. The recall is expected to begin August 2, 2019. Owners may contact Volkswagen customer service at 1-800-253-2834. Audi's number for this recall is 72J3.

19V-415

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2018-2019 Audi Q5 and SQ5 vehicles. The wheel arch cover trim may loosen and detach. The detached trim may become a road hazard, increasing the risk of crash. Volkswagen will notify owners, and dealers will secure the wheel arch trim with an additional screw and nut, free of charge. The recall is expected to begin August 2, 2019. Owners may contact Volkswagen customer at 1-800-253-2834. Volkswagen's number for this recall is 66K6.

19V-416

Thor Motor Coach (TMC) is recalling certain 2019-2020 Magnitude, Omni motorhomes, models BB35 and

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2019**

Published July 23, 2019

BH35. Wires located in the electrical junction box may move around and contact an extra screw that was errantly installed. Contact with the screw may result in the wiring insulation being damaged, increasing the risk of an electrical short circuit and a fire. TMC will notify owners, and dealers will inspect the junction box and remove the extra screw, and repair any damaged wiring, as necessary, free of charge. The recall began on July 15, 2019. Owners may contact TMC customer service at 1-877-855-2867. TMC's number for this recall is RC000169.

19V-417

Suzuki Motor of America, Inc. (Suzuki) is recalling certain 2018-2019 GSX250R motorcycles. Water intrusion may corrode the rear brake light switch causing the rear brake light to fail to illuminate or remain illuminated continuously when the brake is not applied. A failure of the brake light to illuminate, or continued illumination when the brakes are not being applied, can increase the risk of a crash. Suzuki will notify owners, and dealers will replace the rear brake stop light switch, free of charge. The recall began June 28, 2019. Owners may contact Suzuki customer service at 1-800-934-0934. Suzuki's number for this recall is 2A90.

19V-418

Diamond Coach Corporation (Diamond Coach) is recalling one 2017 VIP 2800 vehicle equipped with an ASA Electronics Voyager monitor used to display the back-up camera image. This display may unexpectedly revert back to the factory default settings which may cause the camera image to be reversed. The driver may inadvertently turn the wrong direction to avoid an object behind the vehicle, increasing the risk of a crash. ASA Electronics has notified the affected Diamond Coach owner, and will provide a remedy, free of charge. The recall began on April 2, 2019. Owners may contact ASA Electronics customer service at 1-800-384-4400 or Diamond Coach at 1-800-442-4645.

19V-419

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain 2020 Range Rover Evoque vehicles. The fuse for the front and rear windshield washer system may fail and reduce driver visibility. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 104, "Windshield Wiping and Washing Systems." The driver's reduced visibility can increase the risk of a crash. Land Rover will notify owners, and dealers will replace the fuse for the front and rear washer systems, free of charge. In addition, the Engine Junction Box lid will be replaced and an owner's manual insert will be added with the updated fuse rating information. The recall is expected to begin August 2, 2019. Owners may contact Land Rover customer service at 1-800-637-6837. Land Rover's number for this recall is N341.

19V-421

Navistar, Inc. (Navistar) is recalling certain 2020 International HV Severe Service Diesel Trucks. The steer axle hubs may be insufficiently lubricated or not lubricated at all, which may result in wheel bearing damage. Lack of lubrication may result in a wheel separating from the front axle spindle, increasing the risk of crash. Navistar has notified owners, and dealers will inspect the steer axle wheel hubs for the proper fluid level and repair any damaged components, free of charge. The recall began June 14, 2019. Owners may contact Navistar customer service at 1-800-448-7825. Navistar's number for this recall is 19509.

19V-422

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2019**

Published July 23, 2019

SkyMark Refuelers is recalling certain 2018 Flowmark Vacuum Truck vehicles equipped with Voyager monitors used to display the back-up camera image. The monitors unexpectedly may revert back to the factory default settings which may cause the camera image to be reversed. The driver may inadvertently turn the wrong direction to avoid an object behind the vehicle, increasing the risk of a crash. SkyMark Refuelers will work with ASA Electronics to owners, and remedy the displays, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact ASA Electronics customer service at 1-800-384-4400 or SkyMark Refuelers at 1-913-749-1209.

19V-423

Acura (American Honda Motor Co.) is recalling certain 2016-2019 Acura ILX vehicles. Excessive grease may prevent the set-ring on the half shaft from fully engaging, allowing the driveshaft to separate from the half shaft. A separated driveshaft can cause the vehicle to have a loss of drive or allow the vehicle to move even while in Park, increasing the risk of a crash or injury. Acura will notify owners, and dealers will inspect, and, as necessary, replace the driveshaft and half shaft, free of charge. The recall is expected to begin July 29, 2019. Owners may contact Acura customer service at 1-888-234-2138. Acura's number for this recall is G54.

19V-424

Mazda North American Operations (Mazda) is recalling certain 2019 Mazda3 vehicles. The lug nuts on all four wheels may loosen, potentially resulting in a wheel detaching from the vehicle. A wheel separating from the vehicle increases the risk of a crash. Mazda will notify owners, and dealers will tighten the front and rear wheel lug nuts to the correct specification, free of charge. The recall began July 9, 2019. Owners may contact Mazda customer service at 1-800-222-5500, Option 4. Mazda's number for this recall is 3519F.

19V-425

Newmar Corporation (Newmar) is recalling certain 2016-2019 Ventana LE and 2017-2019 Dutch Star, Essex, London Aire, Mountain Aire and Ventana, and 2018-2019 New Aire motorhomes built on a Daimler trucks chassis. The rear mounted Power Distribution Module (PDM) may have been damaged during manufacturing, possibly resulting in the rear marker lights, brake lights, or turn signals not functioning. Nonfunctioning lights can increase the risk of a crash. Newmar will notify owners, and Daimler Trucks dealers will inspect and replace the rear PDM, as necessary, free of charge. The recall began July 18, 2019. Owners may contact Newmar customer service at 1-800-731-8300. Newmar's number for this recall is 18V-852.

19V-426

Forest River, Inc. (Forest River) is recalling certain 2011-2017 Glaval Universal transit buses, models US50225, US50225C, US50226, US50226C, and US80227C. The buses are missing one egress window on the curbside and roadside of the vehicle. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 217, "Bus Emergency Exits and Window Retention and Release." In the event of an emergency necessitating escape from the vehicle, the lack of egress windows may trap occupants inside, increasing their risk of injury. Forest River will notify owners, and dealers will install one additional egress window on each the curbside and roadside of the vehicle, free of charge. The recall began June 24, 2019. Owners may contact Forest River customer service at 1-800-348-7440. Forest River's number for this recall is 05-1029.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2019**

Published July 23, 2019

19V-427

Unicell Body Company Inc. (Unicell) is recalling certain 2017-2019 Chevrolet Express and GMC Savanna, 2018-2019 Hino 155, Ford Econoline and Transit and Isuzu NPR, and 2018 Ram ProMaster-based vehicles equipped with ASA Electronics Voyager monitors used to display the back-up camera image. The affected monitors may revert back to the factory default settings which may cause the camera image to be reversed. The driver may inadvertently turn the wrong direction to avoid an object behind the vehicle, increasing the risk of a crash. Unicell will work with ASA Electronics to notify owners and offer a remedy, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact ASA Electronics customer service 1-800-384-4400 or Unicell at 1-716-853-8628.

19V-428

Mickey Truck Bodies, Inc. (Mickey Truck Bodies) is recalling certain 2017-2018 Ford F-750 based vehicles equipped with ASA Electronics Voyager monitors used to display the back-up camera image. The affected monitors may revert back to the factory default settings which may cause the camera image to be reversed. The driver may inadvertently turn the wrong direction to avoid an object behind the vehicle, increasing the risk of a crash. Mickey Truck Bodies will work with ASA Electronics to notify owners, and provide a remedy to keep the image from reversing, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact ASA Electronics customer service at 1-800-384-4400 or Mickey Truck Bodies at 1-336-882-6806.

19V-429

Morgan Olson Corporation (Morgan Olson) is recalling certain 2018 P31 vehicles equipped with ASA Electronics Voyager monitors used to display the back-up camera image. The affected monitors may revert back to the factory default settings which may cause the camera image to be reversed. The driver may inadvertently turn the wrong direction to avoid an object behind the vehicle, increasing the risk of a crash. Morgan Olson will work with ASA Electronics to notify owners and remedy the displays, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact ASA Electronics customer service at 1-800-384-4400 or Morgan Olson at 1-800-262-3437.

19V-430

Farber Specialty Vehicles (Farber) is recalling certain specialty vehicles built on 2018 Freightliner XCR chassis equipped with air disc brakes. The brake caliper mounting bolts may not have been sufficiently tightened. Loose brake caliper mounting bolts can reduce brake effectiveness, increasing the risk of a crash. Farber will notify owners, and Daimler Trucks North America authorized service facilities will inspect and repair the vehicles as necessary, free of charge. The recall is expected to begin in July 2019. Owners may contact Farber customer service at 1-800-331-3188.

19V-431

Ford Motor Company (Ford) is recalling certain 2009-2016 Ford Econoline vehicles equipped with a 5R110W transmission, 5.4L engine, and a school bus or ambulance preparation package. A weld within the coast clutch

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2019**

Published July 23, 2019

may fail, causing an unexpected loss of drive power. A sudden loss of drive power increases the risk of a crash. Transferring occupants of a disabled school bus or ambulance to another vehicle increases their risk of injury. Ford will notify owners, and dealers will replace the single-engaging coast one-way clutch with a new dual-engaging one-way clutch, free of charge. Interim notices informing owners of the safety risk were mailed June 25, 2019. Owners will receive a second notice when the remedy becomes available which is expected to be in September 2019. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 19S20.

19V-432

Ford Motor Company (Ford) is recalling certain 2013 F-150 vehicles equipped with 5.0L or 6.2L gasoline engines, that previously had the powertrain control module (PCM) software reprogrammed under recall 19V-075. The software used to reprogram the PCM did not have the necessary updates to prevent the transmission from unexpectedly downshifting into first gear, regardless of vehicle speed. Unexpectedly downshifting into first gear may result in a loss of vehicle control, increasing the risk of a crash. Ford will notify owners, and dealers will reprogram the powertrain control module, free of charge. The recall began June 24, 2019. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 19S19.

19V-433

Volkswagen Group of America, Inc. (Audi) is recalling certain 2019 Audi e-tron vehicles. Moisture can enter the high-voltage battery system through a faulty seal on the charging socket. Moisture in the high-voltage system can cause a short-circuit, increasing the risk of fire. If warning lights appear along with the message "Electrical system: fault," immediately stop driving the vehicle, park outdoors away from structures, do not charge the vehicle, and contact Audi Roadside Assistance at 1-800-411-9988 to have the vehicle towed. Audi will notify owners, and dealers will install a new seal and, as necessary, replace the affected system components, free of charge. Notices informing owners of the safety risk were mailed June 24, 2019. Remedy parts are expected to become available in August 2019. Owners may contact Audi's customer service at 1-800-253-2834. Audi's number for this recall is 93E8.

19V-434

Ford Motor Company (Ford) is recalling certain 2011-2017 Explorer vehicles. The rear suspension toe links may fracture due to stress on the rear suspension. A fractured rear toe link will cause a sudden change in vehicle handling and increase the risk of a crash. Ford will notify owners, and dealers will replace the rear suspension toe links, free of charge. The recall began June 26, 2019. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 19S17.

19V-435

Entegra Coach (Entegra) is recalling certain 2020 Anthem and Cornerstone motorhomes. The steering shaft bolt may have been insufficiently tightened. An unsecured bolt may cause the steering wheel not to function, increasing the risk of a crash. Entegra will notify owners, and dealers will inspect the motorhome and tighten the steering shaft bolt, as necessary, free of charge. The recall began June 17, 2019. Owners may contact Entegra customer service at 1-800-517-9137. Entegra's number for this recall is 9803435.

19V-436

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2019**

Published July 23, 2019

Lakota Corporation (Lakota) is recalling certain 2018-2020 Colt 6-foot 9-inch wide horse trailers. The aluminum axle carrier may be too weak to and begin to tear. If the carrier begins to tear, the stability of the trailer may be affected, increasing the risk of crash. Lakota will notify owners, and dealers will add additional aluminum structure to reinforce the trailers, free of charge. Owners may contact Lakota customer service at 1-574-848-1636.

19V-437

Chrysler (FCA US LLC) is recalling certain 2019 Jeep Renegade vehicles equipped with the Upland trim package. The Occupant Restraint Controller (ORC) may have been incorrectly calibrated. The miscalibrated ORC may incorrectly deploy the air bags during a frontal crash, increasing the risk of injury. Chrysler will notify owners, and dealers will reprogram the ORC. The recall is expected to begin July 31, 2019. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is V73.

19V-438

LA West Inc. (LA West) is recalling certain 2018-2019 Ford Transit vehicles modified to be equipped with glass roof hatches. Temperature and vibration stresses may cause the tempered glass roof hatch to shatter. If the tempered glass roof hatch shatters, glass fragments may fall onto passengers, increasing the risk of an injury. LA West will notify owners, and dealers will replace the hatch lids, free of charge. The recall began July 11, 2019. Owners may contact LA West customer service at 1-704-498-4940.

19V-439

Keystone RV Company (Keystone) is recalling certain 2020 Crossroads Cruiser fifth wheel recreational trailers, models 27MK, 29SI, 28RD, 24RL and 29RK. The furnace exhaust vent may be missing. If the furnace is used without an exhaust vent installed, carbon monoxide poisoning may result, increases the risk of injury. Keystone will notify owners, and dealers will install a furnace exhaust vent if it is missing, free of charge. The recall began on July 12, 2019. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 19-355.

19V-440

Godwin Manufacturing Company, Inc. (Godwin) is recalling certain 2017 453USS10/26 dump body vehicles equipped with Whelen brake lights. Depending on the specific wiring of the vehicle, these brake lights may illuminate when the brake pedal has not been pressed. If the brake lights incorrectly illuminate, it can confuse other drivers, possibly increasing the risk of a crash. Godwin has notified owners and Whelen has provided replacement brake lights, fee of charge. The recall began April 1, 2019. Owners may contact Godwin customer service at 1-800-892-0181 or Whelen customer service at 1-860-718-2331.

19V-441

Vac-Tron Equipment, LLC. (Vac-Tron) is recalling certain 2015-2019 LP873SDT Heavy, Vacuum Excavator-dual axle trailers. The trailer may lack front and rear lights, including clearance lamps, reflex reflectors, and side reflex reflectors. The trailers may also may have an insufficient amount of reflective tape on the sides and rear. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." Due to the lack of lamps and

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2019**

Published July 23, 2019

insufficient reflective tape, the trailer may not be visible at night, increasing the risk of crash. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Vac-Tron customer service at 1-888-822-8766.

19V-442

Daimler Trucks North America LLC (DTNA) is recalling certain 2019-2020 Business Class M2 and 2020 108SD vehicles equipped with Meritor MX 120 EVO Front Drive Steer axles. The axles may have insufficient lubrication, which may result in damage to the wheel end bearings. If the bearings are damaged, the wheel may separate and cause a sudden loss of vehicle control, increasing the risk of crash. DTNA will notify owners, and dealers will inspect and replace the wheel end components, as necessary, free of charge. The recall is expected to begin August 9, 2019. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-817.

19V-443

Daimler Trucks North America LLC (DTNA) is recalling certain 2010-2020 Thomas Built Buses Saf-T-Liner C2, 2016-2019 HDX, and 2017-2019 EFX school buses equipped with Bendix Air Disc Brakes. The driver side rear brakes may drag. The dragging brakes may lead to high temperatures at the wheel end, increasing the risk of smoke and fire, possibly resulting in the bus having to be evacuated, which can increase the risk of injury. DTNA will notify owners, and dealers will install a new caliper with an updated clearance adjustment mechanism, free of charge. The recall is expected to begin August 9, 2019. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-818.

19V-444

Porsche Cars North America, Inc. (Porsche) is recalling certain 2019 911 GT2 RS and 2020 911 Carrera S Coupe vehicles. The bolts connecting the driveshaft to the wheel hub may not have been properly tightened. If the driveshaft disconnects from the wheel hub, it can increase the risk of crash. Porsche will notify owners, and dealers will properly tighten the driveshaft connection to the wheel hub, free of charge. The recall is expected to begin August 11, 2019. Owners may contact Porsche customer service at 1-800-767-7243. Porsche's number for this recall is AKB2.

19V-445

Porsche Cars North America, Inc. (Porsche) is recalling certain 2003-2006 Cayenne S, Cayenne Turbo, 2004-2010 Cayenne, 2006 Cayenne Turbo S, 2010-2016 Panamera S, Panamera 4 S, Panamera Turbo, 2011-2016 Panamera, Panamera 4, 2012-2013 Panamera Turbo S, 2013-2016 Panamera 4 GTS, 2014-2016 Panamera 4 S Executive, Panamera Turbo Executive, Panamera Turbo S G1 II, Panamera Turbo S Executive, 2013 Panamera 4 Platinum Edition, Panamera Platinum Edition, 2016 Panamera 4 Edition, Panamera Edition, Panamera Turbo S Executive Luxury Sports vehicles.

The bushing that attaches the gear selector lever to the gearbox may degrade over time, causing the bushing to detach. This condition could allow the driver to move the shift lever to Park and remove the ignition key, while the transmission may not be in Park, with no warning message or audible chime. If the vehicle is exited without the transmission being in Park and without the parking brake being applied, the vehicle may unexpectedly move,

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2019**

Published July 23, 2019

increasing the risk of a crash. Porsche will notify owners, and dealers will replace the shifter cable bushing, free of charge. Owners are instructed to use the parking brake until their vehicle is repaired. The recall is expected to begin August 11, 2019. Owners may contact Porsche customer service at 1-800-767-7243. Porsche's number for this recall is AKB1.

19V-446

Chrysler (FCA US LLC) is recalling certain 2014 Jeep Cherokee vehicles equipped with 3.2L engines. In the event that a clutch becomes stuck in the transmission, the transmission software may shift the transmission to neutral. An unexpected shift to neutral would result in a loss of drive, increasing the risk of crash. Chrysler will notify owners, and dealers will update the transmission software, free of charge. The recall is expected to begin August 2, 2019. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is V69.

19V-447

Chrysler (FCA US LLC) is recalling certain 2019 Ram 1500 trucks. The spare tire provided may differ in size and required inflation pressure from the information on the tire placard label. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims." The driver, referencing the tire placard label, may incorrectly inflate the spare tire, increasing the risk of a crash. Chrysler has notified owners, and dealers will replace the incorrect size spare tire with the correct size spare tire, free of charge. The recall began June 27, 2019. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is V67.

19V-448

Chrysler (FCA US LLC) is recalling certain 2019 Jeep Cherokee vehicles. The impact and acceleration sensors may fail and reduce the air bag system's ability to properly detect certain crash events. In the event of a crash, the inability to properly detect a crash may result in improper air bag deployment, increasing the risk of injury. Chrysler will notify owners, and dealers will replace the affected sensors, free of charge. The recall is expected to begin August 2, 2019. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is V63.

19V-449

Erwin Hymer Group North America, Inc. (Erwin Hymer) is recalling 2013-2019 Roadtrek E-Trek, RS Adventurous, CS Adventurous, and TS Adventurous motorhomes built on Sprinter chassis and equipped with one or two second row captain's chairs, with integrated seat belts. The seat pedestal base anchor brackets to the chassis frame may not have enough strength to prevent the seat and seat belt from moving in the event of a crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 210, "Seat Belt Assembly Anchorages" and 207, "Seating Systems." In the event of a crash, the second-row captain seats may not provide adequate protection for occupants, increasing their risk of injury. The recall began June 26, 2019. Owners may contact Erwin Hymer customer service at 1-844-464-3735. Erwin Hymer's number for this recall is 2019-01.

19V-450

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2019**

Published July 23, 2019

Gillig LLC (Gillig) is recalling certain 2018-2019 Low Floor vehicles equipped with a certain batch of glass roof hatches. Temperature and vibration stresses may cause the tempered glass roof hatch to shatter. If the tempered glass roof hatch shatters, glass fragments may fall onto passengers, increasing the risk of an injury. Gillig will notify owners, and the glass hatch manufacturer will provide replacement hatch lids, free of charge. The recall began June 27, 2019. Owners may contact Gillig customer service at 1-510-264-5073 or 1-800-735-1500.

19V-451

PACCAR Incorporated (PACCAR) is recalling certain 1990-2020 Peterbilt 320 and 520 vehicles built with specific amber rear turn signals. The turn signals may also light up with the stop/tail lights when the brakes are applied. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." Rear Turn signals that illuminate at the same time as the brake lights may create confusion and impair the effectiveness of the brake lights, increasing the risk of a crash. PACCAR will notify owners, and for trucks with rear amber lights, dealers will add a jumper harness between the chassis electrical harness and amber tail lights, free of charge. The recall is expected to begin August 1, 2019. Owners may contact PACCAR customer service at 1-940-591-4220. PACCAR's number for this recall is 19PBC.

19V-452

Forest River, Inc. (Forest River) is recalling certain 2019-2020 Cherokee trailers, model CKT294BH. The Federal Placard states incorrect Cargo Carrying Capacity (CCC) and Gross Vehicle Weight Rating (GVWR) information, which may result in the trailer being overloaded. An operator may rely on the incorrect Placard information and overload the trailer causing a loss of control and increasing the risk of a crash. Forest River has notified owners, providing replacement placards that contain accurate Gross Vehicle Weight Rating and Cargo Carrying Capacity information, free of charge. The recall began June 24, 2019. Owners may contact Forest River customer service at 1-541-995-3447. Forest River's number for this recall is 64-1033.

19V-453

Forest River, Inc. (Forest River) is recalling certain 2017-2018 Berkshire Coach Ultra UL1912 and UL1913 motorhomes. Water and contaminants may get into the block heater cable's splice connector causing corrosion and damage. When the heater is plugged in, prolonged corrosion could cause a resistive short, increasing the risk of overheated or melted wiring which can increase the risk of a fire. Forest River will notify owners, and Ford dealers will disable the vehicle's engine block heater cable, free of charge. The recall began June 27, 2019. Owners may contact Ford customer service at 1-866-436-7332. Forest River's number for this recall is 78-1032.

19V-454

Altec Industries Inc. (Altec) is recalling certain 2017-2018 LR7, TA50/55/60 and L42/45 Aerial Devices. Multiple fasteners used to secure the rotation bearing may break, possibly resulting in the pedestal separating from the turntable. If the pedestal separates from the turntable, it can increase the risk of injury or death. Altec will notify owners, and dealers will replace the affected fasteners, free of charge. The recall is expected to begin August 14, 2019. Owners may contact Altec customer service at 1-877-462-5832. Altec's number for this recall is CSN 722.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2019**

Published July 23, 2019

19V-455

Autocar, LLC (Autocar) is recalling certain 2013-2018 Autocar Xpeditor vehicles. The drive shaft support cross member may fail. If the cross member fails, the components that it supports may come loose from the vehicle, increasing the risk of crash. Autocar will notify owners, and dealers will install additional support brackets and cross members and replace any damaged components, free of charge. The recall is expected to begin August 8, 2019. Owners may contact Autocar customer service at 1-888-218-3611 or 1-877-973-3486. Autocar's number for this recall is ACX-1906.

19V-456

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain 2016-2017 AMG GTS vehicles. The bonding between the carbon-fiber driveshaft and the engine/transmission flange may be insufficient, causing the driveshaft to separate while in motion. If the driveshaft separates, there may be a loss of drive, increasing the risk of crash. MBUSA will notify owners, and dealers will replace the carbon-fiber draft shaft, including the flange, free of charge. The recall is expected to begin August 13, 2019. Owners may contact MBUSA customer service at 1-800-367-6372.

19V-457

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain 2020 GLE350 4Matic and GLE450 4Matic vehicles. In the event of a crash while the temperature in the passenger cabin is very high, the passenger frontal air bag deployment may be delayed or may not completely deploy. An air bag that does not deploy as intended can increase the risk of injury in the event of a crash. MBUSA will notify owners, and dealers will replace the passenger air bag module, free of charge. The recall is expected to begin August 13, 2019. Owners may contact MBUSA customer service at 1-800-367-6372.

19V-458

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain 2020 GLE350 4Matic and GLE450 4Matic vehicles. A welding error during production may have resulted in a small hole in the floor, possibly allowing water to leak into the passenger cabin. Water in the passenger compartment may affect the vehicle's electrical systems, increasing the risk of a crash or injury. MBUSA will notify owners, and dealers will seal the affected area, free of charge. The recall is expected to begin August 13, 2019. Owners may contact MBUSA customer service at 1-800-367-6372.

19V-459

Proterra, Inc. (Proterra) is recalling certain 2018-2019 Catalyst buses equipped with a certain batch of glass roof hatches. Temperature and vibration stresses may cause the tempered glass roof hatch to shatter. If the tempered glass roof hatch shatters, glass fragments may fall onto passengers, increasing the risk of an injury. Proterra will notify owners, and the glass hatch manufacturer will provide replacement hatch lids, free of charge. Owners may contact Proterra at 1-864-438-0000. Proterra's number for this recall is SC-19-79.

19V-460

Maserati North America, Inc. (Maserati) is recalling certain 2015-2018 Granturismo and 2016-2018

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2019**

Published July 23, 2019

Granturismo Convertible vehicles. The air bag Electronic Control Unit (ECU) may have a defective power supply capacitor that can cause a deactivation or inadvertent deployment of the air bag. A deactivated air bag increases the risk of injury. An inadvertent deployment of the air bag increases the risk of a crash. Maserati will notify owners, and dealers will replace the air bag ECU, free of charge. The recall is expected to begin July 30, 2019. Owners may contact Maserati customer service at 1-877-696-2737. Maserati's number for this recall is 386.

19V-461

Caterpillar Inc. (Caterpillar) is recalling certain 2015-2019 Progress Rail 75HRT SkyTrim Hi-Rail vehicles. The boom cradle includes a support plate that may block the driver's visibility. Additionally, the slew may be insufficient, which may result in the detachment of the boom from the cradle while the vehicle is in motion. The lack of visibility may increase the risk of crash. The detachment of the boom and cradle may become a road hazard, increasing the risk of crash. Caterpillar will notify owners, and Progress Rail dealers will relocate the boom cradle to provide visibility for the driver, and revise the boom hydraulic circuit to prevent an inadvertent boom in the event of a hose failure or leak. These repairs will be performed free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Caterpillar customer service at 1-800-447-4986.

19V-462

Farber Specialty Vehicles (Farber) is recalling certain 2017 Ford F-550 vehicles equipped with Whelen brake lights. Depending on the specific wiring of the vehicle, these brake lights may illuminate when the brake pedal has not been pressed. If the brake lights incorrectly illuminate, it can confuse other drivers, possibly increasing the risk of a crash. Farber will notify owners, and Whelen will remedy the lights, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Whelen customer service at 1-860-718-2331 or Farber at 1-800-331-3188.

19V-463

Farber Specialty Vehicles (Farber) is recalling certain 2018 International 4300 SBA vehicles equipped with Whelen brake lights. Depending on the specific wiring of the vehicle, these brake lights may illuminate when the brake pedal has not been pressed. If the brake lights incorrectly illuminate, it can confuse other drivers, possibly increasing the risk of a crash. Farber will notify owners, and Whelen will remedy the lights, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Whelen customer service at 1-860-718-2331 or Farber at 1-800-331-3188.

19V-464

Altec Industries Inc. (Altec) is recalling certain 2003-2019 Altec AD108 Cable handlers and HLIW-T Trailer Mounted Insulator Washer vehicles. The vehicles may be equipped with non-DOT brake line fittings that may leak at the air fittings. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 106, "Brake Hoses." If the brake lines leak, the parking brake may drag, increasing the risk of crash. Altec will notify owners, and dealers will inspect the vehicles and replace the brake line air fittings if necessary, free of charge. The recall is expected to begin August 13, 2019. Owners may contact Altec customer service at 1-877-462-5832. Altec's number for this recall is CSN 723.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2019**

Published July 23, 2019

19V-465

SVO Group Inc. (SVO Group) is recalling certain 2017-2018 Ford E-350 and E-450-based shuttle buses equipped with ASA Electronics Voyager monitors used to display the back-up camera image. The affected monitors may revert back to the factory default settings which may cause the camera image to be reversed. The driver may inadvertently turn the wrong direction to avoid an object behind the vehicle, increasing the risk of a crash. SVO Group will work with ASA to notify owners, and ASA will provide a harness relay capacitor module to eliminate the image reversal, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact ASA Electronics customer service at 1-800-384-4400.

19V-466

Isuzu Technical Center of America, Inc. (Isuzu) is recalling certain 2018-2020 FTR and Chevrolet 6500XD vehicles. The jam nut for the steering stopper bolt on the left front knuckle may loosen and allow the bolt to back away from the steering knuckle, increasing the turning radius of the vehicle in a left turn. If the vehicle's turning radius is increased, there is an increased risk of a crash. Isuzu will notify owners, and dealers will replace the existing left and right jam nuts with a Grade 8 jam nut, torque the nut to a new torque specification and apply Loctite to the nut and bolt, free of charge. The recall began July 19, 2019. Owners may contact Isuzu customer service at 1-866-441-9638, GM owners may contact GM customer service at 1-800-862-4389. Isuzu's number for this recall is V1902.

19V-467

Blue Bird Body Company (Blue Bird) is recalling certain 2018-2019 Vision and All American school buses equipped with PowerDrive 7000 EV electric drivetrains. The Vehicle Control Unit (VCU) may unexpectedly shut down the high voltage contactors, resulting in loss of all systems powered by high voltage, including the traction drive system and power steering. An unexpected loss of drive and power steering may increase the risk of a crash. Cummins will notify Blue Bird owners and will update the VCU software with a revised version, free of charge. The recall is expected to begin August 1, 2019. Owners may contact Cummins customer service at 1-800-286-6467 or Blue Bird at 1-478-822-2242. Blue Bird's number for this recall is R19AE (SB).

19V-471

BMW of North America, LLC (BMW) is recalling certain 2009 328i and 328xi, 2009-2011 335d, 2008-2012 M3 Coupe and M3 Convertible, and 2008-2011 M3 Sedan vehicles. The connection of the positive battery cable at the fuse box terminal may degrade, resulting in an intermittent loss of electrical power. A loss of electrical power can cause the vehicle to stall, increasing the risk of a crash. BMW will notify owners, and dealers will replace and secure the positive battery cable connector, free of charge. The recall is expected to begin August 12, 2019. Owners may contact BMW customer service at 1-800-525-7417. Note: This recall is an expansion of a previous recall, number 18V-314.

19V-472

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2019 Audi Q5 and SQ5 vehicles. In the event of a crash deploying the passenger's frontal air bag, the instrument panel carrier may break due to incorrect welding. If the carrier breaks, there may be damage to the passenger frontal air bag. A damaged frontal air bag

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2019**

Published July 23, 2019

may not provide adequate protection, increasing the risk of an injury. Audi will notify owners, and dealers will replace the instrument panel and the passenger frontal air bag, free of charge. The recall is expected to begin August 18, 2019. Owners may contact Volkswagen customer service at 1-800-253-2834. Volkswagen's number for this recall is 90N1.

19V-473

Volkswagen Group of America, Inc. (Audi) is recalling certain 2015-2016 Audi S3 Sedan, 2015-2019 A3 Sedan and A3 Cabriolet, 2016-2018 A3 e-tron, and 2017-2019 RS3 vehicles. An improper electrical contact may cause the Passenger Occupant Detection System (PODS) to falsely detect a malfunction and deactivate the passenger air bag. A deactivated passenger air bag increases the risk of injury during a crash. Audi will notify owners, and dealers will replace the connector and reroute the cable, free of charge. The recall is expected to begin August 18, 2019. Owners may contact Volkswagen customer service at 1-800-253-2834. Audi's number for this recall is 69Z4.

19V-474

Forest River, Inc. (Forest River) is recalling certain 2017-2020 Coachmen Chapparral, Chapparral Lite, Chapparral X-Lite and Shasta Phoenix recreational trailers. The outside kitchen may be equipped with a standard outlet receptacle and not a Ground Fault Circuit Interrupter (GFCI) protected outlet. If the outside kitchen receptacles are not GFCI protected, occupants may be electrically shocked, increasing the risk of injury or death. Forest River will notify owners, and dealers will replace a standard 110V outlet in the exterior kitchen with a Ground Fault Circuit Interrupter (GFCI) one. The recall is expected to begin July 31, 2019. Owners may contact Forest River customer service at 1-574-825-8360. Forest River's number for this recall is 110-1035.

19V-476

Spartan Motors USA (Spartan) is recalling certain 2012-2019 Fleet Utilimaster Walk In vehicles built on a DTNA chassis. The brake pedal clevis pin clip may rub or bend on the throttle pedal and possibly detach. If the clip is detaches and clevis pin slides out of position, the brake lights may fail. Loss of brake lights may mislead other drivers if they are unaware the vehicle is stopping or slowing down, which increases the risk of crash. If the pin continues to slide out further, the pedal may detach, increasing the risk of crash. DTNA will notify Spartan owners, and DTNA dealers will inspect the clevis pin clearance and correct it as necessary, free of charge. Owners may contact DTNA customer service at 1-800-547-0712 or Spartan at 1-800-543-5008. Spartan's number for this recall is 19013.

19V-477

Navistar, Inc. (Navistar) is recalling certain 2011 IC Bus BE, CE, and RE school buses equipped with certain non-retractable passenger two-point seat belts. After long term buckling and unbuckling of the seat belt, the plastic fingers on the male portion of the buckle may crack and fall off, requiring excessive force to buckle the seat belt. The seat belt may not easily buckle, increasing the risk of an injury in the event of a crash. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Navistar customer service at 1-800-448-7825.

19V-478

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2019**

Published July 23, 2019

Navistar, Inc. (Navistar) is recalling certain 2011 IC CE transit buses equipped with certain non-retractable passenger two-point lap belts. After long term buckling and unbuckling of the seat belt, the plastic fingers on the male portion of the buckle may crack and fall off, requiring excessive force to buckle the seat belt. In the event of a crash, the seat belt may not buckle or properly restrain a passenger in the event of a crash, increasing the risk of an injury. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Navistar customer service at 1-800-448-7825.

19V-479

Forest River, Inc. (Forest River) is recalling certain 2019-2020 Georgetown and FR3 motorhomes. The slim-rack slide out mechanisms may activate unintentionally, moving the slide room in or out unexpectedly. If the slide-room extends while the vehicle is in motion, there is an increased risk of a crash. Forest River will notify owners, and dealers will provide a new controller and switch for the slideout mechanism, free of charge. The recall is expected to begin July 31, 2019. Owners may contact Forest River at 1-574-206-7600. Forest River's number for this recall is 68-0991.

19V-481

Forest River, Inc. (Forest River) is recalling certain 2020 Work and Play fifthwheel (WPF33W17) trailers. The 12V and 110V cables for an optional generator may not be isolated from objects stored in the generator compartment, which can result in an electrical short. An electrical short can increase the risk of fire. Forest River will notify owners, and dealers will isolate the wires in the generator compartment so that they can't short, free of charge. The recall is expected to begin July 31, 2019. Owners may contact Forest River customer service at 1-574-825-6302. Forest River's number for this recall is 31-1036.

19V-482

Altec Industries Inc. (Altec) is recalling certain 2003-2019 Altec TA45, TA50, TA55, TA60, L37, L39, LRV, LR7, A-T40C, T40P and AP45 vehicles equipped with air-cushioned pintle hitch and/or accessory air components. The accessories utilizing chassis air supply may be missing pressure protection valves. The accessory lines may not prevent service brake line pressure loss due to failure or leakage in the accessory air system. Additionally, the air cushioned pintle hook may have been connected to the incorrect air lines. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 121, "Air Brake Systems." Loss of service brake pressure can increase the risk of a crash. Altec will notify owners, and dealers will inspect the pressure protection installation and repair any unit that does not pass inspection, free of charge. The recall is expected to begin August 14, 2019. Owners may contact Altec customer service at 1-877-462-5832. Altec's number for this recall is CSN 724.

19V-483

Oshkosh Corporation (Oshkosh) is recalling certain 2018 McNeilus Bridgemaster V Concrete Mixer vehicles previously recalled under 18V-322. The vehicles may have received an incorrect replacement part during the recall remedy. The filler neck check valve may seal the tank too tightly, causing the tank to overpressurize and possibly rupture. If the tank ruptures it may cause hydraulic fluid to spill. The ruptured tank can cause injuries from plastic debris. The spilled hydraulic fluid could be hot which could cause burn injuries. If the vehicle is on the road when the tank ruptures, the tank pieces or spilled hydraulic fluid may cause a road hazard which could

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2019**

Published July 23, 2019

increase the risk of a crash. Oshkosh will notify owners, and instruct owners to inspect the vehicle to determine which filler neck was received and installed as part of 18V-322. If found to be incorrect, dealers will replace the filler neck, free of charge. Owners may contact Oshkosh customer service at 1-888-686-7278.

19V-484

Oshkosh Corporation (Oshkosh) is recalling certain 2019 McNeilus Meridian FEL, Atlantic FEL, Contender FEL refuse trucks. The battery cables may have been incorrectly routed and may rub against the fuse box bracket, causing the positive battery cable insulation to wear through. If the battery cable continues to rub against the fuse box bracket, it may short-circuit, increasing the risk of fire. Oshkosh will notify owners to inspect the battery box and reroute the battery cables to ensure they do not come into contact with the fuse box bracket or battery bolts. Owners may contact Oshkosh customer service at 1-888-686-7278.

19V-485

Oshkosh Corporation (Oshkosh) is recalling certain 2018-2019 S-Series Mixer vehicles equipped with Cummins X12 engines with two hydraulic lines. The hydraulic hoses may have been unintentionally switched and installed to the wrong location, which can cause a loss of hydraulic assist steering. Loss of hydraulic assist steering may make it difficult to steer the vehicle, increasing the risk of a crash. Oshkosh will notify owners, and Oshkosh S-Series Service will correct any improperly installed hoses, free of charge. Owners may contact Oshkosh customer service at 1-888-686-7278.

19V-486

Charles Machine Works Inc. (Charles Machine) is recalling certain 2018-2019 Ditch Witch VT9, VT12, VT14, VT17, VT20 and VT24 trailers. The brake wire terminals may have been improperly crimped, which can result in the trailer brakes failing to apply when commanded. If the trailer brakes do not apply as expected, the distance required to stop the trailer may be lengthened, increasing the risk of crash. Charles Machine has notified owners, and dealers will replace the brake terminals with a machine terminal, free of charge. The recall began June 25, 2019. Owners may contact Charles Machine customer service at 1-800-654-6481.

19V-487

Mazda North American Operations (Mazda) is recalling certain 2010-2011 Mazda RX-8 vehicles that were previously recalled under recall 18V-716 but have not yet been repaired.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these inflators may explode due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator explosion may result in sharp metal fragments striking the driver or other occupants resulting in serious injury or death. Mazda will notify owners, and dealers will replace the front passenger air bag inflator with an alternate one, free of charge. The recall began July 9, 2019. Owners may contact Mazda customer service at 1-800-222-5500, option 4. Mazda's number for this recall is 2618F.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2019**

Published July 23, 2019

19V-488

Daimler Vans USA, LLC (DVUSA) is recalling certain 2018-2019 Mercedes-Benz Metris vehicles. An internal sensor within the electric power steering unit may have been improperly manufactured, possibly resulting in the deactivation of the electric power steering assist. An unexpected loss of power steering assist can increase the risk of crash. DVUSA will notify owners, and Metris dealers will replace the steering unit, free of charge. The recall began July 2, 2019. Owners may contact DVUSA customer service at 1-877-762-8267. DVUSA's number for this recall is VS2LENKEPS.

19V-489

Charles Machine Works Inc (Charles Machine) is recalling certain 2018 Ditch Witch VT17, 2018-2019 VT20 and VT24 trailers. The lock nuts that attach the hitch to the trailer may be insufficient to clamp the load after the hitch height has been adjusted. Without a sufficient clamp load, the hitch may unexpectedly detach from the trailer, increasing the risk of a crash. Charles Machine has notified owners, and will provide new hardware, free of charge. The recall began June 28, 2019. Owners may contact Charles Machine customer service at 1-800-654-6481. Charles Machine's number for this recall is ID0568989.

19V-490

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain 2018-2019 Prius C vehicles. The DC-DC converter may fail resulting in the auxiliary battery no longer receiving power from the converter, which may cause a loss of drive. A loss of drive increases the risk of crash. Toyota will notify owners, and dealers will replace the DC-DC converter with a new one, as necessary, free of charge. The recall is expected to begin August 12, 2019. Owners may contact Toyota customer service at 1-888-270-9371. Toyota's number for this recall is K0K.

19V-491

Jerr-Dan Corporation (Jerr-Dan) is recalling certain 2018-2019 Heavy Duty Wrecker vehicles equipped with the optional recovery remote control. If the remote and control system switch is not turned off by the operator, after three minutes of remote inactivity, the truck's engine may unexpectedly shut down. An unexpected engine shut down can increase the risk of crash. Jerr-Dan will notify owners, and dealers will reprogram the remote, free of charge. The recall is expected to begin August 23, 2019. Owners may contact Jerr-Dan customer service at 1-800-926-9666.

19V-492

Subaru of America, Inc. (Subaru) is recalling certain 2019 Legacy and Outback vehicles. Spot welds located on the duct below the cowl panel may have been improperly applied, impacting the vehicle's body strength. In the event of a crash, the reduced strength of the vehicle body may increase the risk of injury. Subaru will notify owners, and dealers will inspect the vehicles and repair or repurchase the vehicle, as necessary, free of charge. Owners may contact Subaru customer service at 1-844-373-6614. Subaru's number for this recall is WUH-93.

19V-493

Nissan North America, Inc. (Nissan) is recalling certain 2017-2019 gasoline, light duty, Titan vehicles. The

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2019**

Published July 23, 2019

alternator harness

may have been damaged during the engine installation process, possibly resulting in an electrical short. An electrical short may cause an engine stall, increasing the risk of a crash. In addition, it increases the risk of a fire. Nissan will notify owners, and dealers will inspect the alternator harness for the proper routing and any damage. The harness will be clipped into the correct position or replaced as necessary, free of charge. Owners may contact Nissan customer service at 1-800-867-7669.

19V-495

Mazda North American Operations (Mazda) is recalling certain 2016 Miata MX-5 vehicles. The skid plate and metal bracket may detach from underneath the vehicle. Parts that separate from the vehicle may become a road hazard, increasing the risk of a crash. Mazda will notify owners, and dealers will replace the skid plate, free of charge. The recall is expected to begin August 26, 2019. Owners may contact Mazda customer service at 1-800-222-5500, option 4. Mazda's number for this recall is 3619F.

19V-496

Mazda North American Operations (Mazda) is recalling certain 2018-2019 CX-5, Mazda6, and 2019 Mazda3 vehicles. A software error in the powertrain control module (PCM) may cause the engine to stall. An unexpected stall increases the risk of a crash. Mazda will notify owners, and dealers will reprogram the PCM software, free of charge. The recall is expected to begin on or before August 26, 2019. Owners may contact Mazda customer service at 1-800-222-5500, option 4. Mazda's number for this recall is 3719F.

19V-497

Chrysler (FCA US LLC) is recalling certain 2019 Ram 2500 and 3500 trucks, and 3500, 4500, and 5500 Cab Chassis vehicles equipped with diesel engines. The fuel lines may leak fuel into the engine compartment. A fuel leak in the presence of an ignition source increases the risk of a fire. Chrysler will notify owners, and dealers will inspect the fuel lines, replacing them if necessary, free of charge. The recall began July 18, 2019. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is V76.

19V-498

Honda (American Honda Motor Co.) is recalling certain 2003 Acura 3.2CL, 2002-2003 3.2TL, 2003-2006 MDX, 2001-2007 Honda Accord, 2001-2005 Civic, 2003-2005 Civic Hybrid, 2001-2005 Civic GX NGV, 2002-2006 CR-V, 2003-2011 Element, 2002-2004 Odyssey, 2003-2008 Pilot and 2006 Ridgeline vehicles.

These vehicles are equipped with driver frontal air bag inflators assembled as a recall remedy part or replacement service part, that may explode due to propellant degradation occurring after long-term exposure to high absolute humidity, temperature and temperature cycling. An inflator explosion may result in sharp metal fragments striking the driver or other occupants resulting in serious injury or death. Honda will notify owners, and dealers will replace the driver frontal air bag inflator, free of charge. The recall is expected to begin August 12, 2019. Owners may contact Honda customer service at 1-888-234-2138. Honda's numbers for this recall are Q5A and Y58.

19V-499

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2019**

Published July 23, 2019

Honda (American Honda Motor Co.) is recalling certain 2013 Acura ILX, 2015 RDX, 2005-2010 and 2012 RL, 2009-2014 TL, 2010 and 2012 ZDX, 2007-2011 CR-V, 2011-2013 and 2015 CR-Z, 2009-2013 Fit, 2013 Fit EV, 2010-2011 and 2013 Insight and 2007-2014 Ridgeline vehicles.

These vehicles are equipped with driver frontal air bag inflators assembled as a recall remedy part or replacement service part, that may explode due to propellant degradation occurring after long-term exposure to high absolute humidity, temperature and temperature cycling. An inflator explosion may result in sharp metal fragments striking the driver or other occupants resulting in serious injury or death. Honda will notify owners, and dealers will replace the driver frontal air bag inflator, free of charge. The recall is expected to begin August 12, 2019. Owners may contact Honda customer service at 1-888-234-2138. Honda's numbers for this recall are S5B and W59.

19V-500

Honda (American Honda Motor Co.) is recalling certain 2003-2006 Acura MDX, 2005-2012 RL, 2003-2007 Honda Accord, 2001-2005 Civic, 2003-2005 Civic Hybrid, 2001-2005 Civic GX NGV, 2002-2006 CR-V, 2003-2011 Element, 2007-2008 Fit, 2002-2004 Odyssey, 2003-2008 Pilot, and 2006-2014 Ridgeline vehicles.

The vehicles are equipped with passenger frontal air bag inflators assembled as a recall remedy part or replacement service part, that may explode due to propellant degradation occurring after long-term exposure to high absolute humidity, temperature and temperature cycling. An inflator explosion may result in sharp metal fragments striking the driver or other occupants resulting in serious injury or death. Honda will notify owners, and dealers will replace the passenger frontal airbag inflator, free of charge. The recall is expected to begin August 12, 2019. Owners may contact Honda customer service at 1-888-234-2138. Honda's numbers for this recall are E5D and X5C.

19V-501

Honda (American Honda Motor Co.) is recalling certain 2009-2014 Acura TSX, 2011-2014 TSX Sport Wagon, 2010-2013 ZDX, 2008-2012 Honda Accord, 2010-2011 Accord Crosstour, 2006-2011 Civic and Civic Hybrid, 2008-2010 Civic GX NGV, 2012-2015 Crosstour, 2007-2011 CR-V, 2009-2013 Fit, 2014 Fit EV, 2010-2014 Insight, and 2009-2015 Pilot vehicles.

The vehicles are equipped with passenger frontal air bag inflators assembled as a recall remedy part or replacement service part, that may explode due to propellant degradation occurring after long-term exposure to high absolute humidity, temperature and temperature cycling. An inflator explosion may result in sharp metal fragments striking the driver or other occupants resulting in serious injury or death. Honda will notify owners, and dealers will replace the passenger frontal air bag inflator, free of charge. The recall is expected to begin August 12, 2019. Owners may contact Honda customer service at 1-888-234-2138. Honda's numbers for this recall are F5F and Q5E.

19V-502

Southeast Toyota Distributors, LLC (SET) is recalling certain 2017-2019 Toyota Camry, Corolla, Rav4,

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2019**

Published July 23, 2019

Sienna, and Yaris iA vehicles equipped with factory-installed floor mats. The load carrying capacity modification label may be incorrect. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims." An incorrect label may lead to unintentionally overloading the vehicle, increasing the risk of a crash. SET will notify owners and provide a corrected label for placement over the inaccurate label, free of charge. The recall is expected to begin August 27, 2019. Owners may contact Toyota customer service at 1-888-270-9371. SET's number for this recall is SET19A.

19V-503

Thor Motor Coach (TMC) is recalling certain 2019-2020 Challenger, Miramar, Magnitude, Outlaw, Omni, and Palazzo motorhomes. The vehicle control system software may cause the slide-out room to move unexpectedly. Unexpected movement of the slide-out room can increase the risk of a crash or injury. TMC will notify owners, and dealers will update the affected software, free of charge. The recall is expected to begin August 28, 2019. Owners may contact TMC customer service at 1-877-855-2867. TMC's number for this recall is RC000170.

19V-504