

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2021**

Published September 22, 2021

CHILD SEATS:

None during June 2021.

EQUIPMENT:

Adventurer LP is recalling certain truck campers equipped with Dometic stoves, model numbers R1731, R2131, and S31, and part numbers 50303, 50430, and 50938, installed in certain Adventurer, Eagle Cap, Overlander, and Scout truck campers. The saddle valve securing bolt may be overtightened, possibly damaging the O-ring seal and causing a continuous gas leak. A gas leak can increase the risk of a fire. Adventurer LP will notify owners, and Dometic service centers will install a remedy kit of gaskets, washers, thread locker bolts, and two round orange labels, free of charge. The manufacturer has not yet provided a schedule for recall notification. Owners may contact Adventurer customer service at 1-509-895-7064.

21E-049

One More Auto Parts Inc. is recalling certain Lasfit headlight bulbs, part number EX-PLAH11FBA. The aftermarket headlight bulb are too bright during the first ten minutes of use. As such these bulbs fail to comply with the Federal Motor Vehicle Safety Standards (FMVSS) number 108, "Lamps, Reflective Devices, and Assoc. Equipment." Excessive brightness can decrease the visibility of oncoming drivers, increasing the risk of a crash. Dealers will provide a full refund or replace the bulbs, free of charge. Owner notification letters were mailed July 21, 2021. Owners may contact One More Auto Parts Inc. customer service at recall2021@onemoreauto.com.

21E-050

Wallace Forge Company (Wallace Forge) is recalling Medium duty adjustable mount couplers part numbers R25160. The coupler may experience excessive play due to a missing .750" radius piece. Excessive play of the mount coupler can cause the trailer to uncouple, increasing the risk of a crash. Dealer will replace the coupler, free of charge. Owner notification letters were mailed on June 24, 2021. Owners may contact Wallace Forge customer service at 1-330-488-1203.

21E-051

Autoliv, Inc. (Autoliv) is recalling certain Automatic Locking Retractor (ALR) seat belt assemblies. The ALR may deactivate early, before the webbing is fully retracted. As such, these assemblies fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 208, "Occupant Crash Protection." A seat belt retractor that does not function as intended can increase the risk of injury during a crash. Autoliv will work with the vehicle manufacturers, and provide replacement seatbelt assemblies for any non-compliant products free of charge. The manufacturer has not yet provided a schedule for recall notification. Owners may contact Autoliv customer service at 1-248-276-0722.

21E-052

Shenzen YouCheng Dianzishangwu Youxiangg (Sealight) is recalling certain Sealight S1H11 LED headlight bulbs with part number AHDS1H11-E. These bulbs can create excessive glare or brightness to oncoming traffic. As such, these bulbs fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 108,

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2021**

Published September 22, 2021

"Lamps, Reflective Devices, and Associated Equipment." Excessive glare or brightness can reduce the vision of oncoming drivers, increasing the risk of a crash. Sealight will replace the LED bulbs with halogen bulbs, free of charge. The manufacturer has not yet provided a schedule for recall notification. Owners may contact Sealight customer service at youchengdianzi2021@163.com.

21E-053

LeMans Corporation is recalling certain Drag Specialties replacement laced motorcycle rear wheels, with part number 0204-0369 and size 16" x 3.00". The holes for the spokes in the hub are misaligned, which could result in broken spokes. Broken spokes can cause wheel failure, increasing the risk of a crash. Dealers will replace the rear wheel, free of charge. Owner notification letters were mailed on August 19, 2021. Owners may contact LeMans Corporation customer service at 1-608-758-1111.

21E-054

Cummins, Inc. (Cummins) is recalling certain ISL remanufactured diesel engines sold as replacement equipment. Please see the Part 573 report for a full list of part numbers. The sealing washer may not seat correctly in the pilot bore holes, allowing the high pressure fuel rail assembly to leak. A fuel leak in the presence of an ignition source increases the risk of a fire. Dealers will inspect the rail threads and fuel lines for damage, and replace the rail as necessary, free of charge. Owners were notified of the defect on August 20, 2021. A final remedy notice will be mailed once a remedy is available. Owners may contact Cummins customer service at 1-800-286-6467. Cummins number for this recall is C2449.

21E-055

R.C. Willett Company Inc. (R.C. Willett) is recalling certain NorthStar 8.5 Arrow U truck campers, equipped with Dometic S31, R1731, and R2131 3-burner slide in stoves. The saddle valve securing bolt may be over tightened, possibly damaging the o-ring seal and causing a continuous gas leak. A gas leak can increase the risk of a fire. Dealers will install a remedy kit of gaskets, washers, thread locker bolts, and two round orange labels, free of charge. Owners may contact R.C. Willett customer service at 1-319-233-3461.

21E-056

Volvo Trucks North America (Volvo Trucks) is recalling one Watson and Chalin steerable lift axle suspension system with part number SL2065.27. The lower rear pivot cap screws may not be long enough to sufficiently engage the locking feature of the corresponding nuts. The short screws can cause the hardware to separate from the suspension system and become a road hazard, increasing the risk of a crash or injury. Volvo Trucks will install a replacement lower rear pivot fastener hardware kit, free of charge. Owner notification letters were mailed on July 30, 2021. Owners may contact Volvo Trucks customer service at 1-800-528-6586.

21E-057

One More Auto Part, Inc. is recalling certain Lasfit aftermarket headlight bulbs model TX002/9005FBA, TX002/9006FBA, TX001/H7FBA, EX-PLA9012FBA, TX001/9004FBA, TX001/9007FBA, TX002/H4FBA, TX002/H13FBA, sizes 9004, 9005, 9006, 9007 only sold through Amazon.com. The aftermarket headlight bulbs are too bright during the first ten minutes of use. As such these bulbs fail to comply with Federal Motor Vehicle Safety Standards (FMVSS) number 108, "Lamps, Reflective Devices, and Assoc.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2021**

Published September 22, 2021

Equipment." Excessive brightness can decrease the visibility for oncoming drivers, increasing the risk of a crash. Dealers will provide a full refund or replace the bulbs, free of charge. Owner letters were mailed July 21, 2021. Owners may contact One More Auto Parts by email at recall2021@onemoreauto.com.

21E-058

Shenzhenshi Axi Technology Co. LTD is recalling certain aftermarket OXILAM LED headlight bulbs with part numbers F3-H11 and F3-9005, sold through Amazon.com. These bulbs can create excessive glare or brightness to oncoming traffic. As such, these bulbs fail to comply with the requirements of Federal Motor Vehicle Safety Standards (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." Excessive glare or brightness can reduce the vision of oncoming drivers, increasing the risk of a crash. Shenzhenshi Axi Technology Co. LTD will replace the LED headlight bulbs with halogen bulbs, free of charge. Owners may contact Shenzhenshi Axi Technology customer service at 1-809-894-9735 or by email at service@oxilam.com.

21E-059

Cummins, Inc. (Cummins) is recalling certain L9 Diesel Engines, with part number D563027BX03. The engine calibration software's management of the injection of Diesel Exhaust Fluid can allow excessive ammonia into the tailpipe exhaust. Exposure to high levels of ammonia can increase the risk of injury. Dealers will recalibrate the engine, free of charge. Owner notification letters were mailed August 20, 2021. Owners may contact Cummins customer service at 1-800-286-6467.

21E-060

TIRES:

None during June 2021.

VEHICLES:

Custom Truck and Body Works (Custom Truck) is recalling certain 2020 F550 vehicles equipped with Weldon V-Mux Vista IV Standard LCD displays. These displays may experience low voltage spikes, and cause the LCD display to lock up or become nonfunctional, due to varying electrical installations. If the LCD display becomes locked up or non-functional it can delay emergency efforts, which can increase the risk of injury. Dealers will replace the IV Standard LCD displays, free of charge. The manufacturer has not yet provided a schedule for recall notification. Owners may contact Custom Truck customer service at 1-888-712-2963.

21V-408

Altec Industries, Inc. (Altec) is recalling certain 2005-2021 A65, A70, A75, A72-T, A77-T, and A82-T vehicles. The lower and upper boom raise spools can shift after releasing the joystick or control interlock. Unintended movement of the lower and upper booms increases the risk of injury. Altec will install a jumper hose and check valve into the boomtip tank lines and replace the overcenter blocking cartridge with an internally

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2021**

Published September 22, 2021

referenced drain path, free of charge. Owner notification letters were mailed on July 28, 2021. Owners may contact Altec customer service at 1-877-462-5832. Altec's number for this recall is CSN 823.

21V-409

Daimler Vans USA, LLC (DVUSA) is recalling 2019-2021 Mercedes Benz Sprinter and Freightliner Sprinter vehicles equipped with swivel seats. The wiring harnesses for the front seats may have been routed incorrectly and could become jammed and damaged in the swivel seat frames. Damage to the wiring harness can prevent the side air bag within the seat to deploy inadvertently or not deploy as designed, increasing the risk of injury. Dealers will attach the mounting clip to the correct position, free of charge. Owner notification letters were mailed on August 11, 2021. Owners may contact DVUSA customer service at 1-877-762-8267. DVUSA's number for this recall is VS3DREHSEL.

21V-410

Daimler Vans USA, LLC (DVUSA) is recalling certain 2019-2021 Mercedes-Benz Sprinter and Freightliner Sprinter vehicles. The MBUX multimedia system software may cause the display to remain black, or reboot after startup. This could result in the rearview camera image not displaying properly. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 111, "Rear Visibility." A backup camera that displays a blank image reduces the driver's rear view, increasing the risk of a crash or injury. The multimedia system software will be updated by a dealer, or through an over-the-air (OTA) update, free of charge. DVUSA issued owners an interim notification on July 23, 2021. Owners may contact DVUSA customer service at 1-877-762-8267. DVUSA's number for this recall is VS3UXPOBOX.

21V-411

Stuphen Corporation (Stuphen) is recalling certain 2019-2020 Fire Trucks equipped with a battery-powered 3600 wireless remote controller units used to control the movement of electric firefighting monitors in firefighting vehicles. The monitor is used to direct the water stream and adjust the spray pattern. The wireless remote controller's sleep mode is disabled, and results in the batteries discharging faster than normal. Inability to use the wireless remote controller may hinder the firefighting efforts, increasing the risk of injury. Dealers will update the wireless remote controller unit software, free of charge. The manufacturer has not yet provided a schedule for recall notification. Owners may contact Stuphen customer service at 1-614-889-1005.

21V-412

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2021 ID.4 vehicles. Caps were installed on the headlight vertical aim instead the horizontal aim, allowing for horizontal adjustment of the headlight beam. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 108, "Lamps, Reflective Devices, and Associated Equipment." Adjusting the horizontal headlight beam can increase glare, reducing visibility for the driver and increasing the risk of a crash. Dealers will remove the caps from the vertical aim and install them on the horizontal aim, free of charge. Owner notification letters were mailed June 18, 2021. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's number for this recall is 9406.

21V-413

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2021**

Published September 22, 2021

Volvo Car USA, LLC (Volvo Car) is recalling certain 2019-2020 V90, XC60, S60, V60, V60CC, S90, V90CC, S90L, and XC90 vehicles. The low-pressure fuel pump can blow a fuse and fail. Failure of the low-pressure fuel pump can cause a stall, increasing the risk of a crash. Dealers will replace the fuse, free of charge. Owner notification letters were mailed July 2, 2021. Owners may contact Volvo Car customer service at 1-800-458-1552. Volvo Car's number for this recall is R10100.

21V-414

Genesis Supreme RV (Genesis) is recalling certain 2020-2021 Genesis, Vortex, and Wanderer bumper pull and low profile fifth wheel trailers, equipped with Dometic 3-burner cooking stoves. The saddle valve securing bolt may be overtightened, possibly damaging the o-ring seal and causing a continuous gas leak. A gas leak can increase the risk of a fire. Genesis Supreme RV will notify owners, and Dometic service centers will install a remedy kit of gaskets, washers, thread locker bolts, and two round orange labels, free of charge. Owner notification letters were mailed on July 16, 2021. Owners may contact Genesis Supreme customer service at 1-951-337-0254.

21V-415

Mack Trucks, Inc. (Mack) is recalling certain 2021-2022 Anthem, Granite, and Pinnacle vehicles. The hubcap compression spring can cause the hubcap to separate. A separated hubcap can create a road hazard, increasing the risk of a crash. Dealers will remove the hubcap, free of charge. Owner notification letters were mailed June 30, 2021. Owners may contact Mack customer service at 1-800-866-1177. Mack's number for this recall is SC0425.

21V-416

Volvo Trucks North America (Volvo Trucks) is recalling certain 2021-2022 VAH, VDH, VNL, AND VNR vehicles. The hubcap compression spring can cause the hubcap to separate. A separated hubcap can create a road hazard, increasing the risk of a crash. The remedy is still under development. In the interim, dealers will remove the hubcap, free of charge. Interim owner notification letters are expected to be mailed July 23, 2021. Owner notification letters were mailed on July 12, 2021. Owners may contact Volvo Trucks customer service at 1-800-528-6586. Mack's number for this recall is RVXX 2102.

21V-417

Stonebrooke Equipment INC. (Stonebrooke) is recalling one 2019 RAM 5500 vehicle. The rear brake caliper flexible line can contact suspension components, causing excessive wear and a brake fluid leak. A brake fluid leak can result a loss of the rear brakes, increasing the risk of a crash. Dealers will inspect, replace the rear brake caliper flexible line if necessary, and install banjo blocks, free of charge. Owners notification letters were mailed June 24, 2021. Owners may contact Stonebrooke customer service at 1-952-244-4440.

21V-418

Nissan North America, Inc. (Nissan) is recalling certain 2017 Infiniti QX30 vehicles. The steering shaft bore hole for the universal joint bearing may allow excessive movement that, over time, could result in the separation of the bearing and universal joint. A separated universal joint bearing can cause a loss of steering control and increase the risk of a crash. Dealers will replace the lower steering shaft, free of charge. Owner notification

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2021**

Published September 22, 2021

letters were mailed on July 30, 2021. Owners may contact Nissan customer service at 1-800-867-7669. Nissan's number for this recall is PG1CF.

21V-419

Bombardier Recreation Products, Inc. (Bombardier) is recalling certain 2021 Sea-Doo Move I Extended 1500 trailers. The wheel spindles were improperly welded to the axle. The welds can break, causing the wheel to detach and increasing the risk of a crash. Dealers will reimburse trailer transportation costs and replace the axle, free of charge. Owners are advised not to drive their trailer until the remedy is completed. Owner notification letters were mailed on June 4, 2021. Owners may contact Bombardier customer service at 1-888-272-9222. Bombardier's number for this recall is 2021-4.

21V-420

General Motors, LLC (GM) is recalling certain 2021 Buick Envision, Cadillac CT4, CT5, Escalade, Escalade ESV, Chevrolet Tahoe, Corvette, Suburban, GMC Yukon, Yukon XL vehicles. The communications gateway module incorrectly processes a loss of communication with the sensing diagnostic module (SDM), causing the air bag malfunction indicator light to inconsistently illuminate. The air bag malfunction indicator light may fail to warn the driver of a problem with the air bag, increasing the risk of injury. Dealers will update the software in the communications gateway module, free of charge. Owner notification letters were mailed on July 1, 2021. Owners may contact Buick customer service at 1-800-521-7300, Cadillac customer service at 1-800-458-8006, Chevrolet customer service at 1-800-222-1020, or GMC customer service at 1-800-462-8782. GM's number for this recall is N212338110.

21V-421

General Motors, LLC. (GM) is recalling certain 2021 Cadillac XT5, XT6, and GMC Acadia vehicles. The fuel supply lines may be improperly attached and seated. Improperly attached and seated fuel supply lines may loosen or separate, causing a fuel leak and increasing the risk of a fire. Dealers will inspect and replace fuel supply lines as necessary, free of charge. Owner notification letters were mailed on July 1, 2021. Owners may contact Cadillac customer service at 1-800-458-8006 and GMC customer service at 1-800-462-8782. GM's number for this recall is N212335590.

21V-422

General Motors, LLC (GM) is recalling certain 2019 Chevrolet Silverado 1500 and GMC Sierra 1500 vehicles. The affected tires were cured for too long during production. Over cured tires may develop a break in the sidewall resulting in sudden air loss or a belt edge separation which could lead to a tread/belt loss. Either condition can cause a loss of vehicle control, increasing the risk of a crash. Dealers inspect and replace the tires as necessary, free of charge, free of charge. Owner notification letters were mailed on June 25, 2021. Owners may contact Chevrolet customer service at 1-800-222-1020 and GMC customer service at 1-800-462-8782. GM's number for this recall is N212336230.

21V-423

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain 2020-2021 Land Rover Defender vehicles equipped with 6-cylinder engines. The Powertrain Control Module (PCM) may unexpectedly switch off

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2021**

Published September 22, 2021

while the vehicle is in motion, resulting in an engine stall with no warning. An engine stall can increase the risk of a crash. The Connected Diagnostic Services (CDS) and the Over-the-air (OTA) diagnostics functionality will be disabled, either by a dealer or through an OTA update, free of charge. Owner notification letters were mailed July 28, 2021. Owners may contact Land Rover customer service at 1-800-637-6837. Land Rover's number for this recall is N599.

21V-424

Jayco, Inc. (Jayco) is recalling certain 2017-2018 Jayco Designer, 2017-2021 Eagle HT, Eagle, Jay Feather, Jay Flight SLX, Jay Flight, North Point, Octane Superlite, Pinnacle, White Hawk, 2017-2020 Eagle HT, 2018-2021 Jay Flight Bungalow, 2017-2019 Octane, and 2019-2020 Eagle HTX travel trailers and fifth wheels equipped with a Winntec model 6020 two-stage propane regulator. The regulator may fail, causing an increase in propane pressure. Increased propane pressure can enlarge the flames in gas appliances, increasing the risk of a fire. Dealers will replace the regulator and test the propane system for leaks, free of charge. Owner notification letters were mailed August 3, 2021. Owners may contact Jayco customer service at 1-800-283-8267.

21V-425

KZRV, L.P. (KZRV) is recalling certain 2018-2019 KZ RV Sidewinder vehicles equipped with a Winntec model 6020 two-stage propane regulator. The regulator may fail, causing an increase in propane pressure. Increased propane pressure can enlarge the flames in gas appliances, increasing the risk of a fire. Dealers will replace the regulator and test the propane system for leaks, free of charge. Owner notification letters were mailed August 3, 2021. Owners may contact KZRV customer service at 1-800-768-4016 ext. 154 or 153.

21V-426

Keystone RV Company (Keystone) is recalling certain 2019 Keystone Bullet, Sprinter, and 2020 Keystone Hideout vehicles equipped with a Winntec model 6020 two-stage propane regulator. The regulator may fail, causing an increase in propane pressure. Increased propane pressure can enlarge the flames in gas appliances, increasing the risk of a fire. Dealers will replace the regulator and test the propane system for leaks, free of charge. Owners were notified of the defect on August 4, 2021. A second owner letter will be mailed once the remedy is available. Owners may contact Keystone customer service at 1-866-425-4369.

21V-427

Heartland Recreational Vehicles, LLC. (Heartland) is recalling certain 2018-2021 Mallard, Shadow Cruiser, Sundance XLTTT, Wilderness, Prowler, Trail Runner, 2018-2019 Pioneer, Terry Classic, 2020-2021 Lithium, and 2021 North Trail trailers equipped with a Winntec model 6020 two-stage propane regulator. The regulator may fail, causing an increase in propane pressure. Increased propane pressure can enlarge the flames in gas appliances, increasing the risk of a fire. Dealers will replace the regulator and test the propane system for leaks, free of charge. Owner notification letters were mailed August 4, 2021. Owners may contact Heartland customer service at 1-877-262-8032.

21V-428

Trails West Manufacturing of Idaho, Inc. (Trails West) is recalling one 2020 Sierra 4H 15x19 LQ

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2021**

Published September 22, 2021

trailersequipped with Dometic 3-burner cooking stoves. The saddle valve securing bolt may be overtightened, possibly damaging the o-ring seal and causing a continuous gas leak. A gas leak can increase the risk of a fire. The trailer had a remedy kit of gaskets, washers, thread locker bolts, and two round orange labels installed, free of charge. The recall was completed on June 4, 2021. Owners may contact Trails West customer service at 1-208-852-2200.

21V-429

Highland Ridge RV (Highland) is recalling certain 2020-2021 Mesa Ridge Limited, Mesa Ridge Lite, Open Range Light, Open Range Ultra Lite, 2019-2020 Mesa Ridge, 2019-2021 Open Range, 2020 Silverstar Limited and Silverstar Lite fifth wheel and travel trailers equipped with a Winntec model 6020 two-stage propane regulator. The regulator may fail, causing an increase in propane pressure. Increased propane pressure can enlarge the flames in gas appliances, increasing the risk of a fire. Dealers will replace the regulator and test the propane system for leaks, free of charge. Owner notification letters were mailed August 3, 2021. Owners may contact Highland customer service at 1-260-768-7771.

21V-430

Starcraft RV (Starcraft) is recalling certain 2017 Starcraft AR-One MAXX, Autumn Ridge SCS, Travel Star EXP, 2018-2021 Autumn Ridge Outfitter, 2017-2019 Autumn Ridge, Launch Ultra Lite, 2018-2019 Avalon, GPS, Launch Outfitter, 2019 Mossy Oak Lite, 2019-2020 Mossy Oak, Mossy Oak Ultra Lite, 2018 Solstice, 2017-2018 Solstice Super Lite, 2018-2020 Telluride, and 2019-2021 Super Lite travel trailers and fifth wheels equipped with a Winntec model 6020 two-stage propane regulator. The regulator may fail, causing an increase in propane pressure. Increased propane pressure can enlarge the flames in gas appliances, increasing the risk of a fire. Dealers will replace the regulator and test the propane system for leaks, free of charge. Owner notification letters were mailed August 3, 2021. Owners may contact Starcraft RV customer service at 1-800-945-4787.

21V-431

Honda (American Honda Motor Co.) is recalling certain 2022 Odyssey vehicles. The second-row outboard seats may have deformed seat rail locking mechanisms, which could prevent the seat rails from locking into place. A seat that is not locked into place can move unexpectedly, increasing the risk of injury. Dealers will replace both second-row outboard seat frames, free of charge. Owner notification letters were mailed August 4, 2021. Owners may contact Honda customer service at 1-888-234-2138. Honda's number for this recall is YBE.

21V-432

Coach House, Inc. (Coach House) is recalling certain 2021 Platinum vehicles equipped with Dometic 3-burner cooking stoves. The saddle valve securing bolt may be overtightened, possibly damaging the o-ring seal and causing a continuous gas leak. A gas leak can increase the risk of a fire. Coach House will notify owners, and Dometic service centers will install a remedy kit of gaskets, washers, thread locker bolts, and two round orange labels, free of charge. Owner notification letters were mailed on July 15, 2021. Owners may contact Coach House customer service at 1-800-235-0984.

21V-433

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain 2020-2022 Defender X vehicles

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2021**

Published September 22, 2021

equipped with smoked rear light assemblies. A voltage spike, triggered by a bright light shining on the rear of the vehicle, can cause the turn signals, brake lights, and tail lights to fail. Turn signals, brake lights, and tail lights that fail to illuminate can reduce visibility to other drivers and increase the risk of a crash. Dealers will replace the rear light assemblies, free of charge. Interim owner notification letters were mailed July 30, 2021. A second letter will be sent once the remedy is available. Owners can contact Land Rover customer service at 1-800-637-6837. Land Rover's number for this recall is N598.

21V-435

Four Guys Stainless Tank & Equip., Inc. (Four Guys) is recalling one 2020 Pumper firetruck equipped with an Akron Bass battery-powered 3600 wireless remote controller. The wireless remote controller's sleep mode is disabled, and results in the batteries discharging faster than normal. Inability to use the wireless remote controller can hinder firefighting efforts, increasing the risk of injury. Four Guys will request owners return the affected wireless remote controllers to Akron Brass for a software update, free of charge. The manufacturer has not yet provided a schedule for recall notification. Owners may contact Four Guys customer service at 1-814-634-8373.

21V-436

Karavan Trailers, Inc. (Karavan) is recalling certain 2021 Move I 1500 Long trailers. The wheel spindles were improperly welded to the axle. The welds can break, causing the wheel to detach and increasing the risk of a crash. Dealers will reimburse trailer transportation costs and replace the axle, free of charge. Owners are advised not to drive their trailer until the remedy is completed. The effected trailer manufacturers have been notified. Owners may contact Karavan customer service at 1-920-928-6200 ext. 333.

21V-437

Chrysler (FCA US, LLC) is recalling certain 2021 Ram 1500 vehicles equipped with a trailer reverse steering module (TRSCM). The rearview camera image may not display. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 111, "Rear Visibility." A rearview camera that does not display an image reduces the driver's rear view, increasing the risk of a crash or injury. Dealers will update the TRSCM software, free of charge. Owner notification letters were mailed June 24, 2021. Owners may contact FCA US, LLC customer service at 1-800-853-1403. FCA, US, LLC's number for this recall is Y30.

21V-438

Chrysler (FCA US, LLC) is recalling certain 2019-2020 Ram 3500, 4500, and 5500 cab chassis vehicles equipped with a Cummins 6.7L High Output engine. The engine calibration software may not warn about low oil volume. Low oil can damage the engine, causing an oil leak or a punctured engine block, increasing the risk of a fire. Dealers will update the engine calibration software, free of charge. Owner notification letters were mailed June 25, 2021. Owners may contact FCA US LLC customer service at 1-800-853-1403. FCA US LLC's number for this recall is Y21.

21V-439

General Motors, LLC. (GM) is recalling certain 2020-2022 Buick Encore GX and 2021-2022 Chevrolet

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2021**

Published September 22, 2021

Trailblazer vehicles. The emergency jack, if not positioned as directed in the vehicle owner's manual, can fracture while in use. A fractured jack can cause the vehicle to collapse, increasing the risk of injury. Dealers will replace the jack, free of charge. Interim owner notification letters informing owner of the safety risk were mailed July 22, 2021. A second notice will be mailed once remedy parts become available. Owner notification letters were mailed on July 29, 2021. Owners may contact Buick customer service at 1-800-521-7300 or Chevrolet customer service at 1-800-222-1020. GM's number for this recall is A212335470.

21V-440

Thor Motor Coach (TMC) is recalling certain 2018-2022 Axis 25.6 and 2018-2021 Vegas 25.6 motorhomes. The heat shield between the LP tank and chassis muffler was not installed. A missing heat shield increases the risk of a fire. Dealers will install a heat shield, free of charge. Owner notification letters were mailed July 22, 2021. Owners may contact TMC customer service at 1-877-855-2867. TMC's number for this recall is RC000228.

21V-441

Forest River, Inc. (Forest River) is recalling certain 2021 IBEX travel trailers. The shackle nuts may have been insufficiently tightened during production. Loose shackle nuts can fall off the shackle bolt, causing the axle to detach and increasing the risk of a crash. Dealers will tighten shackle nuts, free of charge. Owner notification letters were mailed June 24, 2021. Owners may contact Forest River customer service at 1-574-642-3119. Forest River's number for this recall is 77-1361.

21V-442

Forest River, Inc. (Forest River) is recalling certain 2021 Salem Fifth Wheel, Salem Travel Trailer, Wildwood Fifth Wheel, and Wildwood Travel Trailer vehicles. The red and amber clearance lamps do not reflect enough light. As such these vehicles fail to comply with Federal Motor Vehicle Safety Standards (FMVSS) number 108, "Lamps, Reflective Devices, and Assoc. Equipment." Less reflective clearance lamps can affect how other drivers judge the length of the trailer, increasing the risk of a crash. Dealers will add reflex stickers to both the amber and red clearance lamps, free of charge. Owner notification letters were mailed June 11, 2021. Owners may contact Forest River customer service at 1-574-534-3167. Forest River's number for this recall is 51-1359.

21V-443

Forest River, Inc. (Forest River) is recalling certain 2021 East to West Alta Travel Trailers. The LP/CO detector was installed in the incorrect location. Incorrect placement of the LP/CO detector can impair the detection of a propane leak, increasing the risk of a fire, or the presence of carbon monoxide, increasing the risk of injury. Dealers will install a new detector in the correct location, free of charge. Owner notification letters were mailed June 24, 2021. Owners may contact Forest River customer service at 1-574-264-6664. Forest River's number for this recall is 501-1366.

21V-444

Host Industries (Host) is recalling certain 2019-2021 Mammoth, Tahoe, Rainier, and Cascade trailers equipped with Dometic 3 burner cooking stoves. The saddle valve securing bolt may be overtightened, possibly damaging

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2021**

Published September 22, 2021

the o-ring seal and causing a continuous gas leak. A gas leak can increase the risk of a fire. A remedy has not been established at this time. The manufacturer has not yet provided a schedule for recall notification. Owners may contact Host customer service at 1-514-330-2328.

21V-445

Rossmooster Vans LLC (Rossmooster) is recalling certain 2018 Ram Promaster vehicles. The saddle valve securing bolt may be overtightened, possibly damaging the o-ring seal and causing a continuous gas leak. A gas leak can increase the risk of a fire. No remedy established at this time. The manufacturer has not yet provided a schedule for recall notification. Owners may contact Rossmooster customer service at 1-720-295-0623.

21V-446

Kia Motors America (Kia) is recalling certain 2021-2022 K5 vehicles equipped with 2.5L T-GDI engines. The Rack-Mounted Motor Driven Power Steering (R-MDPS) system lacks the ability to diagnose communication faults. If a communication fault occurs while driving around a curve with Lane Following Assist (LFA) engaged, the steering assist level may not adjust properly, causing a sudden increase in the steering effort required. A sudden increase in steering effort can increase the risk of a crash. Dealers will update the R-MDPS software, free of charge. Owner notification letters were mailed June 24, 2021. Owner may contact Kia customer service at 1-800-333-4542. Kia's number for this recall is SC213.

21V-447

Shyft Group is recalling certain 2021 Utilimaster Velocity vehicles. The Tire and Loading Information placard incorrectly states a seating capacity of one, although the actual seating capacity is two. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 110, "Tire Selection and Rims." Incorrect seating capacity information may cause the vehicle to be overloaded, increasing the risk of a crash. Dealers will install new placards, free of charge. Owner notification letters were mailed on June 17, 2021. Owners may contact Shyft Group customer service at 1-800-582-3454. Shyft Group's number for this recall is 21-16.

21V-448

Jayco, Inc. (Jayco) is recalling certain 2021 White Hawk travel trailers. The metallic electrical boxes may not be grounded. An ungrounded metallic electrical box can cause an electrical shock, increasing the risk of injury. Dealers will install a bare copper grounding conductor to the metallic electrical box, free of charge. Owner notification letters were mailed July 27, 2021. Owners may contact Jayco customer service at 1-800-283-8267. Jayco's number for this recall is 9901568.

21V-449

Navistar, Inc. (Navistar) is recalling certain 2014 IC Bus CE, 2019 IC Bus CE, and 2022 IC Bus CE school buses. These buses are not equipped with enough emergency exits. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 217, "Bus Emergency Exits and Window Retention and Release." A lack of emergency exits can delay passengers from exiting the vehicle during an emergency, increasing their risk of injury. Dealers will install two additional emergency exit windows, free of charge. Owner notification letters were mailed on August 6, 2021. Owners may contact Navistar customer

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2021**

Published September 22, 2021

service at 1-800-448-7825. Navistar's number for this recall is 21506.

21V-450

Heartland Recreational Vehicles, LLC (Heartland) is recalling certain 2021 Mallard, Wilderness, Trail Runner and 2020-2021 North Trail trailers. The LP gas lines may not have been tightened properly on the outside cooktops, which could result in a gas leak. A gas leak can increase the risk of a fire. Dealers will inspect and tighten the LP gas lines, and test the propane system for leaks, free of charge. Owner notification letters were mailed August 10, 2021. Owners may contact Heartland customer service at 1-877-262-8032.

21V-453

Temsa is recalling certain 2014-2020 TS45 buses. The external release handle for the roof emergency exit may have a rusted wire, which could break when force is applied to open the exit. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 217, "Bus Emergency Exits and Window Retention and Release." A broken handle wire on the emergency exit can delay passengers from exiting the vehicle during an emergency, increasing their risk of injury. Temsa service centers will replace the external handle wire, free of charge. Owner notification letters were mailed on August 12, 2021. Owners may contact Temsa customer service at 1-800-625-9319.

21V-454

General Motors, LLC (GM) is recalling certain 2021 Cadillac Escalade, Escalade ESV, Chevrolet Suburban, Chevrolet Tahoe, GMC Yukon, and Yukon XL vehicles. A software issue may cause a loss of power steering assist at startup or while driving. Increased steering effort, particularly at lower speeds, increases the risk of a crash. The power steering module software will be updated by a dealer, or through an over-the-air (OTA) update, free of charge. Owner notification letters were mailed July 13, 2021. Owners may contact Chevrolet customer service at 1-800-222-1020; Cadillac customer service at 1-800-458-8006; or GMC customer service at 1-800-462-8782. GM's number for this recall is N212333900.

21V-455

Terex Advance Mixer, Inc. (Terex) is recalling certain 2021 Front Discharge Mixer Commanders & Chargers. The shaft key for the chute swing motor was not installed properly, which could result in unintentional chute movement. A chute that moves unintentionally can increase the risk of injury. Terex will provide inspection instructions, free of charge. Owner notification letters were mailed on September 15, 2021. Owners may contact Terex customer service at 1-260-497-0728.

21V-456

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain 2020-2021 Land Rover Discovery vehicles. A loose contact between the battery ground stud and the chassis may result in various electrical faults, possibly causing a loss of electrical power or the vehicle to shut down while driving. A vehicle that shuts down or loses exterior lighting while driving increases the risk of a crash. Dealers will replace the ground stud, free of charge. Owner notification letters were mailed on August 10, 2021. Owners may contact Land Rover customer service at 1-800-637-6837. Land Rover's number for this recall is N607.

21V-457

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2021**

Published September 22, 2021

Marion Body Works Inc. is recalling certain 2019-2021 Spartan Gladiator and MetroStar vehicles. Pressure may build in the power steering pump and break the shaft seal, resulting in a loss of power steering assist. A loss of power steering assist can increase the risk of a crash. Spartan dealers will replace the power steering pump, free of charge. Owner notification letters were mailed on June 24, 2021. Owners may contact Marion Body Works customer service at 1-715-754-5261. Marion Body Works number for this recall is 21V-252.

21V-458

Spartan Fire, LLC is recalling certain 2019-2021 S180 Pumper emergency vehicles. The pump shift harness may have incorrect terminals, which could result in a poor electrical connection. A poor connection at the terminals may cause the vehicle to not shift into pump mode, hindering fire fighting efforts and increasing the risk of injury. Dealers will replace the terminals on the harness, free of charge. Owner notification letters were mailed on July 9, 2021. Owners may contact Spartan Fire customer service at 1-517-543-6400. Spartan Fire's number for this recall is 21012.

21V-459

KZRV, L.P. (KZRV) is recalling certain 2021 Connect travel trailers. The trailer tongue weight is too low, which may not apply enough downward force to the hitch of the tow vehicle, causing the trailer to be unstable at highway speeds. An unstable trailer can cause a loss of vehicle control, increasing the risk of a crash. Dealers will increase the tongue weight by adding additional weight to the tongue or by moving the axles, free of charge. Owner notification letters were mailed August 12, 2021. Owners may contact KZRV customer service at 1-800-768-4016 ext. 154 or 153. KZRV's number for this recall KZ_2021-04.

21V-460

Nissan North America, Inc. (Nissan) is recalling certain 2020-2021 Sentra vehicles. The left and/or right tie rod may be bent. A bent tie rod can break, causing a loss of steering control and increasing the risk of a crash. Dealers will inspect and replace the left and/or right tie rods as necessary, free of charge. Owner notification letters were mailed August 5, 2021. Owners may contact Nissan customer service at 1-800-867-7669. Nissan's number for this recall is PM985.

21V-461

Daimler Trucks North America, LLC (DTNA) is recalling certain 2018-2022 Thomas Built Saf-T-Liner HDX School Buses. These school buses may have been manufactured with an incorrect passenger seat configuration that does not provide the proper amount of seat back protection. As such, these school buses fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 222, "School Bus Passenger Seating and Crash Protection." In the event of a crash, the seats may not adequately protect the occupants, increasing the risk of injury. Dealers will replace the rear passenger seats, free of charge. No owner notification will be distributed, all units were repaired on August 12, 2021. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-892.

21V-462

Trailstar International Inc. (Trailstar) is recalling certain 2017-2019 International Dump trailers equipped with Ingersoll Smart-Steer self steer axles. The steering arm may detach from the steering knuckle during certain low-

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2021**

Published September 22, 2021

speed, high-side loading maneuvers. A detached steering arm may cause a loss of steering control. In addition, attachment hardware may fall and become a road hazard. Both of these scenarios can increase the risk of a crash. Dealers will inspect the steer arm and apply welds, free of charge. Interim notification letters were mailed on July 29, 2021. Owners may contact Trailstar customer service at 330-821-9900.

21V-463

Altec Industries, Inc. (Altec) is recalling certain 2020-2021 AT200A, AT235, AT235P Aerial Devices. Bolts of insufficient strength may have been used to connect the pedestal and sub-base, which could cause the bolts to become overloaded. Overloaded bolts can fail, causing the pedestal to separate and increasing the risk of injury or death. Altec will issue remedy instructions to owners, to inspect the bolts, and replace any grade 5 bolts with grade 8 bolts, free of charge. Owner notification were mailed on July 22, 2021. Owners may contact Altec customer service at 1-800-462-5832. Altec's number for this recall is CSN 825.

21V-464

Lamborghini (Automobili Lamborghini) is recalling certain 2018-2021 Huracan vehicles. In temperatures below 41°F, the rearview camera may not display due to a software error in the infotainment system. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 111, "Rear Visibility." A rearview camera that does not display an image reduces the driver's rear view, increasing the risk of a crash. Dealers will update the instrument cluster software, free of charge. Owner notification letters were mailed on August 6, 2021. Owners may contact Lamborghini customer service at 1-866-681-6276. Lamborghini's number for this recall is L62X-R.01.21.

21V-466

Porsche Cars North America, Inc. (Porsche) is recalling certain 2021 911 Turbo Coupe, 911 Turbo S Coupe, 911 Carrera 4S Targa, 911 Carrera 4S Cabriolet, 911 Turbo S Cabriolet, and 911 Turbo Cabriolet vehicles. Incorrect passenger seat was installed and may cause a Occupant Classification System (OCS) malfunction. An OCS malfunction may affect the front passenger air bag, increasing the risk of injury. Dealers will install the correct seat, free of charge. Interim owner notification letters were mailed August 20, 2021. Owners will receive a second notice when the remedy becomes available. Owners may contact Porsche customer service at 1-800-767-7243. Porsche's number for this recall is AMB3.

21V-467

Alexander Dennis, Inc. (Alexander Dennis) is recalling certain 2017-2020 E500 buses. The sealing washer may not seat correctly in the pilot bore holes, allowing the high pressure fuel rail assembly to leak. A fuel leak in the presence of an ignition source increases the risk of a fire. Dealers will inspect the rail threads and fuel lines, and replace the rail as necessary, free of charge. Owner notification letters were mailed June 18, 2021. Owners may contact Alexander Dennis customer service at 1-951-244-9429.

21V-468

Daimler Coaches North America (Daimler Coaches) is recalling certain 2009-2020 Setra S417 and 2012-2019 Setra S407 vehicles. The hinge on the engine compartment flap may crack, which could result in the flap detaching from the vehicle. A detached engine compartment flap can become a road hazard, and increase the

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2021**

Published September 22, 2021

risk of a crash. Dealers will attach a restraining tether to the engine compartment flap, free of charge. Owner notification letters were mailed on August 13, 2021. Owners may contact Daimler Coaches' customer service at 1-416-624-3558. Daimler Coaches' number for this recall is TI#: 75.00U21166A.

21V-469

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2000-2001 Audi TT Coupe, TT Roadster, 2000-2002 A4, and S4 vehicles equipped with Non-Azide Driver Air Bag Inflators (NADI) that do not contain phase stabilized ammonium nitrate (PSAN) propellant. Due to a manufacturing issue, the NADI inflators may absorb moisture, possibly causing the air bag to deploy improperly in the event of a crash. In the event of a crash necessitating air bag deployment, the air bag may not properly protect the occupant, increasing the risk of serious injury or death. Dealers will replace the driver frontal airbag inflator with an alternative inflator, free of charge. Interim notification letters informing owners of the safety risk were mailed August 20, 2021. A second notice will be mailed when remedy parts become available in mid-October 2021. Owners may contact Audi customer service at 1-800-253-2834. Volkswagen's number for this recall is 69CJ.

21V-470

Nissan North America, Inc. (Nissan) is recalling certain 2020-2021 Titan, Titan XD, and Versa vehicles. The front right and/or left turn signal bulb can crack and fail to illuminate. Inoperable front turn signals cannot alert on-coming drivers and/or pedestrians that the vehicle will be turning, increasing the risk of a crash. Dealers will inspect and replace the bulbs as necessary, free of charge. Owner notification letters were mailed August 20, 2021. Owners may contact Nissan customer service at 1-800-867-7669. Nissan's numbers for this recall are PM986 and PC811.

21V-471

General Motors, LLC (GM) is recalling certain 2021 Chevrolet Traverse and Buick Enclave vehicles. During service by dealers, certain vehicles may have received incorrect air bag calibration software that may affect frontal airbag deployment. Air bags that do not deploy as intended can increase the risk of injury. Dealers will update the air bag calibration software, free of charge. Owner notification letters were mailed on July 29, 2021. Owners may contact Chevrolet customer service at 1-800-222-1020 and Buick customer service at 1-800-521-7300. GM's number for this recall is N212340220.

21V-472

General Motors, LLC (GM) is recalling certain 2010-2016 Cadillac SRX and 2011-2012 Saab 9-4X vehicles. The rear suspension toe link adjuster may not have been tightened properly, which could result in a loose toe link. A loose toe link can separate and cause a loss of vehicle control, increasing the risk of a crash. Dealers will replace the adjustable toe link with a non-adjustable one, free of charge. Owners are advised to not drive their vehicle if they experience certain Malfunction Indicator Lamp (MIL) warnings or other issues, such as unusual steering behavior, while driving. Please see the Part 573 report for the full list of warnings. Interim owner notification letters were mailed August 6, 2021. Cadillac and Saab customers may direct questions to Cadillac customer service at 1-800-333-4223. GM's number for this recall is N212340980.

21V-473

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2021**

Published September 22, 2021

Nissan North America, Inc. (Nissan) is recalling certain 2021 Rogue vehicles. The second-row upper tether wires may have been improperly welded to the seatback frame, preventing a child seat from being securely anchored. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 225, "Child Restraint Anchorage Systems." An insecurely anchored child seat can move during a sudden stop or crash, increasing the risk of injury. Dealers will inspect and replace the rear seatbacks as necessary, free of charge. Owner notification letters were mailed July 30, 2021. Owners may contact Nissan customer service at 1-800-867-7669. Nissan's number for this recall is PC812.

21V-474

Forest River, Inc. (Forest River) is recalling certain 2021 East to West Entrada Class C Motorhomes. The federal placard incorrectly states that there are six seats equipped with seat belts when there are actually only four. As such, these motorhomes fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 120, "Tire selection and rims and motor home/recreation vehicle trailer load carrying capacity information for motor vehicles with a GVWR of more than 4,536 kilograms (10,000 pounds)." Vehicle occupants may be unaware of the accurate number of seat belts, resulting in unsecured passengers and increasing the risk of injury in a crash. Forest River will provide a new federal placard, free of charge. Owner notification letters were mailed June 25, 2021. Owners may contact Forest River customer service at 1-574-264-6664. Forest River's number for this recall is 504-1374.

21V-475

Mack Trucks, Inc. (Mack Trucks) is recalling certain 2020-2021 Granite vehicles equipped with certain SL2065 steerable lift axles. The lower rear pivot cap screws may not be long enough to sufficiently engage the locking feature of the corresponding nuts. The short screws can cause the hardware to separate from the suspension system and become a road hazard, increasing the risk of a crash or injury. Mack Trucks will inspect the suspension system and replace the lower rear pivot cap screws, as necessary, free of charge. Owner notification letters were mailed on July 30, 2021. Owners may contact Mack Trucks' customer service at 1-800-866-1177. Mack Trucks' number for this recall is SC0426.

21V-476

Roadtrek Inc. (Roadtrek) is recalling certain 2020-2021 Zion, Zion SRT, Play, and Slumber vehicles. An incorrect gas detector that is missing the carbon monoxide alarm may have been installed. The presence of carbon monoxide gas may not be detected, increasing the risk of injury or death. Roadtrek will ship owners a carbon monoxide detector to mount to their vehicle, free of charge. Owner notification letters were mailed on June 29, 2021. Owners may contact Roadtrek customer service at 1-519-745-1160. Roadtrek's number for this recall is 2021-02.

21V-477

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2016-2018 AMG GT vehicles. The bonding between the carbon-fiber driveshaft and the flange may be insufficient, which could result in driveshaft separation. A separated driveshaft may cause a loss of drive power, increasing the risk of a crash. Dealers will inspect and replace the carbon-fiber driveshaft, as necessary, free of charge. Interim Owner notification letters were mailed July 30, 2021. A second letter will be sent once the remedy is available. Owners may contact MBUSA

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2021**

Published September 22, 2021

customer service at 1-800-367-6372.

21V-478

SVI Trucks is recalling certain 2017-2021 Rescue Truck vehicles. The sealing washer may not seat correctly in the pilot bore holes, allowing the high pressure fuel rail assembly to leak. A fuel leak in the presence of an ignition source increases the risk of a fire. Dealers will inspect the rail threads and fuel lines, and replace the rail as necessary, free of charge. Owner notification letters were mailed on June 30, 2021. Owners may contact SVI Truck customer service at 1-888-784-1112.

21V-479

Winnebago Industries, Inc. (Winnebago) is recalling certain 2021-2022 Solis, Travato, and Ekko vehicles, equipped with GE-ES Double Flipseats. The seat belt retractors may lock up when the vehicle is on a slight incline. As such, these seats fail to comply with the requirements of Federal Motor Vehicle Safety Standards numbers 208, "Occupant Crash Protection" and 209, "Seat Belt Assemblies." If the seat belt retractor locks, a passenger may believe they are trapped in the vehicle, increasing the risk of injury. Winnebago will work with Freedman to notify owners, and dealers will inspect the seat and repair, free of charge. Owner notification letters were mailed on July 23, 2021. Owners may contact Winnebago customer service at 1-614-585-6939 or 1-800-537-1885 or Freedman customer service at 1-800-443-4540.

21V-480

Daimler Trucks North America, LLC (DTNA) is recalling certain 2019-2022 Freightliner Cascadia P4, 2021 Western Star WH126, 2020 Western Star WJ121, and 2021-2022 Western Star 49X vehicles. The battery cable terminal may break, resulting in a loss of electrical power and unintended engine stall. An engine stall increases the risk of a crash. Dealers will repair or replace the battery cables, free of charge. Interim notification letters were mailed to owners on August 23, 2021. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-893.

21V-481

Oshkosh Corporation (Oshkosh) is recalling certain 2019-2022 S-Series vehicles. These vehicles were manufactured with 10 amp Anti-Lock Brake System (ABS) fuses, instead of the required 15 amp ABS fuses. The incorrectly sized fuse may blow during an ABS braking event, increasing the risk of a crash. Oshkosh will provide owners new fuses, a new fuse label, and installation instructions, free of charge. Owner notification letters were mailed on July 29, 2021. Owners may contact Oshkosh customer service at 1-888-686-7278.

21V-482

Mercedes-Benz, LLC (MBUSA) is recalling certain 2021 G550, AMG G63, E350, E450, AMG CLS53, AMG E53, AMG GT43, AMG GT53, AMG GT63, 2021-2022 CLS450, and AMG E63 vehicles. The rear seat belt automatic locking retractors may deactivate early, which can prevent the child restraint system from securing properly. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 208, "Occupant Crash Protection." An unsecured child restraint system can increase the risk of injury during a crash. Dealers will inspect, and replace as necessary, the rear seat belt assemblies, free of charge. Interim letters notifying owners of the safety risk were mailed August 13, 2021. A second notice will be sent

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2021**

Published September 22, 2021

once the remedy is available. Owners may contact MBUSA customer service at 1-800-367-6372.

21V-483

Mickey Truck Bodies, Inc. (Mickey Truck) is recalling certain 2017 Freightliner M2, M2-106, International 4300, and 2018 Peterbilt 220 vehicles equipped with certain model lift gates that contain a license plate kit with part number 298872-01. The light kit does not properly illuminate the license plate, shining rearward, instead of downward as intended. The improper lighting may confuse other drivers on the road, increasing the risk of a crash. Dealers will provide a replacement license plate kit, free of charge. Owners may contact Mickey Truck customer service at 1-336-888-2291.

21V-484

Prevost Cars, Inc. (Prevost) is recalling certain 2021 X3 Commuter Coach buses. The passenger seats may have an attachment improperly clamped to the wall rail on the outboard side. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 210, "Seat Belt Assembly Anchorages." Unsecured seats may not properly restrain occupants during a crash, increasing the risk of injury. Prevost will provide instructions to inspect and replace the seat belt clamp, free of charge. Owner notification letters were mailed on August 31, 2021. Owners may contact Prevost's customer service at 1-866-870-2046. Prevost's number for this recall is SR SR21-308.

21V-485

Porsche Cars North America, Inc. (Porsche) is recalling certain 2020-2021 Taycan Turbo, Taycan Turbo S, Taycan 4S, 2021 Taycan, Taycan Cross Turismo, Taycan Turbo S Cross Turismo, Taycan 4S Cross Turismo, and Taycan Turbo Cross Turismo vehicles. The monitoring software can incorrectly detect a fault and shutdown the power train, causing a loss of motive power. A loss of motive power increases the risk of a crash. Dealers will reprogram the power electronics and the engine control unit, free of charge. Owner notification letters were mailed July 30, 2021. Owners may contact Porsche customer service at 1-800-767-7243. Porsche's number for this recall is AMB5.

21V-486

Gillig, LLC (Gillig) is recalling certain 2020-2021 Low Floor Diesel, CNG, and Battery Electric buses. The rear axle may come out of alignment during operation. An improperly aligned rear axle may cause a loss of vehicle control, increasing the risk of a crash. Gillig will install a new locknut, free of charge. Owner notification letters were mailed on July 19, 2021. Owners may contact Gillig's customer service at 1-510-264-5073 or 1-800-735-1500.

21V-487

Prevost Cars, Inc. (Prevost) is recalling certain 2021 X3 Commuter Coach buses. The parking brake emergency release valve may be the incorrect type, which can result in the permanent release of the parking brake. A released parking brake that cannot be re-engaged may cause the vehicle to roll-away, increasing the risk of a crash. Prevost will provide a service document describing the inspection method used and the remedy applied when needed for the parking brake emergency release valve replacement, free of charge. Owner notification letters were mailed on August 31, 2021. Owners may contact Prevost's customer service at 1-866-

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2021**

Published September 22, 2021

870-2046. Prevost's number for this recall is SR21-307.

21V-488

East Manufacturing Corp. (East Manufacturing) is recalling certain 2018-2021 MMX trailers equipped with Ingersoll Smart-Steer self steer axles. The steering arm may detach from the steering knuckle during certain low-speed, high-side loading maneuvers. A detached steering arm may cause a loss of steering control. In addition, attachment hardware may fall and become a road hazard. Both of these scenarios can increase the risk of a crash. Dealers will inspect the steering arm and apply welds, free of charge. The manufacturer has not yet provided a schedule for recall notification. Owners may contact East Manufacturing customer service at 1-352-861-3612.

21V-489

VanLeigh RV (VanLeigh) is recalling certain 2021-2022 Vanleigh Beacon recreational vehicles. Interference from the rear ladder can prevent the rear egress window from fully opening. In an emergency, the rear egress window cannot be used as an exit, increasing the risk of injury. Dealers will replace the egress window, free of charge. Owner letters were mailed August 12, 2021. Owners may contact VanLeigh customer service at 1-662-612-4040.

21V-490

Heartland Recreational Vehicles, LLC (Heartland) is recalling certain 2021 Heartland Pioneer SS171 travel trailers. The Federal Certification label has the incorrect Gross Vehicle Weight Rating (GVWR) and axle rating. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 120, "Wheels and Rims - Other Than Passenger Cars" and 49 CFR Part 567, "Certification." The operator may overload the vehicle, increasing the risk of a crash. Heartland will mail replacement labels to owners, free of charge. Owner notification letters were mailed on August 9, 2021. Owners may contact Heartland customer service at 1-877-262-8032.

21V-491

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2020-2021 Jetta and Jetta GLI vehicles. The air bag control module was welded in the incorrect position. Incorrect positioning of the air bag control module can cause the vehicle's air bags to deploy improperly during a crash, increasing the risk of injury. Additionally, the vehicle's air bags can deploy unintentionally, increasing the risk of a crash. Dealers will replace the air bag control module, free of charge. Owner notification letters were mailed on August 27, 2021. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's number for this recall is 69CK.

21V-492

Porsche Cars North America, Inc. (Porsche) is recalling certain 2021 Cayenne vehicles. The screw connection between the steering column and steering box may fail, which can result in a detached steering column. A detached steering column can cause a loss of control, increasing the risk of a crash. Dealers will install a new screw, free of charge. Owner notification letters were mailed August 24, 2021. Owners may contact Porsche customer service at 1-800-767-7243. Porsche's number for this recall is AMB4.

21V-493