

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2016**

Published September 9, 2016

CHILD SEATS:

Combi USA, Inc. (Combi) is recalling certain Coccoro Convertible Child Restraints, model number 8220, manufactured from January 1, 2009, to June 29, 2016. When the Coccoro car seat is installed in a forward facing position and only secured with the vehicle's lap belt, excessive force may be transmitted to the car seat occupant in the event of a crash, increasing their risk of injury. As such, these child seats fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 213, "Child Restraint Systems." In the event of a crash, the seat occupant is at an increased risk of injury. Combi will notify owners, and provide them with a cover to be added to the bottom of the seat, free of charge. The recall began on July 29, 2016. Owners may contact Combi customer service at 1-888-232-3294, or by going to <http://registration.combiusa.com/recall>. Combi's number for this recall is 610. Note: This recall does not affect the use of the Coccoro child restraint when it is installed in a rearward-facing position.

16C-006

EQUIPMENT:

Tong Ho Hsing Industrial Co. (THH) is recalling certain Hawk AP-80 motorcycle helmets, part number T378, size M. The affected helmets may not adequately protect a user in the event of a head impact during a crash. As such, these helmets fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 218, "Motorcycle Helmets." Helmets that do not adequately protect the wearer increase their risk of injury in the event of a crash. THH will notify owners and provide a replacement helmet free of charge or they will offer a full refund. The recall is expected to begin during September 2016. Owners may contact THH customer service at 1-978-483-8072.

16E-060

Bombardier Recreational Products Inc. (BRP) is recalling certain Coast to Coast accessory passenger seats, manufactured November 18, 2015, to April 4, 2016, and sold for use on Can-Am Spyder F3-series motorcycles. When a passenger is sitting on the accessory seat, the seat may not activate a switch that changes the vehicle stability system to compensate for a passenger being on board. If the vehicle stability system is not altered, the operator may lose control of the motorcycle, increasing the risk of a crash. BRP has notified owners, and dealers will modify the seat to correct the issue, free of charge. The recall began July 22, 2016. Owners may contact BRP customer service at 1-888-272-9222.

16E-061

Tegol, Inc. (Tegol) is recalling certain Outlaw Slim-G Series motorcycle helmets, part number GLD-12-510-511, in all sizes, manufactured March 30, 2013, to June 5, 2013. The affected helmets may not adequately protect the wearer's head in the event of an impact, and an object may penetrate the helmet. Additionally, these helmets may not be labeled properly. As such, these helmets fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 218, "Motorcycle Helmets." Helmets that do properly protect the wearer's head can increase the risk of injury to the wearer in the event of a crash. Missing labeling information reduces the user's possibility of identifying the helmet in the event of a safety recall. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Tegol customer service at 1-714-496-9988.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2016**

Published September 9, 2016

16E-062

Eaton Corporation (Eaton) is recalling certain Spool Valve Motors, part numbers 101-1033-009, 101-1035-009, 101-1042-009, 101-1083-009, 101-1090-009, 101-1091-009, 101-1701-009, 101-1702-009, 101-1703-009, 101-1710-009, 101-1711-009, 101-1722-009, 158-1094-001, 158-1628-001, 158-3373-001, 158-3452-001, and 158-3704-001, manufactured December 26, 2015, to March 30, 2016. These hydraulic motors have a motor shaft that may break. If the motor is used to operate a hydraulic boom or winch and the shaft breaks, there may be unexpected movement of the boom or winch. If the motor shaft breaks causing unexpected boom rotation or winch movement, the operator or those nearby may be at an increased risk of injury. Eaton will notify the vehicle manufacturers that purchased the hydraulic motors, and their dealers will replace the hydraulic motors, free of charge. The recall began on May 10, 2016. Owners may contact Eaton customer service at 1-800-386-1911.

16E-063

Ivolution Sports, Inc. (Ivolution Sports) is recalling certain IV2 JX-SKY helmets, sizes S, M, L, XL manufactured February 1, 2015, to July 15, 2016. These helmets may have two detachable plastic accessory pieces, a plastic mohawk and a face mask, that were attached with small screws. These accessory pieces may alter the angle of impact and neck position in a motorcycle crash. As such, these helmets fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 218, "Motorcycle Helmets." If the accessories are attached with a rigid connection such as with screws, the rider has an increased risk of injury in the event of a crash. Ivolution Sports will notify owners, and provide owners a full refund, free of charge. The recall is expected to begin September 16, 2016. Owners may contact Ivolution Sports customer service at 951-888-0076. Ivolution Sports number for this recall is JXSKY-RECALL(201607).

16E-064

ZF North America, Inc. (ZF) is recalling certain Transmission Control Sensor Clusters manufactured May 1, 2013, to July 15, 2014. These transmission sensor clusters, used in 9-speed automatic transmissions, may have insufficient crimps in the transmission wire harness, and as a result, the transmission may unexpectedly shift to neutral. If the vehicle unexpectedly shifts to neutral, there is an increased risk of a crash. ZF will notify the vehicle manufacturers that purchased the affected transmissions. Those manufacturers will file recalls and their dealers will update the transmission software to prevent the transmission from shifting into neutral due to a faulty crimp, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact ZF customer service at 1-734-416-6200.

16E-065

Aero Industries, Inc. (Aero) is recalling certain Conestoga XP sliding trailer tarping systems manufactured October 15, 2014, to January 19, 2016. In the affected tarping systems, the rear aerodynamic device (RAD) may separate from the rear of the tarping system, due to rivet failure. If the RAD detaches from the trailer it may be a road hazard, increasing the risk of a crash. Aero will notify owners, and will replace the rivets with higher strength bolts and nuts, free of charge. The recall began on September 1, 2016. Owners may contact Aero customer service at 1-800-535-7563.

16E-066

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2016**

Published September 9, 2016

Shower Enclosures America, Inc. (SEA) is recalling certain Arcadia shower curtains manufactured February 1, 2012, to July 15, 2016. These shower curtains may not adequately resist catching fire in the presence of an ignition source. As such, these curtains fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 302, "Flammability of Interior Materials." A flammable shower curtain may further fuel a fire, increasing the risk of injury. SEA has notified the recreational vehicle companies that purchased and installed the shower curtains, and their dealers will replace the shower curtains with shower curtains made with fire retardant, free of charge. The recall began in July 2016. Owners may contact SEA customer service at 1-800-536-7324 extension 3032.

16E-067

TIRES:

Vee Tyre and Rubber Co., Ltd (Vee) is recalling certain Taiga M/T tires, size LT225/75R16, manufactured January 8, 2015, to May 7, 2015. The sidewall of the affected tires may blister and the interliner may separate, compromising the integrity of the tires at high speeds. As such, these tires fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 139, "New Pneumatic Radial Tires for Light Vehicles." If the sidewall blisters or interliner separates it may cause a tire blow out at high speeds, increasing the risk of a crash. Vee has successfully quarantined the affected tires. The recall began on May 25, 2016. Owners may contact Vee customer service at 1-212-564-7575.

16T-010

VEHICLES:

Fontaine Trailer Company (Fontaine) is recalling certain model year 2015-2017 Revolution trailers manufactured February 17, 2014, to April 11, 2016, equipped with certain Bendix SR5 spring brake valves. These brake valves were improperly machined without a radius on the internal check valve seat, causing a delay of application of the spring brakes while parking. If there is a delay of the spring brake application, the trailer may roll away after it has decoupled from the tractor, increasing the risk of a crash or injury. The recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Fontaine Customer Service Department at 1-800-821-6535. Fontaine's number for this recall is Bendix 16E-045.

16V-494

Chrysler (FCA US LLC) is recalling certain model year 2016 Ram 3500 trucks manufactured July 24, 2015, through January 7, 2016, and 2016 Ram 4500/5500 trucks manufactured July 24, 2015, through October 8, 2015. The transfer case may have been manufactured with a misshapen main output shaft, creating voids that may cause a shaft fracture. If the main output shaft fractures, the vehicle may lose motive power, increasing the risk of a crash. Additionally, the driver may be unable to place the vehicle in PARK, increasing the risk of a vehicle rollaway. Chrysler will notify owners, and dealers will replace the transfer case, free of charge. The recall began on August 11, 2016. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is S48.

16V-495

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2016**

Published September 9, 2016

Wilson Trailer Company (Wilson) is recalling certain model year 2015 DWH-550, and CD-1080 trailers manufactured November 20, 2015, equipped with certain Bendix SR5 spring brake valves. These valves may have been improperly machined which may cause a delay of application of the spring brakes while parking. If there is a delay of the spring brake application, the trailer may roll away after it has decoupled from the tractor, increasing the risk of a crash or injury. Wilson will contact owners and provide a remedy kit, complete with instructions, to repair any affected SR-5 trailer relay valves, free of charge. Wilson issued an interim notification to owners on August 18, 2016. The recall began on August 26, 2016. Owners may contact Wilson Customer Service Department at 1-800-798-2002. Wilson's number for this recall is 132P.

16V-496

Ameritrans Bus, Inc. (Ameritrans) is recalling certain model year 2012-2016 shuttle buses manufactured August 1, 2012, to June 24, 2016, built on Ford E-350, E-450, and F-550 chassis, Dodge 5500 chassis, and Freightliner M2 chassis. These vehicles may be equipped with Tire and Loading Placards that are not applicable to vehicles weighing more than 10,000 pounds. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims." Use of the label on these vehicles may confuse the operator and may result in overloading the vehicle, increasing the risk of a crash. Ameritrans will notify owners, and dealers will remove the Tire and Loading Placards, free of charge. The recall began on September 2, 2016. Owners may contact Ameritrans Customer Service Department at 1-574-218-4786.

16V-497

General Motors LLC (GM) is recalling certain model year 2016 Cruze vehicles manufactured November 5, 2015, to May 26, 2016. The headlight assemblies are not marked with a three-digit identifier code used to properly aim the headlights. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 108, "Lamps, Reflective Devices, and Assoc. Equipment." Without the identification code, the headlights may be improperly aimed during service, reducing nighttime visibility and increasing the risk of a crash. GM will mail owners instructions and adhesive labels, with the correct code, to install on their headlight assemblies. Owners may also bring the vehicle to a GM dealership for any assistance with applying the label, free of charge. The recall began on August 11, 2016. Owners may contact Chevrolet Customer Service Department at 1-800-222-1020. GM's number for this recall is 50190.

16V-498

Mazda North American Operations (Mazda) is recalling certain model year 2007-2009 B-Series trucks manufactured June 6, 2006, to January 22, 2009, originally sold, or ever registered, in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands, or "Zone A."

Additionally, unless included in "Zone A" above, Mazda is recalling certain model year 2007-2008 B-Series trucks manufactured February 21, 2006, to April 28, 2008, originally sold, or ever registered, in Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B."

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2016**

Published September 9, 2016

Any vehicle not included in "Zone A", or "Zone B" is not included in this safety recall.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules, and used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death. Mazda notified owners, and dealers will replace the passenger frontal air bag inflator, free of charge. An interim notice was sent out on September 2, 2016, another notice will be sent out when parts are available. Owners may contact Mazda customer service at 1-800-222-5500. Mazda's number for this recall is 9616F.

16V-499

Forest River, Inc. (Forest River) is recalling certain model year 2015-2017 Forest River Orion recreational vehicles manufactured January 1, 2014, to June 30, 2016; 2014 Rockport work and delivery trucks manufactured on January 29, 2016; and 2015-2017 Forest River Rev recreational vehicles manufactured December 10, 2014, to June 30, 2016. These vehicles are built on a Chrysler RAM ProMaster chassis and are equipped with a Trailer Tow Lighting Control Module that may have a software error which can prevent illumination of the trailer brake lights during brake actuation. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." Trailer brake lights that are inoperative can increase the risk of a crash. Forest River will notify owners, and RAM dealers will replace the Trailer Tow Light Control Module, free of charge. The recall began on August 31, 2016. Owners may contact Forest River customer service at 1-800-348-7440, or RAM customer service at 1-800-853-1403. Forest River's number for this recall is 210-06282016-0216.

16V-500

Newmar Corporation (Newmar) is recalling certain model year 1998-2010 Dutch Star, 2008 Kountry Star, 2008-2009 All Star and Ventana, 2009-2010 Dutch Aire, 2014-2015 King Aire and 2015 Essex motorhomes, built on a Spartan Motors chassis. In the affected vehicles, the flexible exhaust tube may tear allowing hot exhaust to blow against other components or materials. If hot exhaust gas contacts other components or materials, it can increase the risk of a fire. Newmar will notify owners, and Spartan dealers will inspect the alignment of the tubes, correcting them and replacing any that are torn. These repairs will be performed free of charge. The recall began on August 29, 2016. Owners may contact Newmar customer service at 1-800-731-8300 or Spartan customer service at 1-800-543-4277. Newmar's number for this recall is 16V 313.

16V-501

General Motors LLC (GM) is recalling certain model year 2016-2017 Buick Verano and 2016 Chevrolet Malibu as the electronic park lock lever may allow the ignition key to be removed without the transmission being in PARK. Also, certain 2013 Buick Encore, 2011 Buick Regal, 2013-2014 Buick Verano, 2011-2016 Chevrolet Cruze, 2010-2013 Chevrolet Equinox 2013-2015 Chevrolet Malibu, and 2011-2013 GMC Terrain vehicles may have been serviced with similar defective replacement electronic park lock levers. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 114,

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2016**

Published September 9, 2016

"Theft Protection and Rollaway Prevention." If the key is removed without the transmission in PARK, the vehicle may rollaway as occupants are exiting, increasing the risk of injury. GM will notify owners, and dealers will inspect and if necessary replace the key cylinder lock housing, free of charge. GM issued an interim notification to owners on August 18, 2016. Owners may contact Chevrolet customer service at 1-800-222-1020, Buick 1-800-521-7300, and GMC 1-800-462-8782. GM's number for this recall is 50490 and 50491.

16V-502

Utility Trailer Manufacturing Company (Utility) is recalling certain model year 2014-2016 FS1CHA, FS1CHS, FS2CDHA, FS2CHA, FS2CHS, FS3CDHA, FS3CHA, FS3CHS, TS1CA, TS2CDHA, TS2CHA, VS1DC, VS1RA, VS2DX, VS2RA, VS2RAP, VS3DX, VS3RA, and VS4DX refrigerated, dry van, and flatbed trailers manufactured January 1, 2014, to March 4, 2016, equipped with certain Bendix SR5 spring brake valves. These valves may have been improperly machined which may cause a delay of application of the spring brakes while parking. If there is a delay of the spring brake application, the trailer may roll away after it has decoupled from the tractor, increasing the risk of a crash or injury. Utility distributed an interim notification to owners on July 27, 2016. Utility will contact owners and provide a remedy kit, complete with instructions, to repair any affected SR-5 trailer relay valves, free of charge. The recall began on August 18, 2016. Owners may contact Utility customer service at 1-800-423-6591.

16V-503

Jerr-Dan Corporation (Jerr-Dan) is recalling certain model year 2014-2016 HDR1000 Wrecker trucks manufactured April 17, 2014 and April 5, 2016, equipped with a JFB body and vehicle mounted controls and remote controls. If the wrecker is being operated with the remote control, it may be possible for the vehicle mounted controls to remain engaged and continue activating the previously selected wrecker function. A sticking control lever may result in unintended movement of the wrecker equipment, increasing the risk of injury. Jerr-Dan will notify owners, and dealers will repair the vehicles, free of charge. The recall is expected to begin during September 2016. Owners may contact Jerr-Dan customer service at 1-717-597-7111.

16V-504

VT Hackney, Inc. (VT Hackney) is recalling certain 2014-2016 Kidron refrigerated trailers, and Hackney Beverage Trailers manufactured February 1, 2014, to June 1, 2016, equipped with certain Bendix SR-5 spring brake valves. These valves may have been improperly machined which may cause a delay of application of the spring brakes while parking. If there is a delay of the spring brake application, the trailer may roll away after it has decoupled from the tractor, increasing the risk of a crash or injury. VT Hackney will notify owners and any affected SR-5 valves will be replaced by kits ordered from Bendix, free of charge. VT Hackney issued an interim notification to owners on August 10, 2016. The recall began on August 24, 2016. Owners may contact VT Hackney customer service at 1-800-763-0700.

16V-505

East Manufacturing Corp. (East) is recalling certain model year 2014-2016 Flatbed, Frame Dump, and Flatbed Tipper trailers manufactured January 10, 2014, to April 24, 2015, equipped with certain Bendix SR5 spring brake valves. These valves may have been improperly machined which may cause a delay of application of the spring brakes while parking. If there is a delay of the spring brake application, the trailer may roll away after it

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2016**

Published September 9, 2016

has decoupled from the tractor, increasing the risk of a crash or injury. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact East customer service at 1-330-325-9921.

16V-506

General Motors LLC (GM) is recalling certain model year 2009-2010 Chevrolet Impala vehicles manufactured April 25, 2008 through February 16, 2010. The front passenger seat frame may contact and damage the wires of the passenger presence sensor module. If the wires are damaged, the passenger presence sensory system may fail to recognize that the passenger seat is occupied, disabling the air bag. Damage may also cause the air bag fuse to short resulting in a loss of all air bags and seat belt pretensions. Both conditions increase the risk of injury during a crash. GM will notify owners, and dealers will double wrap the wires with anti-abrasion tape and replace damaged wires as necessary, free of charge. The recall began on August 1, 2016. Owners may contact Chevrolet customer service at 1-800-521-7300. GM's recall campaign number is 36110.

16V-507

Motor Coach Industries (MCI) is recalling certain model year 2015-2016 J4500 vehicles manufactured April 14, 2015, to February 22, 2016. On the affected vehicles, the non-egress single pane passenger windows may have improperly installed mounting hardware, allowing the windows to open unexpectedly at the bottom. A window that opens unexpectedly as a result of a crash or contact with the window may allow the passenger to be ejected from the bus, increasing their risk of injury. MCI will notify owners, and dealers will tighten and secure the window mounting hardware, free of charge. The recall began on July 22, 2016. Owners may contact MCI customer service at 1-800-241-2947. MCI's number for this recall is SB 433B.

16V-510

Winnebago Industries, Inc (Winnebago) is recalling certain model year 2017 Winnebago View, and Itasca Navion motor coaches manufactured November 16, 2015, to June 23, 2016. In the affected vehicles, the grommet around the liquid propane (LP) line may not be properly sealed to prevent carbon monoxide and/or LP gas from entering the living quarters. If carbon monoxide or LP gas enters the living quarters, it can increase the risk of illness or death to the occupants. Winnebago will notify owners, and dealers will apply sealant to the grommet opening to seal the LP line, free of charge. The recall began on July 22, 2016. Owners may contact Winnebago customer service at 1-800-537-1885. Winnebago's number for this recall is 141.

16V-511

Newmar Corporation (Newmar) is recalling certain model year 2017 Dutch Star, Mountain Aire, London Aire, Essex, and King Aire motorhomes manufactured December 4, 2015, to July 5, 2016. The affected vehicles have front fascia wood trim that may separate from the slide out and possibly contact the driver or a passenger. If the fascia separates and contacts the driver or a passenger, a loss of vehicle control may result, increasing the risk of a crash. Newmar will notify owners, and dealers will secure the trim with screws, free of charge. The recall began on August 16, 2016. Owners may contact Newmar customer service at 1-800-731-8300.

16V-512

Kibbi, LLC (Kibbi) is recalling certain model year 2015-2016 Renegade Vienna vehicles manufactured

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2016**

Published September 9, 2016

February 9, 2015, to June 1, 2016, and 2014-2016 Renegade Villagio vehicles manufactured March 4, 2013, to June 6, 2016. While checking or filing the rear inner tires, the valve stem extensions may inadvertently be loosened, resulting in a slow air leak. If the valve stem extensions loosen and allow air to leak, the tires may be underinflated, increasing the risk of tire failure and a crash. Kibbi will notify owners, and dealers will replace the valve stem extensions, free of charge. The recall began on July 6, 2016. Owners may contact Kibbi customer service at 1-574-966-0196. Kibbi's number for this recall is Sprinter 6302016.

16V-513

Jayco, Inc. (Jayco) is recalling certain model year 2017 Jay Flight SLX travel trailers, model 212 QBW, manufactured June 27, 2016, to June 28, 2016. The affected vehicles were manufactured with Cargo Carrying Capacity (CCC) and Tire Labels indicating incorrect vehicle weight. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims." Incorrect weight on labels can allow the operator to overload the vehicle, affecting vehicle handling, and increasing the risk of a crash. Jayco has notified the dealers that have the affected trailers and supplied them with corrected labels, free of charge. The recall began July 6, 2016. Owners may contact Jayco customer service at 1-800-2833-8267. Jayco's number for this recall is 9901300.

16V-514

Lodi Truck and Equipment (Lodi) is recalling certain model year 2013-2016 Dominator I, Dominator II, Dominator III, Dominator IV, and Dominator-Propane trucks manufactured April 4, 2013, to January 22, 2016, equipped with IMT cranes, models 6000, 7500, 8600, 9500, 10000, 12000, or 14000. The affected cranes have a valve bank cover that may crack and fall from the crane while the crane is being transported. If the valve bank cover detaches from the crane it could be a road hazard, increasing the risk of a crash. Lodi will notify owners, and dealers will replace the valve bank cover, with a thicker cover, free of charge. Owners may contact Lodi customer service at 1-916-372-5634.

16V-515

General Motors LLC (GM) is recalling certain 2016-2017 Buick Envision vehicles manufactured February 4, 2016, to April 25, 2016. The Tire and Loading Information label may display the incorrect maximum weight information. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims." Incorrect weight information may cause an owner to overload the vehicle. Overloading may reduce vehicle control, increasing the risk of a crash. GM will notify owners, and dealers will install a corrected label as necessary, free of charge. The recall began on August 22, 2016. Owners may contact Buick customer service at 1-800-521-7300. GM's number for this recall is 56340.

16V-516

General Motors LLC (GM) is recalling certain model year 2011 Buick Regal vehicles manufactured November 3, 2009, to March 25, 2011, equipped with 8-way power adjustable front seats. The power seat wiring harness may contact the seat frame, causing the wires to chafe. Chafed harness wires may cause a short circuit, increasing the risk of a fire. GM will notify owners, and dealers will inspect and secure the wiring harness, and repair any chafed wires as necessary, free of charge. Remedy parts are currently unavailable. Interim notices were mailed to owners on August 18, 2016. Owners will receive a second notice when remedy parts become

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2016**

Published September 9, 2016

available. Owners may contact Buick customer service at 1-800-521-7300. GM's number for this recall is 30710.

16V-517

General Motors LLC (GM) is recalling certain model year 2014-2016 Chevrolet Caprice Police Pursuit vehicles manufactured May 14, 2013 through June 14, 2016, and Chevrolet SS vehicles manufactured May 15, 2013 through April 27, 2016. The driver's seat belt tensioner cable may be repeatedly bent over the seat side shield as the driver enters and exits the vehicle causing the cable to fatigue and separate. If the tensioner cable separates, the driver may not be properly restrained in the event of a crash, increasing their risk of injury. GM will notify owners, and dealers will inspect the tensioner cable assembly, replacing any cable that is damaged. For vehicles that do not require a tensioner assembly replacement, a cable guide will be installed. All vehicles will receive new seat trim with a redesigned opening for the cable routing. These repairs will be performed free of charge. Remedy parts are currently unavailable. Interim notices were mailed to owners on August 31, 2016. Owners will receive a second notice when remedy parts become available. Owners may contact Chevrolet customer service at 1-800-222-1020. GM's number for this recall is 31340.

16V-518

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2017 Audi Q7 vehicles manufactured August 30, 2015, to May 8, 2016. Due to a software issue within the air bag control module, the frontal air bags may deploy with more force than required in certain crashes. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 208, "Occupant Crash Protection." Air bags that deploy with excessive force may increase the risk of injury. Volkswagen will notify owners, and dealers will update the air bag control module software, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Audi customer service at 1-800-253-2834. Volkswagen's number for this recall is 6903.

16V-519

Porsche Cars North America, Inc. (Porsche) is recalling certain model year 2015 Porsche 918 Spyder Hybrid Electric vehicles manufactured February 2, 2015 through July 1, 2015. In the affected vehicles, incorrect screws might have been used when re-installing and/or re-securing the seat belt mount or the seat belt reel during vehicle service. In the event of a crash, the incorrect bolts may not keep the seat belts properly anchored to the car, increasing the risk of injury to the seat occupants. Porsche will notify owners, and dealers will inspect, and as necessary, replace the seat belt mount and seat belt reel attaching bolts, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Porsche customer service at 1-800-767-7243. Porsche's number for this recall is AG04.

16V-520

General Motors LLC (GM) is recalling certain model year 2016 Malibu Hybrid vehicles manufactured October 27, 2015, to June 3, 2016. The affected vehicles have a shut-off switch for the high voltage battery for use when servicing the vehicle. This manual service disconnect switch (MSD) may not be properly installed and thus may not lock into position, unexpectedly disconnecting the high-voltage power while driving, effectively stalling the vehicle. A vehicle stall increases the risk of a crash. GM will notify owners, and dealers will inspect the MSD and

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2016**

Published September 9, 2016

correct the installation, as necessary, free of charge. The recall began on August 10, 2016. Owners may contact Chevrolet customer service at 1-800-222-1020. GM's number for this recall is 51230.

16V-521

MANAC Trailers USA, Inc. (MANAC) is recalling certain 2016 Flatbed trailers, model 10850B069, manufactured October 1, 2014, to October 31, 2014. These trailers are equipped with certain Bendix SR5 spring brake valves which may have been improperly machined which could cause a delay of application of the spring brakes while parking. If there is a delay of the spring brake application, the trailer may roll away after it has decoupled from the tractor, increasing the risk of a crash or injury. The remedy for this recall is still under development. The recall is scheduled to begin in September 2016. Owners may contact MANAC customer service at 1-573-262-2166.

16V-522

MANAC, Inc. (MANAC) is recalling certain model year 2016 Flatbed trailers manufactured September 1, 2014, to September 30, 2014, and 2017-2018 Van trailers manufactured January 1, 2015, to March 31, 2016. These trailers are equipped with certain Bendix SR5 spring brake valves which may have been improperly machined which could cause a delay of application of the spring brakes while parking. If there is a delay of the spring brake application, the trailer may roll away after it has decoupled from the tractor, increasing the risk of a crash or injury. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact MANAC, Inc. at 1-418 228-2018.

16V-523

Polar Tank Trailer, LLC (Polar Tank) is recalling certain model year 2014-2016 DOT 406, DOT 407, DOT 412, MC 331 and Non-Code trailers manufactured January 1, 2014, to April 28, 2016. These trailers are equipped with certain Bendix SR5 spring brake valves which may have been improperly machined which could cause a delay of application of the spring brakes while parking. If there is a delay of the spring brake application, the trailer may roll away after it has decoupled from the tractor, increasing the risk of a crash or injury. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Polar Tank customer service at 1-320-746-2255.

16V-524

Heil Company (Heil) is recalling certain model year 2014-2016 Petroleum, Crude, Dry Bulk and Flatbed trailers manufactured January 1, 2014, to June 18, 2016. These trailers are equipped with certain Bendix SR5 spring brake valves which may have been improperly machined which could cause a delay of application of the spring brakes while parking. If there is a delay of the spring brake application, the trailer may roll away after it has decoupled from the tractor, increasing the risk of a crash or injury. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Heil customer service at 1-800-400-6913.

16V-525

American Honda Motor Co. (Honda) is recalling certain model year 2016 Civic 2-Door vehicles manufactured February 23, 2016, through May 20, 2016. The affected vehicles may have a damaged LED side marker light

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2016**

Published September 9, 2016

circuit board inside the taillight assembly, making the marker light inoperable. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Assoc. Equipment." If a side marker light does not function, vehicle visibility can be decreased to other drivers, increasing the risk of a crash. Honda will notify owners, and dealers will inspect both the taillight assemblies, replacing them as necessary, free of charge. The recall began on August 31, 2016. Owners may contact Honda customer service at 1-888-234-2138. Honda's number for this recall is KB8.

16V-526

Nissan North America, Inc. (Nissan) is recalling certain model year 2012-2013 Infiniti M35 Hybrid vehicles manufactured March 23, 2010, to September 9, 2013. A system overheat condition may cause the hybrid powertrain control module to shut off the engine. If the engine shuts off while driving, there is an increased risk of a crash. Nissan will notify owners, and dealers will reprogram the hybrid control module, automatic transmission control unit, and inverter software, free of charge. The recall began on August 15, 2016. Owners may contact Nissan customer service at 1-800-647-7261.

16V-527

Honda (American Honda Motor Co.) is recalling certain model year 2015-2016 CBR300RA, CBR300R and CB300F motorcycles. The affected motorcycles may have an improperly machined crankshaft which may result in the failure of the connecting rod bearing retainer. If the connecting rod bearing retainer fails, the engine may stall, increasing the risk of a crash. Honda will notify owners, and dealers will replace the crankshaft assembly, free of charge. The recall began on August 26, 2016. Owners may contact Honda customer service at 1-866-784-1870. Honda's number for this recall is KB9.

16V-528

Chrysler (FCA US LLC) is recalling certain model year 2014-2015 Jeep Cherokee and 2015 Chrysler 200, Jeep Renegade, RAM ProMaster, and 2016 Fiat 500X vehicles equipped with 9-speed automatic transmissions. The transmission sensor clusters may have insufficient crimps in the transmission wire harness, and as a result, the transmission may unexpectedly shift to neutral. On August 29, 2016 Chrysler added the 2016 Fiat 500X vehicles to this recall. If the vehicle unexpectedly shifts to neutral, there is an increased risk of a crash. Chrysler will notify owners, dealers will update the transmission software to prevent the transmission from shifting into neutral due to a faulty crimp, free of charge. The remedy is currently unavailable. Interim notices were mailed to owners on August 24, 2016. Owners will receive a second notice when the remedy becomes available in September 2016. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is S55.

16V-529

Tiffin Motorhomes, Inc. (Tiffin) is recalling certain model year 2007-2011 Allegro, Allegro Bus, Phaeton, and Zephyr motorhomes, 2007-2010 Allegro Bay motorhomes, and 2010-2011 Allegro Breeze motorhomes. The windshield wiper arms on the affected vehicles may break off. If the windshield wiper arms break, the driver's visibility may be reduced, increasing the risk of a crash. Tiffin will notify owners, and dealers will replace the wiper blade arms, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Tiffin customer service at 1-256-356-8661. Tiffin's number for this recall is TIFF-100.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2016**

Published September 9, 2016

16V-532

Triple E Recreational Vehicles (Triple E) is recalling certain model year 2016-2017 Unity recreational vehicles, models U24TB and U24IB, manufactured March 1, 2016, to June 9, 2016. The Truma propane water heater line on the affected vehicles may be damaged from items moving within the lower storage compartment, causing the line to rupture and allow propane gas to leak out. A propane gas leak in the presence of an ignition source increases the risk of a fire. Triple E will notify owners, and dealers will reposition the protective cleat for the gas line, free of charge. The recall began on August 15, 2016. Owners may contact Triple E customer service at 1-877-992-9906. Triple E's number for this recall is CA#8349-1.

16V-533

Ferrara Fire Apparatus, Inc. (Ferrara) is recalling certain model year 2014-2016 Igniter vehicles manufactured January 1, 2014, to May 2, 2016, equipped with certain Class 1 ES-KEY power control modules manufactured by Hale Products. The affected power control modules may not provide sufficient circuit protection depending on their combination of software and installation, possibly resulting in a short circuit. A short circuit may result in damage to components of the vehicle's electrical system, affecting their function, such as causing a loss of headlights, thereby increasing the risk of a crash. A short circuit may also increase the risk of a fire. Ferrara will notify owners, and dealers will upgrade the software and/or retrofit fuses, free of charge. The recall began on August 26, 2016. Owners may contact Ferrara customer service at 1-225-567-7100.

16V-534

Kawasaki Motors Corp., U.S.A. (Kawasaki) is recalling certain model year 2017 Kawasaki Z125 Pro motorcycles manufactured February 4, 2016 through June 7, 2016. In the affected motorcycles, the shock absorbers may leak oil and lose their function. Loss of function of the shock absorbers may affect the motorcycle's handling, increasing the risk of a crash. Kawasaki will notify owners, and dealers will replace the shock absorbers, free of charge. The recall began July 26, 2016. Owners may contact Kawasaki customer service at 1-866-802-9381. Kawasaki's number for this recall is MC16-04.

16V-535

Altec Industries Inc. (Altec) is recalling certain model year 2015-2016 Aerial Devices and Digger Derrick vehicles equipped with front bumper winches or capstans, manufactured December 26, 2015, to March 30, 2016. The affected vehicles have a hydraulic motor whose shaft may fail resulting in unexpected movement of the winch or the capstan. Unexpected winch movement may increase the risk of injury. Altec will notify owners, and dealers will replace the hydraulic motor, free of charge. The recall began on August 26, 2016. Owners may contact Altec customer service at 1-205-991-7733. Altec's number for this recall is CSN 635.

16V-536

Spartan Motors USA (Spartan) is recalling certain model year 2014 Transit Bus Chassis Cabs manufactured January 29, 2014, to December 1, 2014 and built to be completed as transit buses powered by compressed natural gas (CNG). These chassis cabs have frames that may crack. The cracked frame may reduce the driver's ability to control the vehicle, increasing the risk of a crash. Spartan has notified owners, and dealers will weld any cracked frames as an interim fix. For the final remedy, the dealers will add reinforcement to both chassis

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2016**

Published September 9, 2016

rails, free of charge. The recall began on July 15, 2016. Owners may contact Spartan customer service at 1-517-543-6400. Spartan's number for this recall is 16019.

16V-537

Starcraft RV (Starcraft) is recalling certain model year 2016-2017 AR-ONE Maxx travel trailers and fifth wheels manufactured May 4, 2015, to June 27, 2016. The affected vehicles may be equipped with a Federal Label with incorrect tire information, and as a result, the owner could replace the tire with an incorrect size. As such, these vehicles fail to comply with the Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims." If the tire is replaced with an incorrect tire size, vehicle handling could be affected, increasing the risk of a crash. Starcraft will notify owners, and dealers will install a corrected Federal and Tire label, free of charge. The recall began on August 5, 2016. Owners may contact Starcraft customer service at 1-800-945-4787. Starcraft's number for this recall is 9902307.

16V-538

Bentley Motors, Inc. (Bentley) is recalling certain model year 2007-2009 Continental Flying Spur vehicles manufactured April 25, 2007 through October 31, 2008. The sunroof glass on the affected vehicles may not be properly secured to the sunroof frame. As a result, the sunroof glass may detach from the car while driving. If the glass detaches from the sunroof frame it could become a road hazard, increasing the risk of a crash. Bentley will notify owners, and dealers will apply additional adhesive between the sunroof glass frame and sunroof glass panel, free of charge. Owners may contact Bentley customer service at 1-800-777-6923.

16V-539

BMW of North America, LLC (BMW) is recalling certain model year 2015 BMW M5 sedans manufactured September 4, 2014, through December 4, 2014, 2015 M6 coupes manufactured September 3, 2014, through December 3, 2014, 2015 M6 convertibles manufactured September 8, 2014, through December 4, 2014, and 2015 M6 Gran Coupe vehicles manufactured September 3, 2014, through December 4, 2014. The affected vehicles have a driveshaft that may have been inadequately welded during manufacturing. Due to the improper weld, the driveshaft may fracture and fail, causing loss of drive to the rear wheels and a loss of propulsion. Additionally, if the car is turned off and exited without the parking brake applied, the car may roll. Either condition increases the risk of a crash. BMW will notify owners, and dealers will inspect and replace the driveshaft, as necessary, free of charge. The recall is expected to begin during September 2016. Owners may contact BMW customer service at 1-800-525-7417.

16V-540

Charles Machine Works Inc. (Charles Machine) is recalling certain model year 2016 Ditch Witch T14MV trailers manufactured June 23, 2015, to July 01, 2016. The affected trailers may have an incorrect wiring harness that could result in the brakes not applying in the event that the trailer separates from the tow vehicle. If the trailer brakes do not activate in the event of a trailer breakaway, there would be an increased risk of a crash. Charles Machine has notified owners, and dealers will correct the switch wiring, free of charge. The recall began on August 5, 2016. Owners may contact Charles Machine customer service at 1-800-654-6481.

16V-541

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2016**

Published September 9, 2016

Blue Bird Body Company (Blue Bird) is recalling certain model year 2015-2017 Vision school buses manufactured July 3, 2014, to June 24, 2016, equipped with 6.8L Ford engines and Gen 3 propane units. The affected vehicles have propane fuel lines that may rub or are crossed and secured together, possibly resulting in line damage and a propane fuel leak. A propane leak in the presence of an ignition source may increase the risk of a fire. Blue Bird will notify owners, and dealers will inspect and reroute any Gen 3 propane lines that are not parallel. If damaged, the fuel line(s) will be replaced. These repairs will be performed free of charge. The recall began on August 15, 2016. Owners may contact Blue Bird customer service at 1-478-822-2242. Blue Bird's number for this recall is R16YT-SB.

16V-542

Blue Bird Body Company (Blue Bird) is recalling certain model year 2016-2017 Vision transit buses manufactured September 24, 2015, to May 21, 2016, equipped with 6.8L Ford engines and Gen 3 propane units. The affected vehicles have propane fuel lines that may rub or are crossed and secured together, possibly resulting in line damage and a propane fuel leak. A propane leak in the presence of an ignition source may increase the risk of a fire. Blue Bird will notify owners, and dealers will inspect and reroute any Gen 3 propane lines that are not parallel. If damaged, the fuel line(s) will be replaced. These repairs will be performed free of charge. The recall began on August 15, 2016. Owners may contact Blue Bird customer service at 1-478-822-2242. Blue Bird's number for this recall is R16YT-NSB.

16V-543

Ferrara Fire Apparatus, Inc. (Ferrara) is recalling certain model year 2011-2016 Inferno, Igniter, Intruder, and Cinder emergency vehicles manufactured October 3, 2011, to May 31, 2016, equipped with Class 1 Ultraview Touchscreens manufactured by Hale Products. These touchscreens may experience false switch activations that can happen without the operator's knowledge causing accessories to turn on or off, affecting vehicle performance. The unintended turning on or off of accessories such as emergency beacons or automatic snow chains can increase the risk of a crash. Ferrara will notify owners, and service personnel or service centers will reprogram the units, free of charge. The recall began on August 26, 2016. Owners may contact Ferrara customer service at 1-225-567-7100 extension 3011.

16V-544

Chrysler (FCA US LLC) is recalling certain model year 2015-2016 Jeep Renegade vehicles manufactured August 25, 2014, to June 25, 2016, equipped with a factory-installed optional trailer hitch package. The trailer hitch assembly may have been attached with only a single fastener per side, not three per side as required. Without the proper amount of fasteners, the trailer hitch assembly may separate from the vehicle, and any towed vehicle may no longer be properly connected, increasing the risk of a crash. Chrysler will notify owners, and dealers will install two additional fasteners per side, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is S62.

16V-545

Pierce Manufacturing (Pierce) is recalling certain model year 2015-2016 Pumper and Tanker trucks built on Freightliner chassis manufactured September 27, 2014, to June 14, 2016. The affected vehicles were modified

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2016**

Published September 9, 2016

to be equipped with extended bumpers, requiring the vehicles to have additional side marker lights due to the new vehicle length. Since the vehicles do not have the necessary amount of side marker lights, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Assoc. Equipment." If the vehicle is missing side marker lights, it may have reduced visibility to other drivers, increasing the risk of a crash. Pierce notified owners, and dealers will install the required side marker lamps, free of charge. The recall began on August 15, 2016. Owners may contact Pierce customer service at 1-888-974-3723. Pierce's number for this recall is 74B275.

16V-546

Forest River, Inc. (Forest River) is recalling certain model year 2016-2017 Surveyor recreational trailers, model SVT226RLDS, manufactured October 9, 2015, to June 9, 2016. The affected vehicles have a Federal Placard that incorrectly classifies the vehicle as a school bus. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." If the vehicle is misclassified on the label, it can cause the vehicle to be overloaded, increasing the risk of a crash. Forest River will notify owners, and dealers will replace the incorrect Federal Placard with a corrected placard, free of charge. The recall is expected to begin September 16, 2016. Owners may contact Forest River customer service at 1-800-348-7440. Forest River's number for this recall is 37-07142016-0224.

16V-547

Mitsubishi Motors North America, Inc. (MMNA) is recalling certain model year 2015 Mitsubishi Outlander Sport vehicles manufactured June 25, 2014, through November 25, 2015 and equipped with a 2.0L engine and a continuously variable transmission (CVT). During assembly, a clamp for a CVT hose may not have been properly secured, allowing the hose to detach and leak transmission fluid. If enough transmission fluid leaks out, the transmission may not function properly and the vehicle may become inoperable, increasing the risk of a crash. Additionally, if leaking transmission fluid contacts an a hot surface there is an increased risk of a fire. Mitsubishi will notify owners, and dealers will inspect the hose clamps, correcting their installation, as necessary, free of charge. The recall began on August 15, 2016. Owners may contact Mitsubishi customer service at 1-888-648-7820. Mitsubishi's number for this recall is SR-16-005.

16V-548

Forest River, Inc. (Forest River) is recalling certain model year 2017 Rockwood and Flagstaff trailers manufactured July 8, 2016, to July 11, 2016. The affected vehicles are equipped with a Federal Placard that incorrectly indicates that the ST225/75R15D tires have a recommended pressure of 50 PSI. These tires should be maintained at 65PSI. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims." If the tires are run at a low pressure, they may overheat and fail, possibly causing a loss of vehicle control and increasing the risk of a crash. Forest River will notify owners, and dealers will provide a corrected Federal Placard, free of charge. The recall is expected to begin September 16, 2015. Owners may contact Forest River customer service at 1-574-642-2640. Forest River's number for this recall is 10-07192016-0230.

16V-549

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2016**

Published September 9, 2016

Forest River, Inc. (Forest River) is recalling certain model year 2017 Coachmen Freedom Express recreational vehicles, models FET28SE, FET282BHDS, FET282BHDSLE, FET281RLDS, FET281RLDSLE, FET29SE, FET292BHDS and FET292BHDSLE, manufactured May 16, 2016, to July 19, 2016. These vehicles may have insufficient space between the slideroom driveshaft and the driver's side tires, causing the tires to rub. If the driveshaft rubs against the tires, tire failure may result, possibly causing a loss of control and increasing the risk of a crash. A remedy plan has not yet been determined. The recall is expected to begin September 16, 2016. Owners may contact Forest River customer service at 1-574-825-8205. Forest River's number for this recall is 220-07192016-0229.

16V-550

Pierce Manufacturing (Pierce) is recalling certain model year 2015-2016 Enforcer, Impel, and Velocity vehicles manufactured April 12, 2016, to May 31, 2016, equipped with aerial devices. The affected vehicles may have a plastic plug installed in an unused port in the hydraulic pump for the aerial device. This plastic plug may separate from the pump resulting in a hydraulic fluid leak, potentially disabling the aerial device. The inoperable aerial device can increase the risk of injury if the operator needs to move away from a hazardous situation or it may impede the safety mission. Pierce has notified owners, and dealers will inspect the vehicles and replace the plastic plug with a metal plug, as necessary, free of charge. The recall began on July 26, 2016. Owners may contact Pierce customer service at 1-888-974-3723. Pierce's number for this recall is 74B276.

16V-551

Forest River, Inc. (Forest River) is recalling certain model year 2013-2017 Dynamax and Coachmen Pursuit recreational vehicles and 2016-2017 Freelanders and Orion recreational vehicles. The affected vehicles are equipped with shower curtains that may not adequately resist catching fire in the presence of an ignition source. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 302, "Flammability of Interior Materials." A flammable shower curtain may further fuel a fire, increasing the risk of injury. Forest River will notify owners, and dealers will replace the shower curtains with curtains made with fire retardant, free of charge. The recall is expected to begin September 16, 2016. Owners may contact Dynamax customer service at 1-574-262-3474, Pursuit customer service at 1-574-825-8305 (east of the Mississippi) or 1-574-825-8317 (west of the Mississippi) and Freelanders or Orion customer service at 1-574-825-8602. Forest River's number for this recall is 51-07152016-0225.

16V-552

BMW of North America, LLC (BMW) is recalling certain model year 2016-2017 MINI Clubman manufactured August 19, 2015 through July 14, 2016. The affected vehicles are equipped with a side curtain air bag that may not fully open properly in the event of a vehicle crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 226, "Ejection Mitigation." In the event of a vehicle crash, and the side curtain air bag does not inflate as intended, there is an increased risk of injury to the front seat occupant. BMW will notify owners, and dealers will repair the driver and passenger side curtain air bags, free of charge. The recall is expected to begin September 12, 2016. Owners may contact BMW customer service at 1-800-525-7417 or email BMW at CustomerRelations@bmwusa.com.

16V-553

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2016**

Published September 9, 2016

Mahindra Tractor Assembly Inc. (Mahindra) is recalling certain model year 2015-2016 GenZe 2.0 and Enterprise 1 scooters manufactured October 2, 2015, to July 11, 2016. The front forks of the affected scooters may not be properly tightened within the steering mounts and, as a result, the fork tubes may move affecting low speed maneuverability. If the fork tubes move and affect the maneuverability or the turning radius of the scooter, it can increase the risk of a crash. Mahindra will notify owners and new bolts and washers to ensure proper clamp force will be installed, free of charge. Owners may contact Mahindra customer service at 1-888-808-9526.

16V-554

Braun Corporation (Braun) is recalling certain model year 2016 MXV vehicles manufactured February 8, 2016, to June 23, 2016 and built on a Ford Explorer chassis. The passenger seat electrical harness may be incorrectly routed and can be crushed between the seat structure and the seat riser manufactured as part of the wheelchair accessible conversion. The crushed seat harness may prevent correct passenger air bag deployment, increasing the risk of injury to the seat occupant in the event of a crash. Braun will notify owners, and dealers will inspect the seat wiring harness routing. Improperly routed and/or damaged harnesses will be replaced and correctly routed as required, free of charge. The recall began on August 26, 2016. Owners may contact Braun customer service at 1-800-488-0359.

16V-555

Navistar, Inc. (Navistar) is recalling certain model year 2014-2017 International ProStar trucks manufactured June 11, 2013, through May 19, 2016. In the affected vehicles, the connection for the cube fuse terminal may break resulting in a total loss of power to the cab and an unexpected engine stall. An unexpected engine stall can increase the risk of a crash. Navistar will notify owners, and dealers will replace the cube fuse with a chassis-mounted power distribution module (PDM), free of charge. The recall is expected to begin on September 16, 2016. Owners may contact Navistar customer service at 1-800-448-7825. Navistar's number for this recall is 16508.

16V-556

Load Trail LLC (Load Trail) is recalling certain model year 2014-2016 81.5 x 22 Triple Axle Tilt Deck trailers manufactured January 1, 2014, to January 1, 2016. The affected trailers, sold through Altec for use in transporting TDA58 Articulating Telescopic Aerial Devices, have weld joints that may crack where the front bumper, frame, and the stationary deck are joined. If the welds fail, the equipment may disengage from the trailer, increasing the risk of a crash. Load Trail will notify owners, and dealers will repair the weld joints on the trailers, free of charge. The recall is expected to begin on September 20, 2016. Owners may contact Load Trail customer service at 1-800-650-5194.

16V-557

Forest River, Inc. (Forest River) is recalling certain model year 2011-2016 Glaval Titan II Low Floor CNG transit buses manufactured December 30, 2014, to March 7, 2016. The affected buses may have frames that may crack. A cracked frame may reduce the driver's ability to control the vehicle, increasing the risk of a crash. Spartan will notify owners on behalf of Forest River, and Spartan dealers will weld any cracked frame as an interim fix. For the final remedy, the dealers will add reinforcements to both chassis rails, free of charge. The

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2016**

Published September 9, 2016

recall is expected to begin September 19, 2016. Owners may contact Spartan customer service at 1-800-543-4277. Forest River's number for this recall is 37-07222016-0231.

16V-558

Chrysler (FCA US LLC) is recalling certain model year 2015 RAM 2500 trucks, and RAM 3500 trucks and cab chassis. The affected vehicles may have inadequate welds securing the front track bar frame brackets, possibly resulting in the bracket components separating from the frame. If the bracket components separate from the frame, the vehicle may have a reduced response to steering input, increasing the risk of a crash. Chrysler will notify owners, and dealers will weld on a new track bar frame bracket or replace the frame of the vehicle, free of charge. The recall is expected to begin on September 8, 2016. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is S58.

16V-559

Jayco, Inc. (Jayco) is recalling certain model year 2016-2017 Jay Feather, Jay Flight, Jay Flight SLX, Eagle, White Hawk, and Octane travel trailers manufactured January 5, 2016, to July 18, 2016, equipped with a Sway Command anti-sway system. When connected to certain tow vehicles that have an integrated brake controller, and after the anti-sway system has applied the trailer brakes in response to a sway event, the trailer brakes may no longer function to slow or stop the trailer. A loss of trailer brakes may lengthen the distance needed to stop the vehicle and cause a loss of vehicle control, increasing the risk of a crash. Jayco will notify owners, and dealers will remove the Sway Command system from the affected travel trailers, free of charge. The recall began on August 3, 2016. Owners may contact Jayco customer service at 1-800-283-8267. Jayco's number for this recall is 9901308.

16V-560

Jayco, Inc. (Jayco) is recalling certain model year 2016-2017 Alante and Precept motorhomes manufactured October 13, 2014, to June 23, 2016. The affected vehicles have a driver seat that may loosen and detach from the seat base as a result of the seat having been swiveled around. If the seat detaches from the seat base while vehicle is being driven, the operator may lose control, increasing the risk of a crash. Jayco has notified owners, and dealers will install a jam nut on top of the seat base nut, free of charge. The recall began on August 16, 2016. Owners may contact Jayco customer service at 1-800-283-8267. Jayco's number for this recall is 9903310.

16V-561

Tiffin Motorhomes, Inc. (Tiffin) is recalling certain model year 2016-2017 Breeze motorhomes manufactured July 7, 2015, to June 14, 2016. The affected vehicles have air compressors attached to the engine that may fail due to debris from manufacturing being left in the air intake tube. Failure of the air compressor may result in the inability to maintain air pressure while driving which would cause the parking brake to set unexpectedly, increasing the risk of a crash. Tiffin will notify owners, and Cummins certified technicians will inspect the air compressor for debris. Engines with no damage will have a new air intake tube installed. Engines with foreign material damage will be repaired by a Cummins certified technician, and have the air intake tube, charge air cooler, and air filter replaced. These repairs will be performed free of charge. The recall began on August 11, 2016. Owners may contact Tiffin customer service at 1-256-356-8661. Tiffin's number for this recall is TIF-

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2016**

Published September 9, 2016

101.

16V-562

Mitsubishi Motors North America, Inc. (MMNA) is recalling certain model year 2015-2016 Outlander Sport vehicles and 2016 Outlander and Lancer vehicles. The affected vehicles are equipped with a constant velocity transmission (CVT) that, in certain driving conditions, may cause a delay in the vehicle accelerating. A hesitation during acceleration can increase the risk of a crash. MMNA has notified owners, and dealers will reprogram the CVT control unit with modified software, free of charge. The recall began on August 15, 2016. Owners may contact MMNA customer service at 1-888-648-7820. MMNA's number for this recall is SR-16-006.

16V-563

Keystone RV Company (Keystone) is recalling certain model year 2017 Dutchmen Voltage toy hauler fifth wheel trailers manufactured March 11, 2016, to June 14, 2016. The affected vehicles were incorrectly built with a 18,000 lb rated fifth wheel pin box hitch instead of a 21,000 lb rated hitch. If the vehicle is loaded to a weight greater than 18,000 lbs, the pin box can fail, possibly resulting in the trailer separating from the tow vehicle and increasing the risk of a crash. Keystone notified owners, and dealers will remove and replace the pin box inner with one rated for 21,000 lbs, free of charge. The recall began on August 5, 2016. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 16-259.

16V-564

Cruiser RV (Cruiser) is recalling certain model year 2017 Shadow Cruiser, Fun Finder, MPG, Radiance, South Fork, and Stryker recreational trailers. The affected vehicles have an LED light on the front cap of the camper that may short circuit and overheat. If the light overheats there would be an increased risk of a fire. Cruiser will notify owners, and dealers will replace the light with one that has built-in voltage protection. The recall began on September 1, 2016. Owners may contact Cruiser customer service at 1-260-562-3500.

16V-565