

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JULY 2017**

*Published September 8, 2017*

**CHILD SEATS:**

None during July 2017.

**EQUIPMENT:**

Dorman Products, Inc. (Dorman) is recalling certain aftermarket power window switches, Dorman-brand part numbers 901-601 and 901-370, and Solutions-brand part numbers 730-7444-1 and 730-7630-1. When the switch has been activated to raise the window, if something, such as a finger, is between the window glass and the window frame, the switch will not auto-reverse to prevent an injury. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 118, "Power-Operated Window Systems." If the anti-pinch function does not perform as intended during either the accidental or intentional activation of the auto-up feature of the switch, there would be an increased risk of an injury. Dorman will notify owners and dealers will replace the window switch, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Dorman customer service at 1-800-523-2492.

**17E-032**

Cummins, Inc. (Cummins) is recalling certain L9 heavy duty diesel engines, part number D563018BX03, sold for installation in Pierce fire trucks. On some engines, the capscrews that secure the flexplate may not have been properly tightened resulting in the flexplate separating. If the flexplate separates, the engine may stall, increasing the risk of a crash. Cummins will notify owners, and Cummins dealers will replace the flexplate and capscrews on the subject engines, free of charge. The recall began on July 21, 2017. Owners may contact Cummins customer service at 1-800-286-6467. Cummins' number for this recall is C1914.

**17E-033**

Takata Corporation (Takata) has determined that certain PSDI-5 driver frontal air bag inflators that use calcium sulfate as a desiccant may rupture due to propellant degradation occurring after long-term exposure to moderate absolute humidity, temperatures, and temperature cycling. These inflators were assembled as part of the frontal air bag modules, and used as original equipment or replacement equipment, such as after a vehicle crash necessitating replacement of the original air bags. This recall is not for all desiccated PSAN inflators; rather it relates to a subset containing calcium sulfate. An inflator rupture may result in metal fragments striking the driver or other occupants resulting in serious injury or death. Takata will be working with vehicle manufacturers to determine into which vehicles the affected inflators were installed either as original or replacement equipment during service. As this work progresses, various vehicle recalls will likely be announced by the impacted vehicle manufacturers. NHTSA will supply this information as soon as possible.

**17E-034**

Adient plc (Adient) is recalling certain Recaro Commercial Bus Driver Seats, models Ergo R, Ergo D, AM71, AM72 and AM80. In the affected seats, the seat belt buckle may be stuck in the locked position, preventing the seat belt tongue from being able to be inserted and locked. If the seat belt cannot be latched, the bus may be operated without the seat belt being used, increasing the risk of injury in the event of a crash. Adient will notify

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JULY 2017**

*Published September 8, 2017*

the bus manufacturers that purchased the seats with the defective seat belt buckles and will replace the buckle housings, free of charge. The recall began on August 15, 2017. Owners may contact Adient at 1-734-254-5000.

**17E-035**

MORryde International, Inc. (MORryde) is recalling certain accessory Jerry Can Holders, part numbers JP54-004 and JP54-005. The Jerry Can holders may tear apart from the C-channel used to secure the holder to the spare tire. If the Jerry Can holder detaches, it may be a road hazard, increasing the risk of a crash. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact MORryde customer service at 1-574-293-1581.

**17E-036**

PACCAR Incorporated (PACCAR) is recalling certain Braden Hydraulic Recovery winches, model number PD18C, sold as part numbers 05370, 05373, 05374, 05375, 05439, 05644, 06033, 06811, 06979, and 83195 by PACCAR Winches. A defective ring gear adapter might cause the winch to fail under load. Failure of the winch may result in loss of control of the load, increasing the risk of injury. PACCAR will notify owners, and dealers will test the winches, replacing any defective ring gear adapters, free of charge. The recall began on July 28, 2017. Owners may contact PACCAR customer service at 1-918-259-3258. PACCAR's number for this recall is 17WINA.

**17E-037**

TriMark Corporation (TriMark) is recalling certain door striker bolts, model number 070-0100, assembled into door systems for ambulance manufacturers and distributors. The striker bolts may fail under load allowing the doors to open in the event of a crash. As such, these bolts fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 206, "Door locks and door retention components." If a door opens in a crash there would be an increased risk of injury. TriMark will notify the purchasers of the door systems, and will provide replacement Striker Bolts, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Trimark customer service at 1-641-394-3188.

**17E-038**

Carli Suspension is recalling adjustable track bars, part numbers CS-DPRB03 and CS-DPRB14. These track bars were sold for use on 2013-> Ram 3500 4X4, 2014-> Ram 2500 4X4, 2003-2013 Ram 2500 Diesel and Hemi and 2003-2012 Ram 3500 diesel trucks. The track bars have a Johnny Joint rod end that may break, resulting in the track bar detaching from the axle. If the joint were to break, the detached track bar would cause a loss of steering, increasing the risk of a crash. Carli Suspension will notify owners, and will provide a heim joint to replace the Johnny Joint, free of charge. The recall began on August 14, 2017. Owners may contact Carli Suspension customer service at 1-888-992-2754 or info@CarliSuspension.com.

**17E-040**

Dana, Inc., (Dana) is recalling certain Spicer D-Series and E-Series steer axles. The castellated nut on the steer axles may not be properly torqued, allowing the tie rod to loosen. If the tie rod loosens, it may disconnect from the steering knuckle, causing a complete loss of steering and increasing the risk of a crash. Before a tie rod can

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JULY 2017**

*Published September 8, 2017*

disconnect from the vehicle, a driver should experience significant warning, including noise and loosened steering. Dana will notify the manufacturers of the commercial vehicles that purchased the axles. Those manufacturers will conduct recalls and their dealers will inspect the torque of the castellated nut and tie rod, tightening it as necessary, free of charge. The recall began in August 2017. Owners may contact Dana customer service at 1-877-777-5360.

**17E-041**

**TIRES:**

None during July 2017.

**VEHICLES:**

Southeast Toyota Distributors, LLC (SET) is recalling certain 2011-2016 Toyota Tacoma and 4Runner vehicles equipped with accessory hood scoops installed by SET or SET dealers. The adhesive attaching the hood scoop may weaken, allowing the hood scoop to detach from the vehicle. If the hood scoop detaches, it may become a road hazard, increasing the risk of a crash. SET will notify owners, and dealers will mechanically fasten the scoop to the hood, free of charge. The recall began on September 1, 2017. Owners may contact SET customer service at 1-954-429-2000. SET's number for this recall is SET17B.

**17V-425**

Triumph Motorcycles America, LTD (Triumph) is recalling certain 2017-2018 Triumph Street Cup motorcycles. The wiring harness for the hazard warning lights may be pulled and strained during normal steering action. The pulled wires may cause the wires to pull loose from the connector resulting in a loss of the hazard warning lights, reducing the motorcycles visibility when hazard warning lights are wanted, increasing the risk of a crash. Triumph will notify owners, and dealers will extend the wiring length by installing a supplemental harness, free of charge. The recall began July 18, 2017. Owners may contact Triumph customer service at 1-678-854-2010. Triumph's number for this recall is Safety Recall 549.

**17V-426**

Ford Motor Company (Ford) is recalling certain 2017 Lincoln MKZ and Ford Edge and Fusion vehicles. On vehicles with 2.0L gas engines and six-speed automatic transmissions, the torque converter weld studs may have been inadequately welded. If the torque converter weld studs fail, the torque converter will not be connected to the engine flexplate and the vehicle will lose the ability to move, increasing the risk of a crash. Ford or Lincoln will notify owners, and dealers will replace the torque converters, free of charge. The recall began August 25, 2017. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 17S16.

**17V-427**

BMW of North America, Inc. (BMW) is recalling certain 2006 325i, 325xi, 330i, 330xi, 525i, 525xi, 530i, 530xi, and 550i vehicles equipped with the Sport Seat option and certain 2006 525i, 525xi, 530i, 530xi, 550i

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JULY 2017**

*Published September 8, 2017*

vehicles with standard seats. The front passenger seat occupant detection mat that determines if, and how, the passenger frontal air bag should deploy in a crash may fatigue and develop cracks which could lead to a system failure. Should the system fail, in the event of a crash, the front passenger air bag would be deactivated, increasing the risk of personal injury. BMW will notify owners, and dealers will repair the occupant detection mat to eliminate the possibility that it may crack, replacing it as necessary, free of charge. The recall began September 1, 2017. Owners may contact BMW customer service at 1-800-525-7417.

**17V-428**

Forest River, Inc. (Forest River) is recalling certain 2017 Glaval Commute; 2017-2018 Crossfit; 2016-2017 Starcraft Candidate II and Prodigy Bus; 2015-2017 Starcraft Starlite recreational transit buses; and one 2017 Rockport work truck. These vehicles were built on Ford Transit chassis. In the affected vehicles, the flexible coupling connecting the transmission to the driveshaft may prematurely fail. If the coupling fails, the vehicle will not be able to move under its own power and the disconnected driveshaft may impact and damage the brake and fuel lines. Additionally, the separated driveshaft may allow the vehicle to roll if the vehicle is exited when the transmission is in 'Park' but the parking brake is not applied. These scenarios may increase the risk of a crash. Forest River will notify owners, and as an interim repair, Ford dealers will replace the flexible coupling on any vehicle with more than 30,000 miles. A final remedy repair of a redesigned flexible coupling or a revised driveshaft equipped with a universal joint is being developed and is expected in early 2018. These repairs will be made free of charge. The recall began on August 28, 2017. Owners may contact Ford customer service at 1-800-392-3673 or Forest River customer service at 1-800-348-7440. Forest River's number for this recall is 5.35.225-0461.

**17V-430**

Chrysler (FCA US LLC) is recalling certain 2017 Dodge Challenger vehicles equipped with 5.7L V8 engines and eight-speed automatic transmissions. The transmission may not remain in the PARK position if that gear is selected, the engine is still running, and the driver exits the vehicle. If the vehicle is exited without the transmission remaining in the PARK position and without the parking brake set, the vehicle may roll, increasing the risk of a crash. Chrysler will notify owners, and dealers will update the transmission control module software, free of charge. The recall began 28, 2017. Owners may the Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is T41.

**17V-431**

Chrysler (FCA US LLC) is recalling certain 2011-2015 Dodge Journey vehicles. In the affected vehicles, the driver's frontal air bag may unexpectedly deploy if the air bag wiring harness gets chafed within the steering wheel and short circuits. Unexpected deployment of the driver's frontal air bag increases the risk of a crash or driver injury. Chrysler will notify owners, and dealers will inspect the air bag wiring within the steering wheel, replacing it if necessary. A protective cover will also be installed. These repairs will be made free of charge. The recall began August 28, 2017. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is T47.

**17V-432**

Chrysler (FCA US LLC) is recalling certain 2017 Jeep Compass vehicles. The affected vehicles have User's

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JULY 2017**

*Published September 8, 2017*

Guides that contain incorrect information regarding the jump start procedure, specifically, the polarity of the battery terminals are reversed in the battery terminal graphic. If a customer follows the User's Guide, they may hook up the battery jumper cables incorrectly, increasing their risk of injury. Chrysler will notify owners and will replace the User's Guides with a corrected version, free of charge. The recall began August 22, 2017. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is T46.

**17V-433**

Chrysler (FCA US LLC) is recalling certain 2017 Ram 1500 trucks. The fuel tanks in the affected vehicles may have a broken fuel tank control valve which might leak fuel if the vehicle were to become inverted. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 301, "Fuel System Integrity." In the event of a rollover crash, leaking fuel in the presence of an ignition source can increase the risk of a fire. Chrysler will notify owners, and dealers will replace the fuel tanks, free of charge. The recall began on August 10, 2017. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is T45.

**17V-434**

Chrysler (FCA US LLC) is recalling certain model year 2011-2014 Dodge Challenger, Dodge Charger, Chrysler 300, Dodge Durango, and 2012-2014 Jeep Grand Cherokee vehicles. The affected vehicles have electro-hydraulic power steering (EHPS) and are equipped with a 5.7L or a 3.6L engine and a 160, 180 or 220 amp alternator. In the affected vehicles, the alternator may suddenly fail. If the alternator fails, the vehicle may stall without warning, increasing the risk of a crash. There is also the possibility that the alternator may short circuit, increasing the risk of a fire. Chrysler will notify owners, and dealers will inspect the alternator and depending on the part number, will replace the alternator, if necessary, free of charge. Remedy parts are currently unavailable. Interim notices informing owners of the safety risk were mailed August 29, 2017. Owners will receive a second notice when remedy parts become available. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is T36.

**17V-435**

Zero Motorcycles Inc. (Zero) is recalling certain 2017 S ZF6.5, S ZF13.0, DSP ZF13.0, and SR ZF13.0 motorcycles. In the event that a turn signal stops working, the turn signal flasher may not change its flash rate to alert the operator. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." If motorcycle is operated without knowing that a turn signal is not working, there would be an increased risk of a crash. Zero will notify owners and dealers will test the motorcycle's flasher, replacing it as necessary, free of charge. The recall began on July 25, 2017. Owners may contact Zero customer service at 1-888-841-8085. Zero's number for the recall is SV-ZMC-017-369.

**17V-436**

General Motors LLC (GM) is recalling certain model year 2014-2016 Buick Lacrosse and Chevrolet Spark EV, Caprice PPV and SS vehicles, 2014-2017 Buick Encore and Chevrolet Corvette, Silverado 1500 and GMC Sierra 1500 vehicles, 2015-2016 Cadillac Escalade and Escalade ESV, Chevrolet Tahoe, Trax, Suburban and Silverado 2500 and 3500 and GMC Yukon and Yukon XL vehicles, and 2015-2017 GMC

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JULY 2017**

*Published September 8, 2017*

Sierra HD 2500 and 3500 vehicles. While being previously remedied for recall 16V-651, the affected vehicles may not have received the complete software update necessary to remedy the recall condition. Without the update, certain driving conditions may cause the air bag sensing and diagnostic module (SDM) software to activate a diagnostic test. During this test, deployment of the frontal air bags and the seat belt pretensioners would not occur in the event of a crash. A failure of the front air bags or seat belt pretensioners to deploy in the event of a crash necessitating deployment increases the risk of injury to the driver and front passenger. GM will notify owners, and dealers will reflash the SDM software. Vehicles that have had a previous air bag deployment will have the SDM replaced. These repairs will be performed free of charge. The recall began on August 4, 2017. Owners may contact Buick customer service at 1-800-521-7300, Cadillac customer service at 1-800-458-8006, Chevrolet customer service at 1-800-222-1020, or GMC customer service at 1-800-462-8782. GM's number for this recall is 17287.

**17V-437**

BMW of North America, LLC (BMW) is recalling certain 2014-2017 BMW R1200GS and BMW R1200GS Adventure motorcycles. The motorcycle fixed fork tube may separate from the pressed in seal plug that secures the tube to the upper triple clamp. If the fork tube detaches from the sealing plug, the handling and stability of the motorcycle will be affected, increasing the risk of a crash. BMW will notify owners, and dealers will add an additional fixed fork tube bush. A fork that is sufficiently damaged will be replaced with a modified new part. These repairs will be made free of charge. The recall began August 31, 2017. Owners may contact BMW customer service at 1-800-525-7417.

**17V-438**

Keystone RV Company (Keystone) is recalling certain 2016-2017 Keystone Outback travel trailers, models 220URB, 240URS, 250URS, 255UBH, and 293UBH. The affected vehicles were built with an incorrect drawbar installed to tow the travel trailer. Under certain conditions while traveling, the drawbar may bend, affecting vehicle handling and increasing the risk of a crash. Keystone will notify owners, and dealers will bolt on a reinforcement channel over the existing drawbar attachment of the frame, free of charge. The recall began on August 28, 2017. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 17-290.

**17V-439**

Jayco, Inc. (Jayco) is recalling certain 2017 Jay Flight SLX travel trailers equipped with the Rocky Mountain Package option. The Cargo Carrying Capacity (CCC) labels on the affected vehicles did not include the weight of the water tank and water when calculating the CCC, therefore, the CCC is overstated beyond the 1% variance allowed. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims." Without an accurate CCC, the trailer may be overloaded, affecting the handling and increasing the risk of a crash. Jayco has notified owners and will provide them with corrected labels, free of charge. The recall began on July 20, 2017. Owners may contact Jayco customer service at 1-800-283-8267. Jayco's number for this recall is 9901358.

**17V-440**

Entegra Coach (Entegra) is recalling certain 2018 Cornerstone motorhomes equipped with Cummins ISX 15L

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JULY 2017**

*Published September 8, 2017*

engines. These engines have a fuel pump whose drive gear could possibly slip on its drive shaft, causing a fuel pump function loss, resulting in an engine stall. An engine stall can increase the risk of a crash. Entegra has notified owners, and qualified Spartan Service Center/Cummins Distributors will replace the fuel pumps, free of charge. The recall began on July 21, 2017. Owners may contact Spartan customer service at 1-855-589-9836 or Entegra customer service at 1-800-517-9137.

**17V-441**

Honda (American Honda Motor Co.) is recalling certain 2017 Honda CR-V 2WD and AWD vehicles. The affected vehicles have a fuel supply pipe that may have been improperly manufactured, possibly resulting in the pipe disconnecting and leaking while driving. If the pipe disconnects, the engine will stall, increasing the risk of a crash. Additionally, the disconnected pipe may leak fuel, which, in the presence of an ignition source, can increase the risk of a fire. Honda will notify owners, and dealers will replace the fuel supply pipe, free of charge. The recall began August 31, 2017. Owners may contact Honda customer service at 1-888-234-2138. Honda's number for this recall is KH1.

**17V-442**

PACCAR Incorporated (PACCAR) is recalling certain 2017-2018 Peterbilt 367, 389, 567, 579 and 587 trucks, and 2018 Kenworth C500, T680, T800, T880 and W900 trucks equipped with Cummins ISX 15L engines. These engines have a fuel pump whose drive gear could possibly slip on its drive shaft, causing a fuel pump function loss, resulting in an engine stall. An engine stall can increase the risk of a crash. Cummins will notify the vehicle purchaser, and Cummins dealers will replace the fuel pumps, free of charge. A notification schedule has not yet been provided. Owners may contact Cummins customer service at 1-800-286-6467 or PACCAR customer service at 1-425-468-7400. PACCAR's number for this recall is C1909.

**17V-443**

Keystone RV Company (Keystone) is recalling certain 2016-2018 Keystone Avalanche recreational trailers, model 370RD. The affected vehicles have an adjustment bolt for the kitchen slide-out that could contact the front tire. If the bolt contacts the front tire, the tire may suddenly fail, increasing the risk of a crash. Keystone has notified owners, and dealers will replace the adjustment bolt with a shorter one, free of charge. The recall began on July 27, 2017. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 17-293.

**17V-444**

Forest River, Inc. (Forest River) is recalling certain 2017 Rockwood travel trailers, models RLF8301WS and RLF8301WS-W. The affected vehicles have a Federal Placard with an incorrect ninth place check digit printed on the VIN label. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." The incorrect Check Digit will hinder the registration of the vehicle, which can lead to improper licensing and the failure to properly account for the vehicle in the event of a safety recall. Forest River will notify owners, and will provide a corrected Federal Placard, free of charge. The recall began on July 21, 2017. Owners may contact Forest River customer service at 1-574-642-5164. Forest River's number for this recall is 10C-07142017-0480.

**17V-445**

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JULY 2017**

*Published September 8, 2017*

Forest River, Inc. (Forest River) is recalling certain 2016 StarCraft Quest school buses built on Ford Transit chassis. In the affected vehicles, the flexible coupling connecting the transmission to the driveshaft may prematurely fail. If the coupling fails, the vehicle will not be able to move under its own power and the disconnected driveshaft may impact and damage the brake and fuel lines. Additionally, the separated driveshaft may allow the vehicle to roll if the vehicle is exited when the transmission is in 'Park' but the parking brake is not applied. These scenarios may increase the risk of a crash. Forest River will notify owners, and as an interim repair, Ford dealers will replace the flexible coupling on any vehicle with more than 30,000 miles. A final remedy repair of a redesigned flexible coupling or a revised driveshaft equipped with a universal joint is being developed and is expected in early 2018. These repairs will be made free of charge. The recall began on July 25, 2017. Owners may contact Ford customer service at 1-800-392-3673 or Forest River customer service at 1-800-348-7440. Forest River's number for this recall is 5-07142017-0481.

**17V-446**

Mercedes-Benz USA LLC. (MBUSA) is recalling certain 2017 smart fortwo and smart fortwo Cabriolet vehicles. Casting imperfections may result in the failure of the left front axle steering knuckle. Failure of the left front axle steering knuckle could affect vehicle control, increasing the risk of a crash. MBUSA will notify owners, and dealers will inspect the left front axle steering knuckle, replacing any from the affected batch, free of charge. The recall is expected to begin in September 2017. Owners may contact smart customer service at 1-877-496-3691.

**17V-447**

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2016 smart fortwo vehicles. In these vehicles, the lock nut that secures the parking brake cable to the parking brake lever may loosen over time, resulting in increased parking brake lever travel before the parking brake engages. As the parking brake lever travel increases, the holding force may decrease to a point where the vehicle is no longer safely secured in all parking situations, allowing the vehicle to unexpectedly move when parked on a slope, increasing the risk of a crash. MBUSA will notify owners, and dealers will replace the parking brake cable lock nut, free of charge. The recall is expected to begin in early September 2017. Owners may contact smart customer service at 1-877-496-3691.

**17V-448**

Nissan North America, Inc. (Nissan) is recalling certain 2007-2011 Versa Sedan and 2007-2012 Versa Hatchback vehicles. The affected vehicles have a driver frontal air bag inflator that may rupture due to propellant degradation occurring after long-term exposure to moderate absolute humidity, temperatures, and temperature cycling. An inflator rupture may result in metal fragments striking the driver or other occupants resulting in serious injury or death. Nissan will notify owners, and dealers will replace the subject inflator with a new one manufactured by a different supplier, free of charge. Remedy parts are not currently available. An interim owner notification letter will be sent by the end of September 2017, followed by a second letter when remedy parts are available. Owners may contact Nissan customer service at 1-800-647-7261.

**17V-449**

Daimler Trucks North America (DTNA) is recalling certain 2017-2018 Freightliner 122SD trucks, Western Star



**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JULY 2017**

*Published September 8, 2017*

4900 and 6900 trucks, and Freightliner Custom Chassis XCM and XCP chassis equipped with Cummins ISX15 engines. The affected engines have a fuel pump whose drive gear may slip on its drive shaft, resulting in a loss of fuel pump function. Failure of the fuel pump will result in a sudden engine stall with no warning, and with no ability to restart, increasing the risk of a crash. Cummins will send notices to the owners of the affected vehicles and Cummins dealers will replace the fuel pumps, free of charge. The recall is expected to begin September 14, 2017. Owners may contact Cummins customer service at 1-800-286-6467 or DTNA customer service at 1-800-745-8000. DTNA's number for this recall is FL744.

**17V-450**

Daimler Trucks North America (DTNA) is recalling certain 2014-2017 Freightliner Custom Chassis XCR chassis. A battery cable mounting bracket may not have been installed correctly, as a result, the improperly routed and clipped battery cable can contact the frame rail, possibly chafing and short circuiting. A battery cable short circuit can increase the risk of a fire. DTNA will notify owners, and dealers will inspect and revise the battery cable mounting bracket and cable routing, as necessary, free of charge. The recall is expected to begin on September 14, 2017. Owners may contact DTNA customer service at 1-800-745-8000. DTNA's number for this recall is FL741.

**17V-451**

Daimler Trucks North America (DTNA) is recalling certain 2018 Freightliner Cascadia, M2 Business Class, 114SD, and 122SD trucks, and Western Star 4700 and 5700 trucks. These vehicles have tow hooks used for recovery purposes that may fail during use. If the tow hook fails without warning during a recovery operation, the sudden release of the vehicle may increase the risk of injury. DTNA will notify owners, and dealers will inspect the vehicle's tow hooks and, depending on their production date codes, will replace them, free of charge. The recall is expected to begin on September 14, 2017. Owners may contact DTNA customer service at 1-800-745-8000. DTNA's number for this recall is FL-742.

**17V-452**

Daimler Trucks North America LLC (DTNA) is recalling certain 2005-2018 Thomas Built Buses Saf-T-Liner C2 school buses. In the event of a crash, the wheelchair pocket track anchorage may not adequately secure a the wheelchair. In the event of a crash, an unsecured wheelchair may increase the risk of injury. DTNA will notify owners, and dealers will add additional fasteners to the wheelchair pocket track to reinforce the anchorage, free of charge. Owners may contact DTNA customer service at 1-800-745-8000. DTNA's number for this recall is FL-743.

**17V-453**

Daimler Trucks North America LLC (DTNA) is recalling certain 2005-2018 Thomas Built Buses Saf-T-Liner C2 transit buses. In the event of a crash, the wheelchair pocket track anchorage may not adequately secure a the wheelchair. In the event of a crash, an unsecured wheelchair may increase the risk of injury. DTNA will notify owners, and dealers will add additional fasteners to the wheelchair pocket track to reinforce the anchorage, free of charge. Owners may contact DTNA customer service at 1-800-745-8000. DTNA's number for this recall is FL-743.

**17V-454**

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JULY 2017**

*Published September 8, 2017*

Pierce Manufacturing (Pierce) is recalling certain 2016-2017 Arrow XT, Enforcer, Impel, Quantum, and Velocity fire trucks equipped with Hale Pump Interlock Module Kits. The Hale interlock pressure switch can fail after prolonged exposure to extreme cold temperatures, preventing the fire truck water pump from operating. If the fire truck cannot pump water during a fire emergency, there would be an increased risk of injury. Pierce will notify owners, and Hale Products dealers will replace the interlock modules, free of charge. The recall began on March 24, 2017. Owners may contact Hale customer service at 1-800-533-3569 or Pierce customer service at 1-414-832-3000. Pierce's number for this recall is 74B281.

**17V-455**

Winnebago Industries, Inc (Winnebago) is recalling certain 2015 BUS28WC and BUS28SH transit buses. Based on the seating capacity of the vehicle as equipped, if fully loaded, the vehicles may exceed the gross vehicle weight rating (GVWR) and/or the gross axle weight rating (GAWR) limitations indicated on the certification label. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." Overloading of the transit bus may result in a loss of control, increasing the risk of a crash. Winnebago will notify owners, and dealers will reduce the seating capacity of the bus, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Winnebago customer service at 1-641-585-3535.

**17V-456**

Mazda North America Operations (Mazda) is recalling certain 2012 CX-7, CX-9 and Mazda6 vehicles sold, or ever registered, in the states of Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands, or "Zone A."

Additionally, unless included in "Zone A" above, Mazda is recalling certain 2009 CX-7, CX-9 and Mazda6 vehicles sold, or ever registered in the states of Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B."

Additionally, unless included in "Zone A" or "Zone B" above, Mazda is recalling certain 2007-2008 CX-7 and CX-9 sold, or ever registered in the states of Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin, and Wyoming.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death. Mazda will notify owners, and dealers will replace the front passenger side air bag inflator with an alternate inflator, free of charge. The recall is expected to begin August 15, 2017. Owners may contact Mazda customer service at 1-800-222-5500. Mazda's number for this recall is 1317F. Note: This recall supersedes recall 17V-

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JULY 2017**

*Published September 8, 2017*

012.

**17V-457**

Carry-On Trailer Corp. (Carry-On Trailer) is recalling certain 2017 Utility, Dump, and Enclosed trailers equipped with electric brakes. The affected trailers use the Bright Way breakaway box number 2305 which has a push-to-test light that may remain lit at all times. If push to test light remains lit for an extended period of time, the circuit board might fail causing the breakaway brakes to not perform as intended, increasing the risk of a crash if the trailer separates from the tow vehicle. Carry-On Trailer has notified owners, and dealers will retrofit the previous version breakaway charger, free of charge. The recall began on July 14, 2017. Owners may contact Carry-On Trailer customer service at 1-706-356-5379.

**17V-459**

Spartan Motors USA (Spartan) is recalling certain 2015-2017 Spartan Fleet Vehicle and Service Utilimaster Aeromaster vehicles. The affected vehicles are missing a ground wire for the windshield wiper motor, possibly resulting in an intermittent loss of windshield wiper function. A loss of windshield wiper function can reduce the driver's visibility, increasing the risk of a crash. Spartan will notify owners, and dealers will add a ground wire for the wiper motor, free of charge. The recall began on August 17, 2017. Owners may contact Spartan customer service at 1-800-582-3454. Spartan's number for this recall is 17018.

**17V-460**

Mitsubishi Motors North America, Inc. (MMNA) is recalling certain 2007-2013 Outlander vehicles. In the affected vehicles, water may drop between the hood and the windshield and leak into the wiper motor breathing hole. The water may cause internal corrosion of the windshield wiper motor and the possible failure of the motor. Failure of the wiper motor can cause a loss of visibility, increasing the risk of a crash. MMNA will notify owners, and dealers will replace the wiper motor, free of charge. The recall began July 28, 2017. Owners may contact MMNA customer service at 1-888-648-7820. MMNA's number for this recall is SR-17-003.

**17V-461**

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain 2016 Camry Hybrid and Avalon Hybrid vehicles. The front drive shaft may separate. A front driveshaft separation would result in a loss of propulsion while driving, and if the driver exits the vehicle without applying the parking brake, the vehicle may roll. Both scenarios can increase the risk of a crash. Toyota will notify owners, and dealers will check the serial number of the vehicle's drive shaft, replacing any that are affected, free of charge. The recall began on August 11, 2017. Owners may contact Toyota customer service at 1-800-331-4331. Toyota's number for this recall is HOM.

**17V-462**

Smeal Fire Apparatus Co., Inc. (Smeal) is recalling certain 2016-2017 Aerial Fire Apparatus emergency vehicles. The hydraulic manifold that controls the aerial device may not be fully seated, possibly resulting in a hydraulic fluid leak. The hydraulic fluid leak may result in inadvertent movement of the aerial device, increasing the risk of injury. Smeal will notify owners, and dealers will inspect the mating surface of the hydraulic manifold, correcting the problem as necessary, free of charge. The recall began on August 10, 2017. Owners may contact Smeal customer service at 1-800-543-5008. Smeal's number for this recall is 17019.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JULY 2017**

*Published September 8, 2017*

**17V-463**

Tremcar is recalling the rear impact guards used on certain 2008 Tremcar 1350 cubic ft B-train pup, 2008-2017 Tremcar 2800 cubic ft Dry Bulk Quad, 2014 Tremcar 1625 cubic ft Vac tandem, and 2016 Tremcar 2300 cubic ft Quad trailers. When impacted at the outer portions, the guards did not adequately resist sufficient force. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 223, "Rear Impact Guards." These rear impact guards may not adequately reduce the possibility of a car traveling under the trailer in the event of a crash, increasing the risk of injury to the car driver. The purchaser of the affected guards is aware of the recall, therefore owner notification letters will not be sent. The remedy for this recall is still under development. The recall began on July 20, 2017. Owners may contact Tremcar customer service at 1-800-363-2158.

**17V-464**

Kawasaki Motors Corp., U.S.A. (Kawasaki) is recalling certain 2017 Versys-X 300 motorcycles. A loose tail/brake light socket may allow the bulb to fall out. Without a working tail/brake light, there is an increased risk of a crash. Kawasaki will notify owners, and dealers will replace the tail/brake light socket, free of charge. The recall began on July 31, 2017. Owners may contact Kawasaki customer service at 1-866-802-9381.

**17V-465**

BMW of North America, LLC (BMW) is recalling certain 2017 BMW C650 GT and BMW C Evolution scooters for failing to conform to Federal Motor Vehicle Safety Standard (FMVSS) number 120, "Wheels and rims-other than passenger cars." The front rims may not be marked with the required rim type and the DOT designation. Since the rim is not marked with the rim size and the DOT designation, a tire of the incorrect size may be installed on this rim, affecting the handling of the scoter and increasing the risk of a crash. BMW will notify owners, and dealers will replace any rims that are not correctly marked, free of charge. The recall is expected to begin September 15, 2017. Owners may contact BMW customer service at 1-800-525-7417.

**17V-467**

Piaggio Group Americas, Inc. (Piaggio) is recalling certain 2015-2017 Piaggio Fly 150 3V ie scooters. The front brake disc mounting screws may loosen and contact the brake caliper holding plate or the fork leg. If a screw loosens and contacts the caliper holding plate or the fork leg, the front wheel may suddenly lock up, increasing the risk of crash. Piaggio has notified owners, and dealers will tighten the front brake disc mounting screws after applying a thread-locking adhesive, free of charge. The recall began July 31, 2017. Owners may contact Piaggio customer service at 1-212-380-4433. Piaggio's number for this recall is 0000313.

**17V-468**

Piaggio Group Americas, Inc. (Piaggio) is recalling certain 2018 Liberty 50 iGet 3V scooters. The nut that holds the rear swing arm to the frame may loosen allowing the swing arm to move out of position. The shifting swing arm may cause a loss of control, increasing the risk of a crash. Piaggio will notify owners, and dealers will check the swing arm nut torque, tightening or replacing the nut, bolt and washer, free of charge. The recall began on August 2, 2017. Owners may contact Piaggio customer service at 1-212-380-4433.

**17V-469**

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JULY 2017**

*Published September 8, 2017*

Temsa Global Sanayi Ve Ticaret A.S. (Temsa) is recalling certain 2014-2018 TS45 motorcoaches. During use or while servicing, the air bellow protection cover may be bent, allowing it to contact and potentially damage the tires on the tag axle. The contact may cause a tire to go flat, affecting vehicle handling and increasing the risk of crash. Temsa will notify owners, and dealers will replace the air bellow cover with a newly designed cover, free of charge. The recall is expected to begin August 18, 2017. Owners may contact CH Bus Sales, the US Agent for Temsa at 1-407-271-8935.

**17V-470**

PACCAR Incorporated (PACCAR) is recalling certain 2013-2017 Peterbilt 567 and 579 Kenworth T680 and T880 trucks equipped with optional spotlights. The spotlight circuit may not be adequately protected in the event of a short. A short in the spotlight circuitry may increase the risk of a fire at the cab fuse block. PACCAR will notify owners, and dealers will change the polyfuse switch in the spotlight circuit to a standard fuse, free of charge. Owners may contact PACCAR customer service at 1-940-591-4220. PACCAR's number for this recall is 17KWC and 717-B.

**17V-471**

Ford Motor Company (Ford) is recalling certain 2014 Ford F-150 and E-350, 2014-2015 Ford Escape, and 2015 Lincoln MKC vehicles. Improperly manufactured bolts may have been used to install certain seats, seatbacks, seatbelt buckles, or seatbelt anchors on these vehicles. The improperly manufactured bolts may fracture. If a seat, seatback, or seatbelt anchor attaching bolt fractures, the affected component may not be properly secured, increasing the risk of injury in the event of a crash. Ford will notify owners, and dealers will replace the affected bolts, free of charge. Interim notices informing owners of the safety risk will be mailed in September 2017. Owners will receive a second notice when remedy parts become available in the fourth quarter of 2017. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 17S17.

**17V-472**

Lakota Corporation (Lakota) is recalling certain 2017-2018 Lakota trailers. The rear external load ramp was not mounted with nuts and bolts in addition to being welded, possibly resulting in the ramp detaching from the trailer. If the ramp detaches from the rear of trailer, it may be a road hazard, increasing the risk of a crash. Lakota will notify owners, and dealers will install bolts and nuts on each rear external ramp, free of charge. The recall began on August 10, 2017. Owners may contact Lakota customer service at 1-574-848-1636. Lakota's number for this recall is Non-LQ ext ramp.

**17V-473**

Mazda North American Operations (Mazda) is recalling certain model year 2003-2008 Mazda6, 2004-2008 RX-8, and 2006-2007 Mazdaspeed6 vehicles. The affected vehicles are equipped with a dual-stage driver frontal air bag that may be susceptible to moisture intrusion and other factors, including manufacturing variability that, over time, could cause the inflator to rupture. In the event of a crash necessitating deployment of the driver's frontal air bag, the inflator could rupture with metal fragments striking the driver or other occupants resulting in serious injury or death. Mazda will notify owners, and dealers will replace the driver's frontal air bag inflator with an alternate inflator, free of charge. The recall is expected to begin in September 2017. Owners may contact

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JULY 2017**

*Published September 8, 2017*

Mazda customer service at 1-800-222-5500. Mazda's number for this recall is 1417G. Note: This recall supersedes recall 15V-382.

**17V-474**

Nissan North America, Inc. (Nissan) is recalling certain 2016-2018 Infiniti Q50 and 2017 Infiniti Q60 vehicles equipped with a 2.0L engine. Incorrect Fuel Pump Control Module (FPCM) software may allow the fuel level in the main tank to be too low to supply fuel to the engine, causing the engine to stall while driving. An engine stall can increase the risk of a crash. Nissan will notify owners, and Infiniti dealers will reprogram the Fuel Pump Control Module (FPCM) with corrected software, free of charge. The recall began August 29, 2017. Owners may contact Infiniti customer service at 1-800-662-6200.

**17V-476**

REV Recreation Group (REV) is recalling certain 2017-2018 Fleetwood Discovery and Discovery LXE, and Holiday Rambler Endeavor, Endeavor XE, and Admiral XE motorhomes, as well as 2018 Monaco Diplomat, Fleetwood Pace Arrow, Bounder, Flair, and Storm motorhomes, and Holiday Rambler Navigator and Vacationer XE motorhomes. The affected vehicles may have been manufactured with headlights that do not have tempered glass lenses. If the headlamp lens is not tempered, it may crack or break, which may cause decreased illumination and/or premature failure of the headlight bulb, increasing the risk of a crash. REV Recreation Group will notify owners, and authorized REV dealers will inspect, and if necessary, replace non-tempered, defective headlamp lenses with new headlamp lenses, free of charge. The recall is expected to begin September 8, 2017. Owners may contact REV customer service at 1-800-509-3417. REV's number for the recall is 170720REV.

**17V-477**

Daimler Vans USA, LLC (DVUSA) is recalling certain 2007-2009 Freightliner and Dodge Sprinter 2500 and 3500 vehicles. These vehicles are equipped with certain air bag inflators assembled into the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death. DVUSA will notify owners, and dealers will replace the passenger side frontal air bag, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact DVUSA customer service at 1-877-762-8267. Note: This recall fully supersedes recall 15V-354 and partially supersedes recalls 16V-379 and 17V-025.

**17V-478**

Daimler Vans USA, LLC (DVUSA) is recalling certain 2010-2011 Freightliner and Mercedes Benz Sprinter 2500 and 3500 vehicles. These vehicles are equipped with certain air bag inflators assembled into the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death. DVUSA will notify owners, and dealers will replace the front passenger side air bag, free of charge. The manufacturer has not yet

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JULY 2017**

*Published September 8, 2017*

provided a notification schedule. Owners may contact DVUSA customer service at 1-877-762-8267. Note: This recall partially supersedes recall 16V-379.

**17V-479**

Daimler Vans USA, LLC (DVUSA) is recalling certain 2012 Freightliner and Mercedes Benz Sprinter 2500 and 3500 vehicles. These vehicles are equipped with certain air bag inflators assembled into the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death. DVUSA will notify owners, and dealers will replace the front passenger side air bag, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact DVUSA customer service at 1-877-762-8267. Note: This recall supersedes recall 17V-025.

**17V-480**

BMW of North America, LLC (BMW) is recalling certain 2013-2017 R1200GS, F800R and F800GT motorcycles, 2014-2017 R1200GS Adventure motorcycles, 2016-2017 S1000XR motorcycles and 2015-2017 R1200R and R1200RS motorcycles. When equipped with the optional aluminum luggage cases, the rear reflex reflectors may be partially blocked. The aluminum case mounts for the R1200GS and R1200GS Adventure may also partially block the reflectors. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." If the rear reflex reflectors are obscured from view, it can increase the risk of a crash. BMW will notify owners, and dealers will install reflectors on the cases or for the case mounts, an additional bracket with rear reflex reflectors, free of charge. The recall is expected to begin September 21, 2017. Owners may contact BMW customer service at 1-800-525-7417.

**17V-481**

Vantage Mobility International, LLC (VMI) is recalling certain 2017 Chrysler Pacifica lowered floor vehicles modified by VMI. The rear pinion bracket on both sides of the vehicle may crack, causing the axle not to be centered and the wheel to wobble. A wheel wobble may cause a possible loss of control, increasing the risk of a crash. VMI will notify owners, and dealers will replace the pinion brackets, free of charge. The recall began on August 14, 2017. Owners may contact VMI customer service at 1-800-488-9082. VMI's number for this recall is PAC20170728.

**17V-482**