

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JULY 2018**

*Published September 21, 2018*

**CHILD SEATS:**

None during July 2018.

**EQUIPMENT:**

Lippert Components, Inc. (LCI) is recalling certain Solera Smart Arm Awnings. Water may enter the awning control module wiring harness and cause the awnings to partially deploy unexpectedly while the recreational vehicle is being driven. If the awning deploys while the vehicle is moving, it can increase the risk of a crash. LCI will notify the vehicle manufacturers that purchased the awnings and the vehicle manufacturers will conduct recalls to have their dealers replace the Solera Smart Arm controller with a new Smart Arm Controller, free of charge. The recall began August 21, 2018. Owners may contact LCI customer service at 1-574-538-4514. LCI's number for this recall is 18-058-001.

**18E-050**

Badass Helmet Company (Badass) is recalling certain Trooper motorcycle helmets, model TR001.6, in sizes XS, S, M, L, XL, and 2XL. These helmets may not adequately protect the wearer in the event of a head impact during a motorcycle crash and they may not stay secured to the rider's head. Additionally, the label inside the helmet may be incorrect in that it does not list the actual helmet manufacturer and does not list the model of the helmet. As such, these helmets fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 218, "Motorcycle Helmets." A helmet that does not adequately protect the wearer from an impact can increase the risk of injury in the event of a crash. Badass will notify owners and replace the defective helmets, free of charge. The recall began September 7, 2018. Owners may contact Badass customer service at 1-866-334-3563.

**18E-052**

Chrysler (FCA US LLC) is recalling certain Mopar Stage 1 Kit Performance Packages Powertrain Control Modules (PCM) Part Numbers P5160023, P5160025, and Demon Crate PCM Part Number 68412287AA. The PCMs are being recalled to address a defect that could prevent the cruise control system from disengaging. If, when using cruise control, there is a short circuit within the vehicle's wiring, the driver may not be able to shut off the cruise control either by depressing the brake pedal or manually turning the system off once it has been engaged, resulting in either the vehicle maintaining its current speed or possibly accelerating. If the vehicle maintains its speed or accelerates despite attempts to deactivate the cruise control, there would be an increased risk of a crash. Chrysler will notify owners, and dealers will either perform a software update or replace the PCM, free of charge. The recall began July 26, 2018. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is U82, and U83.

**18E-053**

TRW Automotive Inc (TRW) has submitted a Defect Information Report based upon decisions made by Volkswagen Group of America, Inc., Fiat Chrysler USA, BMW of North America, LLC and Mercedes-Benz to conduct recalls to inspect, and bleed the front and/or rear brake system, due to the brake caliper pistons having an insufficient coating. The insufficient coating may cause a reduction in braking performance, increasing the risk of a crash. TRW is working with the affected vehicle manufacturers. Dealers for those manufacturers will

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JULY 2018**

*Published September 21, 2018*

inspect the brake caliper pistons, and bleed the brakes, free of charge.

**18E-054**

Industrias Martinrea de Mexico SA de CV (Martinrea) has submitted a Defect Information Report based upon decisions made by Chrysler (FCA US LLC) and Ford Motor Company to conduct recalls (numbers 18V277 and 18V389 respectively). The brake circuit hose assemblies located between the master cylinder and the hydraulic control unit, may have been manufactured without anti-corrosion plating on the coupling fittings, or "ferrules," of the hoses. This can lead to premature corrosion, and result in a brake fluid leak. A brake fluid leak can reduce brake effectiveness, increasing the risk of a crash. Martinrea is working with the affected vehicle manufacturers. Dealers for those manufacturers will replace the brake hoses, free of charge. Chrysler owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is U41. Ford owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 18S19.

**18E-055**

Hickory Springs Manufacturing Company (HSM) is recalling certain CE White SB11-30" series, standard, unbelted, school bus seats, and SB11-30" series school bus seats with lap belts only. The foam in the knee impact area of the lower seat back may not absorb enough impact in the event of a crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 222, "School Bus Passenger Seating and Crash Protection." If the seat foam does not absorb enough impact energy, it can increase the risk of injury in the event of a crash. HSM will notify the bus manufacturers that purchased the seats, and dealers for those manufacturers will insert an additional piece of expanded polystyrene (EPS) foam into the seatback, free of charge. The recall is expected to begin on October 1, 2018. Owners may contact HSM customer service at 1-419-492-2157 extension 243.

**18E-056**

If the rear brake pad friction material detaches, it may lengthen the distance needed to stop the motorcycle, increasing the risk of a crash. If the brake pad friction material detaches it can, inhibit braking ability, increasing the risk of injury and crash. Brembo will work with the affected vehicle manufacturers and distributors, and replace the defective brake pads, free of charge. The recall began on July 17, 2018.

**18E-057**

Meritor, Inc. (Meritor) is recalling certain Wheel Studs, part number 09001988, installed in steer axle hubs. The wheel studs may have not been properly heat treated causing them to fail. If enough of the improperly heat treated studs fail on the same steer axle hub, the wheel may detach, increasing the risk of a crash. Meritor has notified the purchasers of the affected hubs, and those vehicle manufacturers will replace the wheel studs or replace the entire hub, free of charge. The recall began August 31, 2018. Owners may contact Meritor customer service at 1-866-668-7221.

**18E-058**

Jost International, Inc. (Jost) is recalling certain Outboard Sliders, part number A8PX-Tab (12-24). One of the affected slide bracket assemblies may contain an outboard slider bracket that is too narrow, possibly allowing the fifth wheel trailer to separate from the tractor. If the trailer separates from the tractor, it can increase the risk of a

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JULY 2018**

*Published September 21, 2018*

crash. Jost has notified the vehicle manufacturers that purchased the fifth wheel assemblies, and dealers for those manufacturers will inspect the vehicles and replace the incorrect will replace the incorrect slider bracket if necessary, free of charge. The recall began on August 3, 2018. Owners may contact Jost customer service at 1-616-846-7700.

**18E-059**

SynTec Seating Solutions, LLC (SynTec) is recalling certain S3B 45" Restraint School Bus Seats. The seat's foot may pull through the bolted joint at the bus floor. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 210, "Seat Belt Assembly Anchorages." If the seat mounting foot detaches from the floor, it can increase the risk of injury in the event of a crash. SynTec has notified the bus manufacturer that purchased the seats, and dealers for those manufacturers will install a washer between the rear mounting foot and the bus floor, free of charge. The recall began on August 7, 2018. Owners may contact SynTec customer service at 1-336-862-7509. SynTec's number for this recall is RES101.

**18E-060**

Rock Run Industries (Rock Run) is recalling certain LP Bottle Ring Brackets, part number 10030. These brackets may break at the mounting point. If the LP bracket ring breaks, the propane cylinder may fall from the vehicle, increasing the risk of injury or crash. Rock Run has notified the vehicle manufacturers that purchased the brackets. Dealers for those manufacturers will replace the LP bottle ring brackets, free of charge. Owners may contact Rock Run at 1-574-642-9905.

**18E-061**

PTL Engineering, Inc. (PTL) is recalling certain 3000 and 7000 Series recreational vehicle Entry Doors, part Numbers 009-227 and 019-064. The latch rod may be improperly adjusted, allowing the door to open unexpectedly while the vehicle is moving. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 206, "Door Locks and Door Retention Components." If the door opens while moving, it could become a distraction to the vehicle operator and other drivers and/or objects may fall out and become road hazards. Either scenario increases the risk of a crash. PTL will notify the vehicle manufacturers that purchased the doors and dealers for those manufacturers will readjust the latch rod, free of charge. The recall began August 8, 2018. Owners may contact PTL customer service at 1-810-664-2310.

**18E-062**

Whelen Engineering Co Inc (Whelen) is recalling various models of accessory brake lights for use with emergency vehicles. Depending on the specific wiring of the vehicle, these brake lights may illuminate when the brake pedal has not been pressed. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." For a full list of the affected models visit: <https://static.nhtsa.gov/odi/rcl/2018/RCLRPT-18E063-9047.pdf> If the brake lights incorrectly illuminate, it can confuse other drivers, possibly increasing the risk of a crash. Whelen will notify owners, and will replace the brake lights, free of charge. The recall began August 29, 2018. Owners may contact Whelen customer service at 1-860-718-2331.

**18E-063**

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JULY 2018**

*Published September 21, 2018*

TAP Worldwide LLC (TAP) is recalling certain Pro Comp aftermarket Steering Knuckles, part number EXP59010B-2, sold for use with Nissan Titan vehicles. High loads of force can cause these steering knuckles to deform or fracture. A damaged steering knuckle can cause a loss of control, increasing the risk of a crash. TAP will notify owners and provide a replacement steering knuckle, free of charge. The recall is expected to begin September 2018. Owners may contact TAP customer service at 1-888-376-1417.

**18E-064**

TAP Worldwide LLC (TAP) is recalling certain Pro Comp Extended Thread Lug Nuts, part numbers 21138, 21138B, and 26148 marketed as an accessory to be used with Pro Comp accessory or aftermarket wheels. These lug nuts may not seat properly and may bottom out when used with certain third-part wheel models. If the lug nuts bottom out before they are properly tightened, they may come loose, affecting wheel mounting and causing a loss of vehicle control, increasing the risk of a crash. TAP will notify owners and will provide replacement lug nuts with shorter shanks, free of charge. The recall is expected to begin September 2018. Owners may contact TAP customer service at 1-888-376-1417 or by email at recallpartsassistance@4wp.com.

**18E-065**

TAP Worldwide, LLC (TAP) is recalling certain Pro Comp aftermarket Control Arms, part numbers 8352, 8355, 20051, 20054, 8332, 8335, 8327, 8330, 8346, 8349, 51003B, 51004B, 51005B, 52001B, 56003B, 57001B, 57002B, and 57003B. These control arms may be missing or have improperly seated bottom-side circlips, allowing the control arm to detach. If a control arms detaches it can cause a loss of steering or vehicle stability, increasing the risk of a crash. TAP will notify owners and dealers will inspect the control arms and replace any that are affected, free of charge. The recall is expected to begin September 2018. Owners may contact TAP customer service at 1-888-376-1417.

**18E-066**

TAP Worldwide, LLC (TAP) is recalling certain G2 Axle and Gear aftermarket Wheel Spacers, part number G/293-50-200. These wheel spacers may have been shipped without hub-centering rings, possibly causing the wheels to not be centered on the hub properly. If the hub-centering ring is missing, the wheels may wobble and possibly loosen, increasing the risk of a crash. TAP will notify owners, and dealers will replace the wheels spacers with wheel spacers that are equipped with hub-centering rings, free of charge. The recall is expected to begin September 2018. Owners may contact TAP customer service at 1-888-376-1417 or by email at recallpartsassistance@4wp.com .

**18E-067**

TAP Worldwide, LLC (TAP) is recalling certain LRG Rims 8-Lug aftermarket Wheel Center Caps, models LRG107 and LRG108. These wheel center caps may not seat properly, creating interference between the wheel and the mounting surface which can cause the wheel to loosen over time. If the wheels loosen, a loss of vehicle control may result, increasing the risk of a crash. TAP will notify owners, and dealers will replace the wheel center caps, free of charge. The recall is expected to begin September 2018. Owners may contact TAP customer service at 1-888-376-1417.

**18E-068**

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JULY 2018**

*Published September 21, 2018*

TAP Worldwide, LLC (TAP) is recalling certain LRG Rims aftermarket Wheels, part numbers LRG10129070700, LRG10129070900, and LRG10129082700. These wheels may have surface cracking if the vehicle is overloaded. The surface cracking may progress to the point that the rim loses air, possibly resulting in tire failure and an increased risk of a crash. TAP will notify owners, and will replace the wheels, free of charge. The recall is expected to begin September 2018. Owners may contact TAP customer service at 1-888-376-1417.

**18E-069**

TAP Worldwide, LLC (TAP) is recalling certain G2 Axle and Gear aftermarket Axle Housings, part number 67-2033TJR. The rosette welds in the center of the axle housings may have insufficient strength, allowing the axle tube to rotate unexpectedly. If the axle tubes rotate, the vehicle's driveshaft may bind resulting in a loss of power and an increased risk of a crash. TAP will notify owners and will replace the axle housings with new housings, free of charge. The recall is expected to begin September 2018. Owners may contact TAP customer service at 1-888-376-1417.

**18E-070**

TAP Worldwide, LLC (TAP) is recalling certain Pro Comp aftermarket Pitman Arms, part numbers 56713B-1, 56714B-1, 56716B-1, 56717B-1, 56715B-1, and DC600. These pitman arms may not be properly machined potentially causing a misalignment between the pitman arm and the steering shaft. The misalignment may cause a reduction or loss of steering control, increasing the risk of a crash. TAP will notify owners and will replace the pitman arms, free of charge. The recall is expected to begin September 2018. Owners may contact TAP customer service at 1-888-376-1417.

**18E-071**

TAP Worldwide, LLC (TAP) is recalling certain Rubicon Express aftermarket Lower Control Arms, part numbers RE4000, RE4010, and RE4050. These lower control arms have welds that may fail. Lower control arm weld failure can cause a loss of vehicle control, increasing the risk of a crash. TAP will notify owners and will replace the lower control arms, free of charge. The recall is expected to begin September 2018. Owners may contact TAP customer service at 1-888-376-1417.

**18E-072**

TAP Worldwide, LLC (TAP) is recalling certain Pro Comp aftermarket Pro Runner Monotube Shock Absorbers, part numbers ZX2005 and ZX2007. The lower mount/base cup of the shock absorbers may be incorrect. The incorrect lower mount/base cup may result in the shock absorbers not remaining properly secured to the vehicle, affecting vehicle handling and increasing the risk of a crash. TAP will notify owners and provide replacement shock absorbers that have a correct lower mount/base cup, free of charge. The recall is expected to begin September 2018. Owners may contact TAP customer service 1-888-376-1417.

**18E-073**

**TIRES:**

None during July 2018.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JULY 2018**

*Published September 21, 2018*

**VEHICLES:**

Forest River, Inc. (Forest River) is recalling certain 2016 Forest River Forester, 2014-2016 Forest River Sunseeker and Coachmen Leprechaun, 2014 Coachmen Concord, and 2014-2017 Coachmen Frelander vehicles, built on Chevrolet chassis and equipped with power windows. Liquid may leak into the driver's power window switch and cause corrosion, resulting in high electrical resistance. High electrical resistance can increase the risk of a fire. Forest River has notified owners, and Chevrolet dealers will replace the driver side window switch, free of charge. The recall began July 24, 2018. Owners may contact Chevrolet customer service at 1-800-630-2438, Forest River Forester and Sunseeker at 1-574-206-7600, Coachmen Concord, Frelander, and Leprechaun customer service at 1-574-825-8602. Forest River's number for this recall is 51-0781.

**18V-444**

Jayco, Inc. (Jayco) is recalling certain 2019 Jayco Alante and Precept motorhomes. When traveling at highway speeds, the windshield wiper arms may lift away from the windshield when the wiper speed setting is on high, decreasing the wiper's ability to clear the windshield. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 104, "Windshield Wiping and Washing Systems." The driver's reduced visibility can increase the risk of a crash. Jayco has notified owners, and dealers will replace the wiper system, free of charge. The recall began on July 30, 2018. Owners may contact Jayco customer service at 1-800-517-9137. Jayco's number for this recall is 9903403.

**18V-445**

Entegra Coach (Entegra) is recalling certain 2019 Entegra Emblem and Vision motorhomes. When traveling at highway speeds, the windshield wiper arms may lift away from the windshield when the wiper speed setting is on high, decreasing the wiper's ability to clear the windshield. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 104, "Windshield Wiping and Washing Systems." The driver's reduced visibility can increase the risk of a crash. Entegra has notified owners, and dealers will replace the wiper system, free of charge. The recall began on July 30, 2018. Owners may contact Entegra customer service at 1-800-517-9137. Entegra's number for this recall is 9903403.

**18V-446**

Keystone RV Company (Keystone) is recalling certain 2018-2019 Dutchmen Aerolite recreational trailers, models 2133RB and 2423BH. The Federal Certification Label incorrectly indicates a rim size of 14X5.5J when the correct rim size is 14X5J. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification" and can create a safety risk. The incorrect rim designation on the label, can cause the operator to replace the rim with an incorrect rim size, increasing the risk of a crash. Keystone will notify owners, and dealers will replace the Federal Certification Label, with a corrected label, free of charge. The recall began on August 2, 2018. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 18-325.

**18V-448**

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JULY 2018**

*Published September 21, 2018*

Jayco, Inc. (Jayco) is recalling certain 2019 Jayco White Hawk recreational trailers. The screws that secure the ladder steps to the ladder rail may break, which can cause occupants to fall. If the ladder steps do not remain properly secured when stepped on, the user may fall, increasing the risk of injury. Jayco has notified owners, and dealers will replace the #8 screws with heavier #10 screws, free of charge. The recall began on July 30, 2018. Owners may contact Jayco customer service at 1-800-517-9137. Jayco's number for this recall is 9901404.

**18V-449**

Entegra Coach (Entegra) is recalling certain 2018-2019 Entegra Odyssey, Qwest, Aspire, Insignia, Anthem, and Cornerstone motorhomes. The Cargo Carrying Capacity (CCC) label incorrectly overstates the cargo capacity, potentially causing the vehicle to be overloaded. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 120, "Wheels and Rims - Other than Passenger Cars." An overloaded vehicle has an increased risk of a crash. Entegra will notify owners, and will provided a corrected CCC label, free of charge. The recall began on August 22, 2018. Owners may contact Entegra customer service at 1-800-517-9137. Entegra's number for this recall is 9903405.

**18V-450**

Jayco, Inc. (Jayco) is recalling certain 2018-2019 Jayco Alante, Precept, Seneca, Redhawk, and Melbourne motorhomes. The Cargo Carrying Capacity (CCC) label incorrectly overstates the cargo capacity, potentially causing the vehicle to be overloaded. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 120, "Wheels and Rims - Other than Passenger Cars." An overloaded vehicle has an increased risk of a crash. Jayco will notify owners, and will provided a corrected CCC label, free of charge. The recall began on August 22, 2018. Owners may contact Jayco customer service at 1-800-517-9137. Jayco's number for this recall is 9903405.

**18V-451**

Nissan North America, Inc. (Nissan) is recalling certain 2007-2008 Nissan Versa sedan and Versa hatchback vehicles originally sold, or ever registered, in Alabama, Arizona, Arkansas, California, Delaware, District of Columbia, Florida, Georgia, Hawaii, Illinois, Indiana, Kansas, Kentucky, Louisiana, Maryland, Mississippi, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, South Carolina, Tennessee, Texas, Virginia, West Virginia, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands.

The passenger air bag inflators may explode due to propellant degradation due to exposure to humidity and temperature cycling. If an inflator were to explode it may result in metal fragments striking the vehicle occupants resulting in serious injury or death. Nissan will notify owners, and dealers will replace the passenger frontal air bag inflator, free of charge. The recall began July 25, 2018. Owners may contact Nissan customer service at 1-800-867-7669. Note: The vehicles covered by this recall are in addition to those covered by recall 16V-349.

**18V-452**

BMW of North America, LLC (BMW) is recalling certain 2018-2019 BMW X3 sDrive30i, X3 xDrive30i, X3 M40i and certain 2019 X4 xDrive30i and X4 M40i vehicles. The rear brake caliper pistons on these vehicles may have an insufficient coating, potentially reducing rear brake performance. A reduction of braking

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JULY 2018**

*Published September 21, 2018*

performance can increase the risk of a crash. BMW will notify owners, and dealers will bleed the rear brake circuit, free of charge. The recall began August 31, 2018. Owners may contact BMW customer service at 1-800-525-7417.

**18V-453**

Subaru of America, Inc. (Subaru) is recalling certain 2018 Subaru Forester vehicles. The Certification Label may indicate the incorrect wheel size, tire size, and air pressure. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims." Installing incorrect tires or applying incorrect tire air pressure may increase the risk of a crash. Subaru will notify owners, and dealers will install a corrected label, free of charge. The recall began July 26, 2018. Owners may contact Subaru customer service at 1-844-373-6614. Subaru's number for this recall is WTS-78.

**18V-455**

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2017-2018 Mercedes C300 Cabriolet, C300 4Matic Cabriolet, C43 AMG Cabriolet, C63S AMG Cabriolet, and C63 AMG Cabriolet vehicles. Due to a bonding issue introduced in the production process, the rear beltline trim may separate from the vehicle. If the beltline trim were to separate from the vehicle while driving, it could become a road hazard, increasing the risk of a crash. MBUSA will notify owners, and dealers will inspect the rear beltline trim and replace the trim if necessary, free of charge. MBUSA issued owners an interim notification on September 7, 2018. A second notification letter will be sent once the repair is available. Owners may contact MBUSA customer service at 1-800-367-6372.

**18V-456**

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain 2017 Mercedes-Benz G65 AMG vehicles. These vehicles may be equipped with the incorrect reverse speed limitation software. While in reverse, any abrupt changes in steering while exceeding 16 MPH may cause the vehicle to become unstable. An unstable vehicle in reverse gear can lead to a vehicle rollover, increasing the risk of injury. MBUSA will notify owners, and dealers will update the engine control unit (ECU) software, free of charge. The recall began August 3, 2018. Owners may contact MBUSA customer service at 1-800-367-6372.

**18V-457**

MV Agusta USA, LLC (MV Agusta) is recalling certain 2018 MV Agusta Brutale 800 Dragster RC, F3 800RC, and F3 800 motorcycles. These vehicles are equipped with a fork axle carrier that may have damaged threads which can cause excessive play of the wheel clamping screw. Wheel clamping screws that experience excessive play can cause a loss of control, increasing the risk of a crash. MV Agusta will notify owners, and dealers will inspect the threaded holes in the fork axle carriers, and if necessary replace the fork leg, free of charge. Owners are advised to not ride their motorcycles until the repair has been performed. The recall began July 20, 2018. Owners may contact MV Agusta customer service at 1-215-781-1770. MV Agusta's number for this recall is 18RC02.

**18V-458**

Jayco Inc. (Jayco) is recalling certain 2018 Jayco Octane travel trailers, models VH and VF, equipped with an



**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JULY 2018**

*Published September 21, 2018*

optional generator. During production, the generator exhaust pipe may not have been installed, allowing the generator's exhaust to enter the trailer. If exhaust were to enter the trailer, it can increase the risk of injury. Jayco has notified owners, and dealers will install any missing generator exhaust pipes, free of charge. The recall began on July 24, 2018. Owners may contact Jayco customer service at 1-800-517-9137. Jayco's number for this recall is 9901406.

**18V-460**

Automobili Lamborghini (Lamborghini) is recalling certain 2015-2016 Lamborghini Aventador SV Coupe and Aventador SV Roadster vehicles. The bolts centering and supporting the brake discs to the wheel's hub may loosen over time. Continued driving with loose centering bolts may result in the wheel detaching. A wheel detachment can increase the risk of a crash. Lamborghini will notify owners, and dealers will replace the centering bolts with ones that have thread-locking fluid, free of charge. Owners may contact Lamborghini customer service at 1-866-681-6276. Lamborghini's number for this recall is L73XR0318.

**18V-461**

KZRV, L.P. (KZRV) is recalling certain 2018-2019 KZRV Sportsmen recreational trailers. Propane gas may leak at the back of the outside kitchen cooktop. A gas leak at the outside kitchen cooktop can increase the risk of a fire. KZRV will notify owners and dealers will inspect the propane system for leaks and correct if necessary, free of charge. The recall began on August 31, 2018. Owners may contact KZRV customer service at 1-800-768-4016 extension 154 or 153. KZRV's number for this recall is KZ-2018-005.

**18V-462**

Pierce Manufacturing (Pierce) is recalling certain 2007-2017 Pierce Velocity, Impel, Arrow-XT, Quantum, and Enforcer emergency response vehicles equipped with 75ft aerial devices with a 21 inch or 28 inch limited retraction bracket. The bracket on the aerial device may detach from the aerial and fall to the ground. If the bracket falls, it could strike a person below. Pierce will notify owners, and dealers will install additional hardware to mount the limited retraction bracket, free of charge. The recall began on August 22, 2018. Owners may contact Pierce customer service at 1-888-974-3723. Pierce's number for this recall is 74B290.

**18V-463**

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2015-2018 Volkswagen Golf and Golf Sportwagen vehicles. The build of silicate on the shift lever micro switch contacts may enable the key to be removed from the ignition while the vehicle shift lever is not in "Park." As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 114, "Theft Protection and Rollaway Prevention." Removing the key while the shift lever is in a position other than "Park" increases the risk of an unintended vehicle rollaway that may result in personal injury or a crash. Volkswagen will notify owners, and dealers will install an additional switch and circuit board, free of charge. Volkswagen issued owners an interim notification on August 10, 2018. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's number for this recall is 37L5.

**18V-464**

BMW of North America, LLC (BMW) is recalling certain 2018 BMW 540d xDrive vehicles. The crankshaft

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JULY 2018**

*Published September 21, 2018*

sensor may be equipped with incorrect firmware, preventing the sensor from properly processing input from the crankshaft reluctor ring, possibly resulting in a vehicle stall.

On September 12, 2018, BMW expanded the recall to a total of 5,309 vehicles including certain 2018-2019 BMW 540d xDrive, 230i M240i, M240i xDrive, X2 sDrive28i, X2 xDrive28i, X1 sDrive28i, X1 xDrive28i, 330i, 330i xDrive, 340i, 340i xDrive, 330i xDrive Gran Turismo, 530i, 530i xDrive, 540i, 540i xDrive, 530e, 530e xDrive, 640i xDrive Gran Turismo, 330e, 2019 430i Gran Coupe, 430i xDrive Gran Coupe, 440i Gran Coupe, 440i xDrive Gran Coupe, 430i, 430i xDrive, 440i, 440i xDrive, 740i, 740i xDrive, MINI Cooper, Cooper S, JCW, MINI Countryman (Cooper, Cooper All4, Cooper S, Cooper S All4, JCW All4), and MINI Clubman (Cooper, Cooper S, Cooper All4, Cooper S All4, JCW All4) vehicles. A vehicle stall can increase the risk of a crash. BMW will notify owners, and dealers will replace the crankshaft sensor, free of charge. The recall began September 6, 2018 for the original population of 540d xDrive vehicles. The recall September 6, 2018 for the expanded population of vehicles. Owners may contact BMW customer service at 1-800-525-7417.

**18V-465**

Multiquip, Inc. (Multiquip) is recalling certain 2018 Multiquip TRLR45H and TRLR70USH trailers. The center-mounted trailer jack may unexpectedly collapse from damage caused by excessive load on the trailer. If the center-mounted jack unexpectedly collapses, there would be an increased risk of injury. Multiquip has notified Herc rentals, the company that owns all of the affected trailers, and will install additional gussets to the jack crossmember, free of charge. The recall began on March 23, 2018. Owners may contact Multiquip customer service at 1-800-421-1244. Multiquip's number for this recall is TL 20180306.

**18V-466**

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2018 Volkswagen Tiguan vehicles. The LED module for the panoramic sunroof ambient light bar may short circuit. A short-circuit can increase the risk of a fire. Volkswagen will notify owners, and dealers will disconnect the power supply for the panoramic sunroof LED module, free of charge, until a future service action can safely reactivate the feature. The recall began July 24, 2018. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's number for this recall 60D1.

**18V-467**

Forest River, Inc. (Forest River) is recalling certain 2019 Forest River Palomino hardside truck campers. The Federal Placard incorrectly states the dry weight as 1,591lbs, when the correct dry weight is 2,405lbs. This error may result in the vehicle being overloaded. An overloaded vehicle may have reduced handling performance, increasing the risk of a crash. Forest River has notified owners, and dealers will replace the incorrect Federal Placard with a corrected Placard, free of charge. The recall began on July 23, 2018. Owners may contact Palomino customer service at 1-269-432-3246. Forest River's number for this recall is 400-0783.

**18V-468**

Keystone RV Company (Keystone) is recalling certain 2018-2019 Dutchmen Aerolite trailers. The trailer has a Gross Vehicle Weight Rating (GVWR) of 9,680lbs, however, the safety chains are rated at 7,600lbs. The lower

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JULY 2018**

*Published September 21, 2018*

rated safety chains may fail if the trailer detaches from the tow vehicle, increasing the risk of a crash. Keystone will notify owners, and dealers will replace the 7,600lb rated chains with 11,700lb rated chains, free of charge. The recall began August 16, 2018. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 18-326.

**18V-469**

Ford Motor Company (Ford) is recalling certain 2018 Ford F53 stripped chassis vehicles equipped with 22.5 inch front wheels. The front wheel hub assembly may have wheel studs that were not properly heat treated. If a sufficient quantity of wheel studs break on one hub, vehicle handling could be affected, increasing the risk of a crash. Ford will notify owners, and dealers will replace any suspect front wheel hub studs, free of charge. The recall began August 20, 2018. Owners may contact Ford customers service at 1-866-436-7332. Ford's number for this recall is 18S21.

**18V-470**

Ford Motor Company (Ford) is recalling certain 2013-2014 Ford Escape, and 2013-2016 Ford Fusion vehicles, equipped with six-speed automatic transmissions. The bushing that attaches the transmission shifter cable to the transmission may degrade over time and cause the bushing to detach from the transmission. The condition could allow the driver to move the shift lever to Park and remove the ignition key, while the transmission may not be in Park, with no warning message or audible chime. If the vehicle is exited without the transmission being in Park and without the parking brake being applied, the vehicle may unexpectedly move, increasing the risk of a crash. Ford will notify owners, and dealers will replace the shifter cable bushing, free of charge. Ford issued owners an interim notification on July 27, 2018. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 18S20. Note: Owners are directed to use the parking brake until the recall remedy repairs can be made.

**18V-471**

Van-Con, Inc. (Van-Con) is recalling certain 2011-2018 33803 Dual Rear Wheel school buses, equipped with CE White/HSM SB11-30" series, standard, unbelted, school bus seats, or SB11-30" series school bus seats with lap belts only. The foam in the knee impact area of the lower seat back may not absorb enough impact in the event of a crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 222, "School Bus Passenger Seating and Crash Protection." If the seat foam does not absorb enough impact energy, it can increase the risk of injury in the event of a crash. Van-Con is still finalizing a remedy plan. Van-Con issued owners an interim notification on September 18, 2018. Owners may contact Van-Con customer service at 1-732-356-8484.

**18V-472**

BMW of North America, LLC (BMW) is recalling certain 2018 BMW M5 vehicles. The fuel level sensor in the fuel tank may become stuck against an in-tank fuel line, causing the fuel gauge to display an inaccurate and possibly larger amount of fuel than is actually available. An incorrect fuel reading may lead to the vehicle stalling and increase the risk of a crash. BMW will notify owners, and dealers will secure the in-tank fuel line to keep the fuel line from contacting the fuel level sensor, free of charge. The recall is expected to begin September 2018. Owners may contact BMW customer service at 1-800-525-7417.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JULY 2018**

*Published September 21, 2018*

**18V-473**

Corp. Micro Bird Inc. (Micro Bird) is recalling certain 2011-2018 Micro Bird G5, MB-II, and T-series school buses, equipped with CE White/HSM SB11-30" series, standard, unbelted, school bus seats, or SB11-30" series school bus seats with lap belts only. The foam in the knee impact area of the lower seat back may not absorb enough impact in the event of a crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 222, "School Bus Passenger Seating and Crash Protection." If the seat foam does not absorb enough impact energy, it can increase the risk of injury in the event of a crash. Micro Bird has not yet finalized their remedy plan. Micro Bird issued interim notifications to owners on September 12, 2018. Owners may contact Micro Bird customer service at 1-819-477-2012. Micro Bird's number for this recall is 18-074-SUS.

**18V-474**

Forest River, Inc. (Forest River) is recalling certain 2018-2019 Forest River Rockwood and Flagstaff trailers. The inner wheel bearings may seize, which can cause the trailer wheels to lock-up. If a wheel locks up, there would be an increased the risk of a crash. Forest River will notify owners, and dealers will replace the inner wheel bearings, free of charge. The recall began on August 13, 2018. Owners may contact Forest River customer service at 1-574-642-4053. Forest River's number for this recall is 10-0786.

**18V-475**

Daimler Trucks North America, LLC (DTNA) is recalling certain 2019 Freightliner Cascadia trucks, equipped with certain Continental Coach HA3 tires, size 315/80R22.5 157/154 L. The cords on these tires may be visible through the innerliner. Tires that have cords visible through the innerliner can have sudden air loss, causing a loss of vehicle control, increasing the risk of a crash. DTNA will notify owners, and Continental authorized service facilities will inspect and replace the tires, free of charge. The recall began on September 4, 2018. Owners may contact DTNA customer service at 1-800-547-0712, or Continental customer service at 1-888-799-2168. DTNA's number for this recall is FL-778.

**18V-478**

Daimler Trucks North America LLC (DTNA) is recalling certain 2019 Freightliner Cascadia vehicles, equipped with certain Continental Hybrid HS3 tires, size 11R22.5 Load Range G. The tire cords may be visible through the innerliner. Tires with visible cords through the innerliner may have a sudden loss of air, increasing the risk of a crash. DTNA will notify owners, and Continental authorized service facilities will inspect and replace the tires, free of charge. The recall began on September 4, 2018. Owners may contact DTNA customer service at 1-800-547-0712, or Continental customer service at 1-888-799-2168. DTNA's number for this recall is FL-779.

**18V-479**

Ducati North America (Ducati) is recalling certain 2018 Ducati Panigale V4, Panigale 959, Panigale 1299 FE, and Hypermotard motorcycles. The friction material on the rear brake pads may detach from the backing plate. If the rear brake pad friction material detaches, it may lengthen the distance needed to stop the motorcycle, increasing the risk of a crash. Ducati will notify owners, and dealers will inspect the rear brake pads. Brake pads from the affected batch will be replaced, free of charge. The recall began August 27, 2018. Owners may

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JULY 2018**

*Published September 21, 2018*

contact Ducati customer service at 1-888-391-5446.

**18V-480**

Forest River, Inc. (Forest River) is recalling certain 2017-2018 Glaval Apollo, Commute, Concorde II, Entourage, Legacy, Primetime, Titan II, Titan II Low Floor, and Universal transit buses. A washer used in mounting the passenger's seat belt assembly may break, allowing the seat-belt to separate from the vehicle. If the seat belt end does not remain secured to the vehicle, the occupant will not be restrained in the event of a crash, increasing their risk of injury. Forest River will notify owners, and dealers will replace the seat belt mounting washers, free of charge. The recall began on August 20, 2018. Owners may contact Forest River customer service at 1-574-343-5167. Forest River's number for this recall is 35-0751. Note: This recall supersedes 18V376.

**18V-481**

Thor Motor Coach (TMC) is recalling certain 2018-2019 Thor Outlaw motorhomes, model 29J. These vehicles were manufactured without the rear reflex reflectors, which can make the vehicle less visible to other drivers. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." Missing rear reflex reflectors can make the vehicle less visible to other drivers, increasing the risk of a crash. TMC will notify owners, and dealers will install the missing reflectors, free of charge. The recall began on August 16, 2018. Owners may contact TMC customer service at 1-877-855-2867. TMC's number for this recall is RC0000157.

**18V-482**

Yamaha Motor Corporation, USA (Yamaha) is recalling certain 2018 Yamaha MT-07J, MT-07JC, XSR700J, and XSR700JC motorcycles. The bolts that connect the drive chain guard to the swingarm may loosen, possibly causing the chain guard to contact the drive chain and break. If the chain guard breaks, it may fall onto the road, creating a road hazard and increasing the risk of a crash. Yamaha will notify owners, and dealers will replace both chain guard mounting bolts, free of charge. The recall began on August 3, 2018. Owners may contact Yamaha customer service at 1-800-962-7926. Yamaha's number for this recall is 990120.

**18V-483**

Polaris Industries, Inc. (Polaris) is recalling certain 2016-2017 GEM E2, E4, E6, and ELXD vehicles. The drive mode switch can send an incorrect signal, causing the vehicle to become inoperative or go in the opposite direction than intended. If the operator intends to go forward, but the vehicle reverses instead, there would be an increased risk of a crash. Polaris will notify owners, and dealers will replace the drive mode system with one that has separate inputs for each position (forward, neutral and reverse), free of charge. Owners may contact Polaris customer service at 1-855-863-2284. Note: This recall supersedes recall 16V-884. Vehicles previously repaired under that campaign need the repairs covered by this campaign as well.

**18V-484**

Polaris Industries, Inc. (Polaris) is recalling certain 2011-2016 GEM E2, E2L, ELXD, and EL electric vehicles. The lower main frame tube may crack which can result in failure of the secondary upper cab frame. If the upper cab frame fails, it can increase the risk of injury or crash. Polaris will notify owners, and dealers will install an

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JULY 2018**

*Published September 21, 2018*

additional frame brace to the lower frame tubes, free of charge. Owners may contact Polaris customer service at 1-855-743-3436. Polaris' number for this recall is L-18-03.

**18V-485**

Chrysler (FCA US LLC) is recalling certain 2015-2017 RAM 1500, 2500, and 3500 pickup trucks equipped with a power locking tailgate and either a 5 foot, 7 inch or 6 foot, 4 inch bed. The tailgate actuator limiter tab may fracture and cause the tailgate to unlatch and open while driving. If the tailgate latch releases and the tailgate opens while driving, cargo may fall out, creating a road hazard and increasing the risk of a crash. Chrysler will notify owners, and dealers will repair the vehicle, free of charge. The recall began September 17, 2018. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is U74.

**18V-486**

Daimler Trucks North America LLC (DTNA) is recalling certain 2018-2019 Freightliner Business Class M2 trucks. The steering shaft assembly may have been installed incorrectly, which can cause a loss of connection between the steering wheel and the front wheels. A loss of connection between the steering wheel and front wheels can cause a loss of vehicle control, increasing the risk of a crash. DTNA has notified owners, and dealers will inspect the steering assembly installation, repairing it as necessary, free of charge. The recall began August 9, 2018. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-781.

**18V-487**

Karma Automotive LLC (Karma) is recalling certain 2018 Karma Revero vehicles. The driver's side exterior rearview mirrors may be made with convex, not flat glass. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 111, "Rearview Mirrors." When using the incorrect rearview mirrors, the driver may fail to realize how close a vehicle or object actually is, increasing the risk of a crash. Karma has notified owners, and dealers will inspect the driver side exterior rearview mirror, replacing it as necessary, free of charge. The recall began August 1, 2018. Owners may contact Karma customer service at 1-855-288-6109. Karma's number for this recall is RC-18-78-01.

**18V-488**

On July 20, 2018 Braun Corporation (Braun) filed a recall for certain 2017-2018 BraunAbility Dodge Side Entry Vans with a manual in-floor wheelchair ramp built on Dodge RT minivan chassis. The brake lines may not be connected to the corresponding ports on the hydraulic control unit, causing reduced performance of the electronic stability control (ESC) system. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 135, "Light Vehicle Brake Systems," and 126, "Electronic Stability Control Systems."

On August 21, 2018, Braun expanded this recall to include an additional 31,165 vehicles. Included in this update are 2012-2016 BraunAbility Dodge Side Entry Vans and 2012-2018 Chrysler Town and Country Side Entry Vans. A reduction of ESC function can increase the risk of a crash. Braun will notify owners, and dealers will reroute the right rear brake line to the left wheel, and install a brake line extension to reroute the left rear brake line to the right rear wheel. This repair will be completed free of charge. The recall began on August 17, 2018. Owners may contact Braun customer service at 1-800-488-0359.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JULY 2018**

*Published September 21, 2018*

**18V-489**

Forest River, Inc. (Forest River) is recalling certain 2019 Prime Time Crusader fifth-wheel recreational trailers, model CSF315RST. The Federal Placard on these vehicles indicate that the axles have a weight capacity of 6,000lbs, however, their actual capacity is 5,100lbs. The incorrect Federal Placard may result in the axles being overloaded, causing a loss of control, and increasing the risk of a crash. Forest River has notified owners, and will provide replacement Federal Placards, free of charge. The recall began on July 30, 2018. Owners may contact Forest River customer service at 1-574-862-1025. Forest River's number for this recall is 48-0801.

**18V-490**

Daimler Trucks North America, LLC (DTNA) is recalling certain 2017-2019 Freightliner Cascadia trucks. The Instrument Cluster Unit (ICU) may not perform the required bulb checks for the Anti-lock Brake System (ABS) or Electronic Stability Control (ESC) if the ignition is turned from on to off to on too quickly. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 121, "Air Brake Systems," and 136, "Electronic Stability Control Systems on Heavy Vehicles." Without an ABS or ESC bulb check, the operator may unaware that the warning light bulbs are not working. If the warning bulbs are not working, in the event of an ABS or ESC malfunction, the driver may not be notified, increasing the risk of a crash. DTNA will notify owners, and dealers will reprogram the ICU's to ensure a bulb check is performed each time the ignition is turned on, free of charge. DTNA issued owners an interim notification on September 18, 2018. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-780.

**18V-491**

Chrysler (FCA US LLC) is recalling certain 2019 Jeep Cherokee vehicles and 2018 Chrysler Pacifica non-hybrid vehicles. A component in the transmission may not have been welded properly, possibly causing the transmission to not transmit engine power to the wheels. If the transmission weld fails, the vehicle will stop moving, increasing the risk of a crash. Chrysler will notify owners, and dealers will replace the transmission, free of charge. The recall is expected to begin September 2018. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is U85.

**18V-492**

Chrysler (FCA US LLC) is recalling certain 2018 Chrysler Pacifica vehicles. The front axle halfshafts may have been incorrectly assembled, preventing the shaft from being properly secured to the constant-velocity (CV) joint. If the axle shaft disengages from the CV joint, the vehicle will have a loss of drive or allow the vehicle to move while in the "Park" position. Either condition may increase the risk of a crash. Chrysler will notify owners, and dealers will replace the left or right halfshaft assembly, free of charge. The recall began September 18, 2018. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is U80.

**18V-493**

Chrysler (FCA US LLC) is recalling certain 2018 Jeep Cherokee all-wheel-drive vehicles. The bearing cage for the right front halfshaft assembly may not have been properly heat treated, possibly resulting in the bearing cage breaking and a potential halfshaft assembly failure. If the halfshaft bearing cage breaks, the halfshaft may not be

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JULY 2018**

*Published September 21, 2018*

able to transmit engine power, causing a loss of drive or it can allow the vehicle to move while in the "Park" position. Either condition may increase the risk of a crash. Chrysler will notify owners, and dealers will replace the front right halfshaft assemblies, free of charge. The recall is expected to begin September 2018. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is U78.

**18V-494**

Trail King Industries, Inc. (Trail King) is recalling certain 2016-2018 Trail King Dolly trailers. The dolly frame channel may crack near the center cross members. If the frame channel cracks completely it can cause the frame rail to separate, increasing the risk of a crash. Trail King has notified owners, and dealers will reinforce the frame channel to prevent cracking, free of charge. The recall began August 15, 2018. Owners may contact Trail King customer service at 1-800-843-3324. Trail King's number for this recall is TK201801.

**18V-495**

Hyundai Motor America (Hyundai) is recalling certain 2018 Genesis G80 vehicles. The Occupant Classification System (OCS) may incorrectly detect that an adult is in the passenger seat, even if the seat is unoccupied. In the event of a crash, if a child or infant is in the seat, the front passenger air bag may deploy instead of being deactivated. In the event of a crash, if the front passenger air bag deploys instead of being deactivated when a child or infant are in the front passenger seat, it can increase the risk of injury. Hyundai will notify owners, and dealers will reprogram the OCS, free of charge. Owners may contact Hyundai customer service at 1-855-371-9460. Hyundai's number for this recall is 002G.

**18V-496**

Daimler Vans USA, LLC (DVUSA) is recalling certain 2017-2018 Mercedes-Benz Metris vehicles. The drive shaft securing bolts may loosen at the automatic transmission flange. If the bolts loosen and fall out, the driveshaft may separate causing a loss of drive, thereby increasing the risk of a crash. DVUSA will notify owners, and dealers will replace the transmission flange, securing bolts, and clean the shaft seal, free of charge. The recall is expected to begin September 28, 2018. Owners may contact DVUSA customer service at 1-877-762-8267.

**18V-497**

Thor Motor Coach (TMC) is recalling certain 2018 Thor Ace 27.2 recreational vehicles. The rubber liquid propane (LP) hose may sag and contact the tire in the wheel well. Contact with the tire may cause the LP hose to leak, increasing the risk of a fire. TMC will notify owners, and dealers will inspect the rubber LP hose and replace it as necessary. Dealers will install additional p-clamps or relocate the existing p-clamps to properly secure the hose, free of charge. The recall began on August 22, 2018. Owners may contact TMC customer service at 1-877-855-2867. TMC's number for this recall is RC000158.

**18V-498**

Keystone RV Company (Keystone) is recalling certain 2019 Keystone Summerland recreational trailers, models 1800BH, 1760BH, 1750RD. These trailers have single propane bottle brackets with two mounting legs that may break at the mounting point. If the LP bracket ring bracket breaks, the propane cylinder may detach from the vehicle, increasing the risk of injury or crash. Keystone will notify owners, and dealers will replace the existing LP bottle ring mounting bracket with a 3-legged bracket, free of charge. The recall began on August 24, 2018.



**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JULY 2018**

*Published September 21, 2018*

Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 18-328.

**18V-499**

Forest River, Inc. (Forest River) is recalling certain 2019 Forest River Cherokee Wolf Pup recreational trailers, models CKTR15SW-D, CKTR16BHS-D, CKTR16FQ-D, CKTR18RJB-D and CKTR18TO-D. These trailers have single propane bottle brackets with two mounting legs that may break at the mounting point. If the LP bracket ring bracket breaks, the propane cylinder may detach from the vehicle, increasing the risk of injury or crash. Forest River will notify owners, and dealers will replace the LP bottle ring bracket, free of charge. The recall began August 17, 2018. Owners may contact Forest River customer service at 1-260-499-2100. Forest River's number for this recall is 17D-0805.

**18V-500**

TowBlazer, Inc. (TowBlazer) is recalling certain 2018 TowBlazer Heritage motorcycle tow-behind trailers. The axle spindles on these trailers may have a poor weld, possibly resulting in the spindle breaking and the wheel detaching. If the wheel falls off, there would be an increased risk of a crash. TowBlazer has notified owners, and dealers will correct the weld, or replace the chassis with a correctly welded spindle, free of charge. The recall began on July 11, 2018. Owners may contact TowBlazer customer service at 1-864-501-4559.

**18V-501**

Alta Motors (Alta) is recalling certain 2019 Alta Redshift EXR and 2018-2019 Alta Redshift MXR motorcycles. The software for the throttle control may fault if the throttle is rolled forward past the closed position, possibly resulting in a motorcycle stall. A motorcycle stall can increase the risk of a crash. Alta will notify owners, and dealers will install an update for the throttle software, free of charge. Owners may contact Alta customer service at 1-415-230-0755. Alta's number for this recall is SVC-ESB-18-004.

**18V-502**

Daimler Trucks North America, LLC (DTNA) is recalling certain 2012-2015 Freightliner Cascadia, Coronado, Business Class M2, 114SD, and Western Star 4900 trucks. In certain front axle, brake lining, and brake spider combinations, braking may cause high vibrations, resulting in early failure of the tie-rod tube. A tie-rod failure would cause a disconnect between the front wheels, resulting in a loss of steering ability, thereby increasing the risk of a crash. DTNA will notify owners, and dealers will replace the brake linings, brake spider, and tie-rod, free of charge. The recall is expected to begin September 2018. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL782.

**18V-503**

Cummins Inc. (Cummins) is recalling certain 2015-2018 Power Generation trailers, models C60D6R, C150D6R, C80D6R, C100D6R, C200D6R, C300D6R, C150D2R3 and C200D2Re, 2016-2018 C275D2Re and 2018 C70D2Re and C100D2Re. These generator sets may have incorrectly wired remote emergency stop and remote start connections causing the remote stop to not function and shut down the generator as intended. If the unit does not shut down as expected when the remote E-stop is activated, it can increase the risk of injury. Cummins will notify owners, and dealers will inspect the remote E-stop function and, if necessary, repair or

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING JULY 2018**

*Published September 21, 2018*

replace the remote E-stop/remote start switch panel, free of charge. The recall is expected to begin September 2018. Owners may contact Cummins customer service at 1-800-286-6467.

**18V-504**

Heartland Recreational Vehicles, LLC (Heartland) is recalling certain 2018 Heartland Sundance XLT TT recreational trailers. These vehicles may have been incorrectly equipped with Load Range C tires instead of Load Range D tires. Overloading the tires may result in tire failure, increasing the risk of a crash. Heartland will notify owners, and dealers will replace the tires with ones of the correct load rating, free of charge. The recall began on August 21, 2018. Owners may contact Heartland customer service at 1-877-262-8032. Heartland's number for this recall is 99.01.39.

**18V-510**