

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2019**

Published August 16, 2019

CHILD SEATS:

None during July 2019.

EQUIPMENT:

DLT, LLC. is recalling certain CravenSpeed Fiat Short Shifter shafts sold for use in 2011-2019 Fiat 500 vehicles. The Shifter Shaft may have been improperly manufactured with a through hole for the set screw rather than a blind hole, which may lead to the breakage of the Shifter Shaft. If the shifter breaks while the vehicle is in motion, it can increase the risk of a crash. DLT has notified owners, and will provide a complete replacement shifter assembly with an updated shaft, free of charge. The recall began July 24, 2019. Owners may contact DLT customer service at 1-505-505-6886.

19E-044

Reyco Granning (Reyco) is recalling certain Fire Truck Independent Front Suspensions. The front shocks may separate from their upper mount on the front suspension. The loose shock may contact and damage the steering gear housing, possibly causing a steering fluid leak and a loss of power steering assist. A loss of hydraulic steering assist can increase the risk of a crash. Reyco will notify manufacturers, and dealers will install a new shock mount bolt and nut, hardened washer, and shims to keep the shocks secured, free of charge. Owners may contact Reyco customer service at 1-765-543-5815.

19E-045

MORryde International, Inc. (MORryde) is recalling certain Orbital and You Turn Rubber Pin Box Wedge Kits. These kits may have bolts that are the incorrect lengths. The incorrect bolts may not be able to be properly tightened or may come loose unexpectedly, preventing the fifth-wheel connection to be loose, increasing the risk of a crash. MORryde will notify vehicle manufacturers, and dealers will inspect the bolts, and replace the bolts, if necessary, free of charge. Owners may contact MORryde customer service at 1-574-293-1581.

19E-046

MORryde International, Inc. (MORryde) is recalling certain You Turn and Orbital Rotating Pin boxes. The pin boxes may have been equipped with bolts 1-3/4" in length when they should be equipped with 2" long bolts. If the rotating pin box has been unlocked and allowed to rotate, the shorter bolt can allow the wedge that locks out the rotation of the pin box to break free from the pin box, allowing the rotating pin box to rotate in two places, increasing the risk of a crash. MORryde will notify owners, and dealers will inspect the bolt, and provide replacement bolts if necessary, free of charge. The recall is expected to begin August 2019. Owners may contact MORryde customer service at 1-574-293-1581.

19E-047

Darsan Trading Co. (Darsan), dba as Helmet City, is recalling certain HCI 100 matt black motorcycle helmets in size XL. These helmets may not adequately protect the wearer in the event of a head impact during a motorcycle crash. Additionally, the helmets do not list the month and year of manufacturer. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 218, "Motorcycle Helmets." A helmet that does not adequately protect the wearer from an impact can increase the risk of injury in

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2019**

Published August 16, 2019

the event of a crash. HCI will notify owners, and will provide replacement helmets or give the consumer a credit for a replacement helmet, free of charge. The recall is expected to begin in August 2019. Owners may contact Helmet City customer service at 1-888-550-3731.

19E-048

Meritor, Inc. (Meritor) is recalling certain Non Drive Front Steer Axles, model number FF967. The axles missed the heat treating operation during manufacturing, reducing their strength and possibly causing the axles beam to fracture. Fracture of the axle beam can cause a loss of vehicle control, increasing the risk of a crash. Meritor will notify the affected vehicle manufacturers, and will inspect and replace the axles, free of charge. The recall is expected to begin in August 2019. Owners may contact Meritor customer service at 1-866-668-7221.

19E-049

Indiana Mills and Manufacturing Inc. (IMMI) is recalling certain Inflatable Head Cushions (IHC) and Knee Air Bags (KAB). Due to improper manufacturing, the cushion of the IHC and/or KAB may detach during a deployment event and not inflate. In the event of a crash, if the cushions do not inflate properly, they may not provide the intended protection to the occupant, increasing the risk of injury. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact IMMI customer service at 1-317-896-9531.

19E-050

MORryde International, Inc. (MORryde) is recalling certain battery trays sold for installation on Ford F-550 chassis. The battery trays may have inadequate welds, allowing the battery tray to detach from the chassis. If the battery tray detaches from the chassis, contents of the tray may fall out and become road hazard, and the battery may discharge. Either scenario increases the risk of a crash. MORryde will notify the vehicle manufacturers the purchased the trays, and dealers for those manufacturers will install additional weld areas on both sides of the battery tray for additional support, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact MORryde customer service at 1-574-293-1581.

19E-051

Vitro Automotriz, S.A. de C.V. (Vitro) is recalling certain various aftermarket replacement rear window glass (backlites), sold for use in various Ford, Chevrolet, GMC, Isuzu, Oldsmobile, Buick, Saab, Chrysler, Dodge, RAM, Volkswagen, Mazda, Mercury, Pontiac, Nissan, Toyota, Honda, Jeep, Navistar, International, Saturn, Scion, Cadillac, Lincoln, Infiniti, and Hyundai vehicles including passenger cars, pick-up trucks, SUV's, and Heavy Duty vehicles. For a full list of vehicles affected please see:

<https://static.nhtsa.gov/odi/rcl/2019/RMISC-19E052-0438.pdf>

Due to improper tempering, in the event of a rear window glass breaking, the resulting fragments may not be small enough. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 205, "Glazing Materials." In the event of a crash, larger glass pieces may strike the vehicle occupants, increasing the risk of injury. Vitro will notify distributors and owners, and replace the rear window glasses, free of charge. The recall is expected to begin in August 2019. Owners may contact Vitro customer service at 1-818-863-1524. Vitro's number for this recall is DOT287.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2019**

Published August 16, 2019

19E-052

MEKRA Lang North America, LLC. (MEKRA Lang North America) is recalling certain Main Mirror Housings. Due to improper adhesive bonding, the mirror glass may detach from the mirror carrier plate of the mirror assembly for truck cabs. If the mirror glass detaches from the mirror carrier plate, the driver may have reduced visibility, increasing the risk of a crash. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact MEKRA Lang North America customer service at 1-803-337-5264.

19E-053

TIRES:

None during July 2019.

VEHICLES:

Forest River, Inc. (Forest River) is recalling certain 2019 Rockport work trucks equipped with an optional trailer brake controller. The brake controller may have been wired improperly, which may prevent the brake controller from activating the trailer brakes when the vehicle's brakes are applied. Without the trailer brakes assisting, stopping distances may be lengthened, increasing the risk of a crash. Forest River will notify owners, and dealers will replace the brake controller, free of charge. The recall began July 23, 2019. Owners may contact Forest River customer service at 1-574-327-2392. Forest River's number for this recall is 65-1046.

19V-505

Daimler Vans USA, LLC (DVUSA) is recalling certain 2018-2019 Mercedes-Benz and Freightliner Sprinter 1500, 2500, 3500 and 4500 vehicles. The rear side windows may be single-pane safety glass instead of laminated safety glass. In the event of a side impact crash or vehicle rollover, the fitted side windows may not adequately protect the rear occupants from being ejected, increasing their risk of injury. DVUSA will notify owners, and Mercedes-Benz or Freightliner dealers will replace the single-pane safety glass with laminated safety glass., free of charge. The recall is expected to begin August 2019. Owners may contact DVUSA customer service at 1-877-762-8267. DVUSA's number for this recall is VS3VERGLAS.

19V-507

Altec Industries Inc. (Altec) is recalling certain 2018-2019 AT37/41/48 and L37/42/44 Aerial Devices. The high strength fasteners used to secure the pedestal to the turntable may fail. If the fasteners fail, the pedestal may separate from the turntable, increasing the risk of injury or death. Altec will notify owners, and dealers will replace the fasteners, free of charge. The recall is expected to begin August 28, 2019. Owners may contact Altec customer service at 1-877-462-5832. Altec's number for this recall is CSN 725.

19V-508

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2019**

Published August 16, 2019

Volvo Trucks North America (Volvo Trucks) is recalling certain 2018-2020 VAH, VHD, VNL, and VNR vehicles. The fuse in the transmission circuit may blow, preventing the transmission from shifting. If the fuse blows the transmission may not shift, increasing the risk of a crash. Volvo Trucks will notify owners, and dealers will inspect and replace the fuse, if necessary, free of charge. The recall began August 7, 2019. Owners may contact Volvo Trucks customer service at 1-800-528-6586. Volvo Truck's number for this recall is RVXX1903.

19V-509

Volvo Trucks North America (Volvo Trucks) is recalling certain 2019-2020 VAH, VHD, VNL, and VNR vehicles. The t-bolt clasps on the transmission auxiliary air tank straps may have been over-tightened, resulting in potential deformation to the strap where the t-bolt is anchored. The deformation of the air tank strap t-bolts may cause the t-bolt to disconnect from the strap allowing the tank to drop to the ground and become a road hazard, increasing the risk of a crash. Volvo Trucks will notify owners, and dealers will inspect and replace the air tank strap, if necessary, free of charge. The recall began August 7, 2019. Owners may contact Volvo Trucks customer service at 1-800-528-6586. Volvo Truck's number for this recall is RVXX1904.

19V-510

Nova Bus (Nova) is recalling certain 2014-2017 LFS and LFS Artic buses equipped with USSC cantilever seats. The hardware used to attach the cantilever seats to the side rail may have been improperly tightened. As a result, the cantilever seat may drop to the floor. If the cantilever seat drops while it is occupied, there is an increased risk of an injury. Nova will notify owners, and dealers will inspect and replace the seat rails and hardware, as necessary, free of charge. The recall is expected to begin August 30, 2019. Owners may contact Nova customer service at 1-800-350-6682. Nova's number for this recall is CR4663.

19V-511

Winnebago Industries, Inc. (Winnebago) is recalling certain 2018-2019 Forza motorhomes. The exterior storage compartment door may unexpectedly open while the vehicle is in motion. If the storage compartment door opens while the vehicle is in motion, other drivers may swerve to avoid hitting the compartment door, or objects falling from within, increasing the risk of a crash. Winnebago will notify owners and dealers will install a new latch and the catch will be inspected and properly aligned and readjusted if necessary. The recall is expected to begin August 30, 2019. Owners may contact Winnebago customer service at 1-641-585-6939 or 1-800-537-1885.

19V-512

BMW of North America, LLC (BMW) is recalling certain 2020 750i xDrive, 2019 M850i xDrive Coupe, M850i xDrive Convertible, X5 xDrive50i, X7 xDrive50i, and M5 vehicles. The high pressure fuel pump may not have been properly attached to the engine, which may cause the fuel pump flange to crack, resulting in a fuel leak. A fuel leak in the presence of an ignition source can increase the risk of a fire. BMW will notify owners, and dealers will replace the high pressure fuel pumps, free of charge. The recall is expected to begin August 26, 2019. Owners may contact BMW customer service at 1-800-525-7417.

19V-513

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2019**

Published August 16, 2019

Mazda North American Operations (Mazda) is recalling certain 2019 Mazda3 vehicles. The seat cover material on both front seats may interfere with the head restraint lock release button, causing it to stick in the release position and not allow the head restraint to lock into place. Loose head restraints may increase the risk of injury in the event of a crash. Mazda will notify owners, and dealers will install spacers at the bottom of the lock release buttons on both front seat head restraints, free of charge. The recall is expected to begin September 3, 2019. Owners may contact Mazda customer service at 1-800-222-5500, option 4. Mazda's number for this recall is 3819F.

19V-514

Ford Motor Company (Ford) is recalling certain 2012 and 2017 Focus vehicles equipped with 2.0L GDI gasoline engines and 2013-2014 Focus ST vehicles equipped with 2.0L GTDI engines, previously recalled under 18V-735. The affected vehicles did not have the Powertrain Control Module (PCM) updated as intended. Therefore, the Canister Purge Valve (CPV) may malfunction, possibly causing excessive vacuum in the fuel vapor management system. The excessive vacuum may result in an engine stall while driving, without warning and without the ability to restart the vehicle, increasing the risk of a crash. Ford will notify owners, and dealers will reprogram the Powertrain Control Module. Dealers will also check for fault codes and replace the CPV as needed. If the CPV is replaced, dealers will inspect and replace the carbon canister, fuel tank and fuel delivery module as necessary. The recall began July 29, 2019. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 19S22.

19V-515

Jayco, Inc. (Jayco) is recalling certain 2019-2020 White Hawk Travel Trailers. The breakaway switch may have been incorrectly wired, which can cause the trailer brakes to not function in the event of a trailer separation from the tow vehicle. If the trailer separates from the tow vehicle, the breakaway switch may not activate the trailer brakes, increasing the risk of a crash. Jayco will notify owners, and dealers will inspect the breakaway switch for proper wiring, rewiring it as necessary, free of charge. Owners may contact Jayco customer service at 1-800-517-9137. Jayco's number for this recall is 9901438.

19V-516

Keystone RV Company (Keystone) is recalling certain 2020 Crossroads Hampton and Sunset recreational trailers. The breakaway switch may have been incorrectly wired, which can cause the trailer brakes to not function in the event of a trailer separation from the tow vehicle. If the trailer detaches from the tow vehicle, the breakaway switch may not activate the brakes, increasing the risk of a crash. Keystone will notify owners, and dealers will rewire the breakaway switch, free of charge. The recall began July 29, 2019. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 19-357.

19V-517

Ford Motor Company (Ford) is recalling certain 2019 Ford Ranger vehicles with a SuperCab body style. The front passenger seat belt may have been improperly assembled. Improperly assembled seat belts may not adequately restrain occupants in a crash, increasing their risk of injury. Ford will notify owners, and dealers will inspect and, if necessary, replace the right front seat belt assembly, free of charge. The recall began July 29, 2019. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 19S23.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2019**

Published August 16, 2019

19V-518

Subaru of America, Inc. (Subaru) is recalling certain 2019 Ascent vehicles. The center support bolts for the driveshaft may loosen, possibly resulting in the front portion of the driveshaft disconnecting. If the front end of the driveshaft separates, it can increase the risk of a crash. Subaru will notify owners, and dealers will replace the driveshaft assembly, including the center support brace, free of charge. The recall began July 26, 2019. Owners may contact Subaru customer service at 1-844-373-6614. Subaru's number for this recall is WUI-94.

19V-519

Corp. Micro Bird Inc. (Micro Bird) is recalling certain 2019 MBII propane-powered vehicles equipped with a main battery cut-off switch. If the main battery cut-off switch is activated, the propane conversion controller grounding wire may melt. A melted grounding wire may result in a short-circuit, increasing the risk of a fire in the engine compartment. Micro Bird will notify owners and dealers will relocate the grounding, free of charge. The recall began August 6, 2019. Owners may contact Micro Bird customer service at 1-819-477-2012, extension 364.

19V-520

Maserati North America, Inc. (Maserati) is recalling certain 2019 Levante vehicles equipped with full LED headlights with Adaptive Front Lighting System (AFLS). The headlights may be misadjusted above the maximum height allowed, possibly impairing other driver's visibility on the roadway. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." Affecting the visibility of oncoming traffic can increase the risk of a crash. Maserati will notify owners, and dealers will adjust the headlights, free of charge. The recall is expected to begin August 26, 2019. Owners may contact Maserati customer service at 1-877-696-2737. Maserati's number for this recall is 387.

19V-521

Spartan Motors USA (Spartan) is recalling certain 2014-2020 Emergency Response Gladiator and MetroStar vehicles equipped with an independent front suspension and Koni shocks. The front shocks may separate from their upper mount on the front suspension. The loose shock may contact and damage the steering gear housing, possibly causing a steering fluid leak and a loss of power steering assist. A loss of power steering assist increases the risk of a crash. Spartan will notify owners, and dealers will install new shock bolts, and shims if necessary, free of charge. The recall is expected to begin August 2019. Owners may contact Spartan customer service at 1-800-543-5008. Spartan's number for this recall is 19015.

19V-523

Blue Bird Body Company (Blue Bird) is recalling certain 2020 Vision and All American buses equipped with Specialty Prolo 24" x 24" roof hatches. Due to a manufacturing issue, the roof hatch external handle may unexpectedly break under reasonable use. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 217, "Bus Emergency Exits and Window Retention and Release." If the roof hatch external handle breaks, in the event of an emergency, the hatch cannot be easily opened from outside the vehicle, increasing the risk of injury. Blue Bird will notify owners, and dealers will

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2019**

Published August 16, 2019

replace the outer hatch handle, free of charge. The recall is expected to begin September 1, 2019. Owners may contact Blue Bird customer service at 1-478-822-2242. Blue Bird's number for this recall is R19AF - NSB.

19V-524

Heartland Recreational Vehicles, LLC (Heartland) is recalling certain 2017 Bighorn Traveler, 2016-2020 Elkridge, Elkridge Ex, 2019-2020 Milestone, 2017-2018 North Peak, 2016-2017 Oakmont, 2017-2020 Pioneer FW, 2016-2018 Prowler FW, 2017-2019 Sundance and Sundance XLTFW trailers. The A/C electrical connector may have been improperly installed, possibly causing increased electrical resistance and the connection to overheat. Overheating of the connection can increase the risk of a fire. Heartland will notify owners, and dealers will correct the electrical connections, free of charge. The recall is expected to begin September 6, 2019. Owners may contact Heartland customer service at 1-877-262-8032. Heartland's number for this recall is 99.01.47.

19V-525

Blue Bird Body Company (Blue Bird) is recalling certain 2018-2020 Vision and All American school buses equipped with Specialty Manufacturing Prolo roof emergency exit hatches. Due to a manufacturing issue, the roof hatch external handle may unexpectedly break under reasonable use. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 217, "Bus Emergency Exits and Window Retention and Release." If the roof hatch external handle breaks, in the event of an emergency, the hatch cannot be easily opened from outside the vehicle, increasing the risk of injury. Blue Bird will notify owners, and Specialty dealers will replace the outer handle, free of charge. The recall is expected to begin September 1, 2019. Owners may contact Blue Bird customer service at 1-478-822-2242. Blue Bird's number for this recall is R19AF - SB.

19V-526

Ameritrans Bus, Inc. (Ameritrans) is recalling certain 2013-2016 Ameritrans Ram 5500 (R Series) vehicles. Pushing the brake pedal for prolonged periods when the vehicle is running and in PARK may cause the Brake Transmission Shift Interlock (BTSI) pin to stick in the open position. With the pin in the open position, the transmission can be shifted out of PARK into any gear without pushing the brake pedal or having the key in the ignition. Being able to shift the transmission without pushing the brake pedal and/or without a key in the ignition can increase the risk of an unintended vehicle rollaway that may result in personal injury or a crash. Ameritrans has notified owners and Chrysler dealers will update the vehicle software, inspect the BTSI, and, as necessary, replace it, free of charge. The recall began July 23, 2019. Owners may contact Ameritrans customer service at 1-574-218-4786.

19V-527

Kovatch Mobile Equipment Corp. (KME) is recalling certain 2017-2019 Predator Rescue, SS Rescue, SS Aerial, Aerial, SS TDA and Tanker and Predator Panther Rescue and Aerial, 2016-2020 Predator Panther Pumper and Predator SS Pumper, 2017-2020 Predator Panther Tanker and Predator Pumper, 2017 Predator SS Tanker and 2017-2018 Predator TDA. In the event of a hydraulic system failure while raising or lowering the cab, the hydraulic velocity fuses may not activate and lock the cab in place to prevent the cab from quickly

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2019**

Published August 16, 2019

closing. If the velocity fuses do not activate and stop the cab from lowering, the cab may hit occupants working underneath, increasing the risk of an injury. KME will notify owners, and dealers will replace the velocity fuses for each cab lift cylinder, free of charge. The recall is expected to begin in August 2019. Owners may contact KME customer service at 1-800-235-3928.

19V-528

REV Recreation Group (REV) is recalling certain 2016-2019 American Coach American Eagle and 2016 American Heritage motorhomes equipped with factory-installed rear air deflectors. The center mounting plate for the rear air deflector may have been installed incorrectly with screws that may loosen, possibly resulting in the air deflector detaching from the vehicle. If the rear air deflector detaches from the motorhome, it may become a road hazard, increasing the risk of a crash. REV will notify owners, and dealers will properly secure the rear air deflector to the fiberglass cap with rivets, free of charge. The recall is expected to begin September 10, 2019. Owners may contact REV customer service 1-800-509-3417. REV's number for this recall is 190709REV.

19V-529

BYD Coach & Bus (BYD) is recalling certain 2019 C8M buses equipped with Transpec glass roof escape hatches. Temperature and vibration stresses may cause the tempered glass roof hatch to shatter. If the tempered glass roof hatch shatters, glass fragments may fall onto passengers, increasing the risk of an injury. BYD has notified the affected owners, and BYD technicians will replace the glass roof hatches, free of charge. The recall began July 22, 2019. Owners may contact BYD customer service at 1-661-940-3250.

19V-530

Braun Corporation (Braun) is recalling certain modified 2017-2020 Toyota Sienna vehicles. The steering shaft extensions may have been improperly manufactured, possibly causing the extensions to fracture. If the steering shaft extension completely fractures, it can cause a loss of steering, increasing the risk of a crash. Braun has notified owners, and dealers will replace the steering shaft extensions, free of charge. The recall began July 25, 2019. Owners may contact Braun customer service at 1-800-488-0359.

19V-532

Porsche Cars North America, Inc. (Porsche) is recalling certain 2016-2017 911 and Boxster, 2016 Cayman and Panamera vehicles. The air bag Electronic Control Unit (ECU) may have a defective power supply capacitor that can result in air bag deactivation or inadvertent deployment of the air bags. Deactivated air bags increase the risk of injury. Inadvertent deployment of the air bags increase the risk of a crash. Porsche will notify owners, and dealers will install new software and replace the air bag ECU as necessary, free of charge. The recall is expected to begin September 15, 2019. Owners may contact Porsche customer service at 1-800-767-7243. Porsche's number for this recall is AKB4.

19V-533

Navistar, Inc. (Navistar) is recalling certain 2020 IC CE school buses equipped with PSI gasoline or propane engines and C7 Body Control Modules (BCM). An electrical overload condition in the BCM from the starter solenoid may occur and cause damage to the starter circuit of the BCM, possibly resulting in an unintended command to crank the engine when the ignition key is in the run position and the transmission is in the park or

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2019**

Published August 16, 2019

neutral position. If the ignition is in the run position and the engine starts unexpectedly while the vehicle is being serviced, there would be an increased risk of personal injury. Navistar will notify owners, and dealers will install an overlay harness and relay to provide electrical power to the starter circuit, instead of using the BCM to provide power. This repair will be performed free of charge. The recall is expected to begin September 13, 2019. Navistar's number for this recall is 19512.

19V-534

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2015-2016 Tiguan and CC vehicles. The air bag Electronic Control Unit (ECU) may have a defective power supply capacitor that can result in air bag deactivation or inadvertent deployment of the air bags. Deactivated air bags increases the risk of injury. Inadvertent deployment of the air bags increase the risk of a crash. Volkswagen will notify owners, and dealers will install new software and replace the air bag ECU as necessary, free of charge. The recall is expected to begin September 13, 2019. Volkswagen's number for this recall is 69Z5.

19V-535

Hyundai Motor America (Hyundai) is recalling certain 2018 Genesis G80 and 2017-2018 Genesis G90 vehicles equipped with 3.3 liter turbocharged engines. The turbocharger oil supply pipe may have a loose seal, causing oil to leak onto the exhaust manifold. Oil leaking onto the exhaust manifold increases the risk of a fire. Hyundai will notify owners, and dealers will replace the turbocharger oil supply pipe, free of charge. The recall is expected to begin September 6, 2019. Owners may contact Hyundai customer service at 1-855-371-9460. Hyundai's number for this recall is 003G.

19V-538

Kia Motors America (Kia) is recalling certain 2019 Optima vehicles equipped with Gamma 1.6L Turbo-GDI or Theta II 2.0L Turbo-GDI engines. A software error in the Forward Collision-Avoidance Assist (FCA) system may cause the braking assist function to not engage when a stationary vehicle is detected. Improper intervention of the Forward Collision-Avoidance Assist can increase the risk of a crash. Kia will notify owners, and dealers will update the FCA software, free of charge. The recall is expected to begin August 27, 2019. Owners may contact Kia customer service at 1-800-333-4542. Kia's number for this recall is SC179.

19V-539

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain 2019 C300 Cabrio, C300A Cabrio 4MATIC, C300 Coupe, C300 Coupe 4MATIC, C300, C300 4MATIC, C43 AMG Cabrio 4MATIC, C43 AMG Coupe 4MATIC, C43 AMG 4MATIC, C63 AMG Cabrio, C63S AMG Cabrio, C63 AMG Coupe, C63S AMG Coupe, C63 AMG, C63S AMG, CLS450, CLS450 4MATIC, CLS53 AMG 4MATIC, E300, E300 4MATIC, E450 Cabrio, E450 Cabrio 4MATIC, E450 Coupe, E450 Coupe 4MATIC, E450 Wagon 4MATIC, E450 4MATIC, E53 AMG Cabrio 4MATIC, E53 AMG Coupe 4MATIC, E53 AMG 4MATIC, E63S AMG 4MATIC, E63S AMG Wagon 4MATIC, S450, S450 4MATIC, S560 Cabrio, S560 Coupe 4MATIC, S560, S560 4MATIC, S560 4MATIC Maybach, S63 AMG Cabrio 4MATIC, S63 AMG Coupe 4MATIC, S63 AMG 4MATIC, S65 AMG Cabrio, S65 AMG, and AMG GT53 Coupe 4MATIC vehicles, and 2020 GLC300 Coupe 4MATIC, GLE350 4MATIC, and GLE450 4MATIC vehicles equipped with the Driver Assistance Package. A software error in the radar sensor control unit may impair the functionality of the

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2019**

Published August 16, 2019

Active Brake Assist. An impaired Active Brake Assist may not automatically apply partial or full braking as expected, increasing the risk of a crash. MBUSA will notify owners, and dealers will update the radar sensor control unit software, free of charge. The recall is expected to begin September 17, 2019. Owners may contact MBUSA customer service at 1-800-367-6372.

19V-540

BMW of North America, LLC (BMW) is recalling certain 2019 X5 xDrive50i and X7 xDrive40i vehicles. The left side wheel bolts may have been insufficiently tightened and may loosen over time. Loose bolts may allow a wheel to detach from the vehicle, increasing the risk of a crash. BMW will notify owners, and dealers will replace and tighten the left side wheel bolts, free of charge. The recall is expected to begin September 16, 2019. Owners may contact BMW customer service at 1-800-525-7417.

19V-541

Forest River, Inc. (Forest River) is recalling certain 2019 Glaval Concorde II, Entourage, Legacy, Primetime, Universal, Commute, Startrans Candidate II, P/S2, Senator II, Senator II HD, Senator II MPV, and MFSAB buses. The driver's upper seat belt restraint and bottom retractor anchor bolts may not have been fully tightened during manufacturing, and, as a result, the bolts may loosen. If the bolts loosen, the seat belt assembly may fail to restrain the occupant in the event of a crash, increasing their risk of injury. Forest River will notify owners, and dealers will inspect and correct the tightness of the affected bolts, free of charge. The recall is expected to begin September 2, 2019. Owners may contact Forest River at 1-800-348-7440. Forest River's number for this recall is 05-1061.

19V-542

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain 2019 Lexus LS500, LC500, ES300h, UX250h, LS500h, Toyota Prius, RAV4 HV, 2019-2020 Toyota Prius Prime, and 2020 Corolla HV vehicles. The brake booster pump may fail causing a deactivation of the Vehicle Stability Control system and a loss of braking assist. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 126, "Electronic Stability Control Systems." Deactivation of the vehicle stability control system or a loss of braking assist increases the risk of a crash. Toyota will notify owners, and dealers will inspect and, if necessary, replace the brake booster pump, free of charge. The recall is expected to begin September 9, 2019. Toyota owners may contact Toyota customer service at 1-888-270-9371 and Lexus owners may contact Lexus customer service at 1-800-255-3987. Toyota's numbers for this recall are K1L/K0L. Lexus' numbers for this recall are K2F/KLF.

19V-544

Daimler Vans USA, LLC (DVUSA) is recalling certain 2019 Mercedes-Benz Metris vehicles. The vehicles may have been delivered with a printed operator's manual that does not match the vehicle's features and operating instructions. The incorrect manual may not describe the proper operation of the vehicle, increasing the risk of a crash. DVUSA will notify owners, and dealers will replace the information package including the printed version of the operator's manual, maintenance booklet and information sheets, free of charge. The recall is expected to begin September 16, 2019. Owners may contact DVUSA customer service at 1-877-762-8267. DVUSA's number for this recall is VS2BAFV.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2019**

Published August 16, 2019

19V-545

Braun Corporation (Braun) is recalling certain 2016-2019 Ford Explorer BraunAbility MXV wheelchair accessible conversion vehicles. The switch-activated electric solenoid used to release the rear seat base latches from the floor-mounted strikers may unintentionally switch and stay on. In this case, the wires may overheat, causing the wiring insulation to melt, possibly resulting in an electrical short circuit. An electrical short circuit increases the risk of a fire. Braun has notified owners, and dealers will add timer components to the solenoid circuits, free of charge. The recall began August 7, 2019. Owners may contact Braun customer service at 1-800-488-0359.

19V-546

Volkswagen Group of America, Inc. (Audi) is recalling certain 2018 Audi S5 Cabriolet, S5 Sportback, S5 Coupe, S4 Sedan, A5 Cabriolet, A5 Sportback and A5 Coupe and 2017-2018 A4 Sedan and A4 Allroad vehicles. Oxidation on the Passenger Occupant Detection System (PODS) connecting cable may cause the software to misdiagnose a malfunction and disable the passenger air bag. A disabled passenger air bag increases the risk of injury in the event of a crash. Audi will notify owners, and dealers will update the air bag control unit software, free of charge. The recall is expected to begin September 15, 2019. Owners may contact Volkswagen customer service at 1-800-893-5298. Audi's number for this recall is 74D9.

19V-547

Daimler Trucks North America LLC (DTNA) is recalling certain 2019-2020 Freightliner Cascadia vehicles equipped with a certain 40K Light Weight Extra Duty Airliner suspension and 51 inch axle spacing configuration. The brake airlines may be damaged due to inadequate clearance between the ride height control valve and the brake airlines. Damage to the brake airlines can cause reduced brake effectiveness, increasing the risk of a crash. DTNA will notify owners, and dealers will install a new bracket for the height control valve to add additional clearance for the brake airlines, free of charge. The recall is expected to begin September 21, 2019. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-820.

19V-548

Daimler Trucks North America LLC (DTNA) is recalling certain 2020 Thomas Built Minotour, 2019-2020 Saf-T Liner C2, and 2019 Saf-T Liner HDX buses equipped with Safe Fleet Roof Escape hatches. Due to a manufacturing issue, the roof hatch external handle may unexpectedly break under reasonable use. If the roof hatch external handle breaks, in the event of an emergency, the hatch cannot be easily opened from outside the vehicle, increasing the risk of injury. DTNA will notify owners, and dealers will install a new handle, free of charge. The recall is expected to begin September 21, 2019. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-819.

19V-549

Daimler Trucks North America LLC (DTNA) is recalling certain 2019-2020 Thomas Built Minotour, Saf-T Liner C2, Saf-T Liner EFX, and Saf-T Liner HDX school buses equipped with Safe Fleet Prolo Roof Escape hatches. Due to a manufacturing issue, the roof hatch external handle may unexpectedly break under reasonable use. If the roof hatch external handle breaks, in the event of an emergency, the hatch cannot be easily opened

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2019**

Published August 16, 2019

from outside the vehicle, increasing the risk of injury. DTNA will notify owners, and dealers will install a new handle, free of charge. The recall is expected to begin September 21, 2019. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-819.

19V-550

Alfa Romeo (FCA US LLC) is recalling certain 2018-2019 Giulia and Stelvio vehicles. The Body Control Module (BCM) may indicate an inaccurate fuel level that displays higher than the actual amount. The vehicle may be operated without enough fuel in the tank causing a stall, increasing the risk of a crash. Alfa Romeo will notify owners, and dealers will update the BCM software, free of charge. The recall began August 12, 2019. Owners may contact Alfa Romeo customer service at 1-800-853-1403. Alfa Romeo's number for this recall is V84.

19V-551

MMDi, Inc. (MMDi) is recalling certain 2019 Cummins 'G' A057P788 trailers equipped with Towking brand 12k jacks. The jack handle may have been improperly fastened, allowing the jack handle to separate from the jack assembly. If the jack separates from its assembly, it may become a road hazard, increasing the risk of a crash. MMDi has notified owners, and will provide a nylon locking nut to replace the standard nut used and specific work instructions for replacing the nut, free of charge. The recall began July 25, 2019. Owners may contact MMDi customer service at 1-704-822-4550.

19V-552

Vantage Mobility International, LLC (Vantage) is recalling certain 2012-2018 AMS Genesis wheelchair vans, built on a Toyota Sienna vehicles. The rubber brake hoses that attach to the rear wheel assembly may be too short, causing them to rub against the rear axle trailing arm. The contact may cause failure of the rear brake hoses, resulting in a loss of vehicle control and reduced braking ability, increasing the risk of a crash. Vantage will notify owners, and dealers will install a set of rear brake hoses that will provide the proper clearance, free of charge. The recall is expected to begin August 2019. Owners may contact Vantage customer service at 1-800-488-9082.

19V-553

Champion Bus, Inc. (Champion) is recalling certain 2019 Challenger, Crusader, Defender and LF Transport and Goshen G-Force, Impulse and Pacer II shuttle buses equipped with Prolo roof emergency escape hatches. Due to a manufacturing issue, the roof hatch external handle may unexpectedly break under reasonable use. If the roof hatch external handle breaks, in the event of an emergency, the hatch cannot be easily opened from outside the vehicle, increasing the risk of injury. Champion will notify owners, and dealers will replace the handle, free of charge. The recall is expected to begin September 16, 2019. Owners may contact Champion customer service 1-810-724-1753, extension 415.

19V-554

Forest River, Inc. (Forest River) is recalling certain 2013-2019 Starcraft Allstar, 2013 and 2019 Allstar XL, 2017 Candidate II, 2014-2018 Senator II and Senator II HD, and 2015-2019 Starlite vehicles equipped with Safe Fleet Prolo Roof Escape hatches. Due to a manufacturing issue, the roof hatch external handle may unexpectedly break under reasonable use. If the roof hatch external handle breaks, in the event of an emergency,

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2019**

Published August 16, 2019

the hatch cannot be easily opened from outside the vehicle, increasing the risk of injury. Forest River will notify owners, and dealers will replace the hatch, free of charge. The recall is expected to begin September 13, 2019. Owners may contact Forest River customer service at 1-800-748-3440. Forest River's number for this recall is 05-1060.

19V-555

Chrysler (FCA US LLC) is recalling one 2019 Ram 1500 vehicle. The instrument cluster may not properly illuminate driver warnings. As such, this vehicle fails to conform with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 101, "Control and Displays." Failure of the instrument cluster to properly illuminate may prevent the driver from receiving warnings about the vehicle's systems and increase the risk of crash. Chrysler will notify the owner, and a dealer will replace the instrument cluster, free of charge. The recall is expected to begin September 13, 2019. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is V83.

19V-556

Temsa is recalling certain 2014-2019 TS45 buses. The hydraulic hoses of the steering system may leak or burst during operation of the vehicle. Loss of hydraulic steering fluid pressure may affect steering ability, increasing the risk of a crash. Temsa will notify owners, and dealers will inspect and replace the hydraulic hoses, free of charge. The recall is expected to begin in August 2019. Owners may contact Temsa customer service at 1-833-628-3672.

19V-557

Mazda North American Operations (Mazda) is recalling certain 2019 Mazda3 vehicles equipped with manual dimming mirrors. The adhesive between the interior rearview mirror and the housing may not be properly bonded, allowing the mirror to detach from the housing. Note: Vehicles equipped with auto dimming mirrors are not affected by this recall. Rearward visibility will be reduced without the rearview mirror, increasing the risk of a crash. Mazda will notify owners, and dealers will replace the interior rearview mirror assembly, free of charge. The recall is expected to begin August 30, 2019. Owners may contact Mazda customer service at 1-800-222-5500, option 4. Mazda's number for this recall is 3919G.

19V-558

Gulf Stream Coach, Inc. (Gulf Stream) is recalling certain 2017 Serro Scotty S14 RBR travel trailers. The Federal Placard label indicates an incorrect Gross Vehicle Weight Rating (GVWR). Incorrect GVWR information may result in the trailer being overloaded, affecting the tires or the vehicle's handling, thereby increasing the risk of a crash. Gulf Stream will notify owners, and dealers will replace the Federal Placard label, free of charge. The recall is expected to begin in August 2019. Owners may contact Gulf Stream customer service at 1-800-289-8787. Gulf Stream's number for this recall is GS072619.

19V-560

Piaggio Group Americas, Inc. (Piaggio) is recalling certain 2016-2018 Moto Guzzi Audace 1400 and Eldorado 1400, 2017-2018 Moto Guzzi California 1400, 2017 Moto Guzzi MGX 21 Bagger, 2013-2014 Aprilia Mana 850, 2014-2016 Aprilia Dorsoduro 750, 2018-2019 Aprilia Dorsoduro 900, and 2018 Aprilia Shiver 900

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2019**

Published August 16, 2019

motorcycles. Due to a problem with the front brake master cylinder, the front brakes may drag or apply, causing the motorcycle to unexpectedly slow down or stop completely without activating the rear brake light. Unexpectedly slowing down or stopping while driving with no warning to following traffic can increase the risk of a crash. Piaggio will notify owners, and dealers will inspect, and if necessary, replace the front brake master cylinder free of charge. The recall is expected to begin August 2019. Owners may contact Piaggio customer service at 1-212-380-4433. Piaggio's number for this recall is PA2ZZQ1904.

19V-561

Pierce Manufacturing (Pierce) is recalling certain 2019 Arrow XT, Dash, Enforcer, Impel, Quantum, and Velocity vehicles. Due to improper manufacturing, the passenger-side knee air bag (KAB) may not properly inflate during a deployment event. In the event of a crash, if the KAB does not inflate properly, it may not provide the intended protection to the occupant, increasing the risk of injury. Pierce will notify owners, and dealers will replace the KAB assembly, free of charge. The recall is expected to begin August 2019. Owners may contact Pierce customer service at 1-888-974-3723.

19V-562

BMW of North America, LLC (BMW) is recalling certain 2018-2019 X3 sDrive30i, xDrive30i and M40i and 2019 X4 xDrive30i and M40i vehicles. The front seatback frames may have been improperly welded, allowing the seatback to unexpectedly fold forward or rearward. In the event of a crash, there is an increased risk of injury if the seatback folds forward or rearward. BMW will notify owners, and dealers will replace the front seats, free of charge. The recall is expected to begin September 23, 2019. Owners may contact BMW customer service 1-800-525-7417.

19V-563

Hino Motors Sales U.S.A., Inc. (Hino) is recalling certain 2020 NE8J, NJ8J, and NV8J vehicles. Due to improper adhesive bonding, the exterior mirror glass may detach from the mirror carrier plate. If the mirror glass detaches, the driver may have reduced visibility, increasing the risk of a crash. Hino will notify owners, and dealers will replace the mirrors, free of charge. The recall is expected to begin August 2019. Owners may contact Hino customer service at 1-248-699-9390. Hino's number for this recall is M0330.

19V-564

Prevost Cars, Inc. (Prevost) is recalling certain 2017-2020 X3-45 Coach, Commuter, VIP, and VIP Entertainer buses, and H3-45 Coach and VIP buses. Under certain conditions, such as high altitude and heavy climbing, the engine may overheat and shutdown. If the engine unexpectedly shuts down, passengers may have to be transferred to another vehicle on the side of the road, increasing the risk of an injury. If the engine unexpectedly shuts down while the vehicle is in motion, there is an increased risk of crash. Prevost will notify owners and will update the engine software, free of charge. The recall is expected to begin September 20, 2019. Owners may contact Prevost customer service at 1-866-870-2046.

19V-565