

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2016**

Published September 28, 2016

CHILD SEATS:

None during August 2016.

EQUIPMENT:

WSB Inc (WSB) is recalling certain WSB777 half helmets in all sizes manufactured May 1, 2015, to May 2, 2015. The affected helmets may be missing or have insufficient labeling and may not be strong enough to protect a user in the event of a crash. As such, these helmets fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 218, "Motorcycle Helmets." Helmets that do properly protect the wearer's head can increase the risk of injury to the wearer in the event of a crash. Missing labeling information reduces the user's possibility of identifying the helmet in the event of a safety recall. WSB will notify owners, and replace or reimburse the owners, free of charge. The recall began on September 7, 2016. Owners may contact WSB customer service at 1-855-322-3733.

16E-068

Idle Free Systems, Inc. (IFS) is recalling certain IFS Auxiliary Power Units with the Reefer-type trailer Link Kit option manufactured January 1, 2010, to May 31, 2016. In the affected power units, the battery positive cable may short to ground. If the positive battery cable short circuits, it can increase the risk of a fire. IFS has notified owners, and dealers will install a supplemental auxiliary battery bank positive terminal fuse, free of charge. The recall began on September 19, 2016. Owners may contact IFS customer service at 1-920-206-9333. IFS' number for this recall is RLK.

16E-069

TIRES:

Goodyear Tire & Rubber Company (Goodyear) is recalling certain Dunlop SP50 tires, size P205/70R15 95T, manufactured December 2, 2012, to February 1, 2014. The affected tires could experience tread chunking in service. As such, these tires fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 139, "New Pneumatic Radial Tires for Light Vehicles." If the tire experiences tread chunking in service the risk of a crash may be increased. Goodyear will notify owners, and dealers will replace tires, free of charge. The recall began on September 27, 2016. Owners may contact Goodyear customer service at 1-800-592-3267.

16T-011

VEHICLES:

Heartland Recreational Vehicles, LLC (Heartland) is recalling certain model year 2016-2017 Wilderness and Mallard travel trailers, 2015-2017 Elkridge fifth wheel travel trailers, and 2017 Sundance and Torque travel trailers. The affected vehicles have an LED light on the front cap of the camper that may short circuit and overheat. If the light overheats there would be an increased risk of a fire. Heartland will notify owners, and dealers will replace the light with one that has built-in voltage protection. The recall began on September 1,

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2016**

Published September 28, 2016

2016. Owners may contact Cruiser customer service at 1-877-262-8032.

16V-566

E-One Incorporated (E-One) is recalling certain model year 2015-2016 Cyclone II vehicles manufactured July 31, 2015, to June 12, 2016, 2015-2016 Typhoon vehicles manufactured September 21, 2015, to July 27, 2016, 2015 Freightliner M2 vehicles manufactured November 3, 2015, and 2015 International 7400 vehicles manufactured November 3, 2015. The affected vehicles may be equipped with certain C20 and C21 split-shaft transmissions from Waterous. This transmission sends power to the wheels of an emergency response vehicle or powers an add-on unit such as a water pump used for fighting fires. A component within the shift unit may be damaged and as a result, the operator may not be able to switch the power output. If the power output cannot be changed, once the fire truck arrives at the scene, it may not be able to pump water to aid in extinguishing the fire, increasing the risk of injury. E-One will notify owners and will supply a remedy kit that replaces the clevis pin and retaining rings, free of charge. The recall began on September 8, 2016. Owners may contact E-One customer service at 1-352-861-3612.

16V-567

Jayco, Inc. (Jayco) is recalling certain model year 2013-2017 Redhawk motorhomes manufactured August 1, 2012, to June 24, 2016. The affected vehicles are equipped with shower curtains that may not adequately resist catching fire in the presence of an ignition source. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 302, "Flammability of Interior Materials." A flammable shower curtain may further fuel a fire, increasing the risk of injury. Jayco has notified owners, and dealers will replace the shower curtains with curtains made with fire retardant, free of charge. The recall began August 11, 2016. Owners may contact Jayco customer service at 1-800-283-8267. Jayco's number for this recall is 9903318.

16V-568

Kovatch Mobile Equipment Corp. (KME) is recalling certain model year 2016 Predator SS Tractor Drawn Aerial, Predator SS Aerial, Predator Pumper, Predator Aerial, M114 Tanker, 7600 Tanker, 7600 Pumper, 7400 Tanker, 4400 Pumper, and FDNY Pumper and 2016-2017 Predator SS Pumper and Predator Panther Pumper and 2015-2017 M2 Pumper vehicles. The affected vehicles may be equipped with certain C20 and C21 split-shaft transmissions from Waterous. This transmission sends power to the wheels of an emergency response vehicle or powers an add-on unit such as a water pump used for fighting fires. A component within the shift unit may be damaged and as a result, the operator may not be able to switch the power output. If the power output cannot be changed, once the fire truck arrives at the scene, it may not be able to pump water to aid in extinguishing the fire, increasing the risk of injury. KME will notify owners, and dealers will inspect and repair the transmissions, free of charge. The recall is expected to begin September 27, 2016. Owners may contact KME customer service at 1-800-235-3926.

16V-569

Thor Motor Coach (Thor) is recalling certain model year 2012-2017 Ace, 2013 Citation, 2012-2013 Siesta and 2017 Four Winds and Road Bear Rental motorhomes. The affected vehicles are equipped with shower curtains that may not adequately resist catching fire in the presence of an ignition source. As such, these vehicles fail to

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2016**

Published September 28, 2016

comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 302, "Flammability of Interior Materials." A flammable shower curtain may further fuel a fire, increasing the risk of injury. Thor will notify owners, and dealers will replace the shower curtains with curtains made with fire retardant, free of charge. The recall began on September 15, 2016. Owners may contact Thor customer service at 1-877-500-1020. Thor's number for this recall is RC000121.

16V-571

Aluma/KLM is recalling certain model year 2011-2015 5410T and 5410WD trailers manufactured January 1, 2011, to June 1, 2015. Due to missing welds, the trailer tongues may separate from the body of the trailer. If the trailer tongue separates, the rear of the tongue retainer and tongue tube will drag on pavement and the trailer will not be properly secured to the tow vehicle, resulting in a loss of control, increasing the risk of a crash. Aluma/KLM will notify owners, and dealers will inspect the trailers for missing welds, adding any missing welds and retrofitting two additional gussets, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Aluma/KLM customer service at 1-866-415-3285.

16V-572

Aluma/KLM is recalling certain model year 2011-2015 8605T, 8610T, and 8612T trailers manufactured January 1, 2011, to October 30, 2015. The affected trailers may have misaligned axle mounts, possibly resulting in the axle mounts detaching from the trailer. If the axle mounts separate, there could be a loss of control, increasing the risk of a crash. Aluma/KLM will notify owners, and dealers will inspect the axle mount alignment, repairing it as necessary. Additionally, flat straps will be retrofitted to the axle mounts. These repairs will be performed free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Aluma/KLM customer service at 1-866-415-3285.

16V-573

Hyundai Motor America (Hyundai) is recalling certain model 2013 Elantra vehicles manufactured December 1, 2012, to April 30, 2013. The brake pedal stopper pad can deteriorate allowing the brake light switch plunger to remain extended when the brake pedal is released. If the brake light switch plunger does not retract as it should when the brake pedal is not being pressed, the brake lights may stay illuminated preventing accurate communication to following vehicles that the vehicle is slowing or stopping. Additionally, if the brake switch plunger is not retracted, then the transmission can be shifted out of PARK without depressing the brake pedal. Either condition increases the risk of a crash. Hyundai will notify owners, and dealers will replace the brake pedal stopper pad with an improved part, free of charge. The recall is expected to begin on September 30, 2016. Owners may contact Hyundai customer service at 1-855-371-9460. Hyundai's number for this recall is 146.

16V-574

Hyundai Motor America (Hyundai) is recalling certain model 2015 Genesis vehicles manufactured on February 1, 2015 through May 20, 2015. The affected vehicles are equipped with a TFT-LCD instrument cluster that may read incorrect speed or loss messages, and warning lights of one or more safety related symptoms. These symptoms can include warning lights illuminating, incorrect speedometer reading, turn signal not illuminating, and possible instrument cluster becoming momentarily inoperative. If the instrument cluster reads incorrectly or becomes inoperative, it can cause the driver to not be aware of safety related issues, increasing the risk of a

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2016**

Published September 28, 2016

crash. Hyundai will notify owners, and dealers will perform a software updated, free of charge. The recall is expected to begin on September 30, 2016. Owners may contact Hyundai customer service at 1-800-633-5151. Hyundai's number for this recall is 147.

16V-575

Subaru of America, Inc. (Subaru) is recalling certain model year 2017 Outback vehicles manufactured June 20, 2016, to June 23, 2016. The affected vehicles may have improperly tightened attaching bolts for the front left and right brake calipers, wheel hubs, and the right stabilizer clamp. If any of the front brake caliper, wheel hub or stabilizer clamp attaching bolts loosen or detach, the related components would also become loose and may detach possibly making the vehicle unstable and reducing the braking capability. These conditions would increase the risk of a crash. Subaru has notified owners, and dealers will inspect the bolts for proper torque, and replace any loose bolts, free of charge. The recall began on August 8, 2016. Owners may contact Subaru customer service at 1-800-782-2783. Subaru's number for this recall is WTE-66.

16V-576

Southeast Toyota Distributors, LLC (SET) is recalling certain model year 2010-2015 Toyota 4Runner vehicles manufactured September 3, 2009, to December 1, 2014. The affected vehicles may be equipped with accessory exhaust tips installed by SET or SET dealers that may contact people and possibly burn them while they are standing behind the vehicle. Contact with an exhaust tip may result in personal injury. SET will notify owners, and dealers will install a re-designed exhaust tip that is smaller in diameter and is more recessed behind the bumper, free of charge. The recall began September 15, 2016. Owners may contact SET customer service at 1-866-405-4226. SET's number for this recall is SET16D.

16V-577

E-One Incorporated (E-One) is recalling one model year 2015 Typhoon emergency vehicle manufactured March 16, 2015, to October 30, 2015, equipped with a Class 1 Ultraview Touchscreen manufactured by Hale Products. The touchscreen may experience false switch activations that can happen without the operator's knowledge causing accessories to turn on or off. Untended turning on or off of any or multiple accessories such as emergency beacons or automatic snow chains can increase the risk of a crash. E-One has notified the owner and updated touchscreen software has been installed, free of charge. The recall began on August 4, 2016. Owners may contact E-One customer service at 1-904-237-1122.

16V-578

Forest River, Inc. (Forest River) is recalling certain model year 2017 Cherokee recreational trailers, models CCKT16BHS, CCKT16FQ and CCKT17CJ, manufactured April 15, 2016, to July 28, 2016. The affected vehicles may have insufficient clearance between the bottom of the trailer and the top of the tire and, during use, the tire may make contact, possibly damaging the tire. A damaged tire may unexpectedly deflate, causing a loss of vehicle control and increasing the risk of a crash. Forest River will notify owners, and dealers will install a bolt on lift kit, free of charge. The recall began on September 15, 2016. Owners may contact Forest River customer service at 1-260-593-4005. Forest River's number for this recall is 17C-07292016-0234.

16V-579

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2016**

Published September 28, 2016

Hyundai Translead (HT) is recalling certain model year 2004-2016 Dry Van, Reefer Van, Chassis, and Container trailers manufactured January 4, 2004, to March 4, 2016. These trailers are equipped with certain Bendix SR5 spring brake valves which may have been improperly machined which could cause a delay of application of the spring brakes while parking. If there is a delay of the spring brake application, the trailer may roll away after it has decoupled from the tractor, increasing the risk of a crash or injury. The remedy for this recall is still under development. The recall began on August 4, 2016. Owners may contact HT customer service at 1-819-574-1500. HT's number for this recall is 16E-045.

16V-580

Ferrara Fire Apparatus, Inc. (Ferrara) is recalling certain model year 2015-2016 Inferno, Igniter, Intruder and Cinder fire trucks built on Freightliner and International chassis manufactured April 13, 2015, to May 30, 2016. The affected vehicles may be equipped with certain C20 and C21 split-shaft transmissions from Waterous. This transmission sends power to the wheels of an emergency response vehicle or powers an add-on unit such as a water pump used for fighting fires. A component within the shift unit may be damaged and as a result, the operator may not be able to switch the power output. If the power output cannot be changed, once the fire truck arrives at the scene, it may not be able to pump water to aid in extinguishing the fire, increasing the risk of injury. Ferrara will notify owners, and the shift unit assembly will be removed and the clevis pin and retaining rings will be replaced, free of charge. The recall began on September 9, 2016. Owners may contact Ferrara customer service at 1-225-567-7100 extension 3011.

16V-581

General Motors LLC (GM) is recalling certain model year 2013 Chevrolet Equinox and GMC Terrain vehicles. In the affected vehicles, the ball joints in the windshield wiper module may corrode and wear over time, possibly resulting in one or both of the windshield wipers becoming inoperative. Inoperative windshield wipers may reduce the driver's visibility, increasing the risk of a crash. The remedy for this recall campaign is still under development. An interim notice was sent to owners on September 8, 2016. Owners will receive a second notice when the remedy becomes available. Owners may contact Chevrolet customer service at 1-800-222-1020 or GMC customer service at 1-800-462-8782. GM's number for this recall is 25302.

16V-582

Smeal Fire Apparatus Co., Inc. (Smeal) is recalling certain model year 2015-2016 Smeal Aerial and Pumper fire trucks manufactured July 16, 2015, to August 1, 2016. The affected vehicles may be equipped with certain C20 and C21 split-shaft transmissions from Waterous. This transmission sends power to the wheels of an emergency response vehicle or powers an add-on unit such as a water pump used for fighting fires. A component within the shift unit may be damaged and as a result, the operator may not be able to switch the power output. If the power output cannot be changed, once the fire truck arrives at the scene, it may not be able to pump water to aid in extinguishing the fire, increasing the risk of injury. Smeal will notify owners, and dealers will remove the shift unit assembly and replace the clevis pin and retaining rings, free of charge. The recall began on September 12, 2016. Owners may contact Smeal customer service at 1-877-415-8628.

16V-583

Eldorado National-California, Inc. (Eldorado National) is recalling certain model year 2016 E-Z Rider II transit

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2016**

Published September 28, 2016

buses manufactured March 1, 2016, to July 31, 2016. The affected vehicles are equipped with front steel rims that may allow the inside sidewall of the front tires to contact the outer end of the front tie-rods due to insufficient clearance. If the tie-rods contact the front tires, the tires may be damaged and suddenly lose air, increasing the risk of a crash. Eldorado National has notified the owners, and dealers will replace the steel wheels with ones that provide adequate clearance, free of charge. The recall began on August 10, 2016. Owners may contact Eldorado National customer service at 1-909-591-9557.

16V-584

Pierce Manufacturing (Pierce) is recalling certain model year 2015-2016 Arrow, Dash, Enforcer, Impel, Quantum, Saber, and Velocity fire trucks manufactured June 29, 2015, to June 30, 2016. The affected vehicles may be equipped with certain C20 and C21 split-shaft transmissions from Waterous. This transmission sends power to the wheels of an emergency response vehicle or power to an add-on unit such as a water pump used for fighting fires. A component within the shift unit may be damaged and as a result, the operator may not be able to switch the power output. If the power output cannot be changed, once the fire truck arrives at the scene, it may not be able to pump water to aid in extinguishing the fire, increasing the risk of injury. Piece will notify owners, and dealers will remove the shift unit assembly and replace the clevis pin and retaining rings, free of charge. The recall began on September 2, 2016. Owners may contact Pierce customer service at 1-888-974-3723. Pierce's number for this recall is 74B277.

16V-585

Kovatch Mobile Equipment Corp. (KME) is recalling certain model year 2013 Predator Panther Rescue, 2013-2014 Predator Aerial, 2013-2016 Predator Pumper, Predator Rescue and Predator SS Aerial, 2014 7600 Tanker and Predator Tractor Drawn Aerial, 2014-2017 Predator Panther Pumper and Predator SS Pumper and 2017 Predator SS Rescue vehicles, equipped with Class 1 Ultraview Touchscreens by Hale Products. These touchscreens may experience false switch activations that can happen without the operator's knowledge, causing accessories to turn on or off. The unintended turning on or off of accessories such as emergency beacons or automatic snow chains can increase the risk of a crash. KME will notify owners, and dealers will reprogram the units, free of charge. The recall is expected to begin in September 2016. Owners may contact KME customer service at 1-800-235-3926 or Hale Products Customer Service Center @ 1-800-533-3569 or halecustomerservice@idexcorp.com.

16V-586

Outdoors RV Manufacturing (ORV) is recalling certain model year 2015-2017 Glacier Peak fifth-wheel travel trailers. The affected trailers have a pin box that may flex resulting in metal fatigue and possibly the separation of the fifth-wheel trailer from the tow vehicle. If the fifth-wheel separates from the tow vehicle there would be an increased risk of a crash. ORV has notified owners, and dealers will inspect the pin box, reinforcing it as necessary, free of charge. The recall began on August 26, 2016. Owners may contact ORV customer service at 1-541-962-1866 extension 222. ORV's number for this recall is 2016-001.

16V-587

Pagani Automobili SpA (Pagani) is recalling certain model year 2014-2016 Huayra vehicles manufactured April 21, 2014, to July 29, 2016. The affected vehicles may experience improper driver side air bag deployment, due

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2016**

Published September 28, 2016

to fastener holes on the steering wheel assemblies not meeting proper tolerances. If there is improper deployment of the air bag, it can increase the risk of injury or death of occupants. Pagani will notify owners, and dealers will change the fasteners on the steering wheel air bag assembly, free of charge. The recall began August 10, 2016. Owners may contact Pagani customer service at 1-415-350-7220.

16V-588

Chrysler (FCA US LLC) is recalling certain model year 2016 Chrysler 200 vehicles manufactured May 24, 2016, to May 25, 2016. Multiple chassis fastener joints may not have been tightened to the proper torque specification. If the chassis fastener joints are improperly torqued they may loosen and fail or fall out, reducing steering and handling capability and increasing the risk of a crash. Chrysler has notified owners, and dealers will inspect the joints and tighten or replace the fasteners, as necessary, free of charge. The recall began on September 2, 2016. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is S59.

16V-589

Chrysler (FCA US LLC) is recalling certain model year 2014-2016 Jeep Cherokee vehicles manufactured July 29, 2013, to February 5, 2016. The seat fasteners on the first or second row seats may not have been tightened to the proper torque specification. Loose fasteners may allow the seats to move, increasing the risk of injury to the seat occupants in the event of a crash. Chrysler will notify owners, and dealers will replace the seats or seat sets, free of charge. The recall is expected to begin during September 2016. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall S63.

16V-590

Temsa Global Sanayi Ve Ticaret A.S. (Temsa) is recalling certain model year 2015-2017 TS 45 motorcoaches manufactured July 25, 2014, to April 21, 2016. Due to insufficient clearance between the twin tires on the rear axle, the tires may rub against each other resulting in their failure. A tire that fails unexpectedly can increase the risk of a crash. Temsa will notify owners, and dealers will replace the steel rims with ones that have a bigger offset, free of charge. The recall began on September 19, 2016. Owners may contact Temsa customer service at 1-407-271-8935.

16V-591

Tadano America Corporation (Tadano) is recalling certain model year 2013-2015 ATF70G-4, ATF100G-4, ATF130G-5, ATF180G-5, ATF220G-5, and ATF400G-6 all-terrain crane trucks manufactured April 1, 2014, to October 9, 2015. The affected vehicles may have an improperly assembled air line connection which may result in a sudden loss of mobility or reduced braking. A loss of air supply resulting in a loss of mobility and reduced braking power can increase the risk of a crash. Tadano has notified owners, and dealers will test all of the air connections, repairing the connections as necessary, free of charge. The recall began on August 30, 2016. Owners may contact Tadano customer service at 1-281-869-0030. Tadano's number for this recall is 21602480.

16V-592

Mazda North American Operations (Mazda) is recalling certain model year 2007-2012 Mazda CX-7 vehicles

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2016**

Published September 28, 2016

manufactured February 14, 2006, to May 9, 2012. In the affected vehicles, water may enter the front suspension ball joint fittings. If the water is contaminated with salt, such as from driving on snowy roads that have been treated, the ball joint may corrode and separate from the lower control arm, resulting in a loss of steering control. A loss of steering control can increase the risk of a crash. Mazda will notify owners, and dealers will replace both front lower control arms, free of charge. Parts are not currently available. Mazda will send interim notices to owners beginning around October 10, 2016. Follow-up notices will be sent when remedy parts are available. As a priority, Mazda will first address all affected 2007-2008 vehicles as well as 2009-2011 vehicles currently registered in Connecticut, Delaware, Illinois, Indiana, Iowa, Kentucky, Maine, Maryland, Massachusetts, Michigan, Minnesota, Missouri, New Hampshire, New Jersey, New York, Ohio, Pennsylvania, Rhode Island, Vermont, Virginia, West Virginia, Wisconsin, and the District of Columbia. The remaining vehicles will be addressed when parts are available. Owners may contact Mazda customer service at 1-800-222-5500. Mazda's number for this recall is 9716H.

16V-593

Mazda North American Operations (Mazda) is recalling certain model year 2009-2010 Mazda6 vehicles manufactured February 4, 2008, to December 3, 2009. The protective coating may not have been properly applied to the air bag control unit (ACU) and, as a result, moisture may damage the unit causing it to malfunction. Failure of the ACU would illuminate the air bag warning light and prevent the air bags from deploying in the event of a crash, increasing the risk of injury. Mazda dealers will replace the ACU, free of charge, however parts are not currently available. Mazda will send interim notifications to owners beginning October 3, 2016 and will mail a second notice when remedy parts are available. Owners may contact Mazda customer service at 1-800-222-5500. Mazda's number for this recall is 9816H.

16V-594

General Motors LLC (GM) is recalling certain model year 2016 Buick Verano vehicles manufactured February 16, 2016, to May 12, 2016, equipped with a 2.0 liter turbocharged engine. The engine fuel line assembly may be misrouted, allowing the fuel line to contact the surface of the engine. If the fuel line contacts the engine, the fuel line may wear, resulting in a fuel leak and increasing the risk of a fire. GM will notify owners, and dealers will replace the fuel line assembly, free of charge. The recall began on August 19, 2016. Owners may contact Buick customer service at 1-800-521-7300. GM's number for this recall is 54180.

16V-595

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain model year 2006-2011 Toyota RAV4 vehicles manufactured October 31, 2005, to September 7, 2010, and 2010 Lexus HS250h vehicles manufactured July 6, 2009, to August 26, 2010. The affected vehicles have rear suspension arms (rear tie rods) with adjusting lock nuts that may have been improperly tightened after servicing. As a result of being loose, the arm may have thread damage and may rust, possibly leading to the failure of the arm and an abrupt change in the vehicle's alignment. Failure of the rear tie rod could cause a loss of vehicle control, increasing the risk of a crash. Toyota will notify owners and dealers will replace both rear suspension arms and encapsulate the locknuts, free of charge. The recall is expected to begin September 30, 2016. Owners may contact Toyota customer service at 1-800-331-4331. Toyota's numbers for this recall are G0V for Toyota vehicles and GLK for Lexus vehicles. Note: This recall supersedes recall 13V-383, in which some vehicles were only inspected, sealed, and did not

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2016**

Published September 28, 2016

have both arms replaced. The affected vehicles were previously recalled under 13V-383, but did not have both rear suspension arms replaced at that time. Those vehicles need to have both arms replaced as part of this recall remedy.

16V-596

Harbor Freight Tools (Harbor Freight) is recalling certain model year 2006-2016 Haul Master trailers, model numbers 90154, 42708, 90153, 66771, 42709, 94564 trailers, and 2013-2016 Haul Master trailers, model numbers 62170, 62209, 61730, and 69897. The affected trailers may be equipped with trailer lights that fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." The trailers may be less visible to other drivers, increasing the risk of a vehicle crash. Harbor Freight will notify owners and will provide them with a new tail light package, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Harbor Freight customer service at 1-805-388-1000.

16V-597

Winnebago Industries, Inc (Winnebago) is recalling certain model year 2014-2017 Itasca Cambria, 2015-2017 Winnebago ERA, Travato, Fuse, Aspect, and Vista recreational vehicles, and 2015-2016 Itasca Sunstar recreational vehicles manufactured May 6, 2014, to April 22, 2016. The affected vehicles have a power cord connection to the automatic transfer switch (ATS) that may not be properly tightened. A loose power connection may cause a build up of heat at the connection, increasing the risk of a fire. Winnebago will notify owners, and dealers will tighten the power cord connection, replacing the ATS box and switch, as necessary. These repairs will be performed free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Winnebago customer service at 1-800-537-1885.

16V-598

Autocar Industries, LLC (Autocar) is recalling certain model year 2016-2017 Xspotter vehicles manufactured August 3, 2015, to April 21, 2016. The steering column shaft weld may break causing a separation of the steering wheel from the steering system, creating a loss of steering ability. A loss of steering ability increases the risk of a crash. Autocar will notify owners, and dealers will inspect the steering columns and replace them as necessary, free of charge. The recall is expected to begin October 7, 2016. Owners may contact Autocar customer service at 1-888-218-3611. Autocar's number for this recall is ACTT-1601.

16V-599

Keystone RV Company (Keystone) is recalling certain model year 2011-2017 Bullet and Passport recreational trailers. The affected vehicles are equipped with an air conditioner LCD thermostat that may not be properly wired. If the thermostat is wired improperly, any damage to the thermostat wiring may result in an electrical short, increasing the risk of a fire. Keystone will notify owners, and dealers will correct the wiring at the air conditioner control box, free of charge. The recall is expected to begin in September 2016. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 16-261.

16V-600

Spartan Motors USA (Spartan) is recalling certain model year 2014-2016 Legend and Star fire trucks

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2016**

Published September 28, 2016

manufactured April 15, 2015, to April 16, 2016. The affected vehicles may be equipped with certain C20 and C21 split-shaft transmissions from Waterous. This transmission sends power to the wheels of an emergency response vehicle or powers an add-on unit such as a water pump used for fighting fires. A component within the shift unit may be damaged and as a result, the operator may not be able to switch the power output. If the power output cannot be changed, once the fire truck arrives at the scene, it may not be able to pump water to aid in extinguishing the fire, increasing the risk of injury. Spartan will notify owners, and dealers will replace the retaining clevis pin and retaining rings, free of charge. The recall is expected to begin in September 2016. Owners may contact Spartan customer service at 1-800-543-5008. Spartan's number for this recall is 16021.

16V-601

Mercedes-Benz USA, LLC (MBUSA) is recalling certain model year 2016 GLE Coupe 450 AMG 4Matic vehicles manufactured July 11, 2015, to July 25, 2015. The affected vehicles may be equipped with rear head restraints that may not stay locked in the upright position at very low temperatures. If the vehicle is involved in a crash in very low temperatures, the rear head restraints may not function as intended, increasing the risk of rearseat occupant injury. MBUSA will notify owners, and dealers will replace the rear head restraints, free of charge. The recall is expected to begin in October 2016. Owners may contact MBUSA customer service at 1-800-367-6372.

16V-602

Mercedes-Benz USA, LLC (MBUSA) is recalling certain model year 2016 GLC 300 SUV, GLC 300 4Matic SUV, C300 Sedan and C300 4Matic vehicles manufactured February 8, 2016, to May 18, 2016. The affected vehicles may be equipped with an Electronic Stability Program (ESP) control unit that may have been damaged before being installed. A damaged ESP control unit may inadvertently activate the stability control altering the vehicle's path. Additionally, the electronic parking brake may not function. Either condition may increase the risk of a crash. MBUSA will notify owners, and dealers will replace the ESP Hydraulic control units, free of charge. The recall is expected to begin in October 2016. Owners may contact MBUSA customer service at 1-800-367-6372.

16V-603

REV Ambulance Group Orlando, INC. (REV) is recalling certain model year 2010-2016 Road Rescue Specialty Vehicle, Ultramedic, Promedic, Duramedic, Metromedic and Transmedic emergency vehicles manufactured January 1, 2010, to May 1, 2016. These vehicles are equipped with certain Class 1 ES-Key power control modules manufactured by Hale Products. The affected power control modules may not provide sufficient circuit protection depending on their combination of software and installation, possibly resulting in a short circuit. A short circuit may result in damage to components of the vehicle's electrical system, affecting their function such as causing a loss of headlights, increasing the risk of a crash. A short circuit may also increase the risk of a fire. REV will notify owners, and dealers will upgrade the software or retrofit fuses, free of charge. The recall is expected to begin in September 2016. Owners may contact REV customer service at 1-800-628-8178 or Hale Products Customer Service Center at 1-800-533-3569 or halecustomerservice@idexcorp.com. REV's number for this recall is Recall #16-E038.

16V-605

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2016**

Published September 28, 2016

Kovatch Mobile Equipment Corp. (KME) is recalling certain model year 2012-2013 Predator Pumper, Predator Panther Pumper and Predator Aerial, 2013 Predator Panther Aerial and Predator Rescue and 2012 Predator Panther Tanker emergency vehicles. In the affected vehicles, the front grille may loosen and separate from the cab face. If the front grille detaches from the vehicle while driving, it could become a road hazard, increasing the risk of a crash. All the vehicles affected in this campaign have been remedied. Therefore, an owner notification will not be issued. Owners may contact KME customer service at 1-570-669-5577.

16V-606

Chicago Scooter Company (Chicago Scooter) is recalling certain model year 2016-2017 go. scooters manufactured September 22, 2015, to May 13, 2016. These scooters have front wheel bearings that may fail, adversely affecting handling. Front wheel bearing failure may result in a loss of control of the scooter, increasing the risk of a crash. Chicago Scooter will notify owners, and dealers will replace the entire front wheel, free of charge. The recall is expected to begin in September 2016. Owners may contact Chicago Scooter customer service at 1-773-433-1311 or by email at recall@chicagoscootercompany.com.

16V-607

Keystone RV Company (Keystone) is recalling certain model year 2017 Cougar recreational trailers, models CG28SGS17, CG28RDB17, CG28RKS17, CG29RES17, CG29RLI17 and CG28DBI17, manufactured July 15, 2016, to August 3, 2016. The affected trailers have a Federal Identification Tag and Tire and Loading Information Label with incorrect information. Additionally, tires with the wrong load range may have been installed. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." If tires of an incorrect load range are installed, tire failure may result, possibly causing a loss of vehicle control, and increasing the risk of a crash. Keystone has notified owners, and dealers will replace the tires and/or Federal Identification Tag if it is incorrect, free of charge. The recall began on September 9, 2016. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 16-262.

16V-609

Zero Motorcycles Inc. (Zero) is recalling certain model year 2015 SR, S, DS, and FX motorcycles. The affected motorcycles have a DC-DC converter that may have insufficient output power. During high power demand, the anti-lock brake system (ABS) may not function properly. If the converter power output is insufficient, during an ABS activated event, the ABS and all vehicle lights would temporarily stop functioning, increasing the risk of a crash. Zero has notified owners, and dealers will inspect the DC-DC converters, replacing ones of a specific type as necessary, free of charge. The recall began on September 16, 2016. Owners may contact Zero customer service at 1-888-841-8085. Zero's number for this recall is SV-ZMC-016-356.

16V-610

Morbark, Inc. (Morbark) is recalling certain model year 2009-2016 Beaver wood chipper trailers manufactured January 5, 2009, to August 3, 2016. The affected trailers are missing reflex reflectors. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." Without reflectors, the wood chipper trailer may be less visible to other traffic, increasing the risk of a crash. Morbark will notify owners and provide them with reflectors to

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2016**

Published September 28, 2016

install, free of charge. The recall is expected to begin October 3, 2016. Owners may contact Morbark customer service at 1-517-866-2381.

16V-611

Morbark Inc. (Morbark) is recalling certain model year 2013-2016 Beaver M15R wood-chipper trailers manufactured February 6, 2013, to August 3, 2016, and Beaver M20R wood-chipper trailers manufactured January 5, 2009, to August 3, 2016. The stop lights and tail lights on the affected vehicles may be located too high to be easily seen. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." Rear lights that cannot easily be seen increase the risk of a crash. Morbark will notify owners and dealers will install a kit that repositions the lights, free of charge. The recall is expected to begin October 11, 2016. Owners may contact Morbark customer service at 1-517-866-2381.

16V-612

Jumping Jack, Inc. (Jumping Jack) is recalling certain model year 2014-2015 utility trailers, in sizes Standard 6'x8' and Mid 6'x12', manufactured August 15, 2014, to August 31, 2015. The torsion arm of the axle assembly was made too small for its housing, and as a result, the torsion arm, spindle, and tire and wheel assemblies may detach from the trailer. A separation of the torsion arm can result in a reduction in vehicle stability, increasing the risk of a crash. Jumping Jack will notify owners and provide a free replacement torsion axle. Owners can either preform the repair themselves or, if needed, Jumping Jack will assist owners to find a repair shop. Repairs will be made free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Jumping Jack customer service at 1-801-520-5310.

16V-613

Jaguar Land Rover North America, LCC (Land Rover) is recalling certain model year 2015 Discovery Sport manufactured September 17, 2014 through November 3, 2014 and 2014-2015 Range Rover Evoque vehicles manufactured July 15, 2013 through July 1, 2015. In the affected vehicles the transmission sensor clusters may have insufficient crimps in the transmission wire harness, and as a result, the transmission may unexpectedly shift to neutral. If the vehicle unexpectedly shifts to neutral, there is an increased risk of a crash. Land Rover will notify owners, and dealers will inspect the automatic transmission serial number and if required, will update the transmission software to prevent the transmission from shifting into neutral due to a faulty crimp, free of charge. The recall is expected to begin on October 14, 2016. Owners may contact Land Rover customer service at 1-800-637-6837. Land Rover's number for this recall is P091.

16V-614

Hyundai Motor Company (Hyundai) is recalling certain model year 2016 Sonata vehicles manufactured March 28, 2016 through April 12, 2016. The affected vehicles have a driver-side frontal air bag that may not adequately protect the driver's neck from injury in the event of a crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 208, "Occupant Crash Protection." A frontal air bag that does not adequately protect the driver's neck may increase their risk of injury in the event of a crash. Hyundai will notify owners, and dealers will replace the driver's frontal air bag module, free of charge. The recall is expected to begin October 14, 2016. Owners may contact Hyundai customer

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2016**

Published September 28, 2016

service at 1-800-633-5151. Hyundai's number for this recall is 148.

16V-615

Eldorado National-Kansas (Eldorado National) is recalling certain model year 2011-2016 Aero Elite 300 and 320 vehicles manufactured June 27, 2011, to June 9, 2016 and built on Ford and Navistar chassis. The intermediate side lamps may not stay illuminated when the headlights are on. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." If the side marker lamps do not stay illuminated when the headlights are activated, it can decrease the vehicle's visibility to other drivers, increasing the risk of a crash. Eldorado National will notify owners, and dealers will inspect the intermediate side lamps, replacing them as necessary, free of charge. The recall is expected to begin in September 2016. Owners may contact Eldorado National customer service at 1-800- 955-4236 or by email at bussupport@eldorado-bus.com.

16V-616

Ford Motor Company (Ford) is recalling certain model year 2017 Ford Escape Titanium and SE vehicles manufactured October 5, 2015, to May 12, 2016. The settings for the closing-force of the power-operated windows may allow the windows to close on an object such as a body part and injure it before the windows auto-reverse. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 118, "Power-Operated Window Systems." If a window closes on a body part, it can increase the risk of injury. Ford has notified owners, and dealers will update the power window operating system software, free of charge. The recall began on September 6, 2016. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 16C12.

16V-617

Ford Motor Company (Ford) is recalling certain model year 2015-2016 Transit vehicles manufactured July 15, 2015, to April 14, 2016 and equipped with a 3.2L diesel engine. A fuel injector or the fuel volume control valve may clog due to metallic debris within the fuel system. If debris clogs the fuel system, the engine may stall, increasing the risk of a crash. Ford will notify owners, and dealers will replace the fuel injection pump and associated parts and, if necessary, will replace the fuel filter and flush the fuel system, free of charge. The recall is expected to begin October 10, 2016. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 16S32.

16V-618

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain model year 2010-2013 Audi A8 vehicles manufactured May 15, 2010, to May 14, 2012. The affected vehicles have a coolant valve that may leak, allowing coolant to enter the engine control module causing a loss of power or the engine to stall. A vehicle stall increases the risk of a crash. Audi will notify owners, and dealers will replace the coolant valve and inspect for coolant that has leaked through the electrical connector, free of charge. The recall is expected to begin October 19, 2016. Owners may contact Audi customer service at 1-800-253-2834.

16V-619

Seagrave Fire Apparatus, LLC (Seagrave) is recalling certain model year 2015-2016 Marauder II fire trucks

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2016**

Published September 28, 2016

manufactured April 9, 2015, to April 20, 2016. The affected vehicles may be equipped with certain C20 and C21 split-shaft transmissions from Waterous. This transmission sends power to the wheels of an emergency response vehicle or powers an add-on unit such as a water pump used for fighting fires. A component within the shift unit may be damaged and as a result, the operator may not be able to switch the power output. If the power output cannot be changed, once the fire truck arrives at the scene, it may not be able to pump water to aid in extinguishing the fire, increasing the risk of injury. Seagrave will notify owners, and dealers will remove the shift unit assembly and replace the clevis pin and retaining rings, free of charge. The recall began on August 26, 2016. Owners may contact Seagrave customer service at 1-715-823-1910 or by email at service@seagrave.com. Seagrave's number for this recall is 16E059.

16V-620

Ford Motor Company (Ford) is recalling certain model year 2013-2015 Ford Taurus, Ford Flex, Lincoln MKS and Lincoln MKT vehicles equipped with 3.5L GTDI EcoBoost engines and 2013-2015 Ford Taurus Police Interceptor vehicles. A component within the fuel pump electric module (PEM) may overheat causing a loss of electrical power to the fuel pump. A loss of power to the fuel pump will cause the engine to stall or prevent the vehicle from starting, increasing the risk of a crash. Ford will notify owners, and dealers will inspect the fuel PEM part number and replace the fuel PEM, as necessary, free of charge. An interim notification was mailed to owners on September 15, 2016. A second notice will be mailed when parts become available. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 16S31.

16V-621

Bison Coach, LLC (Bison) is recalling certain model year 2015-2016 Premiere, Silverado, Laredo, Ranger, Trail Hand, and Trail Boss gooseneck horse trailers. The affected trailers do not have an inline fuse installed on the battery cable. In the event of an electrical short circuit, the battery wiring could overheat, increasing the risk of a fire. Bison has notified owners, and dealers will install a 30-amp inline fuse on the battery cable, free of charge. The recall began on September 15, 2016. Owners may contact Bison customer service at 1-574-658-4161. Bison's number for this recall is 9010.

16V-622

Tiffin Motorhomes (Tiffin) is recalling certain model year 2017 Allegro Open Roads vehicles manufactured June 7, 2016, to August 15, 2016. The affected vehicles have a driver-side wiper arm that may sweep off of the edge of the windshield, when trying to return, the wiper arm may break. A broken windshield wiper may reduce the driver's visibility, increasing the risk of a crash. Tiffin will notify owners, and dealers will replace the driver-side wiper pivot shaft and extending linkage, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Tiffin customer service at 1-256-356-8661. Tiffin's number for this recall is TIF-102.

16V-623

Midwest Fire Equipment & Repair (Midwest Fire) is recalling certain model year 2016-2017 All-Poly 2500 series and All-Poly 3000 series fire trucks manufactured October 6, 2015, to April 28, 2016. The affected vehicles may be equipped with certain C20 and C21 split-shaft transmissions from Waterous. This transmission sends power to the wheels of an emergency response vehicle or powers an add-on unit such as a water pump

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2016**

Published September 28, 2016

used for fighting fires. A component within the shift unit may be damaged and as a result, the operator may not be able to switch the power output. If the power output cannot be changed, once the fire truck arrives at the scene, it may not be able to pump water to aid in extinguishing the fire, increasing the risk of injury. Midwest Fire will notify owners, and dealers will remove the shift unit assembly and replace the clevis pin and retaining rings, free of charge. The recall began on September 1, 2016. Owners may contact Midwest Fire customer service at 1-800-344-2059.

16V-624

Halcore Group, Inc. (Halcore) is recalling certain model year 2013-2016 Horton ambulances, models 453, 457, 503, 553, 603, and 623, manufactured November 29, 2013, to March 1, 2016. The affected vehicles may have an improperly sealed Cool-Tech air-conditioning condenser controller wire harness that can allow water to enter the controller housing. If water gets into the controller housing, the controller may short circuit, increasing the risk of an electrical fire. Halcore will notify owners, and dealers will replace the Cool-Tech condenser fan controller assembly, free of charge. Halcore issued an interim notification to owners on September 9, 2016. The recall is expected to begin in September 2016. Owners may contact Horton customer service at 1-614-317-9856, or by email at warranty@hortonambulance.com

16V-625

Kovatch Mobile Equipment Corp. (KME) is recalling certain model year 2015-2016 Predator SS Pumper vehicles manufactured January 17, 2015, to July 21, 2015, and 2014-2016 FDNY Pumper vehicles manufactured May 21, 2014, to July 27, 2015. The affected vehicles may have replacement drive shafts that may twist and fail during use. Failure of the driveshaft may leave the fire truck immobilized in traffic, increasing the risk of a crash. Additionally, the truck may not be able to respond to an emergency, increasing the chances of injury for those at risk. KME has notified owners, and dealers replaced the drive shafts, free of charge. All affected vehicles have been remedied, free of charge. Owners may contact KME customer service at 1-800-235-3926.

16V-626

Triple E Recreational Vehicles (Triple E) is recalling certain model year 2016 Unity motorhomes, model U24X, manufactured October 15, 2015, to June 16, 2016. The affected vehicles have a showerhead that can be lowered into the shower pan or sink basin. In the event of a waste water backup, a submerged showerhead may syphon the waste water, possibly contaminating the fresh water supply, increasing the risk of injury. Triple E will notify owners, and dealers will install two guide rings to prevent the shower head from lowering into the shower pan or sink basin, free of charge. The recall began on September 23, 2016. Owners may contact Triple E customer service at 1-877-992-9906. Triple E's number for this recall is CA #8368-1.

16V-627

Hyundai Motor Company (Hyundai) is recalling certain model year 2016 Tucson vehicles manufactured May 20, 2015 through May 31, 2016 and equipped with a 7-speed EcoShift Dual Clutch Transmission. Certain driving conditions and high temperatures may cause the vehicle to not move if the accelerator pedal is pressed and released repeatedly. Inability to move the vehicle while in traffic may increase the risk of a crash. Hyundai will notify owners, and dealers will update the Transmission Control Module software, free of charge. The recall is

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2016**

Published September 28, 2016

expected to begin on October 28, 2016. Owners may contact Hyundai customer service at 1-855-371-9460. Hyundai's number for this recall is 149.

16V-628

Daimler Trucks North America LLC (DTNA) is recalling certain model year 2015-2017 Thomas Built Buses Safe-T-Liner C2, Saf-T-Liner HDX, Saf-T-Liner EFX, and Minotour DRW school buses manufactured July 15, 2014, to July 21, 2016, and equipped with certain model S2005, S2010, S5005, S5010, S5505, and S5510 wheelchair lifts by Ricon. The affected lifts are equipped with folding link arms that may have pivot holes that are too big, allowing the bearings to move out of position. If the bearings move out of position, the stowed platform may have excessive movement resulting in failure of the platform mounting. This failure could cause the wheel chair lift platform to fall out of the vehicle when the doors are opened, increasing the risk of injury for the lift operator. DTNA will notify owners, and Ricon dealers will inspect the link arms for damage or for displaced bearings. The platform will be inspected for cracks. Any damaged parts will be replaced, free of charge. The recall is expected to begin October 27, 2016. Owners may contact DTNA customer service at 1-800-547-0712, or Ricon customer service at 1-800-322-2884 or by email at admin16E020@wabtec.com. DTNA's number for this recall is FL-716.

16V-629

Hyundai Motor Company (Hyundai) is recalling certain model year 2007-2008 Azera vehicles manufactured March 7, 2007 through August 14, 2007. In the affected vehicles, the power-adjustable front driver seat may unexpectedly move without the driver's input while the vehicle is being driven. Unintentional movement of the driver's seat may affect the driver's ability to control the vehicle, increasing the risk of a crash. Hyundai will notify owners, and dealers will replace the power-adjustable seat switch, free of charge. The recall is expected to begin on October 28, 2016. Owners may contact Hyundai customer service at 1-855-371-9460. Hyundai's number for this recall is 150.

16V-630

Daimler Trucks North America LLC (DTNA) is recalling certain model year 2015-2017 Thomas Built Buses Saf-T-Liner C2, and Saf-T-Liner HDX transit buses manufactured July 15, 2014, to July 21, 2016, and equipped with certain model S2005, S2010, S5005, S5010, S5505, and S5510 wheelchair lifts by Ricon. The affected lifts are equipped with folding link arms that may have pivot holes that are too big, allowing the bearings to move out of position. If the bearings move out of position, the stowed platform may have excessive movement resulting in failure of the platform mounting. This failure could cause the wheel chair lift platform to fall out of the vehicle when the doors are opened, increasing the risk of injury for the lift operator. DTNA will notify owners, and Ricon dealers will inspect the link arms for damage or for displaced bearings. The platform will be inspected for cracks. Any damaged parts will be replaced, free of charge. The recall is expected to begin October 27, 2016. Owners may contact DTNA customer service at 1-800-547-0712, or Ricon customer service at 1-800-322-2884 or by email at admin16E020@wabtec.com. DTNA's number for this recall is FL-716.

16V-631

PACCAR Incorporated (PACCAR) is recalling certain model year 2013 Peterbilt 367 trucks, manufactured April 18, 2012, to June 29, 2012. The affected vehicles may be equipped with a certification label that has

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2016**

Published September 28, 2016

incorrect gross axle weight rating (GAWR) and gross vehicle weight rating (GVWR) information. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." Incorrect GAWR and GVWR information can result in the vehicle being overloaded, increasing the risk of a crash. Peterbilt will notify owners, and dealers will replace the certification labels, free of charge. The recall began on September 21, 2016. Owners may contact Peterbilt customer service at 1-940-591-4000. PACCAR's number for this recall is 816-D.

16V-632

PACCAR Incorporated (PACCAR) is recalling one model year 2017 Peterbilt 567 truck manufactured April 26, 2016. The affected vehicle has a left-hand rail-mounted trailer air and electric bracket that protrudes upward, becoming a tripping hazard. Tripping on the bracket or associated connections could increase the risk of injury in the event of a fall from the top of the vehicle frame. Peterbilt will notify the owner, and an authorized dealer will move the air and electric connections from the left hand rail to the right hand rail, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Peterbilt customer service at 1-940-591-4000. PACCAR's number of this recall is 816-E.

16V-633

Daimler Trucks North America LLC (DTNA) is recalling certain model year 2014-2017 Freightliner M2 Business Class, 108 SD, 114 SD, Cascadia, Coronado, Western Star 4700, 4800, and 5700 XE trucks manufactured March 15, 2013, to July 29, 2016 and equipped with Conmet aluminum non-high capacity hubs. These vehicles specify a front axle weight limit that may be greater than that of the hub capacity. As a result, the hub may fail and the wheel may separate from the axle. If a wheel separates from the axle, there would be an increased risk of a crash. DTNA will notify owners, and dealers will replace the front axle hubs, free of charge. The recall is expected to begin October 27, 2016. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-718.

16V-634