

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2018**

Published September 26, 2018

CHILD SEATS:

None during August 2018.

EQUIPMENT:

H&H Sports Protection (H&H Sports) is recalling certain VCAN V531 motorcycle helmets in sizes XS, S, M, L, XL, and XXL. The helmet straps may not be properly sewn and, as a result, the helmets may not stay secured to the rider's head in the event of a crash. Additionally, the labels have an incorrect manufacturer's name. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 218, "Motorcycle Helmets." A helmet that does not remain secured to the rider's head will not adequately protect the wearer in the event of a crash, increasing the risk of injury. The affected helmets were sold through Amazon. H&H Sports will notify the owners, and instruct them to return the helmets to Amazon. A complete refund of the purchase price and shipping costs will be provided free of charge. Owners may contact Amazon customer service at 1-888-280-4331 or H&H Sports customer service at 1-626-444-0107 or by email at V531Recall@HHsportsprotection.com.

18E-074

Dexter Axle Company (Dexter) is recalling certain Dexter Trailer Axles, part number D30/#10L. Incorrect tapered roller bearings may have been installed. The incorrect bearings may overheat or fail prematurely, increasing the risk of a crash. Dexter has notified the manufacturers that purchased the affected axles and those manufacturers will conduct recalls to have their dealers inspect and replace the bearings, free of charge. The recall began on June 20, 2018. Owners may contact Dexter customer service at 1-574-295-7888.

18E-075

Freedman Seating Company (Freedman) is recalling certain Freedman GO-ES Foldaway Seats, part numbers 43705, 45467, 48923, and 75719. When the back seat cushion is rotated from the stowed position to the upright position, the seat cushion may not remain locked into place when under load, such as in a crash or a sudden stop. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 207, "Seating Systems," and number 210, "Seat Belt Assembly Anchorages." In the event of a crash, if the seat back moves, the seat occupant has an increased risk of injury. Freedman will notify affected the vehicle builders, and dealers for those manufacturers will inspect and repair the foldaway seat, free of charge. Owners may contact Freedman customer service at 1-800-443-4540.

18E-076

Honda (American Honda Motor Co.) is recalling certain Honda Genuine Accessory Centerstand Kits, part number 08M70-MJP-G50, sold for possible installation on 2016-2018 Africa Twin motorcycles. The circlip can break allowing the centerstand to detach. If the centerstand detaches while moving, it can become a road hazard, increasing the risk of a crash. If the centerstand detaches while the motorcycle is parked on the centerstand, the motorcycle can fall over, increasing the risk of injury. Honda will notify all registered owners of 2016-2018 Honda Africa Twins advising them that if they purchased the affected centerstand kit, not to use it and to take the motorcycle to a dealer. Dealers will replace the circlip and washer, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Honda customer service at 1-

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2018**

Published September 26, 2018

866-784-1870. Honda's number for this recall is KJ5.

18E-078

Hale Products Inc (Hale) is recalling certain Kubota Diesel Powered Portable Pumps, part number 200779, revisions A through C. These pumps may be improperly wired, causing the Oil Pressure and Temperature warning lamps to not illuminate when needed. If the warning lamps are not operable, the user may not be warned that there is a problem with the pump's engine. Failure of the pump's engine may inhibit the ability to contain a fire, increasing the risk of injury. Hale will notify the vehicle manufacturers that purchased the pumps, and dealers for those manufacturers will reverse the wires leading to the warning/indicators or provide a plug-in wire harness, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Hale customer service at 1-800-533-3569. Hale's number for this recall is SB-166.

18E-079

TRW Automotive Inc (TRW) is recalling certain Outer Tie Rods, part number JTE7042, sold as replacement parts for certain 1988-2000 General Motors vehicles. The locking nut on these outer tie rod assemblies may not lock as designed, allowing the tie rod to separate and cause a loss of steering. A loss of steering can increase the risk of a crash. TRW will notify their distributors and the known owners, and will refund the owners for the returned parts, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact TRW customer service at 1-248-863-2437.

18E-080

Cummins Inc. (Cummins) is recalling certain ISX15 diesel engines, part number D103012BX03, and X15 diesel engines, part number D103016BX03. These engines have nylon fuel lines and were built with a banjo bolt containing an integrated single screen filter on the fuel pump. The fuel pump cooling circuit screens may become restricted by debris from filtration material causing the fuel line to burst when the vehicle is operated under certain driving conditions, such as on a long down-hill grade. If the fuel line bursts, a significant amount of fuel may leak onto the road resulting in a roadway hazard for other motorists. The engine may also stall, increasing the risk of a crash. The remedy for this recall is still under development. The recall is expected to begin on October 9, 2018. Owners may contact Cummins customer service at 1-800-286-6467.

18E-081

Akoury is recalling certain AK AK88S motorcycle helmets, sizes XS, S, M, L, and XL. These helmets may not adequately protect the wearer in the event of a head impact during a motorcycle crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 218, "Motorcycle Helmets." A helmet that does not adequately protect the wearer from an impact can increase the risk of injury in the event of a crash. Akoury will notify owners, and will provide a replacement helmet or provide a refund, free of charge. The recall is expected to begin October 1, 2018. Owners may contact Akoury customer service at 1-514-824-0666. Akoury's number for this recall is REC2015.

18E-082

Hickory Springs Manufacturing Company (HSM) is recalling certain NextGen School Bus seats with Integrated Child Restraint Systems. These seats may be missing a warning label on the lower restraint strap. As such, these

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2018**

Published September 26, 2018

vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 213, "Child Restraint Systems." Without a warning label, the seat may be used improperly, increasing the risk of injury. HSM will notify the vehicle manufacturers that purchased the seats and dealers for those companies will install a warning label to the lower restraint strap portion of the Restraint Belt System. The recall began August 20, 2018. Owners may contact HSM customer service at 1-419-492-2157 extension 243.

18E-083

Allison Transmission, Inc. (Allison) is recalling certain H 50 EP, H 40 EP, H 50 Cert, and H 40 Cert Drive Units. The pressure switches on these Drive Units may fail, possibly resulting in a loss of drive. A loss of drive can disable the vehicle unexpectedly, increasing the risk of a crash. Allison will notify the vehicle manufacturers that purchased the affected transmissions, and dealers will replace the C1 and C2 pressure switches, free of charge. Owners may contact Allison customer service at 1-800-252-5283.

18E-085

Webasto Charging Systems, Inc (Webasto) is recalling certain AeroVironment TurboCord and TurboDock/TurboDX electric vehicle charging systems. Capacitors within these charging systems may fail, possibly resulting in a shock hazard or a fire. An electrical shock or a fire can increase the risk of injury or death. Webasto will notify owners, and field service representatives will replace all TurboCord and TurboDock/TurboDX charging systems, free of charge. Owners may contact Webasto customer service at 1-888-516-6264.

18E-086

Dexter Axle Company (Dexter) is recalling certain D44 trailer axles with a 4400 pound capacity. These axles may be missing inner bearing races on the hubs, which can cause the bearing to fail or the hub to overheat. The wheel hub may overheat and smoke, increasing the risk of a fire or the bearing may fail, affecting handling and increasing the risk of a crash. Dexter Axle will notify the axle purchasers, and dealers for those vehicle manufacturers will replace the hubs with new hubs, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Dexter Axle customer service at 1-574-295-7888.

18E-087

TIRES:

Bridgestone Americas Tire Operations, LLC (BATO) is recalling certain Firestone FS818 tires with date codes 2318-2418, Bridgestone M854 tires with date codes 2418-2518, Bridgestone M860A tires with date code 2518, and Bridgestone M864 tires with date codes 2318-2418, all of size 425/65R22.5. The sidewall steel body cords may be exposed, which can cause unexpected rapid air loss during use. As such, these tires may fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 119, "New Pneumatic Tires - Other than Passenger Cars." Rapid air loss can increase the risk of a crash. BATO will notify owners, and replace the tires with a comparable replacement, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact BATO customer service at 1-800-847-3272.

18T-011

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2018**

Published September 26, 2018

VEHICLES:

Newmar Corporation (Newmar) is recalling certain 2017-2019 Newmar Ventana LE and Ventana motorhomes, 2018 Mountain Aire and Essex motorhomes, and 2017-2018 London Aire motorhomes. The brake caliper mounting bolts on these vehicles may be insufficiently tightened, allowing the bolts to loosen. If the brake caliper mounting bolts loosen, braking performance may be reduced, increasing the risk of a crash. Newmar will notify owners, and authorized Daimler Trucks service centers will inspect the caliper mounting bolts and tighten them to the proper specification, free of charge. The recall began on August 30, 2018. Owners may contact Newmar customer service at 1-800-731-8300. Newmar's number for this recall is 18V-353.

18V-505

Thor Motor Coach (TMC) is recalling certain 2017-2018 Thor Aria motorhomes and 2017-2019 Thor Venetian motorhomes. The brake caliper mounting bolts on these vehicles may be insufficiently tightened, allowing the bolts to loosen. If the brake caliper mounting bolts loosen, braking performance may be reduced, increasing the risk of a crash. TMC will notify owners, and authorized Daimler Trucks service centers will inspect the caliper mounting bolts and tighten them to the proper specification, free of charge. The recall began September 4, 2018. Owners may contact TMC customer service at 1-877-855-2867. TMC's number for this recall is RC000159.

18V-507

Subaru of America, Inc. (Subaru) is recalling certain 2019 Subaru Ascent vehicles. These vehicles may be missing spot welds on, or around, the B-Pillar, compromising vehicle strength. In the event of a crash, the missing spot welds may compromise the vehicle's strength, increasing the risk of injury. Subaru will notify owners, and dealers will inspect the vehicle to check for missing spot welds. If the welds are missing, the vehicle will be replaced, free of charge. The recall began July 31, 2018. Owners may contact Subaru customer service at 1-844-373-6614. Subaru's number for this recall is WTU-80.

18V-508

General Motors LLC (GM) is recalling certain 2018 Chevrolet Express and GMC Savana vehicles with certain combinations of front-tire and gross-vehicle-weight option codes. The Tire Pressure Monitoring System (TPMS) may be incorrectly calibrated, causing the TPMS warning lamp to illuminate when tire pressure reaches 37 PSI, not 41 PSI. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 138, "Tire Pressure Monitoring Systems." If the low tire pressure telltale is not illuminated at the correct tire pressure, the driver may have less time to react to a low-tire-pressure situation, which could affect the driver's ability to control the vehicle in certain situations and could increase the risk of a crash. GM will notify owners, and dealers will check the PSI information on the remote control door lock receiver (RCDLR) and tire placard match, and if the information is different the RCDLR will be reprogrammed. This repair will be done free of charge. The recall began August 27, 2018. Owners may contact Chevrolet customer service at 1-800-222-1020, or GMC customer service at 1-800-462-8782. GM's number for this recall is 18255.

18V-509

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2018**

Published September 26, 2018

Gillig LLC (Gillig) is recalling certain 2012-2018 Gillig Low Floor vehicles. The front and rear turn signals on these vehicles may flash at different rates, potentially confusing other drivers of the vehicle's intention. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." The mismatched flashing may confuse other drivers, increasing the risk of a crash. Gillig will notify the owner of the buses, and dealers will reprogram the turn signals with new software, free of charge. The recall began August 30, 2018. Owners may contact Gillig customer service at 1-510-264-5073 or 1-800-735-1500.

18V-511

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2018 GLE350, GLE350 4Matic, and GLE43 AMG vehicles. During manufacturing, components of the panoramic sunroof may have been installed with a bonding primer that was incorrectly made, possibly affecting the long-term adhesion to the vehicle. If the front cover and/or rear fixed glass are not properly adhered, they may detach, creating a road hazard and increasing the risk of a crash. MBUSA will notify owners, and dealers will inspect the panoramic sunroof, replace it if necessary, free of charge. The recall began September 7, 2018. Owners may contact MBUSA customer service at 1-800-367-6372. MBUSA's number for this recall is 2018080006.

18V-512

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2018 Mercedes-Benz E400 Cabrio and E400 4Matic Cabrio vehicles. The child seat anchoring system (ISOFIX) in these vehicles may not have been properly installed. As a result, in the event of a crash, the ISOFIX console may partially detach from the car body. If the ISOFIX console partially detaches in a crash, it can increase the risk of injury for a child in a child seat. MBUSA will notify owners, and dealers will inspect the ISOFIX console, and replace it if necessary, free of charge. The recall is expected to begin October 3, 2018. Owners may contact MBUSA customer service at 1-800-367-6372.

18V-513

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2018 Mercedes-Benz CLA250, CLA250 4Matic, and CLA45 AMG 4Matic vehicles. The Occupant Classification System (OCS) may not be properly calibrated, resulting in the front passenger air bag not being deactivated if a child seat is in the front seat. If a child seat is in the front seat and the passenger air bag is not deactivated, in the event of a crash, it can increase the risk of injury. MBUSA will notify owners, and dealers will replace the front passenger seat cushion, free of charge. The recall is expected to begin October 3, 2018. Owners may contact MBUSA customer service at 1-800-367-6372.

18V-514

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2018 Mercedes-Benz E300, E300 4Matic, E43 AMG 4Matic, E400 4Matic, E63S AMG 4Matic+, and 2019 CLS450 4Matic vehicles. The Occupant Classification System (OCS) may not be properly calibrated, resulting in the front passenger air bag not being deactivated if a child seat is in the front seat. If a child seat is in the front seat and the passenger air bag is not deactivated, in the event of a crash, it can increase the risk of injury. MBUSA will notify owners, and dealers will replace the front passenger seat cushion, free of charge. The recall is expected to begin October 3, 2018.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2018**

Published September 26, 2018

Owners may contact MBUSA customer service at 1-800-367-6372.

18V-515

Corp. Micro Bird Inc. (Micro Bird) is recalling certain 2015-2018 Micro Bird G5, MB II, and T-Series school buses. During manufacturing, the seat belt anchorage plate may not have been correctly attached to the wall, limiting the capacity of the shoulder belt to restrain a passenger in the event of a crash. If the belt anchorage plate detaches from the wall and cannot properly restrain a passenger it can increase the risk of injury. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Micro Bird customer service at 1-819-477-2012. Micro Bird's number for this recall is 18-075-CUS.

18V-516

Corp. Micro Bird Inc. (Micro Bird) is recalling certain 2015-2018 Micro Bird G5, MB II, and T-Series transit buses. During manufacturing, the seat belt anchorage plate may not have been correctly attached to the wall, limiting the capacity of the shoulder belt to restrain a passenger in the event of a crash. If the belt anchorage plate detaches from the wall, and cannot properly restrain a passenger it can increase the risk of injury. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Micro Bird customer service at 1-819-477-2012. Micro Bird's number for this recall is 18-075-CUC.

18V-517

Newmar Corporation (Newmar) is recalling certain 2018-2019 Newmar Ventana LE, Mountain Aire, Essex, Ventana, Dutch Star, New Aire, London Aire and King Aire motorhomes. The affected vehicles have entry doors that have latch rods that may be improperly adjusted, allowing the door to open during transit. If the door opens during transit, it can increase the risk of injury or a crash. Newmar will notify owners, and dealers will readjust the door latch rod, free of charge. The recall began September 5, 2018. Owners may contact Newmar customer service at 1-800-731-8300.

18V-518

Garden State Bus Group (Garden State) is recalling certain 2015 Garden State Double Deck Buses. The roof emergency exit may be incorrectly located towards the center of the passenger compartment and not in the rear, as required. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 217, "Bus Emergency Exits and Window Retention and Release." If the emergency exit is located in the wrong location, it can cause a delay in exiting the vehicle in the event of an emergency, increasing the risk of injury. Garden State will notify owners, and dealers will install an additional emergency exit hatch in the rear portion of the lower level that opens to the upper level, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Garden State customer service at 1-888-800-3779.

18V-519

Terex south Dakota, Inc. (Terex) is recalling certain 2015-2018 Terex C4000, C5000, C6000, and General digger derricks. The welds between the coupler and hex shaft may be undersized, causing them to fail and the auger to fall unexpectedly. If the auger falls, it can increase the risk of injury to the user or bystanders. Terex will notify owners, and dealers will either repair the weld or replace the affected component, free of charge. The

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2018**

Published September 26, 2018

recall is expected to begin October 5, 2018. Owners may contact Terex customer service at 1-605-882-4000. Terex's number for this recall is SN665.

18V-520

BYD Coach & Bus (BYD) is recalling certain 2016-2017 K11M hybrid electric transit buses, equipped with ZF Axles that have radial air disk brakes. Surface roughness of a guide pin in the radial brake calipers may cause the brake carriage guide pin support bolt to break. Breakage of the guide pin can cause a loss of braking ability or a loss of tire pressure, increasing the risk of a crash. BYD will notify owners, and dealers will install a bushing kit and reinstall the brake calipers, free of charge. Owners may contact BYD customer service at 1-661-940-3250.

18V-521

Daimler Trucks North America, LLC (DTNA) is recalling certain 2018-2019 Freightliner Cascadia vehicles. Over time, the pitman arms may crack and fracture. If the pitman arm fractures there would be a loss of steering control, increasing the risk of a crash. DTNA will notify owners, and dealers will replace the pitman arms, free of charge. The recall is expected to begin October 6, 2018. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-784.

18V-522

Chrysler (FCA US LLC) is recalling certain 2018-2019 Dodge Grand Caravan and Jeep Compass, 2018 Dodge Journey, and 2019 Jeep Cherokee vehicles. The rear brake caliper pistons on these vehicles may have an insufficient coating causing gas pockets to form, potentially reducing rear brake performance. A reduction of braking performance can increase the risk of a crash. Chrysler will notify owners, and dealers will bleed the vehicle's brake system, free of charge. The recall began September 29, 2018. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is U86.

18V-523

Chrysler (FCA US LLC) is recalling certain 2018 Jeep Renegade, Compass and Grand Cherokee, RAM 1500 and Promaster, Fiat 500x, Dodge Journey, Challenger, Charger and Durango and Chrysler 300x vehicles, 2017-2018 Jeep Wrangler, Dodge Grand Caravan and Chrysler Town and Country vehicles and 2018-2019 Jeep Cherokee and Chrysler Pacifica vehicles. The powertrain control module may be equipped with a voltage regulator chip in the circuit board that may fail, causing a stall or a no start condition. A vehicle stall can increase the risk of a crash. Chrysler will notify owners, and dealers will replace the powertrain control module, free of charge. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is U87.

18V-524

Daimler Trucks North America, LLC (DTNA) is recalling certain 2018-2019 Freightliner 108SD, 114SD, 122SD, Cascadia, Columbia, Coronado, and Business Class M2 vehicles. During manufacturing, the brake caliper mounting bolts may have been insufficiently tightened. Loose brake caliper mounting bolts can reduce brake effectiveness, increasing the risk of a crash. DTNA will notify owners, and dealers will check and tightened the brake caliper mounting bolts, free of charge. The recall is expected to begin October 6, 2018. Owners may

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2018**

Published September 26, 2018

contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-783.

18V-525

KZRV, L.P. (KZRV) is recalling certain 2018-2019 KZ RV Sportsmen 333BHK Travel Trailers. The liquid propane lines on these vehicles are routed through the wheel well and may be damaged by road debris. A damaged liquid propane can increase the risk of a fire. KZRV will notify owners, and dealers will install a steel plate to protect the propane supply line, free of charge. The recall is expected to begin October 6, 2018. Owners may contact KZRV customer service at 1-800-768-4016 extension 154 or 153. KZRV's number for this recall is KZ-2018-006.

18V-526

Forest River, Inc. (Forest River) is recalling certain 2019 Coachmen Work and Play and Adrenaline recreational trailers, 2018-2019 Forest River Forester and XLR recreational trailers and 2018 Forest River Rockwood recreational trailers. The awning may deploy while moving. If the awning deploys while moving, there would be an increased risk of a crash. Forest River will notify owners, and dealers will replace the awning controller, free of charge. The recall began September 13, 2018. Owners may contact Coachmen customer service at 1-574-825-6302, Forester customer service at 1-574-206-7600, Rockwood customer service at 1-574-642-4053, XLR Toyhauler customer service at 1-574-642-0432, or Lippert customer service at 1-574-538-4514 or recall@lci1.com. Forest River's number for this recall is 51-0715.

18V-527

Erwin Hymer Group North America, Inc. (Erwin Hymer) is recalling certain 2017-2018 Roadtrek RS Adventurous XL, E-trek XL, RS Adventurous, and E-trek motorhomes equipped with a driver's side second row captain seat option. The diesel fuel tank may have been damaged while installing the second row seat pedestal. A damaged fuel tank may leak fuel, increasing the risk of a fire. Erwin Hymer will notify owners, and Mercedes dealers will inspect the diesel fuel tank, replacing it as necessary, free of charge. The recall began September 11, 2018. Owners may contact Erwin Hymer customer service at 1-800-663-0066. Erwin Hymer's number for this recall is 2018-0010.

18V-528

Erwin Hymer Group North America, Inc. (Erwin Hymer) is recalling certain 2015-2018 Roadtrek Zion motorhomes equipped with a side-facing sofa. Installation of the sofa may have resulted in damage to the vehicle's rear brake line, possibly reducing braking performance. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 105, "Hydraulic and Electric Brake Systems," and number 106, "Brake Hoses." Damage to the rear brake line can increase the distance needed to stop the vehicle, increasing the risk of a crash. Erwin Hymer will notify owners, and dealers will replace the brake lines and the sofa bolts, as necessary, free of charge. Owners may contact Erwin Hymer customer service at 1-800-663-0066. Erwin Hymer's number for this recall is 2018-0012.

18V-529

KZRV, L.P. (KZRV) is recalling certain 2018-2019 KZ RV Connect recreational trailers, model C261RL. The liquid propane lines on these vehicles are routed through the wheel well and may be damaged by road debris. A

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2018**

Published September 26, 2018

damaged liquid propane can increase the risk of a fire. KZRV will notify owners, and dealers will re-route the propane supply lines away from the wheel well, free of charge. The recall is expected to begin October 12, 2018. Owners may contact KZRV customer service at 1-800-768-4016 extension 154 or 153. KZRV's number for this recall is KZ-2018-07.

18V-530

Polaris Industries, Inc. (Polaris) is recalling certain 2017-2019 Polaris Slingshot S, Slingshot SL, Slingshot GT LE, and Slingshot SLR motorcycles. In the event of a crash, the seatbelt retractor on the side opposite of the impact may separate, preventing the seatbelt from locking. In the event of a crash, if the seat belt does not lock, the occupant may not be properly restrained, increasing their risk of injury. Polaris will notify owners, and dealers will install a kit that prevents the retractor from separating in the event of a crash, free of charge. Owners may contact Polaris customer service at 1-855-863-2284. Polaris' number for this recall is T-18-03.

18V-531

Winnebago Industries, Inc. (Winnebago) 2012-2013 Winnebago Era, View, and Via motorhomes and Itasca Navion and Reyo motorhomes. The high pressure liquid propane hoses may harden at the crimp fitting, possibly resulting in a propane leak. A propane leak in the presence of an ignition source can increase the risk of a fire. Winnebago will notify owners, and dealers will inspect the propane hose, replacing it as necessary, free of charge. The recall is expected to begin October 8, 2018. Owners may contact Winnebago customer service at 1-641-585-6939 or 1-800-537-1885. Winnebago's number for this recall is 151.

18V-532

BMW of North America, LLC (BMW) is recalling one each of 2019 BMW 430i xDrive Gran Coupe, 440i xDrive Gran Coupe and 430i xDrive Convertible vehicles. The front passenger air bag inflator may have been incorrectly manufactured, potentially affecting the air bag deployment performance in the event of a crash. If the front passenger air bag does not deploy properly in the event of a crash, the occupant has an increased risk of injury. All affected vehicles are still in dealer inventory. Dealers will replace the front passenger air bag module, free of charge.

18V-533

Forest River, Inc. (Forest River) is recalling certain 2019 Prime Time Tracer and Avenger travel trailers equipped with a Greystone oven. These ovens may be missing a diverter which can cause the countertop to get extremely hot. The hot countertop increases the risk of burn injuries. The remedy for this recall is still under development. The recall began September 11, 2018. Owners may contact Prime Time customer service at 1-574-862-1025. Forest River's number for this recall is 48-0833.

18V-534

Volvo Cars USA LLC (Volvo) is recalling certain 2019 Volvo XC40 vehicles. The rear seats may not have rear seat back lock strikers, allowing the seat back to move forward during certain hard braking conditions or a crash. If the seat back moves forward during hard braking or in a crash, it can increase the risk of injury. Volvo will notify owners, and dealers will inspect the vehicles and install the seat back lock strikers if they are missing, free of charge. The recall is expected to begin October 15, 2018. Owners may contact Volvo customer service

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2018**

Published September 26, 2018

at 1-800-458-1552. Volvo's number for this recall is R89898.

18V-535

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2018 Volkswagen Atlas and 2017-2018 Volkswagen Passat vehicles. The brake caliper bracket mounting bolts on these vehicles may not have been tightened sufficiently. The loose brake bracket bolts can allow the caliper to move, reducing braking ability or causing a loss of vehicle control and increasing the risk of a crash. Volkswagen will notify owners, and dealers will inspect the brake caliper bracket bolt tightness, replacing and re-torque the bolts as necessary, free of charge. Additionally brake caliper fasteners, bleeder valve, and brake hose bolts will be checked and torqued to the correct specification, if necessary, free of charge. For Passat vehicles, dealers will also inspect the parking brake cable for proper connection, free of charge. The recall began September 14, 2018. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's number for this recall is 46H6.

18V-536

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2018 Volkswagen Atlas vehicles. During production, the air conditioning system drain tube may have been twisted, causing water to drain into the air bag control module. The wet air bag control module may result in an unintentional deployment of the air bags, increasing the risk of injury or crash. Volkswagen will notify owners, and dealers will inspect the air conditioning drain tube, and if it is twisted, the drain tube and air bag control module will be replaced, free of charge. Some of the affected vehicles have had their drain tube previously replaced but did not receive a new air bag control module; the airbag control module will be replaced in these vehicles. The recall began September 14, 2018. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's number for this recall is 87F9.

18V-537

Spartan Motors USA (Spartan) is recalling certain 2018-2019 Spartan Specialty K2 vehicles. The park brake systems on these chassis may not be able to prevent the vehicles from moving unintentionally if parked on a grade. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 121, "Air Brake Systems." If the vehicle moves unintentionally while parked on a grade, it could increase the risk of a crash. Spartan will notify the Entegra motorhome owners, and Spartan dealers will install new brake chambers, free of charge. The recall began September 11, 2018. Owners may contact Spartan customer service at 1-800-543-5008. Spartan's number for this recall is 18023.

18V-538

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2018 Mercedes-Benz GLE350 4Matic, GLE350, GLS450 4Matic, GLS550 4matic, GLE43 AMG 4Matic, GLE63 AMG 4Matic, GLE63S AMG 4Matic, and GLS63 AMG 4Matic vehicles. The rear brake caliper pistons on these vehicles may not have been correctly coated, causing gas to become temporarily released into the rear brake hydraulic circuit, reducing braking performance. Reduced braking performance can increase the risk of a crash. MBUSA will notify owners, and dealers will bleed the rear axle brake system, free of charge. The recall began September 14, 2018. Owners may contact MBUSA customer service at 1-800-367-6372. MBUSA's number for this recall is 2018080013.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2018**

Published September 26, 2018

18V-539

KZRV, L.P. (KZRV) is recalling certain 2017-2019 KZRV Durango, Venom and Sidewinder recreational trailers. The Federal Certification label incorrectly lists the tire size as being ST235/80R16G, however, the correct tire size is ST235/85R16G. The incorrect information may result in the incorrect tires being installed, increasing the risk of a crash. KZRV will notify owners, and dealers will replace the Federal Certification label, free of charge. The recall is expected to begin October 8, 2018. Owners may contact KZRV customer service at 1-800-768-4016 extension 154 or 153. KZRV's number for this recall is KZ-2018-08.

18V-540

Supreme Corporation (Supreme) is recalling certain 2009-2018 Supreme Curtainside trucks. These trucks have intermediate clearance lights on the angled roof rail bracket, that may have limited visibility, reducing the vehicle's visibility to other drivers. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." Reduced visibility can increase the risk of a crash. Supreme will notify owners, and dealers will replace the 30 degree clearance lights with 45 degree clearance lights, free of charge. The recall is expected to begin October 8, 2018. Owners may contact Supreme customer service at 1-844-352-4921.

18V-541

Volvo Trucks North America (Volvo) is recalling certain 2019 Volvo VNL and VNR trucks equipped with Jost fifth wheel couplings. The fifth wheel may have an outboard slider bracket that is too narrow, possibly allowing the trailer to separate from the tractor. If the trailer separates from the tractor, it can increase the risk of a crash. Volvo will notify owners, and dealers will inspect the fifth wheel slider bracket, replacing it as necessary, free of charge. The recall began September 25, 2018. Owners may contact Volvo customer service at 1-800-528-6586. Volvo's number for this recall RVXX1801.

18V-542

Mack Trucks, Inc. (Mack) is recalling certain 2019 Mack Anthem trucks equipped with Jost fifth wheel couplings. The fifth wheel may have an outboard slider bracket that is too narrow, possibly allowing the trailer to separate from the tractor. If the trailer separates from the tractor, it can increase the risk of a crash. Mack will notify owners, and dealers will inspect the fifth wheel slider bracket, replacing it as necessary, free of charge. The recall began September 25, 2018. Owners may contact Mack customer service at 1-800-866-1177. Mack's number for this recall is SC0411.

18V-543

Forest River, Inc. (Forest River) is recalling certain 2019 Coachmen Freedom Express recreational trailers. The break-away safety switch was not wired to a constant power source, and, as a result, the switch may be inadvertently disconnected from the trailer house battery and cause the brakes to not engage if the trailer detaches from the tow vehicle. If the trailer brakes cannot engage if the trailer detaches from tow vehicle, there would be an increased risk of a crash. Forest River has notified owners, and dealers will correct the break-away safety switch wiring, free of charge. The recall began September 11, 2018. Owners may contact Coachmen Freedom Express customer service at 1-574-825-8657. Forest River's number for this recall is 220/320-0825.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2018**

Published September 26, 2018

18V-545

Winnebago Industries, Inc (Winnebago) is recalling certain 2016-2019 Winnebago Era, Travato, Fuse, View, Trend, Aspect, Paseo, Via, Adventurer, Journey, Tour, and Grand Tour motorhomes. These vehicles have an auxiliary solar charging port circuit that is not fused. If solar panels are connected and they exceed the amperage capacity of the circuit, the unprotected circuit can increase the risk of a fire. Winnebago will notify owners, and dealers will install an inline 15 amp fuse into the auxiliary solar charging port circuit, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Winnebago customer service 1-641-585-6939 or 1-800-537-1885.

18V-546

Winnebago Industries, Inc (Winnebago) is recalling certain 2018-2019 Winnebago Intent vehicles. The cabinet mirror over the driver's seat may not be properly secured, allowing the mirror to fall while moving. If the mirror falls, it can distract the driver, increasing the risk of a crash. Winnebago will notify owners, and dealers will install screws to secure the mirror to the overhead cabinet, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Winnebago customer service at 1-641-585-6939 or 1-800-537-1885.

18V-547

Ford Motor Company (Ford) is recalling certain 2018 Ford Edge, Lincoln MKX, 2019 Ford Flex, and Lincoln MKT vehicles. The power supply cables at the starter and the alternator may not have been properly secured, possibly resulting in an electrical arc. An electrical arc can increase the risk of a fire. Ford will notify owners, and dealers will inspect the alternator and starter motor power supply cables to verify that they are properly secured, correcting them as necessary, free of charge. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 18S25.

18V-548

Forest River, Inc. (Forest River) is recalling certain 2014-2019 Forest River Salem, Wildcat Maxx, Wildwood, Vibe, and Rainier recreational trailers. The break-away safety switch may not have been wired to a constant power source, and, as a result, the switch may be inadvertently disconnected from the trailer house battery causing the brakes to not engage if the trailer detaches from the tow vehicle. If the trailer brakes cannot engage if the trailer detaches from tow vehicle, there would be an increased risk of a crash. Forest River will notify owners, and dealers will install a new wiring harness to reroute the wiring, free of charge. The recall began September 25, 2018. Owners may contact Forest River customer service at 1-503-831-5410. Forest River's number for this recall is 22/30-0824.

18V-550

Nissan North America, Inc. (Nissan) is recalling certain 2017 Nissan NV200, Sentra, NV3500 Van, NV3500 Bus, NV200 Taxi, NV1500, NV2500 Van, Chevrolet City Express, 2017-2018 Frontier, Versa Note, and Versa Sedan vehicles that have a mechanical (physical) key ignition system. In these models, over time, the

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2018**

Published September 26, 2018

weight on the key ring and road conditions or some other jarring event may cause the ignition switch to move out of the run position to the accessory position, turning off the engine. If the vehicle stalls, it can increase the risk of a crash. Nissan will notify owners, and dealers will inspect the production information on the ignition switch, and replace it as necessary, free of charge. The recall is expected to begin October 19, 2018. Owners may contact Nissan customer service at 1-800-867-7669.

18V-551

Altec Industries Inc. (Altec) is recalling certain 2008-2018 Aerial Devices equipped with aluminum work platforms. The platform mounting holes may fail, causing the platform to move unexpectedly. If the platform moves unexpectedly, it can increase the risk of injury. Altec will notify owners, and dealers will install a bracket reinforcing kit, free of charge. The recall is expected to begin October 17, 2018. Owners may contact Altec customer service at 1-877-462-5832. Altec's number for this recall is CSN 689.

18V-552

Altec Industries Inc. (Altec) is recalling certain 2017-2018 Altec LS63 Aerial Devices. The fuse for the battery was not installed to the guidelines. The incorrectly placed fuse may increase the risk for an electrical short. An electrical short can increase the risk of a fire. Altec will notify owners, and dealers will inspect the battery fuse location, relocating it if necessary, free of charge. The recall is expected to begin October 15, 2018. Owners may contact Altec customer service at 1-877-462-5832. Altec's number for this recall is CSN 691.

18V-553

Volvo Car USA LLC (Volvo) is recalling certain 2019 Volvo XC40 vehicles. The brake pedals may not have been correctly riveted, allowing the pedal to move out of position, possibly reducing braking performance. Reduced braking performance can increase the risk of a crash. Volvo has notified owners advising them to stop driving their vehicle. Cars will be inspected on-site or towed to dealers and the brake pedals will be replaced as necessary, free of charge. Volvo began contacting their owners on August 23, 2018. Owners may contact Volvo customer service at 1-800-458-1552. Volvo's number for this recall is R59899.

18V-554

PACCAR Incorporated (PACCAR) is recalling certain 2016-2019 Kenworth C500, T660, T800, and W900 vehicles, equipped with 1.9M ISX15 engines. The engine harnesses may have been manufactured without check engine light (CEL) and stop engine light (SEL) circuits, preventing the driver from being warned of a serious engine problem. If the driver is not warned of a serious engine problem, the engine may unexpectedly fail, increasing the risk of a crash. PACCAR will notify owners, and dealers will inspect or test the ISX15 engine harness, and install an overlay jumper harness to supply the missing CEL and SEL circuits, free of charge. The recall is expected to begin October 19, 2018. Owners may contact PACCAR customer service at 1-918-259-3258. PACCAR's number for this recall is 18KWE.

18V-555

Chrysler (FCA US LLC) is recalling certain 2018-2019 RAM 1500 trucks. The rear differential may have been insufficiently filled, possibly resulting in its failure. If the rear axle assembly fails, it can cause a loss of drive or the rear wheels may lock up. Either scenario increases the risk of a crash. Chrysler will notify owners, and dealers

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2018**

Published September 26, 2018

will inspect the rear axle oil level. Rear axles with an insufficient amount of oil will be replaced, free of charge. The recall is expected to begin October 12, 2018. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is U88.

18V-556

BMW of North America, LLC (BMW) is recalling certain 2017-2019 MINI Cooper Countryman vehicles. These vehicles may be missing a crash protection plate near the high pressure fuel pump, which may result in a fuel leak in the event of a crash. Without the crash protection plate, in the event of a crash, the fuel pump can become damaged, causing a fuel leak and increasing the risk of a fire. MINI will notify owners, and dealers will install a crash protection plate, free of charge. The recall is expected to begin October 15, 2018. Owners may contact MINI customer service at 1-866-825-1525.

18V-557

Autocar Industries, LLC (Autocar) is recalling certain 2018-2019 Autocar Xspotter vehicles. The brake pedal mounting plate may be incorrectly welded, possibly resulting in the brake pedal disconnecting. If the brake pedal becomes disconnected, the brakes may not be able to be applied, increasing the risk of a crash. Autocar will notify owners, and dealers will replace the brake pedal floor mounting plate, free of charge. Owners may contact Autocar customer service at 1-888-218-3611. Autocar's number for this recall is ACTT-1801.

18V-558

REV Recreation Group (REV) is recalling certain 2018 Fleetwood Pulse, and 2018-2019 Holiday Rambler Prodigy motorhomes equipped with diesel-fuel generators. The generator's exhaust pipe may be routed close to the polypropylene water waste tank. If the exhaust pipe contacts the waste water tank, the tank may melt, increasing the risk of a fire. REV will notify owners, and dealers will correct the generator exhaust pipe routing and repair the waste water tank as necessary, free of charge. The recall is expected to begin October 16, 2018. Owners may contact REV customer service at 1-800-509-3417. REV's number for this recall is 180817REV.

18V-559

Daimler Trucks North America LLC (DTNA) is recalling certain 2015-2019 Thomas Built Buses Saf-T-Liner C2 and Saf-T-Liner HDX school buses, equipped with certain S-Series and K-Series Titanium Wheelchair Lifts, models K200, K201, K550, K551, S200, S2201, S550 and S551. The wheelchair lift positioning input cam may fail while the lift is in use, allowing the platform to travel higher than the vehicle's floor height. If the wheelchair lift platform stops above the vehicle floor, the wheelchair user can tip inwards toward the vehicle when exiting the lift, increasing their risk of injury. The remedy for this recall is still under development. The recall is expected to begin October 21, 2018. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL785.

18V-560

Daimler Trucks North America LLC (DTNA) is recalling certain 2017-2019 Thomas Built Buses Saf-T-Liner C2 school buses, equipped with S3B 45" Restraint School Bus Seats. In the event of a crash, the seat's foot may pull through the bolted joint at the bus floor. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 210, "Seat Belt Assembly Anchorages." In the event

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2018**

Published September 26, 2018

of a crash, if the seat detaches from the floor, it can increase the risk of injury. DTNA will notify owners, and dealers will install a washer between the rear mounting foot, and the bus floor to keep the seat secured, free of charge. The recall is expected to begin October 21, 2018. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL787.

18V-561

Navistar, Inc. (Navistar) is recalling certain 2015-2019 IC Bus CE school buses, equipped with certain S-Series and K-Series Titanium Wheelchair Lifts, models K200, K201, K550, K551, S200, S2201, S550 and S551. The wheelchair lift positioning input cam may fail while the lift is in use, allowing the platform to travel higher than the vehicle's floor height. If the wheelchair lift platform stops above the vehicle floor, the wheelchair user can tip inwards toward the vehicle when exiting the lift, increasing their risk of injury. Navistar will notify owners, and IC Bus or Ricon dealers will replace the injection molded cam with an aluminum machined cam, free of charge. The recall is expected to begin October 23, 2018. Owners may contact Navistar customer service at 1-800-448-7825.

18V-563

Jayco, Inc. (Jayco) is recalling certain 2015-2017 Jayco Redhawk motorhomes built on Chevrolet Van chassis. Liquid may leak into the driver's power window switch and cause corrosion, resulting in high electrical resistance. High electrical resistance can increase the risk of a fire. GM will notify owners, and GM dealers will replace the driver side door window switch, free of charge. The recall began on August 27, 2018. Owners may contact Jayco customer service at 1-800-517-9137, Chevrolet customer service at 1-800-222-1020 or GMC customer service at 1-800-462-8782.

18V-564

Fabform Industries, Inc. (Fabform) is recalling certain 2018 EPT dump trailers. The hinges welded on the bottom frame may fracture and the dump box may unexpectedly fall. If the dump box falls unexpectedly, it can increase the risk of injury or death. Fabform will notify owners, and dealers will install gussets with reinforced welds to the existing hinges, free of charge. The recall began on September 13, 2018. Owners may contact Fabform customer service at 1-541-679-2920.

18V-565

Blue Bird Body Company (Blue Bird) is recalling certain 2019 Blue Bird All American and 2019-2020 Blue Bird Vision school buses, equipped with certain NextGen School Bus seats with Integrated Child Restraint Systems. These seats may be missing a warning label on the lower restraint strap. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 213, "Child Restraint Systems." Without a warning label, the seat may be used improperly, increasing the risk of injury. Blue Bird will notify owners, and dealers will install a warning label to the lower restraint strap portion of the Restraint Belt System, free of charge. The recall began September 26, 2018. Owners may contact Blue Bird customer service at 1-478-822-2242. Blue Bird's number for this recall is R18ZN-SB.

18V-566

MAC Trailer Mfg., Inc. (MAC) is recalling certain 2019 Dump and Waste trailers. The wheel end nut locking

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2018**

Published September 26, 2018

device on these trailers may not be properly installed, allowing the wheel end to separate from the axle. If the wheel end separates from the axle, it can increase the risk of a crash. MAC will notify owners, and dealers will inspect the locking nut to ensure that it is properly installed, correcting it as necessary, free of charge. The recall began September 25, 2018. Owners may contact MAC customer service at 1-800-795-8454. MAC's number for this recall is 10-70-001 2018.

18V-567

Ford Motor Company (Ford) is recalling certain 2015-2018 Ford F-150 Regular Cab and SuperCrew Cab vehicles. If a front seat belt pretensioner deploys as the result of a crash, the sparks may ignite materials such as carpeting or insulation within the B-pillar area. A vehicle fire could result if materials ignite inside the vehicle. Ford will notify owners, and dealers will remove the B-pillar insulation material and wiring harness tape, and install heat resistant tape, free of charge. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 18S27.

18V-568

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain 2012 Toyota Avalon vehicles. During a vehicle repair, the seat belt inner buckles may have been replaced with parts that may incorrectly tell the air bag management system that the seat belt is always buckled. If the seat belt is falsely interpreted as being buckled, in the event of a crash, the air bags may not deploy appropriately, increasing the risk of injury. Toyota will notify owners, and dealers will test the seat belt assembly to verify that it is properly detecting being unbuckled, replacing the inner seat belt assembly as necessary, free of charge. Owners may contact Toyota customer service at 1-888-270-9371. Toyota's number for this recall is J0S.

18V-569

Jayco, Inc. (Jayco) is recalling certain 2018 Jayco Alante vehicles. The leveling system hydraulic hoses may become damaged due to their location, resulting in a hydraulic fluid leak. The leaking hydraulic fluid leak may spray onto the exhaust system, increasing the risk of a fire. Jayco will notify owners, and dealers will inspect the location of hoses and replace any damaged hoses, free of charge. Owners may contact Jayco customer service at 1-800-517-9137. Jayco's number for this recall is 9903407.

18V-570

Entegra Coach (Entegra) is recalling certain 2018 Entegra Odyssey vehicles. The leveling system hydraulic hoses may become damaged due to their location, resulting in a hydraulic fluid leak. The leaking hydraulic fluid leak may spray onto the exhaust system, increasing the risk of a fire. Entegra has notified owners, and dealers will inspect the location of hoses and replace any damaged hoses, free of charge. The recall began on September 13, 2018. Owners may contact Entegra customer service at 1-800-517-9137. Entegra's number for this recall is 9903407.

18V-571

Thor Motor Coach (TMC) is recalling certain 2018-2019 Outlaw motorhomes, model 29J. The 12V wiring for the coach may have been improperly wired to the battery instead of wired through a circuit breaker. In the event of an electrical short circuit, the unprotected circuit can increase the risk of a fire. TMC will notify owners, and

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2018**

Published September 26, 2018

dealers will correct the circuit's wiring, free of charge. The recall is expected to begin October 29, 2018. Owners may contact TMC customer service at 1-877-855-2867. TMC's number for this recall is RC000160.
18V-572

Champion Bus (Champion) is recalling certain 2012-2018 Champion American Coach, American Crusader, American S2, Challenger, Crusader, Defender, and Impulse vehicles, equipped with certain S-Series and K-Series Titanium Wheelchair Lifts, models K200, K201, K550, K551, S200, S2201, S550 and S551. The wheelchair lift positioning input cam may fail while the lift is in use, allowing the platform to travel higher than the vehicle's floor height. If the wheelchair lift platform stops above the vehicle floor, the wheelchair user can tip inwards toward the vehicle when exiting the lift, increasing their risk of injury. The remedy for this recall is still under development. The recall is expected to begin October 25, 2018. Owners may contact Champion customer service 1-810-724-1753 extension 415 or Ricon customer service at 1-800-322-2884 or by emailing the Ricon at Admin18E044@wabtec.com.

18V-573

Corp. Micro Bird Inc. (Micro Bird) is recalling certain 2012-2018 Micro Bird G5, MBII, and T-Series school buses, equipped with certain S-Series and K-Series Titanium Wheelchair Lifts, models K200, K201, K550, K551, S200, S2201, S550 and S551. The wheelchair lift positioning input cam may fail while the lift is in use, allowing the platform to travel higher than the vehicle's floor height. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 403, "Platform Lift Systems." If the wheelchair lift platform stops above the vehicle floor, the wheelchair user can tip inwards toward the vehicle when exiting the lift, increasing their risk of injury. Micro Bird will notify owners, and Ricon dealers will replace the injection molded cam with a new aluminum machined cam. The recall is expected to begin October 22, 2018. Owners may contact Micro Bird customer service at 1-819-477-2012. Micro Bird's number for this recall is 18-077-RUS.

18V-574

Corp. Micro Bird Inc. (Micro Bird) is recalling certain 2012-2018 Micro Bird G5, and T-Series school buses, equipped with certain S-Series and K-Series Titanium Wheelchair Lifts, models K200, K201, K550, K551, S200, S2201, S550 and S551. The wheelchair lift positioning input cam may fail while the lift is in use, allowing the platform to travel higher than the vehicle's floor height. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 403, "Platform Lift Systems." If the wheelchair platform stops above the vehicle floor, the wheelchair user can tip inwards toward the vehicle when exiting the lift, increasing their risk of injury. Micro Bird will notify owners, and Ricon dealers will replace the injection molded cam with a new aluminum machined cam. The recall is expected to begin October 22, 2018. Owners may contact Micro Bird customer service at 1-819-477-2012. Micro Bird's number for this recall is 18-077-RUC.

18V-575

General Motors LLC (GM) is recalling certain 2018-2019 Chevrolet Equinox, Impala, Cruze, Volt and Bolt EV vehicles, GMC Terrain vehicles, Buick Lacrosse and Regal vehicles, Cadillac XTS and XTS Professional

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2018**

Published September 26, 2018

vehicles and 2018 Chevrolet Malibu vehicles. The rear brake caliper pistons may have an insufficient coating causing gas pockets to form, potentially reducing rear brake performance. A reduction of braking performance can increase the risk of a crash. GM will notify owners, and dealers will bleed the vehicle's brake system, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Buick customer service at 1-800-521-7300, Cadillac customer service at 1-800-458-8006, Chevrolet customer service at 1-800-222-1020, or GMC customer service at 1-800-462-8782. GM's number for this recall is 18279.

18V-576

Brown Industries, LLC (Brown) is recalling certain 2017-2018 American Heritage Trolley buses, equipped with certain Ricon S-Series and K-Series Titanium Wheelchair Lifts, models K200, K201, K550, K551, S200, S2201, S550 and S551. The wheelchair lift positioning input cam may fail while the lift is in use, allowing the platform to travel higher than the vehicle's floor height. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 403, "Platform Lift Systems." If the wheelchair platform stops above the vehicle floor, the wheelchair user can tip inwards toward the vehicle when exiting the lift, increasing their risk of injury. American Trolley will notify owners and Ricon dealers will replace the defective input cams, free of charge. Owners may contact American Trolley customer service at 1-800-255-6827.

18V-577

General Motors LLC (GM) is recalling certain 2015-2016 Chevrolet Silverado 2500, 3500, 1500 Crew Cab Special Service, Tahoe Police Pursuit/Special Service, GMC Sierra 2500, and 3500 vehicles. The brake pedal pivot nut may loosen, causing the brake pedal to be loose or inoperative. If the brake pedal becomes loose or inoperative, the driver may be unable to stop the vehicle by using the brake pedal. Additionally, a loose pedal may also interfere with the accelerator pedal. Either condition may increase the risk of a crash. GM will notify owners, and dealers will add adhesive to the nut and reinstall the nut with increased tightness, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Chevrolet customer service at 1-800-222-1020, or GMC customer service at 1-800-462-8782. GM's number for this recall is 18278. Note: The vehicles in this recall need this additional remedy despite being covered by recall 16V069 for brake pedal loosening.

18V-578

Kawasaki Motors Corp., U.S.A. (Kawasaki) is recalling certain 2018 Kawasaki Ninja H2 SX SE (ZXT02BJ) motorcycles. The pin for the center stand spring may have been improperly welded, and, as a result, the pin may shift or fall off resulting in the spring detaching and the center stand dropping to the ground unexpectedly and dragging while riding. The dragging center stand can cause a loss of control, increasing the risk of a crash. Kawasaki will notify owners, and dealers will replace the left center stand bracket, free of charge. Owners may contact Kawasaki customer service at 1-866-802-9381. Kawasaki's number for this recall is MC18-05.

18V-580

Daimler Trucks North America LLC (DTNA) is recalling certain 2017-2019 Freightliner Cascadia, Coronado and 122SD, and Western Star 4900 trucks, equipped with Cummins ISX15 or X15 diesel engines. In certain driving conditions, such as on a long down-hill grade, the fuel line may burst if the fuel pump cooling circuit screen

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING AUGUST 2018**

Published September 26, 2018

becomes restricted. If the fuel line bursts, fuel may leak onto the road resulting in a roadway hazard for other motorists. The engine may also stall without warning, resulting in the vehicle's inability to restart, increasing the risk of a crash. Cummins will notify the affected owners. The remedy for this recall is still under development. The recall is expected to begin October 28, 2018. Owners may contact DTNA customer service at 1-800-547-0712 or Cummins customer service at 1-800-286-6467. DTNA's number for this recall is FL789.

18V-581

Daimler Trucks North America LLC (DTNA) is recalling certain 2016-2019 Freightliner Custom Chassis Corporation (FCCC) XBR, XBS, XCR, XCM, XCL, and XCS recreation vehicle chassis. The rear mounted Power Distribution Module (PDM) may have been damaged during manufacturing, possibly resulting in the rear marker lights, brake lights, or turn signals not functioning. Nonfunctioning lights can increase the risk of a crash. The remedy for this recall is still under development. The recall is expected to begin October 29, 2018. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL788.

18V-582

Eldorado National-Kansas (Eldorado) is recalling certain 2012-2018 Eldorado Aerotech, Aero Elite, Transtech, Advantage, World Trans and Impulse transit buses, equipped with Ricon S-Series and K-Series Titanium Wheelchair. The wheelchair lift positioning input cam may fail while the lift is in use, allowing the platform to travel higher than the vehicle floor height. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 403, "Platform Lift Systems." If the wheelchair lift platform stops above the vehicle floor, the wheelchair user can tip inwards toward the vehicle when exiting the lift, increasing their risk of injury. Eldorado will notify owners and Ricon dealers will replace the injection molded cam with an aluminum machined cam, free of charge. The recall is expected to begin October 25, 2018. Owners may contact Eldorado National-Kansas customer service at 1-800-955-4236.

18V-583